


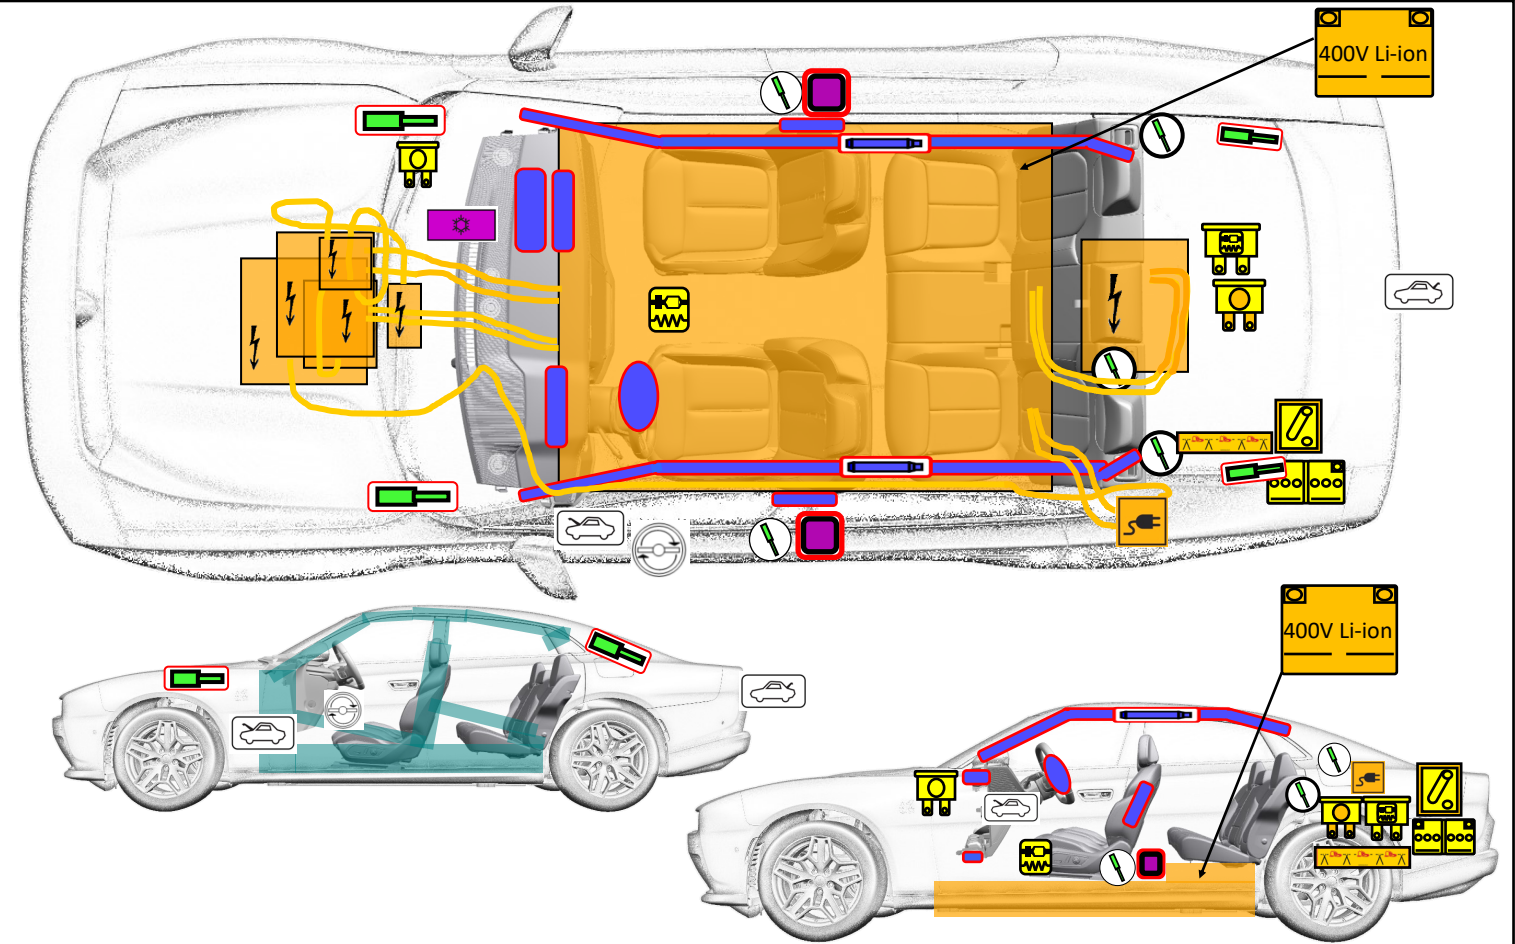

	AIR BAGS & BOLSTERS		SIDE CURTAIN AIR BAGS		AIR BAG INFLATION CARTRIDGE		SEATBELT PRETENSIONER		
	GAS STRUT		PRE-LOADED SPRING		PRELOADED BELT RETRACTOR SPRING		SUPPLEMENTAL RESTRAINT (AIR BAG) CONTROLLER		AREA OF SPECIAL CONCERN
	LOW VOLTAGE BATTERY		HIGH VOLTAGE LITHIUM-ION BATTERY				HIGH VOLTAGE CABLE		
	HIGH VOLTAGE DEVICE		LOW VOLTAGE FUSE BOX CONTROLLING HIGH VOLTAGE		LOW VOLTAGE HIGH VOLTAGE DISCONNECT		RESPONDER CUT POINT FOR HV & SRS		
	EMERGENCY DOOR RELEASE				AIR CONDITIONING REFRIDGERANT		HOOD RELEASE		TRUNK RELEASE
					BATTERY-ELECTRIC				
							LOW VOLTAGE FUSE BOX DISABLING SRS		LOW VOLTAGE FUSE BOX
	LEFT HAND DRIVE								

WARNING: This vehicle does not have an internal combustion engine and does not make traditional sounds. Vehicle movement capability exists until vehicle is fully shut down.

Always wear appropriate high voltage and turn-out PPE when addressing a damaged Dodge Charger Daytona Battery-Electric Vehicle.

High voltage components may remain energized even after following the steps in this sheet.

1. Identification / recognition

Front grille to hood spoiler:



Unique Dodge Charger “Daytona” and “Fratzonic” badging:



Charge Port on Left Side:





2. Immobilization / stabilisation / lifting


1. Set ignition to “RUN” or “ACC”.
2. Place Shifter in Park (Squeeze switch and push lever Forward).
3. Set the Park brake by pulling the button on the floor console until the LED illuminates.



 Recommended Lift Points:
As viewed from below 

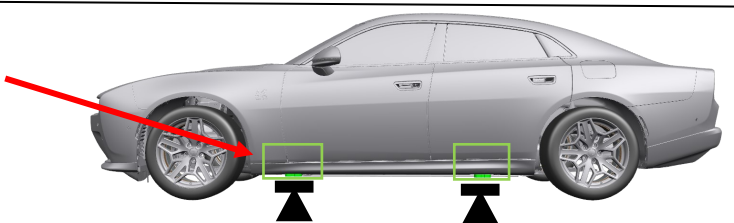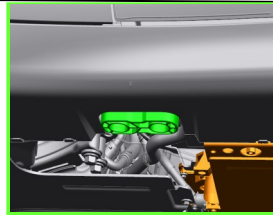

WARNING: In some cases, vehicle damage may result in wheel rotation generating high voltage power.



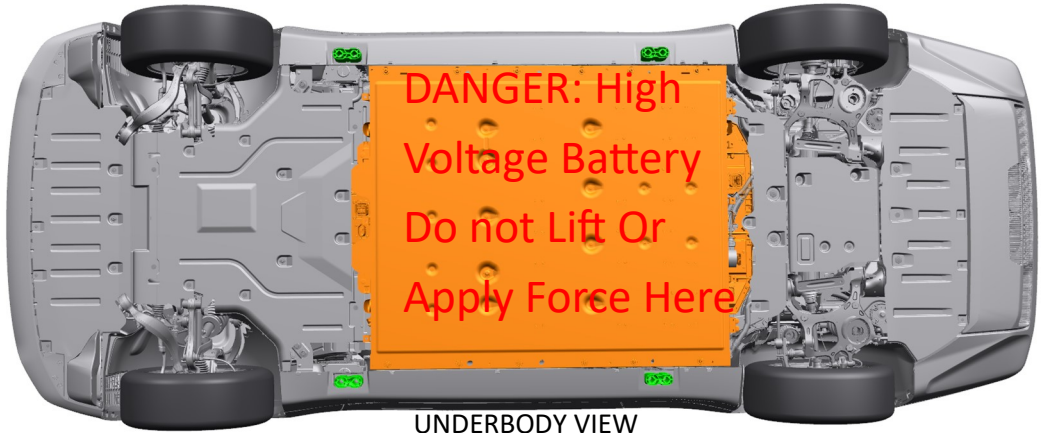


Chock wheels front & rear.

3. Disable direct hazards / safety regulations

PREFERRED METHOD

1. Unplug from any charging equipment.
2. Set Ignition to OFF.
3. Move key fob at least 20 feet away.
4. Open rear hatch.
5. Remove the left quarter access panel with the emergency helmet.
6. Locate the responder cut tape.

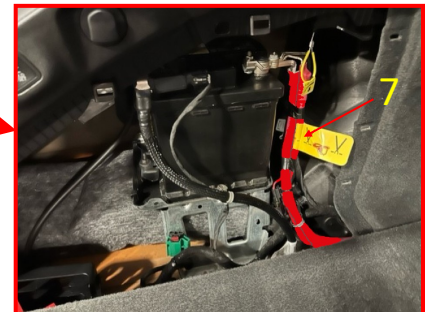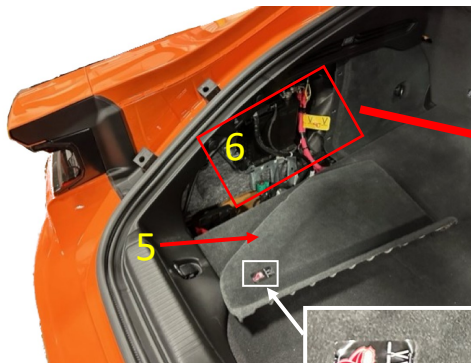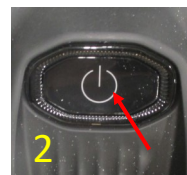

7. Cut wire on either side of tape to Remove a 1” segment of wire.

This disables high voltage and low voltage including restraints.



Wait 5 minutes after depowering for high voltage capacitors to drain. Always treat all high voltage components as if live, as the methods above can fail in cases of battery damage. Never cut any high voltage cables or components.

4. Access to the occupants

Do not cut into any hazards depicted on page 1. Also avoid cutting brake & coolant tanks/lines

Laminated Glass
Tempered Glass
High Strength Steel

Optional Roof

Power Hood Release

Hatch Release Button

Hood-Manual Pull Strap

Manual Or Power

1. Fore/Aft and Up/Down
2. Tilt Back

5. Stored energy / liquids / gases / solids

High voltage energy should be contained to within the Lithium-ion battery pack when possible. Do not discharge.

Steering Wheel and Steering Column Mount Magnesium Alloy

400V Li-ion

Warning icons: High Voltage, Fire, Corrosive, Toxic, Explosive, etc.

6. In case of fire

Do not cut into any hazards depicted on page 1. Also avoid cutting fuel, brake & coolant tanks/lines

Apply large amounts of water at the first sign of thermal activity. Misting is recommended.

WARNING: Gaseous emissions from a thermally active damaged lithium-ion battery include hydrogen, which is explosive when mixed with oxygen in the air.

WARNING: Gaseous emissions from a thermally active lithium-ion battery include hydrogen fluoride which when combined with moisture in the human body forms an acid that can cause burns, respiratory distress and injury, blindness and/or death.

Recommended: Immediately open all doors and remove all glass to maximize ventilation.

WARNING: Delayed ignition or re-ignition is possible. Monitor for thermal activity throughout response operations with an infrared thermometer or equivalent.

Warning icons: Fire, Corrosive, High Voltage, Toxic, Explosive, etc.

7. In case of submersion

With a Dodge Charger Daytona BEV that is without physical damage (such as from an accident) The risk of electrical shock when submerged or flooded is not increased.

A vehicle with impact damage presents an increased electrical shock hazard risk. If HV is open to the environment you must stay away from damaged HV components.

In salt water, chlorine may be produced in concentrations that could be corrosive and could have adverse effects on human health.

Warning icons: Electrical Shock, Corrosive, Toxic, etc.

8. Towing / transportation / storage


POST-INCIDENT DELIVERY TO SERVICE: If air bags have deployed, the vehicle cannot be driven again until repaired, as air bag protection will not be available to occupants in the event of a collision. After any collision, the vehicle should be taken to an authorized dealer immediately.

Towing Instructions:

1. Place car in PARK, with brake on
2. Transport on flatbed or trailer ONLY
3. Drag vehicle onto flatbed or trailer
4. Secure fully to conveyance
5. At location, drag off conveyance
6. Leave vehicle in PARK with brake set
7. Chock wheels if not secured otherwise



DO NOT PUSH

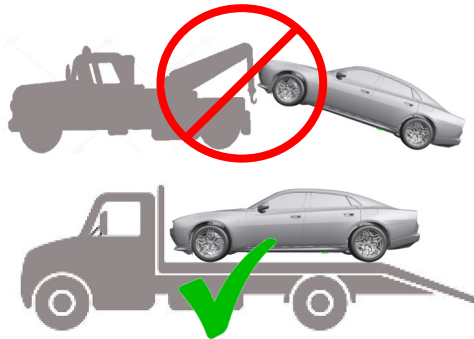

WARNING: Rotation of wheels may result in generation of high voltage or unexpected propulsion.



Monitor for thermal activity/fire throughout transport and storage. Store away from other vehicles, outside, and away from air inlets to occupied structures.

Collect spilled fluids for disposal as follows:

Collect spilled battery coolant and any coolant from electronic systems in the normal manner for spilled glycol/water mix.

Collect spilled engine and hydraulic oil with absorbent material, and use detergents to recover from masonry. Collect contaminated ground for disposal in accordance with local requirements as applicable.

Collect spilled 12 V battery electrolyte with an absorbent that neutralizes the highly acidic sulfuric acid electrolyte. Do not handle 12 V battery electrolyte, or materials contaminated with 12 V battery electrolyte without chemically resistant protection.



All debris should be collected and disposed of in an environmentally appropriate manner. Skin contact with battery pack internals is to be avoided. Leakage of electrolyte from the Li-ion battery is unlikely. Any leaking battery fluids are likely glycol-water coolant.

9. Important additional information

Stellantis / FCA US Customer Center:

Stellantis / FCA Canada Customer Center:

Stellantis / FCA Mexico Customer Center:

Stellantis / FCA within Mexico City only:

Stellantis / FCA Caribbean Customer Center:

(877) 426-5337

(800) 465-2001 (English) (800) 387-9983 (French)

+(52) 55 50817568

(800) 505-1300

(877) 426-5337

This Rescue Sheet is a publication of FCA US LLC. All product illustrations and specifications are based upon current information at the time of publication approval. FCA US LLC reserves the right to make changes from time to time, without notice or obligation, in prices, specifications, colors and materials, and to change or discontinue models, which are considered necessary to the purpose of product improvement or for reason of design and/or marketing.

10. Explanation of pictograms used

	LIFT ONLY AT THESE POINTS		ELECTRIC SHOCK HAZRD		ATTENTION		DO NOT PUSH		USE WATER
	FLAMABLE		CORROSIVE		EXPLOSIVE		TOXIC		AFFECTS HU-MAN HEALTH
	MOVE KEY FOB AWAY		SEAT ADJUST BACK TO FRONT		SEAT ADJUST UP/DOWN		STEERING WHEEL TILT ADJUST		USE INFRA-RED MONITORING
	DO NOT TOW WITH WHEELS ON GROUND		FLATBED/ TRAILER TOW ONLY						