Nuclear Reactor Thermal-Hydraulics

NUGN520 - Homework

By

GUILLAUME L'HER



Department of Nuclear Engineering COLORADO SCHOOL OF MINES

Homework submitted for the Nuclear Reactor Thermal-Hydraulics class at the Colorado School of Mines.

SPRING 2017

TABLE OF CONTENTS

				Page
1 Flu		x in the	e core	1
	1.1	Finite	cylinder	1
		1.1.1	Problem	1
		1.1.2	Solution	1
	1.2	Radioa	activity	4
		1.2.1	Problem	4
		1.2.2	Solution	4
	1.3	Therm	nal fission factor	5
		1.3.1	Problem	5
		1.3.2	Solution	5
	1.4	Cubica	al reactor core	6
		1.4.1	Problem	6
		1.4.2	Solution	6
	1.5	Nuclea	ar temperature coefficient	7
		1.5.1	Problem	7
		1.5.2	Solution	7
	1.6	Spher	ical reactor	8
		1.6.1	Problem	8
		1.6.2	Solution	8
Bi	hling	ranhv		11

CHAPTER

FLUX IN THE CORE

everal exercises from the book written by M. M. El Wakil [1] are tackled in this homework. The problems in this section relate mostly to the third chapter of the book, covering the subject of the neutron flux distribution in cores.

1.1 Finite cylinder

1.1.1 Problem

Find the flux in a finite cylinder of radius R and height H using the diffusion theory.

1.1.2 Solution

The diffusion equation can be written following Equation 1.1.

$$(1.1) \qquad \qquad \nabla^2 \phi + B^2 \phi = 0$$

In a cylindrical coordinates system, the Laplacian ∇ can be explicited according to Equation 1.2.

(1.2)
$$\nabla^2 \phi = \frac{\partial^2}{\partial r^2} + \frac{1}{r} \frac{\partial}{\partial r} + \frac{\partial^2}{\partial z^2}$$

Consequently, we can rewrite Equation 1.1 to obtain Equation 1.3.

(1.3)
$$\frac{\partial^2 \phi(r,z)}{\partial r^2} + \frac{1}{r} \frac{\partial \phi(r,z)}{\partial r} + \frac{\partial^2 \phi(r,z)}{\partial z^2} + B^2 \phi(r,z) = 0$$

In order to solve this differential equation, one assumes that the axial flux component is independent from the radial flux component. In this case, the variables can be separated, using Definition 1.4.

$$\phi(r,z) = \rho(r)\zeta(z)$$

This implies Equation 1.5.

(1.5)
$$\zeta(z)\frac{\partial^2 \rho(r)}{\partial r^2} + \frac{\zeta(z)}{r}\frac{\partial \rho(r)}{\partial r} + \rho(r)\frac{\partial^2 \zeta(z)}{\partial z^2} + B^2 \rho(r)\zeta(z) = 0$$

Now, it is useful to divide the equation by $\rho(r)\zeta(z)$ in order to isolate the *r*-component from the *z*-component, as seen in Equation 1.6.

(1.6)
$$\frac{1}{\rho(r)}\frac{\partial^2 \rho(r)}{\partial r^2} + \frac{1}{r\rho(r)}\frac{\partial \rho(r)}{\partial r} + \frac{1}{\zeta(z)}\frac{\partial^2 \zeta(z)}{\partial z^2} = -B^2$$

Now, we have an equation of the form f(x) + g(y) = cst. This equation can only be verified if f(x) = cst and g(y) = cst. Consequently, we have the following system of equations 1.7 and 1.8 to solve.

(1.7)
$$\frac{1}{\rho(r)} \frac{\partial^2 \rho(r)}{\partial r^2} + \frac{1}{r\rho(r)} \frac{\partial \rho(r)}{\partial r} = -\alpha$$

(1.8)
$$\frac{1}{\zeta(z)} \frac{\partial^2 \zeta(z)}{\partial z^2} = -\beta$$

Where:

$$\alpha + \beta = B^2$$

Focusing on Equation 1.7 first, one can multiply both sides by $\rho(r)$, obtaining Equation 1.9.

(1.9)
$$\frac{\partial^2 \rho(r)}{\partial r^2} + \frac{1}{r} \frac{\partial \rho(r)}{\partial r} + \alpha \rho(r) = 0$$

Equation 1.9 is known as a Bessel equation. The solutions to this equation are the first and second kind of Bessel functions, $J_0(\sqrt{\alpha}r)$ (Figure 1.1) and $Y_0(\sqrt{\alpha}r)$ (Figure 1.2).

Consequently, the solution will be of the form $\rho(r) = AJ_0(\sqrt{\alpha}r) + CY_0(\sqrt{\alpha}r)$, A and C being constants.

We can now use boundary conditions. We know that the radial component of the flux has to be greater or equal to $0 \, \forall r$. In our system, r = 0 at the center of the cylinder. However, $\lim_{r\to 0} Y_0(r) = -\infty$, implying that C = 0.

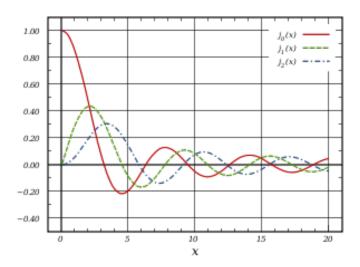


FIGURE 1.1. Bessel function of the first kind - J.

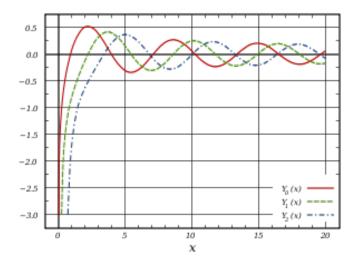


FIGURE 1.2. Bessel function of the second kind - Y.

We also know that at a radius $R_e = R + \delta_e$, the flux is to be zero. Thus, $\phi(R_e) = 0$. So, we have to solve Equation 1.10.

$$(1.10) AJ_0(\sqrt{\alpha}R_e) = 0$$

This can be solved by A = 0, in which case we would obtain the trivial solution $\rho(r) = 0$, of no interest. $J_0(x) = 0$ can be verified for several x. However, since the flux has to be positive, the solution has to be the first zero of the function, happening for x = 2.405. Hence, Equation 1.10 is verified for $\sqrt{\alpha}R_e = 2.405$.

Thus, we have the solution of the radial component of the flux, presented in Equation 1.11.

(1.11)
$$\rho(r) = AJ_0(\frac{2.405}{R_e}r)$$

Now, we can focus on the axial component of the flux, shown in Equation 1.8. It is interesting to recognize in this equation the equation for an infinite slab geometry, for which the solution is known, explicited in Equation 1.12.

(1.12)
$$\zeta(z) = D\cos(\frac{\pi}{H_{\rho}}z)$$

Finally, one can compute the flux $\phi(r,z)$, according to Equation 1.13.

(1.13)
$$\phi(r,z) = \phi_0 * J_0(\frac{2.405}{R_e}r)\cos(\frac{\pi}{H_e}z)$$

Where $\phi_0 = A * D$.

We can also deduce the buckling $B^2 = \alpha + \beta = \left(\frac{2.405}{R_e}\right)^2 + \left(\frac{\pi}{H_e}\right)^2$.

1.2 Radioactivity

1.2.1 Problem

A radioactive sample is composed of two independently radioactive isotopes. A nuclear counter whose output is directly proportional to the total activity of the sample was used and gave the following count (Table 1-13, [1]). Find the half-life and the decay constant of each of the two isotopes.

1.2.2 Solution

The sample is composed of two independently radioactive isotopes. We assume that their respective hal-life is sufficiently different and low for one isotope contribution to be neglected after 26 hours. This means that after 26h, only one isotope, B, is contributing, as seen in Equation 1.14.

$$A(t) = A_{B 0}e^{-\lambda_B t}$$

Assuming that after 26 hours, the contribution comes only from isotope A implies that we can use the data points t=26h and t=28h to obtain a equations system. This system is needed to solve for $A_{B,0}$ and for λ_B .

We can write Equations 1.15 and 1.16.

(1.15)
$$\lambda_B = \frac{\ln(1072/1010)}{3600 * (28 - 26)} = 8.2744 \times 10^{-6}$$

(1.16)
$$A_{B,0} = 1010 * e^{\lambda_B(28*3600)} = 842.4$$

Consequently, the half-life of isotope B is $T_{1/2,B} = 23.27h$.

Substituting the activity due to isotope B from the total measured, we can obtain the contribution of isotope C. Hence, A(C,t=0) = 102000 - 842.4 = 101157.6 and $A(C,t=4) = 26300 - A_{B,0}e^{-\lambda_B 4*3600} = 25552$.

Hence, using Equation 1.17, we can obtain.

$$A(t) = A_{C,0}e^{-\lambda_C t}$$

And so,

(1.18)
$$\lambda_C = \frac{\ln(101157.6/25552)}{3600 * 4} = 9.555 \times 10^{-5}$$

Consequently, the half-life of isotope C is $T_{1/2,C}=2.015h$. We can verify that after 10 periods of isotopes C half-life (21h), only the contribution of isotope B would remain. The calculation thus stands.

1.3 Thermal fission factor

1.3.1 Problem

Calculate the thermal-fission factor for 2200-m/sec neutrons for (a) natural uranium and for (b) 2 percent, (c) 20 percent, and (d) fully enriched uranium.

1.3.2 Solution

The thermal fission factor, η , is described using Equation 1.20.

(1.19)
$$\eta = \frac{v\Sigma_f}{\Sigma_f + \Sigma_c} = v \frac{N_5 \sigma_f^5}{N_5 \sigma_f^5 + N_5 \sigma_c^5 + N_8 \sigma_c^8}$$

Where:

 N_5 = Density of U^{235}

 N_8 = Density of U^{238}

 $\sigma_{\scriptscriptstyle f}^5$ = microscopic fission cross section of U^{235}

 σ_c^5 = microscopic capture cross section of U^{235}

 σ_c^8 = microscopic capture cross section of U^{238}

Knowing that the enrichment can be written $e = \frac{N_5}{N_5 + N_8}$, one can rewrite Equation 1.20 into Equation 1.30.

(1.20)
$$\eta = v \frac{e\sigma_f^5}{e\sigma_f^5 + e\sigma_c^5 + (1 - e)\sigma_c^8}$$

Considering v = 2.43, $\sigma_f^5 = 571.1$ b, $\sigma_a^5 = \sigma_c^5 + \sigma_f^5 = 678.2$ b and $\sigma_c^8 = 2.73$ b, the answers to (a), (b), (c) and (d) are respectively 1.30, 1.71, 2.01 and 2.05.

1.4 Cubical reactor core

1.4.1 Problem

The extrapolation lengths in a cubical reactor core are negligibly small. Find the ratio of average to maximum flux if the flux distribution is: (a) Sinusoidal in the x, y and z directions (b) Sinusoidal in the x and y directions but uniform in the z direction (c) Sinusoidal in the x direction only and uniform in the y and z directions.

1.4.2 Solution

The average flux is given by Equation 1.21.

(1.21)
$$\overline{\phi} = \frac{\iiint_V \phi(x, y, z) dx dy dz}{V}$$

If we consider a flux sinusoidal in the x, y and z directions, then we have 1.22, considering a the side of the cube.

(1.22)
$$\phi(x, y, z) = \phi_0 \cos(\frac{\pi x}{a}) \cos(\frac{\pi y}{a}) \cos(\frac{\pi z}{a})$$

The flux being maximum at the center of the cube, the integration has to be done from 0 to a/2. The triple integrals are independent from one another, and thus we can write Equation 1.23.

(1.23)
$$\overline{\phi(x,y,z)} = \frac{\phi_0}{V} \int_0^{a/2} \cos(\frac{\pi x}{a}) dx \int_0^{a/2} \cos(\frac{\pi y}{a}) dy \int_0^{a/2} \cos(\frac{\pi z}{a}) dz$$

Knowing Equation 1.24, we can obtain Equation 1.25.

(1.24)
$$\int_0^{a/2} \cos(\frac{\pi x}{a}) dx = \left[\frac{a \sin(\frac{\pi x}{a})}{\pi} \right]_0^{a/2} = \frac{a}{\pi}$$

The maximum flux being ϕ_0 , the ratio of average to maximum flux is equal to $\frac{a^3}{V\pi^3}$. V being a^3 , it is easy to see that the ratio is $\frac{1}{\pi^3}$.

Now, if we consider a flux sinusoidal in the x and y directions but uniform in the z direction, we can write Equation 1.23 as Equation 1.26.

(1.26)
$$\overline{\phi(x,y,z)} = \frac{\phi_0}{V} \int_0^{a/2} \cos(\frac{\pi x}{a}) dx \int_0^{a/2} \cos(\frac{\pi y}{a}) dy \int_0^{a/2} B dz$$

Knowing Equation 1.24 and Equation 1.27, we can write Equation 1.29.

(1.27)
$$\int_0^{a/2} B \, dx = [Bx + C]_0^{a/2} = \frac{Ba}{2}$$

And thus, the ratio of average to maximum flux is equal to $\frac{B}{2\pi^2}$.

Finally, using the same reasoning, we can obtain Equation 1.36 for the last case (uniform flux B and C for y and z directions respectively).

(1.29)
$$\frac{\overline{\phi(x,y,z)}}{\phi_{max}} = \frac{BC}{4\pi}$$

1.5 Nuclear temperature coefficient

1.5.1 Problem

Assuming constant k_{∞} and B^2 , and a 1/V dependence of the thermal neutron absorption, show that the nuclear temperature coefficient in a thermal reactor is given by $\frac{\delta \rho_n}{\delta T} = -\frac{B^2 L^2}{2k_{\infty} T}$.

1.5.2 Solution

We know that $L=\sqrt{\frac{d}{\Sigma_a}}$ and that $D=\frac{\lambda_{tr}}{3}$. Consequently,

$$(1.30) L^2 = \frac{\lambda_a \lambda_{tr}}{3} = \frac{1}{3\Sigma_a \Sigma_s}$$

In the 1/v region, v is proportional to \sqrt{T} . Consequently, $\sigma_a=\sigma_{a,0}\sqrt{\frac{T_0}{T}}$. So, we can write $L^2=L_0^2\sqrt{\frac{T_0}{T}}$.

Now, we can start from Equation 1.31.

$$k_{eff} = \frac{k_{\infty} l_f}{1 + L^2 B^2}$$

Knowing that $\rho = \frac{k_{eff} - 1}{k_{eff}}$, one can write:

$$\rho = \frac{k_{\infty} - 1 - L^2 B^2}{k_{\infty}}$$

And so, plugging in L^2 :

(1.33)
$$\rho = \frac{k_{\infty} - 1}{k_{\infty}} - \frac{B^2 L_0^2 \sqrt{\frac{T}{T_0}}}{k_{\infty}}$$

Derivative of this equation with regards to T gives us:

(1.34)
$$\frac{\delta \rho}{\delta T} = -\frac{B^2 L_0^2 (TT_0)^{-1/2}}{2k_{\infty}}$$

The temperature coefficient at T is given for $T = T_0$, in which case:

$$\frac{\delta \rho}{\delta T} = -\frac{B^2 L^2}{2k_{\infty} T}$$

1.6 Spherical reactor

1.6.1 Problem

solve the diffusion equation $(\nabla^2 \phi + B^2 \phi = 0)$ for a bare spherical core of radius R and extrapolated radius R_e .

1.6.2 Solution

The spherical diffusion equation can be written using Equation 1.36.

(1.36)
$$\frac{\partial^2 \phi(r)}{\partial r^2} + \frac{2}{r} \frac{\partial \phi(r)}{\partial r} + B^2 \phi(r) = 0$$

Using the substitution $\phi(r) = \frac{\Phi(r)}{r}$, we can obtain Equation 1.37.

$$(1.37) \qquad \frac{2}{r^3}\Phi(r) - \frac{2}{r^2}\frac{\partial\Phi(r)}{\partial r} + \frac{1}{r}\frac{\partial^2\Phi(r)}{\partial r^2} - \frac{2}{r^3}\Phi(r) + \frac{2}{r^2}\frac{\partial\Phi(r)}{\partial r} + \frac{1}{r}B^2\Phi(r) = 0$$

This equation can trivially be simplified to Equation 1.38, by eliminating terms and multiplying both sides by r.

(1.38)
$$\frac{1}{r}\frac{\partial^2 \Phi(r)}{\partial r^2} + \frac{1}{r}B^2 \Phi(r) = 0$$

Equation 1.38 is well known and has two possible solutions, $\sin(Br)$ and $\cos(Br)$. Consequently, $\Phi(r) = A\cos(Br) + C\sin(Br)$, and finally, $\phi(r) = \frac{A}{r}\cos(Br) + \frac{C}{r}\sin(Br)$.

The flux has to be finite for every r, including r=0. This allows us to eliminate the cosinus part of the equation, because $\lim_{r\to 0} \frac{A}{r} \cos(Br) = -\infty$. So, A=0.

The solution is thus given by Equation 1.39.

(1.39)
$$\phi(r) = \frac{C}{r}\sin(Br)$$

The flux has to be zero at a distance R_e . Consequently, $\frac{C}{R_e}\sin(BR_e)=0$. This is possible if and only if C=0 (trival zero solution) or $\sin(BR_e)=0$. This is possible for $B=\frac{n\pi}{R_e}$, n being an odd integer. The flux has to stay positive, and so only the first zero of the sinus function can be physically true, n=1.

Finally, the flux in the spherical reactor is $\phi(r) = \frac{C}{r} \sin(\frac{\pi}{R_e}r)$.

BIBLIOGRAPHY

- [1] M. M. EL-WAKIL, Nuclear Heat Transport, American Nuclear Society, 1993.
- [2] G. Leinweber, D. Barry, R. Block, M. Rapp, J. Hoole, Y. Danon, R. Bahran, D. Williams, J. Geuther, and F. Saglime III, Thermal total cross sections of europium from neutron capture and transmission measurements, Transactions of the American Nuclear Society, 107 (2012), p. 1007.