
Where the wreckage is on the seabed, for each use of the 00:19 satellite data (waypoint routes, with the extra northern flights)

Both log-on causes together (fuel exhaustion 3 : 1 other); the aircraft did not break up before 00:19:37

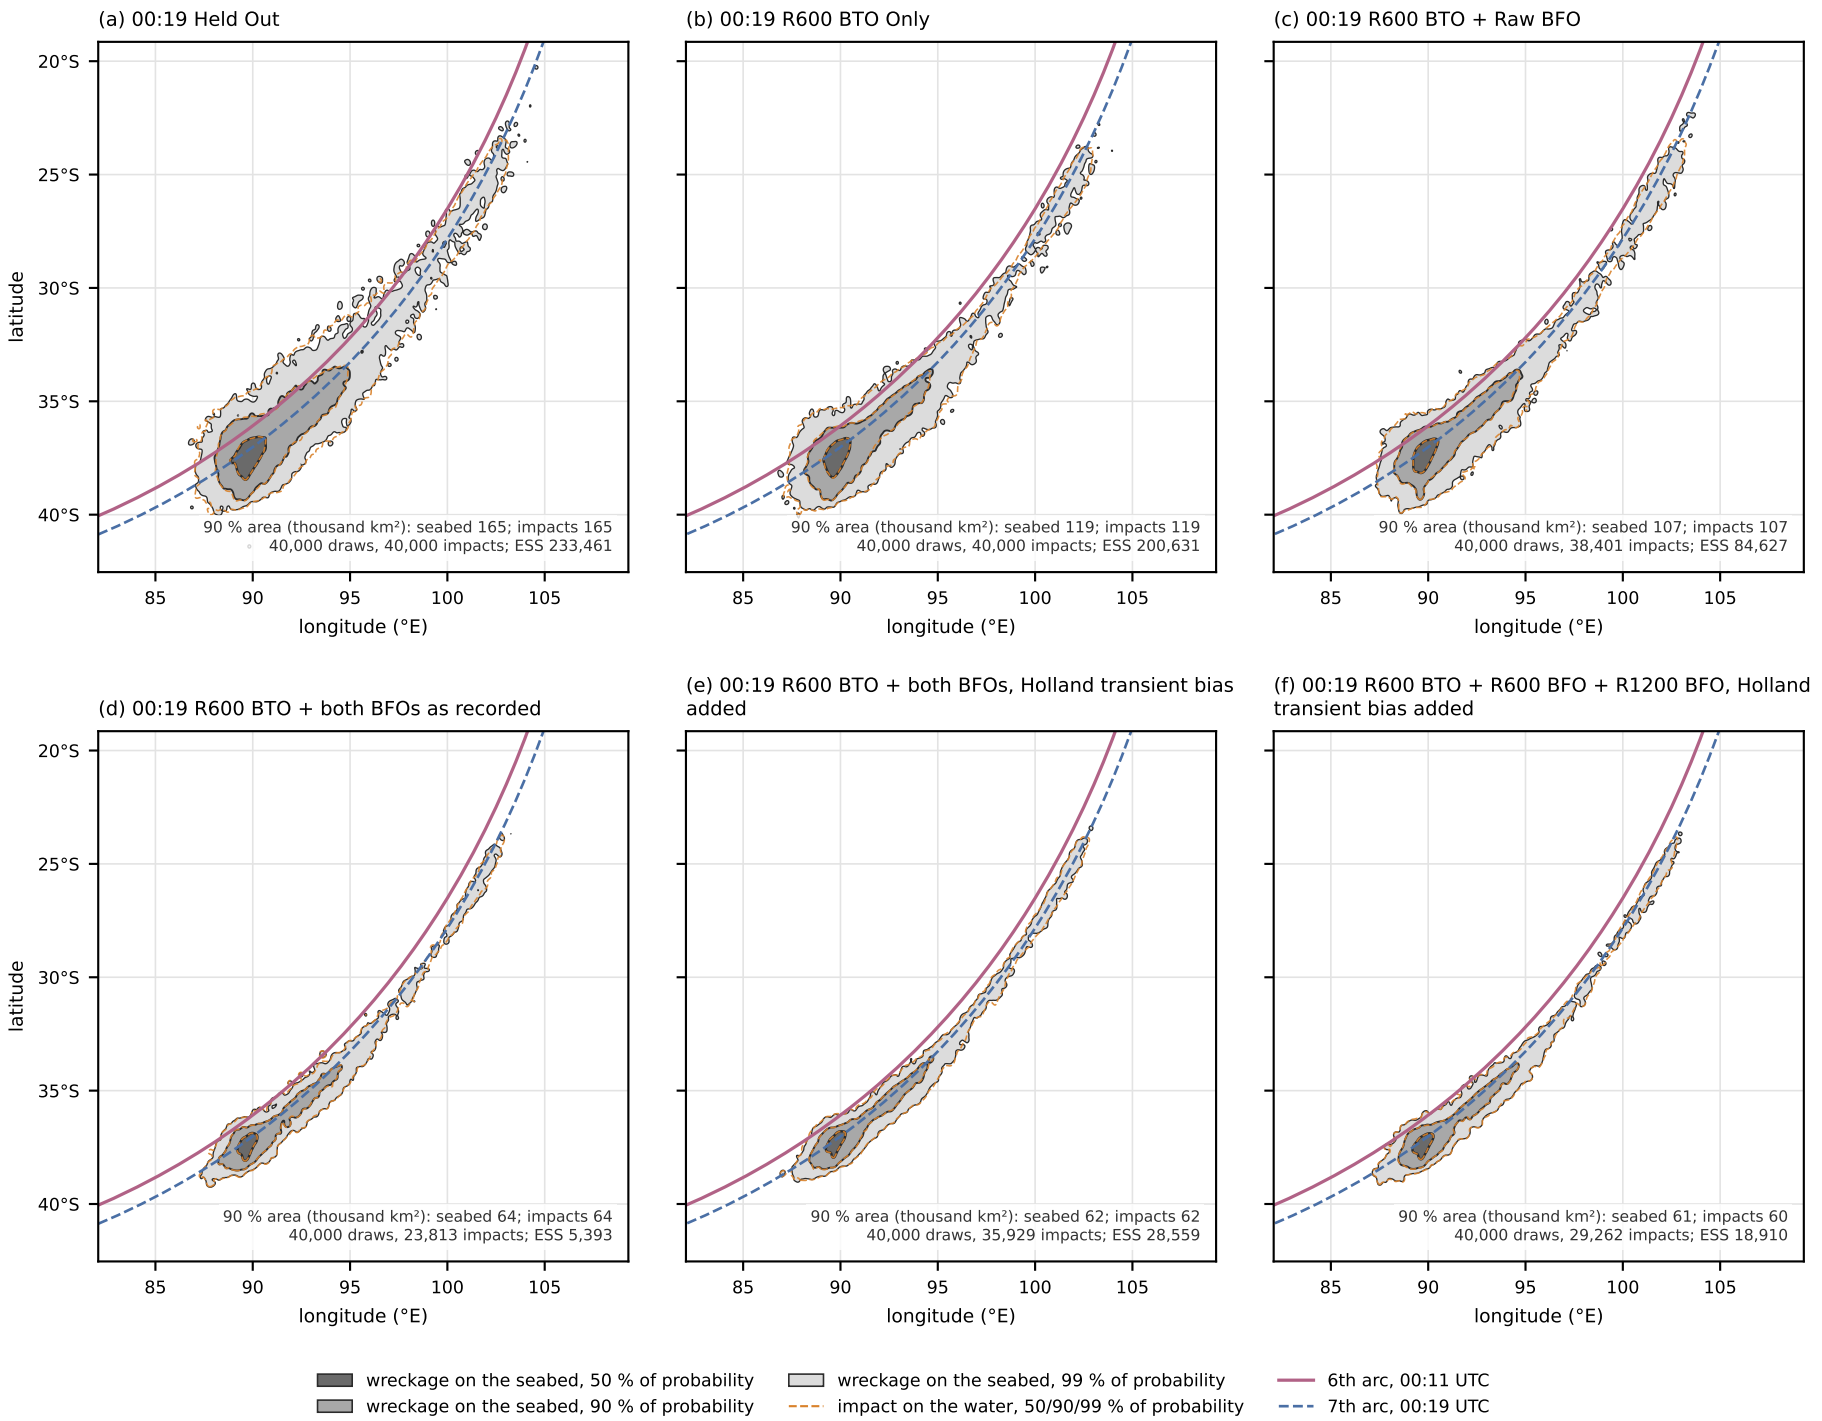

Summary (STE): Grey areas show where the wreckage is on the seabed. Dashed orange lines show where the aircraft hit the water. Each map uses one way to read the 00:19 satellite data. The flight model now has more flights that end in the north; a known weight keeps the probabilities correct. Some parts of the flight model are provisional, so these areas can change. When the aircraft breaks up in the air, the model still puts the wreckage at one impact point. Search results and debris drift are not used here.

Technical: Settled-mass seabed density (real ocean: GLORYS12V1 column 75-115 E, 45-10 S, TEOS-10; GLORYS12V1 surface current; ERA5 wind; AusSeabed then GEBCO_2026), settling 9330d4c, breakup table PROVISIONAL, afloat pieces excluded. Impacts: end of flight's rule-B reduced table (impacts-ruleB.npz, 2,408,038 rows): core run J waypoints production (24 seeds) + northern supplement (16 seeds, all rows) + extra descents (D2-D5), combined by rule B with core's r_hat, one Horvitz-Thompson thinning; binary mh370-eof-rj1. Waypoints stratum only (conditional on it). Row weight = end of flight's stored lnw:comb (hand-off weight x survival x L(00:19 treatment) x L(cause), both causes q = 1/3 with C2 silent, W = 00:10:58-01:15:56; 'other log-on cause only' = C2-silent arm). D3 = R600 BTO + both BFOs as recorded; D4 = both BFOs, Holland transient bias added; D5 = R600 BFO as recorded + R1200 BFO, Holland transient bias added U[17, 130] Hz; BFO error 4.3177 Hz. Systematic resample, one settling draw each: 40,000. 0.02 deg grid, Gaussian 0.1 deg, HPD. Row ESS by Kish; below 1,000 not estimable. Held Out is D0' (impact after 00:19:37.443 imposed). Prior track: core run J waypoint routes. Labels: core run J split-half accepted as a pass by project ruling, 16 Oct 2026; uncontrolled-arm dynamics not calibrated (Boeing leave-one-out gate failed); piloted-turn model and INTERIM pitch-down PROVISIONAL; in-flight structural outcome PROVISIONAL; breakup rows settled from the intact impact point (G-bf); P(left) = 0.8 PROVISIONAL; Mac.