Dhaka University of Engineering & Technology (DUET), Gazipur

Department of Computer Science and Engineering (CSE)

Course Title: Microprocessor & Interfacing Sessional (CSE 3812)

Lab: 05


Getting Familiar with Dot-Matrix Display of MDA-8086 Kit.

Objectives:

To understand MDA 8086 trainer Kit Command to control its Dot-Matrix display.

Basic Theory:

The Dot Matrix inside the MDA-8086 trainer kit can be used to display any pattern of LEDs in the dot matrix display. This requires PIO 8255 PPI ports which are already connected to the Dot Matrix internally. Through the code we can access these ports and provide binary or hex value to switch the required LEDs on and off. In order to turn an LED ON, a logical 0 should be provided to the row and a logical 1 should be provided to the column because of the following arrangement. Any particular shape or design can be formed by turning on the required LEDs on the Dot Matrix display.

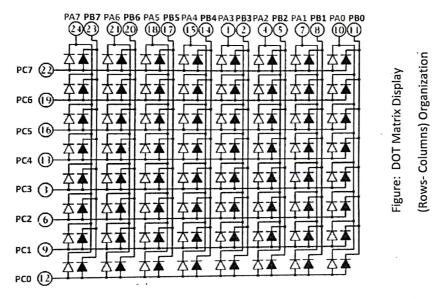

Dot-Matrix display data generation rules: As a different Programmable Peripheral Interface (PPI) 8255 is used for Dot Matrix display, the address of the ports is also different. Hence, the addresses are:

Port A: 18h Port B:1Ah Port C:1Ch Control Reg:1Eh

In Dot Matrix display, Port C will be used for the value of the COLUMNS and Port A or B will be used for the value of the ROWS. In-case of Ports C, pass LOGIC '1' signal for the particular column. In-case of Port A or B pass LOGIC '0' signal for the particular row.

Port A is used for displaying GREEN light and port B for displaying RED light. Column 0 is the LSB of Port C and Column 7 is the MSB of Port C. Row 0 is the MSB of Port A or B and Row 7 is the LSB.

Example 1: To illuminate the TOP RIGHT-MOST LED with GREEN light the values are:

For port C = 10000000For port A = 01111111For port B = 11111111

Example 2: To illuminate Column LEDs from left-to-right with an interval the code is:

CODE SEGMENT ASSUME CS: CODE, DS: CODE

PPIC C	EQU 1EH	; Control register address
PPIC	EQU 1CH	; Port C address
PPIB	EQU 1AH	; Port B address
PPIA	EQU 18H	; Port A address

	ORG MOV OUT		1000H AL, 10000000B PPIC_C, AL	;The code is placed at offset 1000h ;Mode set for Control Word to control 8255 PPI
	MOV OUT		AL, 11111111B PPIA, AL	; Turning of Port A
	MOV OUT		AL, 00000000B PPIB, AL	; Passing data to Port B
L1: L2:	MOV OUT CALL CLC		AL, 00000001B PPIC, AL TIMER	; Passing data to Port C
	ROL JNC JMP INT		AL,1 L2 L1 3	; Changing data of Port C
TIME		MOV NOP NOP NOP NOP LOOP RET	CX, 0FFFFH	

CODE ENDS **END**

Task to do:
Write an assembly language program to illuminate rows from Top-to-Bottom with alternate colors LEDs.