


Resistor Forming Type and Dimensions


Resistor Forming Type and Dimensions / 电阻加工类型与尺寸

▶ Tape Type Dimensions

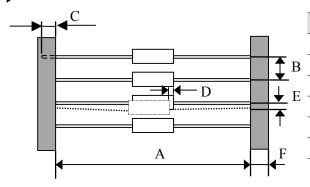


TYPE	T-26	T-52	T-63	T-73
A	26 ± 1	52 ± 1	63 ± 1.5	73 ± 1.5
В	5 ± 0.5	5 ± 0.5	10 ± 0.5	10 ± 0.5
C	5 ± 1	5 ± 1	5 ± 1	5 ± 1
D	Max 0.6	Max 0.6	Max 0.8	Max 0.8
Е	Max 1.2	Max 1.2	Max 1.2	Max 1.2
F	6 ± 1	6 ± 1	6 ± 1	6 ± 1

▶ MB Form Dimensions

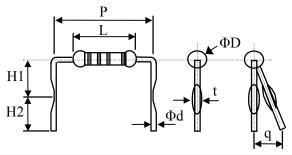

Wa	atts	$\Phi D \pm 0.5$	L ± 1	P ± 1	H1 ± 1	$H2 \pm 0.5$	$d \pm 0.5$	$t \pm 0.2$	q Max
1/2W	1WS	3	9	12.5	10.5	4	0.6	1.2	3
1W	2WS	4	11	15	10.5	4	0.8	1.25	3
2W	3WS	5	15	20	10.5	4	0.8	1.25	3
3W	5WS	6	17	25	10.5	4	0.8	1.25	3
5W	-	8	24	30	14	6.5	0.8	1.25	3

F Form Dimensions

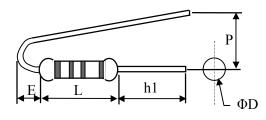


Watts		Dimensions						
		$\Phi D \pm 0.5 L \pm 1.0 P \pm 2$		$P \pm 2.0$	E Max	$h1 \pm 1.0$		
1 / 2W	1WS	3	9	6	3.5	5		
1W	2WS	4	11	6	3.5	5		
2W	3WS	5	15	6	3.5	5		
3W	5WS	6	17	6	3.5	5		




Resistor Forming Type and Dimensions

▶ FK Form Dimensions

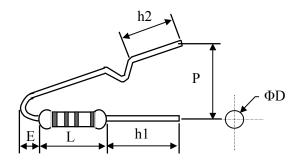

Watts		Dimensions						
		$\Phi D \pm 0.5$	$L \pm 1.0$	$P \pm 2.0$	E Max	$h1 \pm 1.0$	h2Max	
1 / 2W	1WS	3	9	6	3.5	5	4	
1W	2WS	4	11	6	3.5	5	4	
2W	3WS	5	15	6	3.5	5	4	
3W	5WS	6	17	6	3.5	5	4	

▶ M Form Dimensions

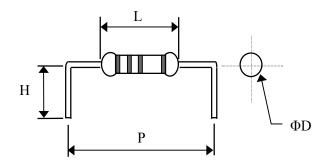

Watts		Dimensions						
		$\Phi D \pm 0.5$	$L \pm 1.0$	P ± 2.0	$H \pm 1.0$			
1 / 8W	1/4WS	1.5	3.2	6	10			
1/4W	1/2WS	2.3	6	10	10			
1/2W	1WS	3	9	12.5	10			
1W	2WS	4	11	15	10			
2W	3WS	5	15	20	10			
3W	5WS	6	17	25	10			
5W		8	24	30	20			