

Datamate

CONTENTS

INTRODUCTION	14
L-TEK (INCLUDING BRITISH STANDARD)	17
J-TEK (2-ROW)	35
J-TEK (3-ROW)	66
S-TEK	71
MIX-TEK (2-ROW)	75
TOOLING & INSTRUCTIONS	87

HARWIN

Datamate Introduction

Performance without compromise

Datamate is a 2mm pitch, 3A per contact, high reliability, high performance connector system which is approved to British Standard 9525-F0033 and has a proven track record under the most extreme conditions.

This approval is made possible by Harwin's high reliability, low frequency four finger Beryllium Copper contact technology (3A max).

The contact features a four finger Beryllium Copper clip to ensure integrity of connection under the most severe conditions and makes Datamate ideally suited to applications that are subject to high loads of vibration and shock. Secure termination is achieved by latches (L-Tek), Jackscrews (J-Tek) or the new 101Lok fast mate hardware, which speeds and simplifies the mating process.

The range further benefits from mixed layout options (Mix-Tek) that afford the engineer complete flexibility of design. Contact options include high frequency (6GHz max) and high power (20A max).

Additional flexibility is available with: automated crimping versions (Trio-Tek) which reduces installed costs; fully shielded Datamate (S-Tek) for complete EMI/RFI screening; and Datamate BS with 100% in-process testing for peace of mind in safety-critical applications.



High reliability
4-Finger Beryllium
Copper contact



Features & benefits

- ❖ Miniature connector system with high performance contact reduce space and weight.
- ❖ Four finger Beryllium Copper contact ensures integrity of signal connection.
- ❖ Professional connector system at commercial prices.
- ❖ Rugged connectors for use in harsh environments & safety critical applications when failure is not an option.
- ❖ Proven history in: aerospace, industrial, military, oil & gas etc.
- ❖ Suited for use in harsh environments where high vibration, shock and extremes of temperature are a consideration.
- ❖ Global distribution network – stocked in depth.
- ❖ Approved to BS9525-F0033.
- ❖ Complies with CECC 75101-008.
- ❖ Live Help, 3D CAD models and evaluation samples at www.harwin.com/datamate.

Harwin operates an ongoing product development programme, visit www.harwin.com for the latest additions to the Datamate range.



Datamate Introduction – Product Families

Datamate L-Tek Datamate low frequency connectors with 3 flexible mating options: friction latch, locking latch and no latch.		Pages 17 – 34
Datamate J-Tek Datamate low frequency connectors with a variety of optional Jackscrews for increased security of connection. Includes 2-row and 3-row configurations.		2-Row: Pages 35 – 65 3-Row: Pages 66 – 70
Datamate S-Tek Datamate J-Tek with metal shells; shielded connectors for cable-to-panel and PCB applications where EMI and RFI screening is required. 360° braid attachment, tested to MIL-STD-1377.		Pages 71 – 74
Datamate Mix-Tek 3 connector styles in one. Includes low frequency signal, power (20A) and coax (6Ghz) options. Includes a stocked range of signal/power or power-only connectors, ideal for COTS requirements.		Pages 75 – 86
Datamate 101 Lok 101Lok hardware reduces assembly time by simplifying the mating process. The fast mate hardware requires 101-degree turn to securely mate and requires no special tooling.		Pages 39, 42, 47, 53, 55, 57, 59, 61
Datamate Trio-Tek Performing to the same high-reliability standards as conventional Datamate, the Trio-Tek open barrel crimp contact automates the crimp process to significantly save on assembly time and reduce process costs.		Pages 24 – 25, 50 – 51
Datamate BS Manufactured to British Standard 9525-F0033 for safety-critical applications. Datamate BS assures total security in the knowledge that the product is of the highest calibre.		Pages 18 – 19
Datamate -Plus Datamate with 100% in-process (A & B) testing. Similar to Datamate BS in nature but applicable to the whole range of Datamate.		Pages 18 – 19

Datamate Specification

Datamate **L-Tek**

Materials

Mouldings:	Glass-filled thermoplastic UL94V-0
Female contacts:	Brass shell, with Beryllium Copper inner contact
Male contacts:	Copper alloy
Finish:	See individual pages

Electrical

Current (individual contacts in isolation):	3.3A max (at 25°C) 2.6A max (at 85°C)
All contacts simultaneously:	3.0A max (at 25°C) 2.2A max (at 85°C)
Working Voltage (at sea level 1013 mbar):	800V DC or ACrms
Voltage Proof (at sea level 1013 mbar):	1,200V DC or ACrms
Contact resistance (initial):	20 mΩ max
Contact resistance (after conditioning):	25 mΩ max
Insulation resistance (initial):	1,000 MΩ min
Insulation resistance (after conditioning):	100 MΩ min

Mechanical

Durability:	500 operations 400 operations (Trio-Tek)
Insertion force (max):	2.8N
Withdrawal force (min):	0.2N
Signal crimp accommodation:	22 AWG to 32 AWG BS 3G 210 Type A, MIL-W-16878

Environmental


Environmental classification:	55/125/56 days at 95% RH
Operational temperature:	-55°C to +125°C
*Vibration sensitivity:	10Hz to 2000Hz, 0.75mm, 98m/s ² (10G), duration 6h
*Bump severity:	390m/s ² (40G), 4000 ±10 bumps
*Shock severity:	981m/s ² (100G) for 6ms
*Acceleration severity:	490m/s ² (50G)

* Tested with latched connectors.


All preferred sizes of this range are held in stock.
Check www.harwin.com for availability.

Pin Numbering

Single Row

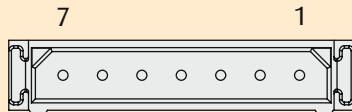

Double Row

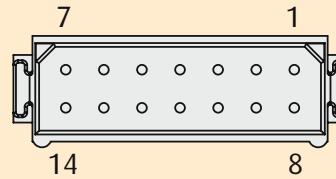

Contact numbering is shown looking onto mating face of male connector.

British Standard 9525-F0033

Designed for performance critical applications where operation and safety are paramount, BS Datamate delivers the highest level of quality.

All BS Datamate parts are subject to in-process testing and individual inspection by qualified personnel. In addition, independent third-party test programmes are completed annually and all processes are audited by the British Standard Institute.

BS Datamate assures total security in the knowledge that the product is of the highest calibre.



Certificate No.: 1243/M

PART NUMBERING SYSTEM

B5XXX - X XX - X - X - X

STYLE NUMBER

B5740	Female Connector Types C and D (Crimp)
B5741	Female Connector Types N and T (PC Tail)
B5743	Male Connector Types L and T (PC Tail)

NUMBER OF ROWS

1	Single Row
2	Double Row

TOTAL NUMBER OF CONTACTS

02 to 07, 17	Single Row
04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34	Double Row

GENDER

F	Female (Socket)
M	Male (Plug)

VARIANT

0	Unlatched connector, tin finish PC Tail (Male) or outer shell (Female)
1	Latched connector, tin finish PC Tail – Male only
2	Unlatched connector, gold finish PC Tail (Male) or outer shell (Female)
3	Latched connector, gold finish PC Tail – Male only
X	Variant

Note: all connectors are gold finish on the contact area.

TERMINATION STYLE

C	Crimp 24-28 AWG (Small Bore) – Female only
D	Crimp 22 AWG (Large Bore) – Female only
L	Throughboard Solder 90° (PC Tail Horizontal) – Male only
N	Throughboard Solder Straight Short (PC Tail Vertical) – Female only
T	Throughboard Solder Straight (PC Tail Vertical)
































EXAMPLE REFERENCE NO: **B5740-216-F-C-2**

British Standard 9525-F0033

<u>Datamate</u> BS	<u>Datamate</u> BS CONTAINS 	<u>Datamate</u> -Plus 	<u>Datamate</u> 	<u>Datamate</u> CONTAINS
B5740-1XX-F-C-0	n/a	n/a	M80-898XX01	n/a
B5740-1XX-F-C-2	n/a	n/a	M80-898XX05	n/a
B5740-1XX-F-D-0	n/a	n/a	M80-899XX01	n/a
B5740-1XX-F-D-2	n/a	n/a	M80-899XX05	n/a
B5740-2XX-F-C-0	n/a	n/a	M80-888XX01	n/a
B5740-2XX-F-C-2	n/a	n/a	M80-888XX05	n/a
B5740-2XX-F-D-0	n/a	n/a	M80-889XX01	n/a
B5740-2XX-F-D-2	n/a	n/a	M80-889XX05	n/a
n/a	B5741-1XX-F-N-0	B5741-614XX42	M80-614XX42	M80-894XX01
n/a	B5741-1XX-F-N-2	B5741-614XX45	M80-614XX45	M80-894XX05
n/a	B5741-1XX-F-T-0	B5741-840XX42	M80-840XX42	M80-897XX01
n/a	B5741-1XX-F-T-2	B5741-840XX45	M80-840XX45	M80-897XX05
n/a	B5741-2XX-F-N-0	B5741-615XX42	M80-615XX42	M80-891XX01
n/a	B5741-2XX-F-N-2	B5741-615XX45	M80-615XX45	M80-891XX05
n/a	B5741-2XX-F-T-0	B5741-850XX42	M80-850XX42	M80-887XX01
n/a	B5741-2XX-F-T-2	B5741-850XX45	M80-850XX45	M80-887XX05
n/a	B5743-1XX-M-L-0	B5743-843XX42	M80-843XX42	M80-878XX22
n/a	B5743-1XX-M-L-1	B5743-842XX42	M80-842XX42	M80-876XX22
n/a	B5743-1XX-M-L-2	B5743-843XX45	M80-843XX45	M80-878XX05
n/a	B5743-1XX-M-L-3	B5743-842XX45	M80-842XX45	M80-876XX05
n/a	B5743-1XX-M-T-0	B5743-852XX42	M80-852XX42	M80-879XX22
n/a	B5743-1XX-M-T-1	B5743-882XX42	M80-882XX42	M80-877XX22
n/a	B5743-1XX-M-T-2	B5743-852XX45	M80-852XX45	M80-879XX05
n/a	B5743-1XX-M-T-3	B5743-882XX45	M80-882XX45	M80-877XX05
n/a	B5743-2XX-M-L-0	B5743-841XX42	M80-841XX42	M80-868XX22
n/a	B5743-2XX-M-L-1	B5743-851XX42	M80-851XX42	M80-866XX22
n/a	B5743-2XX-M-L-2	B5743-841XX45	M80-841XX45	M80-868XX05
n/a	B5743-2XX-M-L-3	B5743-851XX45	M80-851XX45	M80-866XX05
n/a	B5743-2XX-M-T-0	B5743-854XX42	M80-854XX42	M80-869XX22
n/a	B5743-2XX-M-T-1	B5743-853XX42	M80-853XX42	M80-867XX22
n/a	B5743-2XX-M-T-2	B5743-854XX45	M80-854XX45	M80-869XX05
n/a	B5743-2XX-M-T-3	B5743-853XX45	M80-853XX45	M80-867XX05

Mating Profiles

Datamate **L-Tek**

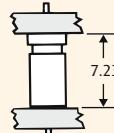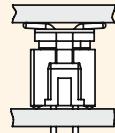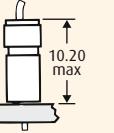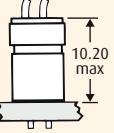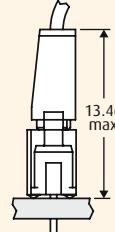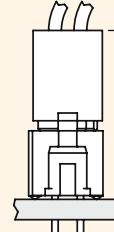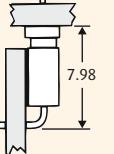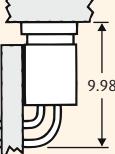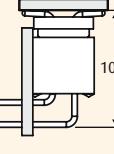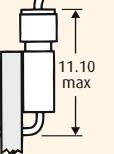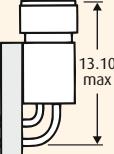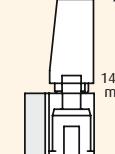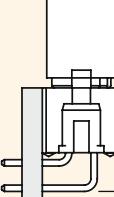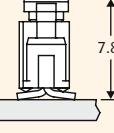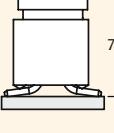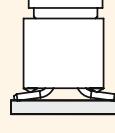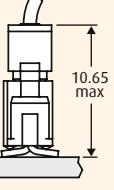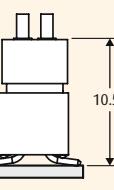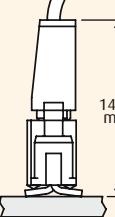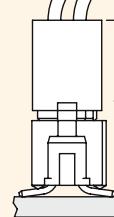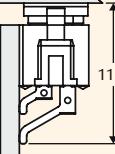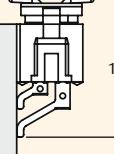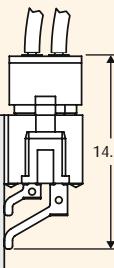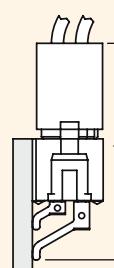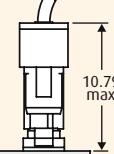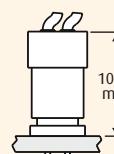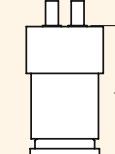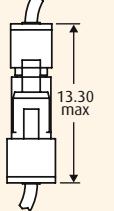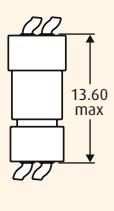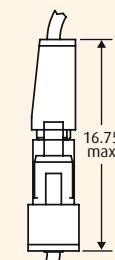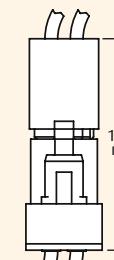FEMALE MALE	VERTICAL PC TAIL		VERTICAL SMT	CRIMP		CRIMP (Trio-Tek)	
	SIL	DIL	DIL	SIL	DIL	SIL	DIL
VERTICAL PC TAIL							
HORIZONTAL PC TAIL							
VERTICAL SMT							
HORIZONTAL SMT							
CRIMP							


All dimensions in mm.

Datamate Connectors

Datamate L-Tek

Female Vertical PC Tail

- Polarised mouldings.
- For British Standard versions see pages 18 to 19.
- Dummy contacts for additional polarisation use **order code M80-023**.
- Mates with male connectors on pages 27 to 33.

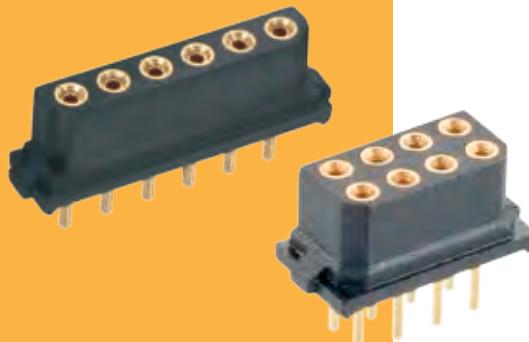

SINGLE ROW	CALCULATION				
	<table border="1"> <tr> <td>A</td><td>$B + 5.15$</td></tr> <tr> <td>B</td><td>(Total no. of contacts - 1) x 2</td></tr> </table>	A	$B + 5.15$	B	(Total no. of contacts - 1) x 2
A	$B + 5.15$				
B	(Total no. of contacts - 1) x 2				
DOUBLE ROW	<table border="1"> <tr> <td>A</td><td>$B + 5.15$</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> </table>	A	$B + 5.15$	B	Total no. of contacts - 2
A	$B + 5.15$				
B	Total no. of contacts - 2				
HOW TO ORDER					
SERIES CODE	M80 - XXX XX XX				
RoHS Non-RoHS					
840	897	Single Row (3mm tail)			
850	887	Double Row (3mm tail)			
790	790	Single Row (4.5mm tail)			
770	770	Double Row (4.5mm tail)			
		FINISH			
		01 Gold + Tin/Lead			
		05 Gold			
		42 Gold + Tin			
		45 Gold			
		TOTAL NO. OF CONTACTS			
		02 to 07, 17, 22 Single Row			
		04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44 Double Row			


All dimensions in mm.

Datamate Connectors


Datamate **L-Tek**

Female Vertical Surface Mount



- Optional pick and place pad.
- Contact datamate@harwin.com for tape & reel options.
- Mates with male connectors on pages 27 to 33.
- Gull wing SMT tails simplify inspection process.

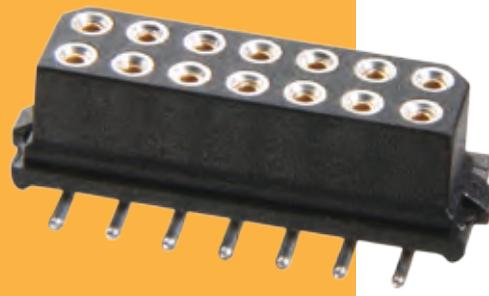


DOUBLE ROW

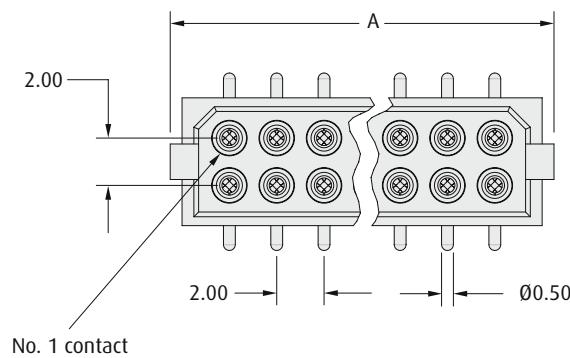

No. 1 contact

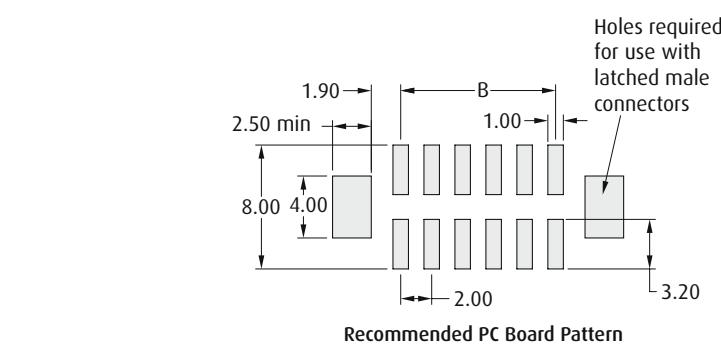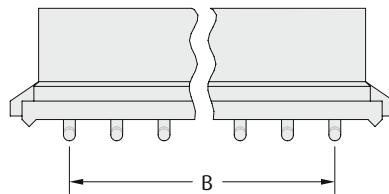

Recommended PC Board Pattern

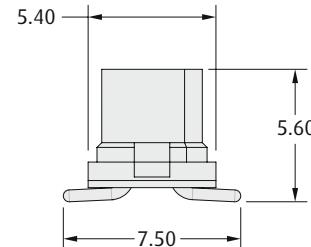

CALCULATION

$$A = B + 5.15$$

$$B = \text{Total no. of contacts} - 2$$

HOW TO ORDER

M80 - 681 XX XX P

SERIES CODE

TOTAL NO. OF CONTACTS

04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44

PICK AND PLACE CAP

BLANK	No cap
P	Pick and place cap

FINISH

01	Gold + Tin/Lead	
42	Gold + Tin	
45	Gold	

All dimensions in mm.

Datamate Connectors

Datamate L-Tek

Female Crimp

- Part numbers are for housings and the equivalent number of contacts.
- Contacts are rear insertable.
- For British Standard versions see pages 18 to 19.
- Mates with male connectors on pages 27 to 33.
- Spare contacts are available – see page 25.



SINGLE ROW	CALCULATION	DOUBLE ROW	CALCULATION
	A B + 5.15 B (Total no. of contacts - 1) x 2		A B + 5.15 B Total no. of contacts - 2
TOOLS	WIRE STRIPPING DETAILS		
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 □ Instruction sheets available at www.harwin.com/downloads/instructions			
HOW TO ORDER			
M80 - XXX XX XX			
SERIES CODE			
TYPE			
SINGLE	DOUBLE		
798	788	Extra Small Bore (28-32 AWG), Hi-Temp Plastic	
845	844	Small Bore (24-28 AWG), Hi-Temp Plastic	
611	613	Large Bore (22 AWG), Hi-Temp Plastic	
898	888	Small Bore (24-28 AWG)	
899	889	Large Bore (22 AWG)	
FINISH			
01	Gold + Tin (M80-788/789/888/889/898/899)	01	
05	Gold (M80-788/789/888/889/898/899)	05	
42	Gold + Tin (M80-611/613/844/845)	42	
45	Gold (M80-611/613/844/845)	45	
TOTAL NO. OF CONTACTS			
02 to 07, 17		Single Row	
04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34		Double Row	

All dimensions in mm.



Datamate Connectors

Datamate **Trio-Tek**

Female Crimp Trio-Tek

- Part numbers are for housings only, see page 25 for Trio-Tek contacts.
- Contacts are rear-insertable.
- Crimp inspection window in housing.
- Mates with male connectors on pages 27 to 33.
- Ideal for volume applications.

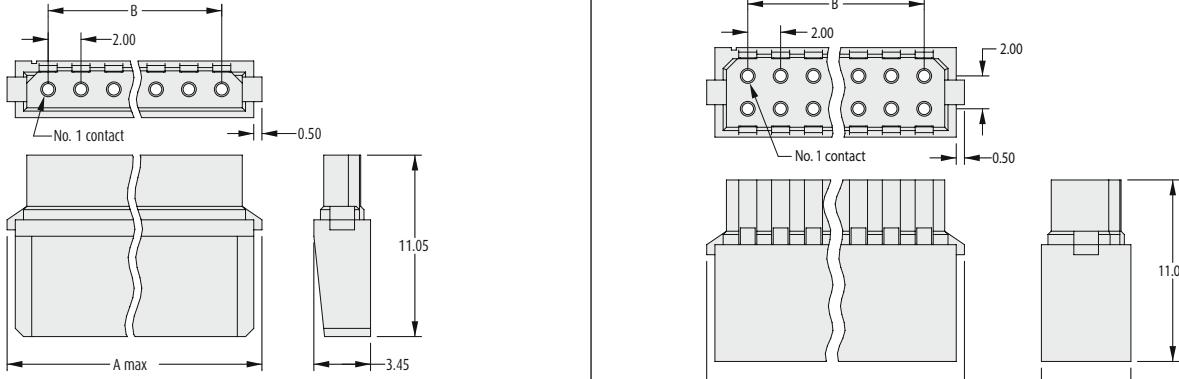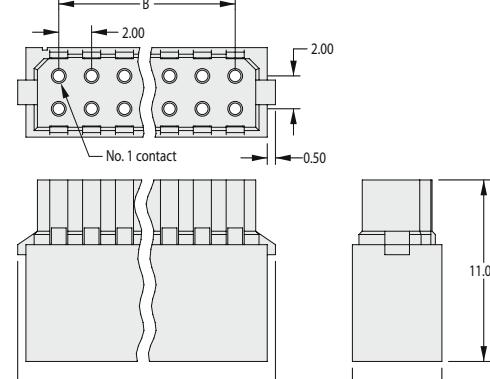

SINGLE ROW	CALCULATION	DOUBLE ROW	CALCULATION								
	<table border="1"> <tr> <td>A</td><td>B + 5.15</td></tr> <tr> <td>B</td><td>(Total no. of contacts - 1) x 2</td></tr> </table> 	A	B + 5.15	B	(Total no. of contacts - 1) x 2		<table border="1"> <tr> <td>A</td><td>B + 5.15</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> </table> 	A	B + 5.15	B	Total no. of contacts - 2
A	B + 5.15										
B	(Total no. of contacts - 1) x 2										
A	B + 5.15										
B	Total no. of contacts - 2										
TOOLS	WIRE STRIPPING DETAILS										
Recommended Hand Crimp Tool – Z80-255 See pages 87 to 89 ▷ Instruction sheets available at www.harwin.com/downloads/instructions											
HOW TO ORDER											
SERIES CODE	M80 - 69 X XX 98	FINISH									
TYPE		98 Housing 									
<table border="1"> <tr> <td>0</td><td>Single Row</td></tr> <tr> <td>1</td><td>Double Row</td></tr> </table>	0	Single Row	1	Double Row		TOTAL NO. OF CONTACTS					
0	Single Row										
1	Double Row										
		02 to 07, 17	Single Row								
		04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44	Double Row								


All dimensions in mm.

Datamate Connectors



Datamate **L-Tek**

Female Crimp Contacts

- Trio-Tek contacts must be ordered separately, see page 24 for applicable housings.
- Barrel Crimp contacts are supplied with the connectors (page 23) – use the order codes below for extra crimps.
- For crimp and insertion tools, see pages 87 to 89.

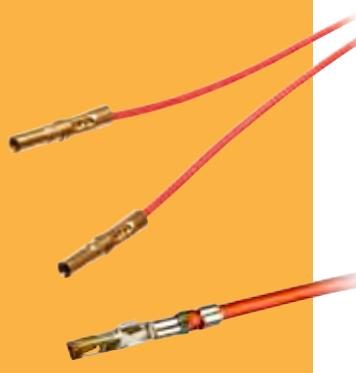


TRIO-TEK

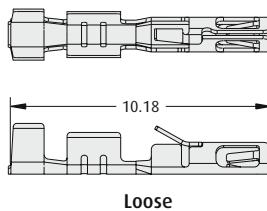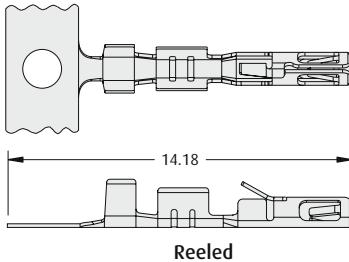


Datamate **Trio-Tek**

Wire Stripping Details

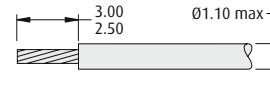


BARREL CRIMP


Large Bore (22 AWG):

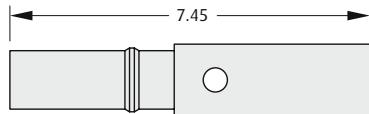


Extra Small Bore (28 - 32 AWG):

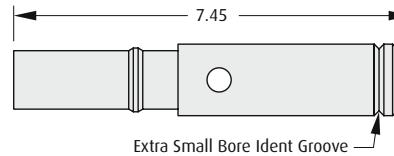

Small Bore (24 - 28 AWG):

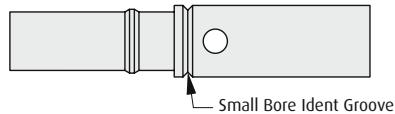

Wire Stripping Details

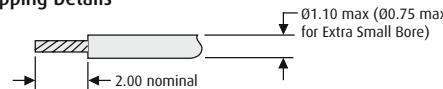

HOW TO ORDER

M80 - XXX 00 XX

SERIES CODE

FINISH

01	Gold + Tin (M80-01x)	
05	Gold (M80-01x)	
42	Gold + Tin (M80-2xx)	
45	Gold (M80-2xx)	

TYPE

011	Barrel Crimp, Large Bore (22 AWG)	253	Trio-Tek Crimp 22-24 AWG, Reeled
013	Barrel Crimp, Small Bore (24-28 AWG)	254	Trio-Tek Crimp 26-28 AWG, Reeled
019	Barrel Crimp, Extra Small Bore (28-32 AWG)	283	Trio-Tek Crimp 22-24 AWG, Loose

Datamate Connectors


Datamate **L-Tek**

Female Crimp Hood

- Supplied as a kit of parts, including body, lid, cable clamp and 4 screws.
- For use with double row female crimp connectors shown on page 23.
- Mates with unlatched or friction latch male connectors.



HOOD

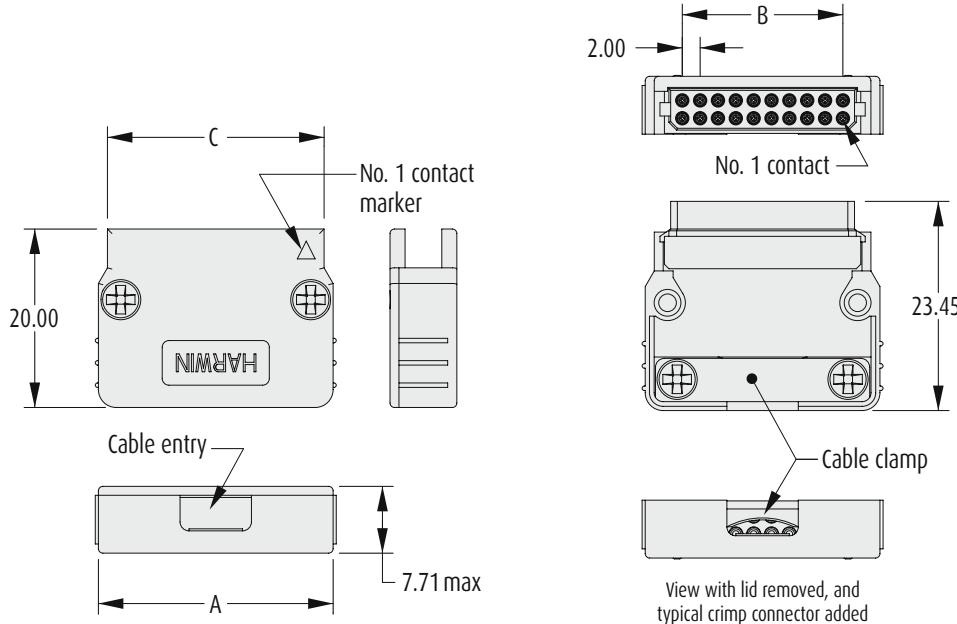

View with lid removed, and typical crimp connector added

CALCULATION

A	$B + 8.30$
B	Total no. of contacts - 2
C	$B + 6.30$

HOW TO ORDER

M80 - 880 XX 98

SERIES CODE

TOTAL NO. OF CONTACTS

10, 12, 14, 16, 18, 20, 26, 34

All dimensions in mm.

Male Single Row Vertical PC Tail

- Polarised mouldings.
- Fully shrouded contacts.
- Mates with female connectors shown on pages 21 to 24.
- For British Standard versions see pages 18 to 19.
- Can be used with Strain Relief straps:
order code M80-0030006.



UNLATCHED	CALCULATION														
	<table border="1"> <tr> <td>A</td><td>$B + 5.60$</td></tr> <tr> <td>B</td><td>(Total no. of contacts - 1) x 2</td></tr> </table>	A	$B + 5.60$	B	(Total no. of contacts - 1) x 2										
A	$B + 5.60$														
B	(Total no. of contacts - 1) x 2														
	<p>Recommended PC Board Pattern</p>														
HOW TO ORDER															
SERIES CODE <table border="1"> <tr> <td>RoHS </td> <td>Non-RoHS </td> </tr> <tr> <td>852</td> <td>879</td> </tr> <tr> <td>882</td> <td>877</td> </tr> <tr> <td>881</td> <td>805</td> </tr> <tr> <td>752</td> <td>752</td> </tr> <tr> <td>782</td> <td>782</td> </tr> <tr> <td>781</td> <td>781</td> </tr> </table>	RoHS	Non-RoHS	852	879	882	877	881	805	752	752	782	782	781	781	M80 - XXX XX XX
RoHS	Non-RoHS														
852	879														
882	877														
881	805														
752	752														
782	782														
781	781														
FINISH <table border="1"> <tr> <td>05</td> <td>Gold </td> </tr> <tr> <td>22</td> <td>Gold + Tin/Lead </td> </tr> <tr> <td>42</td> <td>Gold + Tin </td> </tr> <tr> <td>45</td> <td>Gold </td> </tr> </table>		05	Gold	22	Gold + Tin/Lead	42	Gold + Tin	45	Gold						
05	Gold														
22	Gold + Tin/Lead														
42	Gold + Tin														
45	Gold														
TOTAL NO. OF CONTACTS <table border="1"> <tr> <td>02 to 07, 17, 22</td> </tr> </table>		02 to 07, 17, 22													
02 to 07, 17, 22															


All dimensions in mm.

Datamate Connectors

Datamate **L-Tek**

Male Double Row Vertical PC Tail

- Polarised mouldings.
- Fully shrouded contacts.
- Mates with female connectors shown on pages 21 to 24.
- For British Standard versions see pages 18 to 19.
- Can be used with Strain Relief straps:
order code **M80-0030006**.

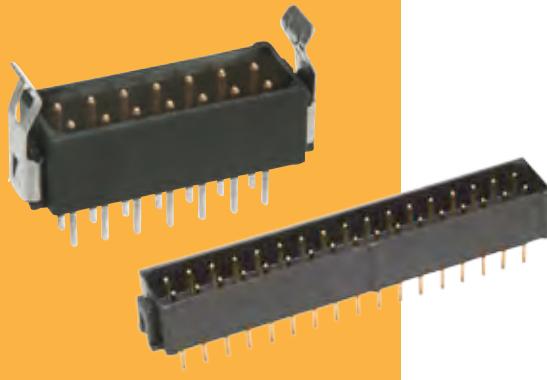


UNLATCHED		CALCULATION	
		A	B + 5.60
		B	Total no. of contacts - 2
Recommended PC Board Pattern			
LOCKING LATCH		FRICTION LATCH	
HOW TO ORDER			
SERIES CODE	M80 - XXX XX XX	FINISH	TOTAL NO. OF CONTACTS
RoHS Non-RoHS		05 Gold 22 Gold + Tin/Lead 42 Gold + Tin 45 Gold	04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44
854 869 Unlatched (3mm tail) 853 867 Locking Latch (3mm tail) 863 815 Friction Latch (3mm tail) 754 754 Unlatched (4.5mm tail) 753 753 Locking Latch (4.5mm tail) 763 763 Friction Latch (4.5mm tail)			

All dimensions in mm.

Male Single Row Horizontal PC Tail

- Mates with female connectors on pages 21 to 24.
- For British Standard versions see pages 18 to 19.
- Supplied with Strain Relief straps:

Order code M80-0030006.

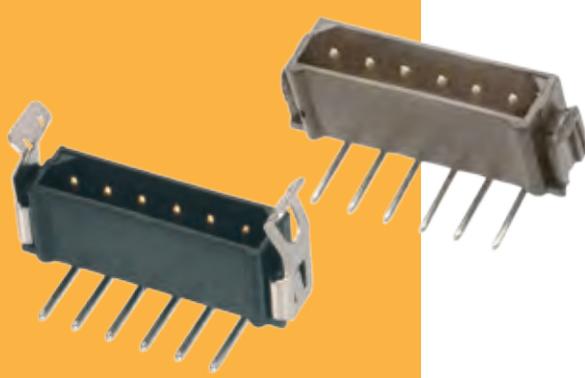

UNLATCHED		CALCULATION			
		A $B + 5.60$ B $(\text{Total no. of contacts} - 1) \times 2$			
LOCKING LATCH		FRICTION LATCH			
HOW TO ORDER					
M80 - XXX XX XX					
SERIES CODE					
RoHS	Non-RoHS				
843	878	Unlatched (3mm tail)			
842	876	Locking Latch (3mm tail)			
846	804	Friction Latch (3mm tail)			
793	793	Unlatched (4.5mm tail)			
792	792	Locking Latch (4.5mm tail)			
796	796	Friction Latch (4.5mm tail)			
FINISH					
05	Gold				
22	Gold + Tin/Lead				
42	Gold + Tin				
45	Gold				
TOTAL NO. OF CONTACTS	02 to 07, 17, 22				

All dimensions in mm.


Datamate Connectors

Datamate **L-Tek**

Male Double Row Horizontal PC Tail

- Mates with female connectors on pages 21 to 24.
- For British Standard versions see pages 18 to 19.
- Supplied with Strain Relief straps:

Order code M80-0030006.

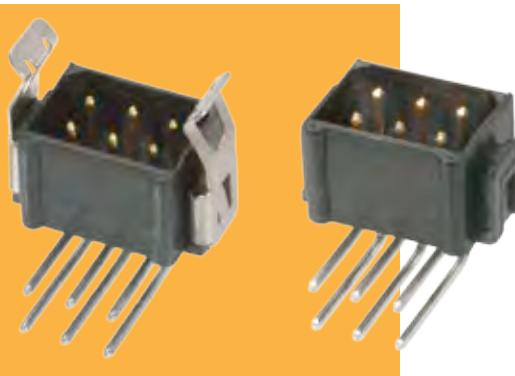

UNLATCHED		CALCULATION	
		A $B + 5.60$ B Total no. of contacts - 2	
LOCKING LATCH		FRICTION LATCH	
HOW TO ORDER			
SERIES CODE		M80 - XXX XX XX	
RoHS Non-RoHS		FINISH	
841	868	05	Gold
851	866	22	Gold + Tin/Lead
839	814	42	Gold + Tin
791	791	45	Gold
771	771		
789	789		
TOTAL NO. OF CONTACTS			
04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44			

All dimensions in mm.

Datamate Connectors

Datamate L-Tek

Male Vertical Surface Mount

- Contact datamate@harwin.com for tape & reel options.
- Optional pick and place cap.
- Mates with female connectors on pages 21 to 24.
- Gull wing SMT tails simplify inspection process.



SINGLE ROW	CALCULATION	DOUBLE ROW	CALCULATION
	A B + 5.60 B (Total no. of contacts - 1) x 2		A B + 5.60 B Total no. of contacts - 2
	Latches (when fitted) add 0.5mm to overall length 'A'		Latches (when fitted) add 0.5mm to overall length 'A'
	Recommended PC Board Pattern		Recommended PC Board Pattern

HOW TO ORDER

SERIES CODE	M80	-	X	2	X	XX	XX	P
ROWS								
9	Single Row							
8	Double Row							
TYPE	TOTAL NO. OF CONTACTS							
6	02 to 07, 17, 22							Single Row
7	04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44							Double Row
PICK AND PLACE CAP								
BLANK	No cap							
P	Pick and place cap							
FINISH								
22	Gold + Tin/Lead							
42	Gold + Tin							
45	Gold							


All dimensions in mm.

Datamate Connectors

Datamate **L-Tek**

Male Horizontal Surface Mount

- Contact datamate@harwin.com for tape & reel options.
- Strain Relief straps M80-0030006 supplied with these connectors.
- Mates with female connectors shown on pages 21 to 24.
- Stamped contact ensures co-planarity.

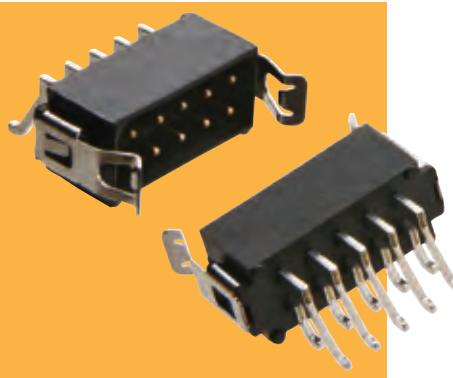

UNLATCHED	CALCULATION	
 	A B + 5.60 B Total no. of contacts - 2	Latches (when fitted) add 0.5mm to overall length 'A'
		Strain Relief strap holes Ø0.90 min
LOCKING LATCH	FRiction LATCH	
HOW TO ORDER		
SERIES CODE	M80 - 66 X XX XX	FINISH
TYPE		22 Gold + Tin/Lead 42 Gold + Tin
5 Unlatched		
6 Locking Latch		
7 Friction Latch		
	TOTAL NO. OF CONTACTS	
	04, 06, 08, 10, 12, 14, 16, 18, 20, 26, 34, 44	

Strain Relief straps are supplied with all horizontal connectors. There is no need to order separately. Straps locate at the end of each connector (see page 30).

All dimensions in mm.

Datamate Connectors

Datamate L-Tek

Male Crimp

- Mates with female connectors shown on pages 21 to 24.
- Contacts are rear insertable.
- Part numbers are for housings and the equivalent number of contacts.
- Back potting & cable assembly service available, contact datamate@harwin.com.
- Spare contacts available, see page 34.



SINGLE ROW	CALCULATION	DOUBLE ROW	CALCULATION								
Latches (when fitted) add 0.5mm to overall length 'A'	<table border="1"> <tr> <td>A</td><td>B + 5.60</td></tr> <tr> <td>B</td><td>(Total no. of contacts - 1) x 2</td></tr> </table>	A	B + 5.60	B	(Total no. of contacts - 1) x 2	Latches (when fitted) add 0.5mm to overall length 'A'	<table border="1"> <tr> <td>A</td><td>B + 5.60</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> </table>	A	B + 5.60	B	Total no. of contacts - 2
A	B + 5.60										
B	(Total no. of contacts - 1) x 2										
A	B + 5.60										
B	Total no. of contacts - 2										
TOOLS	WIRE STRIPPING DETAILS										
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ► Instruction sheets available at www.harwin.com/downloads/instructions											
HOW TO ORDER											
SERIES CODE	M80	- XXX XX XX	FINISH								
TYPE			05 Gold								
Single	Double										
806	810	Small Bore, Unlatched									
807	811	Large Bore, Unlatched									
808	812	Small Bore, Locking Latch									
809	813	Large Bore, Locking Latch									
883	816	Small Bore, Friction Latch									
884	817	Large Bore, Friction Latch									
TOTAL NO. OF CONTACTS											
02, 03, 04, 05, 06, 07		Single Row									
04, 06, 08, 10, 12		Double Row									

All dimensions in mm.


Male Crimp Contacts

- ▀ Crimp contacts are supplied with the connectors (page 30) – use the order codes below for extra crimp contacts.
- ▀ For crimp and insertion tools, see pages 87 to 89.




SPARE CRIMP CONTACT


Large Bore (22 AWG):

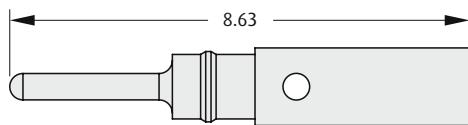

Wire Stripping Details

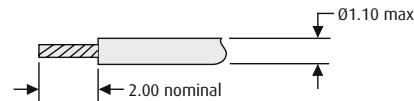

Small Bore (24 – 28 AWG):

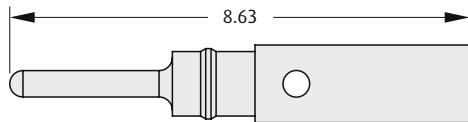

HOW TO ORDER

M80 - 04 X 00 05

SERIES CODE

TYPE

0 Large Bore

1 Small Bore

FINISH

05

Gold



All dimensions in mm.

Datamate Specification

Datamate **J-Tek**

Materials

Mouldings:	Glass-filled thermoplastic UL94V-0
Female contacts:	Brass shell, with Beryllium Copper inner contact
Male contacts:	Copper alloy
Finish:	See individual pages

Electrical

Current (individual contacts in isolation):	3.3A max (at 25°C) 2.6A max (at 85°C)
All contacts simultaneously:	3.0A max (at 25°C) 2.2A max (at 85°C)
Working Voltage (at sea level 1013 mbar):	800V DC or ACrms
Voltage Proof (at sea level 1013 mbar):	1,200V DC or ACrms
Contact resistance (initial):	20 mΩ max
Contact resistance (after conditioning):	25 mΩ max
Insulation resistance (initial):	1,000 MΩ min
Insulation resistance (after conditioning):	100 MΩ min

Mechanical

Durability:	500 operations 400 operations (Trio-Tek)
Insertion force (max):	2.8N
Withdrawal force (min):	0.2N
Signal crimp accommodation:	22 AWG to 32 AWG BS 3G 210 Type A, MIL-W-16878


Environmental

Environmental classification:	55/125/56 days at 95% RH
Operational temperature:	-55°C to +125°C
*Vibration sensitivity:	10Hz to 2000Hz, 0.75mm, 98m/s ² (10G), duration 6h
*Bump severity:	390m/s ² (40G), 4000 ±10 bumps
*Shock severity:	981m/s ² (100G) for 6ms
*Acceleration severity:	490m/s ² (50G)

* Tested with connectors with Jackscrews.

All preferred sizes of this range are held in stock.
Check www.harwin.com for availability.

Pin Numbering

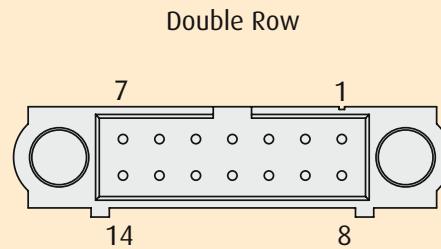

Contact numbering is shown looking onto mating face of male connector.

Mating Profiles






















Datamate **J-Tek**

FEMALE MALE	VERTICAL PC TAIL	VERTICAL SMT	CRIMP
VERTICAL PC TAIL			
HORIZONTAL PC TAIL			
VERTICAL SMT			
HORIZONTAL SMT			
CRIMP			
CRIMP 1mm EXTENDED WALL			
CRIMP 5mm EXTENDED WALL			

All dimensions in mm.

Mating Profiles

Datamate **J-Tek**

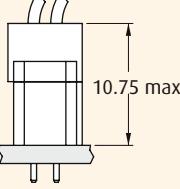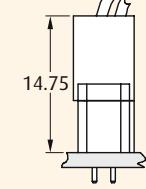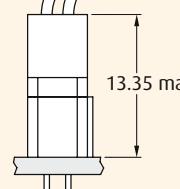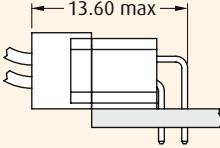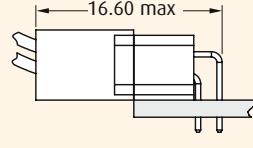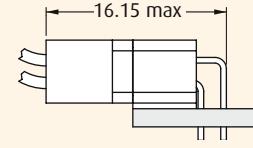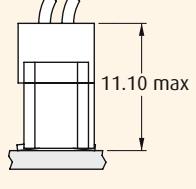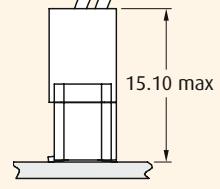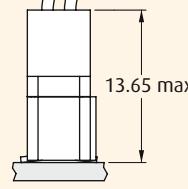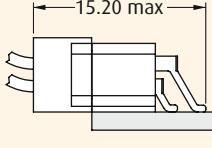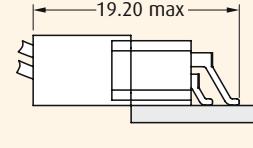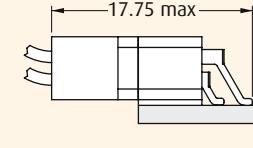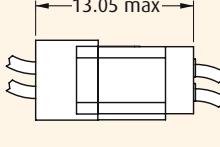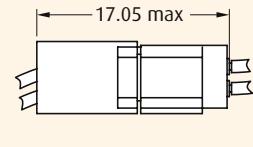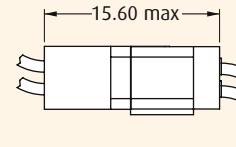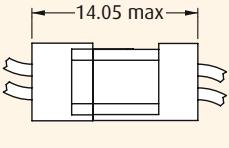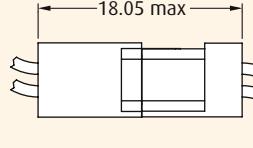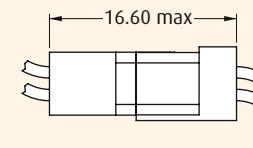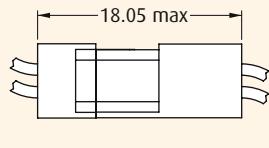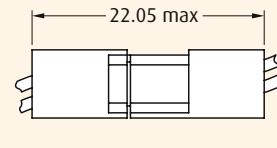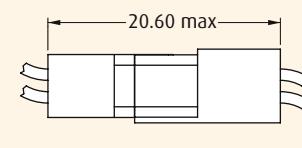FEMALE MALE \	CRIMP 1mm EXTENDED WALL	CRIMP 5mm EXTENDED WALL	CRIMP TRIO-TEK
VERTICAL PC TAIL			
HORIZONTAL PC TAIL			
VERTICAL SMT			
HORIZONTAL SMT			
CRIMP			
CRIMP 1mm EXTENDED WALL			
CRIMP 5mm EXTENDED WALL			


All dimensions in mm.

Datamate Connectors



Datamate J-Tek

Female Vertical PC Tail

- Fully shrouded contacts.
- Polarised mouldings.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.

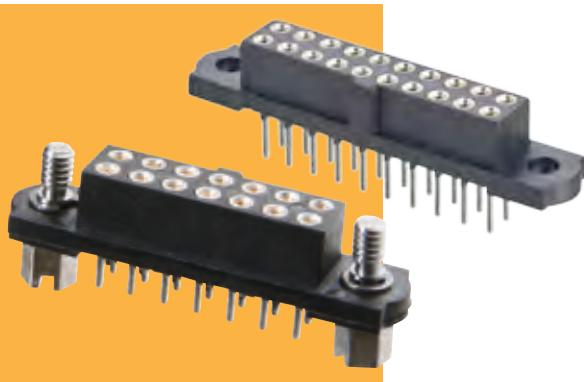


WITHOUT JACKSCREWS

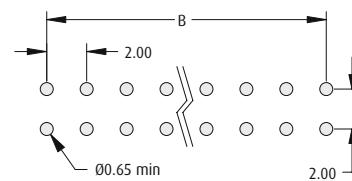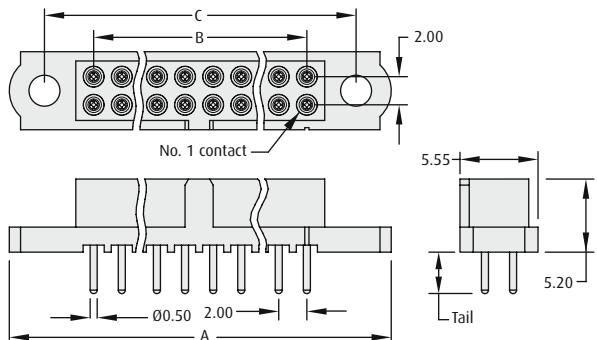


Recommended PC Board Pattern

WITH JACKSCREWS

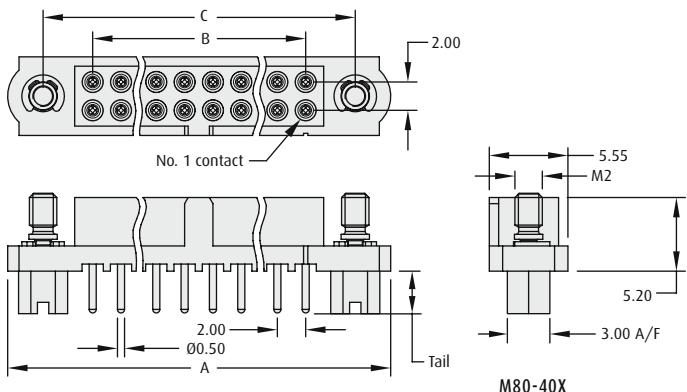

CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

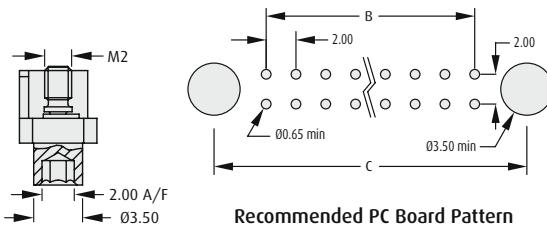

Recommended PC Board Pattern

HOW TO ORDER

SERIES CODE

M80 - 4 X X XX XX

0	With Hex Slotted Jackscrews
1	Without Jackscrews
2	With Hex Socket Jackscrews

0	3mm Tails
1	4.5mm Tails

FINISH

01	Gold + Tin/Lead
05	Gold
42	Gold + Tin

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only


All dimensions in mm.

Datamate Connectors



Datamate J-Tek

Female Vertical PC Tail Guide Pin, 101Lok

- 101Lok fixing gives secure, fast and simple mating; no special tooling required. Just a simple 101-degree turn is required to fix the connectors together.
- 101Lok style mates with male connectors shown on pages 53, 55, 57, 59 and 61.
- Guide pin style includes board mount fixing, and mates with male connectors with Jackscrews, shown on pages 52, 54, 56, 58, 60, 63 and 64.

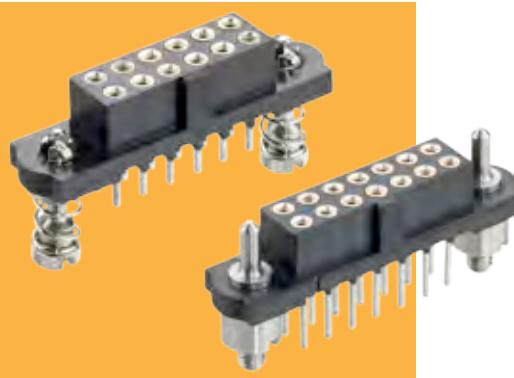


GUIDE PIN JACKSCREWS

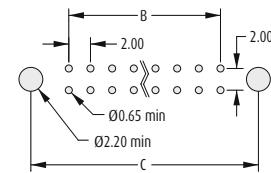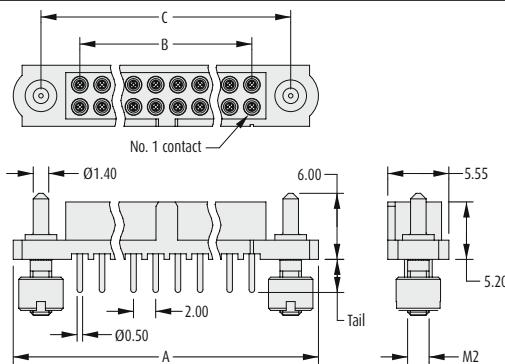


Recommended PC Board Pattern

101LOK

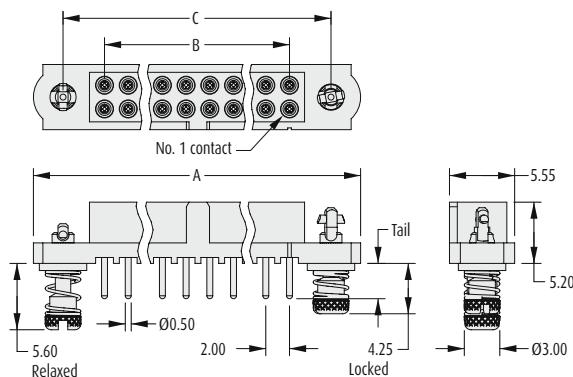

CALCULATION

A	B + 12
B	Total no. of contacts - 2
C	B + 7

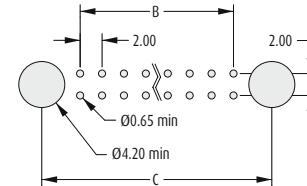

Recommended PC Board Pattern

HOW TO ORDER

SERIES CODE

M80 - 4 TX XX XX FX

JACKSCREW

F3	Guide Pin
FC	101Lok

TYPE

T1 3mm Tails

T2 4.5mm Tails

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

FINISH

01	Gold + Tin/Lead	Pb
05	Gold	Pb
42	Gold + Tin	Pb

All dimensions in mm.





Datamate Connectors

Datamate **J-Tek**

Female Vertical PC Tail Reverse Fix

- Fully shrouded contacts.
- Polarised mouldings.
- Includes board mount fixing, and mates with male connectors shown on page 62.

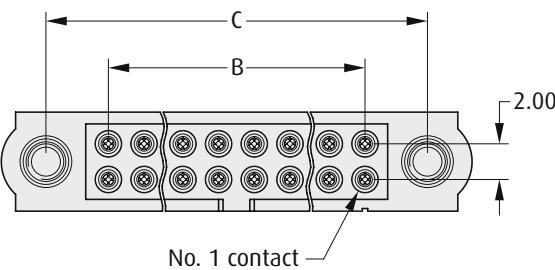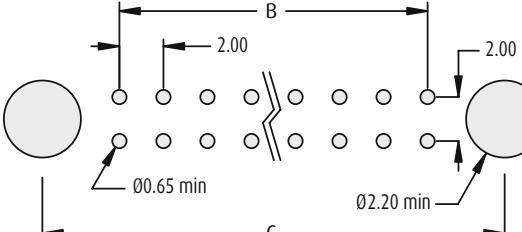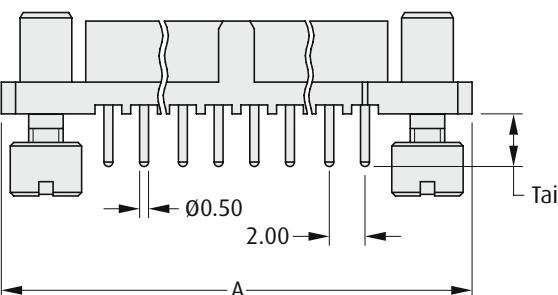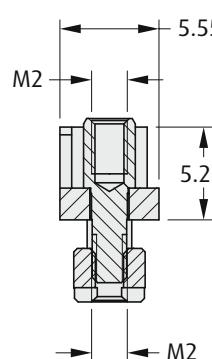

REVERSE FIX		CALCULATION									
		<table border="1"><tr><td>A</td><td>B + 12</td></tr><tr><td>B</td><td>Total no. of contacts - 2</td></tr><tr><td>C</td><td>B + 7</td></tr></table>	A	B + 12	B	Total no. of contacts - 2	C	B + 7			
A	B + 12										
B	Total no. of contacts - 2										
C	B + 7										
		Recommended PC Board Pattern									
											
HOW TO ORDER											
SERIES CODE	M80 - 40 X XX XX	FINISH									
TYPE	5 3mm Tails 6 4.5mm Tails	<table border="1"><tr><td>01</td><td>Gold + Tin/Lead</td><td></td></tr><tr><td>05</td><td>Gold</td><td></td></tr><tr><td>42</td><td>Gold + Tin</td><td></td></tr></table>	01	Gold + Tin/Lead		05	Gold		42	Gold + Tin	
01	Gold + Tin/Lead										
05	Gold										
42	Gold + Tin										
TOTAL NO. OF CONTACTS		04 to 50									
Even numbers only											


All dimensions in mm.

Datamate Connectors



Datamate J-Tek

Female Vertical Surface Mount

- Optional pick and place cap.
- Contact datamate@harwin.com for tape and reel options.
- Gull wing SMT tails simplify inspection process.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.

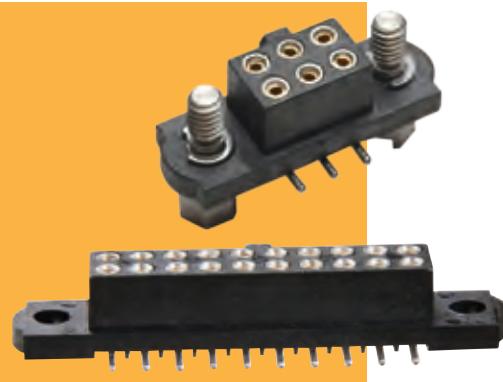

WITHOUT JACKSCREWS

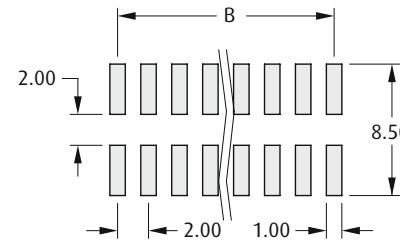
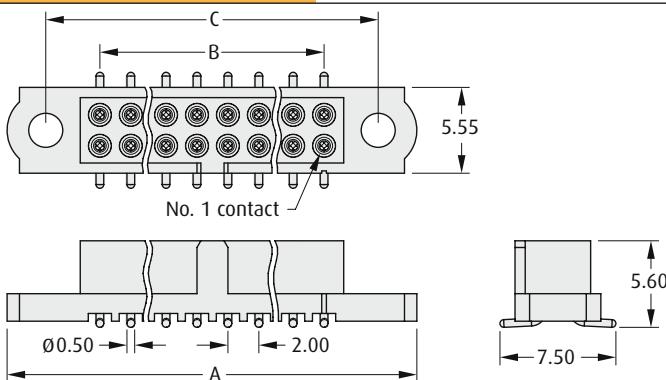


Recommended PC Board Pattern

CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

WITH JACKSCREWS

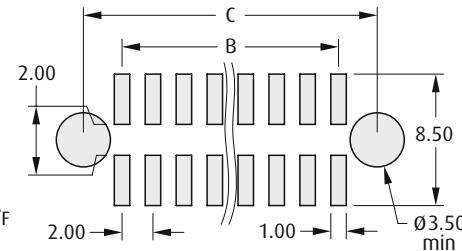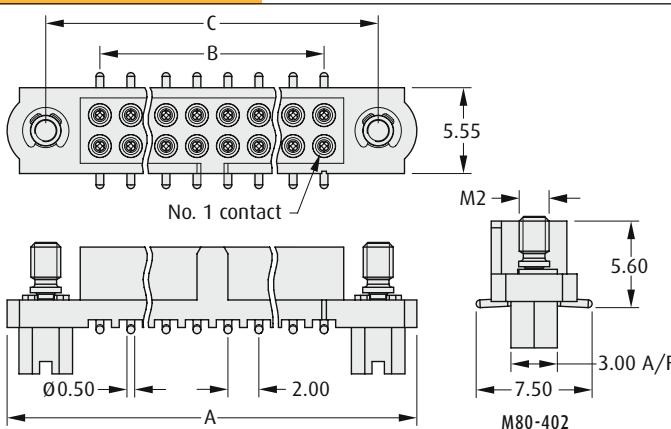

Recommended PC Board Pattern

HOW TO ORDER

M80 - 4 X 2 XX XX P

SERIES CODE

TYPE

0	With Hex Slotted Jackscrews
1	Without Jackscrews
2	With Hex Socket Jackscrews

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

PICK AND PLACE CAP

BLANK	No cap
P	Pick and place cap


FINISH

01	Gold + Tin/Lead	
05	Gold	
42	Gold + Tin	



All dimensions in mm.

Female Vertical Surface Mount Guide Pin, 101Lok


- 101Lok fixing gives secure, fast and simple mating; no special tooling required. Just a simple 101-degree turn is required to fix the connectors together.
- 101Lok style mates with male connectors shown on pages 53, 55, 57, 59 and 61.
- Guide pin style includes Board Mount fixing, and mates with male connectors with Jackscrews, shown on pages 52, 54, 56, 58, 60, 63 and 64.

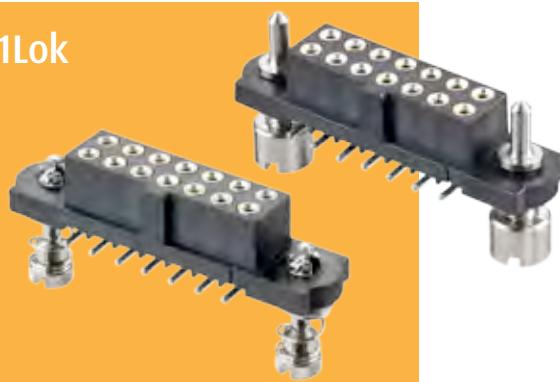


GUIDE PIN JACKSCREWS

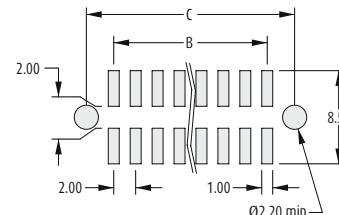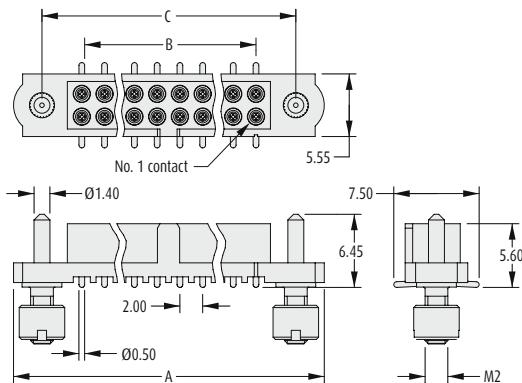

101LOK

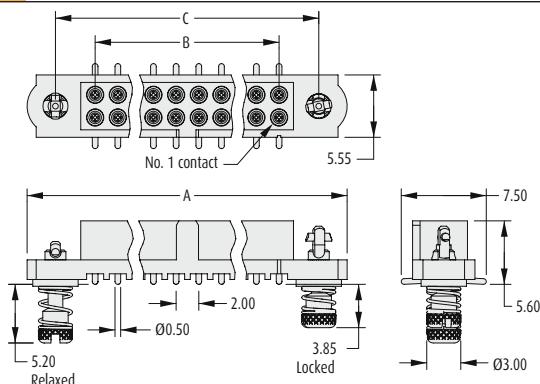

101 Lok

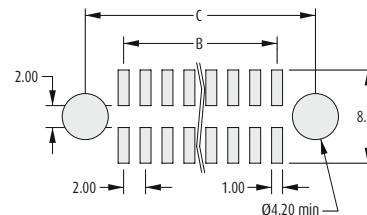

Recommended PC Board Pattern

CALCULATION

A	B + 12
B	Total no. of contacts - 2
C	B + 7

HOW TO ORDER

M80 - 4S1 XX XX FX

TYPE

F3	Guide Pin
FC	101Lok

SERIES CODE

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

FINISH

01	Gold + Tin/Lead	Pb
05	Gold	Pd
42	Gold + Tin	Pt

All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Female Vertical Surface Mount Reverse Fix

- Fully shrouded contacts.
- Polarised mouldings.
- Includes Board Mount fixing, and mates with male connectors shown on page 62.



REVERSE FIX		CALCULATION								
		<table border="1"> <tr> <td>A</td><td>B + 12</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> <tr> <td>C</td><td>B + 7</td></tr> </table>	A	B + 12	B	Total no. of contacts - 2	C	B + 7		
A	B + 12									
B	Total no. of contacts - 2									
C	B + 7									
		Recommended PC Board Pattern								
HOW TO ORDER										
M80 - 4S1 XX XX FX										
SERIES CODE		<table border="1"> <tr> <td>TYPE</td><td></td></tr> <tr> <td>F8</td><td>3.5mm Board Mount Jackscrew</td></tr> <tr> <td>F9</td><td>5mm Board Mount Jackscrew</td></tr> </table>	TYPE		F8	3.5mm Board Mount Jackscrew	F9	5mm Board Mount Jackscrew		
TYPE										
F8	3.5mm Board Mount Jackscrew									
F9	5mm Board Mount Jackscrew									
TOTAL NO. OF CONTACTS		<table border="1"> <tr> <td>FINISH</td><td></td></tr> <tr> <td>01</td><td>Gold + Tin/Lead </td></tr> <tr> <td>05</td><td>Gold </td></tr> <tr> <td>42</td><td>Gold + Tin </td></tr> </table>	FINISH		01	Gold + Tin/Lead	05	Gold	42	Gold + Tin
FINISH										
01	Gold + Tin/Lead									
05	Gold									
42	Gold + Tin									
04 to 50										
Even numbers only										

All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Female Crimp

- Large bore 22 AWG, small bore 24 – 28 AWG.
- Jackscrews are assembled where specified.
- Crimp contacts are rear insertable.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.
- Part numbers are for housings and the equivalent number of contacts.
- Spare contacts available, see page 51.
- Version also available for 28 – 32 AWG cable – see page 46.



DATAMATE J-TEK

WITHOUT JACKSCREWS		WITH JACKSCREWS	
CALCULATION			
A	B + 12	M80-460 M80-461	M80-480 M80-481
B	Total no. of contacts - 2		
C	B + 7		
TOOLS		WIRE STRIPPING DETAILS	
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 □ Instruction sheets available at www.harwin.com/downloads/instructions			
HOW TO ORDER			
SERIES CODE	M80	- XXX XX XX	FINISH
TYPE 460 Large Bore, with Jackscrews* 471 Small Bore, without Jackscrews 461 Small Bore, with Jackscrews* 480 Large Bore, with Hex Jackscrews 470 Large Bore, without Jackscrews 481 Small Bore, with Hex Jackscrews		05 Gold 42 Gold + Tin	TOTAL NO. OF CONTACTS 04 to 50
<small>* Slotted</small> Even numbers only			

All dimensions in mm.

Female Crimp Reverse Fix

- Mates with male connectors shown on page 62.
- Allows for further flexibility in system design.
- Crimp contacts supplied loose and are inserted from rear.
- Large bore 22 AWG, small bore 24 – 28 AWG.
- Part numbers are for housings and the equivalent number of contacts.
- Spare contacts are available – see page 51.
- Version also available for 28 – 32 AWG cable – see page 47.



WITH JACKSCREWS		CALCULATION									
		<table border="1"> <tr> <td>A</td><td>$B + 12$</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> <tr> <td>C</td><td>$B + 7$</td></tr> </table>	A	$B + 12$	B	Total no. of contacts - 2	C	$B + 7$			
A	$B + 12$										
B	Total no. of contacts - 2										
C	$B + 7$										
TOOLS	WIRE STRIPPING DETAILS	HOW TO ORDER									
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ► Instruction sheets available at www.harwin.com/downloads/instructions		<p>M80 - XXX XX XX</p> <div style="display: flex; justify-content: space-between;"> <div style="flex: 1;"> <table border="1"> <tr> <td>SERIES CODE</td> </tr> <tr> <td>TYPE</td> </tr> <tr> <td>462 Large Bore Connector</td> </tr> <tr> <td>463 Small Bore Connector</td> </tr> </table> </div> <div style="flex: 1;"> <table border="1"> <tr> <td>FINISH</td> </tr> <tr> <td>05 Gold</td> </tr> <tr> <td>42 Gold + Tin</td> </tr> </table> </div> <div style="flex: 1;"> <table border="1"> <tr> <td>TOTAL NO. OF CONTACTS</td> </tr> <tr> <td>04 to 50</td> </tr> </table> <p>Even numbers only</p> </div> </div>	SERIES CODE	TYPE	462 Large Bore Connector	463 Small Bore Connector	FINISH	05 Gold	42 Gold + Tin	TOTAL NO. OF CONTACTS	04 to 50
SERIES CODE											
TYPE											
462 Large Bore Connector											
463 Small Bore Connector											
FINISH											
05 Gold											
42 Gold + Tin											
TOTAL NO. OF CONTACTS											
04 to 50											

All dimensions in mm.




Datamate Connectors

Datamate J-Tek

Female Crimp Extra Small Bore

- Extra small bore for 28 – 32 AWG.
- Crimp contacts are rear insertable.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.
- Part numbers are for a housing and the equivalent number of contacts.
- Spare contacts available, see page 51.
- Versions also available for 22 – 28 AWG cable – see page 44.

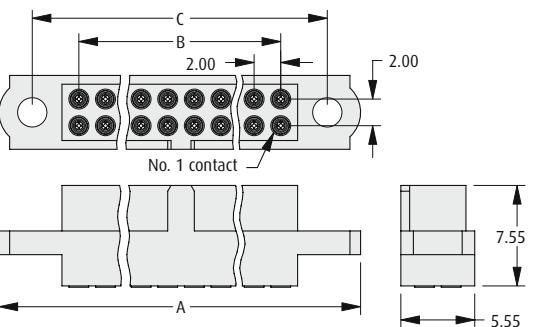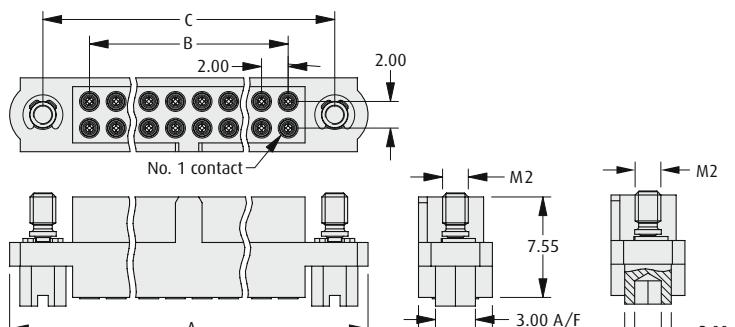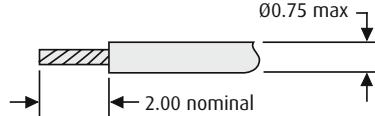


WITHOUT JACKSCREWS	WITH JACKSCREWS							
 <p>No. 1 contact</p>	 <p>No. 1 contact</p>							
CALCULATION								
A	B + 12							
B	Total no. of contacts - 2							
C	B + 7							
TOOLS	WIRE STRIPPING DETAILS							
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ▶ Instruction sheets available at www.harwin.com/downloads/instructions	 <p>0.75 max</p> <p>2.00 nominal</p>							
HOW TO ORDER								
M80 - 4 E1 XX XX FX	<table border="1"> <tr> <td>JACKSCREW</td></tr> <tr> <td>00 Without Jackscrews</td></tr> <tr> <td>F1 With Hexagonal Slotted Jackscrews</td></tr> <tr> <td>F2 With Hex Socket Jackscrews</td></tr> </table> <table border="1"> <tr> <td>FINISH</td></tr> <tr> <td>05 Gold </td></tr> <tr> <td>42 Gold + Tin </td></tr> </table>	JACKSCREW	00 Without Jackscrews	F1 With Hexagonal Slotted Jackscrews	F2 With Hex Socket Jackscrews	FINISH	05 Gold 	42 Gold + Tin 
JACKSCREW								
00 Without Jackscrews								
F1 With Hexagonal Slotted Jackscrews								
F2 With Hex Socket Jackscrews								
FINISH								
05 Gold 								
42 Gold + Tin 								
SERIES CODE E1 Extra Small Bore 28-32AWG TOTAL NO. OF CONTACTS 04 to 50 <small>Even numbers only</small>								

All dimensions in mm.

Female Crimp 101Lok, Guide Pin, Reverse Fix

- Extra Small Bore for 28 – 32 AWG.
- 101Lok fixing gives secure, fast and simple mating; no special tooling required. Just a simple 101-degree turn to fix the connectors together.
- 101Lok style mates with male connectors shown on pages 53, 55, 57, 59 and 61.
- Reverse fix includes board mount fixing, and mates with male connectors shown on page 62.
- Guide pin style includes Board Mount fixing, and mates with male connectors with Jackscrews, shown on pages 52, 54, 56, 58, 60, 63 and 64.

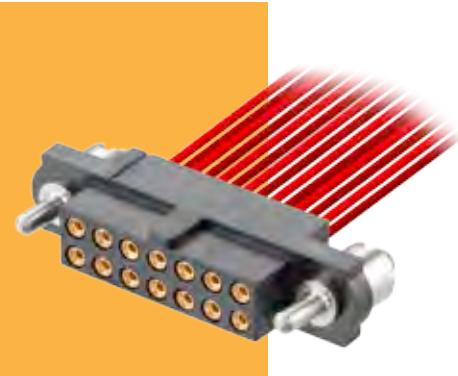

101LOK	GUIDE PIN, REVERSE FIX						
CALCULATION							
<table border="1"> <tr> <td>A</td><td>B + 12</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> <tr> <td>C</td><td>B + 7</td></tr> </table>	A	B + 12	B	Total no. of contacts - 2	C	B + 7	
A	B + 12						
B	Total no. of contacts - 2						
C	B + 7						
TOOLS	WIRE STRIPPING DETAILS						
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ▪ Instruction sheets available at www.harwin.com/downloads/instructions							
HOW TO ORDER							
SERIES CODE TYPE C1 Small Bore 24-28AWG D1 Large Bore 22AWG E1 Extra Small Bore 28-32AWG	M80 - 4 X1 XX XX FX TOTAL NO. OF CONTACTS 04 to 50 <small>Even numbers only</small>						
	JACKSCREW F3 Guide Pin F8 Reverse Fix (3.5mm Board Mount) F9 Reverse Fix (5mm Board Mount) FC 101Lok						
	FINISH 05 Gold 42 Gold + Tin						


All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Female Crimp Extended Wall

- Extended Wall Datamate allows back potting to be performed.
- Polarised mouldings.
- Crimp contacts are rear insertable.
- Large bore 22AWG, small bore 24 – 28 AWG.
- Part numbers are for a housing and the equivalent number of contacts.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.
- Spare contacts are available – see page 51.

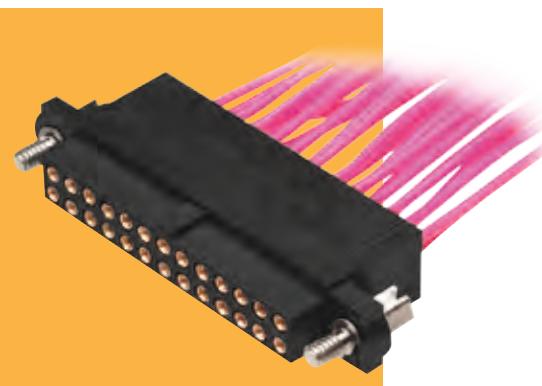

WITHOUT JACKSCREWS		WITH JACKSCREWS													
		CALCULATION													
		<table border="1"> <tr> <td>A</td><td>B + 12</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> <tr> <td>C</td><td>B + 7</td></tr> </table>		A	B + 12	B	Total no. of contacts - 2	C	B + 7						
A	B + 12														
B	Total no. of contacts - 2														
C	B + 7														
TOOLS <ul style="list-style-type: none"> Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 Instruction sheets available at www.harwin.com/downloads/instructions 		WIRE STRIPPING DETAILS													
HOW TO ORDER															
SERIES CODE M80 - XXX XX XX		WALL SIZE <table border="1"> <tr> <td>BLANK</td><td>Wall = 5mm</td></tr> <tr> <td>A</td><td>Wall = 1mm</td></tr> </table> FINISH <table border="1"> <tr> <td>05</td><td>Gold</td><td></td></tr> <tr> <td>42</td><td>Gold + Tin</td><td></td></tr> </table> TOTAL NO. OF CONTACTS <table border="1"> <tr> <td>06, 10, 12, 14, 18, 20, 26, 34, 42, 50</td> </tr> </table>		BLANK	Wall = 5mm	A	Wall = 1mm	05	Gold		42	Gold + Tin		06, 10, 12, 14, 18, 20, 26, 34, 42, 50	
BLANK	Wall = 5mm														
A	Wall = 1mm														
05	Gold														
42	Gold + Tin														
06, 10, 12, 14, 18, 20, 26, 34, 42, 50															
TYPE <table border="1"> <tr> <td>465</td><td>Large Bore, with Jackscrews*</td> <td>476</td><td>Small Bore, without Jackscrews</td> </tr> <tr> <td>466</td><td>Small Bore, with Jackscrews*</td> <td>485</td><td>Large Bore, with Hex Jackscrews</td> </tr> <tr> <td>475</td><td>Large Bore, without Jackscrews</td> <td>486</td><td>Small Bore, with Hex Jackscrews</td> </tr> </table>				465	Large Bore, with Jackscrews*	476	Small Bore, without Jackscrews	466	Small Bore, with Jackscrews*	485	Large Bore, with Hex Jackscrews	475	Large Bore, without Jackscrews	486	Small Bore, with Hex Jackscrews
465	Large Bore, with Jackscrews*	476	Small Bore, without Jackscrews												
466	Small Bore, with Jackscrews*	485	Large Bore, with Hex Jackscrews												
475	Large Bore, without Jackscrews	486	Small Bore, with Hex Jackscrews												

All dimensions in mm.

Datamate Connectors


Datamate **J-Tek**

Female Crimp with Hood

- Supplied as a complete kit, including hood, screws, connector, contacts and Jackscrews.
- For spare crimp contacts, see page 51.
- Provides strain relief by preventing cable bending at the rear of the connector, and also has the option of inserting a cable tie to reduce pull strain.
- Mates with male connectors shown on pages 52, 54, 56, 58, 60, 63 and 64.




FEMALE

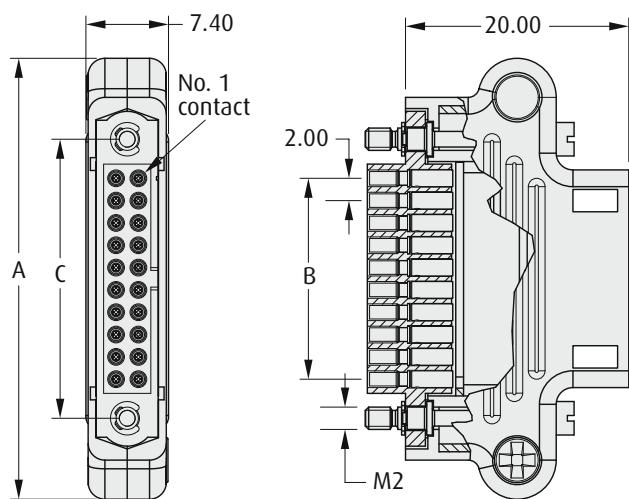

CALCULATION

A	B + 21.5
B	Total no. of contacts - 2
C	B + 7

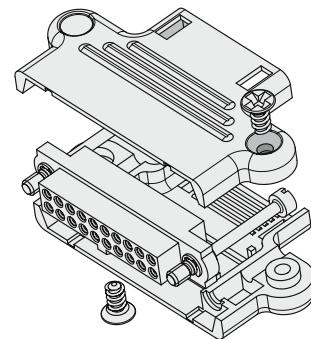

TOOLS

Recommended Crimp Tool - M22520/2-01


Positioner - T5747

Contact Insertion/Removal Tool - Z80-280

See pages 87 to 89

Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

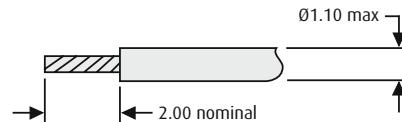

HOW TO ORDER

M80 - 94 X XX XX

SERIES CODE

TYPE

0	Small Bore 24-28AWG
1	Large Bore 22AWG

FINISH

05	Gold	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

06, 08, 10, 12, 14, 20, 26, 34, 42, 50

All dimensions in mm.

Datamate Connectors

Datamate **Trio-Tek**

Female Crimp Trio-Tek

- Crimp inspection window in housing.
- Mates with male connectors shown on pages 52 to 64.
- Contacts available separately, see page 51.
- Triangular contact design for automated assembly equipment.
- Ideal for volume applications.



WITH JACKSCREWS		CALCULATION	
	No.1 contact	A	B + 12
		B	Total no. of contacts - 2
		C	B + 7
WITHOUT JACKSCREWS		TOOLS	
	No.1 contact	Recommended Hand Crimp Tool – Z80-255 Contact Removal Tool – Z80-258 See pages 87 to 89 ▶ Instruction sheets available at www.harwin.com/downloads/instructions	
		WIRE STRIPPING DETAILS	
HOW TO ORDER			
SERIES CODE	M80 - 45X XX 98	FINISH	
TYPE		98	Housings
454 Without Jackscrews	457 Reverse Fix Jackscrews		
455 Hex Slotted Jackscrews	458 Guide pin with panel mount		
456 Hex Socket Jackscrews	459 101Lok Jackscrews		
		TOTAL NO. OF CONTACTS 06, 08, 10, 12, 14, 20, 26, 34, 42, 50	


All dimensions in mm.

Datamate Connectors


Datamate J-Tek

Female Crimp Contacts


- Trio-Tek contacts must be ordered separately, see page 50 for applicable housings.
- Barrel Crimp contacts are supplied with the connectors (pages 44 to 49) – use the order codes below for extra crimps.
- For crimp and insertion tools, see pages 87 to 89.

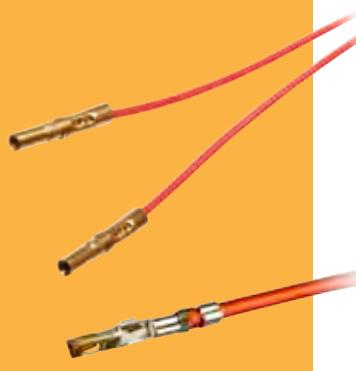

TRIO-TEK

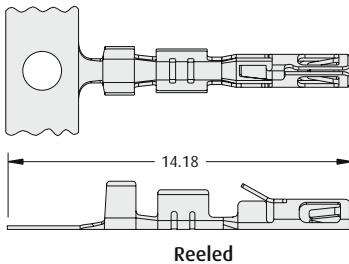


Reeled

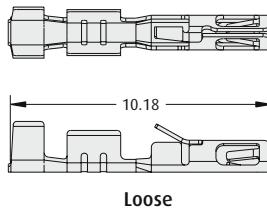

Loose


Datamate Trio-Tek

Wire Stripping Details

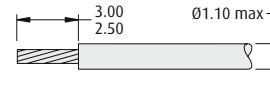


BARREL CRIMP


Large Bore (22 AWG):

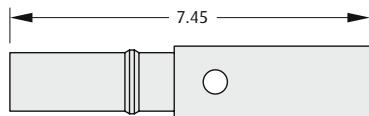


Small Bore (24 – 28 AWG):

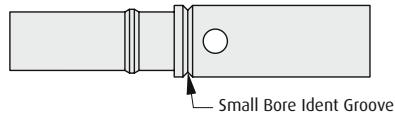

Extra Small Bore (28 – 32 AWG):

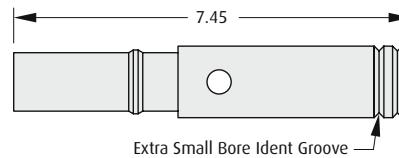

Wire Stripping Details

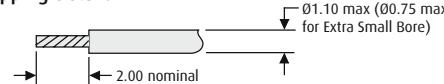

HOW TO ORDER

M80 - XXX 00 XX

SERIES CODE

FINISH

01	Gold + Tin (M80-01x)	
05	Gold (M80-01x)	
42	Gold + Tin (M80-2xx)	
45	Gold (M80-2xx)	

TYPE

011	Barrel Crimp, Large Bore (22 AWG)	253	Trio-Tek Crimp 22-24 AWG, Reeled
013	Barrel Crimp, Small Bore (24-28 AWG)	254	Trio-Tek Crimp 26-28 AWG, Reeled
019	Barrel Crimp, Extra Small Bore (28-32 AWG)	283	Trio-Tek Crimp 22-24 AWG, Loose

284 Trio-Tek Crimp 26-28 AWG, Loose


All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Male Vertical PC Tail

- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50 (excluding 101Lok).
- Polarised mouldings.
- Fully shrouded contacts.
- Jackscrews are assembled where specified.
- Choice of PC tail length.
- Board Mount provides PCB strain relief.

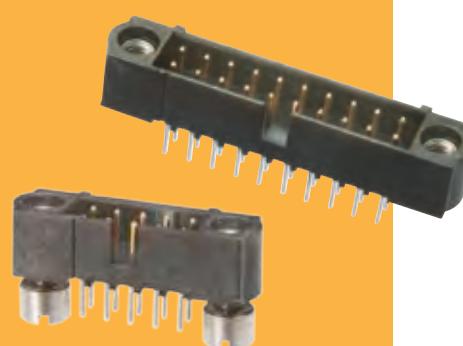

WITHOUT JACKSCREWS		CALCULATION	
		A	$B + 12$
		B	Total no. of contacts - 2
		C	$B + 7$
		<p>Recommended PC Board Pattern</p>	
WITH JACKSCREWS		WITH BOARD MOUNT	
HOW TO ORDER			
M80 - 5 X X XX XX			
SERIES CODE		FINISH	
0	With Jackscrews	05	Gold
1	With Board Mount	22	Gold + Tin/Lead
2	Without Jackscrews	42	Gold + Tin
TOTAL NO. OF CONTACTS		04 to 50	
Even numbers only			


All dimensions in mm.

Datamate Connectors


Datamate J-Tek

Male Vertical PC Tail 101Lok

- Mates with female connectors shown on pages 39, 42, 47 and 50.
- Polarised mouldings.
- Fully shrouded contacts.
- Jackscrews are assembled where specified.
- Choice of PC tail length.
- Board Mount provides PCB strain relief.

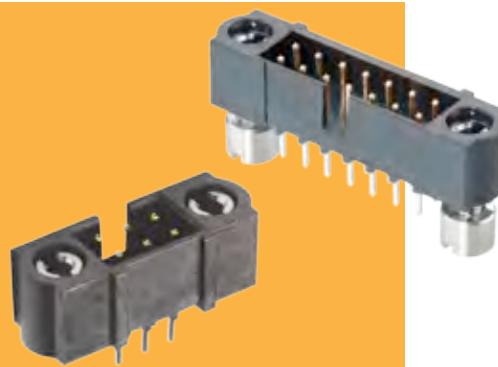


101 Lok

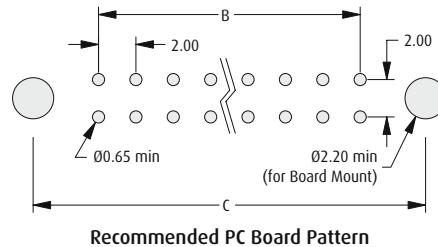


CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

101LOK

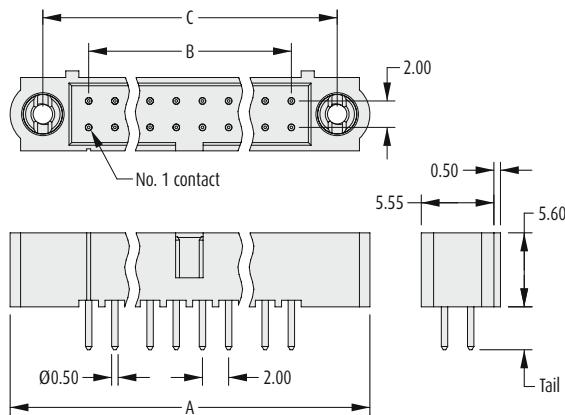

101LOK WITH BOARD MOUNT

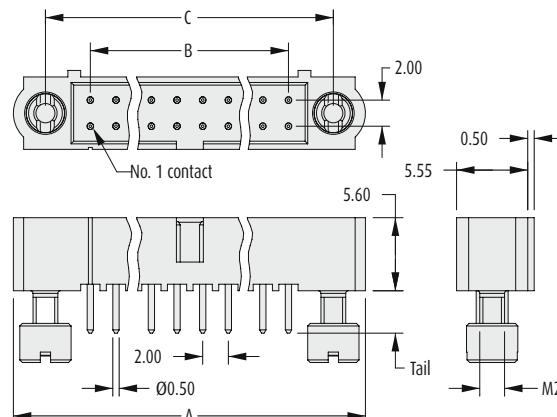

HOW TO ORDER

M80 - 5 TX XX XX MX

SERIES CODE

TYPE

T1 3mm Tails

T2 4.5mm Tails

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

JACKSCREW

MC 101Lok

ME 101Lok with Board Mount

FINISH

05 Gold

22 Gold + Tin/Lead

42 Gold + Tin


All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Male Horizontal PC Tail

- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50 (excluding 101Lok).
- Jackscrews are assembled where specified.
- Choice of PC tail length.
- Board Mount provides PCB strain relief.

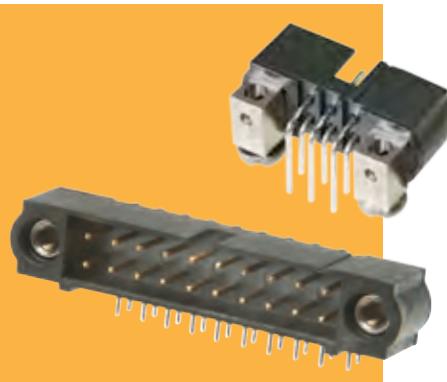

WITHOUT JACKSCREWS		CALCULATION
		A $B + 12$ B Total no. of contacts - 2 C $B + 7$
WITH JACKSCREWS		WITH BOARD MOUNT
HOW TO ORDER		
M80 - 5 X X XX XX		
SERIES CODE		FINISH
3	With Jackscrews	05 Gold
4	With Board Mount	22 Gold + Tin/Lead
5	Without Jackscrews	42 Gold + Tin
TOTAL NO. OF CONTACTS	04 to 50	
Even numbers only		

All dimensions in mm.

Datamate Connectors


Datamate J-Tek

Male Horizontal PC Tail 101Lok

- Mates with female connectors shown on pages 39, 42, 47 and 50.
- Jackscrews are assembled where specified.
- Choice of PC tail length.
- Board Mount provides PCB strain relief.




101 Lok

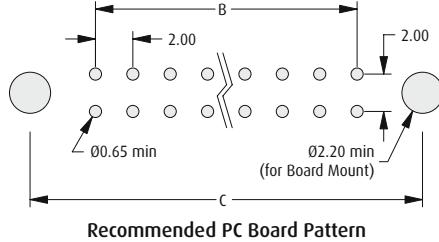


CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

101LOK

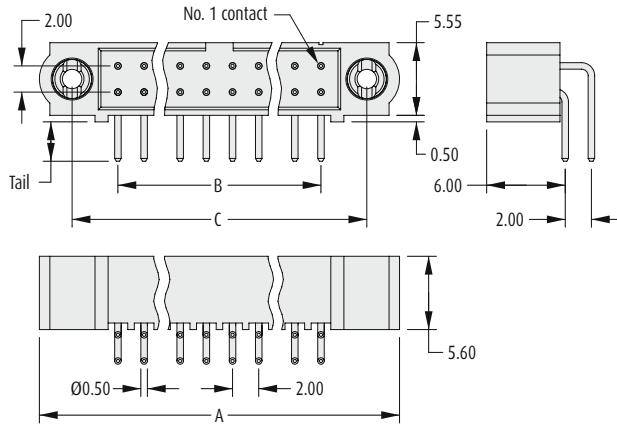

101LOK WITH BOARD MOUNT

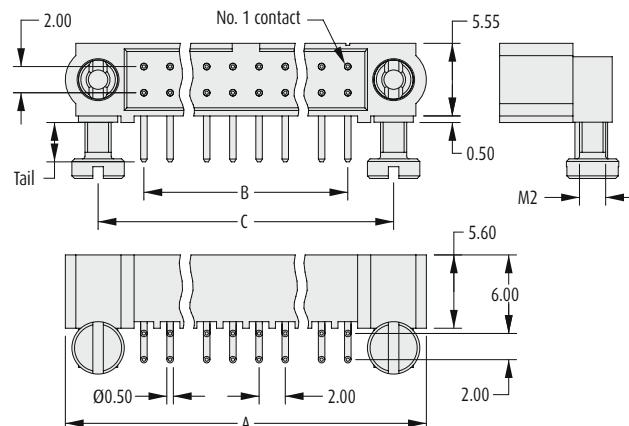

HOW TO ORDER

M80 - 5 LX XX XX MX

SERIES CODE

TYPE

L1	3mm Tails
L2	4.5mm Tails

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

JACKSCREW

MC 101Lok

MD 101Lok with Board Mount

FINISH

05 Gold



22 Gold + Tin/Lead



42 Gold + Tin



All dimensions in mm.

Male Vertical Surface Mount

- Contact datamate@harwin.com for tape & reel options.
- Optional pick and place cap.
- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50.
- Gull wing SMT tails simplify inspection process.
- Board Mount provides PCB strain relief.



WITHOUT JACKSCREWS		CALCULATION	
 		A	B + 12
		B	Total no. of contacts - 2
		C	B + 7
WITH JACKSCREWS		Recommended PC Board Pattern	
HOW TO ORDER			
SERIES CODE	M80 - 5 XX XX XX P	PICK AND PLACE CAP	
TYPE		BLANK	No cap
02		P	Pick and place cap
12			
13			
22			
TOTAL NO. OF CONTACTS		FINISH	
04 to 50		05	Gold
		22	Gold + Tin/Lead
		42	Gold + Tin


All dimensions in mm.

Datamate Connectors

Datamate **101 Lok**

Male Vertical Surface Mount 101Lok


- Contact datamate@harwin.com for tape & reel options.
- Optional pick and place cap.
- Mates with female connectors shown on pages 39, 42, 47 and 50.
- Gull wing SMT tails simplify inspection process.
- Board Mount provides PCB strain relief.

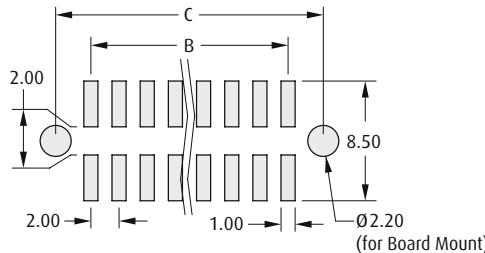


CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

101LOK

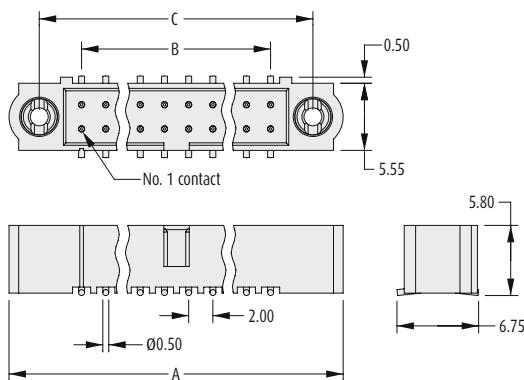

101LOK WITH BOARD MOUNT

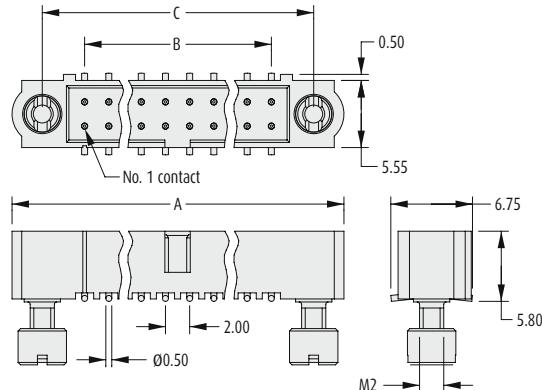

HOW TO ORDER

M80 - 5 S1 XX XX MX

SERIES CODE

TYPE

S1 Vertical Surface Mount

TOTAL NO. OF CONTACTS

04 to 50

Even numbers only

JACKSCREW

MC 101Lok

ME 101Lok with 5mm Board Mount

FINISH

05 Gold



22 Gold + Tin/Lead



42 Gold + Tin




Datamate Connectors

Datamate J-Tek

Male Horizontal Surface Mount

- Contact datamate@harwin.com for tape & reel options.
- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50.
- Stamped contact ensures co-planarity.
- Board Mount provides PCB strain relief.

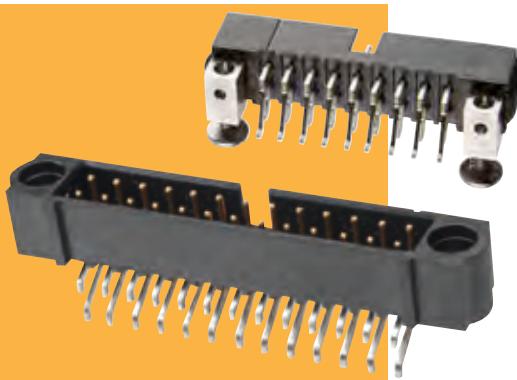

WITHOUT JACKSCREWS		CALCULATION	
		A	B + 12
		B	Total no. of contacts - 2
		C	B + 7
		<p>Recommended PC Board Pattern</p>	
WITH JACKSCREWS		WITH BOARD MOUNT	
HOW TO ORDER			
M80 - 5 XX XX XX			
SERIES CODE		FINISH	
32	With Jackscrews	05	Gold
42	With 3.5mm Board Mount	22	Gold + Tin/Lead
43	With 5mm Board Mount	42	Gold + Tin
52	Without Jackscrews	TOTAL NO. OF CONTACTS	
		04 to 50	
Even numbers only			


All dimensions in mm.

Datamate Connectors

Datamate **101 Lok**


Male Horizontal Surface Mount 101Lok

- Contact datamate@harwin.com for tape & reel options.
- Mates with female connectors shown on pages 39, 42, 47 and 50.
- Stamped contact ensures co-planarity.
- Board Mount provides PCB strain relief.

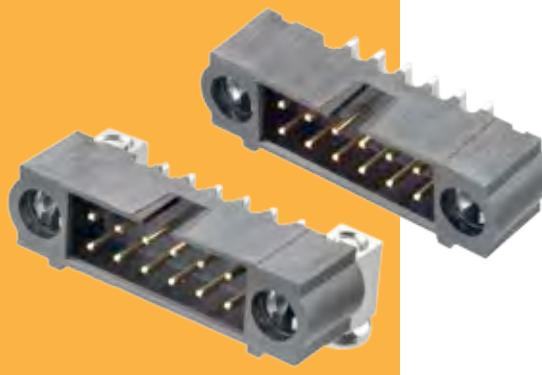


CALCULATION

A	$B + 12$
B	Total no. of contacts - 2
C	$B + 7$

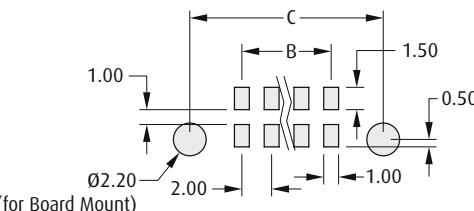


Recommended PC Board Pattern

101LOK

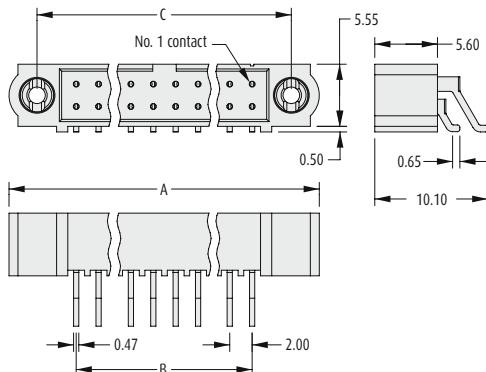

101LOK WITH BOARD MOUNT

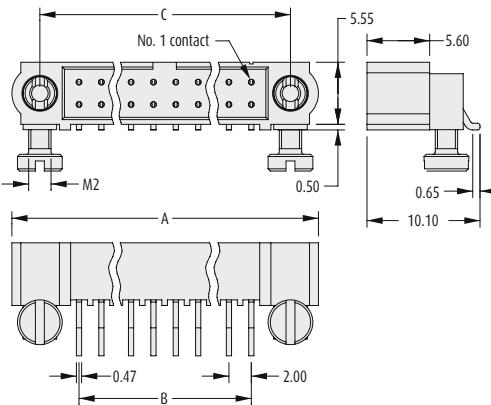

HOW TO ORDER

M80 - 5 S2 XX XX MX

SERIES CODE

TYPE

S2 | Horizontal Surface Mount

TOTAL NO. OF CONTACTS

04 to 50

JACKSCREW

MC | 101Lok

MD | 101Lok with Board Mount

FINISH

05 | Gold



22 | Gold + Tin/Lead



42 | Gold + Tin



Even numbers only


All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Male Crimp

- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50.
- Jackscrews are assembled where specified.
- Crimp contacts supplied loose.
- Crimp contacts are rear insertable and replaceable.
- Large Bore 22 AWG, Small Bore 24 – 28 AWG.
- Part numbers are for housings and the equivalent no. of contacts.
- Spare contacts are available – see page 65.

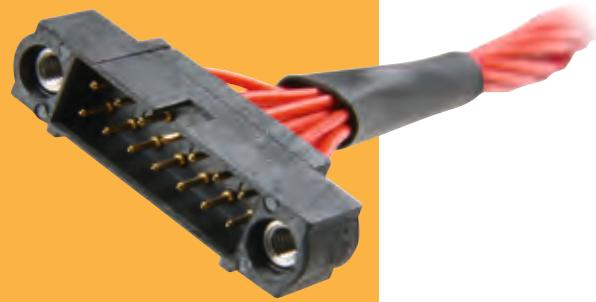

DATAMATE J-TEK

WITHOUT JACKSCREWS	WITH JACKSCREWS												
CALCULATION													
A $B + 12$													
B Total no. of contacts - 2													
C $B + 7$													
TOOLS	WIRE STRIPPING DETAILS												
Recommended Crimp Tool – M22520/2-01 Positioner – Z80-193 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ▪ Instruction sheets available at www.harwin.com/downloads/instructions													
HOW TO ORDER													
SERIES CODE 	M80 - XXX XX 05 												
TYPE <table border="1"> <tr> <td>560</td><td>Large Bore, with Jackscrews</td> <td>570</td><td>Large Bore, without Jackscrews</td> </tr> <tr> <td>561</td><td>Small Bore, with Jackscrews</td> <td>571</td><td>Small Bore, without Jackscrews</td> </tr> </table>	560	Large Bore, with Jackscrews	570	Large Bore, without Jackscrews	561	Small Bore, with Jackscrews	571	Small Bore, without Jackscrews	FINISH <table border="1"> <tr> <td>05</td><td>Gold</td> <td></td> </tr> </table> TOTAL NO. OF CONTACTS <table border="1"> <tr> <td>04 to 50</td> </tr> </table>	05	Gold		04 to 50
560	Large Bore, with Jackscrews	570	Large Bore, without Jackscrews										
561	Small Bore, with Jackscrews	571	Small Bore, without Jackscrews										
05	Gold												
04 to 50													
<small>Even numbers only</small>													


All dimensions in mm.

Datamate Connectors

Datamate **101 Lok**

Male Crimp 101Lok

- Mates with female connectors shown on pages 39, 42, 47 and 50.
- Crimp contacts supplied loose.
- Crimp contacts are rear insertable and replaceable.
- Large Bore 22 AWG, Small Bore 24 – 28 AWG.
- Part numbers are for housings and the equivalent number of contacts.
- Spare contacts are available – see page 65.

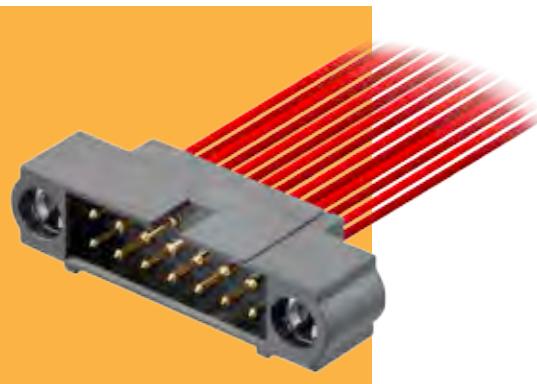

101LOK		CALCULATION						
		<table border="1"> <tr> <td>A</td><td>$B + 12$</td></tr> <tr> <td>B</td><td>Total no. of contacts - 2</td></tr> <tr> <td>C</td><td>$B + 7$</td></tr> </table>	A	$B + 12$	B	Total no. of contacts - 2	C	$B + 7$
A	$B + 12$							
B	Total no. of contacts - 2							
C	$B + 7$							
Recommended Crimp Tool – M22520/2-01 Positioner – Z80-193 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ► Instruction sheets available at www.harwin.com/downloads/instructions								
HOW TO ORDER								
SERIES CODE	M80	-	5	X1	XX	05	MC	
TYPE								
C1	Small Bore 24-28 AWG							
D1	Large Bore 22 AWG							
TOTAL NO. OF CONTACTS								
04 to 50								
Even numbers only								
All dimensions in mm.								
JACKSCREW								
MC								
FINISH								
05								
Gold								

Male Crimp Reverse Fix

- Mates with female connectors shown on pages 40, 43, 45 and 46.
- Allows for further flexibility in system design.
- Crimp contacts supplied loose.
- Crimp contacts are rear insertable and replaceable.
- Large Bore 22 AWG, Small Bore 24 – 28 AWG.
- Part numbers are for housings and the equivalent number of contacts.
- Spare contacts are available – see page 65.



REVERSE FIX		CALCULATION			
	No. 1 contact	A	B + 12		
		B	Total no. of contacts - 2		
	Slotted	C	B + 7		
TOOLS		WIRE STRIPPING DETAILS			
Recommended Crimp Tool – M22520/2-01 Positioner – Z80-193 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ▶ Instruction sheets available at www.harwin.com/downloads/instructions					
HOW TO ORDER					
SERIES CODE TYPE 562 Large Bore, Slotted Jackscrew 563 Small Bore, Slotted Jackscrew 582 Large Bore, Hex Socket Jackscrew 583 Small Bore, Hex Socket Jackscrew	M80 - XXX XX 05	FINISH 05 Gold	TOTAL NO. OF CONTACTS 04 to 50 <small>Even numbers only</small>		

All dimensions in mm.

Datamate Connectors

Datamate J-Tek

Male Crimp Extended Wall

- Extended Wall Datamate allows back potting to be performed.
- Fully shrouded contacts.
- Large Bore 22 AWG, Small Bore 24 – 28 AWG.
- Part numbers are for housings and the equivalent number of contacts.
- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50.
- Spare contacts are available – see page 65.



WITHOUT JACKSCREWS	WITH JACKSCREWS										
CALCULATION <table border="1"> <tr> <td>A</td> <td>B + 12</td> </tr> <tr> <td>B</td> <td>Total no. of contacts - 2</td> </tr> <tr> <td>C</td> <td>B + 7</td> </tr> </table>	A	B + 12	B	Total no. of contacts - 2	C	B + 7					
A	B + 12										
B	Total no. of contacts - 2										
C	B + 7										
TOOLS <p>Recommended Crimp Tool – M22520/2-01 Positioner – Z80-193 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ▪ Instruction sheets available at www.harwin.com/downloads/instructions</p>	WIRE STRIPPING DETAILS										
HOW TO ORDER											
SERIES CODE M80	WALL SIZE <table border="1"> <tr> <td>BLANK</td> <td>Wall = 5mm</td> </tr> <tr> <td>A</td> <td>Wall = 1mm</td> </tr> </table>	BLANK	Wall = 5mm	A	Wall = 1mm						
BLANK	Wall = 5mm										
A	Wall = 1mm										
TYPE <table border="1"> <tr> <td>565</td> <td>Large Bore, with Jackscrews</td> <td>575</td> <td>Large Bore, without Jackscrews</td> </tr> <tr> <td>566</td> <td>Small Bore, with Jackscrews</td> <td>576</td> <td>Small Bore, without Jackscrews</td> </tr> </table>	565	Large Bore, with Jackscrews	575	Large Bore, without Jackscrews	566	Small Bore, with Jackscrews	576	Small Bore, without Jackscrews	FINISH <table border="1"> <tr> <td>05</td> <td>Gold </td> </tr> </table>	05	Gold
565	Large Bore, with Jackscrews	575	Large Bore, without Jackscrews								
566	Small Bore, with Jackscrews	576	Small Bore, without Jackscrews								
05	Gold										
	TOTAL NO. OF CONTACTS <table border="1"> <tr> <td>06, 10, 14, 20, 26, 34</td> </tr> </table>	06, 10, 14, 20, 26, 34									
06, 10, 14, 20, 26, 34											

All dimensions in mm.

Datamate Connectors




Datamate **J-Tek**

Male Crimp with Hood

- Supplied as a complete kit, including hood, screws, connector, contacts and Jackscrews.
- For spare crimp contacts, see page 65.
- Provides strain relief by preventing cable bending at the rear of the connector, and also the option of inserting a cable tie to reduce pull strain.
- Mates with female connectors shown on pages 38, 39, 41, 42, 44 and 46 to 50.



MALE

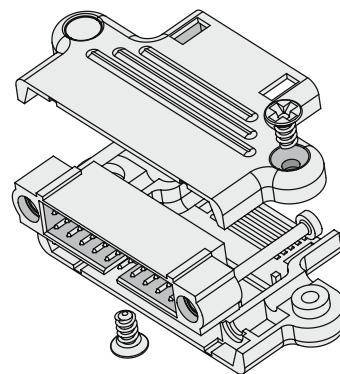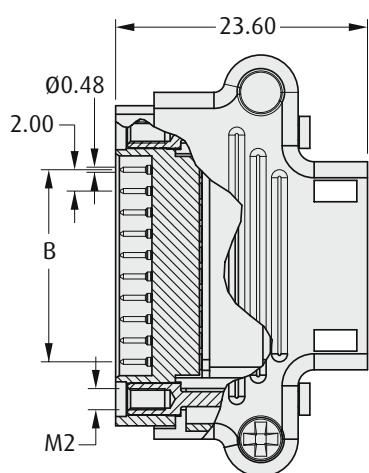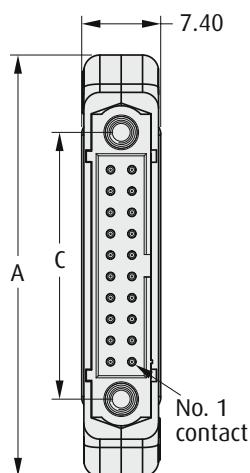

CALCULATION

A	B + 21.5
B	Total no. of contacts - 2
C	B + 7

TOOLS

Recommended Crimp Tool – M22520/2-01


Positioner – Z80-193

Contact Insertion/Removal Tool – Z80-280

See pages 87 to 89

► Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

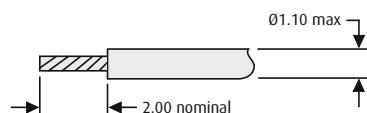

HOW TO ORDER

M80 - 94 X XX XX

SERIES CODE

TYPE

2 Small Bore 24-28AWG

3 Large Bore 22AWG

FINISH

05

Gold



TOTAL NO. OF CONTACTS

06, 08, 10, 12, 14, 20, 26, 34, 42, 50

All dimensions in mm.

Datamate Connectors

Datamate **J-Tek**


Male Crimp Contacts

- Crimp contacts are supplied with the connectors (pages 60 to 64) – use the order codes below for extra crimp contacts.
- For crimp and insertion tools, see pages 87 to 89.




SPARE CRIMP CONTACT


Large Bore (22 AWG):

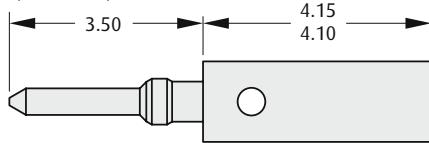

Wire Stripping Details

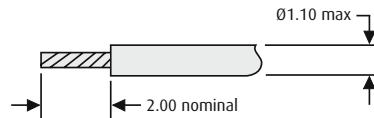

Small Bore (24 – 28 AWG):

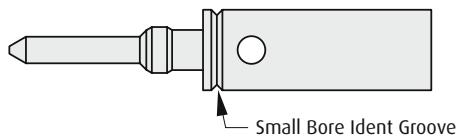

HOW TO ORDER

M80 - 19 X 00 XX

SERIES CODE

TYPE	
4	Large Bore for J-Tek
5	Small Bore for J-Tek

FINISH

05 Gold

All dimensions in mm.

Datamate Specification

Datamate **3-Row**

Materials

Mouldings:	Glass-filled thermoplastic UL94V-0
Female contacts:	Brass shell, with Beryllium Copper inner contact
Male contacts:	Phosphor bronze
Finish:	See individual pages

Electrical

Current (individual contacts in isolation):	3.3A max (at 25°C) 2.6A max (at 85°C)
All contacts simultaneously:	3.0A max (at 25°C) 2.2A max (at 85°C)
Working Voltage (at sea level 1013 mbar):	800V DC or ACrms
Proof Voltage (at sea level 1013 mbar):	1200V DC or ACrms
Contact resistance (initial):	20 mΩ max
Contact resistance (after conditioning):	25 mΩ max
Insulation resistance (initial):	1000 MΩ min
Insulation resistance (after conditioning):	100 MΩ min

Mechanical


Durability:	500 operations
Insertion force (max):	1.0N
Withdrawal force (min):	0.2N
Signal crimp accommodation:	22 AWG to 28 AWG BS 3G 210 Type A or MIL-DTL-16878/6 Type ET

Environmental

Environmental classification:	55/125/56 days at 95% RH
Operational temperature:	-55°C to +125°C
*Vibration sensitivity:	10Hz to 2000Hz, 0.75mm, 98m/s ² (10G), duration 6h
*Bump severity:	390m/s ² (40G), 4000 ±10 bumps
*Shock severity:	981m/s ² (100G) for 6ms
*Acceleration severity:	490m/s ² (50G)





* Tested with connectors with Jackscrews.

Pin Numbering

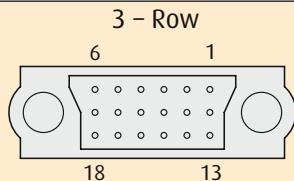

Contact numbering is shown looking onto mating face of male connector.


Mating Profiles

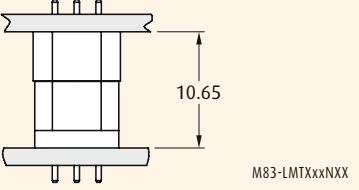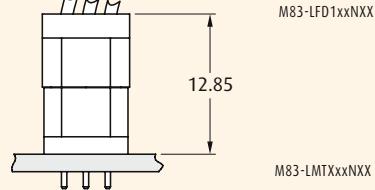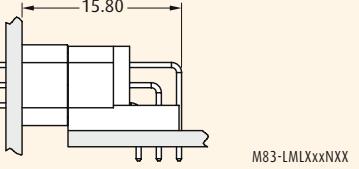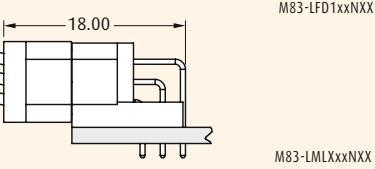FEMALE MALE	VERTICAL PC TAIL	CRIMP
VERTICAL PC TAIL	M83-LFTxxNXN 	M83-LFC1xxNXN 
HORIZONTAL PC TAIL	M83-LFTxxNXN 	M83-LFC1xxNXN 

All dimensions in mm.

Female Vertical PC Tail

- Low-force 4-finger Beryllium Copper contact clip.
- Fully shrouded contacts.
- Polarised mouldings.
- All contacts are gold finish for full RoHS compliance.
- Mates with male connectors shown on pages 69 and 70.

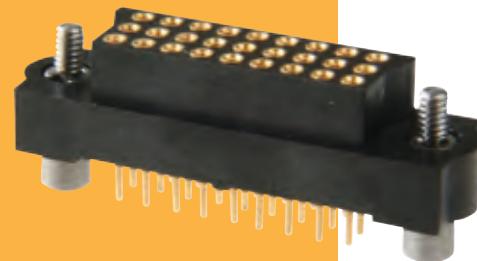

FEMALE VERTICAL		CALCULATION
		A B + 15
		B (Total no. of contacts - 3) x 2/3
		C B + 9
		Recommended PC Board Pattern
HOW TO ORDER		
M83 - LF T1 F2 N XX - 0000 - 000		
SERIES CODE		TOTAL NO. OF CONTACTS
TAIL		18, 27, 36, 54, 60, 96
T1 3mm Tail		JACKSCREW
	F2 Hex Socket Jackscrew	


All dimensions in mm.

M83 Datamate Connectors

Datamate **3-Row**

Female Crimp

- Part numbers are for a kit of housing and contacts.
- Spare contacts are available.
- Low-force 4-finger Beryllium Copper contact clip.
- Fully shrouded contacts, rear-insertable.
- Crimp instruction sheets & video available online at www.harwin.com.
- Mates with male connectors shown on pages 69 and 70.

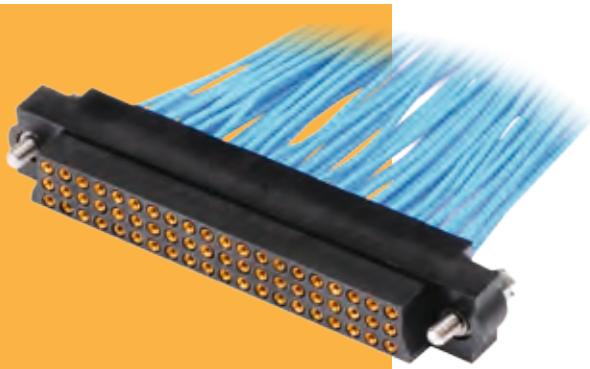

FEMALE CRIMP		CALCULATION			SPARE CONTACTS						
		A	B + 15								
		B	(Total no. of contacts - 3) x 2/3								
		C	B + 9								
WIRE SIZE		PART NUMBER									
22 AWG		M83-0110005									
24-28 AWG		M83-0130005									
TOOLS											
Recommended Crimp Tool – M22520/2-01 Positioner – T5747 Contact Insertion/Removal Tool – Z80-280 See pages 87 to 89 ► Instruction sheets available at www.harwin.com/downloads/instructions											
WIRE STRIPPING DETAILS											
HOW TO ORDER											
M83 - LF X1 F2 N XX - 0000 - 000											
SERIES CODE C1 Small Bore (24-28 AWG) D1 Large Bore (22 AWG)				TOTAL NO. OF CONTACTS 18, 27, 36, 54, 60, 96							
				JACKSCREW F2 Hex Socket Jackscrew							


All dimensions in mm.

Datamate Connectors

Datamate **3-Row**

Male Vertical PC Tail





- Board Mount nuts to be tightened to a maximum torque of 23cmN.
- Fully shrouded contacts.
- Polarised mouldings.
- All contacts are gold finish for full RoHS compliance.
- Mates with female connectors shown on pages 67 and 68.

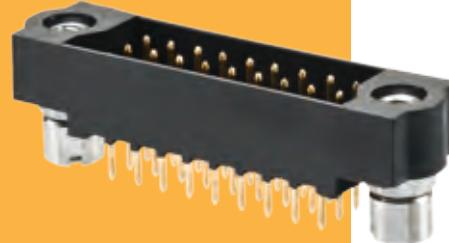

MALE VERTICAL

CALCULATION

A	B + 15
B	(Total no. of contacts - 3) x 2/3
C	B + 9

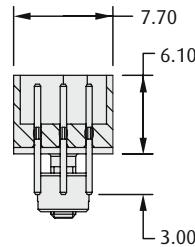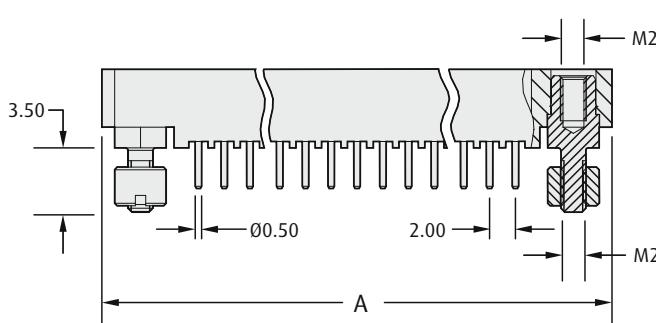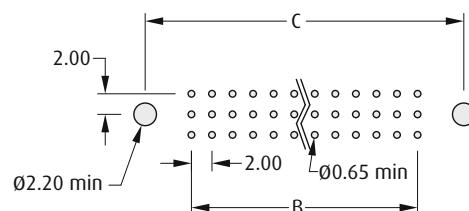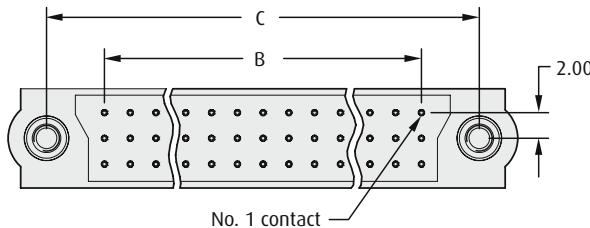

HOW TO ORDER

M83 - LM T1 M2 N XX - 0000 - 000

SERIES CODE

TAIL

T1 3mm Tail

TOTAL NO. OF CONTACTS

18, 27, 36, 54, 60, 96


JACKSCREW

M2 Board Mount Jackscrew

All dimensions in mm.

Male Horizontal PC Tail

- Board Mount screws to be tightened to a maximum torque of 23cmN.
- Suitable for motherboard/daughterboard configurations.
- Fully shrouded contacts, polarised mouldings.
- All contacts are gold finish for full RoHS compliance.
- Mates with female connectors shown on pages 67 and 68.

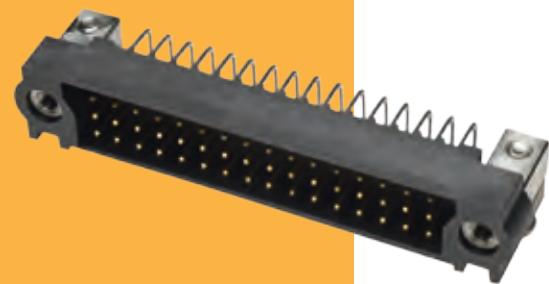

MALE HORIZONTAL		CALCULATION						
		<table border="1"> <tr> <td>A</td><td>B + 15</td></tr> <tr> <td>B</td><td>(Total no. of contacts - 3) x 2/3</td></tr> <tr> <td>C</td><td>B + 9</td></tr> </table>	A	B + 15	B	(Total no. of contacts - 3) x 2/3	C	B + 9
A	B + 15							
B	(Total no. of contacts - 3) x 2/3							
C	B + 9							
Recommended PC Board Pattern								
HOW TO ORDER								
M83 - LM L3 M7 N XX - 0000 - 000								
SERIES CODE	L3	TOTAL NO. OF CONTACTS						
TAIL	4mm Tail	18, 27, 36, 54, 60, 96						
JACKSCREW	M7	Hex Socket Board Mount						

All dimensions in mm.

Features and Benefits

- Shielded High-Reliability connectors, for I/O and cable-to-board applications.
- Performs to the same high standards as the existing Datamate range, but with the added facility of complete shielding for cable-to-panel and PCB applications where EMI and RFI screening is required.
- Tested in accordance with MIL-STD-1377.
- 30dBs attenuation.
- Nickel-plated aluminium alloy construction, 360° attachment to braid.

Typical Applications

- | | | |
|--------------------------|-------------------|----------------------|
| ► Avionic Systems | ► Control Systems | ► Space Applications |
| ► Communications Systems | ► Radar Equipment | ► Life Sciences |

Specifications

► Materials

Mouldings:	Glass-filled thermoplastic UL94V-0
Female contacts:	Brass shell, with Beryllium Copper inner contact
Male contacts:	Copper alloy
Finish:	See individual pages

► Electrical

RF Attenuation:	10kHz to 400MHz @ >30dBs
Current (individual contacts in isolation):	3.3A max (at 25°C) 2.6A max (at 85°C)
All contacts simultaneously:	3.0A max (at 25°C) 2.2A max (at 85°C)
Working Voltage (at sea level 1013 mbar):	800V DC or ACrms
Voltage Proof (at sea level 1013 mbar):	1,200V DC or ACrms
Contact resistance (initial):	20 mΩ max
Contact resistance (after conditioning):	25 mΩ max
Insulation resistance (initial):	1,000 MΩ min
Insulation resistance (after conditioning):	100 MΩ min

Mechanical

Durability:	500 operations
Insertion force (max):	2.8N
Withdrawal force (min):	0.2N
Signal crimp accommodation:	22 A.W.G. to 28 A.W.G. BS 3G 210 Type A, MIL-W-16878

► Environmental


Environmental classification:	55/125/56 days at 95% RH
Operational temperature:	-55°C to +125°C
*Vibration sensitivity:	10Hz to 2000Hz, 0.75mm, 98m/s ² (10G). duration 6h
*Bump severity:	390m/s ² (40G), 4000 ±10 bumps
*Shock severity:	981m/s ² (100G) for 6ms
*Acceleration severity:	490m/s ² (50G)

* Tested with connectors with Jackscrews.

All preferred sizes of this range are held in stock.
Check www.harwin.com for availability.

See page 35 for Pin Numbering

Mating Profiles

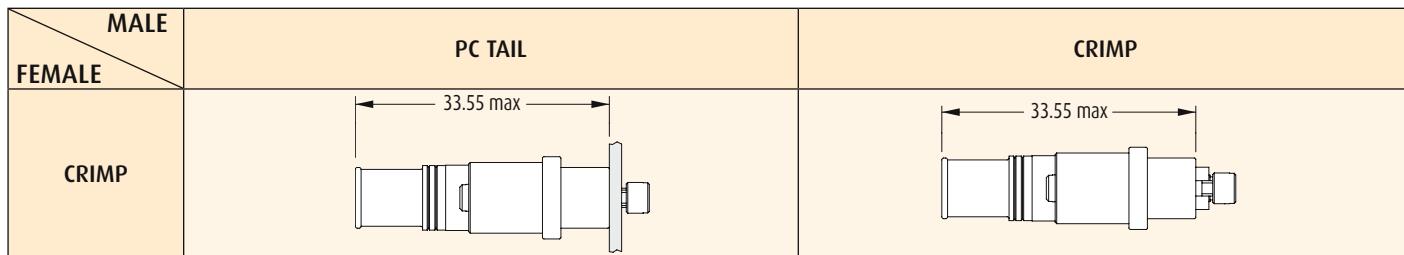

All dimensions in mm.

Datamate Connectors

Datamate **S-Tek**



Female Crimp with Metal Backshell

A range of shielded Datamate connectors, performing to the same high-reliability standards, with the added feature of aluminium backshells compatible with full 360° securing to braiding.

- Supplied as a kit, including backshell, tie-band (not shown), e-clips, Jackscrews, connector housing and contacts (braiding not included).
- For spare crimp contacts, see page 51.
- Mates with male connectors shown on pages 73 and 74.



FEMALE

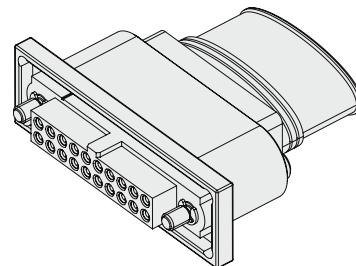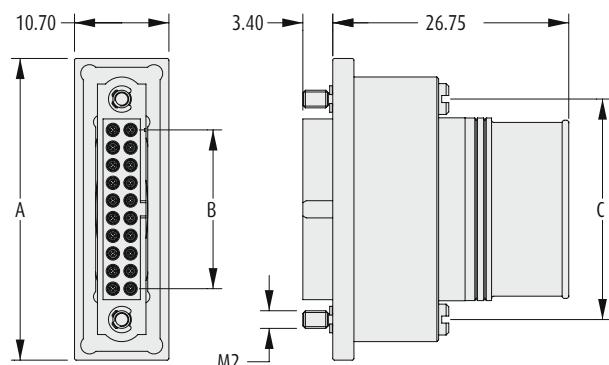

TOOLS

Recommended Crimp Tool – M22520/2-01
Positioner – T5747

Contact Insertion/Removal Tool – Z80-280
E-Clip Assembly Tool – Z80-300


See pages 87 to 89

Instruction sheets available at www.harwin.com/downloads/instructions

CALCULATION

A	B + 16.20
B	Total no. of contacts - 2
C	B + 7

WIRE STRIPPING DETAILS

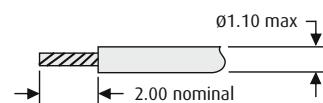

HOW TO ORDER

M80 - 4 X1 XX XX S1

SERIES CODE

TYPE

C1	Small Bore 24-28 AWG
D1	Large Bore 22 AWG

FINISH

05	Gold	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

06, 10, 14, 20, 26


All dimensions in mm.

Datamate Connectors

Datamate **S-Tek**

Male Vertical PC Tail with Metal Backshell

- Board Mount version, with Jackscrew fixings for attachment to PCB for added strain relief.
- Supplied as a complete kit, including backshell, jackscrew nuts, and connector with Jackscrew studs assembled.
- Mates with female connectors shown on page 72.

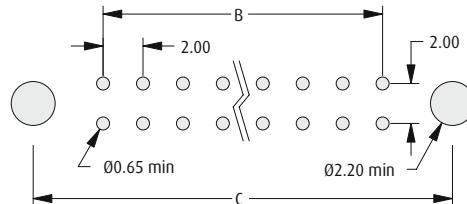


Recommended PC Board Pattern


CALCULATION

A	$B + 13.40$
B	Total no. of contacts - 2
C	$B + 7$

2.7mm TAIL

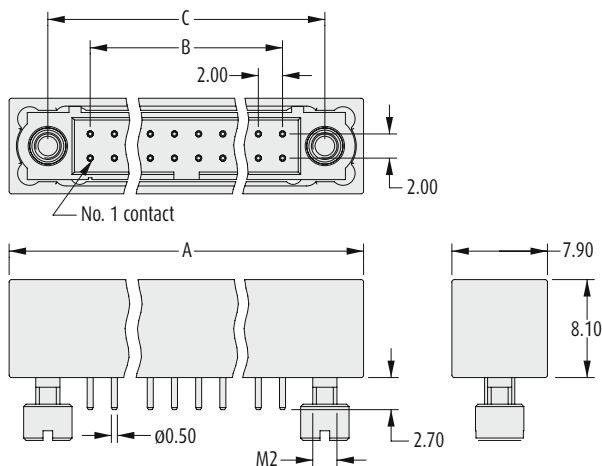

3.8mm TAIL

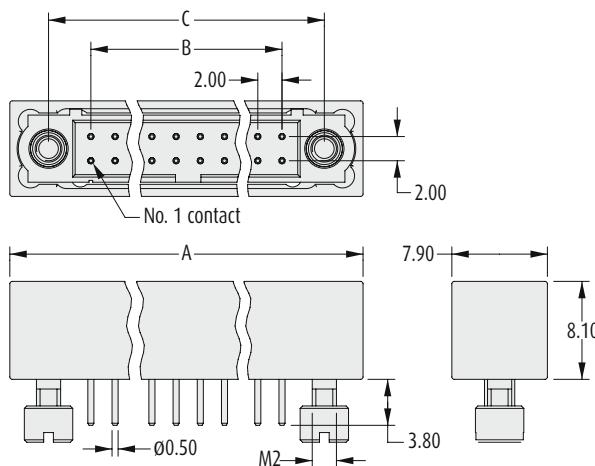

HOW TO ORDER

M80 - 5 TX XX XX B1

SERIES CODE

TYPE

T1 2.7mm Tails

T2 3.8mm Tails

FINISH

05	Gold	
22	Gold + Tin/Lead	
42	Gold + Tin	

TOTAL NO. OF CONTACTS

06, 10, 14, 20, 26



All dimensions in mm.

Datamate Connectors

Datamate **S-Tek**

Male Crimp with Metal Backshell


- Panel mount version, with Jackscrew fixings for attachment to panels.
- Supplied as a complete kit, including backshell, contacts, Jackscrew nuts, and connector housing with jackscrew studs assembled.
- For spare crimp contacts, see page 65.
- Mates with female connectors shown on page 72.

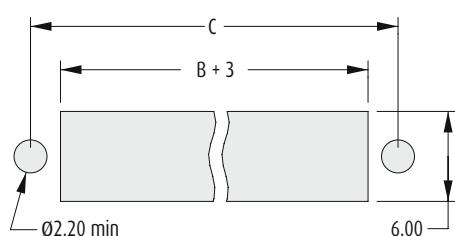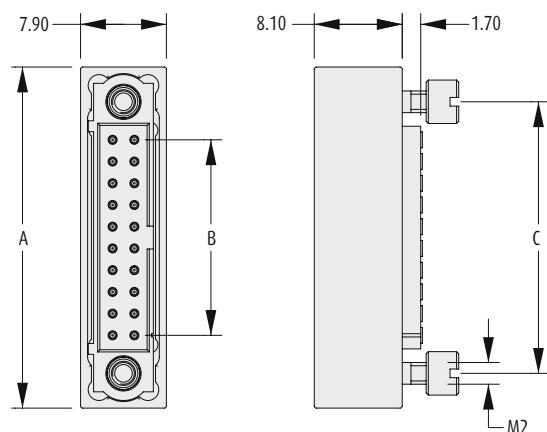

Recommended Panel Cutout

CALCULATION

A	B + 13.40
B	Total no. of contacts - 2
C	B + 7

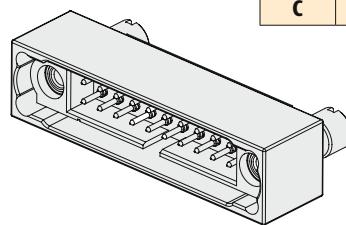

TOOLS


Recommended Crimp Tool – M22520/2-01
Positioner – Z80-193

Contact Insertion/Removal Tool – Z80-280

See pages 87 to 89

▪ Instruction sheets available at www.harwin.com/downloads/instructions

WIRE STRIPPING DETAILS

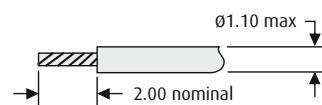

HOW TO ORDER

M80 - 5 X1 XX 05 B1

SERIES CODE	
TYPE	
C1	Small Bore 24-28 AWG

D1	Large Bore 22 AWG
----	-------------------

FINISH	
05	Gold

TOTAL NO. OF CONTACTS	
06, 10, 14, 20, 26	

All dimensions in mm.

Datamate Specification

Datamate **Mix - Tek**

► Materials

Mouldings:	Glass-filled thermoplastic UL94V-0
Female contacts:	Brass shell, with Beryllium Copper inner contact
Male contacts:	Copper alloy
Finish:	See individual pages

► Electrical

Current (individual contacts in isolation):	3.3A max (at 25°C) 2.6A max (at 85°C)
All contacts simultaneously:	3.0A max (at 25°C) 2.2A max (at 85°C)
Working Voltage (at sea level 1013 mbar):	800V DC or ACrms
Voltage Proof (at sea level 1013 mbar):	1,200V DC or ACrms
Contact resistance (initial):	20 mΩ max
Contact resistance (after conditioning):	25 mΩ max
Insulation resistance (initial):	1,000 MΩ min
Insulation resistance (after conditioning):	100 MΩ min

► Mechanical

Durability:	500 operations
Insertion force (max):	2.8N
Withdrawal force (min):	0.2N
Signal crimp accommodation:	22 AWG to 28 AWG BS 3G 210 Type A

► Environmental

Environmental classification:	55/125/56 days at 95% RH
Operational temperature:	-55°C to +125°C
*Vibration sensitivity:	10Hz to 2000Hz, 0.75mm, 98m/s² (10G), duration 6h
*Bump severity:	390m/s² (40G), 4000 ±10 bumps
*Shock severity:	981m/s² (100G) for 6ms
*Acceleration severity:	490m/s² (50G)

* Tested with connectors with Jackscrews.

All preferred sizes of this range are held in stock.
Check www.harwin.com for availability.

DATAMATE MIX-Tek

Power Contacts

► Materials

Latching collar:	Beryllium Copper, nickel plated
Other metallic parts:	Copper alloy, Gold plated

► Electrical

Current (contact only):	20A max
Contact resistance:	6 mΩ max

► Mechanical

Insertion force (max):	8N
Withdrawal force (min):	0.5N
Contact replacement in connector:	5 times
Power contact accommodation:	12 to 20 AWG

Coax Contacts

► Materials

Latching collar:	Beryllium Copper, nickel plated
Other metallic parts:	Copper alloy, Gold plated
Insulator:	PTFE

► Electrical

Frequency range:	6 GHz (depending on cable)
Impedance:	50Ω
VSWR:	1.05 + (0.04 x Frequency) GHz max
Operating voltage (sea level):	180 V AC at 500 mA
Maximum voltage (sea level):	1000 V ACrms
Contact resistance:	6 mΩ max
Insulation resistance:	10 ⁶ MΩ at 250 V ACrms




► Mechanical

Insertion force (max):	8N
Withdrawal force (min):	0.5N
Contact replacement in connector:	5 times

Datamate Connectors






















Datamate **Mix - Tek**
OFF THE SHELF

DATAMATE MIX-TEK

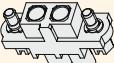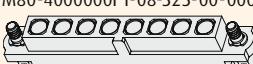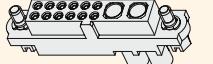	FEMALE CABLE	MALE HORIZONTAL PC TAIL
	HEXAGONAL SLOTTED JACKSCREW	JACKSCREW WITH 5mm BOARD-MOUNT
CONTACT ARRANGEMENT	2 Power	M80-4000000F1-02-325-00-000 
	4 Power	M80-4000000F1-04-325-00-000 
	6 Power	M80-4000000F1-06-325-00-000 
	8 Power	M80-4000000F1-08-325-00-000 
	10 Power	M80-4000000F1-10-325-00-000 
	2 Signal, 2 Power	M80-4C10205F1-02-325-00-000 
	2 Signal, 4 Power	M80-4C10205F1-04-325-00-000 
	4 Signal, 2 Power	M80-4C10405F1-02-325-00-000 
	4 Signal, 4 Power	M80-4C10405F1-04-325-00-000 
	6 Signal, 2 Power	M80-4C10605F1-02-325-00-000 
	6 Signal, 4 Power	M80-4C10605F1-04-325-00-000 
	8 Signal, 2 Power	M80-4C10805F1-02-325-00-000 
	8 Signal, 4 Power	M80-4C10805F1-04-325-00-000 
	12 Signal, 2 Power	M80-4C11205F1-02-325-00-000 
	12 Signal, 4 Power	M80-4C11205F1-04-325-00-000 







Datamate Connectors

Datamate **Mix - Tek**
OFF THE SHELF

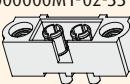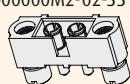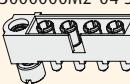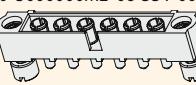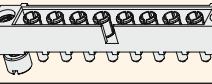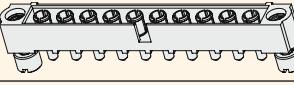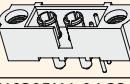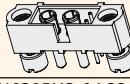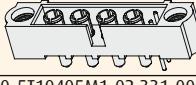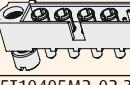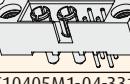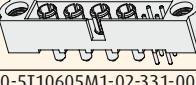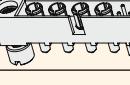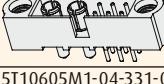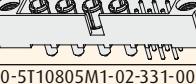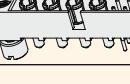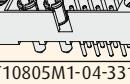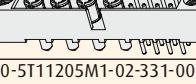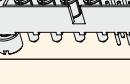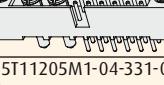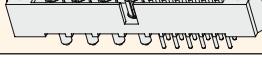	MALE VERTICAL PC TAIL		
	JACKSCREW ONLY	JACKSCREW WITH 3.5mm BOARD-MOUNT	JACKSCREW WITH 5mm BOARD-MOUNT
CONTACT ARRANGEMENT	2 Power	M80-5000000M1-02-331-00-000 	M80-5000000M2-02-331-00-000 
	4 Power	M80-5000000M1-04-331-00-000 	M80-5000000M2-04-331-00-000 
	6 Power		M80-5000000M2-06-331-00-000 
	8 Power		M80-5000000M2-08-331-00-000 
	10 Power		M80-5000000M2-10-331-00-000 
	2 Signal, 2 Power	M80-5T10205M1-02-331-00-000 	M80-5T10205M2-02-331-00-000 
	2 Signal, 4 Power	M80-5T10205M1-04-331-00-000 	M80-5T10205M2-04-331-00-000 
	4 Signal, 2 Power	M80-5T10405M1-02-331-00-000 	M80-5T10405M2-02-331-00-000 
	4 Signal, 4 Power	M80-5T10405M1-04-331-00-000 	M80-5T10405M2-04-331-00-000 
	6 Signal, 2 Power	M80-5T10605M1-02-331-00-000 	
	6 Signal, 4 Power	M80-5T10605M1-04-331-00-000 	M80-5T10605M2-04-331-00-000 
	8 Signal, 2 Power	M80-5T10805M1-02-331-00-000 	
	8 Signal, 4 Power	M80-5T10805M1-04-331-00-000 	M80-5T10805M2-04-331-00-000 
	12 Signal, 2 Power	M80-5T11205M1-02-331-00-000 	
	12 Signal, 4 Power	M80-5T11205M1-04-331-00-000 	





Mating Profiles

Datamate **Mix - Tek**
OFF THE SHELF

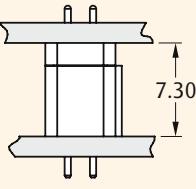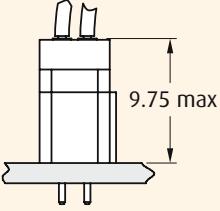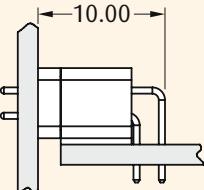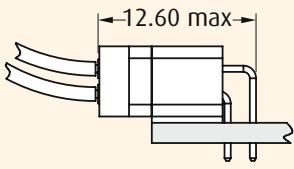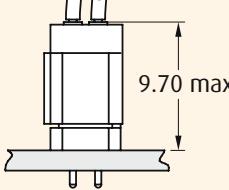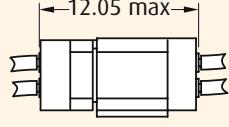FEMALE MALE	VERTICAL PC TAIL	CRIMP
VERTICAL PC TAIL		
HORIZONTAL PC TAIL		
CRIMP		

All dimensions in mm.

Pin Numbering

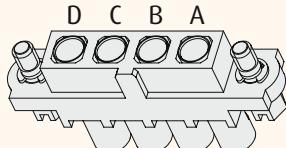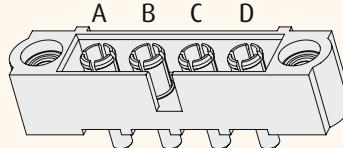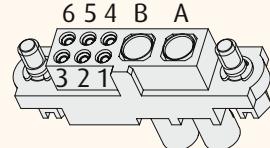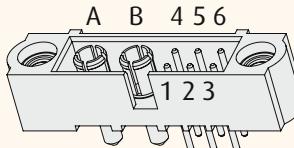FEMALE	MALE
	
	

Datamate Connectors

Datamate **Mix - Tek**
OFF THE SHELF

Female Off-The-Shelf

A selection of stocked, female crimp, Datamate Mix-Tek standard layouts.

- Hexagonal slotted jackscrew style.
- Crimp tooling on pages 87 to 89.
- Polarised mouldings.
- Power contacts rated to 20A, signal to 3A.
- Mates with connectors on pages 80 and 81.



POWER CONTACTS ONLY		CALCULATION	
		A	B + 14
		B	(No. of Power contacts - 1) x 4
		C	B + 9
HOW TO ORDER			
M80 - 4000000F1 - XX - 325 - 00 - 000		Refer to page 76 for stocked sizes.	
		NO. OF POWER CONTACTS	
02, 04, 06, 08, 10			
SIGNAL AND POWER CONTACTS		CALCULATION	
		A	B + 13
		B	(No. of Power contacts - 1) x 4 + Total no. of Signal contacts +1
		C	B + 8
HOW TO ORDER			
M80 - 4C1 XX 05F1 - XX - 325 - 00 - 000		Refer to page 76 for stocked sizes.	
NO. OF SIGNAL CONTACTS		NO. OF POWER CONTACTS	
02, 04, 06, 08, 12		02, 04	

All dimensions in mm.

Datamate Connectors

Datamate **Mix - Tek**
OFF THE SHELF

Male Vertical Off-The-Shelf

- A selection of stocked Datamate Mix-Tek solder tail standard layouts.
- Choice to suit two PCB thicknesses and two stud lengths.
- Mates with connectors shown on page 79.



POWER CONTACTS ONLY		CALCULATION			
JACKSCREW		A	B + 14		
M1	Jackscrew only	B	(No. of Power contacts - 1) x 4		
M2	With 3.5mm Board Mount stud	C	B + 9		
M3	With 5mm Board Mount stud	Recommended PC Board Pattern			
HOW TO ORDER					
M80 - 5000000 XX - XX - XXX - 00 - 000					
JACKSCREW		Refer to page 77 for stocked sizes.			
M1	Jackscrew only	POWER CONTACT PART NO.			
M2	With 3.5mm Board Mount stud	331	3.5mm Tail		
M3	With 5mm Board Mount stud	332	5 mm Tail		
SIGNAL AND POWER CONTACTS		CALCULATION			
NO. OF SIGNAL CONTACTS		A	B + 13		
02, 04, 06, 08, 12		B	(No. of Power contacts - 1) x 4+ Total no. of Signal contacts +1		
NO. OF POWER CONTACTS		C	B + 8		
02, 04, 06, 08, 10		Recommended PC Board Pattern			
HOW TO ORDER					
M80 - 5T1 XX 05 XX - XX - 331 - 00 - 000					
NO. OF SIGNAL CONTACTS		Refer to page 77 for stocked sizes.			
02, 04, 06, 08, 12		NO. OF POWER CONTACTS			
		02, 04			

All dimensions in mm.

Datamate Connectors

Datamate **Mix - Tek**
OFF THE SHELF

Male Horizontal Off-The-Shelf

- A selection of stocked Datamate Mix-Tek solder tail standard layouts.
- Choice to suit two PCB thicknesses and two stud lengths.
- Mates with connectors shown on page 79.



POWER CONTACTS ONLY		CALCULATION						
		<table border="1"> <tr> <td>A</td><td>$B + 14$</td></tr> <tr> <td>B</td><td>(No. of Power contacts - 1) x 4</td></tr> <tr> <td>C</td><td>$B + 9$</td></tr> </table>	A	$B + 14$	B	(No. of Power contacts - 1) x 4	C	$B + 9$
A	$B + 14$							
B	(No. of Power contacts - 1) x 4							
C	$B + 9$							
		Recommended PC Board Pattern						
HOW TO ORDER								
M80 - 5000000 M5 - XX - 333 - 00 - 000								
Refer to page 76 for stocked sizes.								
NO. OF POWER CONTACTS		NO. OF SIGNAL CONTACTS						
02, 04, 06, 08, 10		02, 04						
SIGNAL AND POWER CONTACTS		CALCULATION						
		<table border="1"> <tr> <td>A</td><td>$B + 13$</td></tr> <tr> <td>B</td><td>(No. of Power contacts - 1) x 4 + Total no. of Signal contacts + 1</td></tr> <tr> <td>C</td><td>$B + 8$</td></tr> </table>	A	$B + 13$	B	(No. of Power contacts - 1) x 4 + Total no. of Signal contacts + 1	C	$B + 8$
A	$B + 13$							
B	(No. of Power contacts - 1) x 4 + Total no. of Signal contacts + 1							
C	$B + 8$							
		Recommended PC Board Pattern						
HOW TO ORDER								
M80 - 5L1 04 05 M5 - XX - 333 - 00 - 000								
Refer to page 76 for stocked sizes.								
NO. OF SIGNAL CONTACTS		NO. OF POWER CONTACTS						
04		02, 04						


All dimensions in mm.

Datamate Connectors

Datamate **Mix - Tek**

If you are unable to specify the connectors you require from our Off-The-Shelf range of Datamate Mix-Tek (pages 76 to 81), then customise your own Mix-Tek part number.

All items in this range are made-to-order, and may be subject to minimum order quantities and current availability conditions.

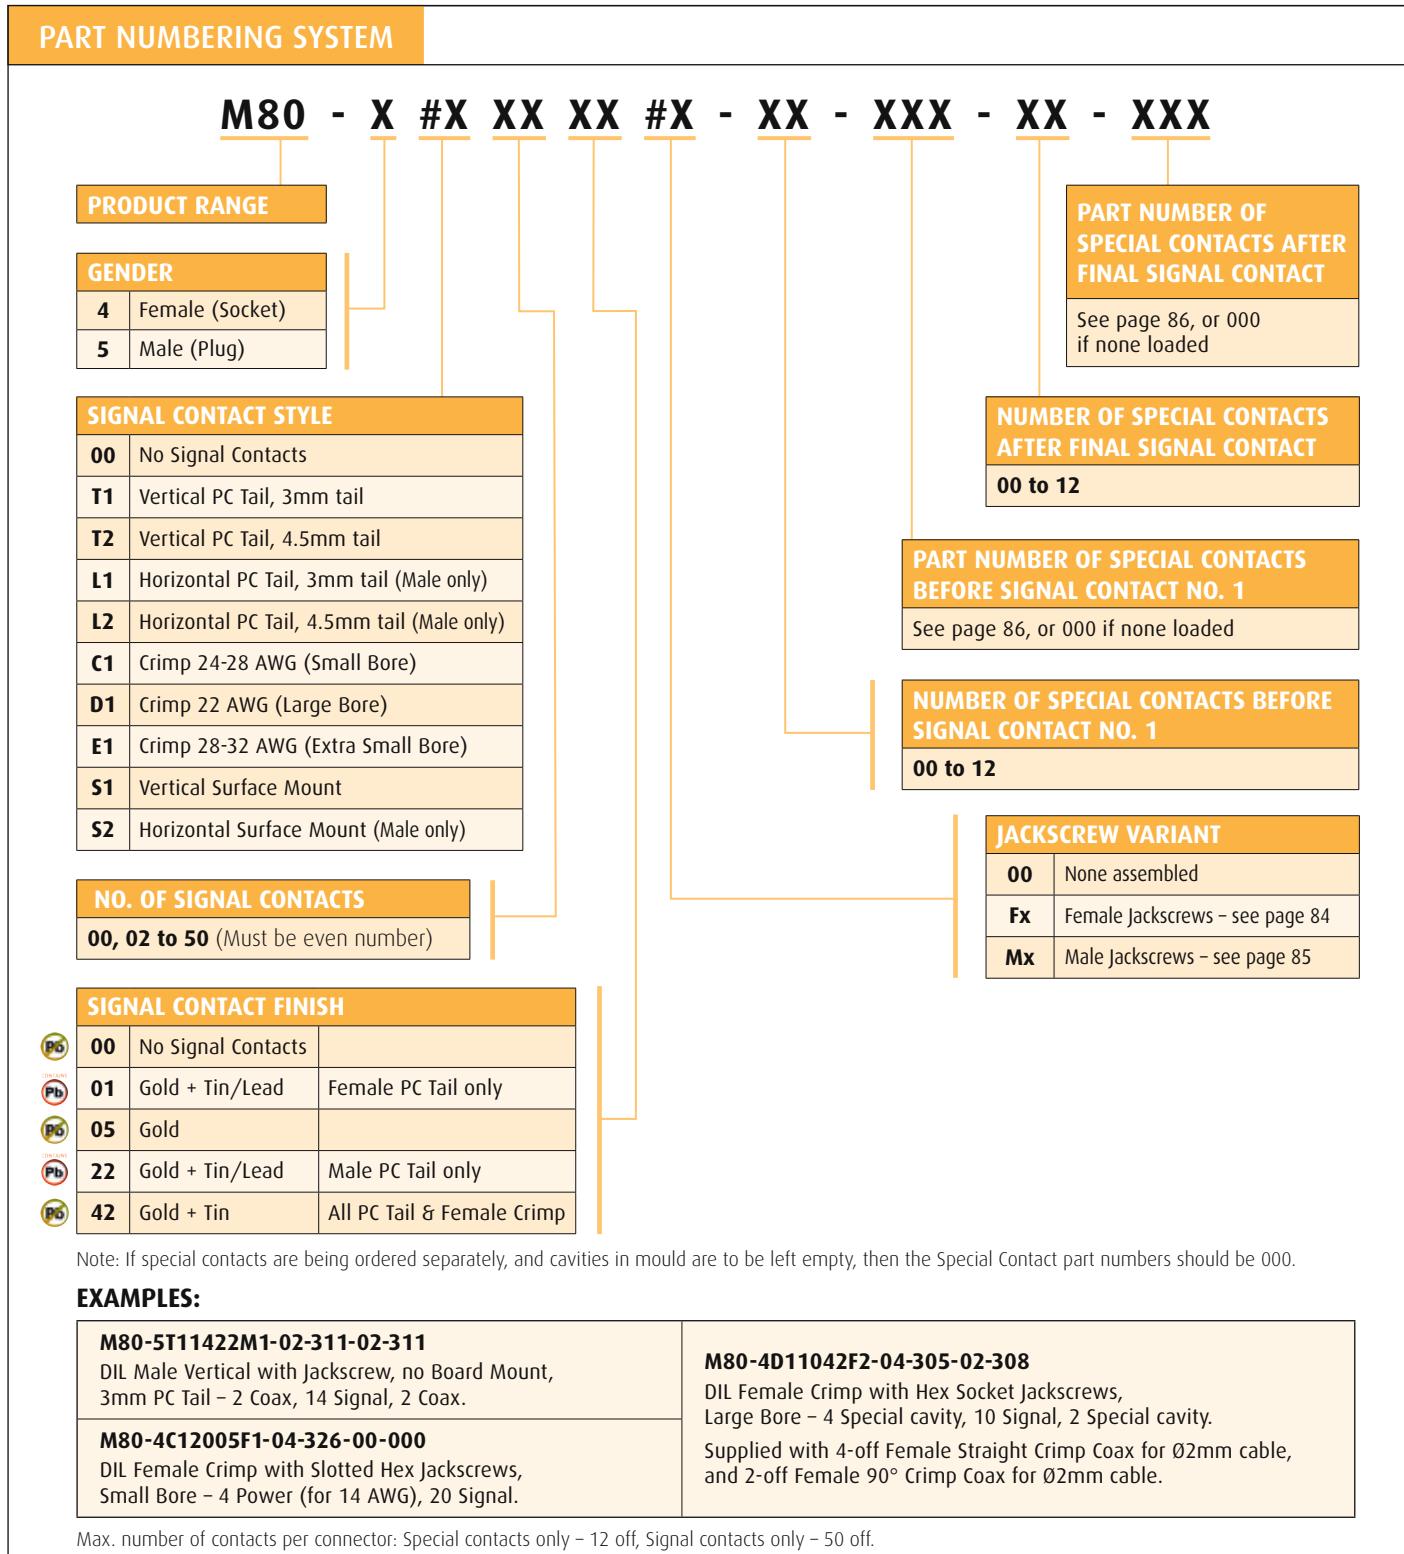

Note: If special contacts are being ordered separately, and cavities in mould are to be left empty, then the Special Contact part numbers should be 000.

EXAMPLES:

M80-5T11422M1-02-311-02-311

DIL Male Vertical with Jackscrew, no Board Mount,
3mm PC Tail – 2 Coax, 14 Signal, 2 Coax.

M80-4C12005F1-04-326-00-000

DIL Female Crimp with Slotted Hex Jackscrews,
Small Bore – 4 Power (for 14 AWG), 20 Signal.

M80-4D11042F2-04-305-02-308

DIL Female Crimp with Hex Socket Jackscrews,
Large Bore – 4 Special cavity, 10 Signal, 2 Special cavity.

Supplied with 4-off Female Straight Crimp Coax for Ø2mm cable,
and 2-off Female 90° Crimp Coax for Ø2mm cable.

Max. number of contacts per connector: Special contacts only – 12 off, Signal contacts only – 50 off.

All dimensions in mm.

Datamate Connectors

Datamate **Mix - Tek**


Spare Signal Crimp Contacts

- Crimp contacts are supplied with all Mix-Tek connectors – use the order codes below for extra crimp contacts.
- For crimp and insertion tools, see pages 87 to 89.




FEMALE


Large Bore (22 AWG):

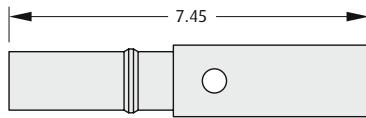


Small Bore (24 – 28 AWG):

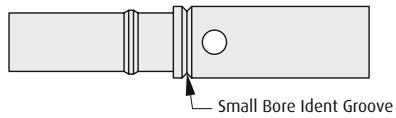

Extra Small Bore (28 – 32 AWG):

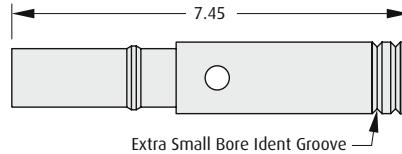


Wire Stripping Details

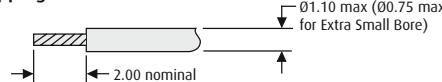


MALE


Large Bore (22 AWG):

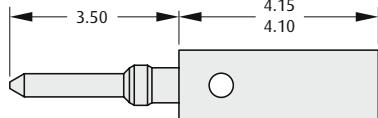

Small Bore (24 – 28 AWG):

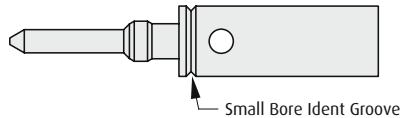

Wire Stripping Details

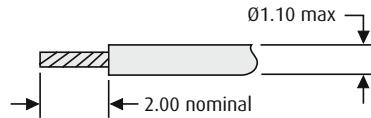

HOW TO ORDER

M80 - XXX 00 XX

SERIES CODE

FINISH











01	Gold + Tin (Female only)	
05	Gold	

TYPE

011	Female Large Bore (22 AWG)	194	Male Large Bore (22 AWG)
013	Female Small Bore (24-28 AWG)	195	Male Small Bore (24-28 AWG)
019	Female Extra Small Bore (28-32 AWG)		

All dimensions in mm.














Datamate – Jackscrews Female

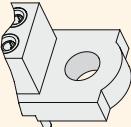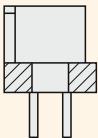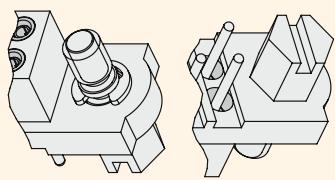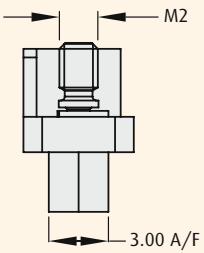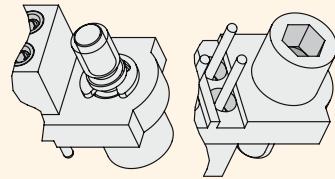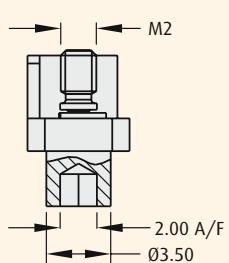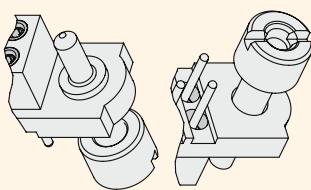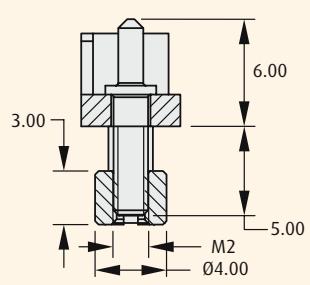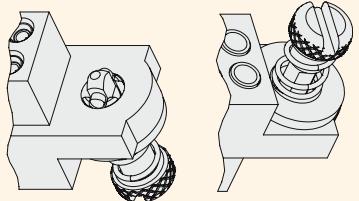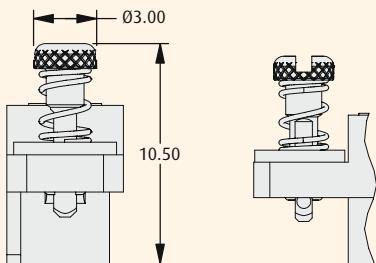00			None assembled
F1			Hexagonal Slotted Jackscrew (floating)
F2			Hexagonal Socket Jackscrew (floating)
F3			Guide Pin Jackscrew with Panel Mount
FC			101 Lok Jackscrew

Datamate – Jackscrews Male

00			None assembled
M1			Jackscrew nut only
M2 or M3			Jackscrew with Vertical Board Mount, slotted nut M2 = 3.50mm stud length M3 = 5.00mm stud length
M5 or M7			Jackscrew with Horizontal Board Mount, 5mm bolt length M5 = Slotted bolt M7 = Hex Socket bolt
MC			Jackscrew Retainer

Datamate – Special Contacts

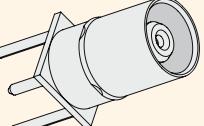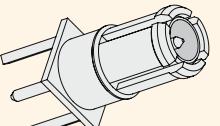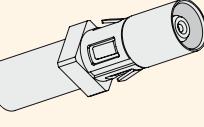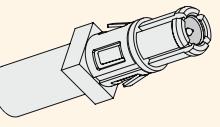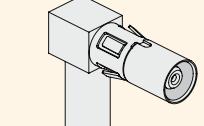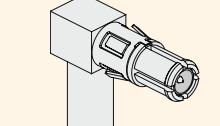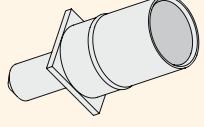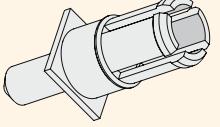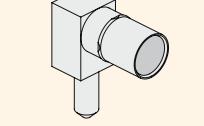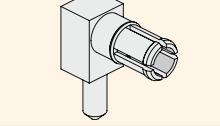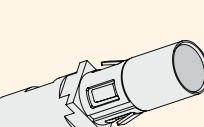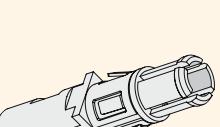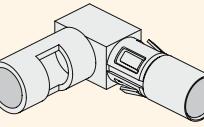COAX		
	FEMALE	MALE
301 or 302	 <p>Vertical PC Tail 301 = 3.00mm tail 302 = 4.50mm tail</p>	 <p>Vertical PC Tail 311 = 3.00mm tail 312 = 4.50mm tail</p>
305 306 307	 <p>Straight Crimp 305 = Ø2.00mm cable 306 = Ø2.40mm cable 307 = Ø2.70mm cable</p>	 <p>Straight Crimp 315 = Ø2.00mm cable 316 = Ø2.40mm cable 317 = Ø2.70mm cable</p>
308 or 309	 <p>90° Crimp 308 = Ø2.00mm cable 309 = Ø2.70mm cable</p>	 <p>90° Crimp 318 = Ø2.00mm cable 319 = Ø2.70mm cable</p>
POWER		
	FEMALE	MALE
321 or 322	 <p>Vertical PC Tail 321 = 3.50mm tail 322 = 5.00mm tail</p>	 <p>Vertical PC Tail 331 = 3.50mm tail 332 = 5.00mm tail</p>
323 or 324	 <p>Horizontal PC Tail 323 = 3.50mm tail 324 = 5.00mm tail</p>	 <p>Horizontal PC Tail 333 = 3.50mm tail 334 = 5.00mm tail</p>
325 326 327 328 329	 <p>Straight Solder 325 = 12 AWG cable 326 = 14 AWG cable 327 = 16 AWG cable Straight Crimp 328 = 18 AWG cable 329 = 20 AWG cable</p>	 <p>Straight Solder 335 = 12 AWG cable 336 = 14 AWG cable 337 = 16 AWG cable Straight Crimp 338 = 18 AWG cable 339 = 20 AWG cable</p>
32A 32B 32C	 <p>90° Solder 32A = 12 AWG cable 32B = 14 AWG cable 32C = 16 AWG cable</p>	

Datamate Tooling

Instruction sheets (where available) can be accessed at www.harwin.com/downloads/instructions

HAND CRIMP TOOL	HAND CRIMP TOOL
<ul style="list-style-type: none">► Standard circular crimp tool BS5210-3A-300 and MIL specification M22520/2-01.► Precision tool with ratchet mechanism and 8-indent form.► Must be used with applicable positioner shown below.► Instruction sheet available. 	<ul style="list-style-type: none">► Standard circular crimp tool.► Precision tool with ratchet mechanism and 8-indent form.► Must be used with applicable positioner shown below.► Instruction sheet available. 
ORDER CODE	ORDER CODE
Signal contacts, L-Tek, J-Tek & Mix-Tek	M22520/2-01
HAND CRIMP TOOL	POSITIONER
<ul style="list-style-type: none">► Standard coax crimp tool for crimping the outer sleeve of Mix-Tek coax contacts.► Instruction sheet available. 	<ul style="list-style-type: none">► Used with applicable hand crimp tool shown above. 
ORDER CODE	ORDER CODE
Outer sleeve of Mix-Tek coax contacts	Z80-293
	T5747
	Z80-193
	Z80-291

Datamate Tooling

Instruction sheets (where available) can be accessed at www.harwin.com/downloads/instructions

INSERTION/REMOVAL TOOL	REMOVAL TOOL
<ul style="list-style-type: none"> For inserting crimped contacts into the rear of mouldings. Instruction sheet available. Suitable for all Datamate signal Barrel crimp contacts. 	<ul style="list-style-type: none"> To aid removal of special cable contacts from Mix-Tek connectors. 
ORDER CODE Barrel Signal crimps for L-Tek, J-Tek & Mix-Tek Z80-280	ORDER CODE Mix-Tek special cable connectors Z80-290
SEPARATOR TOOL	SCREWDRIVER
<ul style="list-style-type: none"> Recommended for unplugging L-Tek latched connectors (tool releases the latches prior to disengagement). Can also be used with unlatched and friction lock connectors. Suitable for all sizes. 	<ul style="list-style-type: none"> Recommended for use on J-Tek board mount nuts. 
ORDER CODE L-Tek Z80-299	ORDER CODE J-Tek screwdriver Z80-298
E-CLIP TOOL	
	<ul style="list-style-type: none"> For assembling E-Clips supplied with J-Tek hooded connectors. 
	ORDER CODE J-Tek E-Clips Z80-300

Instruction sheets (where available) can be accessed at www.harwin.com/downloads/instructions

HAND CRIMP TOOL	REMOVAL TOOL
<ul style="list-style-type: none"> ► 'Rigidus' crimp tool design. ► Precision parallel action crimp tool with ratchet mechanism. ► Supplied with locator and die-set – spares available. ► Instruction sheet available.  <div style="background-color: #f0e68c; padding: 2px;"> ORDER CODE Z80-255 </div>	<ul style="list-style-type: none"> ► For removal of crimped contacts from mouldings. ► Instruction sheet available.  <div style="background-color: #f0e68c; padding: 2px;"> ORDER CODE Z80-258 </div>
 <div style="background-color: #f0e68c; padding: 2px;"> ORDER CODE Z80-244 </div>	 <div style="background-color: #f0e68c; padding: 2px;"> ORDER CODE Z80-259 </div>

Datamate Crimping

Datamate Signal Contacts: Barrel Crimps

Crimps and Tools

These instructions are applicable for the following crimp contacts:

- Female Crimp contacts **M80-01100XX, M80-01300XX, M80-01900XX, M83-01100XX, M83-01300XX**
- Male Crimp contacts **M80-04000XX, M80-04100XX, M80-19400XX, M80-19500XX**

The following tools are used (see pages 87 and 88):

- Hand Crimp Tool **M22520/2-01**
- Insertion/Removal Tool **Z80-280**
- Positioner **Z80-193** (for M80-19400XX or M80-19500XX) or **T5747** (for all others)

All tools are supplied with instruction sheets, which are available at www.harwin.com/downloads/instructions.

Before starting, assemble the positioner to the crimp tool (see the M22520/2-01 Instruction Sheet for details).

Crimping

- Check that your selected cable size is correct to the following table – Harwin recommend PTFE insulated equipment wire to BS 3G 210 Type A or MIL-W-16878:

Type	Wire gauge (AWG)	Typical Stranding	Crimp tool setting	Minimum pull-off force	Insulator diameter
Large Bore	22	19/0.15	6	50 Newtons	Ø1.10mm max
Small Bore	24	7/0.2	6	44 Newtons	
	26	7/0.15	6	25 Newtons	
	28	7/0.125	6	12.5 Newtons	
Extra Small Bore	28	7/0.12	5	12.5 Newtons	Ø0.75mm max
	30	7/0.25	4	7 Newtons	
	32	7/0.08	4	4 Newtons	

- Cut the end of the cable to give a clean cut end. Strip the end of the cable by $2.00 \pm 0.15\text{mm}$ using a PTFE wire stripper, ideally with an adjustable rotating cutter. This should result in a clean edge to the insulation, and all the strands laying together neatly. If the strands are disturbed, they can be re-aligned by putting a slight twist into the strand bundle.
- Assemble the contact onto the end of the cable – make sure all the strands are within the crimp body. The cable insulation should also go inside the crimp barrel – see Figure 1.
- Position the contact fully into the positioner, by inserting it clip-end first through the crimp tool jaws. Keep a small amount of pressure on the cable, to ensure it stays inserted in the crimp.
- Squeeze the handles of the crimp tool fully together, until the ratchet releases. The handles will then return to the open position. Remove the crimped wire, and check the following:
 - Evenness of crimp indentations, no fractures or rough edges around the crimp
 - No damage to the rest of the crimp or insulation
 - Regularly check a sample to ensure the minimum pull-off force is maintained

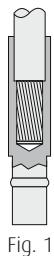


Fig. 1

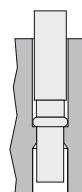


Fig. 2 – correct

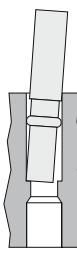


Fig. 3 – incorrect

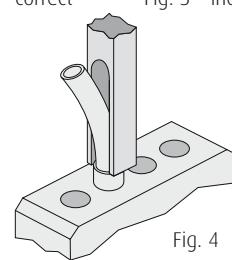


Fig. 4

Crimp Insertion

- Attach the correct tool piece to the handle of Z80-280 for inserting your cable size (check the instruction sheet for further advice).
- Place the crimped contact partially in the moulding – this should leave 1.5-2mm of crimp protruding from the moulding. It is important that the correct position is found (Figure 2), otherwise the retention shoulder inside the moulding will get removed when force is applied, and the crimp will not stay in the moulding (Figure 3).
- Support the face of the moulding on a solid surface (do not rest the connector on any fitted latches). Place the insertion tool around the wire and onto the back of the crimp (Figure 4). Push firmly – there will be an audible click when the socket is correctly seated.

Datamate Crimping

DATAMATE

Datamate Signal Contacts: Datamate Trio-Tek

Crimps and Tools

These instructions are applicable for the following crimp contacts:

- Female Crimp contacts **M80-25300XX, M80-25400XX, M80-28300XX, M80-28400XX** (Pages 25 and 51).

The following tools are used (see page 89):

- Hand Crimp Tool **Z80-255**
- Locator **Z80-259** (supplied with crimp tool)
- Removal Tool **Z80-258**

All tools are supplied with instruction sheets, which are available at www.harwin.com/downloads/instructions.

Crimping

- Check that your selected cable size is correct to the following table – Harwin recommend PTFE insulated equipment wire to BS 3G 210 Type A:

Type	Wire gauge (AWG)	Typical Stranding	Minimum pull-off force	Insulator diameter
M80-25300XX or M80-28300XX	22	19/0.15	45 Newtons	Ø1.10mm max
	24	7/0.2	29 Newtons	Ø0.95mm max
M80-25400XX or M80-28400XX	26	7/0.15	18 Newtons	Ø0.80mm max
	28	7/0.125	9.8 Newtons	Ø0.71mm max

- Cut the end of the cable to give a clean cut end. Strip the end of the cable by $2.75\pm0.25\text{mm}$ using a PTFE wire stripper, ideally with an adjustable rotating cutter. This should result in a clean edge to the insulation, and all the strands laying together neatly. If the strands are disturbed, they can be re-aligned by putting a slight twist into the strand bundle.
- Check the locator is assembled (see the Z80-255 Instruction Sheet for details). Ensure that the crimp tool is at the fully open position (Figure 1).
- Push the button on the back of the locator (Figure 2), which will move the locator forward between the crimp dies (Figure 3). Whilst holding the locator in the forward position, insert the crimp contact into the correct locator nest (Figure 4). The wire size is marked on the crimp die, above each location.

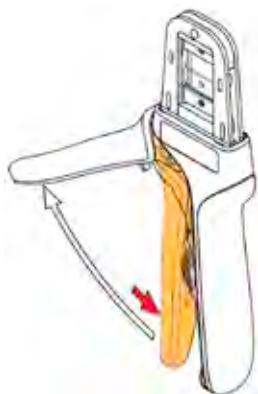


Fig. 1



Fig. 2



Fig. 3


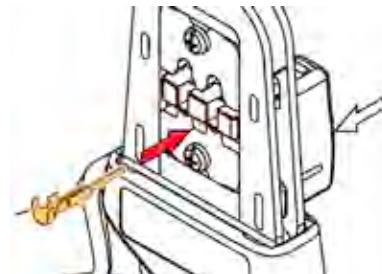


Fig. 4

Datamate Crimping

- Release the locator button, allowing the crimp contact to move back between the crimping jaws (Figure 5). Partially close the handle, until the second ratchet position engages (Figure 6). Load the stripped wire through the terminal, and against the wire stop inside the tool (Figure 7).

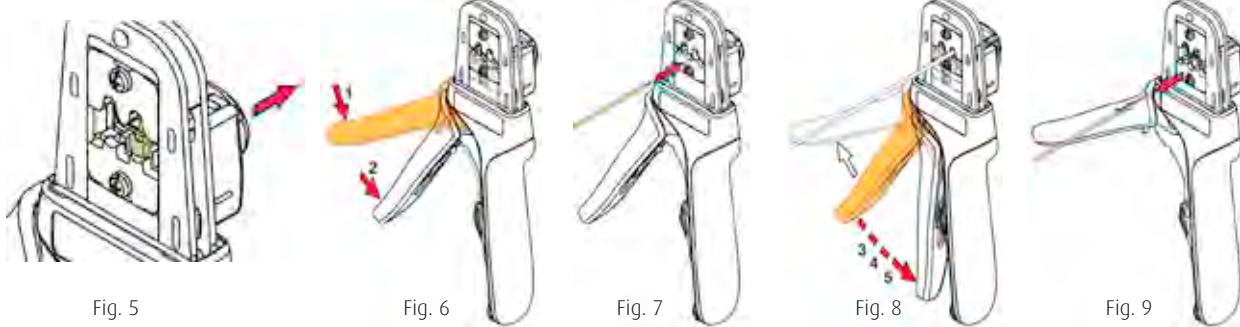

- Whilst holding the wire against the wire stop, complete the crimp by squeezing the tool handles together through the rest of the ratchet clicks – another 3, to make 5 in total (Figure 8). The handles should then be free to open. Remove the crimped wire (Figure 9).

Crimp Insertion

- The completed crimp can now be inserted into the appropriate Trio-Tek crimp housing. Crimps are assembled into the mould with the retaining tang towards the outer edge of the housing. With thinner wires, it may be helpful to push onto the back of the crimp with the Extraction Tool Z80-258. If it is necessary to remove a crimp once assembled, please refer to the instruction sheet for the Removal Tool Z80-258.

Datamate Coax Contacts: Datamate Mix-Tek

Crimps and Tools

These instructions are applicable for the following crimp contacts:

- Female Crimp Coax contacts: straight **M80-305, M80-306, M80-307** and 90° **M80-308, M80-309** (Page 86)
- Male Crimp Coax contacts: straight **M80-315, M80-316, M80-317** and 90° **M80-318, M80-319** (Page 86)

The following tools are used (see pages 87 and 88):

- Hand Crimp Tools **Z80-292, Z80-293**
- Positioner **Z80-291**
- Removal Tool **Z80-290**


Crimping Straight Coax Contacts

- Check that your selected cable size is correct to the following table:

Type	Cable size	Cable type	Correct Hex on tool Z80-293, for crimping sleeve	Correct setting on tool Z80-292, for crimping inner contact
M80-305, M80-315	Ø2.00mm	RG 178	Small Hex	4
M80-306	Ø2.40mm	PTFE Cellular	Small Hex	4
M80-307, M80-317	Ø2.70mm	RG 174, 179, 316	Large Hex	4 (M80-307), 6 (M80-317)

- Strip the cable to the appropriate dimensions for the part being crimped (as specified on the drawing). If the strands are disturbed, they can be re-aligned by putting a slight twist into the strand bundle.

- Identify the pieces of the coax connector to be assembled:

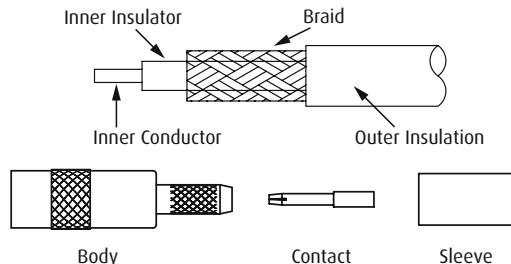


Datamate Crimping

- ▶ Slide the sleeve onto the cable, past the stripped area:

- ▶ Crimp the inner contact to the end of the cable inner conductor, using the Hand Crimp Tool **Z80-292**, with the Positioner **Z80-291** assembled.

- ▶ Insert the cable and crimped inner contact into the coax body from the rear. Make sure that the braid goes outside and over the rear section of the body.

- ▶ Slide the sleeve back to the body of the coax, so that it covers the exposed braid, and touches the shoulder of the coax body. Crimp into place using the Hand Crimp Tool **Z80-293**.

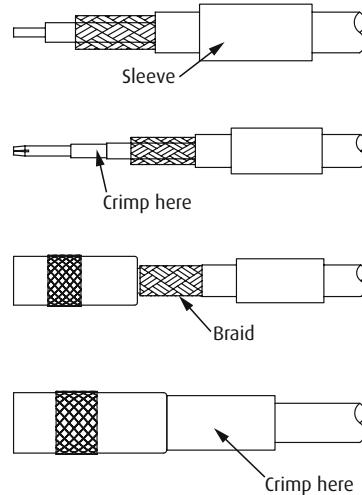

Crimping 90° Coax Contacts

- ▶ Check that your selected cable size is correct to the following table:

Type	Cable size	Cable type	Correct Hex on tool Z80-293, for crimping sleeve
M80-308, M80-318	Ø2.00mm	RG 178	Small Hex
M80-316	Ø2.40mm	PTFE Cellular	Small Hex
M80-309, M80-319	Ø2.70mm	RG 174, 179, 316	Large Hex


- ▶ Strip the cable to the appropriate dimensions for the part being crimped (as specified on the drawing). If the strands are disturbed, they can be re-aligned by putting a slight twist into the strand bundle.

- ▶ Identify the pieces of the coax connector to be assembled:

- ▶ Slide the sleeve onto the cable until it stops against the outer insulation. Fold the braid over the sleeve:

- ▶ Push the cable and sleeve into the body, as far as it will go. The cable inner conductor will be visible through the hole in the top of the coax body, and should go into the slot in the inner contact of the body.

- ▶ Solder the cable inner conductor to the body inner contact. When cool, place the insulator inside the top, and press the cover into place. Crimp the back end of the coax onto the insulation of the cable using the Hand Crimp Tool **Z80-293**.

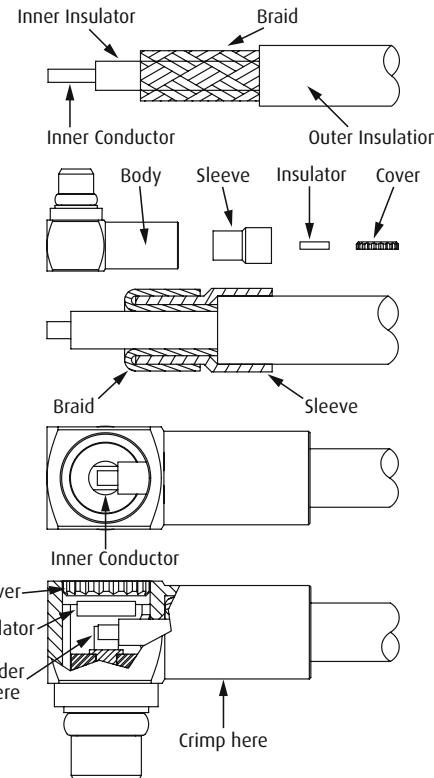

Datamate Jackscrews

Using Datamate Jackscrews: Datamate J-Tek

Introduction

Jackscrews are available for all variations of Datamate J-Tek and Mix-Tek. They are often specified where the following needs may require more than the holding force of the contacts:

- To prevent disengaging of connectors under adverse conditions, where the withdrawal forces may be exceeded.
- To provide a locking feature which deters accidental disengaging by operators.
- To aid engaging, where the number of contacts is high enough to require additional force to complete the mating operation.
- To aid engaging where access to the connector is restricted.

Using M2 threaded Jackscrews

- Engage the two halves of the connector, and lightly push together until the Jackscrews touch.
- Maintaining pressure, turn one of the floating Jackscrews clockwise, until it engages with the fixed Jackscrews. Repeat with the other jackscrew.
- If high forces are encountered early on during engaging, then you may have cross-threaded the Jackscrews. Unscrew anti-clockwise, and try again. Ensure the connectors are directly in line before attempting to engage.
- Once both Jackscrews have begun to engage, ensure an even movement by applying a maximum of one turn to each jackscrew, in sequence. When the connectors have bottomed, the force required to turn the Jackscrews will suddenly increase.
- The torque force on each jackscrew should not exceed 23 cmN.
- To disengage the connectors, repeat the instructions in reverse: unscrew with an anti-clockwise movement. Ensure even movement by applying a maximum of one turn to each jackscrew, in sequence. Once the Jackscrews turn loose with no resistance, you can then easily pull apart the two connectors.

Using 101 Lok Jackscrews

Please see Jackscrews FC and MC on pages 84 and 85.


- Before engaging, the slot on the jackscrew should be at right angles to the length of the connector.
- Push the connectors together. Once the connectors are mated, use a screwdriver to push down onto each 101Lok jackscrew until the spring is compressed. Turn the jackscrew clockwise 101 degrees, and release. The jackscrew should remain partially compressed.
- To disengage, use a screwdriver to push down onto each 101Lok jackscrew until the spring is compressed. Turn the jackscrew anti-clockwise 101 degrees, and release. The jackscrew will spring back to its uncompressed position.

Using Board Mount


Two styles of Board Mount are used, either using a nut or a screw. Both are assembled by placing the connector in the correct position on the board, then screwing in the board fixing nut/screw on the underside of the board. Harwin recommend Slotted Screwdriver Z80-298 (page 88) for use with the slotted nuts.

- Nuts and Screws should be tightened to a torque of 21 ± 2 cmN.


Examples of Jackscrews:

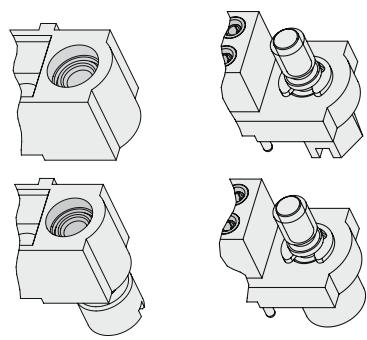

M2 Threaded Jackscrews

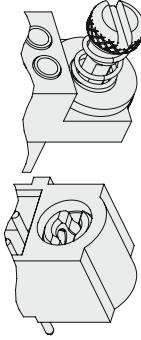

101 Lok Jackscrews

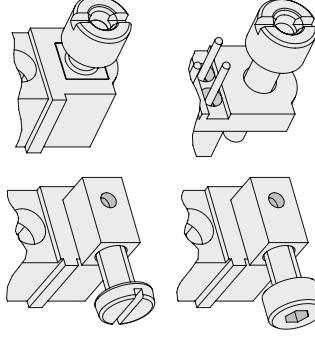

Board Mount Jackscrews