Roller Coaster v1.7 timing card. Print at 100 % (Actual size). The card must measure 115 x 72 mm.

Cut on the corner marks, laminate (total thickness 1 mm or less), trim to 115 x 72 mm, slide it into the holder from the top.

TIMING CARD

target T = 30 to 60 s. Aim: T + 0.5 s.

1. Find T in the table.
2. LADDERS: carriage pin in strip hole N, counted from the TOP.
   L1 = cage at THIS end. L2 = far cage, behind the elevators.
3. PEG: pull the pin, slide the arm, pin into the hole marked Peg mm.
   CHECK: every pin pushed FULLY in.

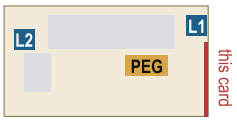

FRONT (you)

T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s
30	6	6	15.75	30.6	41	4	4	14.5	41.5	51	2	3	15.25	51.5
31	5	6	12	31.6	42	4	4	15.5	42.6	52	2	2	13.5	52.5
32	5	6	14.25	32.5	43	3	4	13	43.4	53	2	3	16.25	53.5
33	5	6	15.5	33.4	44	3	4	14.5	44.5	54	1	2	12.25	54.6
34	5	5	12.25	34.5	45	3	4	15.25	45.4	55	1	2	13.5	55.5
35	5	5	14.25	35.4	46	3	3	13.25	46.5	56	1	2	14.5	56.6
36	5	5	15.5	36.5	47	3	3	14.5	47.5	57	1	1	12.25	57.5
37	4	5	12.5	37.4	48	2	3	12	48.6	58	1	1	13.5	58.5
38	4	5	14.5	38.6	49	2	3	13.5	49.5	59	1	1	14.25	59.4
39	4	5	15.5	39.5	50	2	3	14.5	50.5	60	1	1	15	60.6
40	4	4	13	40.5										

Test run X s SLOW: use the row for T - X. X s FAST: the row for T + X.

Small fix, peg only: bigger gap = slower; one step (12.25 to 12.5 ...) = 0.15 to 0.35 s.

TIMING CARD

target T = 30 to 60 s. Aim: T + 0.5 s.

1. Find T in the table.
2. LADDERS: carriage pin in strip hole N, counted from the TOP.
   L1 = cage at THIS end. L2 = far cage, behind the elevators.
3. PEG: pull the pin, slide the arm, pin into the hole marked Peg mm.
   CHECK: every pin pushed FULLY in.

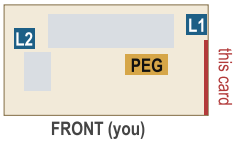

FRONT (you)

T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s
30	6	6	15.75	30.6	41	4	4	14.5	41.5	51	2	3	15.25	51.5
31	5	6	12	31.6	42	4	4	15.5	42.6	52	2	2	13.5	52.5
32	5	6	14.25	32.5	43	3	4	13	43.4	53	2	3	16.25	53.5
33	5	6	15.5	33.4	44	3	4	14.5	44.5	54	1	2	12.25	54.6
34	5	5	12.25	34.5	45	3	4	15.25	45.4	55	1	2	13.5	55.5
35	5	5	14.25	35.4	46	3	3	13.25	46.5	56	1	2	14.5	56.6
36	5	5	15.5	36.5	47	3	3	14.5	47.5	57	1	1	12.25	57.5
37	4	5	12.5	37.4	48	2	3	12	48.6	58	1	1	13.5	58.5
38	4	5	14.5	38.6	49	2	3	13.5	49.5	59	1	1	14.25	59.4
39	4	5	15.5	39.5	50	2	3	14.5	50.5	60	1	1	15	60.6
40	4	4	13	40.5										

Test run X s SLOW: use the row for T - X. X s FAST: the row for T + X.

Small fix, peg only: bigger gap = slower; one step (12.25 to 12.5 ...) = 0.15 to 0.35 s.