Roller Coaster v1.8 timing card. Print at 100 % (Actual size). The card must measure 115 x 72 mm.

Cut on the corner marks, laminate (total thickness 1 mm or less), trim to 115 x 72 mm, slide it into the holder from the top.

TIMING CARD

target T = 30 to 60 s. Aim: T + 0.5 s.

1. Find T in the table.
2. LADDERS: carriage pin in strip hole N, counted from the TOP.
   L1 = cage at THIS end. L2 = far cage, behind the elevators.
3. PEG: pull the pin, slide the arm, pin into the hole marked Peg mm.
   CHECK: every pin pushed FULLY in.

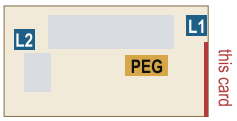

FRONT (you)

T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s
30	6	6	15	30.5	41	4	4	13.75	41.5	51	3	3	16.5	51.4
31	6	6	16.25	31.6	42	4	4	15	42.6	52	2	3	15.5	52.4
32	5	6	13.25	32.5	43	3	4	12.25	43.5	53	2	3	16	53.4
33	5	6	15	33.5	44	3	4	13.75	44.4	54	2	2	14.75	54.3
34	5	6	16	34.5	45	3	4	15	45.6	55	2	2	15.5	55.5
35	5	5	13.5	35.5	46	3	3	12.5	46.5	56	1	2	14	56.5
36	5	5	15	36.5	47	3	3	14	47.5	57	1	2	14.75	57.4
37	5	5	16	37.6	48	3	3	15	48.6	58	1	1	12.75	58.5
38	4	5	13.75	38.6	49	2	3	12.75	49.6	59	1	1	14	59.6
39	4	5	15	39.5	50	2	3	14	50.5	60	1	1	14.75	60.6
40	4	4	12	40.5										

Test run X s SLOW: use the row for T - X. X s FAST: the row for T + X.

Small fix, peg only: bigger gap = slower; one step (12.25 to 12.5 ...) = 0.14 to 0.36 s.

TIMING CARD

target T = 30 to 60 s. Aim: T + 0.5 s.

1. Find T in the table.
2. LADDERS: carriage pin in strip hole N, counted from the TOP.
   L1 = cage at THIS end. L2 = far cage, behind the elevators.
3. PEG: pull the pin, slide the arm, pin into the hole marked Peg mm.
   CHECK: every pin pushed FULLY in.

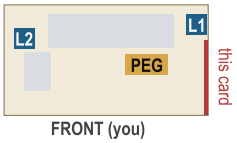

FRONT (you)

T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s	T s	L1	L2	Peg mm	run s
30	6	6	15	30.5	41	4	4	13.75	41.5	51	3	3	16.5	51.4
31	6	6	16.25	31.6	42	4	4	15	42.6	52	2	3	15.5	52.4
32	5	6	13.25	32.5	43	3	4	12.25	43.5	53	2	3	16	53.4
33	5	6	15	33.5	44	3	4	13.75	44.4	54	2	2	14.75	54.3
34	5	6	16	34.5	45	3	4	15	45.6	55	2	2	15.5	55.5
35	5	5	13.5	35.5	46	3	3	12.5	46.5	56	1	2	14	56.5
36	5	5	15	36.5	47	3	3	14	47.5	57	1	2	14.75	57.4
37	5	5	16	37.6	48	3	3	15	48.6	58	1	1	12.75	58.5
38	4	5	13.75	38.6	49	2	3	12.75	49.6	59	1	1	14	59.6
39	4	5	15	39.5	50	2	3	14	50.5	60	1	1	14.75	60.6
40	4	4	12	40.5										

Test run X s SLOW: use the row for T - X. X s FAST: the row for T + X.

Small fix, peg only: bigger gap = slower; one step (12.25 to 12.5 ...) = 0.14 to 0.36 s.