Test plate for ultrasonic inspection trials

Mild steel IS 2062 E250 or equivalent. 600 x 300 x 6.
All dimensions in mm. Do not paint either face.

FRONT FACE (welded side)

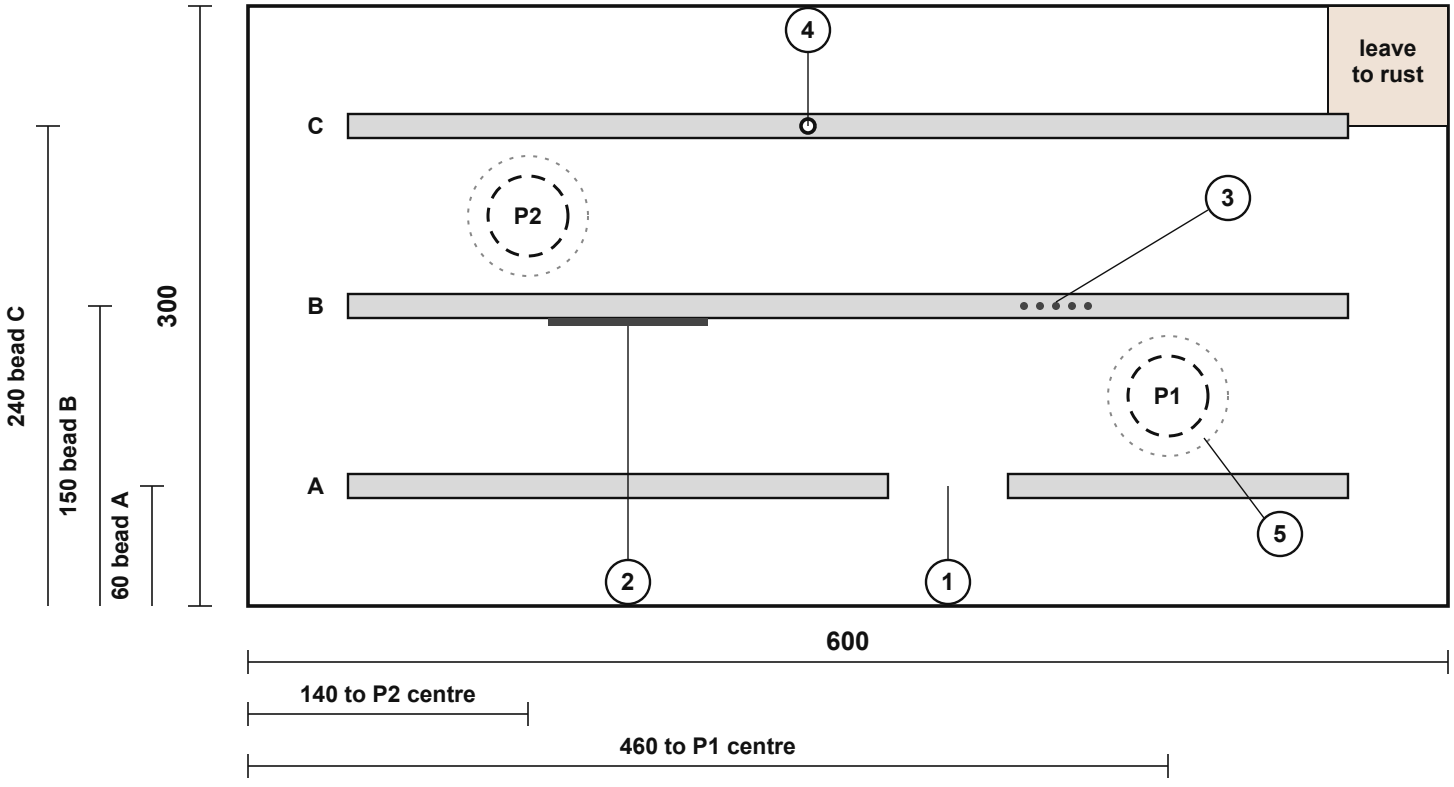

All three beads run 500, from X = 50 to X = 550. P1 centre Y = 105. P2 centre Y = 195.
Datum is the bottom left corner of the front face. X runs along the 600, Y across the 300.

1. **B001 stop the bead for 60 and restart, leaving bare plate showing in the gap**
2. **B002 grind a groove 80 long and 1.5 deep along the lower toe, into the PLATE, not the bead**
3. **B003 five pores or dimples, 2 dia, in the face of the bead**
4. **B004 one hole 6 dia, burned or drilled right through bead and plate**
5. **dashed circle = pocket machined in the BACK face. dotted 60 circle = grind the FRONT smooth here**

SECTION THROUGH P1

part section. Thickness drawn much enlarged so it can be read.

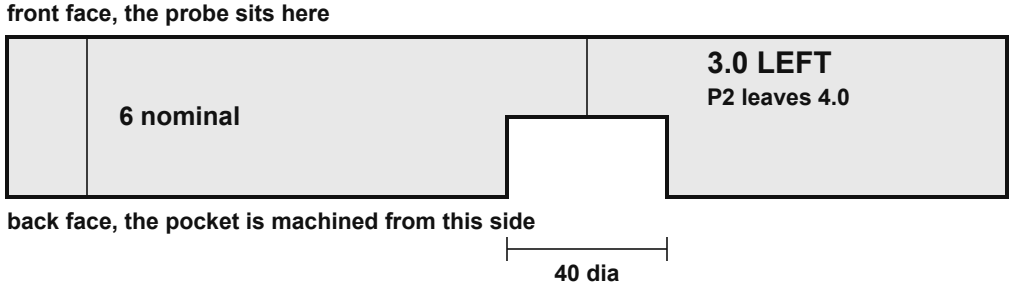

The figure is the metal REMAINING under the pocket, not the depth of cut.
On a 6 plate, leaving 3.0 means cutting about 3.0 deep. Leaving 4.0 means cutting about 2.0 deep.
Flat bottom, end mill, not a grinder. Measure what you actually achieve and report it to 0.05.