

Bob Moore Collision Center
 111 NW 122nd Street
 Oklahoma City, OK. 73114
 Ph; (405) 749-9050 Fax; (405) 749-9074

Scott Noland (Fox 25) 1211 E Wilshire Blvd Oklahoma City, OK 73111 s.noland@sbgtv.com Home: 405-406-5248 Work: Est.: Kendall Received: 3/29/18 Del. Date: Paid:	Date of Loss: Year: 11 Make: SUBA Model: Forester X Auto Type: UV Style: 4D UTV Engine: 4-2.5L Gasoline MPFI Color: License: OK CGZ540 Mileage: 105,740 105,743 VIN: JF2SHBBC5BH758183	REPUBLIC Phone: Fax: Adjuster: Claim #: 12234702 Policy: Betterment: 137.41 Deductible: 0.00
---	--	---

Ln.	Description	Parts	Labor Units	Team	Refin Units	Team	Other
	GASKET	9.95					
	GASKET	9.95					
1	EXHAUST SYSTEM			113 MIKE G			
2	LT Muffler & pipe	349.95	0.50	BILL 1168			
3	Intermed pipe	427.19	1.00	BILL 1168			
4	WHEELS			113 MIKE G			
5	Spare R&I wheel		0.10	113 MIKE G			
6	REAR BODY & FLOOR			113 MIKE G			
7	Rear body panel		5.00	113 MIKE G	1.00	Blue Team	
8	Add for Three Stage				0.60	Blue Team	
9	Rear floor pan		6.00	113 MIKE G	1.50	Blue Team	
10	Rear sill gray		0.20	113 MIKE G			
11	Trunk cover		0.20	113 MIKE G			
12	LIFT GATE			113 MIKE G			
13	R&I liftgate assy		0.60	113 MIKE G			
14	Lift gate w/o spoiler		5.00	113 MIKE G	2.20	Blue Team	
15	Overlap Major Adj. Panel				-0.40	Blue Team	
16	Add for Three Stage				0.70	Blue Team	
17	Finish panel paint to match w/		1.10	113 MIKE G			
18	Nameplate "SUBARU AWD"	54.95	0.30	113 MIKE G			
19	Rope Lift gate glass Subaru				0.50	Blue Team	
20	Nozzle assy		0.10	113 MIKE G			
21	Nameplate "FORESTER"	33.95	0.30	113 MIKE G			
22	Emblem			113 MIKE G			
23	REAR BUMPER			113 MIKE G			
24	O/H rear bumper		1.40	113 MIKE G			
25	A/M CAPA Bumper cover B50%	253.00		113 MIKE G	2.40	Blue Team	
26	Overlap Major Non-Adj. Panel				-0.20	Blue Team	
27	Add for Three Stage				0.90	Blue Team	
28	LT Reflector	12.50		113 MIKE G			
29	Reinforcement	259.95	0.40	113 MIKE G			
30	MISCELLANEOUS OPERATIONS			113 MIKE G			
31	Hazardous waste disposal						3.00
32	Set up		2.00	113 MIKE G			
33	Frame Mash, Rear		1.00	113 MIKE G			

RO: 0138368.00

Detailed Customer Invoice

4/17/18 3:11PM

Page: 2
150147

913	Paint Materials						247.00
919	Clear Coat Paint Materials						83.60
921	3-Stage Paint Materials						333.60
	Totals	1,411.39	25.50	9.20			333.60

	Total Category		Rate	Units	Est.	Suppl.	Total
	LABOR:BODY		48.00	23.00	931.20	172.80	1,104.00
	LABOR:PAINT		48.00	9.20	441.60		441.60
	LABOR:FRAME		60.00	1.00	60.00		60.00
	LABOR:MECH		90.00	1.50		135.00	135.00
	MTL:PAINT		38.00		313.20	17.40	330.60
	PARTS:OEM				12.50	1,145.89	1,158.39
	PARTS:AFTERMKT				253.00		253.00
	HAZARDOUS WASTE				3.00		3.00
	Subtotals			34.70	2,014.50	1,471.09	3,485.59
	SALES TAX				50.18	100.33	150.51
	Grand Total:			34.70	2,064.68	1,571.42	3,636.10

BOB MOURE
 NORTH COLLISION CTR
 111 NW 122ND ST
 OKLAHOMA CITY, OK 73114
 (405) 749-9050

Merchant ID: 240666123
 Term ID: 2509

Sale

Application Label: AMERICAN EXPRESS
 ANEX
 XXXXXXXXX1005
 AID: A000000025010801
 Entry Method: Chip Read
 Apprvd: Online Batch#: 000006
 04/25/18 11:24:31
 Inv#: 00000001 Appr Code: 840626

Total: USD\$ 2,521.53

Mode: Issuer
 TVR: 00000008000
 IAD: 06660103602002
 TSI: F800
 ARC: 00
 I agree to pay above total amount
 according to card issuer agreement
 (Merchant agreement if credit voucher)

X-----

BYERS/GREGORY

Customer Copy

THANK YOU



WARRANTY

The labor performed by the BOB MOORE COLLISION CENTER LLC
is guaranteed against any defect in workmanship for as long
as you own your car, truck or van.

Name: Fox 25 Repair Order #: 138368

Vehicle Make: 11 Subaru Model: Forester

VIN: — BH758183 AUTHORIZED BY: [Signature]
DATE: 4/17/18

IAnet Accurate Nationwide Appraisals
22044 North 44th Street, Suite 200
Phoenix, AZ 85050
Phone 480-596-1105
Fax 480-596-1140

For supplements, please call, or visit:
<https://ianetwork.net/supplements/> or email: supplements@ianetwork.net

*** CORRECTED SUPPLEMENT 1 ***

03/02/2018 10:32 AM
S1
04/05/2018 12:08 PM

Owner

Owner: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111

Work/Day: (405)475-9127
FAX:

Control Information

Claim #: 12234702
Loss Date/Time: 02/09/2018 01:00 AM

Insured Policy #:
Loss Type: Liability

Ins. Company: Rental Insurance Services

Claimant: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111

Work/Day: (405)475-9127
FAX:

Claim Rep: Christopher Jeremie

Inspection

Inspection Date: 03/01/2018 02:00 PM
Inspection Location: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111
Primary Impact: Rear
Driveable: Yes

Inspection Type: Field
Contact:
Work/Day: (405)475-9127x
FAX:
Secondary Impact:
Rental Assisted:

Appraiser Name: Maria Williamson

Appraiser License #:

Orig Appraiser Name: Maria Williamson

Appraiser License #:

Repairer

Repairer: Bob Moore Body Shop North
Address: 111 NW 122nd
City State Zip: Oklahoma City, OK 73114

Contact:
Work/Day: (405)749-9050
FAX: (405)749-9074

Target Complete Date/Time:

Days To Repair: 6

Vehicle

2011 Subaru Forester X 4 DR Wagon
4cyl Gasoline 2.5 DOHC
4 Speed Automatic

Lic.Plate:	CGZ540	Lic State:	OK
Lic Expire:	06/2018	VIN:	JF2SHBBC5BH758183
Prod Date:	03/2011	Mileage:	105,034
Veh Insp# :		Mileage Type:	Actual
Condition:	Good	Code:	F1925B
Ext. Color:	Satin White Pearl	Int. Color:	Gray
Ext. Refinish:	Two-Stage	Int. Refinish:	
Ext. Paint Code:	WHI	Int. Trim Code:	GR3

Options - AudaVIN Information Received

2nd Row Head Airbags	AM/FM CD Player	Air Conditioning
Alarm System	Anti-Lock Brakes	Auto Headlamp Control
Bodyside Cladding	Bucket Seats	Cargo/Trunk Mat
Center Console	Cruise Control	Daytime Running Lights
Dual Airbags	Floor Mats	Halogen Headlights
Head Airbags	Heavy Duty Suspension	Interior Cargo Tray
Intermittent Wipers	Keyless Entry System	Lighted Entry System
MP3 Decoder	Mud/Splash Guards	Overhead Console
Power Brakes	Power Door Locks	Power Mirrors
Power Steering	Power Windows	Rear Window Defroster
Rear Window Wiper/Washer	Side Airbags	Split Folding Rear Seat
Stability Cntrl Suspensn	Styled Steel Wheels	Tachometer
Tilt Steering Wheel	Tinted Glass	Traction Control System
Trip Computer	Velour/Cloth Seats	

AudaVIN options are listed in bold-italic fonts

Damages

Line	Op	Guide	MC	Description	MFR.Part No.	Price	ADJ%	B%	Hours	R
Wheels										
1	RI	968		Spare Wheel R & I	R & I Assembly				S1	0.2
Tailgate										
2	I	479		Shell,Tailgate	Repair				S1	5.0*
3	L	479	#	Shell,Tailgate	Refinish					3.1*
					2.0 Surface					
					0.6 Two-stage setup					
					0.5 Two-stage					
					# = 10, 13					
					>> Reduced basecoat					
4	RI	479		Tailgate R & I	R & I Assembly					0.6
5	RI	419		Pnl,T/G Finish Upper	R & I Assembly					1.1
6	RI	335		N/Plate,Tailgate	R & I Assembly					0.2
7	RI	386		N/Plate,Tailgate	R & I Assembly					0.2
8	I	484		Glass,Tailgate Heated	Repair					0.5*
					>> Rope glass					
9	RI	645		Nozzle,T/G Washer	R & I Assembly					0.1
10	RI	486		Pnl,T/G Inner Trim	R & I Assembly					INC
Rear Bumper										
11	EP	566		Cover,Rear Bumper	Replace PXN	\$253.00			0.4	SM
					>> KEYSTONE AUTO (855) 375-4325					
					>> KEYSTONE USA 855-375-4325					
					>> ALL, US, 99999					
12	L	566		Cover,Rear Bumper	Refinish					3.1
					Betterment					RF
					2.6 Surface					
					0.5 Two-stage					
							50			

13 E 21	Reinf,Rear Bumper	57711SC0209P	\$259.95	C	S1	1.4	SM
14 E 24	Reflector,Rear Bumper LT	84281SC010	\$12.50	C	S1	INC	SM

Rear Body, Lamps And Floor Pan

15 E 749	Muffler Assembly LT	44300SC142 Betterment	\$329.95*	C	S1	0.5*	ME
16 E 1171	Pipe,Exhaust	44200SC031 Betterment	\$427.19	C	S1	1.0*	ME
17 RI 640	Compt,Interior	R & I Assembly			S1	0.2*	SM
18 I 509	Panel,Rear Body	Repair				5.0*	SM
19 L 509	Panel,Rear Body	Refinish 1.0 Surface				1.0	RF
20 I 626	Pan,Rear Floor	Repair				6.0*	SM
21 L 626	Pan,Rear Floor	Refinish 1.5 Surface				1.5	RF
22 RI 470	Plate,Sill	R & I Assembly				0.2	SM

Manual Entries

23 I M18	Set-Up And Measure	Repair	2.0*	SM*
24 I M49	Frame Mash,Rear	Repair	1.0*	FR
25 SB M60	Hazardous Waste Removal	Sublet Repair	\$3.00*	SM
25 Items				

MC	Message
10	INCLUDES AUDATEX TIME TO CLEAR ENTIRE PANEL
13	INCLUDES 0.6 HOURS FIRST PANEL TWO-STAGE ALLOWANCE

Estimate Total & Entries

Gross Parts		\$1,029.59
Other Parts		\$253.00
Paint & Materials	8.7 Hours @ \$38.00	\$330.60
Parts & Material Total		\$1,613.19
Tax on Parts & Material	@ 8.625%	\$139.14

Labor	Rate	Replace Hrs	Repair Hrs	Total Hrs	
Sheet Metal (SM)	\$48.00	4.6	18.5	23.1	\$1,108.80
Mech/Elec (ME)	\$75.00	1.5		1.5	\$112.50
Frame (FR)	\$60.00		1.0	1.0	\$60.00
Refinish (RF)	\$48.00	8.7		8.7	\$417.60

Labor Total	34.3 Hours	\$1,698.90
Sublet Repairs	\$3.00	
Gross Total		\$3,454.23
Less: Betterment		\$568.12- <i>(Handwritten)</i>
Net Total		\$2,886.11
Rates / Taxes Adjustment	S1	
Actual Supplement Total	\$932.70	
Less: Previous Net Total		\$1,953.41-
Net Corrected Supplement Total		\$932.70

Owner To Pay All Damages

Alternate Parts Y/00/00/00/00 CUM 01/01/00/00 Zip Code: 73099 Geo 73099
 SPPL Yes Zip Code: 73099 Default
 Rate Name Default

IAnet Accurate Nationwide Appraisals
22044 North 44th Street, Suite 200
Phoenix, AZ 85050
Phone 480-596-1105
Fax 480-596-1140

For supplements, please call, or visit:
<https://ianetwork.net/supplements/> or email: supplements@ianetwork.net

*** CORRECTED ESTIMATE ***

03/02/2018 10:32 AM

Owner

Owner: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111

Work/Day: (405)475-9127
FAX:

Control Information

Claim #: 12234702
Loss Date/Time: 02/09/2018

Insured Policy # :
Loss Type: Liability

Ins. Company: Rental Insurance Services

Claimant: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111

Work/Day: (405)475-9127
FAX:

Claim Rep: Christopher Jeremie

Inspection

Inspection Date: 03/01/2018 01:00 PM
Inspection Location: Sinclair Communications, LLC
Address: 1228 E. Wilshire
City State Zip: Oklahoma City, OK 73111
Primary Impact: Rear
Driveable: Yes

Inspection Type: Field
Contact:
Work/Day: (405)475-9127x
FAX:
Secondary Impact:
Rental Assisted:

Appraiser Name: Maria Williamson

Appraiser License # :

Repairer

Target Complete Date/Time:

Days To Repair: 5

Vehicle

2011 Subaru Forester X 4 DR Wagon
4cyl Gasoline 2.5 DOHC
4 Speed Automatic

Lic.Plate: CGZ540
Lic Expire: 06/2018
Prod Date: 03/2011
Veh Insp# :
Condition: Good

Lic State: OK
VIN: JF2SHBBC5BH758183
Mileage: 105,034
Mileage Type: Actual
Code: F1925B

Ext. Color: Satin White Pearl
Ext. Refinish: Two-Stage
Ext. Paint Code: WH1

Int. Color: Gray
Int. Refinish:
Int. Trim Code: GR3

Options - AudaVIN Information Received

2nd Row Head Airbags	AM/FM CD Player	Air Conditioning
Alarm System	Anti-Lock Brakes	Auto Headlamp Control
Bodyside Cladding	Bucket Seats	Cargo/Trunk Mat
Center Console	Cruise Control	Daytime Running Lights
Dual Airbags	Floor Mats	Halogen Headlights
Head Airbags	Heavy Duty Suspension	Interior Cargo Tray
Intermittent Wipers	Keyless Entry System	Lighted Entry System
MP3 Decoder	Mud/Splash Guards	Overhead Console
Power Brakes	Power Door Locks	Power Mirrors
Power Steering	Power Windows	Rear Window Defroster
Rear Window Wiper/Washer	Side Airbags	Split Folding Rear Seat
Stability Cntrl Suspensn	Styled Steel Wheels	Tachometer
Tilt Steering Wheel	Tinted Glass	Traction Control System
Trip Computer	Velour/Cloth Seats	

AudaVIN options are listed in bold-italic fonts

Damages									
Line	Op	Guide	MC	Description	MFR.Part No.	Price	ADJ% B%	Hours	R
Tailgate									
1	I	479		Shell,Tailgate	Repair			3.0*	SM
2	L	479	#	Shell,Tailgate	Refinish		C	3.1*	RF
					2.0 Surface				
					0.6 Two-stage setup				
					0.5 Two-stage				
				# = 10, 13					
				>> Reduced basecoat					
3	RI	479		Tailgate R & I	R & I Assembly			0.6	SM
4	RI	419		Pnl,T/G Finish Upper	R & I Assembly			1.1	SM
5	RI	335		N/Plate,Tailgate	R & I Assembly		C	0.2	SM
6	RI	386		N/Plate,Tailgate	R & I Assembly		C	0.2	SM
7	I	484		Glass,Tailgate Heated	Repair		C	0.5*	SM
				>> Rope glass					
8	RI	645		Nozzle,T/G Washer	R & I Assembly			0.1	SM
9	RI	486		Pnl,T/G Inner Trim	R & I Assembly			INC	SM
Rear Bumper									
10	EP	566		Cover,Rear Bumper	Replace PNX	\$253.00		0.4	SM
				>> KEYSTONE AUTO (855) 375-4325					
				>> KEYSTONE USA 855-375-4325					
				>> ALL, US, 99999					
11	L	566		Cover,Rear Bumper	Refinish			3.1	RF
					Betterment		50		
					2.6 Surface				
					0.5 Two-stage				
12	E	24		Reflector,Rear Bumper LT	84281SC010	\$12.50	C	1.0	SM
Rear Body, Lamps And Floor Pan									
13	RI	640		Compt,Interior	R & I Assembly				SM
14	I	509		Panel,Rear Body	Repair			5.0*	SM
15	L	509		Panel,Rear Body	Refinish			1.0	RF
					1.0 Surface				
16	I	626		Pan,Rear Floor	Repair			6.0*	SM

17 L 626	Pan,Rear Floor	Refinish 1.5 Surface R & I Assembly	1.5	RF
18 RI 470	Plate,Sill		0.2	SM

Manual Entries

19 I M18	Set-Up And Measure	Repair	2.0*	SM*
20 I M49	Frame Mash,Rear	Repair	1.0*	FR
21 SB M60	Hazardous Waste Removal	Sublet Repair		SM
21 Items			\$3.00*	

MC	Message
10	INCLUDES AUDATEX TIME TO CLEAR ENTIRE PANEL
13	INCLUDES 0.6 HOURS FIRST PANEL TWO-STAGE ALLOWANCE

Estimate Total & Entries

Gross Parts	\$12.50
Other Parts	\$253.00
Paint & Materials	\$313.20
Parts & Material Total	\$578.70
Tax on Parts & Material	\$49.91

Labor	Rate	Replace Hrs	Repair Hrs	Total Hrs	
					Hrs
Sheet Metal (SM)	\$48.00	3.8	16.5	20.3	\$974.40
Mech/Elec (ME)	\$75.00				
Frame (FR)	\$60.00		1.0	1.0	\$60.00
Refinish (RF)	\$48.00	8.7		8.7	\$417.60
Labor Total			30.0 Hours		\$1,452.00
Sublet Repairs				\$3.00	
Gross Total					\$2,083.61
Less: Betterment					\$130.20-
Net Corrected Total					\$1,953.41

Owner To Pay All Damages

Alternate Parts Y/01/01/00/00 CUM 01/01/00/00 Zip Code: 73099 Geo 73099
SPPL Yes Zip Code: 73099 Default
Rate Name Default

Audatex Estimating 8.0.414 CES 03/02/2018 03:09 PM REL 8.0.414 DT 02/01/2018 DB 03/01/2018
© 2018 Audatex North America, Inc.

1.6 HRS WERE ADDED TO THIS ESTIMATE BASED ON AUDATEX'S TWO-STAGE REFINISH FORMULA.

THIS ESTIMATE HAS BEEN PREPARED BASED ON THE USE OF CRASH PARTS SUPPLIED BY A SOURCE OTHER THAN THE MANUFACTURER OF YOUR VEHICLE. WARRANTIES APPLICABLE TO THESE REPLACEMENT PARTS ARE PROVIDED BY THE MANUFACTURER OR DISTRIBUTOR OF THESE PARTS RATHER THAN THE MANUFACTURER OF YOUR VEHICLE.

THIS IS NOT AN AUTHORIZATION TO REPAIR. ALL COSTS OF REPAIR ARE THE

RESPONSIBILITY OF THE VEHICLE OWNER, WHO MUST ULTIMATELY AUTHORIZE ALL REPAIRS. NO SUPPLEMENTS WILL BE HONORED WITHOUT PRIOR INSPECTION AND AUTHORIZATION BY THE PREPARER OF THIS ESTIMATE.

****IMPORTANT DISCLOSURE - PLEASE READ BEFORE REPAIRING VEHICLE****

THIS IS A DAMAGE APPRAISAL ONLY, NOT AN AUTHORIZATION TO REPAIR. THE VEHICLE OWNER MUST AUTHORIZE ALL REPAIRS.

FAILURE TO OBTAIN PRIOR APPROVAL FOR PAYMENT OF SUPPLEMENTAL REPAIRS MAY RESULT IN OUT OF POCKET EXPENSE TO THE VEHICLE OWNER OR ALTERNATIVELY, THE REPAIR FACILITY NOT RECEIVING FULL PAYMENT FOR REPAIRS.

ALL APPRAISALS ARE SUBJECT TO REVIEW BY THE COMPANY TO ASSURE CONSISTENCY WITH ESTIMATE GUIDELINES.

THIS APPRAISAL IS BASED ON AN INSPECTION OF VISIBLE DAMAGE AND MAY NOT ADDRESS ADDITIONAL PARTS OR LABOR THAT MAY BE REQUIRED IF THE VEHICLE IS TORN DOWN FOR REPAIRS OR HIDDEN DAMAGE IS FOUND. THOSE ARE COMMONLY REFERRED TO AS SUPPLEMENTAL REPAIRS.

SUPPLEMENTAL REPAIRS SHOULD BE REVIEWED WITH THE COMPANY AUTHORIZED REPRESENTATIVE FOR APPROVAL AS PART OF THE AGREED ESTIMATE AMOUNT TO VERIFY RELATEDNESS OF THE REPAIRS AND CONSISTENCY WITH ESTIMATE GUIDELINES. IT IS NECESSARY TO CONTACT THE FIELD APPRAISER WHO PREPARED THIS ESTIMATE PRIOR TO STARTING OR COMPLETING REPAIRS NOT INCLUDED IN THIS ESTIMATE. ANY SUPPLEMENTAL CHARGES MUST BE SUPPORTED BY DOCUMENTS SUCH AS PHOTOS, RECEIPTS, OLD PARTS AND PARTS INVOICES AND OR ANY OTHER DOCUMENT AS REQUIRED BY THE COMPANY.

THE COMPANY RESERVES THE RIGHT TO INSPECT ANY REPAIRS OR SUPPLEMENTAL REPAIRS.

TO DISCUSS A POTENTIAL SUPPLEMENT, PLEASE CALL THE FIELD APPRAISER LISTED ON THE TOP OF THIS DAMAGE ESTIMATE. THIS IS NOT AN AUTHORIZATION OF PAYMENT OR GUARANTEE OF COVERAGE BY THE COMPANY OR ITS INSURED[S] CONTACT YOUR CLAIMS REPRESENTATIVE TO DISCUSS DETAILS REGARDING YOUR CLAIM AND POTENTIAL COVERAGE WHICH MAY APPLY.

Op Codes

* = User-Entered Value
NG = Replace NAGS
UE = Replace OE Surplus
EU = Replace Recycled
UM = Replace Reman/Rebuilt
UC = Replace Reconditioned
N = Additional Labor
IT = Partial Repair
P = Check

^ = Labor Matches System Assigned Rates
EC = Replace Economy
ET = Partial Replace Labor
TE = Partial Replace Price
L = Refinish
TT = Two-Tone
BR = Blend Refinish
CG = Chipguard
AA = Appearance Allowance
E = Replace OEM
OE = Replace PNX OE Srpls
EP = Replace PNX
PM = Replace PNX Reman/Reblt
PC = Replace PNX Reconditioned
SB = Sublet Repair
I = Repair
RI = R & I Assembly
RP = Related Prior Damage



This report contains proprietary information of Audatex and may not be disclosed to any third party (other than the insured, claimant and others on a need to know basis in order to effectuate the claims process) without Audatex's prior written consent.

© 2018 Audatex North America, Inc.

AUDATEX is a trademark owned by Audatex North America, Inc. All rights reserved.



Estimate Summary Page

Maria Williamson

Gross Total	\$2,083.61
Less: Betterment	\$130.20-
Net Corrected Total	\$1,953.41

Owner To Pay All Damages

Audatex Estimating 8.0.414 CES 03/02/2018 03:09 PM REL 8.0.414 DT 02/01/2018 DB 03/01/2018
© 2018 Audatex North America, Inc.

Commerce Bank of St. Louis

80-49/815


Rental Insurance Services, Inc.
PO Box 670010
Coral Springs, FL 33067-0001

CHECK NO.

221085DATE **03/07/2018****\$2,083.61**PAY *Two Thousand Eighty-Three and 61/100 Dollars*TO THE
ORDER
OF

KOKH, LLC
1228 E. Wilshire Boulevard
OKLAHOMA CITY, OK 73111

Rental Insurance Services, Inc.
VOID IF NOT PRESENTED FOR PAYMENT WITHIN 180 DAYS

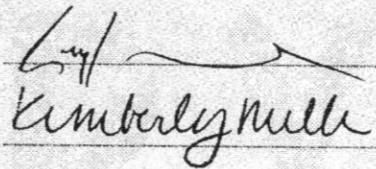

#00000221085# 10815004931 350703781#

Invoice No.	Date	Voucher ID	Paid Amount	Payment Message
12234702	E419RB	12234702	2,083.61	'11 SUBARU FORESTER 20180306 20180306

Rental Insurance Services, Inc.
PO Box 670010
Coral Springs, FL 33067-0001

Vendor #	Vendor Name	Check #	Date	Total Paid Amount
PB00037226	KOKH, LLC	221085	03/07/2018	\$2,083.61