
CENTAUR WALKER

0 Check and index

Print this sheet first. Measure both squares; if either is off, set the printer to Actual size and print again.

Print at 100%
letter, landscape



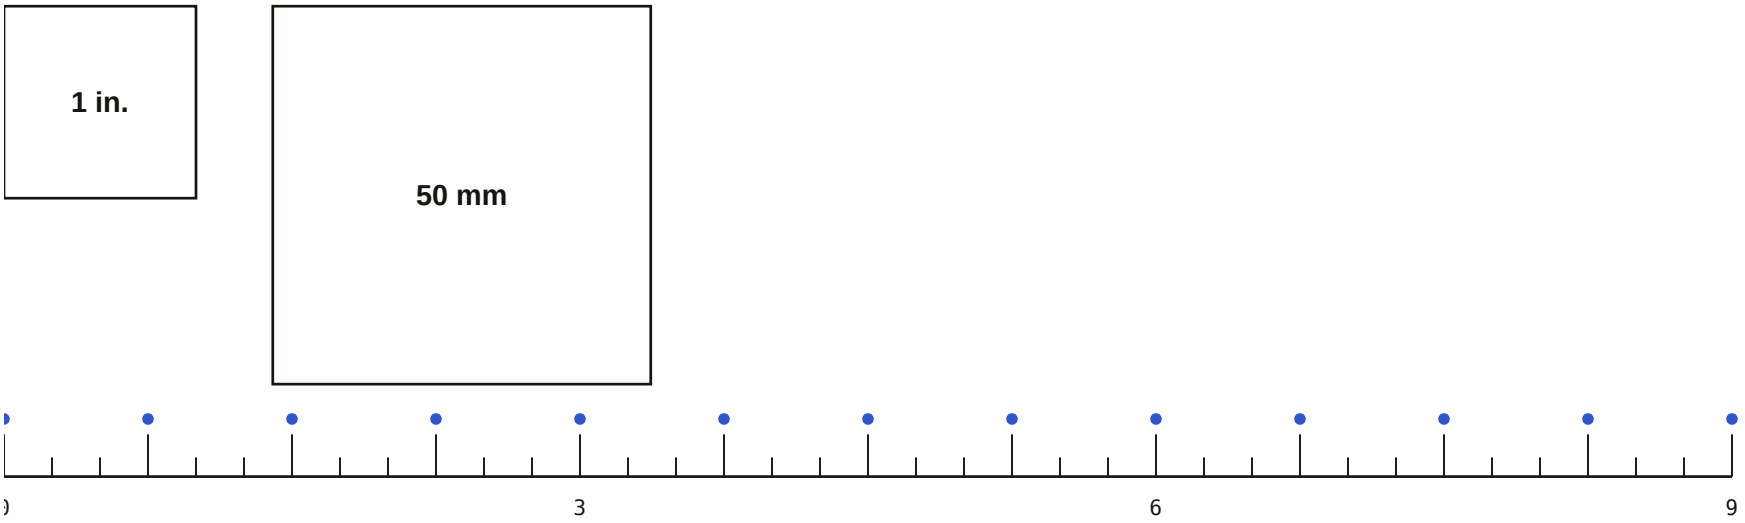

Blue dots: 3/4 in. pitch. Every hole spacing on the legs is a whole number of these.

SHEETS

B1	Leg bars	m j	B7	Leg bars	g h
B2	Leg bars	k	B8	Leg bars	i
B3	Leg bars	b d	P1	Centre plate, front corner	hub hole
B4	Leg bars	d e	P2	Centre plate, rear corner	pivot B
B5	Leg bars	c f	R	Hub ring wrap	3 in. PVC
B6	Leg bars	f g	H	Hoof pad	1×4, make 2

CENTAUR WALKER

B1 Leg bars


Tape each strip to a 1×2 so its long edges sit on the bar's edges. Punch through each cross. Cut on the solid end lines.

Print at 100%
letter, landscape

1 in.
check


m Crank · cut 6-9/16 in. · holes 3-3/4 in. apart (95 mm) to C; hub holes 2-5/8 in. apart · make 2

At C: 7/8 in. counterbore 5/16 in. deep on the inner face; glue a 1-1/2 in. square of offcut over C on the outer face (build book step 3).

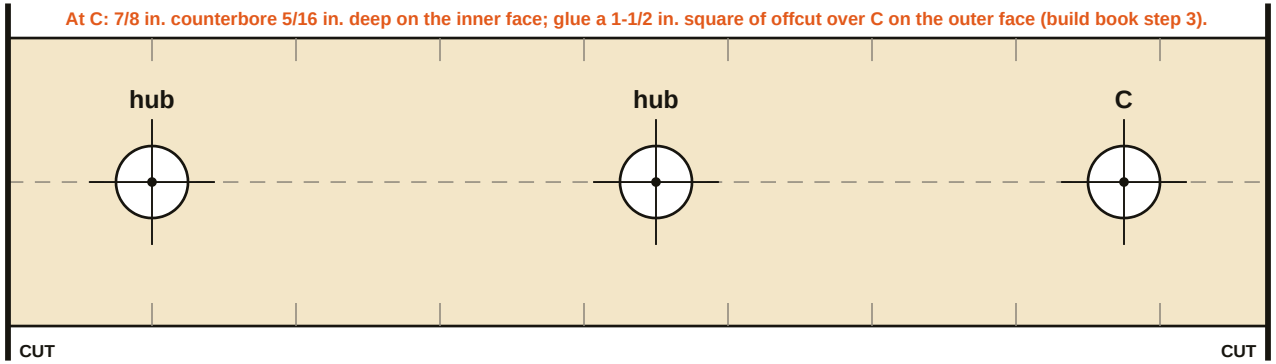


j Upper rod · cut 15 in. · holes 13-1/2 in. apart (343 mm) · make 2 — part 1 of 2

butt to A

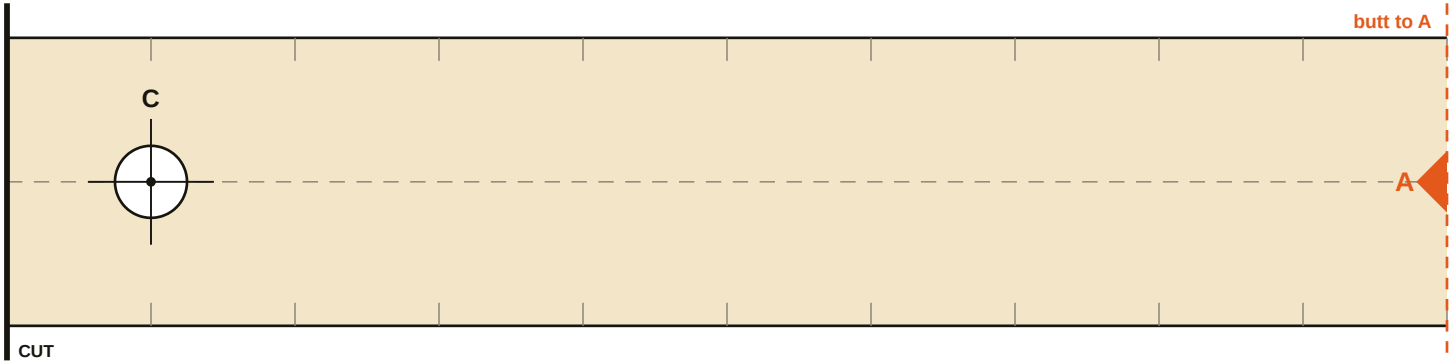

j Upper rod · cut 15 in. · holes 13-1/2 in. apart (343 mm) · make 2 — part 2 of 2

butt to A

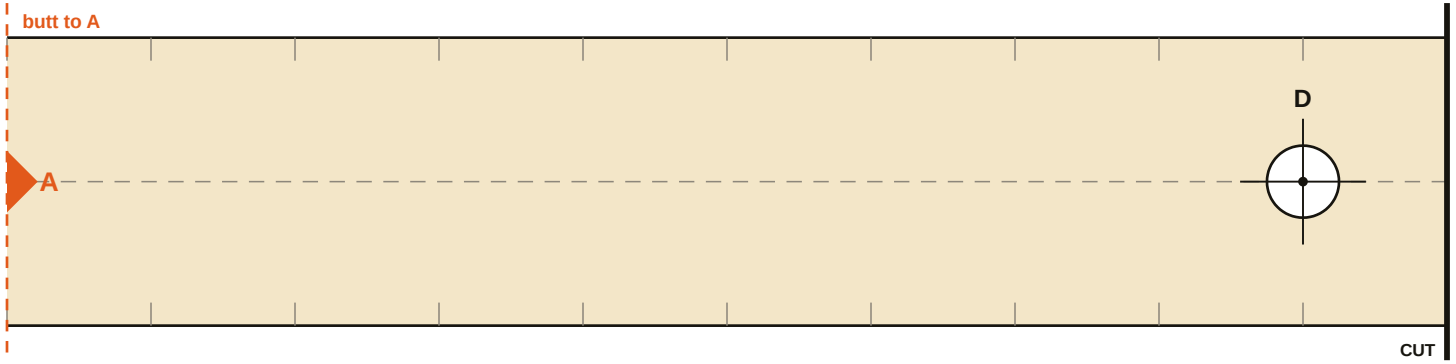

CENTAUR WALKER


B2 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar's edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


k Lower rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — **part 1 of 3**

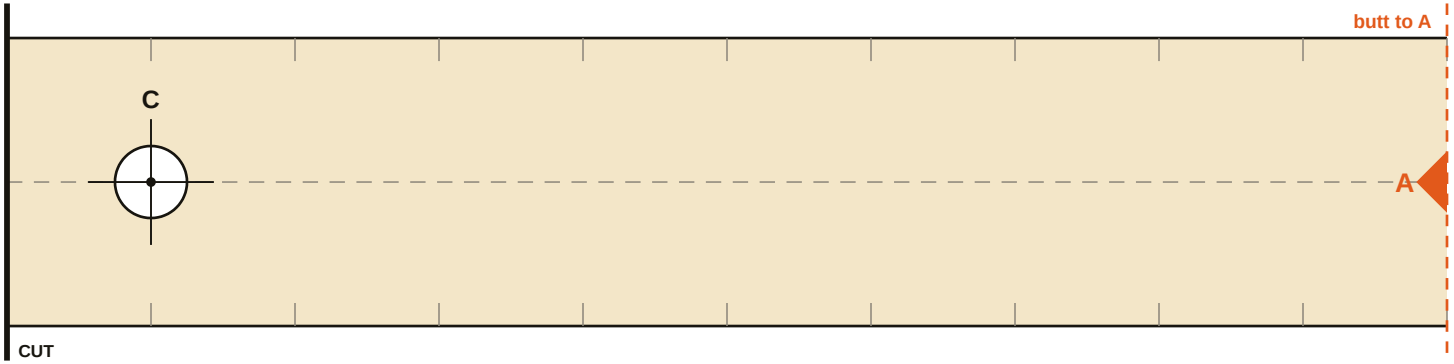

k Lower rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — **part 2 of 3**

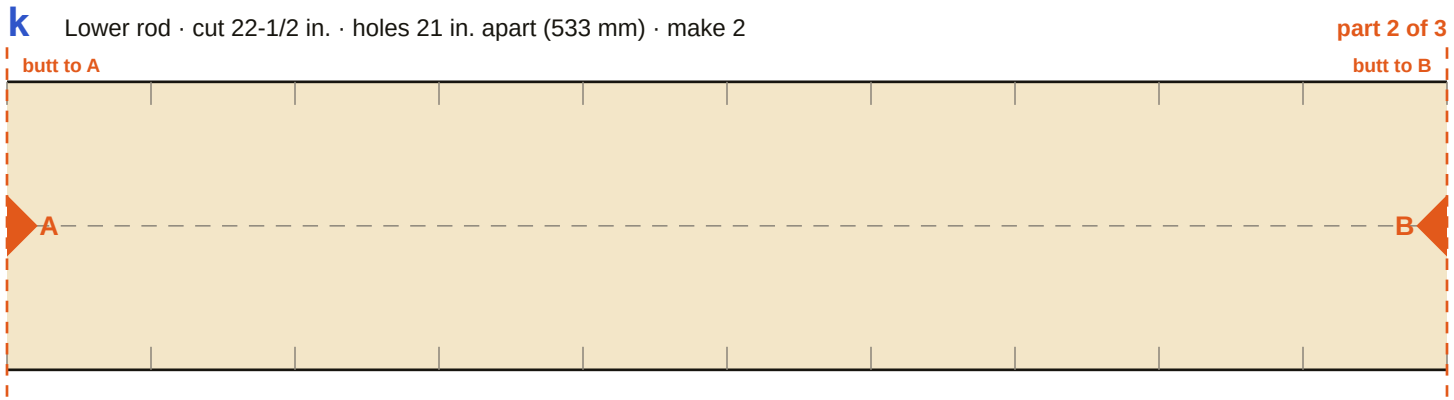

k Lower rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — **part 3 of 3**

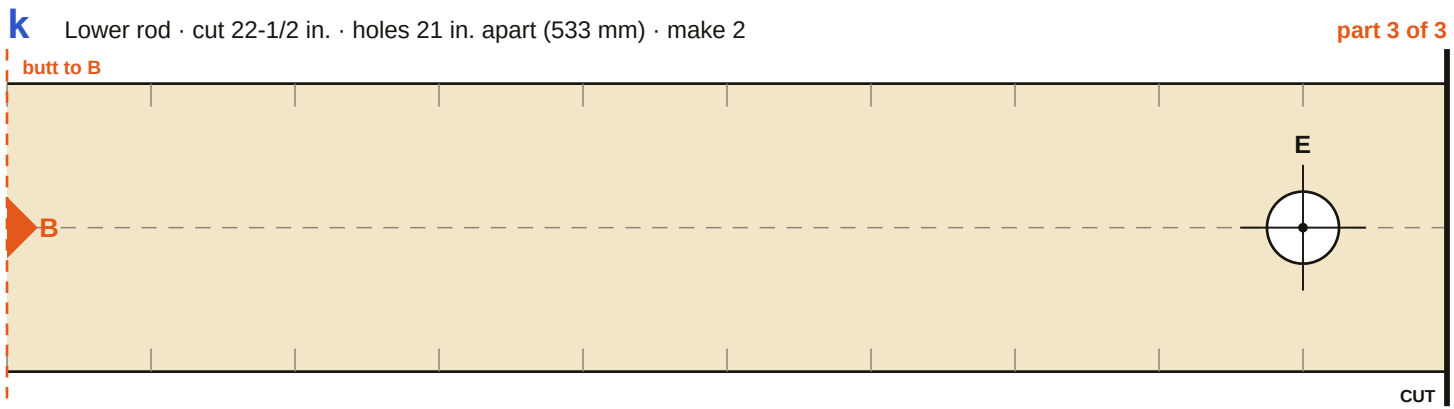

CENTAUR WALKER


B3 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar’s edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


b Hip bar, front · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 1 of 2**

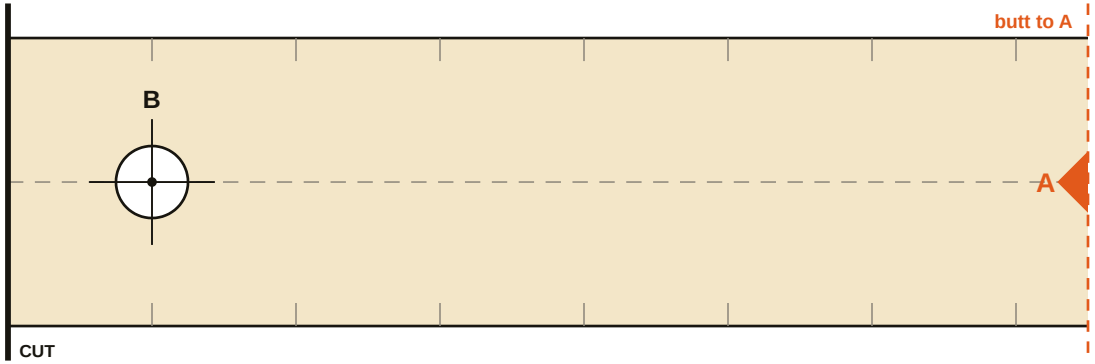

b Hip bar, front · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 2 of 2**

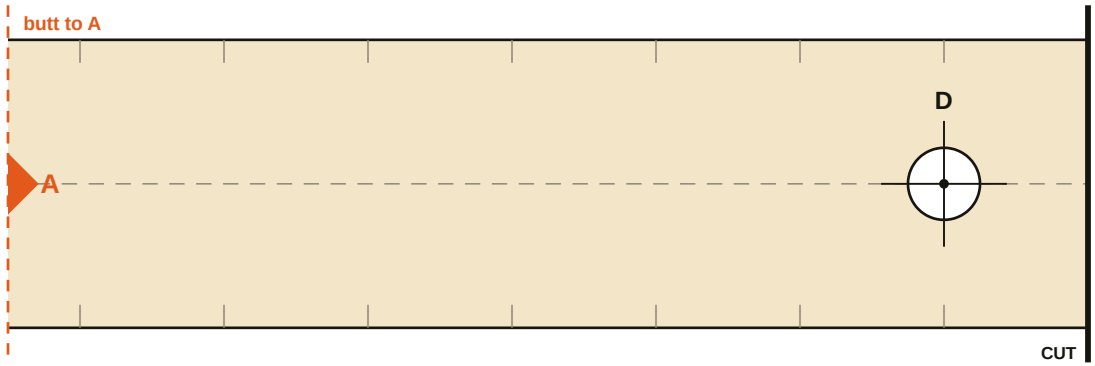

d Hip bar, rear · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 1 of 2**

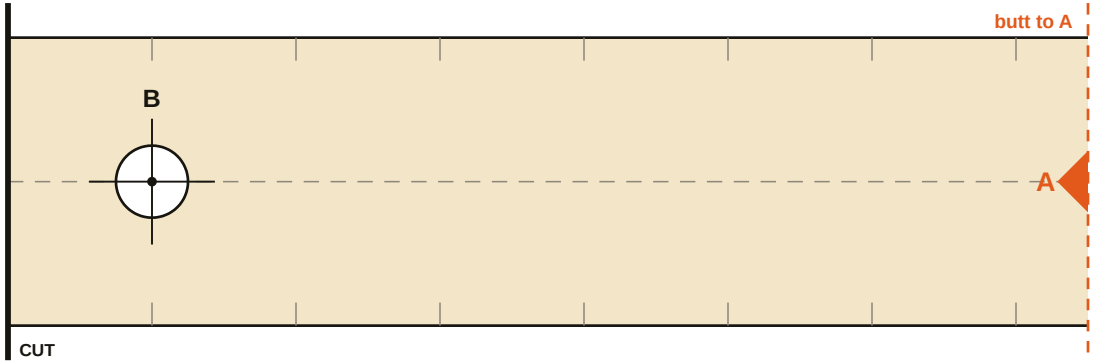

CENTAUR WALKER


B4 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar’s edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


d Hip bar, rear · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 2 of 2**

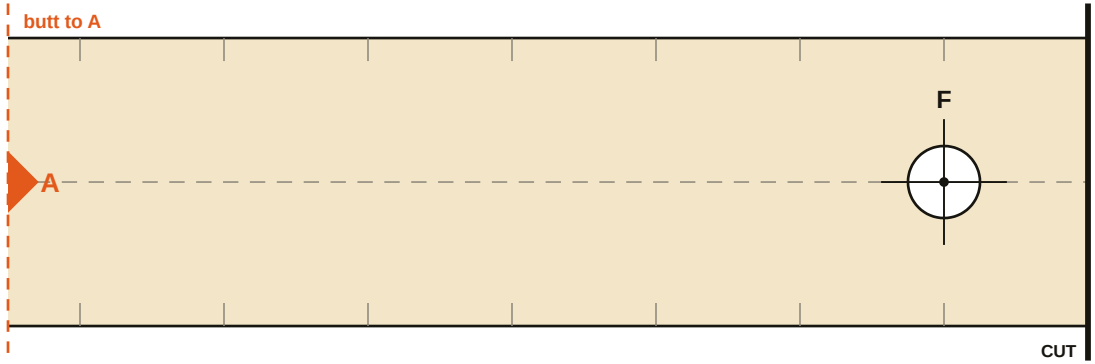

e Hip bar, top · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 1 of 2**

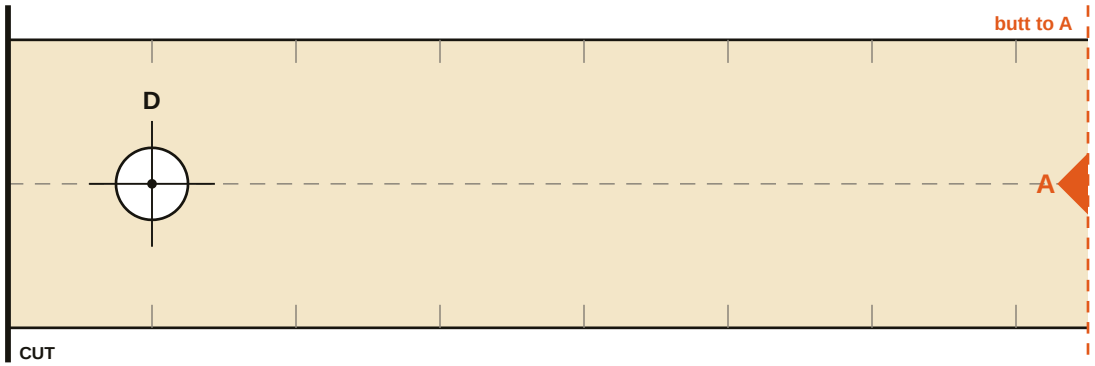

e Hip bar, top · cut 11-1/4 in. · holes 9-3/4 in. apart (248 mm) · make 2 — **part 2 of 2**

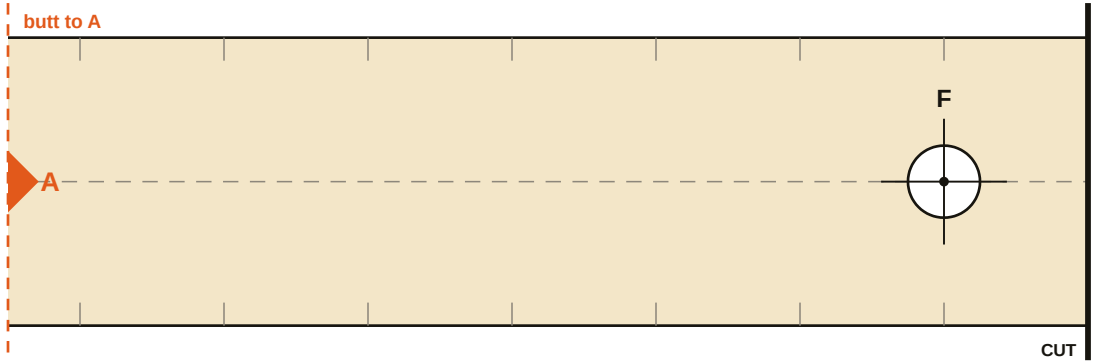

CENTAUR WALKER


B5 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar's edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


C Thigh rod · cut 15 in. · holes 13-1/2 in. apart (343 mm) · make 2 — **part 1 of 2**

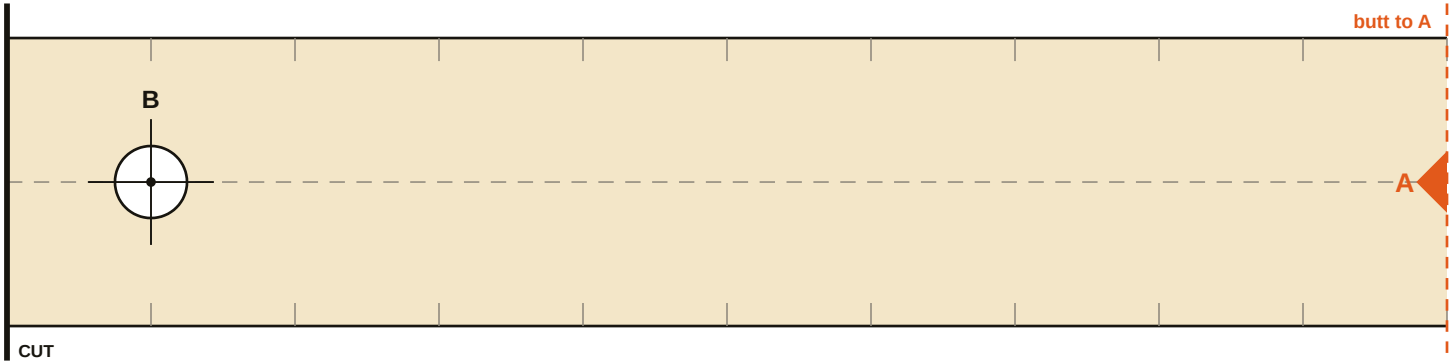

C Thigh rod · cut 15 in. · holes 13-1/2 in. apart (343 mm) · make 2 — **part 2 of 2**

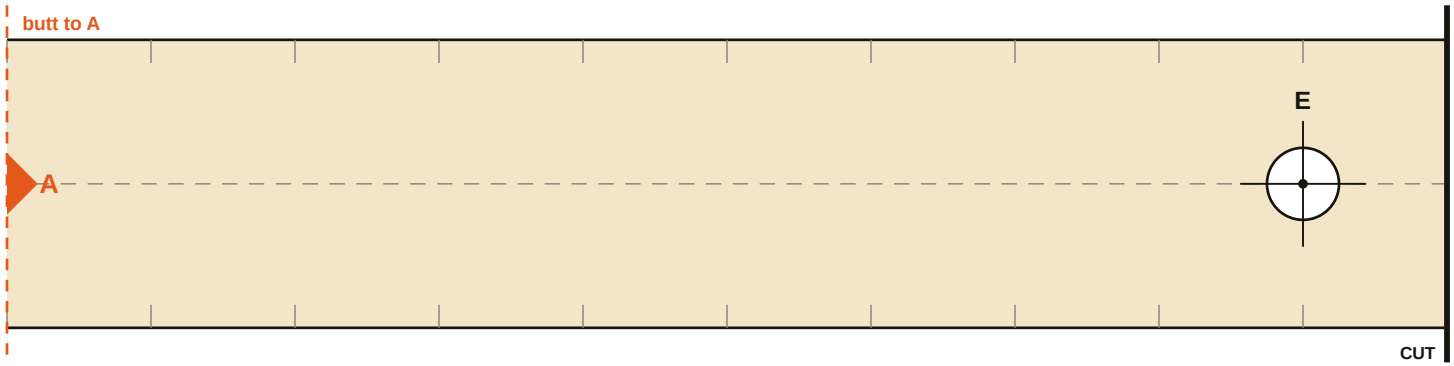

f Gaskin rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — **part 1 of 3**

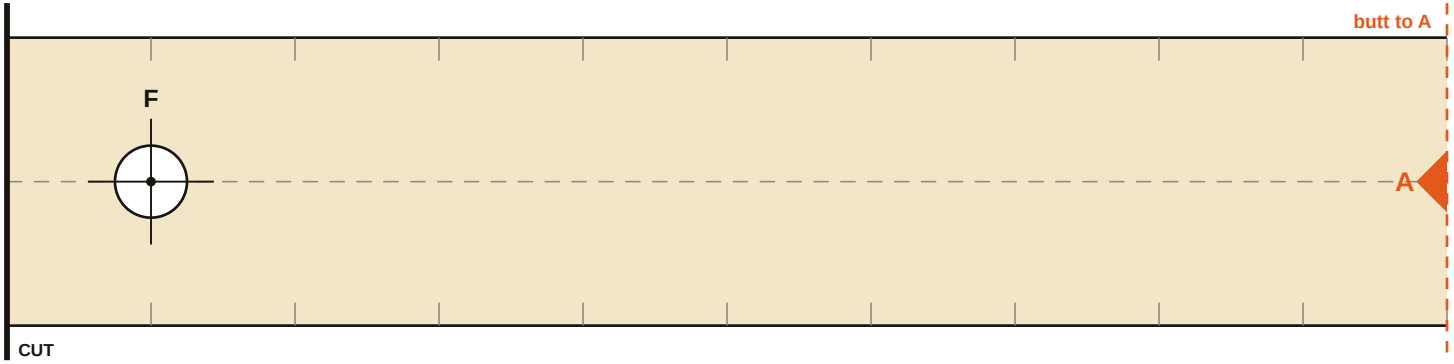

CENTAUR WALKER


B6 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar's edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


f Gaskin rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — part 2 of 3

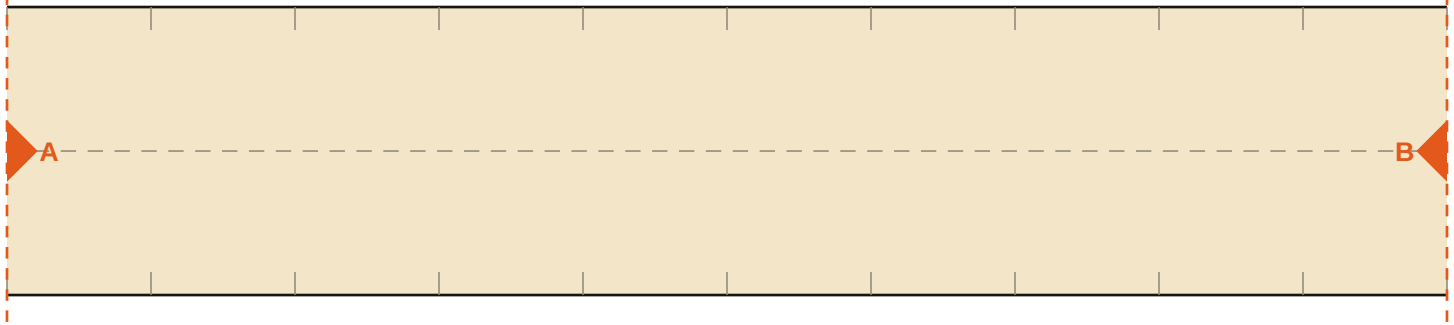

f Gaskin rod · cut 22-1/2 in. · holes 21 in. apart (533 mm) · make 2 — part 3 of 3

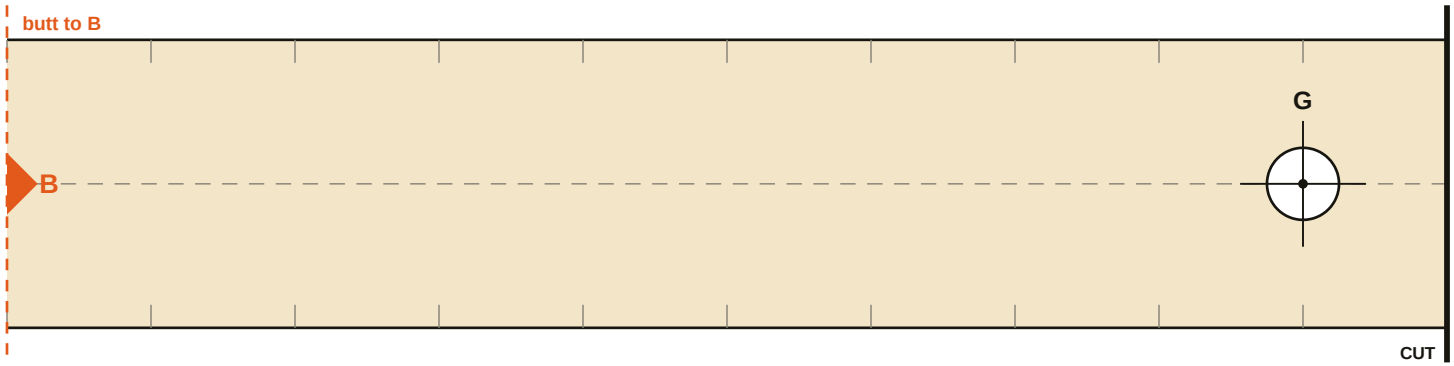

g Hock bar · cut 9-3/4 in. · holes 8-1/4 in. apart (210 mm) · make 2 — part 1 of 2

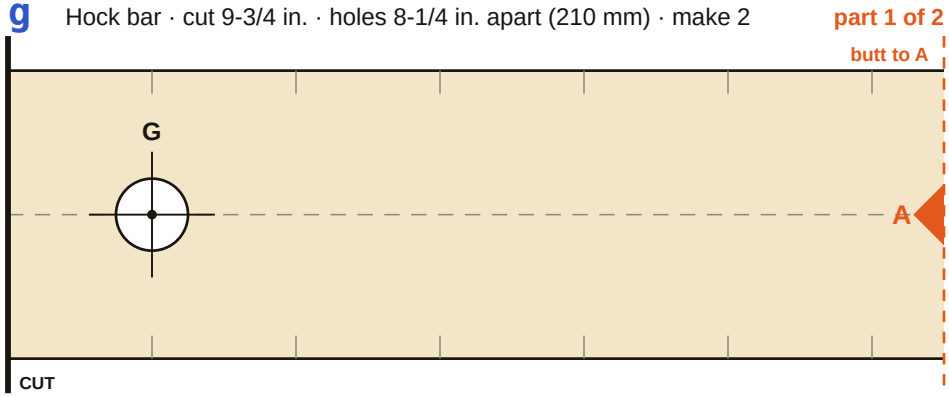

CENTAUR WALKER


B7 Leg bars

Tape each strip to a 1×2 so its long edges sit on the bar's edges. Punch through each cross. Cut on the solid end lines.


Print at 100%
letter, landscape

1 in.
check


g Hock bar · cut 9-3/4 in. · holes 8-1/4 in. apart (210 mm) · make 2 — part 2 of 2

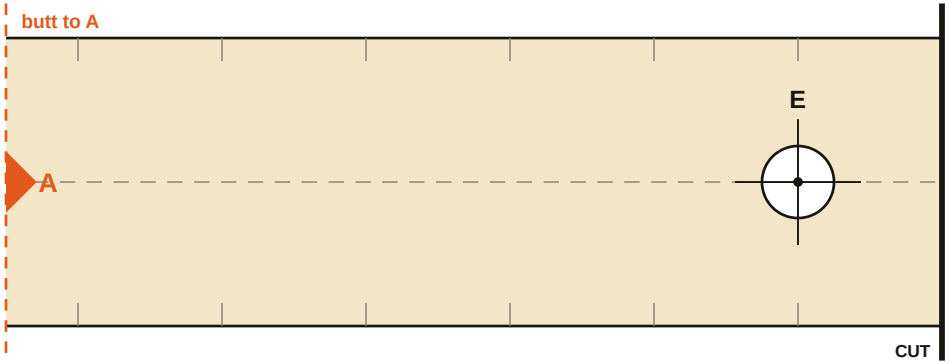

h Cannon bar, rear · cut 18 in. · holes 16-1/2 in. apart (419 mm) · make 2 — part 1 of 2

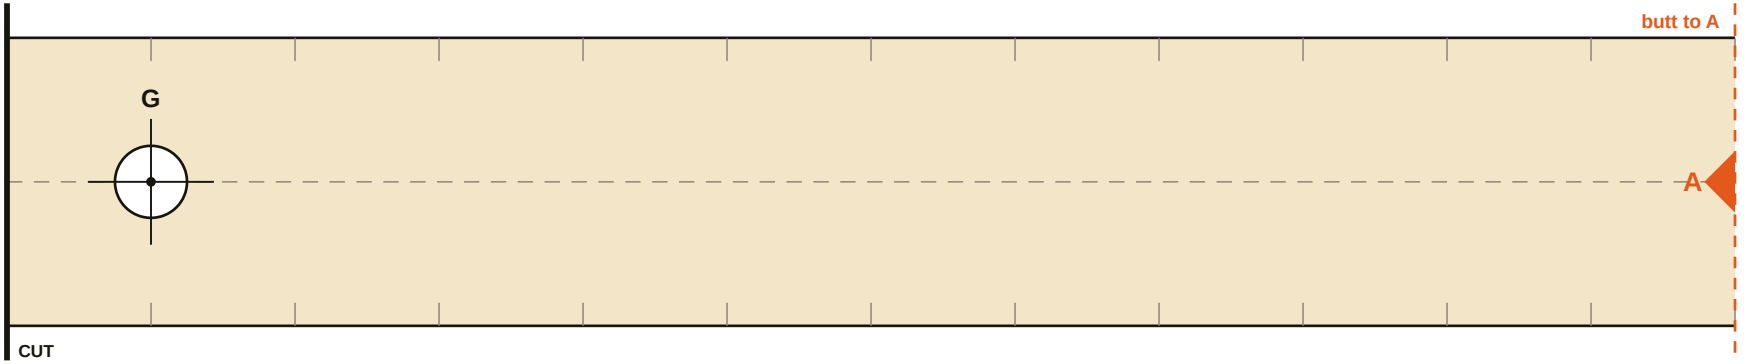

h Cannon bar, rear · cut 18 in. · holes 16-1/2 in. apart (419 mm) · make 2 — part 2 of 2

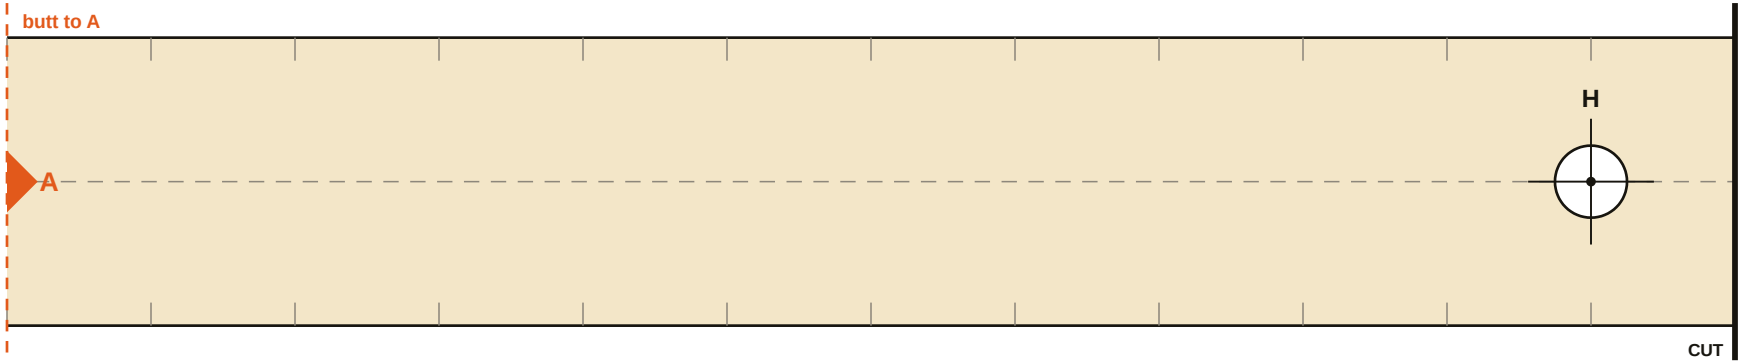

CENTAUR WALKER

B8 Leg bars


Tape each strip to a 1×2 so its long edges sit on the bar’s edges. Punch through each cross. Cut on the solid end lines.

Print at 100%
letter, landscape

1 in.
check


Cannon bar, front · cut 18-3/4 in. · holes 17-1/4 in. apart (438 mm) · make 2

part 1 of 2

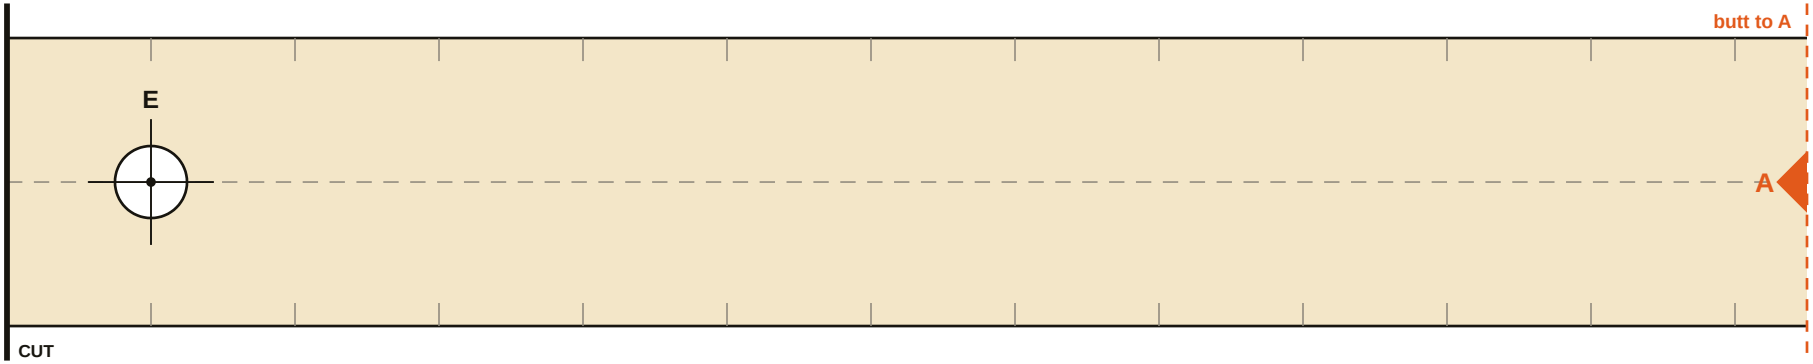

Cannon bar, front · cut 18-3/4 in. · holes 17-1/4 in. apart (438 mm) · make 2

part 2 of 2

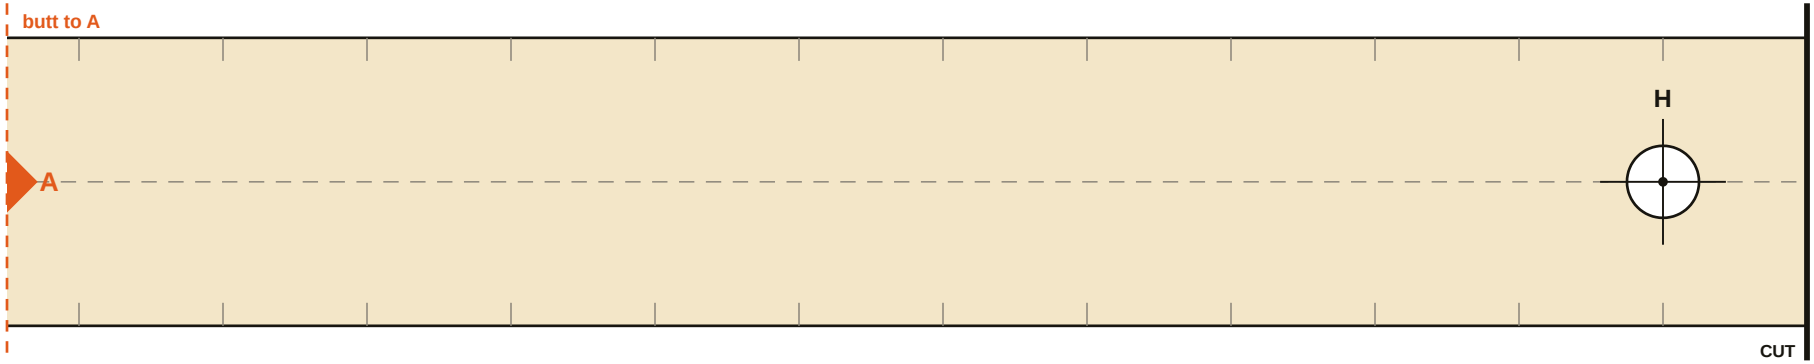

CENTAUR WALKER

P1 Centre plate, front corner


Lay the plate on its side. Butt its front edge and bottom edge into the corner lines. Punch the centre, bore with the 3-5/8 in. hole saw.

Print at 100%
letter, landscape

1 in.
check

Plate: 1/2 in. plywood, 15-1/4 × 13 in. The hub centre is 2-1/2 in. from the front edge and 5 in. from the bottom edge.

to the rear edge: B is 12 in. this way and 3-3/4 in. toward the bottom edge (sheet P2)

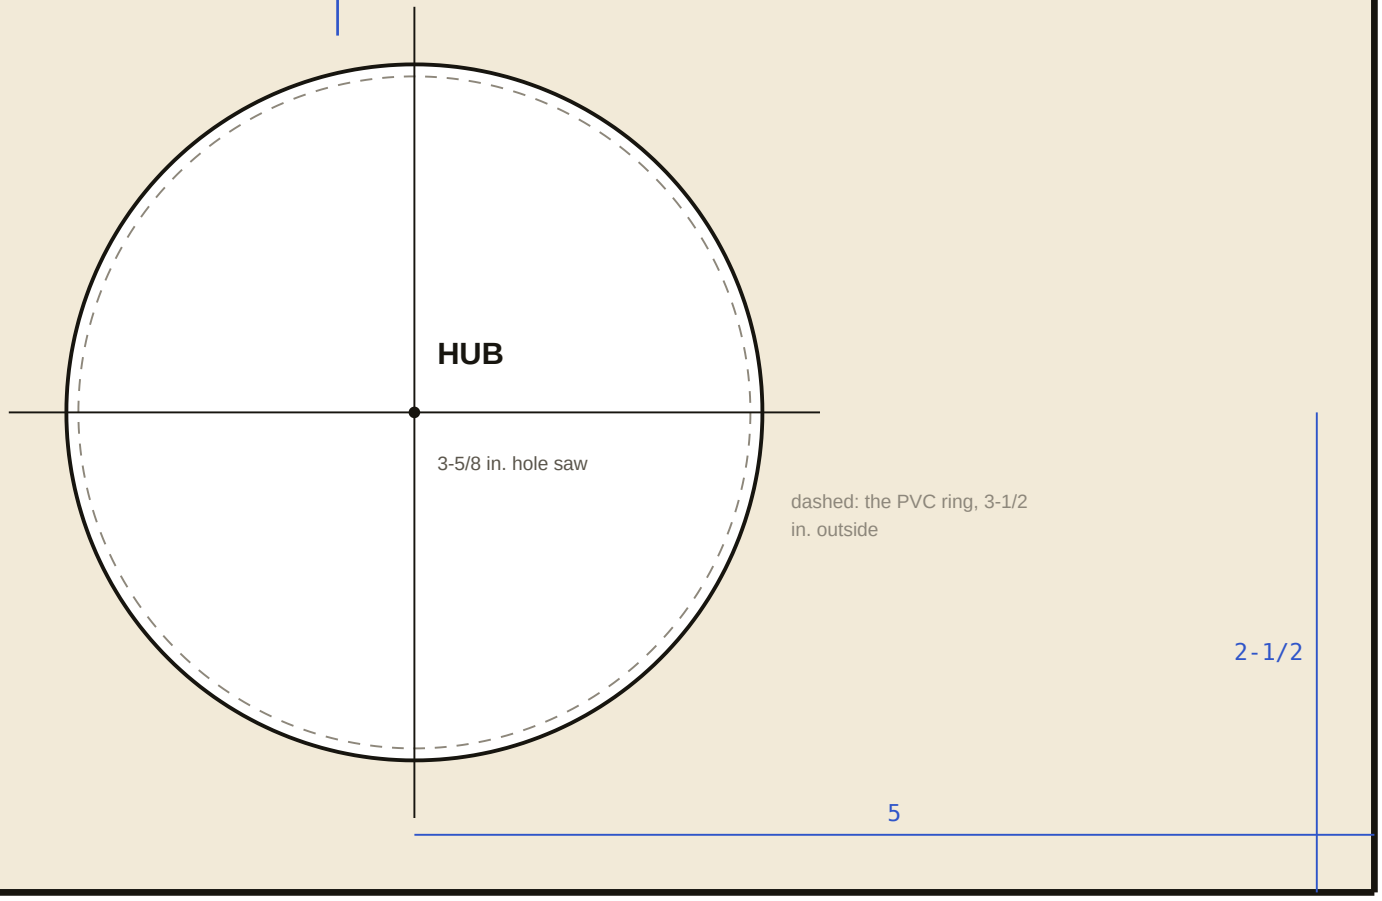


CENTAUR WALKER

P2 Centre plate, rear corner

Butt the plate’s rear and bottom edges into the corner lines. Punch B and drill 3/8 in. Check: B to hub centre measures 12-9/16 in.

Print at 100%
letter, landscape

1 in.
check

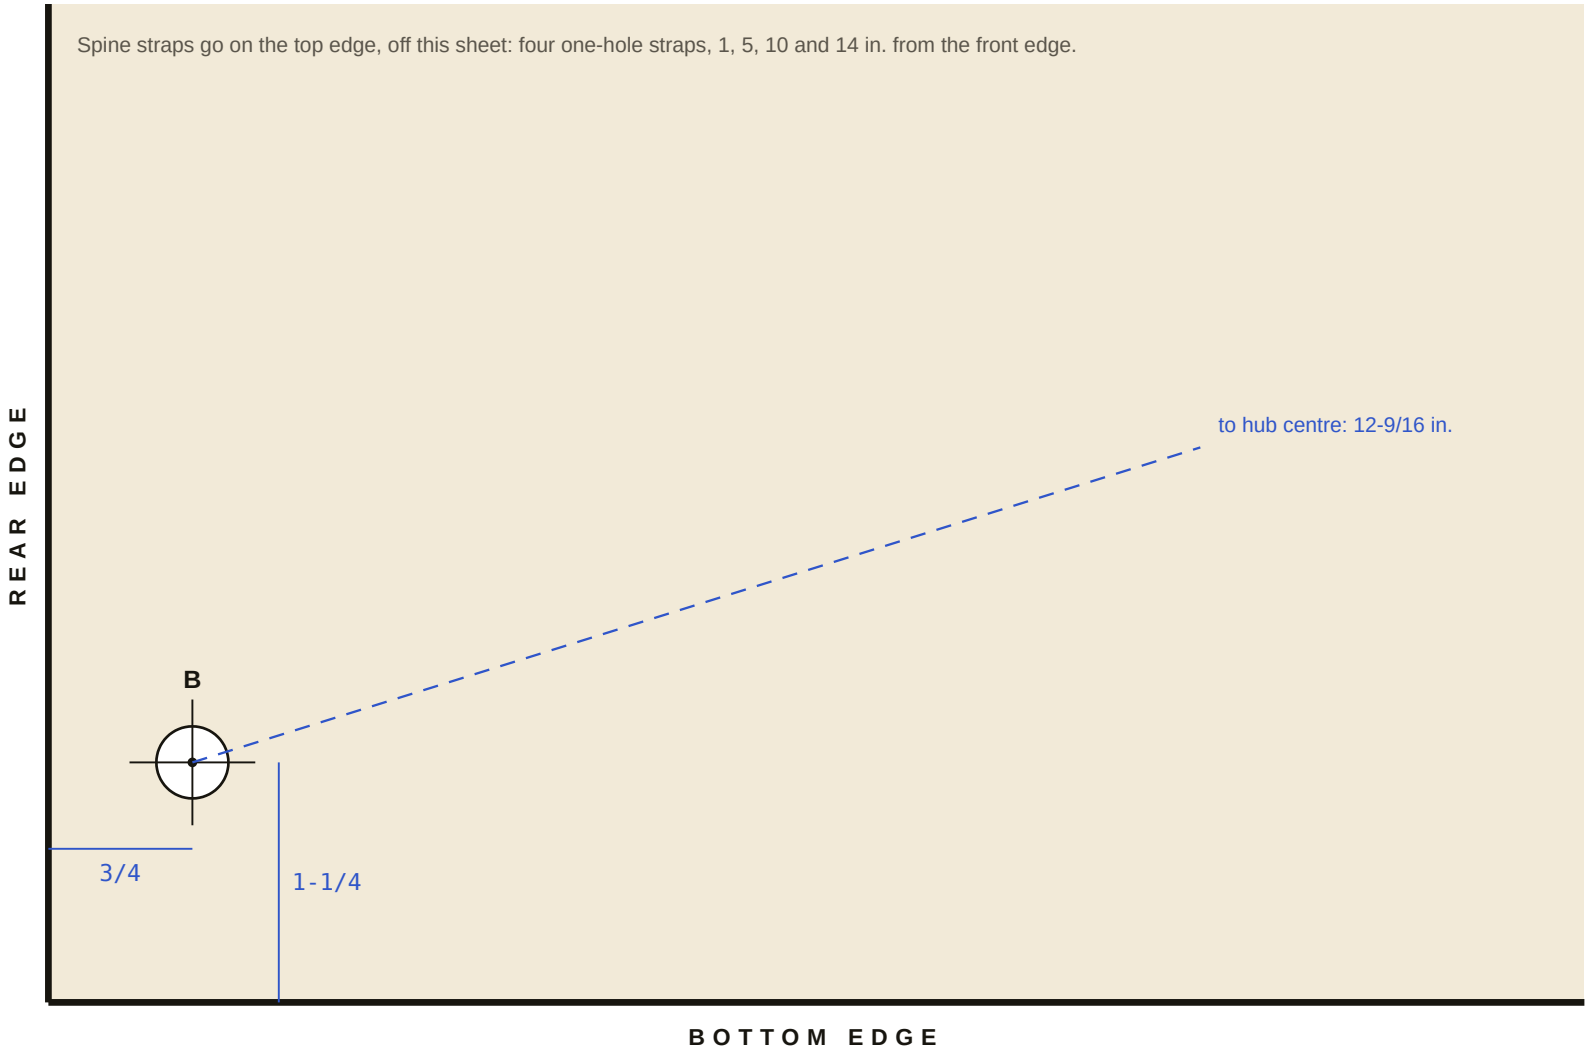


CENTAUR WALKER

R Hub ring wrap

Cut out both bands, tape them end to end at A, and wrap the 3 in. PVC pipe so the end meets the start. Saw on the outside of each line, keeping the cut square.

Print at 100%
letter, landscape

1 in.
check

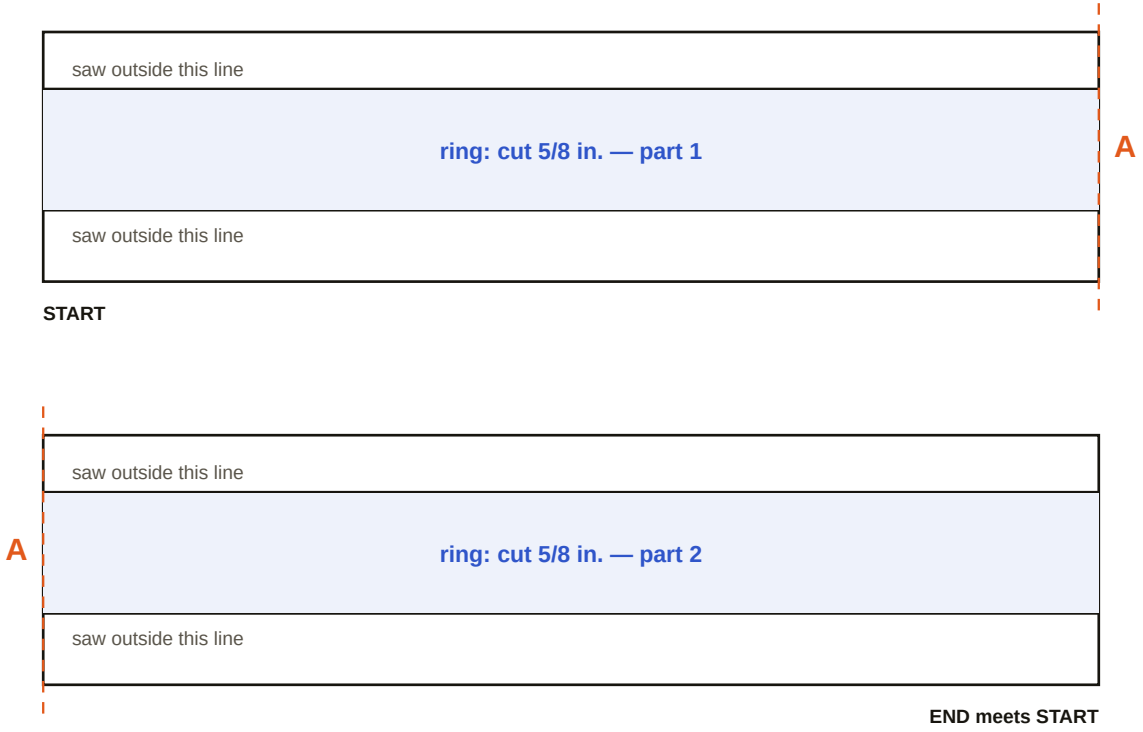

Band length 11 in. = the outside of 3 in. PVC (3-1/2 in. across). Cut the ring 5/8 in., then sand it to 19/32 in.: the plywood (actual 15/32 in.) plus two nylon washers. The cranks clamp the ring, never the plate.


CENTAUR WALKER

H Hoof pad, full size from above

Cut 4 in. of 1×4. Lay this on top. The inner edge goes toward the centre plate. Brace feet point outward.

Print at 100%
letter, landscape

1 in.
check

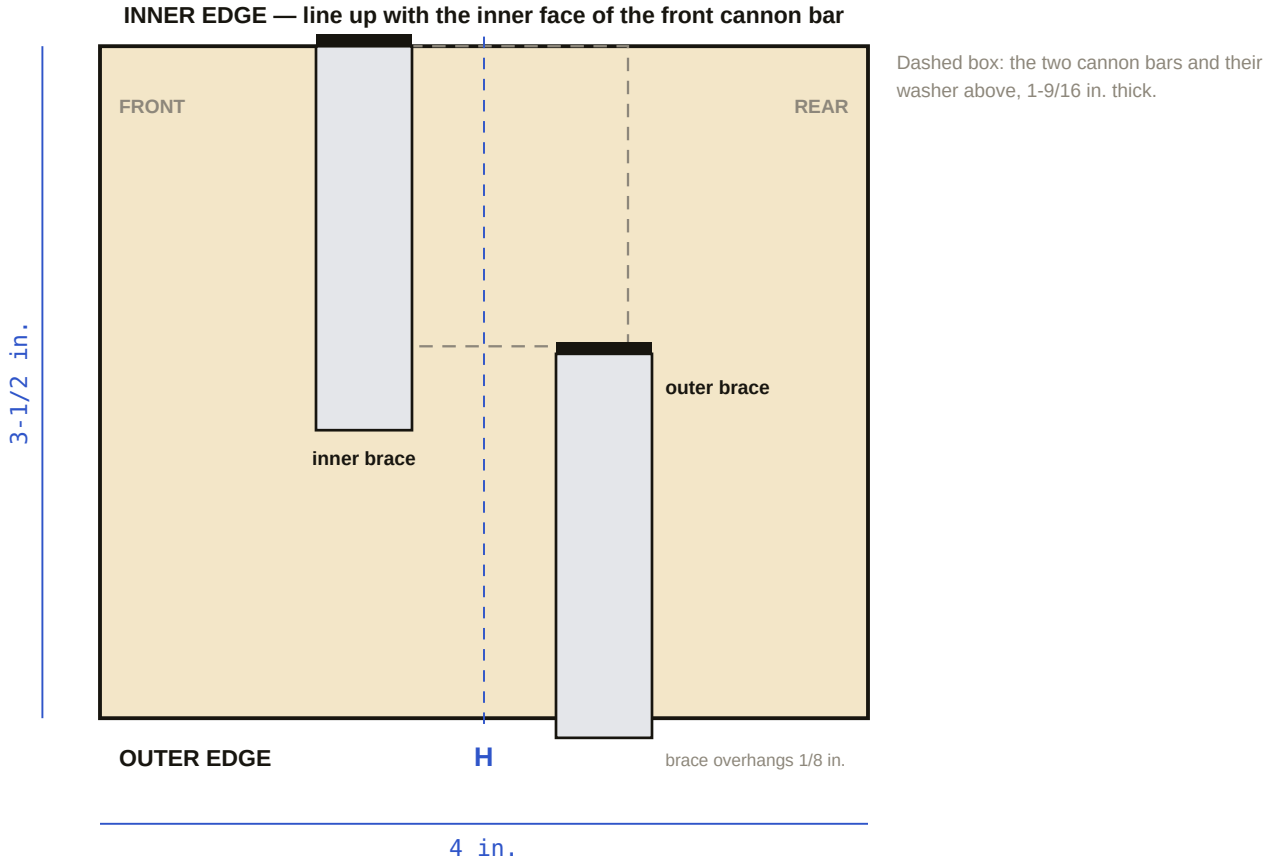

Dashed box: the two cannon bars and their washer above, 1-9/16 in. thick.

Each brace screws to the outside face of one cannon bar, 5/8 in. off H so it clears the nut. Mark the pad through the foot holes; drive #8 × 5/8 in. screws so none come through the rubber. Glue rubber from a floor protector pad to the underside. Hoof weight with braces and rubber: about 90 g.