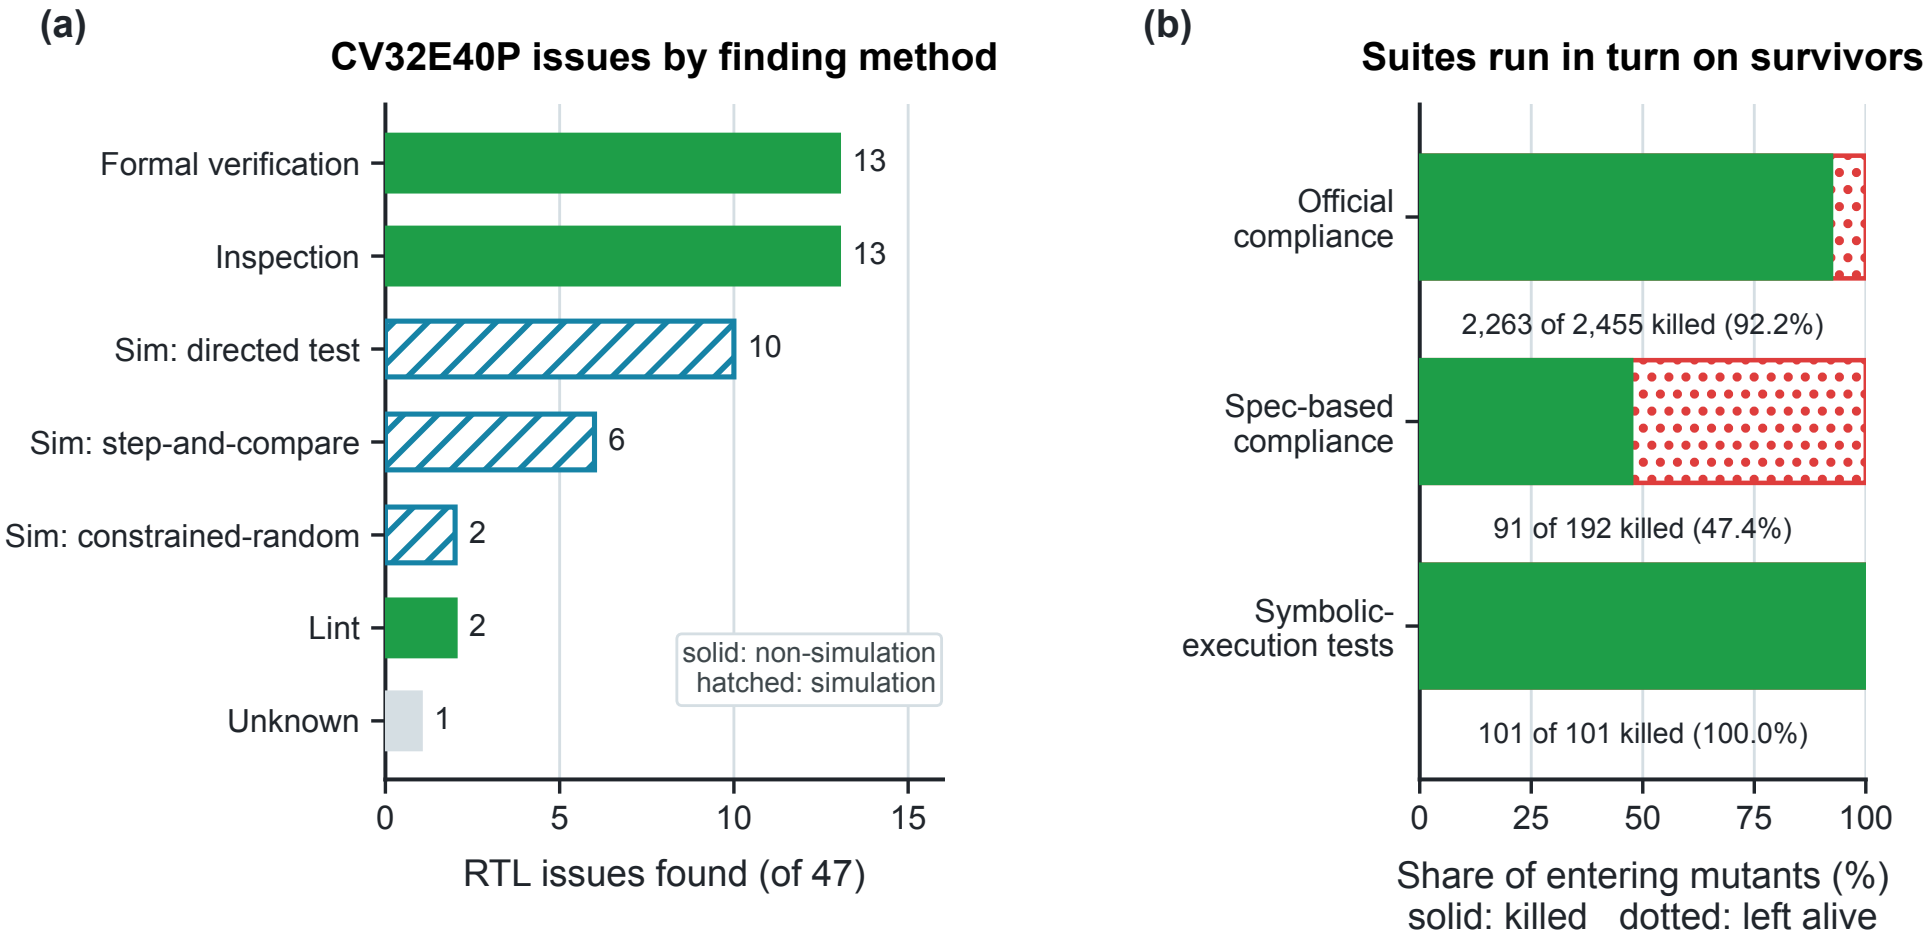

(a)
CV32E40P issues by finding method
Formal verification
Inspection
Sim: directed test
Sim: step-and-compare
Sim: constrained-random
Lint
Unknown
13
13
10
6
2
2
1
solid: non-simulation
hatched: simulation
0
5
10
15
RTL issues found (of 47)
(b)
Suites run in turn on survivors
Official compliance
2,263 of 2,455 killed (92.2%)
Spec-based compliance
91 of 192 killed (47.4%)
Symbolic-execution tests
101 of 101 killed (100.0%)
0
25
50
75
100
Share of entering mutants (%)
solid: killed dotted: left alive