CODE

COMMENTARY

critical section checks are required at a distance d/2 beyond any point where variations in shear reinforcement occur, such as changes in size, spacing, or configuration.

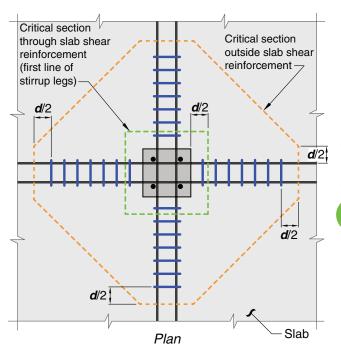


Fig. R22.6.4.2a—Critical sections for two-way shear in slab with shear reinforcement at interior column.

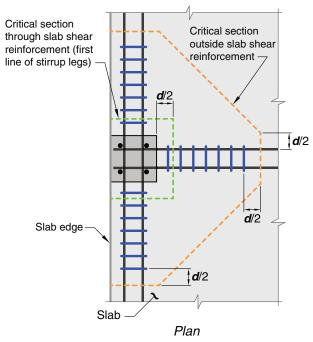


Fig. R22.6.4.2b—Critical sections for two-way shear in slab with shear reinforcement at edge column.