



Hazardous Area

PR 20

ΔP Range: 0 to 0.075 upto 4 bar 0 to 1 upto 60 psi

COMBINATIONS

Gauge + switch (with a terminal strip inside)







Specifications

Accuracy

Migration

Range

First marking on the scale

Sensing element

Wetted parts

Case material & dial size

Mounting

Maximum working pressure

Maximum process temperature

Body material Diaphragm

Window Connection

Porting

Over range protection Protection for gauge & switch

Electrical connection

Net weight

±2% of the FSD (Ascending)

No migration: Zero leakage from high to low port

0-0.075 to 0-4 bar or equivalent range in other units

20% of the FSD

Diaphragm

Body material, SS 302 spring, ceramic magnet & seals

Stainless steel (SS 304): 4.5", 6.0"

Direct or 2" horizontal / vertical pipe mounting bracket

100 bar / 1500 psi 0 to 80°C (32 to 175°F)

SS316 attached to flameproof aluminium enclosure

Buna-N, Viton, EPDM

Float glass(Std.), toughened glass, & safety glass.

1/4" NPT(F) (Std.), 1/4" BSP(F) through adaptor

In-line only

Up to the max. working pressure from high & low side

IP 66 / NEMA-4X

1/2"NPT(F) for 2 conduit ports at bottom,

left and right 40° from center line.

Cable glands and plugs are not supplied with the instrument.

Approximately 2.500 kgs.

Options

Customerlogo Dual scale

Color band


Switches (Adjustable in 40-100% of FSD)

1 or 2 SPSTs with a terminal strip 1 or 2 SPDTs with a terminal strip

Filter mesh in (+) connection

COMMON MOUNTING BRACKET

Horizontal pipe mounting

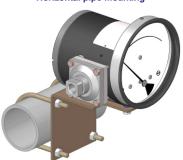

Vertical pipe mounting



