

TOOLS & AIDS

SEARCH

BACK NEXT

# 1. Exploratory Data Analysis

This chapter presents the assumptions, principles, and techniques necessary to gain insight into data via EDA--exploratory data analysis.

# 1. EDA Introduction

- 1. What is EDA?
- 2. EDA vs Classical & **Bayesian**
- 3. EDA vs Summary
- 4. EDA Goals
- 5. The Role of Graphics
- 6. An EDA/Graphics Example
- 7. General Problem Categories

# 2. EDA Assumptions

- 1. <u>Underlying Assumptions</u>
- 2. Importance
- 3. Techniques for Testing **Assumptions**
- 4. Interpretation of 4-Plot
- 5. Consequences

# 3. EDA Techniques

- 1. <u>Introduction</u>
- 2. Analysis Questions
- 3. Graphical Techniques: **Alphabetical**
- 4. Graphical Techniques: By **Problem Category**
- 5. Quantitative Techniques
- 6. Probability Distributions

### 4. EDA Case Studies

- 1. <u>Introduction</u>
- 2. By Problem Category

**Detailed Chapter Table of Contents** 

References

**Dataplot Commands for EDA Techniques** 



HOME

TOOLS & AIDS

SEARCH

# 1. Exploratory Data Analysis - Detailed Table of Contents [1.]

This chapter presents the assumptions, principles, and techniques necessary to gain insight into data via EDA-exploratory data analysis.

- 1. EDA Introduction [1.1.]
  - 1. What is EDA? [1.1.1.]
  - 2. How Does Exploratory Data Analysis differ from Classical Data Analysis? [1.1.2.]
    - 1. <u>Model</u> [1.1.2.1.]
    - 2. Focus [1.1.2.2.]
    - 3. <u>Techniques</u> [1.1.2.3.]
    - 4. <u>Rigor</u> [1.1.2.4.]
    - 5. <u>Data Treatment</u> [1.1.2.5.]
    - 6. <u>Assumptions</u> [1.1.2.6.]
  - 3. How Does Exploratory Data Analysis Differ from Summary Analysis? [1.1.3.]
  - 4. What are the EDA Goals? [1.1.4.]
  - 5. The Role of Graphics [1.1.5.]
  - 6. An EDA/Graphics Example [1.1.6.]
  - 7. General Problem Categories [1.1.7.]
- 2. EDA Assumptions [1.2.]
  - 1. <u>Underlying Assumptions</u> [1.2.1.]
  - 2. <u>Importance</u> [1.2.2.]
  - 3. Techniques for Testing Assumptions [1.2.3.]
  - 4. Interpretation of 4-Plot [1.2.4.]
  - 5. Consequences [1.2.5.]
    - 1. Consequences of Non-Randomness [1.2.5.1.]
    - 2. Consequences of Non-Fixed Location Parameter [1.2.5.2.]
    - 3. Consequences of Non-Fixed Variation Parameter [1.2.5.3.]
    - 4. Consequences Related to Distributional Assumptions [1.2.5.4.]
- 3. EDA Techniques [1.3.]
  - 1. <u>Introduction</u> [1.3.1.]
  - 2. Analysis Ouestions [1.3.2.]
  - 3. Graphical Techniques: Alphabetic [1.3.3.]
    - 1. Autocorrelation Plot [1.3.3.1.]
      - 1. Autocorrelation Plot: Random Data [1.3.3.1.1.]
      - 2. <u>Autocorrelation Plot: Moderate Autocorrelation</u> [1.3.3.1.2.]
      - 3. Autocorrelation Plot: Strong Autocorrelation and Autoregressive Model [1.3.3.1.3.]
      - 4. Autocorrelation Plot: Sinusoidal Model [1.3.3.1.4.]
    - 2. Bihistogram [1.3.3.2.]
    - 3. <u>Block Plot</u> [1.3.3.3.]
    - 4. Bootstrap Plot [1.3.3.4.]
    - 5. Box-Cox Linearity Plot [1.3.3.5.]
    - 6. Box-Cox Normality Plot [1.3.3.6.]
    - 7. <u>Box Plot</u> [1.3.3.7.]

- 8. Complex Demodulation Amplitude Plot [1.3.3.8.]
- 9. Complex Demodulation Phase Plot [1.3.3.9.]
- 10. <u>Contour Plot</u> [1.3.3.10.]
  - 1. <u>DOE Contour Plot</u> [1.3.3.10.1.]
- 11. <u>DOE Scatter Plot</u> [1.3.3.11.]
- 12. <u>DOE Mean Plot</u> [1.3.3.12.]
- 13. DOE Standard Deviation Plot [1.3.3.13.]
- 14. <u>Histogram</u> [1.3.3.14.]
  - 1. <u>Histogram Interpretation: Normal</u> [1.3.3.14.1.]
  - 2. <u>Histogram Interpretation: Symmetric, Non-Normal, Short-Tailed</u> [1.3.3.14.2.]
  - 3. <u>Histogram Interpretation: Symmetric, Non-Normal, Long-Tailed</u> [1.3.3.14.3.]
  - 4. <u>Histogram Interpretation: Symmetric and Bimodal</u> [1.3.3.14.4.]
  - 5. <u>Histogram Interpretation: Bimodal Mixture of 2 Normals</u> [1.3.3.14.5.]
  - 6. <u>Histogram Interpretation: Skewed (Non-Normal) Right</u> [1.3.3.14.6.]
  - 7. <u>Histogram Interpretation: Skewed (Non-Symmetric) Left</u> [1.3.3.14.7.]
  - 8. <u>Histogram Interpretation: Symmetric with Outlier</u> [1.3.3.14.8.]
- 15. <u>Lag Plot</u> [1.3.3.15.]
  - 1. <u>Lag Plot: Random Data</u> [1.3.3.15.1.]
  - 2. Lag Plot: Moderate Autocorrelation [1.3.3.15.2.]
  - 3. Lag Plot: Strong Autocorrelation and Autoregressive Model [1.3.3.15.3.]
  - 4. Lag Plot: Sinusoidal Models and Outliers [1.3.3.15.4.]
- 16. <u>Linear Correlation Plot</u> [1.3.3.16.]
- 17. Linear Intercept Plot [1.3.3.17.]
- 18. <u>Linear Slope Plot</u> [1.3.3.18.]
- 19. <u>Linear Residual Standard Deviation Plot</u> [1.3.3.19.]
- 20. Mean Plot [1.3.3.20.]
- 21. Normal Probability Plot [1.3.3.21.]
  - 1. Normal Probability Plot: Normally Distributed Data [1.3.3.21.1.]
  - 2. Normal Probability Plot: Data Have Short Tails [1.3.3.21.2.]
  - 3. Normal Probability Plot: Data Have Long Tails [1.3.3.21.3.]
  - 4. Normal Probability Plot: Data are Skewed Right [1.3.3.21.4.]
- 22. Probability Plot [1.3.3.22.]
- 23. Probability Plot Correlation Coefficient Plot [1.3.3.23.]
- 24. Quantile-Quantile Plot [1.3.3.24.]
- 25. Run-Sequence Plot [1.3.3.25.]
- 26. <u>Scatter Plot</u> [1.3.3.26.]
  - 1. Scatter Plot: No Relationship [1.3.3.26.1.]
  - 2. Scatter Plot: Strong Linear (positive correlation) Relationship [1.3.3.26.2.]
  - 3. Scatter Plot: Strong Linear (negative correlation) Relationship [1.3.3.26.3.]
  - 4. Scatter Plot: Exact Linear (positive correlation) Relationship [1.3.3.26.4.]
  - 5. Scatter Plot: Quadratic Relationship [1.3.3.26.5.]
  - 6. Scatter Plot: Exponential Relationship [1.3.3.26.6.]
  - 7. Scatter Plot: Sinusoidal Relationship (damped) [1.3.3.26.7.]
  - 8. Scatter Plot: Variation of Y Does Not Depend on X (homoscedastic) [1.3.3.26.8.]
  - 9. Scatter Plot: Variation of Y Does Depend on X (heteroscedastic) [1.3.3.26.9.]
  - 10. Scatter Plot: Outlier [1.3.3.26.10.]
  - 11. <u>Scatterplot Matrix</u> [1.3.3.26.11.]
  - 12. <u>Conditioning Plot</u> [1.3.3.26.12.]
- 27. Spectral Plot [1.3.3.27.]
  - 1. Spectral Plot: Random Data [1.3.3.27.1.]
  - 2. Spectral Plot: Strong Autocorrelation and Autoregressive Model [1.3.3.27.2.]
  - 3. Spectral Plot: Sinusoidal Model [1.3.3.27.3.]
- 28. Standard Deviation Plot [1.3.3.28.]
- 29. Star Plot [1.3.3.29.]

- 30. Weibull Plot [1.3.3.30.]
- 31. Youden Plot [1.3.3.31.]
  - 1. <u>DOE Youden Plot</u> [1.3.3.31.1.]
- 32. <u>4-Plot</u> [1.3.3.32.]
- 33. <u>6-Plot</u> [1.3.3.33.]
- 4. Graphical Techniques: By Problem Category [1.3.4.]
- 5. Quantitative Techniques [1.3.5.]
  - 1. Measures of Location [1.3.5.1.]
  - 2. Confidence Limits for the Mean [1.3.5.2.]
  - 3. Two-Sample t-Test for Equal Means [1.3.5.3.]
    - 1. <u>Data Used for Two-Sample *t*-Test</u> [1.3.5.3.1.]
  - 4. <u>One-Factor ANOVA</u> [1.3.5.4.]
  - 5. Multi-factor Analysis of Variance [1.3.5.5.]
  - 6. Measures of Scale [1.3.5.6.]
  - 7. Bartlett's Test [1.3.5.7.]
  - 8. Chi-Square Test for the Standard Deviation [1.3.5.8.]
    - 1. <u>Data Used for Chi-Square Test for the Standard Deviation</u> [1.3.5.8.1.]
  - 9. F-Test for Equality of Two Standard Deviations [1.3.5.9.]
  - 10. Levene Test for Equality of Variances [1.3.5.10.]
  - 11. Measures of Skewness and Kurtosis [1.3.5.11.]
  - 12. Autocorrelation [1.3.5.12.]
  - 13. Runs Test for Detecting Non-randomness [1.3.5.13.]
  - 14. Anderson-Darling Test [1.3.5.14.]
  - 15. Chi-Square Goodness-of-Fit Test [1.3.5.15.]
  - 16. Kolmogorov-Smirnov Goodness-of-Fit Test [1.3.5.16.]
  - 17. Grubbs' Test for Outliers [1.3.5.17.]
  - 18. <u>Yates Analysis</u> [1.3.5.18.]
    - 1. <u>Defining Models and Prediction Equations</u> [1.3.5.18.1.]
    - 2. <u>Important Factors</u> [1.3.5.18.2.]
- 6. Probability Distributions [1.3.6.]
  - 1. What is a Probability Distribution [1.3.6.1.]
  - 2. Related Distributions [1.3.6.2.]
  - 3. Families of Distributions [1.3.6.3.]
  - 4. Location and Scale Parameters [1.3.6.4.]
  - 5. Estimating the Parameters of a Distribution [1.3.6.5.]
    - 1. Method of Moments [1.3.6.5.1.]
    - 2. Maximum Likelihood [1.3.6.5.2.]
    - 3. <u>Least Squares</u> [1.3.6.5.3.]
    - 4. PPCC and Probability Plots [1.3.6.5.4.]
  - 6. Gallery of Distributions [1.3.6.6.]
    - 1. Normal Distribution [1.3.6.6.1.]
    - 2. <u>Uniform Distribution</u> [1.3.6.6.2.]
    - 3. Cauchy Distribution [1.3.6.6.3.]
    - 4. <u>t Distribution</u> [1.3.6.6.4.]
    - 5. <u>F Distribution</u> [1.3.6.6.5.]
    - 6. Chi-Square Distribution [1.3.6.6.6.]
    - 7. Exponential Distribution [1.3.6.6.7.]
    - 8. Weibull Distribution [1.3.6.6.8.]
    - 9. Lognormal Distribution [1.3.6.6.9.]
    - 10. Fatigue Life Distribution [1.3.6.6.10.]
    - 11. Gamma Distribution [1.3.6.6.11.]
    - 12. <u>Double Exponential Distribution</u> [1.3.6.6.12.]
    - 13. Power Normal Distribution [1.3.6.6.13.]
    - 14. Power Lognormal Distribution [1.3.6.6.14.]

- 15. Tukey-Lambda Distribution [1.3.6.6.15.]
- 16. Extreme Value Type I Distribution [1.3.6.6.16.]
- 17. Beta Distribution [1.3.6.6.17.]
- 18. Binomial Distribution [1.3.6.6.18.]
- 19. <u>Poisson Distribution</u> [1.3.6.6.19.]
- 7. Tables for Probability Distributions [1.3.6.7.]
  - 1. <u>Cumulative Distribution Function of the Standard Normal Distribution</u> [1.3.6.7.1.]
  - 2. <u>Upper Critical Values of the Student's-t Distribution</u> [1.3.6.7.2.]
  - 3. <u>Upper Critical Values of the F Distribution</u> [1.3.6.7.3.]
  - 4. Critical Values of the Chi-Square Distribution [1.3.6.7.4.]
  - 5. Critical Values of the t<sup>\*</sup> Distribution [1.3.6.7.5.]
  - 6. Critical Values of the Normal PPCC Distribution [1.3.6.7.6.]
- 4. EDA Case Studies [1.4.]
  - 1. Case Studies Introduction [1.4.1.]
  - 2. <u>Case Studies</u> [1.4.2.]
    - 1. Normal Random Numbers [1.4.2.1.]
      - 1. Background and Data [1.4.2.1.1.]
      - 2. Graphical Output and Interpretation [1.4.2.1.2.]
      - 3. Quantitative Output and Interpretation [1.4.2.1.3.]
      - 4. Work This Example Yourself [1.4.2.1.4.]
    - 2. <u>Uniform Random Numbers</u> [1.4.2.2.]
      - 1. Background and Data [1.4.2.2.1.]
      - 2. Graphical Output and Interpretation [1.4.2.2.2.]
      - 3. Quantitative Output and Interpretation [1.4.2.2.3.]
      - 4. Work This Example Yourself [1.4.2.2.4.]
    - 3. Random Walk [1.4.2.3.]
      - 1. Background and Data [1.4.2.3.1.]
      - 2. Test Underlying Assumptions [1.4.2.3.2.]
      - 3. Develop A Better Model [1.4.2.3.3.]
      - 4. <u>Validate New Model</u> [1.4.2.3.4.]
      - 5. Work This Example Yourself [1.4.2.3.5.]
    - 4. Josephson Junction Cryothermometry [1.4.2.4.]
      - 1. Background and Data [1.4.2.4.1.]
      - 2. Graphical Output and Interpretation [1.4.2.4.2.]
      - 3. Quantitative Output and Interpretation [1.4.2.4.3.]
      - 4. Work This Example Yourself [1.4.2.4.4.]
    - 5. Beam Deflections [1.4.2.5.]
      - 1. Background and Data [1.4.2.5.1.]
      - 2. Test Underlying Assumptions [1.4.2.5.2.]
      - 3. Develop a Better Model [1.4.2.5.3.]
      - 4. <u>Validate New Model</u> [1.4.2.5.4.]
      - 5. Work This Example Yourself [1.4.2.5.5.]
    - 6. Filter Transmittance [1.4.2.6.]
      - 1. Background and Data [1.4.2.6.1.]
      - 2. Graphical Output and Interpretation [1.4.2.6.2.]
      - 3. Quantitative Output and Interpretation [1.4.2.6.3.]
      - 4. Work This Example Yourself [1.4.2.6.4.]
    - 7. Standard Resistor [1.4.2.7.]
      - 1. Background and Data [1.4.2.7.1.]
      - 2. Graphical Output and Interpretation [1.4.2.7.2.]
      - 3. Quantitative Output and Interpretation [1.4.2.7.3.]
      - 4. Work This Example Yourself [1.4.2.7.4.]

- 8. Heat Flow Meter 1 [1.4.2.8.]
  - 1. Background and Data [1.4.2.8.1.]
  - 2. <u>Graphical Output and Interpretation</u> [1.4.2.8.2.]
  - 3. Quantitative Output and Interpretation [1.4.2.8.3.]
  - 4. Work This Example Yourself [1.4.2.8.4.]
- 9. Fatigue Life of Aluminum Alloy Specimens [1.4.2.9.]
  - 1. Background and Data [1.4.2.9.1.]
  - 2. Graphical Output and Interpretation [1.4.2.9.2.]
- 10. Ceramic Strength [1.4.2.10.]
  - 1. Background and Data [1.4.2.10.1.]
  - 2. Analysis of the Response Variable [1.4.2.10.2.]
  - 3. Analysis of the Batch Effect [1.4.2.10.3.]
  - 4. Analysis of the Lab Effect [1.4.2.10.4.]
  - 5. Analysis of Primary Factors [1.4.2.10.5.]
  - 6. Work This Example Yourself [1.4.2.10.6.]
- 3. References For Chapter 1: Exploratory Data Analysis [1.4.3.]





TOOLS & AIDS

SEARCH

BACK NEXT

#### 1. Exploratory Data Analysis

# 1.1. EDA Introduction

## Summary

What is exploratory data analysis? How did it begin? How and where did it originate? How is it differentiated from other data analysis approaches, such as classical and Bayesian? Is EDA the same as statistical graphics? What role does statistical graphics play in EDA? Is statistical graphics identical to EDA?

These questions and related questions are dealt with in this section. This section answers these questions and provides the necessary frame of reference for EDA assumptions, principles, and techniques.

Table of Contents for Section 1

- 1. What is EDA?
- 2. EDA versus Classical and Bayesian
  - 1. Models
  - 2. Focus
  - 3. Techniques
  - 4. Rigor
  - 5. Data Treatment
  - 6. Assumptions
- 3. EDA vs Summary
- 4. EDA Goals
- 5. The Role of Graphics
- 6. An EDA/Graphics Example
- 7. General Problem Categories



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# **1.1.1.** What is EDA?

### *Approach*

Exploratory Data Analysis (EDA) is an approach/philosophy for data analysis that employs a variety of techniques (mostly graphical) to

- 1. maximize insight into a data set;
- 2. uncover underlying structure;
- 3. extract important variables;
- 4. detect outliers and anomalies;
- 5. test underlying assumptions;
- 6. develop parsimonious models; and
- 7. determine optimal factor settings.

#### Focus

The EDA approach is precisely that--an approach--not a set of techniques, but an attitude/philosophy about how a data analysis should be carried out.

### *Philosophy*

EDA is not identical to statistical graphics although the two terms are used almost interchangeably. Statistical graphics is a collection of techniques--all graphically based and all focusing on one data characterization aspect. EDA encompasses a larger venue; EDA is an approach to data analysis that postpones the usual assumptions about what kind of model the data follow with the more direct approach of allowing the data itself to reveal its underlying structure and model. EDA is not a mere collection of techniques; EDA is a philosophy as to how we dissect a data set; what we look for; how we look; and how we interpret. It is true that EDA heavily uses the collection of techniques that we call "statistical graphics", but it is not identical to statistical graphics per se.

# History

The seminal work in EDA is Exploratory Data Analysis, Tukey, (1977). Over the years it has benefitted from other noteworthy publications such as Data Analysis and Regression, Mosteller and Tukey (1977), Interactive Data Analysis, Hoaglin (1977), The ABC's of EDA, Velleman and Hoaglin (1981) and has gained a large following as "the" way to analyze a data set.

# *Techniques*

Most EDA techniques are graphical in nature with a few quantitative techniques. The reason for the heavy reliance on graphics is that by its very nature the main role of EDA is to open-mindedly explore, and graphics gives the analysts unparalleled power to do so, enticing the data to reveal its structural secrets, and being always ready to gain some new, often unsuspected, insight into the data. In combination with the natural pattern-recognition capabilities that we all possess, graphics provides, of course, unparalleled power to carry this out.

The particular graphical techniques employed in EDA are often quite simple, consisting of various techniques of:

- 1. Plotting the raw data (such as <u>data traces</u>, <u>histograms</u>, bihistograms, probability plots, lag plots, block plots, and <u>Youden plots</u>.
- 2. Plotting simple statistics such as mean plots, standard deviation plots, box plots, and main effects plots of the raw data.
- 3. Positioning such plots so as to maximize our natural pattern-recognition abilities, such as using multiple plots per page.



HOME

TOOLS & AIDS

SEARCH



- ludant lidded & wie
- 1.1. EDA Introduction

1. Exploratory Data Analysis

# 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

Data Analysis Approaches EDA is a data analysis approach. What other data analysis approaches exist and how does EDA differ from these other approaches? Three popular data analysis approaches are:

- 1. Classical
- 2. Exploratory (EDA)
- 3. Bayesian

Paradigms for Analysis Techniques These three approaches are similar in that they all start with a general science/engineering problem and all yield science/engineering conclusions. The difference is the sequence and focus of the intermediate steps.

For classical analysis, the sequence is

Problem => Data => Model => Analysis => Conclusions

For EDA, the sequence is

Problem => Data => Analysis => Model => Conclusions

For Bayesian, the sequence is

Problem => Data => Model => Prior Distribution => Analysis => Conclusions

Method of dealing with underlying model for the data distinguishes the 3 approaches Thus for classical analysis, the data collection is followed by the imposition of a model (normality, linearity, etc.) and the analysis, estimation, and testing that follows are focused on the parameters of that model. For EDA, the data collection is not followed by a model imposition; rather it is followed immediately by analysis with a goal of inferring what model would be appropriate. Finally, for a Bayesian analysis, the analyst attempts to incorporate scientific/engineering knowledge/expertise into the analysis by imposing a data-independent distribution on the parameters of the selected model; the analysis thus consists of formally combining both the prior distribution on the parameters and the collected

data to jointly make inferences and/or test assumptions about the model parameters.

In the real world, data analysts freely mix elements of all of the above three approaches (and other approaches). The above distinctions were made to emphasize the major differences among the three approaches.

Further discussion of

Focusing on EDA versus classical, these two approaches differ as follows:

the

distinction
between the
classical and
EDA

1. Models
2. Focus
3. Techniques
4. Rigor

approaches
5. Data Treatment
6. Assumptions



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# 1.1.2.1. Model

#### Classical

The classical approach imposes models (both deterministic and probabilistic) on the data. Deterministic models include, for example, regression models and analysis of variance (ANOVA) models. The most common probabilistic model assumes that the errors about the deterministic model are normally distributed--this assumption affects the validity of the ANOVA F tests.

# **Exploratory**

The Exploratory Data Analysis approach does not impose deterministic or probabilistic models on the data. On the contrary, the EDA approach allows the data to suggest admissible models that best fit the data.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# **1.1.2.2.** Focus

Classical The two approaches differ substantially in focus. For classical

> analysis, the focus is on the model--estimating parameters of the model and generating predicted values from the model.

For exploratory data analysis, the focus is on the data--its **Exploratory** 

structure, outliers, and models suggested by the data.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# **1.1.2.3.** Techniques

Classical Classical techniques are generally quantitative in nature. They

include ANOVA, t tests, chi-squared tests, and F tests.

**Exploratory** EDA techniques are generally graphical. They include scatter

plots, character plots, box plots, histograms, bihistograms,

probability plots, residual plots, and mean plots.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# 1.1.2.4. Rigor

Classical

Classical techniques serve as the probabilistic foundation of science and engineering; the most important characteristic of classical techniques is that they are rigorous, formal, and "objective".

**Exploratory** 

EDA techniques do not share in that rigor or formality. EDA techniques make up for that lack of rigor by being very suggestive, indicative, and insightful about what the appropriate model should be.

EDA techniques are subjective and depend on interpretation which may differ from analyst to analyst, although experienced analysts commonly arrive at identical conclusions.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# 1.1.2.5. Data Treatment

## Classical

Classical estimation techniques have the characteristic of taking all of the data and mapping the data into a few numbers ("estimates"). This is both a virtue and a vice. The virtue is that these few numbers focus on important characteristics (location, variation, etc.) of the population. The vice is that concentrating on these few characteristics can filter out other characteristics (skewness, tail length, autocorrelation, etc.) of the same population. In this sense there is a loss of information due to this "filtering" process.

# **Exploratory**

The EDA approach, on the other hand, often makes use of (and shows) all of the available data. In this sense there is no corresponding loss of information.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction
- 1.1.2. How Does Exploratory Data Analysis differ from Classical Data Analysis?

# **1.1.2.6. Assumptions**

#### Classical

The "good news" of the classical approach is that tests based on classical techniques are usually very sensitive--that is, if a true shift in location, say, has occurred, such tests frequently have the power to detect such a shift and to conclude that such a shift is "statistically significant". The "bad news" is that classical tests depend on underlying assumptions (e.g., normality), and hence the validity of the test conclusions becomes dependent on the validity of the underlying assumptions. Worse yet, the exact underlying assumptions may be unknown to the analyst, or if known, untested. Thus the validity of the scientific conclusions becomes intrinsically linked to the validity of the underlying assumptions. In practice, if such assumptions are unknown or untested, the validity of the scientific conclusions becomes suspect.

### **Exploratory**

Many EDA techniques make little or no assumptions--they present and show the data--all of the data--as is, with fewer encumbering assumptions.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# 1.1.3. How Does Exploratory Data Analysis **Differ from Summary Analysis?**

### Summary

A summary analysis is simply a numeric reduction of a historical data set. It is quite passive. Its focus is in the past. Quite commonly, its purpose is to simply arrive at a few key statistics (for example, mean and standard deviation) which may then either replace the data set or be added to the data set in the form of a summary table.

## **Exploratory**

In contrast, EDA has as its broadest goal the desire to gain insight into the engineering/scientific process behind the data. Whereas summary statistics are passive and historical, EDA is active and futuristic. In an attempt to "understand" the process and improve it in the future, EDA uses the data as a "window" to peer into the heart of the process that generated the data. There is an archival role in the research and manufacturing world for summary statistics, but there is an enormously larger role for the EDA approach.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# 1.1.4. What are the EDA Goals?

Primary and Secondary Goals The primary goal of EDA is to maximize the analyst's insight into a data set and into the underlying structure of a data set, while providing all of the specific items that an analyst would want to extract from a data set, such as:

- 1. a good-fitting, parsimonious model
- 2. a list of outliers
- 3. a sense of robustness of conclusions
- 4. estimates for parameters
- 5. uncertainties for those estimates
- 6. a ranked list of important factors
- 7. conclusions as to whether individual factors are statistically significant
- 8. optimal settings

Insight into the Data

Insight implies detecting and uncovering underlying structure in the data. Such underlying structure may not be encapsulated in the list of items above; such items serve as the specific targets of an analysis, but the real insight and "feel" for a data set comes as the analyst judiciously probes and explores the various subtleties of the data. The "feel" for the data comes almost exclusively from the application of various graphical techniques, the collection of which serves as the window into the essence of the data. Graphics are irreplaceable--there are no quantitative analogues that will give the same insight as well-chosen graphics.

To get a "feel" for the data, it is not enough for the analyst to know what is in the data; the analyst also must know what is not in the data, and the only way to do that is to draw on our own human pattern-recognition and comparative abilities in the context of a series of judicious graphical techniques applied to the data.



HOME

TOOLS & AIDS

SEARCH



OLS & AIDS SEARCH

7

BACK NEXT

- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# 1.1.5. The Role of Graphics

# Quantitative/ Graphical

Statistics and data analysis procedures can broadly be split into two parts:

- quantitative
- graphical

# **Quantitative**

Quantitative techniques are the set of statistical procedures that yield numeric or tabular output. Examples of quantitative techniques include:

- hypothesis testing
- analysis of variance
- point estimates and confidence intervals
- least squares regression

These and similar techniques are all valuable and are mainstream in terms of classical analysis.

# **Graphical**

On the other hand, there is a large collection of statistical tools that we generally refer to as graphical techniques. These include:

- scatter plots
- histograms
- probability plots
- residual plots
- box plots
- block plots

EDA
Approach
Relies
Heavily on
Graphical
Techniques

The EDA approach relies heavily on these and similar graphical techniques. Graphical procedures are not just tools that we could use in an EDA context, they are tools that we must use. Such graphical tools are the shortest path to gaining insight into a data set in terms of

- testing assumptions
- model selection
- model validation
- estimator selection
- relationship identification
- factor effect determination

• outlier detection

If one is not using statistical graphics, then one is forfeiting insight into one or more aspects of the underlying structure of the data.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# 1.1.6. An EDA/Graphics Example

Anscombe Example A simple, classic (<u>Anscombe</u>) example of the central role that graphics play in terms of providing insight into a data set starts with the following data set:

Data


X	Y
10.00	8.04
8.00	6.95
13.00	7.58
9.00	8.81
11.00	8.33
14.00	9.96
6.00	7.24
4.00	4.26
12.00	10.84
7.00	4.82
5.00	5.68

Summary Statistics If the goal of the analysis is to compute summary statistics plus determine the best linear fit for Y as a function of X, the results might be given as:

$$N = 11$$
  
Mean of  $X = 9.0$   
Mean of  $Y = 7.5$   
Intercept = 3  
Slope = 0.5  
Residual standard deviation = 1.237  
Correlation = 0.816

The above quantitative analysis, although valuable, gives us only limited insight into the data.

Scatter Plot In contrast, the following simple scatter plot of the data

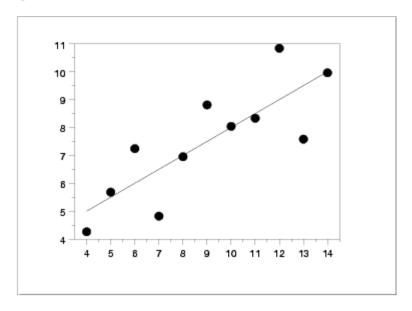

# suggests the following:

- 1. The data set "behaves like" a linear curve with some scatter;
- 2. there is no justification for a more complicated model (e.g., quadratic);
- 3. there are no outliers;
- 4. the vertical spread of the data appears to be of equal height irrespective of the *X*-value; this indicates that the data are equally-precise throughout and so a "regular" (that is, equi-weighted) fit is appropriate.

Three Additional Data Sets This kind of characterization for the data serves as the core for getting insight/feel for the data. Such insight/feel does not come from the quantitative statistics; on the contrary, calculations of quantitative statistics such as intercept and slope should be subsequent to the characterization and will make sense only if the characterization is true. To illustrate the loss of information that results when the graphics insight step is skipped, consider the following three data sets [Anscombe data sets 2, 3, and 4]:

X2	Y2	X3	Y3	X4	Y4
10.00	9.14	10.00	7.46	8.00	6.58
8.00	8.14	8.00	6.77	8.00	5.76
13.00	8.74	13.00	12.74	8.00	7.71
9.00	8.77	9.00	7.11	8.00	8.84
11.00	9.26	11.00	7.81	8.00	8.47
14.00	8.10	14.00	8.84	8.00	7.04
6.00	6.13	6.00	6.08	8.00	5.25
4.00	3.10	4.00	5.39	19.00	12.50
12.00	9.13	12.00	8.15	8.00	5.56
7.00	7.26	7.00	6.42	8.00	7.91
5.00	4.74	5.00	5.73	8.00	6.89

Quantitative Statistics for Data Set 2 A quantitative analysis on data set 2 yields

N = 11Mean of X = 9.0Mean of Y = 7.5Intercept = 3 Slope = 0.5 Residual standard deviation = 1.237 Correlation = 0.816


which is identical to the analysis for data set 1. One might naively assume that the two data sets are "equivalent" since that is what the statistics tell us; but what do the statistics not tell us?

Quantitative Statistics for Data Sets 3 and 4 Remarkably, a quantitative analysis on data sets 3 and 4 also yields

N = 11Mean of X = 9.0Mean of Y = 7.5Intercept = 3 Slope = 0.5 Residual standard deviation = 1.236 Correlation = 0.816 (0.817 for data set 4)

which implies that in some quantitative sense, all four of the data sets are "equivalent". In fact, the four data sets are far from "equivalent" and a scatter plot of each data set, which would be step 1 of any EDA approach, would tell us that immediately.

#### Scatter Plots

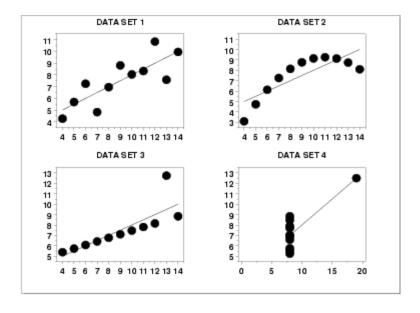

Interpretation of Scatter Plots

Conclusions from the scatter plots are:

- 1. data set 1 is clearly linear with some scatter.
- 2. data set 2 is clearly quadratic.
- 3. data set 3 clearly has an outlier.
- 4. data set 4 is obviously the victim of a poor experimental design with a single point far removed from the bulk of the data "wagging the dog".

*Importance* 

These points are exactly the substance that provide and

of **Exploratory** Analysis

define "insight" and "feel" for a data set. They are the goals and the fruits of an open exploratory data analysis (EDA) approach to the data. Quantitative statistics are not wrong per se, but they are incomplete. They are incomplete because they are numeric **summaries** which in the summarization operation do a good job of focusing on a particular aspect of the data (e.g., location, intercept, slope, degree of relatedness, etc.) by judiciously reducing the data to a few numbers. Doing so also **filters** the data, necessarily omitting and screening out other sometimes crucial information in the focusing operation. Quantitative statistics focus but also filter; and filtering is exactly what makes the quantitative approach incomplete at best and misleading at worst.

The estimated intercepts (= 3) and slopes (= 0.5) for data sets 2, 3, and 4 are misleading because the estimation is done in the context of an assumed linear model and that linearity assumption is the fatal flaw in this analysis.

The EDA approach of deliberately postponing the model selection until further along in the analysis has many rewards, not the least of which is the ultimate convergence to a much-improved model and the formulation of valid and supportable scientific and engineering conclusions.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.1. EDA Introduction

# **1.1.7.** General Problem Categories

Problem Classification

The following table is a convenient way to classify EDA problems.

Univariate and Control

# UNIVARIATE

Data:

A single column of numbers, *Y*.

Model:

$$y = constant + error$$

# Output:

- 1. A number (the estimated constant in the model).
- 2. An estimate of uncertainty for the constant.
- 3. An estimate of the distribution for the error.

## Techniques:

- <u>4-Plot</u>
- Probability Plot
- PPCC Plot

# **CONTROL**

Data:

A single column of numbers, *Y*.

Model:

$$y = constant + error$$

Output:

A "yes" or "no" to the question "Is the system out of control? ".

Techniques:

• Control Charts

Comparative and Screening

### COMPARATIVE

Data:

A single response variable and k independent variables  $(Y, X_1, X_2, ..., X_k)$ , primary focus is on

### **SCREENING**

Data:

A single response variable and k independent variables  $(Y, X_1, X_2, \dots, X_k)$ .

*one* (the primary factor) of these independent variables.

## Model:

$$y = f(x_1, x_2, ..., x_k) +$$
  
error

# Output:

A "yes" or "no" to the question "Is the primary factor significant?".

# Techniques:

- Block Plot
- Scatter Plot
- Box Plot

# Model:

$$y = f(x_1, x_2, ..., x_k) +$$

# Output:

- 1. A ranked list (from most important to least important) of factors.
- 2. Best settings for the factors.
- 3. A good model/prediction equation relating *Y* to the factors.

# Techniques:

- Block Plot
- Probability Plot
- Bihistogram

# Optimization and Regression

# **OPTIMIZATION**

## Data:

A single response variable and k independent variables  $(Y, X_1, X_2, ..., X_k)$ .

#### Model:

$$y = f(x_1, x_2, ..., x_k) +$$

# Output:

Best settings for the factor variables.

# Techniques:

- Block Plot
- Least Squares Fitting
- Contour Plot

# REGRESSION

## Data:

A single response variable and k independent variables  $(Y, X_1, X_2, ..., X_k)$ . The independent variables can be continuous.

### Model:

$$y = f(x_1, x_2, ..., x_k) +$$
  
error

# Output:

A good model/prediction equation relating *Y* to the factors.

# Techniques:

- Least Squares Fitting
- Scatter Plot

6-Plot

Time Series and Multivariate

## TIME SERIES

#### Data:

A column of time dependent numbers, Y. In addition, time is an indpendent variable. The time variable can be either explicit or implied. If the data are not equi-spaced, the time variable should be explicitly provided.

# Model:

 $y_t = f(t) + \text{error}$ The model can be either a time domain based or frequency domain based.

# Output:

A good model/prediction equation relating *Y* to previous values of *Y*.

# Techniques:

- Autocorrelation Plot
- Spectrum
- Complex
   Demodulation
   Amplitude Plot
- Complex
  Demodulation
  Phase Plot
- ARIMA Models

# **MULTIVARIATE**

#### Data:

k factor variables  $(X_1, X_2, ..., X_k)$ .

#### Model:

The model is not explicit.

# Output:

Identify underlying correlation structure in the data.

## Techniques:

- Star Plot
- Scatter Plot Matrix
- Conditioning Plot
- Profile Plot
- Principal Components
  - Clustering
  - Discrimination/Classification

Note that multivarate analysis is only covered lightly in this Handbook.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



1. Exploratory Data Analysis

# 1.2. EDA Assumptions

# Summary

The gamut of scientific and engineering experimentation is virtually limitless. In this sea of diversity is there any common basis that allows the analyst to systematically and validly arrive at supportable, repeatable research conclusions?

Fortunately, there is such a basis and it is rooted in the fact that every measurement process, however complicated, has certain underlying assumptions. This section deals with what those assumptions are, why they are important, how to go about testing them, and what the consequences are if the assumptions do not hold.

Table of Contents for Section

- 1. <u>Underlying Assumptions</u>
- 2. Importance
- 3. Testing Assumptions
- 4. <u>Importance of Plots</u>
- 5. Consequences



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions

# **1.2.1.** Underlying Assumptions

Assumptions Underlying a Measurement Process There are four assumptions that typically underlie all measurement processes; namely, that the data from the process at hand "behave like":

- 1. random drawings;
- 2. from a fixed distribution;
- 3. with the distribution having fixed location; and
- 4. with the distribution having fixed variation.

Univariate or Single Response Variable The "fixed location" referred to in item 3 above differs for different problem types. The simplest problem type is univariate; that is, a single variable. For the univariate problem, the general model

response = deterministic component + random component

becomes

response = constant + error

Assumptions for Univariate Model For this case, the "fixed location" is simply the unknown constant. We can thus imagine the process at hand to be operating under constant conditions that produce a single column of data with the properties that

- the data are uncorrelated with one another;
- the random component has a fixed distribution;
- the deterministic component consists of only a constant; and
- the random component has fixed variation.

Extrapolation to a Function of Many Variables

The universal power and importance of the univariate model is that it can easily be extended to the more general case where the deterministic component is not just a constant, but is in fact a function of many variables, and the engineering objective is to <u>characterize and model the function</u>.

Residuals The key po

The key point is that regardless of how many factors there

Will Behave According to Univariate Assumptions

are, and regardless of how complicated the function is, if the engineer succeeds in choosing a good model, then the differences (residuals) between the raw response data and the predicted values from the fitted model should themselves behave like a univariate process. Furthermore, the residuals from this univariate process fit will behave like:

- random drawings;
- from a fixed distribution;
- with fixed location (namely, 0 in this case); and
- with fixed variation.

# Validation of Model

Thus if the <u>residuals from the fitted model</u> do in fact behave like the ideal, then testing of underlying assumptions becomes a tool for the validation and quality of fit of the chosen model. On the other hand, if the residuals from the chosen fitted model violate one or more of the above univariate assumptions, then the chosen fitted model is inadequate and an opportunity exists for arriving at an improved model.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions

# 1.2.2. Importance

**Predictability** and Statistical Control

Predictability is an all-important goal in science and engineering. If the four underlying assumptions hold, then we have achieved probabilistic predictability--the ability to make probability statements not only about the process in the past, but also about the process in the future. In short, such processes are said to be "in statistical control".

Validity of Engineering **Conclusions**  Moreover, if the four assumptions are valid, then the process is amenable to the generation of valid scientific and engineering conclusions. If the four assumptions are not valid, then the process is drifting (with respect to location, variation, or distribution), unpredictable, and out of control. A simple characterization of such processes by a location estimate, a variation estimate, or a distribution "estimate" inevitably leads to engineering conclusions that are not valid, are not supportable (scientifically or legally), and which are not repeatable in the laboratory.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions

# **1.2.3.** Techniques for Testing Assumptions

Testing
Underlying
Assumptions
Helps Assure the
Validity of
Scientific and
Engineering
Conclusions

Because the validity of the final scientific/engineering conclusions is inextricably linked to the validity of the underlying univariate assumptions, it naturally follows that there is a real necessity that each and every one of the above four assumptions be routinely tested.


Four Techniques to Test Underlying Assumptions The following EDA techniques are simple, efficient, and powerful for the routine testing of underlying assumptions:

- 1. run sequence plot  $(Y_i \text{ versus } i)$
- 2.  $\frac{\log plot}{(Y_i \text{ versus } Y_{i-1})}$
- 3. <u>histogram</u> (counts versus subgroups of *Y*)
- 4. <u>normal probability plot</u> (ordered *Y* versus theoretical ordered *Y*)

Plot on a Single Page for a Quick Characterization of the Data The four EDA plots can be juxtaposed for a quick look at the characteristics of the data. The plots below are ordered as follows:


- 1. Run sequence plot upper left
- 2. Lag plot upper right
- 3. Histogram lower left
- 4. Normal probability plot lower right

Sample Plot: Assumptions Hold

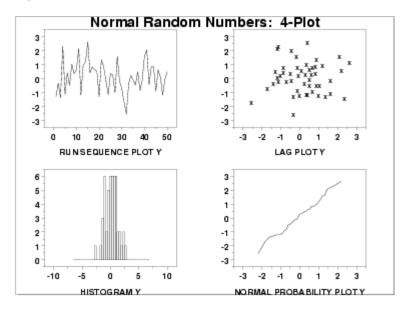

This <u>4-plot</u> reveals a process that has fixed location, fixed variation, is random, apparently has a fixed approximately normal distribution, and has no outliers.

Sample Plot: Assumptions Do Not Hold If one or more of the four underlying assumptions do not hold, then it will show up in the various plots as demonstrated in the following example.

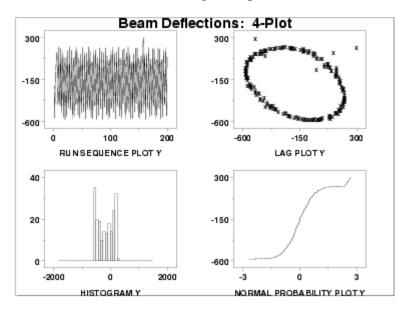

This 4-plot reveals a process that has fixed location, fixed variation, is non-random (oscillatory), has a non-normal, U-shaped distribution, and has several outliers.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions

# **1.2.4.** Interpretation of 4-Plot

Interpretation of EDA Plots: Flat and Equi-Banded, Random, Bell-Shaped, and Linear The four EDA plots discussed on the previous page are used to test the underlying assumptions:

### 1. Fixed Location:

If the fixed location assumption holds, then the run sequence plot will be flat and non-drifting.

#### 2. Fixed Variation:

If the fixed variation assumption holds, then the vertical spread in the run sequence plot will be the approximately the same over the entire horizontal axis.

#### 3. Randomness:

If the randomness assumption holds, then the lag plot will be structureless and random.

#### 4. Fixed Distribution:

If the fixed distribution assumption holds, in particular if the fixed normal distribution holds, then

- 1. the histogram will be bell-shaped, and
- 2. the normal probability plot will be linear.

Plots Utilized to Test the Assumptions

Conversely, the underlying assumptions are tested using the EDA plots:

# • Run Sequence Plot:

If the run sequence plot is flat and non-drifting, the fixed-location assumption holds. If the run sequence plot has a vertical spread that is about the same over the entire plot, then the fixed-variation assumption holds.

# • Lag Plot:

If the lag plot is structureless, then the randomness assumption holds.

### • Histogram:

If the histogram is bell-shaped, the underlying distribution is symmetric and perhaps approximately normal.

#### **Normal Probability Plot:**

If the normal probability plot is linear, the underlying distribution is approximately normal.

If all four of the assumptions hold, then the process is said definitionally to be "in statistical control".



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions

# 1.2.5. Consequences

What If Assumptions Do Not Hold? If some of the underlying assumptions do not hold, what can be done about it? What corrective actions can be taken? The positive way of approaching this is to view the testing of underlying assumptions as a framework for learning about the process. Assumption-testing promotes insight into important aspects of the process that may not have surfaced otherwise.

Primary Goal is Correct and Valid Scientific **Conclusions** 

The primary goal is to have correct, validated, and complete scientific/engineering conclusions flowing from the analysis. This usually includes intermediate goals such as the derivation of a good-fitting model and the computation of realistic parameter estimates. It should always include the ultimate goal of an understanding and a "feel" for "what makes the process tick". There is no more powerful catalyst for discovery than the bringing together of an experienced/expert scientist/engineer and a data set ripe with intriguing "anomalies" and characteristics.

Consequences of Invalid Assumptions

The following sections discuss in more detail the consequences of invalid assumptions:

- 1. Consequences of non-randomness
- 2. Consequences of non-fixed location parameter
- 3. Consequences of non-fixed variation
- 4. Consequences related to distributional assumptions



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions
- 1.2.5. Consequences

# **1.2.5.1.** Consequences of Non-Randomness

#### Randomness Assumption

There are four underlying assumptions:

- 1. randomness;
- 2. fixed location;
- 3. fixed variation; and
- 4. fixed distribution.

The randomness assumption is the most critical but the least tested.

#### Consequeces of Non-Randomness

If the randomness assumption does not hold, then

- 1. All of the usual statistical tests are invalid.
- 2. The calculated uncertainties for commonly used statistics become meaningless.
- 3. The calculated minimal sample size required for a pre-specified tolerance becomes meaningless.
- 4. The simple model: y = constant + error becomes invalid.
- 5. The parameter estimates become suspect and non-supportable.

Non-Randomness Due to Autocorrelation One specific and common type of non-randomness is autocorrelation. Autocorrelation is the correlation between  $Y_t$  and  $Y_{t-k}$ , where k is an integer that defines the lag for the autocorrelation. That is, autocorrelation is a time dependent non-randomness. This means that the value of the current point is highly dependent on the previous point if k = 1 (or k points ago if k is not 1). Autocorrelation is typically detected via an autocorrelation plot or a lag plot.

If the data are not random due to autocorrelation, then

- 1. Adjacent data values may be related.
- 2. There may not be *n* independent snapshots of the phenomenon under study.
- 3. There may be undetected "junk"-outliers.
- 4. There may be undetected "information-rich"-outliers.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions
- 1.2.5. Consequences

# 1.2.5.2. Consequences of Non-Fixed Location **Parameter**

Location Estimate

The usual estimate of location is the mean

$$\bar{Y} = \frac{1}{N} \sum_{i=1}^{N} Y_i$$

from N measurements  $Y_1, Y_2, ..., Y_N$ .

Consequences of Non-Fixed Location

If the run sequence plot does not support the assumption of fixed location, then

- 1. The location may be drifting.
- 2. The single location estimate may be meaningless (if the process is drifting).
- 3. The choice of location estimator (e.g., the sample mean) may be sub-optimal.
- 4. The usual formula for the uncertainty of the mean:

$$s(\bar{Y}) = \frac{1}{\sqrt{N(N-1)}} \sqrt{\sum_{i=1}^{N} (Y_i - \bar{Y})^2}$$

may be invalid and the numerical value optimistically small.

- 5. The location estimate may be poor.
- 6. The location estimate may be biased.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions
- 1.2.5. Consequences

# 1.2.5.3. Consequences of Non-Fixed Variation **Parameter**

Variation Estimate

The usual estimate of variation is the standard deviation

$$s_Y = \frac{1}{\sqrt{(N-1)}} \sqrt{\sum_{i=1}^{N} (Y_i - \bar{Y})^2}$$

from N measurements  $Y_1, Y_2, ..., Y_N$ .

Consequences of Non-Fixed Variation

If the run sequence plot does not support the assumption of fixed variation, then

- 1. The variation may be drifting.
- 2. The single variation estimate may be meaningless (if the process variation is drifting).
- 3. The variation estimate may be poor.
- 4. The variation estimate may be biased.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.2. EDA Assumptions
- 1.2.5. Consequences

# 1.2.5.4. Consequences Related to Distributional Assumptions

#### Distributional Analysis

Scientists and engineers routinely use the mean (average) to estimate the "middle" of a distribution. It is not so well known that the variability and the noisiness of the mean as a location estimator are intrinsically linked with the underlying distribution of the data. For certain distributions, the mean is a poor choice. For any given distribution, there exists an optimal choice—that is, the estimator with minimum variability/noisiness. This optimal choice may be, for example, the median, the midrange, the midmean, the mean, or something else. The implication of this is to "estimate" the distribution first, and then--based on the distribution—choose the optimal estimator. The resulting engineering parameter estimators will have less variability than if this approach is not followed.

#### Case Studies

The <u>airplane glass failure</u> case study gives an example of determining an appropriate distribution and estimating the parameters of that distribution. The <u>uniform random numbers</u> case study gives an example of determining a more appropriate centrality parameter for a non-normal distribution.

Other consequences that flow from problems with distributional assumptions are:

#### Distribution

- 1. The distribution may be changing.
- 2. The single distribution estimate may be meaningless (if the process distribution is changing).
- 3. The distribution may be markedly non-normal.
- 4. The distribution may be unknown.
- 5. The true probability distribution for the error may remain unknown.

#### Model

- 1. The model may be changing.
- 2. The single model estimate may be meaningless.
- 3. The default model

Y = constant + error

may be invalid.

4. If the default model is insufficient, information about

- a better model may remain undetected.
- 5. A poor deterministic model may be fit.
- 6. Information about an improved model may go undetected.

**Process** 

- 1. The process may be out-of-control.
- 2. The process may be unpredictable.
- 3. The process may be un-modelable.



HOME

TOOLS & AIDS

SEARCH



1. Exploratory Data Analysis

# **1.3. EDA Techniques**

#### Summary

After you have collected a set of data, how do you do an exploratory data analysis? What techniques do you employ? What do the various techniques focus on? What conclusions can you expect to reach?

This section provides answers to these kinds of questions via a gallery of EDA techniques and a detailed description of each technique. The techniques are divided into graphical and quantitative techniques. For exploratory data analysis, the emphasis is primarily on the graphical techniques.

Table of Contents for Section

- 1. Introduction
- 2. Analysis Questions
- 3. Graphical Techniques: Alphabetical
- 4. Graphical Techniques: By Problem Category
- 5. Quantitative Techniques: Alphabetical
- 6. Probability Distributions



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques

#### 1.3.1. Introduction

Graphical and Quantitative Techniques

This section describes many techniques that are commonly used in exploratory and classical data analysis. This list is by no means meant to be exhaustive. Additional techniques (both graphical and quantitative) are discussed in the other chapters. Specifically, the <u>product comparisons</u> chapter has a much more detailed description of many classical statistical techniques.

EDA emphasizes graphical techniques while classical techniques emphasize quantitative techniques. In practice, an analyst typically uses a mixture of graphical and quantitative techniques. In this section, we have divided the descriptions into graphical and quantitative techniques. This is for organizational clarity and is not meant to discourage the use of both graphical and quantitative techniques when analyzing data.

Use of Techniques Shown in Case Studies This section emphasizes the techniques themselves; how the graph or test is defined, published references, and sample output. The use of the techniques to answer engineering questions is demonstrated in the <u>case studies</u> section. The case studies do not demonstrate all of the techniques.

Availability in Software

The sample plots and output in this section were generated with the <u>Dataplot software program</u>. Other general purpose statistical data analysis programs can generate most of the plots, intervals, and tests discussed here, or macros can be written to acheive the same result.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques

# 1.3.2. Analysis Questions

EDA Questions Some common questions that exploratory data analysis is used to answer are:

- 1. What is a typical value?
- 2. What is the <u>uncertainty for a typical value?</u>
- 3. What is a good distributional fit for a set of numbers?
- 4. What is a percentile?
- 5. Does an engineering modification have an effect?
- 6. Does a factor have an effect?
- 7. What are the most important factors?
- 8. Are measurements coming from <u>different laboratories</u> <u>equivalent?</u>
- 9. What is the best function for relating a response variable to a set of factor variables?
- 10. What are the best settings for factors?
- 11. Can we separate <u>signal from noise in time dependent</u> data?
- 12. Can we extract any <u>structure from multivariate data?</u>
- 13. Does the data have <u>outliers</u>?

Analyst
Should
Identify
Relevant
Questions
for his
Engineering
Problem

A critical early step in any analysis is to identify (for the engineering problem at hand) which of the above questions are relevant. That is, we need to identify which questions we want answered and which questions have no bearing on the problem at hand. After collecting such a set of questions, an equally important step, which is invaluable for maintaining focus, is to prioritize those questions in decreasing order of importance. EDA techniques are tied in with each of the questions. There are some EDA techniques (e.g., the scatter plot) that are broad-brushed and apply almost universally. On the other hand, there are a large number of EDA techniques that are specific and whose specificity is tied in with one of the above questions. Clearly if one chooses not to explicitly identify relevant questions, then one cannot take advantage of these question-specific EDA techniques.

EDA Approach Emphasizes Graphics Most of these questions can be addressed by techniques discussed in this chapter. The <u>process modeling</u> and <u>process improvement</u> chapters also address many of the questions above. These questions are also relevant for the classical approach to statistics. What distinguishes the EDA approach is an emphasis on graphical techniques to gain insight as

opposed to the classical approach of quantitative tests. Most data analysts will use a mix of graphical and classical quantitative techniques to address these problems.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS


SEARCH


BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques

# 1.3.3. Graphical Techniques: Alphabetic

This section provides a gallery of some useful graphical techniques. The techniques are ordered alphabetically, so this section is not intended to be read in a sequential fashion. The use of most of these graphical techniques is demonstrated in the <u>case studies</u> in this chapter. A few of these graphical techniques are demonstrated in later chapters.

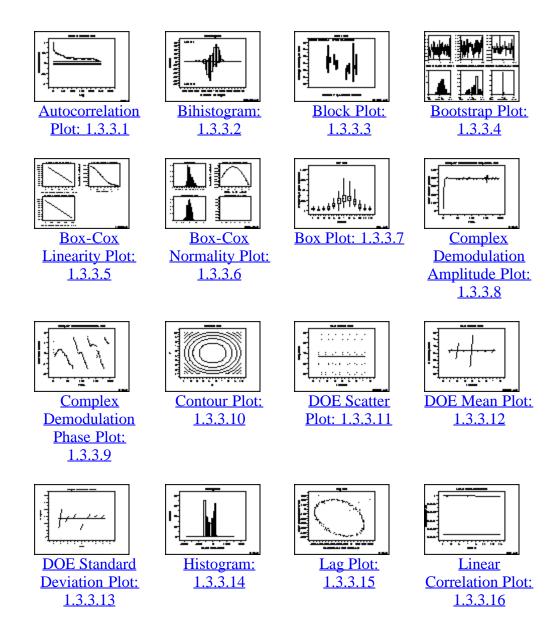

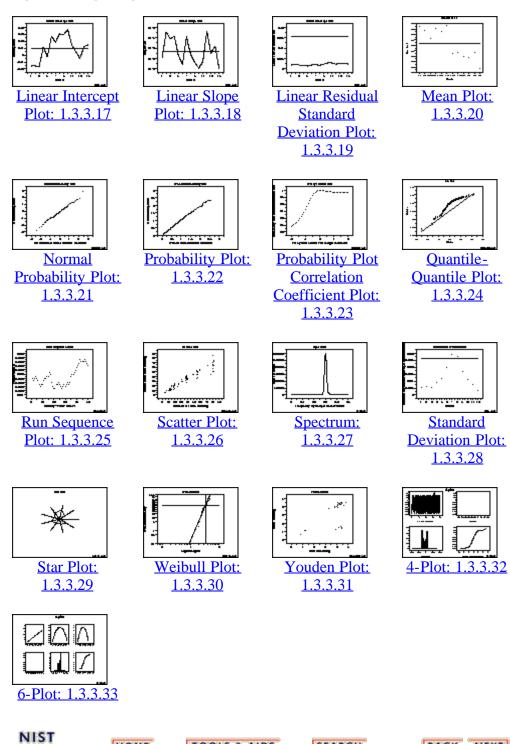

TOOLS & AIDS

SEARCH

BACK NEXT

HOME

**SEMATECH** 


- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.1. Autocorrelation Plot

Purpose: Check Randomness Autocorrelation plots (Box and Jenkins, pp. 28-32) are a commonly-used tool for checking randomness in a data set. This randomness is ascertained by computing autocorrelations for data values at varying time lags. If random, such autocorrelations should be near zero for any and all time-lag separations. If non-random, then one or more of the autocorrelations will be significantly non-zero.

In addition, autocorrelation plots are used in the model identification stage for <u>Box-Jenkins</u> autoregressive, moving average time series models.

Sample Plot: Autocorrelations should be nearzero for randomness. Such is not the case in this example and thus the randomness assumption fails

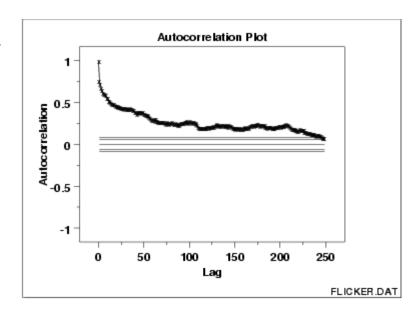

This sample autocorrelation plot shows that the time series is not random, but rather has a high degree of autocorrelation between adjacent and near-adjacent observations.

Definition: r(h) versus h

Autocorrelation plots are formed by

• Vertical axis: Autocorrelation coefficient

$$R_h = C_h/C_0$$

where  $C_h$  is the autocovariance function

$$C_h = \frac{1}{N} \sum_{t=1}^{N-h} (Y_t - \bar{Y})(Y_{t+h} - \bar{Y})$$

and  $C_0$  is the variance function

$$C_0 = rac{\sum_{t=1}^N (Y_t - ar{Y})^2}{N}$$

Note-- $\mathbf{R}_h$  is between -1 and +1.

Note--Some sources may use the following formula for the autocovariance function

$$C_h = rac{1}{N-h} \sum_{t=1}^{N-h} (Y_t - \bar{Y})(Y_{t+h} - \bar{Y})$$

Although this definition has less bias, the (1/N) formulation has some desirable statistical properties and is the form most commonly used in the statistics literature. See pages 20 and 49-50 in Chatfield for details.

- Horizontal axis: Time lag h (h = 1, 2, 3, ...)
- The above line also contains several horizontal reference lines. The middle line is at zero. The other four lines are 95 % and 99 % confidence bands. Note that there are two distinct formulas for generating the confidence bands.
  - 1. If the autocorrelation plot is being used to test for randomness (i.e., there is no time dependence in the data), the following formula is recommended:

$$\pm \frac{z_{1-\alpha/2}}{\sqrt{N}}$$

where N is the sample size, z is the cumulative distribution function of the standard normal distribution and  $\alpha$  is the significance level. In this case, the confidence bands have fixed width that depends on the sample size. This is the formula that was used to generate the confidence bands in the above plot.

 Autocorrelation plots are also used in the model identification stage for fitting <u>ARIMA</u> <u>models</u>. In this case, a moving average model is assumed for the data and the following confidence bands should be generated:

$$\pm z_{1-lpha/2} \sqrt{rac{1}{N} (1 + 2 \sum_{i=1}^{k} y_i^2)}$$

where k is the lag, N is the sample size, z is the cumulative distribution function of the standard normal distribution and  $\alpha$  is the significance level. In this case, the confidence bands increase as the lag increases.

#### Questions

The autocorrelation plot can provide answers to the following questions:

- 1. Are the data random?
- 2. Is an observation related to an adjacent observation?
- 3. Is an observation related to an observation twice-removed? (etc.)
- 4. Is the observed time series white noise?
- 5. Is the observed time series sinusoidal?
- 6. Is the observed time series autoregressive?
- 7. What is an appropriate model for the observed time series?
- 8. Is the model

$$Y = constant + error$$

valid and sufficient?

9. Is the formula 
$$s_{\bar{V}} \equiv s/\sqrt{N}$$
 valid?

Importance: Ensure validity of engineering conclusions Randomness (along with fixed model, fixed variation, and fixed distribution) is one of the four assumptions that typically underlie all measurement processes. The randomness assumption is critically important for the following three reasons:

- Most standard statistical tests depend on randomness. The validity of the test conclusions is directly linked to the validity of the randomness assumption.
- 2. Many commonly-used statistical formulae depend on the randomness assumption, the most common formula being the formula for determining the standard deviation of the sample mean:

$$s_{ ilde{Y}} = s/\sqrt{N}$$

where  $\mathbf{s}$  is the standard deviation of the data. Although heavily used, the results from using this formula are of no value unless the randomness

assumption holds.

3. For univariate data, the default model is

Y = constant + error

If the data are not random, this model is incorrect and invalid, and the estimates for the parameters (such as the constant) become nonsensical and invalid.

In short, if the analyst does not check for randomness, then the validity of many of the statistical conclusions becomes suspect. The autocorrelation plot is an excellent way of checking for such randomness.

**Examples** 

Examples of the autocorrelation plot for several common situations are given in the following pages.

- 1. Random (= White Noise)
- 2. Weak autocorrelation
- 3. Strong autocorrelation and autoregressive model
- 4. Sinusoidal model

Related Techniques Partial Autocorrelation Plot

<u>Lag Plot</u>

Spectral Plot

Seasonal Subseries Plot

Case Study

The autocorrelation plot is demonstrated in the beam

deflection data case study.

*Software* 

Autocorrelation plots are available in most general purpose statistical software programs.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.1. Autocorrelation Plot

## 1.3.3.1.1. Autocorrelation Plot: Random Data

Autocorrelation Plot The following is a sample autocorrelation plot.

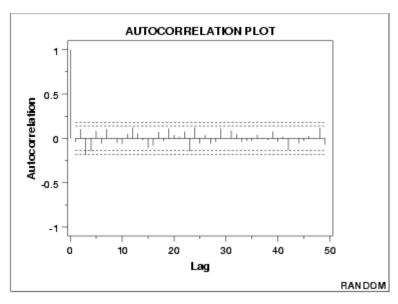

Conclusions

We can make the following conclusions from this plot.

- 1. There are no significant autocorrelations.
- 2. The data are random.

Discussion

Note that with the exception of lag 0, which is always 1 by definition, almost all of the autocorrelations fall within the 95% confidence limits. In addition, there is no apparent pattern (such as the first twenty-five being positive and the second twenty-five being negative). This is the abscence of a pattern we expect to see if the data are in fact random.

A few lags slightly outside the 95% and 99% confidence limits do not neccessarily indicate non-randomness. For a 95% confidence interval, we might expect about one out of twenty lags to be statistically significant due to random fluctuations.

There is no associative ability to infer from a current value  $Y_i$  as to what the next value  $Y_{i+1}$  will be. Such non-association is the essense of randomness. In short, adjacent

observations do not "co-relate", so we call this the "no autocorrelation" case.



HOME

TOOLS & AIDS

SEARCH




- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.1. Autocorrelation Plot

# 1.3.3.1.2. Autocorrelation Plot: Moderate Autocorrelation

Autocorrelation Plot

The following is a sample autocorrelation plot.

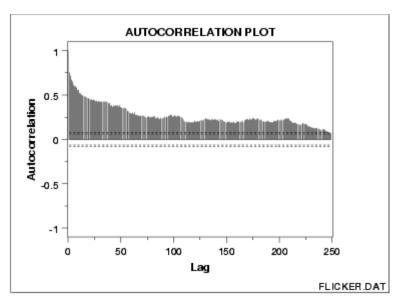

**Conclusions** 

We can make the following conclusions from this plot.

1. The data come from an underlying autoregressive model with moderate positive autocorrelation.

Discussion

The plot starts with a moderately high autocorrelation at lag 1 (approximately 0.75) that gradually decreases. The decreasing autocorrelation is generally linear, but with significant noise. Such a pattern is the autocorrelation plot signature of "moderate autocorrelation", which in turn provides moderate predictability if modeled properly.

Recommended Next Step The next step would be to estimate the parameters for the autoregressive model:

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Such estimation can be performed by using <u>least squares</u> <u>linear regression</u> or by fitting a <u>Box-Jenkins</u> autoregressive (AR) model.

The randomness assumption for least squares fitting applies to the residuals of the model. That is, even though the original data exhibit non-randomness, the residuals after fitting  $\mathbf{Y}_i$  against  $\mathbf{Y}_{i-1}$  should result in random residuals. Assessing whether or not the proposed model in fact sufficiently removed the randomness is discussed in detail in the <u>Process Modeling</u> chapter.

The residual standard deviation for this autoregressive model will be much smaller than the residual standard deviation for the default model

$$Y_i = A_0 + E_i$$



HOME

TOOLS & AIDS

SEARCH






- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.1. Autocorrelation Plot

# 1.3.3.1.3. Autocorrelation Plot: Strong Autocorrelation and Autoregressive Model

Autocorrelation Plot for Strong Autocorrelation The following is a sample autocorrelation plot.

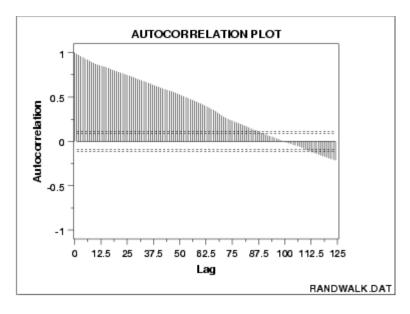

**Conclusions** 

We can make the following conclusions from the above plot.

1. The data come from an underlying autoregressive model with strong positive autocorrelation.

Discussion

The plot starts with a high autocorrelation at lag 1 (only slightly less than 1) that slowly declines. It continues decreasing until it becomes negative and starts showing an incresing negative autocorrelation. The decreasing autocorrelation is generally linear with little noise. Such a pattern is the autocorrelation plot signature of "strong autocorrelation", which in turn provides high predictability if modeled properly.

Recommended Next Step The next step would be to estimate the parameters for the autoregressive model:

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Such estimation can be performed by using <u>least squares</u> linear regression or by fitting a Box-Jenkins autoregressive (AR) model.

The randomness assumption for least squares fitting applies to the residuals of the model. That is, even though the original data exhibit non-randomness, the residuals after fitting  $Y_i$  against  $Y_{i-1}$  should result in random residuals. Assessing whether or not the proposed model in fact sufficiently removed the randomness is discussed in detail in the **Process Modeling** chapter.

The residual standard deviation for this autoregressive model will be much smaller than the residual standard deviation for the default model

$$Y_i = A_0 + E_i$$



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.1. Autocorrelation Plot

# 1.3.3.1.4. Autocorrelation Plot: Sinusoidal Model

Autocorrelation Plot for Sinusoidal Model The following is a sample autocorrelation plot.

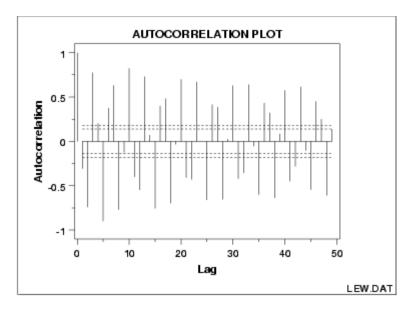

**Conclusions** 

We can make the following conclusions from the above plot.

1. The data come from an underlying sinusoidal model.

Discussion

The plot exhibits an alternating sequence of positive and negative spikes. These spikes are not decaying to zero. Such a pattern is the autocorrelation plot signature of a sinusoidal model.

Recommended Next Step The <u>beam deflection case study</u> gives an example of modeling a sinusoidal model.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


# 1.3.3.2. Bihistogram

Purpose: Check for a change in location, variation, or distribution The bihistogram is an EDA tool for assessing whether a before-versus-after engineering modification has caused a change in

- location;
- variation; or
- distribution.

It is a graphical alternative to the <u>two-sample t-test</u>. The bihistogram can be more powerful than the t-test in that all of the distributional features (location, scale, skewness, outliers) are evident on a single plot. It is also based on the common and well-understood <u>histogram</u>.

Sample Plot: This bihistogram reveals that there is a significant difference in ceramic breaking strength between batch 1 (above) and batch 2 (below)

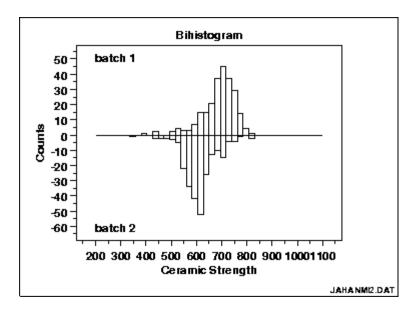

From the above bihistogram, we can see that batch 1 is centered at a ceramic strength value of approximately 725 while batch 2 is centered at a ceramic strength value of approximately 625. That indicates that these batches are displaced by about 100 strength units. Thus the batch factor has a significant effect on the location (typical value) for strength and hence batch is said to be "significant" or to "have an effect". We thus see graphically and convincingly what a t-test or analysis of variance would indicate quantitatively.

With respect to variation, note that the spread (variation) of the above-axis batch 1 histogram does not appear to be that much different from the below-axis batch 2 histogram. With respect to distributional shape, note that the batch 1 histogram is skewed left while the batch 2 histogram is more symmetric with even a hint of a slight skewness to the right.

Thus the bihistogram reveals that there is a clear difference between the batches with respect to location and distribution, but not in regard to variation. Comparing batch 1 and batch 2, we also note that batch 1 is the "better batch" due to its 100-unit higher average strength (around 725).

Definition: Two adjoined histograms Bihistograms are formed by vertically juxtaposing two histograms:

- Above the axis: Histogram of the response variable for condition 1
- Below the axis: Histogram of the response variable for condition 2

#### Questions

The bihistogram can provide answers to the following questions:

- 1. Is a (2-level) factor significant?
- 2. Does a (2-level) factor have an effect?
- 3. Does the location change between the 2 subgroups?
- 4. Does the variation change between the 2 subgroups?
- 5. Does the distributional shape change between subgroups?
- 6. Are there any outliers?

Importance: Checks 3 out of the 4 underlying assumptions of a measurement process The bihistogram is an important EDA tool for determining if a factor "has an effect". Since the bihistogram provides insight into the validity of three (location, variation, and distribution) out of the four (missing only randomness) underlying assumptions in a measurement process, it is an especially valuable tool. Because of the dual (above/below) nature of the plot, the bihistogram is restricted to assessing factors that have only two levels. However, this is very common in the before-versus-after character of many scientific and engineering experiments.

Related Techniques t test (for shift in location)F test (for shift in variation)

Kolmogorov-Smirnov test (for shift in distribution)

Quantile-quantile plot (for shift in location and distribution)

Case Study

The bihistogram is demonstrated in the <u>ceramic strength</u> data case study.

Software The bihistogram is not widely available in general purpose

statistical software programs. Bihistograms can be generated using Dataplot and R software.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT


- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### **1.3.3.3.** Block Plot

Purpose: Check to determine if a factor of interest has an effect robust over all other factors The block plot (Filliben 1993) is an EDA tool for assessing whether the factor of interest (the primary factor) has a statistically significant effect on the response, and whether that conclusion about the primary factor effect is valid robustly over all other nuisance or secondary factors in the experiment.

It replaces the <u>analysis of variance test</u> with a less assumption-dependent binomial test and should be routinely used whenever we are trying to robustly decide whether a primary factor has an effect.

Sample Plot: Weld method 2 is lower (better) than weld method 1 in 10 of 12 cases

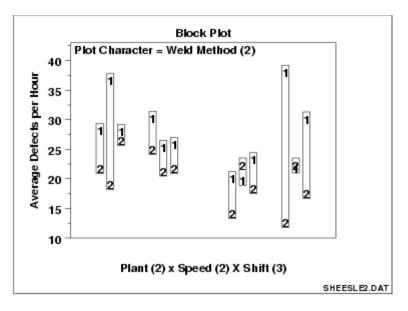

This block plot reveals that in 10 of the 12 cases (bars), weld method 2 is lower (better) than weld method 1. From a binomial point of view, weld method is statistically significant.

#### Definition

Block Plots are formed as follows:

- Vertical axis: Response variable Y
- Horizontal axis: All combinations of all levels of all nuisance (secondary) factors X1, X2, ...
- Plot Character: Levels of the primary factor XP

Discussion:
Primary
factor is
denoted by
plot
character:
within-bar
plot

character.

Average number of defective lead wires per hour from a study with four factors,

- 1. weld strength (2 levels)
- 2. plant (2 levels)
- 3. speed (2 levels)
- 4. shift (3 levels)

are shown in the plot above. Weld strength is the primary factor and the other three factors are nuisance factors. The 12 distinct positions along the horizontal axis correspond to all possible combinations of the three nuisance factors, i.e., 12 = 2 plants x 2 speeds x 3 shifts. These 12 conditions provide the framework for assessing whether any conclusions about the 2 levels of the primary factor (weld method) can truly be called "general conclusions". If we find that one weld method setting does better (smaller average defects per hour) than the other weld method setting for all or most of these 12 nuisance factor combinations, then the conclusion is in fact general and robust.

Ordering along the horizontal axis

In the above chart, the ordering along the horizontal axis is as follows:

- The left 6 bars are from plant 1 and the right 6 bars are from plant 2.
- The first 3 bars are from speed 1, the next 3 bars are from speed 2, the next 3 bars are from speed 1, and the last 3 bars are from speed 2.
- Bars 1, 4, 7, and 10 are from the first shift, bars 2, 5, 8, and 11 are from the second shift, and bars 3, 6, 9, and 12 are from the third shift.

Setting 2 is better than setting 1 in 10 out of 12 cases In the block plot for the first bar (plant 1, speed 1, shift 1), weld method 1 yields about 28 defects per hour while weld method 2 yields about 22 defects per hour--hence the difference for this combination is about 6 defects per hour and weld method 2 is seen to be better (smaller number of defects per hour).

Is "weld method 2 is better than weld method 1" a general conclusion?

For the second bar (plant 1, speed 1, shift 2), weld method 1 is about 37 while weld method 2 is only about 18. Thus weld method 2 is again seen to be better than weld method 1. Similarly for bar 3 (plant 1, speed 1, shift 3), we see weld method 2 is smaller than weld method 1. Scanning over all of the 12 bars, we see that weld method 2 is smaller than weld method 1 in 10 of the 12 cases, which is highly suggestive of a robust weld method effect.

An event

What is the chance of 10 out of 12 happening by chance?

with chance probability of only 2%

This is probabilistically equivalent to testing whether a coin is fair by flipping it and getting 10 heads in 12 tosses. The chance (<u>from the binomial distribution</u>) of getting 10 (or more extreme: 11, 12) heads in 12 flips of a fair coin is about 2%. Such low-probability events are usually rejected as untenable and in practice we would conclude that there is a difference in weld methods.

Advantage: Graphical and binomial The advantages of the block plot are as follows:

- A quantitative procedure (analysis of variance) is replaced by a graphical procedure.
- An F-test (analysis of variance) is replaced with a binomial test, which requires fewer assumptions.

#### Questions

The block plot can provide answers to the following questions:

- 1. Is the factor of interest significant?
- 2. Does the factor of interest have an effect?
- 3. Does the location change between levels of the primary factor?
- 4. Has the process improved?
- 5. What is the best setting (= level) of the primary factor?
- 6. How much of an average improvement can we expect with this best setting of the primary factor?
- 7. Is there an interaction between the primary factor and one or more nuisance factors?
- 8. Does the effect of the primary factor change depending on the setting of some nuisance factor?
- 9. Are there any outliers?

Importance:

Robustly checks the significance of the factor of interest

The block plot is a graphical technique that pointedly focuses on whether or not the primary factor conclusions are in fact robustly general. This question is fundamentally different from the generic multi-factor experiment question where the analyst asks, "What factors are important and what factors are not" (a screening problem)? Global data analysis techniques, such as analysis of variance, can potentially be improved by local, focused data analysis techniques that take advantage of this difference.

Related Techniques t test (for shift in location for exactly 2 levels)

ANOVA (for shift in location for 2 or more levels)

Bihistogram (for shift in location, variation, and distribution for exactly 2 levels).

Case Study

The block plot is demonstrated in the <u>ceramic strength</u> data case study.

Software

Block plots are not currently available in most general

purpose statistical software programs. However they can be generated using Dataplot and, with some programming, R software.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


# 1.3.3.4. Bootstrap Plot

Purpose: Estimate uncertainty The bootstrap (<u>Efron and Gong</u>) plot is used to estimate the uncertainty of a statistic.

Generate subsamples with replacement To generate a bootstrap uncertainty estimate for a given statistic from a set of data, a subsample of a size less than or equal to the size of the data set is generated from the data, and the statistic is calculated. This subsample is generated with replacement so that any data point can be sampled multiple times or not sampled at all. This process is repeated for many subsamples, typically between 500 and 1000. The computed values for the statistic form an estimate of the sampling distribution of the statistic.

For example, to estimate the uncertainty of the median from a dataset with 50 elements, we generate a subsample of 50 elements and calculate the median. This is repeated at least 500 times so that we have at least 500 values for the median. Although the number of bootstrap samples to use is somewhat arbitrary, 500 subsamples is usually sufficient. To calculate a 90% confidence interval for the median, the sample medians are sorted into ascending order and the value of the 25th median (assuming exactly 500 subsamples were taken) is the lower confidence limit while the value of the 475th median (assuming exactly 500 subsamples were taken) is the upper confidence limit.

Sample Plot:

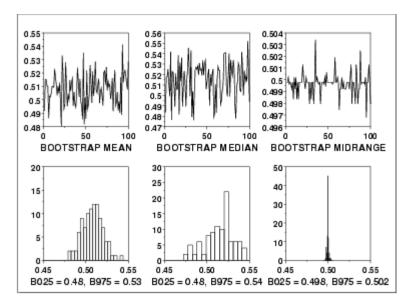

This bootstrap plot was generated from 500 uniform random numbers. Bootstrap plots and corresponding histograms were generated for the mean, median, and mid-range. The histograms for the corresponding statistics clearly show that for uniform random numbers the mid-range has the smallest variance and is, therefore, a superior location estimator to the mean or the median.

#### Definition

The bootstrap plot is formed by:

- Vertical axis: Computed value of the desired statistic for a given subsample.
- Horizontal axis: Subsample number.

The bootstrap plot is simply the computed value of the statistic versus the subsample number. That is, the bootstrap plot generates the values for the desired statistic. This is usually immediately followed by a histogram or some other distributional plot to show the location and variation of the sampling distribution of the statistic.

#### Questions

The bootstrap plot is used to answer the following questions:

- What does the sampling distribution for the statistic look like?
- What is a 95% confidence interval for the statistic?
- Which statistic has a sampling distribution with the smallest variance? That is, which statistic generates the narrowest confidence interval?

#### *Importance*

The most common uncertainty calculation is generating a confidence interval for the mean. In this case, the uncertainty formula can be derived mathematically. However, there are many situations in which the uncertainty formulas are mathematically intractable. The bootstrap provides a method for calculating the uncertainty in these cases.

Cautuion on use of the bootstrap

The bootstrap is not appropriate for all distributions and statistics (Efron and Tibrashani). For example, because of the shape of the uniform distribution, the bootstrap is not appropriate for estimating the distribution of statistics that are heavily dependent on the tails, such as the range.

Related *Techniques*  **Histogram** Jackknife

The jacknife is a technique that is closely related to the bootstrap. The jackknife is beyond the scope of this handbook. See the Efron and Gong article for a discussion of

the jackknife.

The bootstrap plot is demonstrated in the <u>uniform random</u> Case Study

numbers case study.

Software The bootstrap is becoming more common in general purpose

> statistical software programs. However, it is still not supported in many of these programs. Both R software and Dataplot support a bootstrap capability.

NIST **SEMATECH** 

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# 1.3.3.5. Box-Cox Linearity Plot

Purpose:
Find the
transformation
of the X
variable that
maximizes the
correlation
between a Y
and an X
variable

When performing a linear fit of Y against X, an appropriate transformation of X can often significantly improve the fit. The Box-Cox transformation (Box and Cox, 1964) is a particularly useful family of transformations. It is defined as:


$$T(X) = (X^{\lambda} - 1)/\lambda$$

where X is the variable being transformed and  $\lambda$  is the transformation parameter. For  $\lambda = 0$ , the natural log of the data is taken instead of using the above formula.

The Box-Cox linearity plot is a plot of the correlation between Y and the transformed X for given values of  $\lambda$ . That is,  $\lambda$  is the coordinate for the horizontal axis variable and the value of the correlation between Y and the transformed X is the coordinate for the vertical axis of the plot. The value of  $\lambda$  corresponding to the maximum correlation (or minimum for negative correlation) on the plot is then the optimal choice for  $\lambda$ .

Transforming X is used to improve the fit. The Box-Cox transformation applied to Y can be used as the basis for meeting the <u>error assumptions</u>. That case is not covered here. See page 225 of (<u>Draper and Smith</u>, 1981) or page 77 of (<u>Ryan</u>, 1997) for a discussion of this case.

Sample Plot

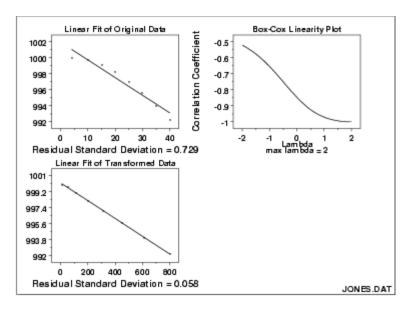

The plot of the original data with the predicted values from a linear fit indicate that a quadratic fit might be preferable. The Box-Cox linearity plot shows a value of  $\lambda = 2.0$ . The plot of the transformed data with the predicted values from a linear fit with the transformed data shows a better fit (verified by the significant reduction in the residual standard deviation).

Definition

Box-Cox linearity plots are formed by

- Vertical axis: Correlation coefficient from the transformed X and Y
- Horizontal axis: Value for  $\lambda$

**Questions** 

The Box-Cox linearity plot can provide answers to the following questions:

- 1. Would a suitable transformation improve my fit?
- 2. What is the optimal value of the transformation parameter?

Importance: Find a suitable transformation Transformations can often significantly improve a fit. The Box-Cox linearity plot provides a convenient way to find a suitable transformation without engaging in a lot of trial and error fitting.

Related Techniques <u>Linear Regression</u> <u>Box-Cox Normality Plot</u>

Case Study

The Box-Cox linearity plot is demonstrated in the <u>Alaska pipeline</u> data case study.

Software

Box-Cox linearity plots are not a standard part of most general purpose statistical software programs. However, the underlying technique is based on a transformation and computing a correlation coefficient. So if a statistical program supports these capabilities, writing a macro for a Box-Cox linearity plot should be feasible.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# **1.3.3.6.** Box-Cox Normality Plot

Purpose: Find transformation to normalize data Many statistical tests and intervals are based on the assumption of normality. The assumption of normality often leads to tests that are simple, mathematically tractable, and powerful compared to tests that do not make the normality assumption. Unfortunately, many real data sets are in fact not approximately normal. However, an appropriate transformation of a data set can often yield a data set that does follow approximately a normal distribution. This increases the applicability and usefulness of statistical techniques based on the normality assumption.

The Box-Cox transformation is a particulary useful family of transformations. It is defined as:


$$T(Y) = (Y^{\lambda} - 1)/\lambda$$

where Y is the response variable and  $\lambda$  is the transformation parameter. For  $\lambda = 0$ , the natural log of the data is taken instead of using the above formula.

Given a particular transformation such as the Box-Cox transformation defined above, it is helpful to define a measure of the normality of the resulting transformation. One measure is to compute the correlation coefficient of a normal probability plot. The correlation is computed between the vertical and horizontal axis variables of the probability plot and is a convenient measure of the linearity of the probability plot (the more linear the probability plot, the better a normal distribution fits the data).

The Box-Cox normality plot is a plot of these correlation coefficients for various values of the  $\lambda$  parameter. The value of  $\lambda$  corresponding to the maximum correlation on the plot is then the optimal choice for  $\lambda$ .

Sample Plot

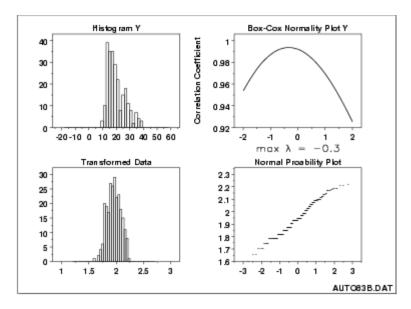

The histogram in the upper left-hand corner shows a data set that has significant right skewness (and so does not follow a normal distribution). The Box-Cox normality plot shows that the maximum value of the correlation coefficient is at  $\lambda = -0.3$ . The histogram of the data after applying the Box-Cox transformation with  $\lambda = -0.3$  shows a data set for which the normality assumption is reasonable. This is verified with a normal probability plot of the transformed data.

#### Definition

Box-Cox normality plots are formed by:

- Vertical axis: Correlation coefficient from the normal probability plot after applying Box-Cox transformation
- Horizontal axis: Value for  $\lambda$

#### Questions

The Box-Cox normality plot can provide answers to the following questions:

- 1. Is there a transformation that will normalize my data?
- 2. What is the optimal value of the transformation parameter?

Importance:
Normalization
Improves
Validity of
Tests

Normality assumptions are critical for many univariate intervals and hypothesis tests. It is important to test the normality assumption. If the data are in fact clearly not normal, the Box-Cox normality plot can often be used to find a transformation that will approximately normalize the data.

Related Techniques Normal Probability Plot Box-Cox Linearity Plot *Software* 

Box-Cox normality plots are not a standard part of most general purpose statistical software programs. However, the underlying technique is based on a normal probability plot and computing a correlation coefficient. So if a statistical program supports these capabilities, writing a macro for a Box-Cox normality plot should be feasible.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH


BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.7. Box Plot

Purpose: Check location and variation shifts Box plots (<u>Chambers 1983</u>) are an excellent tool for conveying location and variation information in data sets, particularly for detecting and illustrating location and variation changes between different groups of data.

Sample
Plot:
This box
plot reveals
that
machine
has a
significant
effect on
energy with
respect to
location
and
possibly
variation

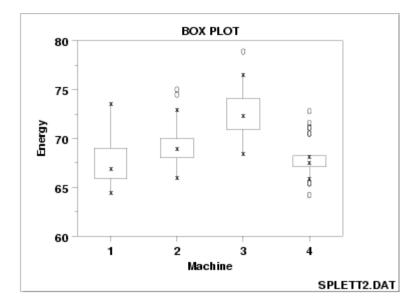

This box plot, comparing four machines for energy output, shows that machine has a significant effect on energy with respect to both location and variation. Machine 3 has the highest energy response (about 72.5); machine 4 has the least variable energy response with about 50% of its readings being within 1 energy unit.

Definition

Box plots are formed by

Vertical axis: Response variable Horizontal axis: The factor of interest

More specifically, we

1. Calculate the <u>median</u> and the <u>quartiles</u> (the lower quartile is the 25th percentile and the upper quartile is the 75th percentile).

- 2. Plot a symbol at the median (or draw a line) and draw a box (hence the name--box plot) between the lower and upper quartiles; this box represents the middle 50% of the data--the "body" of the data.
- 3. Draw a line from the lower quartile to the minimum point and another line from the upper quartile to the maximum point. Typically a symbol is drawn at these minimum and maximum points, although this is optional.

Thus the box plot identifies the middle 50% of the data, the median, and the extreme points.

Single or multiple box plots can be drawn A single box plot can be drawn for one batch of data with no distinct groups. Alternatively, multiple box plots can be drawn together to compare multiple data sets or to compare groups in a single data set. For a single box plot, the width of the box is arbitrary. For multiple box plots, the width of the box plot can be set proportional to the number of points in the given group or sample (some software implementations of the box plot simply set all the boxes to the same width).

Box plots with fences

There is a useful variation of the box plot that more specifically identifies outliers. To create this variation:

- 1. Calculate the <u>median</u> and the <u>lower and upper</u> <u>quartiles</u>.
- 2. Plot a symbol at the median and draw a box between the lower and upper quartiles.
- 3. Calculate the interquartile range (the difference between the upper and lower quartile) and call it IQ.
- 4. Calculate the following points:

L1 = lower quartile - 1.5\*IQ L2 = lower quartile - 3.0\*IQ U1 = upper quartile + 1.5\*IQ U2 = upper quartile + 3.0\*IQ

- 5. The line from the lower quartile to the minimum is now drawn from the lower quartile to the smallest point that is greater than L1. Likewise, the line from the upper quartile to the maximum is now drawn to the largest point smaller than U1.
- 6. Points between L1 and L2 or between U1 and U2 are drawn as small circles. Points less than L2 or greater than U2 are drawn as large circles.

Questions

The box plot can provide answers to the following questions:

- 1. Is a factor significant?
- 2. Does the location differ between subgroups?
- 3. Does the variation differ between subgroups?

4. Are there any outliers?

Importance: The box plot is an important EDA tool for determining if a

factor has a significant effect on the response with respect to

either location or variation. Check the

significance The box plot is also an effective tool for summarizing large of a factor

quantities of information.

Related Mean Plot

**Analysis of Variance** *Techniques* 

Case Study The box plot is demonstrated in the <u>ceramic strength</u> data

case study.

Software Box plots are available in most general purpose statistical

software programs.

NIST SEMATECH

HOME TOOLS & AIDS SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# 1.3.3.8. Complex Demodulation Amplitude Plot

Purpose:
Detect
Changing
Amplitude
in
Sinusoidal
Models

In the frequency analysis of time series models, a common model is the sinusoidal model:

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

In this equation,  $\alpha$  is the amplitude,  $\phi$  is the phase shift, and  $\omega$  is the dominant frequency. In the above model,  $\alpha$  and  $\phi$  are constant, that is they do not vary with time,  $t_i$ .

The complex demodulation amplitude plot (Granger, 1964) is used to determine if the assumption of constant amplitude is justifiable. If the slope of the complex demodulation amplitude plot is not zero, then the above model is typically replaced with the model:


$$Y_i = C + \alpha_i \sin(2\pi\omega t_i + \phi) + E_i$$

where  $\hat{\alpha}_i$  is some type of <u>linear model fit with standard least squares</u>. The most common case is a linear fit, that is the model becomes

$$Y_i = C + (B_0 + B_1 * t_i) \sin(2\pi\omega t_i + \phi) + E_i$$

Quadratic models are sometimes used. Higher order models are relatively rare.

Sample Plot:

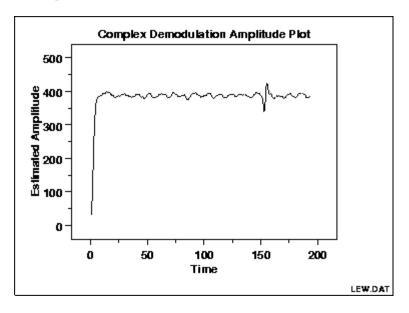

This complex demodulation amplitude plot shows that:

- the amplitude is fixed at approximately 390;
- there is a start-up effect; and
- there is a change in amplitude at around x = 160 that should be investigated for an outlier.

Definition:

The complex demodulation amplitude plot is formed by:

• Vertical axis: Amplitude

• Horizontal axis: Time

The mathematical computations for determining the amplitude are beyond the scope of the Handbook. Consult Granger (Granger, 1964) for details.

Questions

The complex demodulation amplitude plot answers the following questions:

- 1. Does the amplitude change over time?
- 2. Are there any outliers that need to be investigated?
- 3. Is the amplitude different at the beginning of the series (i.e., is there a start-up effect)?

Importance: Assumption Checking As stated previously, in the frequency analysis of time series models, a common model is the sinusoidal model:

$$Y_i = C + \alpha \sin \left(2\pi\omega t_i + \phi\right) + E_i$$

In this equation,  $\alpha$  is assumed to be constant, that is it does not vary with time. It is important to check whether or not this assumption is reasonable.

The complex demodulation amplitude plot can be used to verify this assumption. If the slope of this plot is essentially zero, then the assumption of constant amplitude is justified. If it is not,  $\alpha$  should be replaced with some type of timevarying model. The most common cases are linear ( $B_0$  +

 $B_1^*t$ ) and quadratic  $(B_0 + B_1^*t + B_2^*t^2)$ .

Related Spectral Plot

Techniques Complex Demodulation Phase Plot

Non-Linear Fitting

Case Study The complex demodulation amplitude plot is demonstrated in

the beam deflection data case study.

Software Complex demodulation amplitude plots are available in some,

but not most, general purpose statistical software programs.

NIST SEMATECH

HOME TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# 1.3.3.9. Complex Demodulation Phase Plot

Purpose: Improve the estimate of frequency in sinusoidal time series models As stated previously, in the frequency analysis of time series models, a common model is the sinusoidal model:


$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

In this equation,  $\alpha$  is the amplitude,  $\phi$  is the phase shift, and  $\omega$  is the dominant frequency. In the above model,  $\alpha$  and  $\phi$  are constant, that is they do not vary with time  $t_i$ .

The complex demodulation phase plot (Granger, 1964) is used to improve the estimate of the frequency (i.e.,  $\omega$ ) in this model.

If the complex demodulation phase plot shows lines sloping from left to right, then the estimate of the frequency should be increased. If it shows lines sloping right to left, then the frequency should be decreased. If there is essentially zero slope, then the frequency estimate does not need to be modified.

Sample Plot:

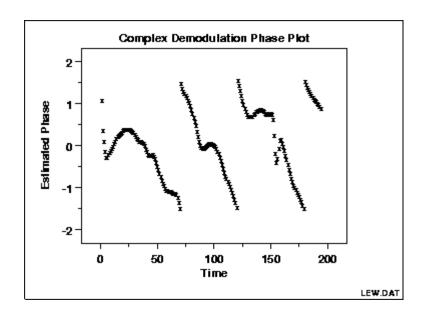

This complex demodulation phase plot shows that:

the specified demodulation frequency is incorrect;

• the demodulation frequency should be increased.

Definition

The complex demodulation phase plot is formed by:

Vertical axis: Phase Horizontal axis: Time

The mathematical computations for the phase plot are beyond the scope of the Handbook. Consult Granger (Granger, 1964) for details.

Questions

The complex demodulation phase plot answers the following question:

Is the specified demodulation frequency correct?

Importance
of a Good
Initial
Estimate
for the
Frequency

The non-linear fitting for the sinusoidal model:

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

is usually quite sensitive to the choice of good starting values. The initial estimate of the frequency,  $\omega$ , is obtained from a spectral plot. The complex demodulation phase plot is used to assess whether this estimate is adequate, and if it is not, whether it should be increased or decreased. Using the complex demodulation phase plot with the spectral plot can significantly improve the quality of the non-linear fits obtained.

Related Techniques Spectral Plot

Techniques Complex Demodulation Phase Plot

Non-Linear Fitting

Case Study

The complex demodulation amplitude plot is demonstrated in the <u>beam deflection data</u> case study.

Software

Complex demodulation phase plots are available in some, but not most, general purpose statistical software programs.



HOME

TOOLS & AIDS

SEARCH



# **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT


- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# **1.3.3.10.** Contour Plot

Purpose: Display 3-d surface on 2-d plot A contour plot is a graphical technique for representing a 3-dimensional surface by plotting constant z slices, called contours, on a 2-dimensional format. That is, given a value for z, lines are drawn for connecting the (x,y) coordinates where that z value occurs.

The contour plot is an alternative to a 3-D surface plot.

Sample Plot:

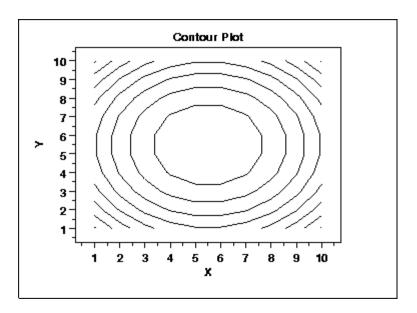

This contour plot shows that the surface is symmetric and peaks in the center.

**Definition** 

The contour plot is formed by:

- Vertical axis: Independent variable 2
- Horizontal axis: Independent variable 1
- Lines: iso-response values

The independent variables are usually restricted to a regular grid. The actual techniques for determining the correct isoresponse values are rather complex and are almost always computer generated.

An additional variable may be required to specify the Z values for drawing the iso-lines. Some software packages require explicit values. Other software packages will determine them automatically.

If the data (or function) do not form a regular grid, you typically need to perform a 2-D interpolation to form a regular grid.

**Questions** 

The contour plot is used to answer the question

How does Z change as a function of X and Y?

Importance: Visualizing 3-

dimensional data For univariate data, a <u>run sequence plot</u> and a <u>histogram</u> are considered necessary first steps in understanding the data. For 2-dimensional data, a <u>scatter plot</u> is a necessary first step in understanding the data.

In a similar manner, 3-dimensional data should be plotted. Small data sets, such as result from designed experiments, can typically be represented by <u>block plots</u>, <u>DOE mean plots</u>, and the like ("DOE" stands for "Design of Experiments"). For large data sets, a contour plot or a 3-D surface plot should be considered a necessary first step in understanding the data.

DOE Contour Plot The <u>DOE contour plot</u> is a specialized contour plot used in the design of experiments. In particular, it is useful for <u>full</u> and <u>fractional</u> designs.

Related Techniques 3-D Plot

Software

Contour plots are available in most general purpose statistical software programs. They are also available in many general purpose graphics and mathematics programs. These programs vary widely in the capabilities for the contour plots they generate. Many provide just a basic contour plot over a rectangular grid while others permit color filled or shaded contours.

Most statistical software programs that support design of experiments will provide a DOE contour plot capability.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.10. <u>Contour Plot</u>

## **1.3.3.10.1. DOE Contour Plot**

DOE
Contour Plot:
Introduction

The DOE contour plot is a specialized contour plot used in the analysis of <u>full</u> and <u>fractional</u> experimental designs. These designs often have a low level, coded as "-1" or "-", and a high level, coded as "+1" or "+" for each factor. In addition, there can optionally be one or more center points. Center points are at the mid-point between the low and high level for each factor and are coded as "0".

The DOE contour plot is generated for two factors. Typically, this would be the two most important factors as determined by previous analyses (e.g., through the use of the DOE mean plots and an analysis of variance). If more than two factors are important, you may want to generate a series of DOE contour plots, each of which is drawn for two of these factors. You can also generate a matrix of all pairwise DOE contour plots for a number of important factors (similar to the scatter plot matrix for scatter plots).

The typical application of the DOE contour plot is in determining settings that will maximize (or minimize) the response variable. It can also be helpful in determining settings that result in the response variable hitting a pre-determined target value. The DOE contour plot plays a useful role in determining the settings for the next iteration of the experiment. That is, the initial experiment is typically a fractional factorial design with a fairly large number of factors. After the most important factors are determined, the DOE contour plot can be used to help define settings for a full factorial or response surface design based on a smaller number of factors.

Construction of DOE
Contour Plot

The following are the primary steps in the construction of the DOE contour plot.

- 1. The x and y axes of the plot represent the values of the first and second factor (independent) variables.
- 2. The four vertex points are drawn. The vertex points are (-1,-1), (-1,1), (1,1), (1,-1). At each vertex point, the average of all the response values at that vertex point is printed.
- 3. Similarly, if there are center points, a point is drawn at (0,0) and the average of the response values at the center points is printed.
- 4. The **linear** DOE contour plot assumes the model:

$$Y = \mu + \beta_1 \cdot U_1 + \beta_2 \cdot U_2 + \beta_{12} \cdot U_1 \cdot U_2$$

where  $\mu$  is the overall mean of the response variable. The values of  $\beta_1$ ,  $\beta_2$ ,  $\beta_{12}$ , and  $\mu$  are estimated from the vertex points using <u>least squares</u> estimation.

In order to generate a single contour line, we need a value for Y, say Y. Next, we

n

solve for  $U_2$  in terms of  $U_1$  and, after doing the algebra, we have the equation:


$$U_2=rac{(Y_0-\mu)-eta_1\cdot U_1}{eta_2+eta_{12}\cdot U_1}$$

We generate a sequence of points for  $U_1$  in the range -2 to 2 and compute the corresponding values of  $U_2$ . These points constitute a single contour line corresponding to  $Y = Y_0$ .

The user specifies the target values for which contour lines will be generated.

The above algorithm assumes a linear model for the design. DOE contour plots can also be generated for the case in which we assume a quadratic model for the design. The algebra for solving for  $U_2$  in terms of  $U_1$  becomes more complicated, but the fundamental idea is the same. Quadratic models are needed for the case when the average for the center points does not fall in the range defined by the vertex point (i.e., there is curvature).

Sample DOE Contour Plot The following is a DOE contour plot for the data used in the Eddy current case study. The analysis in that case study demonstrated that X1 and X2 were the most important factors.

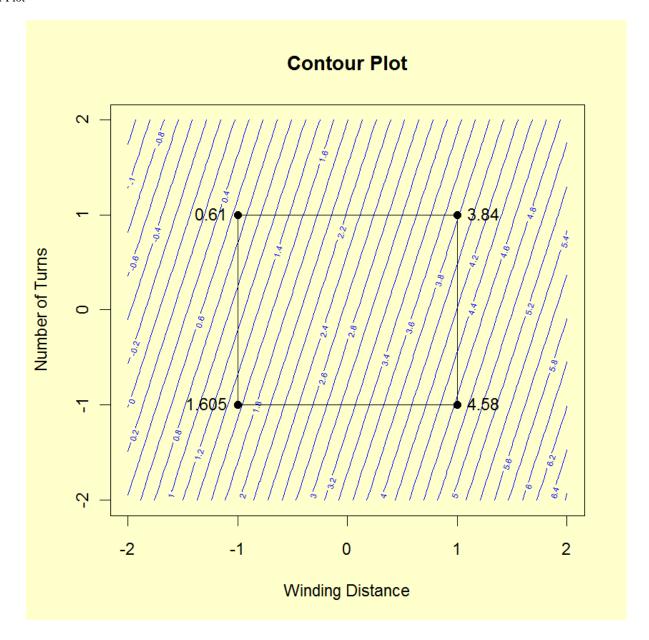

Interpretation of the Sample DOE
Contour Plot

From the above DOE contour plot we can derive the following information.

- 1. Interaction significance;
- 2. Best (data) setting for these two dominant factors;

Interaction Significance Note the appearance of the contour plot. If the contour curves are linear, then that implies that the interaction term is not significant; if the contour curves have considerable curvature, then that implies that the interaction term is large and important. In our case, the contour curves do not have considerable curvature, and so we conclude that the X1\*X2 term is not significant.

Best Settings

To determine the best factor settings for the already-run experiment, we first must define what "best" means. For the Eddy current data set used to generate this DOE contour plot, "best" means to **maximize** (rather than minimize or hit a target) the response. Hence from the contour plot we determine the best settings for the two dominant factors by simply scanning the four vertices and choosing the vertex with the **largest** value (= average response). In this case, it is (X1 = +1, X2 = +1).

As for factor X3, the contour plot provides no best setting information, and so we would resort to other tools: the main effects plot, the interaction effects matrix, or the ordered data to determine optimal X3 settings.

Case Study

The <u>Eddy current</u> case study demonstrates the use of the DOE contour plot in the context of the analysis of a full factorial design.

*Software* 

DOE Contour plots are available in many statistical software programs that analyze data from designed experiments.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


## **1.3.3.11. DOE Scatter Plot**

Purpose:
Determine
Important
Factors with
Respect to
Location and
Scale

The DOE scatter plot shows the response values for each level of each factor (i.e., independent) variable. This graphically shows how the location and scale vary for both within a factor variable and between different factor variables. This graphically shows which are the important factors and can help provide a ranked list of important factors from a designed experiment. The DOE scatter plot is a complement to the traditional analyis of variance of designed experiments.

DOE scatter plots are typically used in conjunction with the DOE mean plot and the DOE standard deviation plot. The DOE mean plot replaces the raw response values with mean response values while the DOE standard deviation plot replaces the raw response values with the standard deviation of the response values. There is value in generating all 3 of these plots. The DOE mean and standard deviation plots are useful in that the summary measures of location and spread stand out (they can sometimes get lost with the raw plot). However, the raw data points can reveal subtleties, such as the presence of outliers, that might get lost with the summary statistics.

Sample Plot: Factors 4, 2, 3, and 7 are the Important Factors.

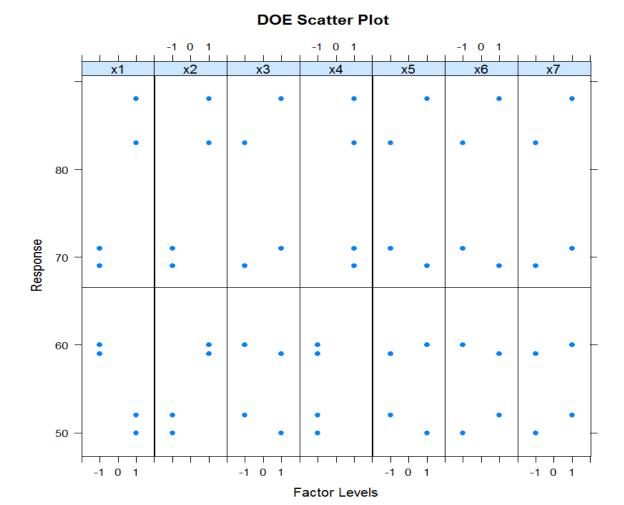

# Description of the Plot

For this sample plot, there are seven factors and each factor has two levels. For each factor, we define a distinct *x* coordinate for each level of the factor. For example, for factor 1, level 1 is coded as 0.8 and level 2 is coded as 1.2. The *y* coordinate is simply the value of the response variable. The solid horizontal line is drawn at the overall mean of the response variable. The vertical dotted lines are added for clarity.

Although the plot can be drawn with an arbitrary number of levels for a factor, it is really only useful when there are two or three levels for a factor.

#### Conclusions

This sample DOE scatter plot shows that:

- 1. there does not appear to be any outliers;
- 2. the levels of factors 2 and 4 show distinct location differences; and
- 3. the levels of factor 1 show distinct scale differences.

Definition: Response

Kesponse Values

Versus Factor Variables DOE scatter plots are formed by:

- Vertical axis: Value of the response variable
- Horizontal axis: Factor variable (with each level of the factor coded with a slightly offset *x* coordinate)

#### Questions

The DOE scatter plot can be used to answer the following questions:

- 1. Which factors are important with respect to location and scale?
- 2. Are there outliers?

Importance:
Identify
Important
Factors with
Respect to
Location and
Scale


The goal of many designed experiments is to determine which factors are important with respect to location and scale. A ranked list of the important factors is also often of interest. DOE scatter, mean, and standard deviation plots show this graphically. The DOE scatter plot additionally shows if outliers may potentially be distorting the results.

DOE scatter plots were designed primarily for analyzing designed experiments. However, they are useful for any type of multi-factor data (i.e., a response variable with two or more factor variables having a small number of distinct levels) whether or not the data were generated from a designed experiment.

Extension for Interaction Effects

Using the concept of the <u>scatterplot matrix</u>, the DOE scatter plot can be extended to display first order interaction effects.

Specifically, if there are k factors, we create a matrix of plots with k rows and k columns. On the diagonal, the plot is simply a DOE scatter plot with a single factor. For the off-diagonal plots, we multiply the values of  $X_i$  and  $X_j$ . For the common 2-level designs (i.e., each factor has two levels) the values are typically coded as -1 and 1, so the multiplied values are also -1 and 1. We then generate a DOE scatter plot for this interaction variable. This plot is called a DOE interaction effects plot and an example is shown below.

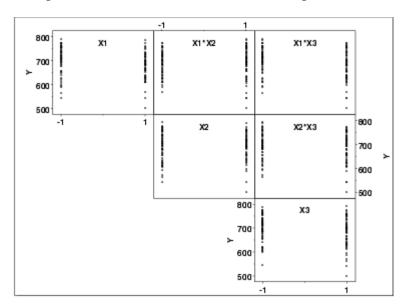

Interpretation of the DOE Interaction Effects Plot We can first examine the diagonal elements for the main effects. These diagonal plots show a great deal of overlap between the levels for all three factors. This indicates that location and scale effects will be relatively small.

We can then examine the off-diagonal plots for the first order interaction effects. For example, the plot in the first row and second column is the interaction between factors X1 and X2. As with the main effect plots, no clear patterns are evident.

Related Techniques

DOE mean plot
DOE standard deviation plot
Block plot

Box plot

Analysis of variance

Case Study The DOE scatter plot is demonstrated in the <u>ceramic strength</u> data case study.

Software DOE scatter plots are available in some general purpose statistical software programs, although the format may vary somewhat between these programs. They are essentially just scatter plots with the X variable defined in a particular way, so it should be feasible to write

macros for DOE scatter plots in most statistical software programs.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


## **1.3.3.12. DOE Mean Plot**

Purpose:
Detect
Important
Factors
With
Respect to
Location

The DOE mean plot is appropriate for analyzing data from a designed experiment, with respect to important factors, where the factors are at two or more levels. The plot shows mean values for the two or more levels of each factor plotted by factor. The means for a single factor are connected by a straight line. The DOE mean plot is a complement to the traditional <u>analysis of variance</u> of designed experiments.

This plot is typically generated for the mean. However, it can be generated for other location statistics such as the median.

Sample
Plot:
Factors 4,
2, and 1 Are
the Most
Important
Factors

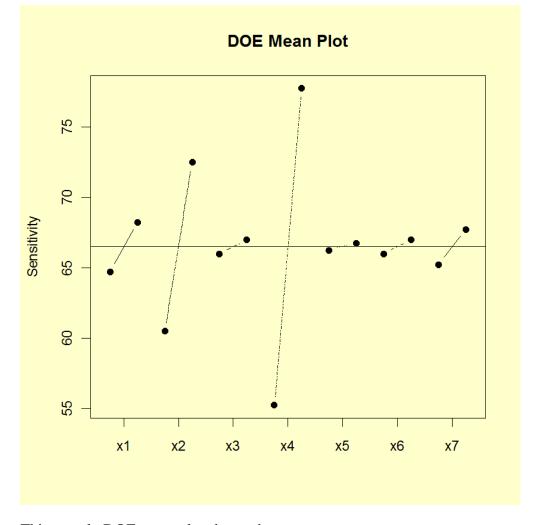

This sample DOE mean plot shows that:

- 1. factor 4 is the most important;
- 2. factor 2 is the second most important;
- 3. factor 1 is the third most important;
- 4. factor 7 is the fourth most important;
- 5. factor 6 is the fifth most important;
- 6. factors 3 and 5 are relatively unimportant.

In summary, factors 4, 2, and 1 seem to be clearly important, factors 3 and 5 seem to be clearly unimportant, and factors 6 and 7 are borderline factors whose inclusion in any subsequent models will be determined by further analyses.

Definition: Mean Response DOE mean plots are formed by:

Response Versus Factor

- Vertical axis: Mean of the response variable for each level of the factor
- · Horizontal axis: Factor variable

Questions

Variables

The DOE mean plot can be used to answer the following questions:

- 1. Which factors are important? The DOE mean plot does not provide a definitive answer to this question, but it does help categorize factors as "clearly important", "clearly not important", and "borderline importance".
- 2. What is the ranking list of the important factors?

Importance:
Determine
Significant
Factors


The goal of many designed experiments is to determine which factors are significant. A ranked order listing of the important factors is also often of interest. The DOE mean plot is ideally suited for answering these types of questions and we recommend its routine use in analyzing designed experiments.

Extension for Interaction Effects

Using the concept of the <u>scatter plot matrix</u>, the DOE mean plot can be extended to display first-order interaction effects.

Specifically, if there are k factors, we create a matrix of plots with k rows and k columns. On the diagonal, the plot is simply a DOE mean plot with a single factor. For the off-diagonal plots, measurements at each level of the interaction are plotted versus level, where level is  $X_i$  times  $X_j$  and  $X_i$  is the code for the ith main effect level and  $X_j$  is the code for the jth main effect. For the common 2-level designs (i.e., each factor has two levels) the values are typically coded as -1 and 1, so the multiplied values are also -1 and 1. We then generate a DOE mean plot for this interaction variable. This plot is called a DOE interaction effects plot and an example is shown below.

DOE Interaction Effects Plot

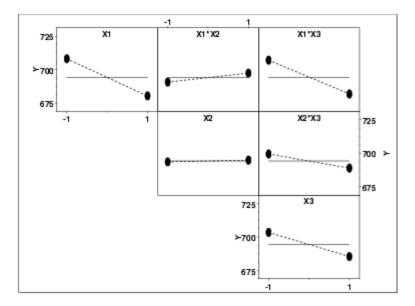

This plot shows that the most significant factor is X1 and the most significant interaction is between X1 and X3.

Related Techniques DOE scatter plot

DOE standard deviation plot

Block plot
Box plot

Analysis of variance

Case Study

The DOE mean plot and the DOE interaction effects plot are demonstrated in the <u>ceramic strength</u> data case study.

Software

DOE mean plots are available in some general purpose statistical software programs, although the format may vary somewhat between these programs. It may be feasible to write macros for DOE mean plots in some statistical software programs that do not support this plot directly.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


# 1.3.3.13. DOE Standard Deviation Plot

Purpose:
Detect
Important
Factors
With
Respect to
Scale

The DOE standard deviation plot is appropriate for analyzing data from a designed experiment, with respect to important factors, where the factors are at two or more levels and there are repeated values at each level. The plot shows standard deviation values for the two or more levels of each factor plotted by factor. The standard deviations for a single factor are connected by a straight line. The DOE standard deviation plot is a complement to the traditional <u>analysis of variance</u> of designed experiments.

This plot is typically generated for the standard deviation. However, it can also be generated for other scale statistics such as the range, the median absolute deviation, or the average absolute deviation.

Sample Plot

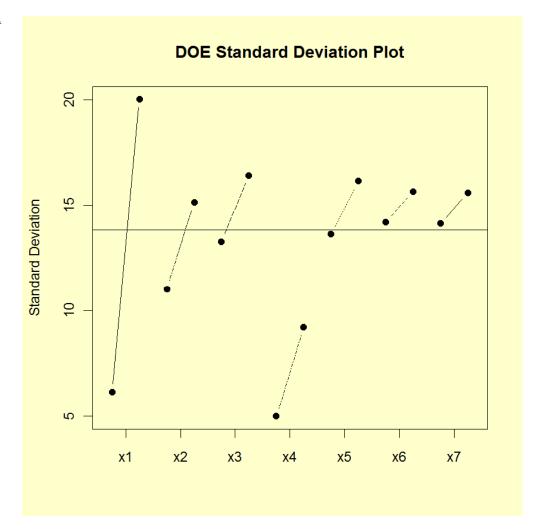

This sample DOE standard deviation plot shows that:

- 1. factor 1 has the greatest difference in standard deviations between factor levels;
- 2. factor 4 has a significantly lower average standard deviation than the average standard deviations of other factors (but the level 1 standard deviation for factor 1 is about the same as the level 1 standard deviation for factor 4);
- 3. for all factors, the level 1 standard deviation is smaller than the level 2 standard deviation.

Definition: Response DOE standard deviation plots are formed by:

Standard Deviations

- Vertical axis: Standard deviation of the response variable for each level of the factor
- Horizontal axis: Factor variable

Versus Factor Variables

Questions

The DOE standard deviation plot can be used to answer the following questions:

- 1. How do the standard deviations vary across factors?
- 2. How do the standard deviations vary within a factor?
- 3. Which are the most important factors with respect to scale?
- 4. What is the ranked list of the important factors with respect to scale?

Importance: Assess Variability The goal with many designed experiments is to determine which factors are significant. This is usually determined from the means of the factor levels (which can be conveniently shown with a DOE mean plot). A secondary goal is to assess the variability of the responses both within a factor and between factors. The DOE standard deviation plot is a convenient way to do this.

Related Techniques DOE scatter plot
DOE mean plot
Block plot
Box plot
Analysis of variance

Case Study

The DOE standard deviation plot is demonstrated in the <u>ceramic strength</u> data case study.

*Software* 

DOE standard deviation plots are not available in most general purpose statistical software programs. It may be feasible to write macros for DOE standard deviation plots in some statistical software programs that do not support them directly.



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

# **1.3.3.14.** Histogram

Purpose: Summarize The purpose of a histogram (<u>Chambers</u>) is to graphically summarize the distribution of a univariate data set.

a Univariate Data Set


The histogram graphically shows the following:

- 1. center (i.e., the location) of the data;
- 2. spread (i.e., the scale) of the data;
- 3. skewness of the data;
- 4. presence of outliers; and
- 5. presence of multiple modes in the data.

These features provide strong indications of the proper distributional model for the data. The <u>probability plot</u> or a <u>goodness-of-fit</u> test can be used to verify the distributional model.

The <u>examples</u> section shows the appearance of a number of common features revealed by histograms.

Sample Plot

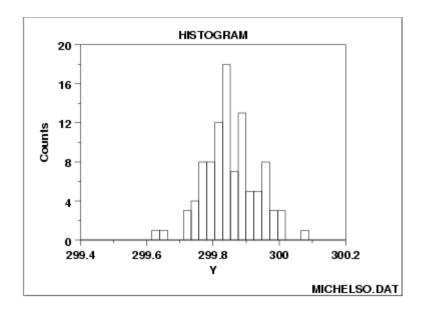

Definition

The most common form of the histogram is obtained by splitting the range of the data into equal-sized bins (called classes). Then for each bin, the number of points from the data set that fall into each bin are counted. That is

Vertical axis: Frequency (i.e., counts for each bin)

• Horizontal axis: Response variable

The classes can either be defined arbitrarily by the user or via some systematic rule. A number of theoretically derived rules have been proposed by Scott (Scott 1992).

The cumulative histogram is a variation of the histogram in which the vertical axis gives not just the counts for a single bin, but rather gives the counts for that bin plus all bins for smaller values of the response variable.

Both the histogram and cumulative histogram have an additional variant whereby the counts are replaced by the normalized counts. The names for these variants are the relative histogram and the relative cumulative histogram.

There are two common ways to normalize the counts.

- 1. The normalized count is the count in a class divided by the total number of observations. In this case the relative counts are normalized to sum to one (or 100 if a percentage scale is used). This is the intuitive case where the height of the histogram bar represents the proportion of the data in each class.
- 2. The normalized count is the count in the class divided by the number of observations times the class width. For this normalization, the area (or integral) under the histogram is equal to one. From a probabilistic point of view, this normalization results in a relative histogram that is most akin to the probability density function and a relative cumulative histogram that is most akin to the cumulative distribution function. If you want to overlay a probability density or cumulative distribution function on top of the histogram, use this normalization. Although this normalization is less intuitive (relative frequencies greater than 1 are quite permissible), it is the appropriate normalization if you are using the histogram to model a probability density function.

Questions The histogram can be used to answer the following questions:

- 1. What kind of population distribution do the data come from?
- 2. Where are the data located?
- 3. How spread out are the data?
- 4. Are the data symmetric or skewed?
- 5. Are there outliers in the data?

#### Examples

- 1. Normal
- 2. Symmetric, Non-Normal, Short-Tailed

- 3. Symmetric, Non-Normal, Long-Tailed
- 4. Symmetric and Bimodal
- 5. Bimodal Mixture of 2 Normals
- 6. Skewed (Non-Symmetric) Right
- 7. Skewed (Non-Symmetric) Left
- 8. Symmetric with Outlier

Related Techniques Box plot Probability plot

The techniques below are not discussed in the Handbook. However, they are similar in purpose to the histogram. Additional information on them is contained in the <a href="#">Chambers</a> and <a href="#">Scott</a> references.

Frequency Plot Stem and Leaf Plot Density Trace

Case Study

The histogram is demonstrated in the <u>heat flow meter</u> data

case study.

Software

Histograms are available in most general purpose statistical software programs. They are also supported in most general purpose charting, spreadsheet, and business graphics programs.



HOME


TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

# 1.3.3.14.1. Histogram Interpretation: Normal

Symmetric, Moderate-Tailed Histogram

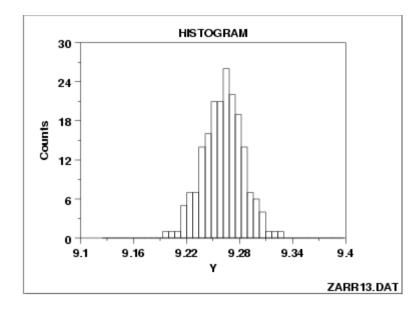

Note the classical bell-shaped, symmetric histogram with most of the frequency counts bunched in the middle and with the counts dying off out in the tails. From a physical science/engineering point of view, the normal distribution is that distribution which occurs most often in nature (due in part to the central limit theorem).

Recommended Next Step

If the histogram indicates a symmetric, moderate tailed distribution, then the recommended next step is to do a normal probability plot to confirm approximate normality. If the normal probability plot is linear, then the normal distribution is a good model for the data.



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK TOOLS & AIDS SEARCH BACK NEXT


- 1.3. EDA Techniques

1. Exploratory Data Analysis

- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

# 1.3.3.14.2. Histogram Interpretation: Symmetric, Non-Normal, Short-Tailed

Symmetric, Short-Tailed Histogram

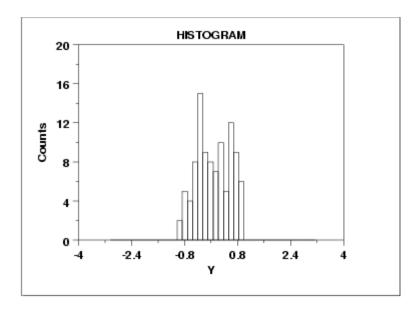

Description of What Short-Tailed Means For a symmetric distribution, the "body" of a distribution refers to the "center" of the distribution--commonly that region of the distribution where most of the probability resides--the "fat" part of the distribution. The "tail" of a distribution refers to the extreme regions of the distribution--both left and right. The "tail length" of a distribution is a term that indicates how fast these extremes approach zero.

For a short-tailed distribution, the tails approach zero very fast. Such distributions commonly have a truncated ("sawed-off") look. The classical short-tailed distribution is the uniform (rectangular) distribution in which the probability is constant over a given range and then drops to zero everywhere else--we would speak of this as having no tails, or extremely short tails.

For a moderate-tailed distribution, the tails decline to zero in a moderate fashion. The classical moderate-tailed distribution is the normal (Gaussian) distribution.

For a long-tailed distribution, the tails decline to zero very slowly--and hence one is apt to see probability a long way from the body of the distribution. The classical long-tailed distribution is the Cauchy distribution.

In terms of tail length, the histogram shown above would be characteristic of a "short-tailed" distribution.

The optimal (unbiased and most precise) estimator for location for the center of a distribution is heavily dependent on the tail length of the distribution. The common choice of taking N observations and using the calculated sample mean as the best estimate for the center of the distribution is a good choice for the normal distribution (moderate tailed), a poor choice for the uniform distribution (short tailed), and a horrible choice for the Cauchy distribution (long tailed). Although for the normal distribution the sample mean is as precise an estimator as we can get, for the uniform and Cauchy distributions, the sample mean is not the best estimator.

For the uniform distribution, the midrange

```
midrange = (smallest + largest) / 2
```

is the best estimator of location. For a Cauchy distribution, the median is the best estimator of location.

Recommended Next Step

If the histogram indicates a symmetric, short-tailed distribution, the recommended next step is to generate a uniform probability plot. If the uniform probability plot is linear, then the uniform distribution is an appropriate model for the data.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

# 1.3.3.14.3. Histogram Interpretation: Symmetric, Non-Normal, Long-Tailed

Symmetric, Long-Tailed Histogram

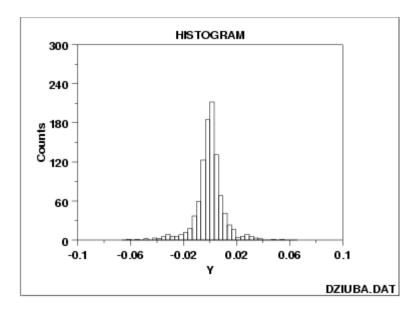

Description of Long-Tailed

The previous example contains a discussion of the distinction between <u>short-tailed</u>, <u>moderate-tailed</u>, <u>and long-tailed</u> distributions.

In terms of tail length, the histogram shown above would be characteristic of a "long-tailed" distribution.

Recommended Next Step If the histogram indicates a symmetric, long tailed distribution, the recommended next step is to do a <u>Cauchy probability plot</u>. If the Cauchy probability plot is linear, then the Cauchy distribution is an appropriate model for the data. Alternatively, a <u>Tukey Lambda PPCC plot</u> may provide insight into a suitable distributional model for the data.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

# 1.3.3.14.4. Histogram Interpretation: Symmetric and Bimodal

Symmetric, Bimodal Histogram

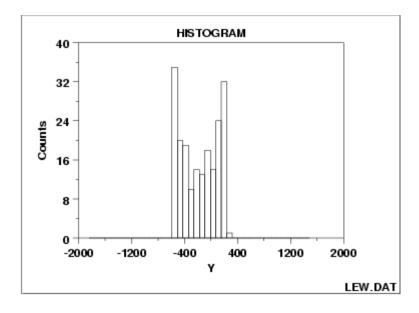

# Description of Bimodal

The mode of a distribution is that value which is most frequently occurring or has the largest probability of occurrence. The sample mode occurs at the peak of the histogram.

For many phenomena, it is quite common for the distribution of the response values to cluster around a single mode (unimodal) and then distribute themselves with lesser frequency out into the tails. The normal distribution is the classic example of a unimodal distribution.

The histogram shown above illustrates data from a bimodal (2 peak) distribution. The histogram serves as a tool for diagnosing problems such as bimodality. Questioning the underlying reason for distributional non-unimodality frequently leads to greater insight and improved deterministic modeling of the phenomenon under study. For example, for the data presented above, the bimodal histogram is caused by sinusoidality in the data.

Recommended Next Step If the histogram indicates a symmetric, bimodal distribution, the recommended next steps are to:

- 1. Do a <u>run sequence plot</u> or a <u>scatter plot</u> to check for sinusoidality.
- 2. Do a <u>lag plot</u> to check for sinusoidality. If the lag plot is elliptical, then the data are sinusoidal.
- 3. If the data are sinusoidal, then a spectral plot is used to graphically estimate the underlying sinusoidal frequency.
- 4. If the data are not sinusoidal, then a <u>Tukey Lambda</u> PPCC plot may determine the best-fit symmetric distribution for the data.
- 5. The data may be fit with a mixture of two distributions. A common approach to this case is to fit a mixture of 2 <u>normal</u> or <u>lognormal</u> distributions. Further discussion of fitting mixtures of distributions is beyond the scope of this Handbook.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

## 1.3.3.14.5. Histogram Interpretation: Bimodal Mixture of 2 Normals

Histogram from Mixture of 2 Normal Distributions

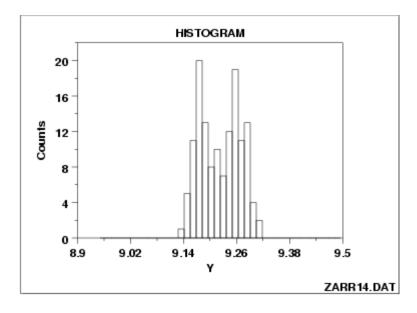

BACK NEXT

Discussion of Unimodal and Bimodal

The histogram shown above illustrates data from a bimodal (2 peak) distribution.

In contrast to the previous example, this example illustrates bimodality due not to an underlying deterministic model, but bimodality due to a mixture of probability models. In this case, each of the modes appears to have a rough bell-shaped component. One could easily imagine the above histogram being generated by a process consisting of two normal distributions with the same standard deviation but with two different locations (one centered at approximately 9.17 and the other centered at approximately 9.26). If this is the case, then the research challenge is to determine physically why there are two similar but separate sub-processes.

Recommended Next Steps

If the histogram indicates that the data might be appropriately fit with a mixture of two normal distributions, the recommended next step is:

Fit the normal mixture model using either least squares or maximum likelihood. The general normal mixing model is

$$M = p\phi_1 + (1-p)\phi_2$$

where p is the mixing proportion (between 0 and 1) and  $\phi_1$  and  $\phi_2$  are normal probability density functions with location and scale parameters  $\mu_1$ ,  $\sigma_1$ ,  $\mu_2$ , and  $\sigma_2$ , respectively. That is, there are 5 parameters to estimate in the fit.

Whether maximum likelihood or least squares is used, the quality of the fit is sensitive to good starting values. For the mixture of two normals, the histogram can be used to provide initial estimates for the location and scale parameters of the two normal distributions.

Both <u>Dataplot code</u> and <u>R code</u> can be used to fit a mixture of two normals.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS


SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

## 1.3.3.14.6. Histogram Interpretation: Skewed (Non-Normal) Right

Right-Skewed Histogram

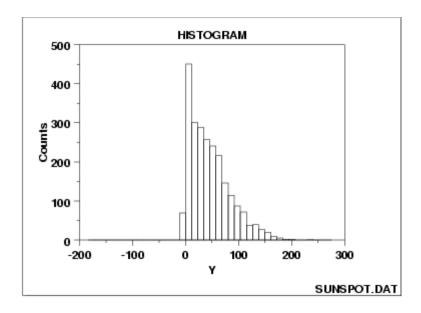

Discussion of Skewness

A symmetric distribution is one in which the 2 "halves" of the histogram appear as mirror-images of one another. A skewed (non-symmetric) distribution is a distribution in which there is no such mirror-imaging.

For skewed distributions, it is quite common to have one tail of the distribution considerably longer or drawn out relative to the other tail. A "skewed right" distribution is one in which the tail is on the right side. A "skewed left" distribution is one in which the tail is on the left side. The above histogram is for a distribution that is skewed right.

Skewed distributions bring a certain philosophical complexity to the very process of estimating a "typical value" for the distribution. To be specific, suppose that the analyst has a collection of 100 values randomly drawn from a distribution, and wishes to summarize these 100 observations by a "typical value". What does typical value mean? If the distribution is symmetric, the typical value is unambiguous—it is a well-defined center of the distribution. For example, for a bell-shaped symmetric distribution, a center point is identical to that value at the peak of the distribution.

For a skewed distribution, however, there is no "center" in the usual sense of the word. Be that as it may, several "typical value" metrics are often used for skewed distributions. The first metric is the mode of the distribution. Unfortunately, for severely-skewed distributions, the mode may be at or near the left or right tail of the data and so it seems not to be a good representative of the center of the distribution. As a second choice, one could conceptually argue that the mean (the point on the horizontal axis where the distribution would balance) would serve well as the typical value. As a third choice, others may argue that the median (that value on the horizontal axis which has exactly 50% of the data to the left (and also to the right) would serve as a good typical value.

For symmetric distributions, the conceptual problem disappears because at the population level the mode, mean, and median are identical. For skewed distributions, however, these 3 metrics are markedly different. In practice, for skewed distributions the most commonly reported typical value is the mean; the next most common is the median; the least common is the mode. Because each of these 3 metrics reflects a different aspect of "centerness", it is recommended that the analyst report at least 2 (mean and median), and preferably all 3 (mean, median, and mode) in summarizing and characterizing a data set.

Some Causes for Skewed Data Skewed data often occur due to lower or upper bounds on the data. That is, data that have a lower bound are often skewed right while data that have an upper bound are often skewed left. Skewness can also result from start-up effects. For example, in reliability applications some processes may have a large number of initial failures that could cause left skewness. On the other hand, a reliability process could have a long start-up period where failures are rare resulting in right-skewed data.

Data collected in scientific and engineering applications often have a lower bound of zero. For example, failure data must be non-negative. Many measurement processes generate only positive data. Time to occurence and size are common measurements that cannot be less than zero.

Recommended Next Steps If the histogram indicates a right-skewed data set, the recommended next steps are to:

- 1. Quantitatively summarize the data by computing and reporting the sample mean, the sample median, and the sample mode.
- 2. Determine the best-fit distribution (skewed-right)

#### from the

- Weibull family (for the maximum)
- Gamma family
- Chi-square family
- Lognormal family
- Power lognormal family
- 3. Consider a normalizing transformation such as the <u>Box-Cox transformation</u>.






- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

## 1.3.3.14.7. Histogram Interpretation: Skewed (Non-Symmetric) Left

Skewed Left Histogram

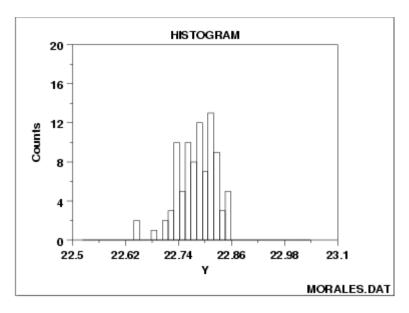

The issues for skewed left data are similar to those for skewed right data.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS


SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.14. <u>Histogram</u>

# **1.3.3.14.8.** Histogram Interpretation: Symmetric with Outlier

Symmetric Histogram with Outlier

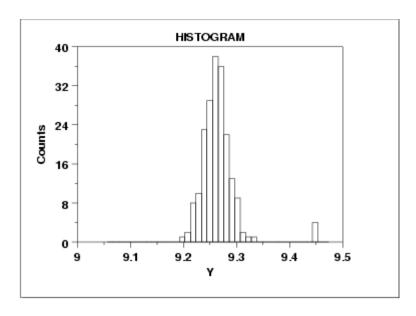

Discussion of Outliers

A symmetric distribution is one in which the 2 "halves" of the histogram appear as mirror-images of one another. The above example is symmetric with the exception of outlying data near Y = 4.5.

An outlier is a data point that comes from a distribution different (in location, scale, or distributional form) from the bulk of the data. In the real world, outliers have a range of causes, from as simple as

- 1. operator blunders
- 2. equipment failures
- 3. day-to-day effects
- 4. batch-to-batch differences
- 5. anomalous input conditions
- 6. warm-up effects

to more subtle causes such as

- 1. A change in settings of factors that (knowingly or unknowingly) affect the response.
- 2. Nature is trying to tell us something.

**Outliers** Should be Investigated All outliers should be taken seriously and should be investigated thoroughly for explanations. Automatic outlier-rejection schemes (such as throw out all data beyond 4 sample standard deviations from the sample mean) are particularly dangerous.

The classic case of automatic outlier rejection becoming automatic information rejection was the South Pole ozone depletion problem. Ozone depletion over the South Pole would have been detected years earlier except for the fact that the satellite data recording the low ozone readings had outlier-rejection code that automatically screened out the "outliers" (that is, the low ozone readings) before the analysis was conducted. Such inadvertent (and incorrect) purging went on for years. It was not until ground-based South Pole readings started detecting low ozone readings that someone decided to double-check as to why the satellite had not picked up this fact--it had, but it had gotten thrown out!

The best attitude is that outliers are our "friends", outliers are trying to tell us something, and we should not stop until we are comfortable in the explanation for each outlier.

Recommended Next Steps

If the histogram shows the presence of outliers, the recommended next steps are:

- 1. Graphically check for outliers (in the commonly encountered normal case) by generating a box plot. In general, box plots are a much better graphical tool for detecting outliers than are histograms.
- 2. Quantitatively check for outliers (in the commonly encountered normal case) by carrying out **Grubbs** test which indicates how many sample standard deviations away from the sample mean are the data in question. Large values indicate outliers.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH


BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.15. Lag Plot

Purpose: Check for randomness A lag plot checks whether a data set or time series is random or not. Random data should not exhibit any identifiable structure in the lag plot. Non-random structure in the lag plot indicates that the underlying data are not random. Several common patterns for lag plots are shown in the examples below.

Sample Plot

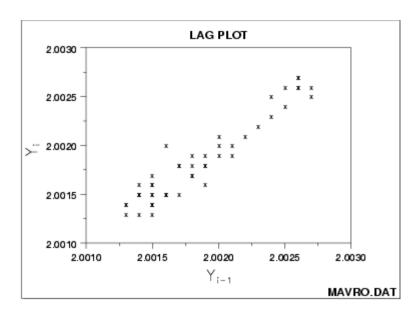

This sample lag plot exhibits a linear pattern. This shows that the data are strongly non-random and further suggests that an autoregressive model might be appropriate.

Definition

A lag is a fixed time displacement. For example, given a data set  $Y_1$ ,  $Y_2$  ...,  $Y_n$ ,  $Y_2$  and  $Y_7$  have lag 5 since 7 - 2 = 5. Lag plots can be generated for any arbitrary lag, although the most commonly used lag is 1.

A plot of lag 1 is a plot of the values of  $Y_i$  versus  $Y_{i-1}$ 

Vertical axis: Y<sub>i</sub> for all i
Horizontal axis: Y<sub>i-1</sub> for all i

Questions

Lag plots can provide answers to the following questions:

- 1. Are the data random?
- 2. Is there serial correlation in the data?
- 3. What is a suitable model for the data?
- 4. Are there outliers in the data?

*Importance* 

Inasmuch as randomness is an underlying assumption for most statistical estimation and testing techniques, the lag plot should be a routine tool for researchers.

Examples

- Random (White Noise)
- Weak autocorrelation
- Strong autocorrelation and autoregressive model
- Sinusoidal model and outliers

Related **Autocorrelation Plot** 

*Techniques* Spectrum

**Runs Test** 

Case Study The lag plot is demonstrated in the beam deflection data case

study.

Software Lag plots are not directly available in most general purpose

statistical software programs. Since the lag plot is essentially a scatter plot with the 2 variables properly lagged, it should be feasible to write a macro for the lag plot in most statistical

programs.



HOME


TOOLS & AIDS SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.15. Lag Plot

## 1.3.3.15.1. Lag Plot: Random Data

#### Lag Plot

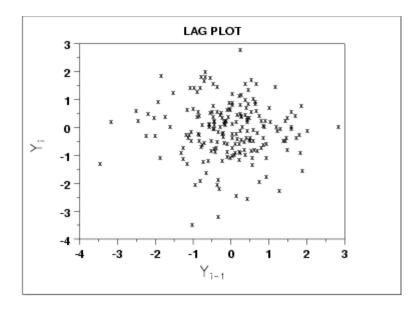

#### **Conclusions**

We can make the following conclusions based on the above plot.

- 1. The data are random.
- 2. The data exhibit no autocorrelation.
- 3. The data contain no outliers.

#### Discussion

The lag plot shown above is for lag = 1. Note the absence of structure. One cannot infer, from a current value  $Y_{i-1}$ , the next value  $Y_i$ . Thus for a known value  $Y_{i-1}$  on the horizontal axis (say,  $Y_{i-1} = +0.5$ ), the  $Y_i$ -th value could be virtually anything (from  $Y_i = -2.5$  to  $Y_i = +1.5$ ). Such non-association is the essence of randomness.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.15. Lag Plot

### 1.3.3.15.2. Lag Plot: Moderate Autocorrelation

Lag Plot

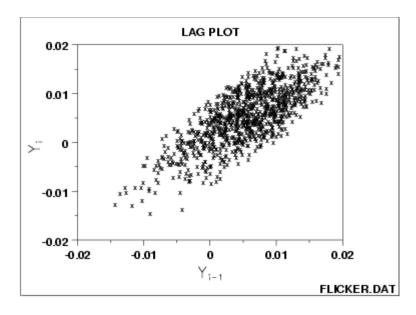

**Conclusions** 

We can make the conclusions based on the above plot.

- 1. The data are from an underlying autoregressive model with moderate positive autocorrelation
- 2. The data contain no outliers.

Discussion

In the plot above for lag = 1, note how the points tend to cluster (albeit noisily) along the diagonal. Such clustering is the lag plot signature of moderate autocorrelation.

If the process were completely random, knowledge of a current observation (say  $Y_{i-1} = 0$ ) would yield virtually no knowledge about the next observation  $Y_i$ . If the process has moderate autocorrelation, as above, and if  $Y_{i-1} = 0$ , then the range of possible values for  $Y_i$  is seen to be restricted to a smaller range (.01 to +.01). This suggests prediction is possible using an autoregressive model.

Recommended Next Step Estimate the parameters for the autoregressive model:

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Since Y and Y are precisely the axes of the lag plot,

such estimation is a <u>linear regression</u> straight from the lag plot.

The residual standard deviation for the autoregressive model will be much smaller than the residual standard deviation for the default model

$$Y_i = A_0 + E_i$$



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.15. Lag Plot

## 1.3.3.15.3. Lag Plot: Strong Autocorrelation and Autoregressive Model

#### Lag Plot

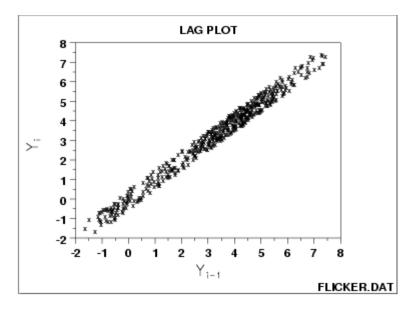

#### **Conclusions**

We can make the following conclusions based on the above plot.

- 1. The data come from an underlying autoregressive model with strong positive autocorrelation
- 2. The data contain no outliers.

#### Discussion

Note the tight clustering of points along the diagonal. This is the lag plot signature of a process with strong positive autocorrelation. Such processes are highly non-random-there is strong association between an observation and a succeeding observation. In short, if you know  $Y_{i-1}$  you can make a strong guess as to what  $Y_i$  will be.

If the above process were completely random, the plot would have a shotgun pattern, and knowledge of a current observation (say  $Y_{i-1} = 3$ ) would yield virtually no knowledge about the next observation  $Y_i$  (it could here be anywhere from -2 to +8). On the other hand, if the process had strong autocorrelation, as seen above, and if  $Y_{i-1} = 3$ , then the range of possible values for Y is seen to be

restricted to a smaller range (2 to 4)--still wide, but an improvement nonetheless (relative to -2 to +8) in predictive power.

Recommended Next Step

When the lag plot shows a strongly autoregressive pattern and only successive observations appear to be correlated, the next steps are to:

1. Extimate the parameters for the autoregressive

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Since  $Y_i$  and  $Y_{i-1}$  are precisely the axes of the lag plot, such estimation is a <u>linear regression</u> straight from the lag plot.

The residual standard deviation for this autoregressive model will be much smaller than the residual standard deviation for the default model

$$Y_i = A_0 + E_i$$

- 2. Reexamine the system to arrive at an explanation for the strong autocorrelation. Is it due to the
  - 1. phenomenon under study; or
  - 2. drifting in the environment; or
  - 3. contamination from the data acquisition system?

Sometimes the source of the problem is contamination and carry-over from the data acquisition system where the system does not have time to electronically recover before collecting the next data point. If this is the case, then consider slowing down the sampling rate to achieve randomness.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.15. Lag Plot

## 1.3.3.15.4. Lag Plot: Sinusoidal Models and Outliers

Lag Plot

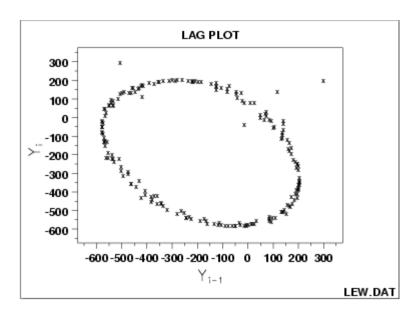

**Conclusions** 

We can make the following conclusions based on the above plot.

- 1. The data come from an underlying single-cycle sinusoidal model.
- 2. The data contain three outliers.

Discussion

In the plot above for lag = 1, note the tight elliptical clustering of points. Processes with a single-cycle sinusoidal model will have such elliptical lag plots.

Consequences of Ignoring Cyclical Pattern If one were to naively assume that the above process came from the null model

$$Y_i = A_0 + E_i$$

and then estimate the constant by the sample mean, then the analysis would suffer because

- 1. the sample mean would be biased and meaningless;
- 2. the confidence limits would be meaningless and optimistically small.

The proper model

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

(where  $\alpha$  is the amplitude,  $\omega$  is the frequency-between 0 and .5 cycles per observation--, and  $\phi$  is the phase) can be fit by standard non-linear least squares, to estimate the coefficients and their uncertainties.

The lag plot is also of value in outlier detection. Note in the above plot that there appears to be 4 points lying off the ellipse. However, in a lag plot, each point in the original data set Y shows up twice in the lag plot--once as  $Y_i$  and once as  $Y_{i-1}$ . Hence the outlier in the upper left at  $Y_i = 300$ is the same raw data value that appears on the far right at  $Y_{i-1} = 300$ . Thus (-500,300) and (300,200) are due to the same outlier, namely the 158th data point: 300. The correct value for this 158th point should be approximately -300 and so it appears that a sign got dropped in the data collection. The other two points lying off the ellipse, at roughly (100,100) and at (0,-50), are caused by two faulty data values: the third data point of -15 should be about +125 and the fourth data point of +141 should be about -50, respectively. Hence the 4 apparent lag plot outliers are traceable to 3 actual outliers in the original run sequence: at points 4 (-15), 5 (141) and 158 (300). In retrospect, only one of these (point 158 (= 300)) is an obvious outlier in the run sequence plot.

Unexpected Value of EDA

Frequently a technique (e.g., the lag plot) is constructed to check one aspect (e.g., randomness) which it does well. Along the way, the technique also highlights some other anomaly of the data (namely, that there are 3 outliers). Such outlier identification and removal is extremely important for detecting irregularities in the data collection system, and also for arriving at a "purified" data set for modeling. The lag plot plays an important role in such outlier identification.

Recommended Next Step When the lag plot indicates a sinusoidal model with possible outliers, the recommended next steps are:

- 1. Do a spectral plot to obtain an initial estimate of the frequency of the underlying cycle. This will be helpful as a starting value for the subsequent nonlinear fitting.
- 2. Omit the outliers.
- 3. Carry out a non-linear fit of the model to the 197 points.

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


#### 1.3.3.16. Linear Correlation Plot

Purpose: Detect changes in correlation between groups Linear correlation plots are used to assess whether or not correlations are consistent across groups. That is, if your data is in groups, you may want to know if a single correlation can be used across all the groups or whether separate correlations are required for each group.

Linear correlation plots are often used in conjunction with linear slope, linear intercept, and linear residual standard deviation plots. A linear correlation plot could be generated intially to see if linear fitting would be a fruitful direction. If the correlations are high, this implies it is worthwhile to continue with the linear slope, intercept, and residual standard deviation plots. If the correlations are weak, a different model needs to be pursued.

In some cases, you might not have groups. Instead you may have different data sets and you want to know if the same correlation can be adequately applied to each of the data sets. In this case, simply think of each distinct data set as a group and apply the linear slope plot as for groups.



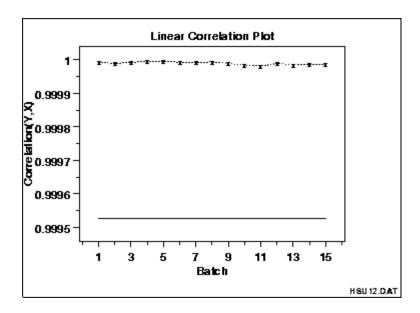

This linear correlation plot shows that the correlations are high for all groups. This implies that linear fits could provide a good model for each of these groups.

Definition: Group

Group Correlations

Versus Group ID Linear correlation plots are formed by:

Vertical axis: Group correlations Horizontal axis: Group identifier

A reference line is plotted at the correlation between the full data sets.

**Questions** 

The linear correlation plot can be used to answer the following questions.

- 1. Are there linear relationships across groups?
- 2. Are the strength of the linear relationships relatively constant across the groups?

Importance: Checking Group

Group Homogeneity For grouped data, it may be important to know whether the different groups are homogeneous (i.e., similar) or heterogeneous (i.e., different). Linear correlation plots help answer this question in the context of linear fitting.

Related Techniques <u>Linear Intercept Plot</u> <u>Linear Slope Plot</u>

Linear Residual Standard Deviation Plot

**Linear Fitting** 

Case Study

The linear correlation plot is demonstrated in the <u>Alaska pipeline</u> data case study.

*Software* 

Most general purpose statistical software programs do not support a linear correlation plot. However, if the statistical program can generate correlations over a group, it should be feasible to write a macro to generate this plot.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.17. Linear Intercept Plot


Purpose:
Detect
changes in
linear
intercepts
between
groups

Linear intercept plots are used to graphically assess whether or not linear fits are consistent across groups. That is, if your data have groups, you may want to know if a single fit can be used across all the groups or whether separate fits are required for each group.

Linear intercept plots are typically used in conjunction with <u>linear slope</u> and <u>linear residual standard deviation</u> plots.

In some cases you might not have groups. Instead, you have different data sets and you want to know if the same fit can be adequately applied to each of the data sets. In this case, simply think of each distinct data set as a group and apply the linear intercept plot as for groups.

Sample Plot

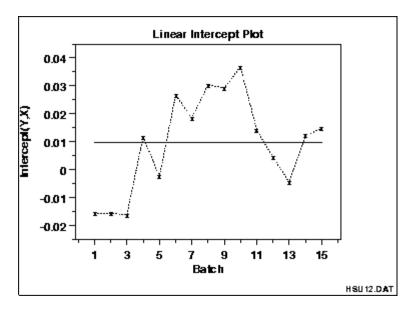

This linear intercept plot shows that there is a shift in intercepts. Specifically, the first three intercepts are lower than the intercepts for the other groups. Note that these are small differences in the intercepts.

Definition: Group Intercepts Versus Linear intercept plots are formed by:

- Vertical axis: Group intercepts from linear fits
- Horizontal axis: Group identifier

Group ID

A reference line is plotted at the intercept from a linear fit using all the data.

Questions

The linear intercept plot can be used to answer the following questions.

- 1. Is the intercept from linear fits relatively constant across groups?
- 2. If the intercepts vary across groups, is there a discernible pattern?

*Importance:* Checking Group Homogeneity For grouped data, it may be important to know whether the different groups are homogeneous (i.e., similar) or heterogeneous (i.e., different). Linear intercept plots help answer this question in the context of linear fitting.

Related *Techniques*  **Linear Correlation Plot Linear Slope Plot** 

Linear Residual Standard Deviation Plot

**Linear Fitting** 

Case Study

The linear intercept plot is demonstrated in the Alaska pipeline data case study.

Software

Most general purpose statistical software programs do not support a linear intercept plot. However, if the statistical program can generate linear fits over a group, it should be feasible to write a macro to generate this plot.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.18. Linear Slope Plot


Purpose: Detect changes in linear slopes between groups

Linear slope plots are used to graphically assess whether or not linear fits are consistent across groups. That is, if your data have groups, you may want to know if a single fit can be used across all the groups or whether separate fits are required for each group.

Linear slope plots are typically used in conjunction with <u>linear intercept</u> and <u>linear residual standard deviation</u> plots.

In some cases you might not have groups. Instead, you have different data sets and you want to know if the same fit can be adequately applied to each of the data sets. In this case, simply think of each distinct data set as a group and apply the linear slope plot as for groups.

Sample Plot

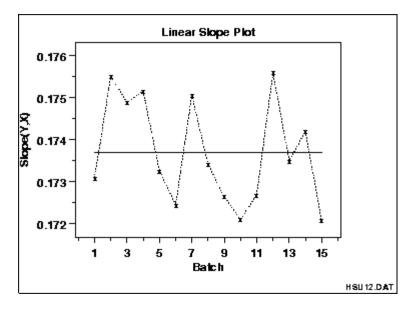

This linear slope plot shows that the slopes are about 0.174 (plus or minus 0.002) for all groups. There does not appear to be a pattern in the variation of the slopes. This implies that a single fit may be adequate.

Definition: Group Slopes Versus Group ID Linear slope plots are formed by:

- Vertical axis: Group slopes from linear fits
- Horizontal axis: Group identifier

A reference line is plotted at the slope from a linear fit using all the data.

Questions

The linear slope plot can be used to answer the following questions.

- 1. Do you get the same slope across groups for linear fits?
- 2. If the slopes differ, is there a discernible pattern in the slopes?

Importance: Checking Group Homogeneity For grouped data, it may be important to know whether the different groups are homogeneous (i.e., similar) or heterogeneous (i.e., different). Linear slope plots help answer this question in the context of linear fitting.

Related Techniques Linear Intercept Plot Linear Correlation Plot

Linear Residual Standard Deviation Plot

**Linear Fitting** 

Case Study The linear slope plot is demonstrated in the Alaska pipeline

data case study.

Software Most general purpose statistical software programs do not

support a linear slope plot. However, if the statistical program can generate linear fits over a group, it should be

feasible to write a macro to generate this plot.



HOME TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.19. Linear Residual Standard Deviation Plot

Purpose:
Detect
Changes in
Linear
Residual
Standard
Deviation
Between
Groups


Linear residual standard deviation (RESSD) plots are used to graphically assess whether or not linear fits are consistent across groups. That is, if your data have groups, you may want to know if a single fit can be used across all the groups or whether separate fits are required for each group.

The residual standard deviation is a goodness-of-fit measure. That is, the smaller the residual standard deviation, the closer is the fit to the data.

Linear RESSD plots are typically used in conjunction with linear intercept and linear slope plots. The linear intercept and slope plots convey whether or not the fits are consistent across groups while the linear RESSD plot conveys whether the adequacy of the fit is consistent across groups.

In some cases you might not have groups. Instead, you have different data sets and you want to know if the same fit can be adequately applied to each of the data sets. In this case, simply think of each distinct data set as a group and apply the linear RESSD plot as for groups.



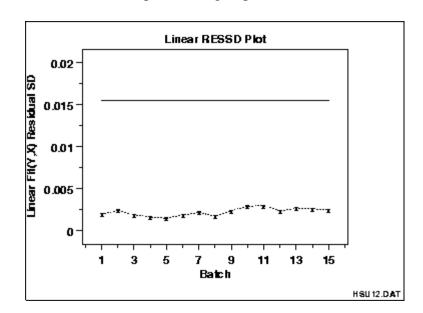

This linear RESSD plot shows that the residual standard deviations from a linear fit are about 0.0025 for all the groups.

Definition: Group Residual

Linear RESSD plots are formed by:

Standard Deviation

Versus

- Vertical axis: Group residual standard deviations from linear fits
- Horizontal axis: Group identifier

A reference line is plotted at the residual standard deviation Group ID from a linear fit using all the data. This reference line will typically be much greater than any of the individual residual standard deviations.

Questions

The linear RESSD plot can be used to answer the following questions.

- 1. Is the residual standard deviation from a linear fit constant across groups?
- 2. If the residual standard deviations vary, is there a discernible pattern across the groups?

*Importance:* Checking Group Homogeneity For grouped data, it may be important to know whether the different groups are homogeneous (i.e., similar) or heterogeneous (i.e., different). Linear RESSD plots help answer this question in the context of linear fitting.

Related *Techniques*  Linear Intercept Plot **Linear Slope Plot Linear Correlation Plot Linear Fitting** 

Case Study

The linear residual standard deviation plot is demonstrated in the Alaska pipeline data case study.

Software

Most general purpose statistical software programs do not support a linear residual standard deviation plot. However, if the statistical program can generate linear fits over a group, it should be feasible to write a macro to generate this plot.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.20. Mean Plot

Purpose:
Detect
changes in
location
between
groups


Mean plots are used to see if the mean varies between different groups of the data. The grouping is determined by the analyst. In most cases, the data set contains a specific grouping variable. For example, the groups may be the levels of a factor variable. In the sample plot below, the months of the year provide the grouping.

Mean plots can be used with ungrouped data to determine if the mean is changing over time. In this case, the data are split into an arbitrary number of equal-sized groups. For example, a data series with 400 points can be divided into 10 groups of 40 points each. A mean plot can then be generated with these groups to see if the mean is increasing or decreasing over time.

Although the mean is the most commonly used measure of location, the same concept applies to other measures of location. For example, instead of plotting the mean of each group, the median or the trimmed mean might be plotted instead. This might be done if there were significant outliers in the data and a more robust measure of location than the mean was desired.

Mean plots are typically used in conjunction with standard deviation plots. The mean plot checks for shifts in location while the <u>standard deviation</u> plot checks for shifts in scale.

Sample Plot

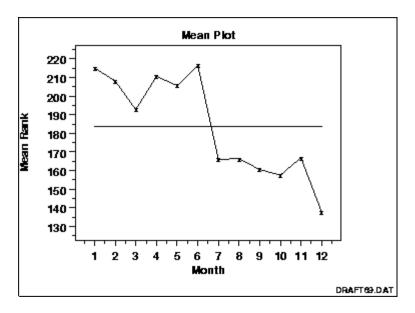

This sample mean plot shows a shift of location after the 6th month.

Definition: Group Means Versus Mean plots are formed by:

• Vertical axis: Group mean

• Horizontal axis: Group identifier

A reference line is plotted at the overall mean.

Questions

Group ID

The mean plot can be used to answer the following questions.

- 1. Are there any shifts in location?
- 2. What is the magnitude of the shifts in location?
- 3. Is there a distinct pattern in the shifts in location?

Importance: Checking Assumptions A common assumption in 1-factor analyses is that of constant location. That is, the location is the same for different levels of the factor variable. The mean plot provides a graphical check for that assumption. A common assumption for univariate data is that the location is constant. By grouping the data into equal intervals, the mean plot can provide a graphical test of this assumption.

Related Techniques **Standard Deviation Plot** 

**DOE Mean Plot** 

**Box Plot** 

*Software* 

Most general purpose statistical software programs do not support a mean plot. However, if the statistical program can generate the mean over a group, it should be feasible to write a macro to generate this plot. NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### 1.3.3.21. Normal Probability Plot


Purpose:
Check If Data
Are
Approximately
Normally
Distributed

The normal probability plot (<u>Chambers 1983</u>) is a graphical technique for assessing whether or not a data set is approximately <u>normally</u> distributed.

The data are plotted against a theoretical normal distribution in such a way that the points should form an approximate straight line. Departures from this straight line indicate departures from normality.

The normal probability plot is a special case of the <u>probability plot</u>. We cover the normal probability plot separately due to its importance in many applications.

Sample Plot

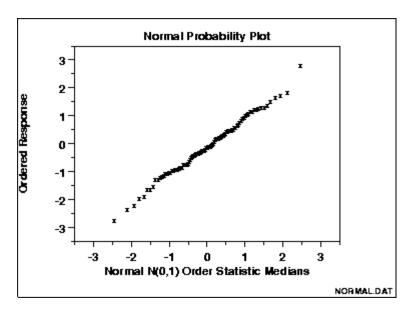

The points on this plot form a nearly linear pattern, which indicates that the normal distribution is a good model for this data set.

Definition:
Ordered
Response
Values Versus
Normal Order
Statistic
Medians

The normal probability plot is formed by:

- Vertical axis: Ordered response values
- Horizontal axis: Normal order statistic medians

The observations are plotted as a function of the corresponding normal order statistic medians which are

defined as:

$$N(i) = G(U(i))$$

where U(i) are the uniform order statistic medians (defined below) and G is the <u>percent point function</u> of the normal distribution. The percent point function is the inverse of the <u>cumulative distribution function</u> (probability that x is less than or equal to some value). That is, given a probability, we want the corresponding x of the cumulative distribution function.

The uniform order statistic medians are defined as:

$$U(i) = 1 - U(n)$$
 for  $i = 1$   
 $U(i) = (i - 0.3175)/(n + 0.365)$  for  $i = 2, 3, ..., n-1$   
 $U(i) = 0.5^{(1/n)}$  for  $i = n$ 

In addition, a straight line can be fit to the points and added as a reference line. The further the points vary from this line, the greater the indication of departures from normality.

<u>Probability plots</u> for distributions other than the normal are computed in exactly the same way. The normal percent point function (the G) is simply replaced by the percent point function of the desired distribution. That is, a probability plot can easily be generated for any distribution for which you have the percent point function.

One advantage of this method of computing probability plots is that the intercept and slope estimates of the fitted line are in fact estimates for the location and scale parameters of the distribution. Although this is not too important for the normal distribution since the location and scale are estimated by the mean and standard deviation, respectively, it can be useful for many other distributions.

The correlation coefficient of the points on the normal probability plot can be compared to a <u>table of critical</u> <u>values</u> to provide a formal test of the hypothesis that the data come from a normal distribution.

**Questions** 

The normal probability plot is used to answer the following questions.

- 1. Are the data normally distributed?
- 2. What is the nature of the departure from normality (data skewed, shorter than expected tails, longer than expected tails)?

Importance: Check

The underlying assumptions for a measurement process are that the data should behave like:

Normality Assumption

- 1. random drawings;
- 2. from a fixed distribution;
- 3. with fixed location;
- 4. with fixed scale.

Probability plots are used to assess the assumption of a fixed distribution. In particular, most statistical models are of the form:

response = deterministic + random

where the deterministic part is the fit and the random part is error. This error component in most common statistical models is specifically assumed to be normally distributed with fixed location and scale. This is the most frequent application of normal probability plots. That is, a model is fit and a normal probability plot is generated for the residuals from the fitted model. If the residuals from the fitted model are not normally distributed, then one of the major assumptions of the model has been violated.

Examples

- 1. Data are normally distributed
- 2. Data have short tails
- 3. Data have fat tails
- 4. Data are skewed right

Related **Techniques**  **Histogram** 

<u>Probability plots</u> for other distributions (e.g., Weibull)

Probability plot correlation coefficient plot (PPCC plot)

Anderson-Darling Goodness-of-Fit Test

Chi-Square Goodness-of-Fit Test

Kolmogorov-Smirnov Goodness-of-Fit Test

Case Study

The normal probability plot is demonstrated in the heat

flow meter data case study.

Software

Most general purpose statistical software programs can

generate a normal probability plot.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH




## TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.21. Normal Probability Plot

## 1.3.3.21.1. Normal Probability Plot: Normally Distributed Data

Normal Probability Plot The following normal probability plot is from the <u>heat flow</u> meter data.

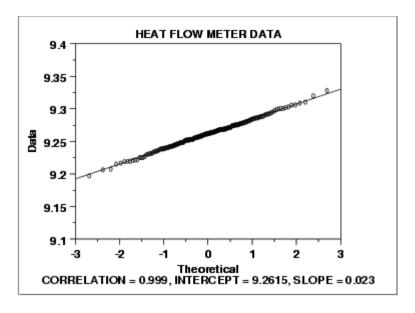

Conclusions

We can make the following conclusions from the above plot.

- 1. The normal probability plot shows a strongly linear pattern. There are only minor deviations from the line fit to the points on the probability plot.
- 2. The normal distribution appears to be a good model for these data.

Discussion

Visually, the probability plot shows a strongly linear pattern. This is verified by the correlation coefficient of 0.9989 of the line fit to the probability plot. The fact that the points in the lower and upper extremes of the plot do not deviate significantly from the straight-line pattern indicates that there are not any significant outliers (relative to a normal distribution).

In this case, we can quite reasonably conclude that the normal distribution provides an excellent model for the data. The intercept and slope of the fitted line give estimates of 9.26 and 0.023 for the location and scale parameters of the fitted normal distribution.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.21. Normal Probability Plot

## 1.3.3.21.2. Normal Probability Plot: Data Have Short Tails

Normal Probability Plot for Data with Short Tails The following is a normal probability plot for 500 random numbers generated from a <u>Tukey-Lambda</u> distribution with the  $\lambda$  parameter equal to 1.1.

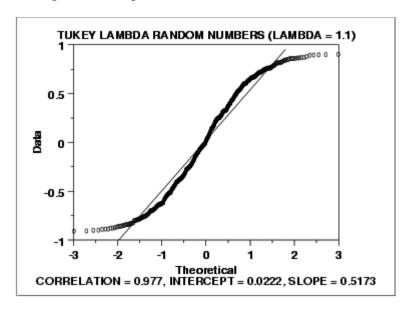

#### **Conclusions**

We can make the following conclusions from the above plot.

- 1. The normal probability plot shows a non-linear pattern.
- 2. The normal distribution is not a good model for these data.

#### Discussion

For data with short tails relative to the normal distribution, the non-linearity of the normal probability plot shows up in two ways. First, the middle of the data shows an S-like pattern. This is common for both short and long tails. Second, the first few and the last few points show a marked departure from the reference fitted line. In comparing this plot to the long tail example in the next section, the important difference is the direction of the departure from the fitted line for the first few and last few points. For short tails, the first few points show increasing departure from the fitted line *above* the line and last few points show increasing departure from the fitted line *below* the line. For long tails,

this pattern is reversed.

In this case, we can reasonably conclude that the normal distribution does not provide an adequate fit for this data set. For probability plots that indicate short-tailed distributions, the next step might be to generate a Tukey Lambda PPCC plot. The Tukey Lambda PPCC plot can often be helpful in identifying an appropriate distributional family.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.21. Normal Probability Plot

# 1.3.3.21.3. Normal Probability Plot: Data Have Long Tails

Normal Probability Plot for Data with Long Tails The following is a normal probability plot of 500 numbers generated from a <u>double exponential</u> distribution. The double exponential distribution is symmetric, but relative to the normal it declines rapidly and has longer tails.

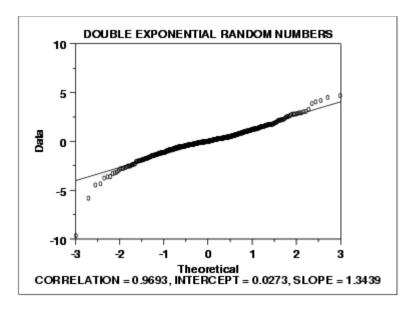

**Conclusions** 

We can make the following conclusions from the above plot.

- 1. The normal probability plot shows a reasonably linear pattern in the center of the data. However, the tails, particularly the lower tail, show departures from the fitted line.
- 2. A distribution other than the normal distribution would be a good model for these data.

Discussion

For data with long tails relative to the normal distribution, the non-linearity of the normal probability plot can show up in two ways. First, the middle of the data may show an S-like pattern. This is common for both short and long tails. In this particular case, the S pattern in the middle is fairly mild. Second, the first few and the last few points show marked departure from the reference fitted line. In the plot above, this is most noticeable for the first few data points. In

comparing this plot to the <u>short-tail example</u> in the previous section, the important difference is the direction of the departure from the fitted line for the first few and the last few points. For long tails, the first few points show increasing departure from the fitted line *below* the line and last few points show increasing departure from the fitted line *above* the line. For short tails, this pattern is reversed.

In this case we can reasonably conclude that the normal distribution can be improved upon as a model for these data. For probability plots that indicate long-tailed distributions, the next step might be to generate a <a href="Tukey Lambda PPCC">Tukey Lambda PPCC</a> plot. The Tukey Lambda PPCC plot can often be helpful in identifying an appropriate distributional family.



HOME

TOOLS & AIDS

SEARCH




## TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.21. Normal Probability Plot

## 1.3.3.21.4. Normal Probability Plot: Data are Skewed Right

Normal Probability Plot for Data that are Skewed Right

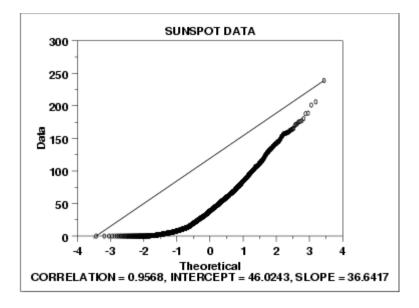

#### **Conclusions**

We can make the following conclusions from the above plot.

- 1. The normal probability plot shows a strongly nonlinear pattern. Specifically, it shows a quadratic pattern in which all the points are below a reference line drawn between the first and last points.
- 2. The normal distribution is not a good model for these data.

#### Discussion

This quadratic pattern in the normal probability plot is the signature of a significantly right-skewed data set. Similarly, if all the points on the normal probability plot fell above the reference line connecting the first and last points, that would be the signature pattern for a significantly left-skewed data set.

In this case we can quite reasonably conclude that we need to model these data with a right skewed distribution such as the Weibull or lognormal.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.22. Probability Plot

Purpose: Check If Data Follow a Given Distribution The probability plot (<u>Chambers 1983</u>) is a graphical technique for assessing whether or not a data set follows a given distribution such as the normal or Weibull.


The data are plotted against a theoretical distribution in such a way that the points should form approximately a straight line. Departures from this straight line indicate departures from the specified distribution.

The correlation coefficient associated with the linear fit to the data in the probability plot is a measure of the goodness of the fit. Estimates of the location and scale parameters of the distribution are given by the intercept and slope. Probability plots can be generated for several competing distributions to see which provides the best fit, and the probability plot generating the highest correlation coefficient is the best choice since it generates the straightest probability plot.

For distributions with <u>shape parameters</u> (not counting location and scale parameters), the shape parameters must be known in order to generate the probability plot. For distributions with a single shape parameter, the <u>probability plot correlation coefficient</u> (PPCC) plot provides an excellent method for estimating the shape parameter.

We cover the special case of the <u>normal probability plot</u> separately due to its importance in many statistical applications.

Sample Plot

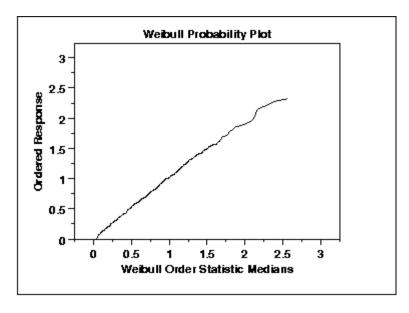

This data is a set of 500 Weibull random numbers with a shape parameter = 2, location parameter = 0, and scale parameter = 1. The Weibull probability plot indicates that the Weibull distribution does in fact fit these data well.

Definition:
Ordered
Response
Values
Versus Order
Statistic
Medians for
the Given
Distribution

The probability plot is formed by:

- Vertical axis: Ordered response values
- Horizontal axis: Order statistic medians for the given distribution

The order statistic medians are defined as:

$$N(i) = G(U(i))$$

where the U(i) are the uniform order statistic medians (defined below) and G is the <u>percent point function</u> for the desired distribution. The percent point function is the inverse of the <u>cumulative distribution function</u> (probability that x is less than or equal to some value). That is, given a probability, we want the corresponding x of the cumulative distribution function.

The uniform order statistic medians are defined as:

$$\begin{array}{l} m(i) = 1 - m(n) \text{ for } i = 1 \\ m(i) = (i - 0.3175)/(n + 0.365) \text{ for } i = 2, 3, ..., n\text{--}1 \\ m(i) = 0.5**(1/n) \text{ for } i = n \end{array}$$

In addition, a straight line can be fit to the points and added as a reference line. The further the points vary from this line, the greater the indication of a departure from the specified distribution.

This definition implies that a probability plot can be easily generated for any distribution for which the percent point function can be computed.

One advantage of this method of computing proability plots is that the intercept and slope estimates of the fitted line are in fact estimates for the location and scale parameters of the distribution. Although this is not too important for the normal distribution (the location and scale are estimated by the mean and standard deviation, respectively), it can be useful for many other distributions.

Questions

The probability plot is used to answer the following questions:

- Does a given distribution, such as the Weibull, provide a good fit to my data?
- What distribution best fits my data?
- What are good estimates for the location and scale parameters of the chosen distribution?

Importance: Check distributional assumption The discussion for the <u>normal probability plot</u> covers the use of probability plots for checking the fixed distribution assumption.

Some statistical models assume data have come from a population with a specific type of distribution. For example, in reliability applications, the Weibull, lognormal, and exponential are commonly used distributional models. Probability plots can be useful for checking this distributional assumption.

Related Techniques

<u>Histogram</u>
<u>Probability Plot Correlation Coefficient (PPCC) Plot</u>
Hazard Plot

**Ouantile-Ouantile Plot** 

Anderson-Darling Goodness of Fit

Chi-Square Goodness of Fit

Kolmogorov-Smirnov Goodness of Fit

Case Study

The probability plot is demonstrated in the <u>uniform random</u> <u>numbers</u> case study.

*Software* 

Most general purpose statistical software programs support probability plots for at least a few common distributions.



HOME TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.23. Probability Plot Correlation Coefficient Plot

Purpose:
Graphical
Technique for
Finding the
Shape
Parameter of
a
Distributional
Family that
Best Fits a
Data Set

The probability plot correlation coefficient (PPCC) plot (Filliben 1975) is a graphical technique for identifying the shape parameter for a distributional family that best describes the data set. This technique is appropriate for families, such as the Weibull, that are defined by a single shape parameter and location and scale parameters, and it is not appropriate for distributions, such as the normal, that are defined only by location and scale parameters.

The PPCC plot is generated as follows. For a series of values for the shape parameter, the correlation coefficient is computed for the <u>probability plot</u> associated with a given value of the shape parameter. These correlation coefficients are plotted against their corresponding shape parameters. The maximum correlation coefficient corresponds to the optimal value of the shape parameter. For better precision, two iterations of the PPCC plot can be generated; the first is for finding the right neighborhood and the second is for fine tuning the estimate.

The PPCC plot is used first to find a good value of the shape parameter. The <u>probability plot</u> is then generated to find estimates of the location and scale parameters and in addition to provide a graphical assessment of the adequacy of the distributional fit.

Compare
Distributions

In addition to finding a good choice for estimating the shape parameter of a given distribution, the PPCC plot can be useful in deciding which distributional family is most appropriate. For example, given a set of reliabilty data, you might generate PPCC plots for a Weibull, lognormal, gamma, and inverse Gaussian distributions, and possibly others, on a single page. This one page would show the best value for the shape parameter for several distributions and would additionally indicate which of these distributional families provides the best fit (as measured by the maximum probability plot correlation coefficient). That is, if the maximum PPCC value for the Weibull is 0.99 and only 0.94 for the lognormal, then we could reasonably

conclude that the Weibull family is the better choice.

Tukey-Lambda PPCC Plot for Symmetric Distributions The <u>Tukey Lambda</u> PPCC plot, with shape parameter  $\lambda$ , is particularly useful for symmetric distributions. It indicates whether a distribution is short or long tailed and it can further indicate several common distributions. Specifically,

- 1.  $\lambda = -1$ : distribution is approximately Cauchy
- 2.  $\lambda = 0$ : distribution is exactly logistic
- 3.  $\lambda = 0.14$ : distribution is approximately normal
- 4.  $\lambda = 0.5$ : distribution is U-shaped
- 5.  $\lambda = 1$ : distribution is exactly uniform

If the Tukey Lambda PPCC plot gives a maximum value near 0.14, we can reasonably conclude that the normal distribution is a good model for the data. If the maximum value is less than 0.14, a long-tailed distribution such as the double exponential or logistic would be a better choice. If the maximum value is near -1, this implies the selection of very long-tailed distribution, such as the Cauchy. If the maximum value is greater than 0.14, this implies a short-tailed distribution such as the Beta or uniform.


The Tukey-Lambda PPCC plot is used to suggest an appropriate distribution. You should follow-up with PPCC and probability plots of the appropriate alternatives.

Use
Judgement
When
Selecting An
Appropriate
Distributional
Family

When comparing distributional models, do not simply choose the one with the maximum PPCC value. In many cases, several distributional fits provide comparable PPCC values. For example, a lognormal and Weibull may both fit a given set of reliability data quite well. Typically, we would consider the complexity of the distribution. That is, a simpler distribution with a marginally smaller PPCC value may be preferred over a more complex distribution. Likewise, there may be theoretical justification in terms of the underlying scientific model for preferring a distribution with a marginally smaller PPCC value in some cases. In other cases, we may not need to know if the distributional model is optimal, only that it is adequate for our purposes. That is, we may be able to use techniques designed for normally distributed data even if other distributions fit the data somewhat better.

Sample Plot

The following is a PPCC plot of 100 normal random numbers. The maximum value of the correlation coefficient = 0.997 at  $\lambda$  = 0.099.

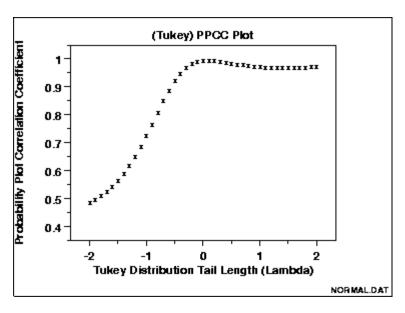

#### This PPCC plot shows that:

- 1. the best-fit symmetric distribution is nearly normal;
- 2. the data are not long tailed;
- 3. the sample mean would be an appropriate estimator of location.

We can follow-up this PPCC plot with a normal probability plot to verify the normality model for the data.

#### Definition:

The PPCC plot is formed by:

- Vertical axis: Probability plot correlation coefficient;
- Horizontal axis: Value of shape parameter.

#### **Questions**

The PPCC plot answers the following questions:

- 1. What is the best-fit member within a distributional family?
- 2. Does the best-fit member provide a good fit (in terms of generating a probability plot with a high correlation coefficient)?
- 3. Does this distributional family provide a good fit compared to other distributions?
- 4. How sensitive is the choice of the shape parameter?

#### *Importance*

Many statistical analyses are based on distributional assumptions about the population from which the data have been obtained. However, distributional families can have radically different shapes depending on the value of the shape parameter. Therefore, finding a reasonable choice for the shape parameter is a necessary step in the analysis. In many analyses, finding a good distributional model for the data is the primary focus of the analysis. In both of these cases, the PPCC plot is a valuable tool.

Related **Probability Plot** 

**Maximum Likelihood Estimation** *Techniques* 

**Least Squares Estimation** 

Method of Moments Estimation

*Software* PPCC plots are currently not available in most common

> general purpose statistical software programs. However, the underlying technique is based on probability plots and correlation coefficients, so it should be possible to write macros for PPCC plots in statistical programs that support

these capabilities. Dataplot supports PPCC plots.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.24. Quantile-Quantile Plot

Purpose:
Check If
Two Data
Sets Can Be
Fit With the
Same
Distribution

The quantile-quantile (q-q) plot is a graphical technique for determining if two data sets come from populations with a common distribution.

A q-q plot is a plot of the quantiles of the first data set against the quantiles of the second data set. By a quantile, we mean the fraction (or percent) of points below the given value. That is, the 0.3 (or 30%) quantile is the point at which 30% percent of the data fall below and 70% fall above that value.


A 45-degree reference line is also plotted. If the two sets come from a population with the same distribution, the points should fall approximately along this reference line. The greater the departure from this reference line, the greater the evidence for the conclusion that the two data sets have come from populations with different distributions.

The advantages of the q-q plot are:

- 1. The sample sizes do not need to be equal.
- 2. Many distributional aspects can be simultaneously tested. For example, shifts in location, shifts in scale, changes in symmetry, and the presence of outliers can all be detected from this plot. For example, if the two data sets come from populations whose distributions differ only by a shift in location, the points should lie along a straight line that is displaced either up or down from the 45-degree reference line.

The q-q plot is similar to a <u>probability plot</u>. For a probability plot, the quantiles for one of the data samples are replaced with the quantiles of a theoretical distribution.

Sample Plot

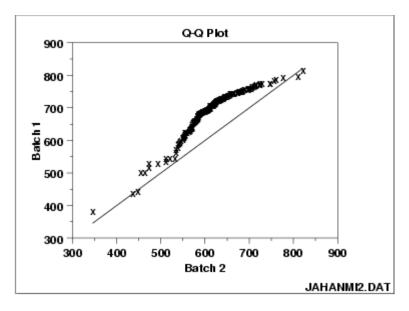

This q-q plot shows that

- 1. These 2 batches do not appear to have come from populations with a common distribution.
- 2. The batch 1 values are significantly higher than the corresponding batch 2 values.
- 3. The differences are increasing from values 525 to 625. Then the values for the 2 batches get closer again.

Definition:
Quantiles
for Data Set
1 Versus
Quantiles of
Data Set 2

The q-q plot is formed by:

- Vertical axis: Estimated quantiles from data set 1
- Horizontal axis: Estimated quantiles from data set 2

Both axes are in units of their respective data sets. That is, the actual quantile level is not plotted. For a given point on the q-q plot, we know that the quantile level is the same for both points, but not what that quantile level actually is.

If the data sets have the same size, the q-q plot is essentially a plot of sorted data set 1 against sorted data set 2. If the data sets are not of equal size, the quantiles are usually picked to correspond to the sorted values from the smaller data set and then the quantiles for the larger data set are interpolated.

Questions

The q-q plot is used to answer the following questions:

- Do two data sets come from populations with a common distribution?
- Do two data sets have common location and scale?
- Do two data sets have similar distributional shapes?
- Do two data sets have similar tail behavior?

Importance: Check for Common When there are two data samples, it is often desirable to know if the assumption of a common distribution is justified. If so, then location and scale estimators can pool both data

sets to obtain estimates of the common location and scale. If Distribution

two samples do differ, it is also useful to gain some

understanding of the differences. The q-q plot can provide more insight into the nature of the difference than analytical methods such as the chi-square and Kolmogorov-Smirnov 2-

sample tests.

Related **Bihistogram** 

*Techniques* T Test

F Test 2-Sample Chi-Square Test

2-Sample Kolmogorov-Smirnov Test

The quantile-quantile plot is demonstrated in the <u>ceramic</u> Case Study

strength data case study.

Software Q-Q plots are available in some general purpose statistical

> software programs. If the number of data points in the two samples are equal, it should be relatively easy to write a macro in statistical programs that do not support the q-q plot. If the number of points are not equal, writing a macro for a

q-q plot may be difficult.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


## **1.3.3.25. Run-Sequence Plot**

Purpose: Check for Shifts in Location and Scale and Outliers Run sequence plots (<u>Chambers 1983</u>) are an easy way to graphically summarize a univariate data set. A common assumption of univariate data sets is that they behave like:

- 1. random drawings;
- 2. from a fixed distribution;
- 3. with a common location; and
- 4. with a common scale.

With run sequence plots, shifts in location and scale are typically quite evident. Also, outliers can easily be detected.

Sample
Plot:
Last Third
of Data
Shows a
Shift of
Location

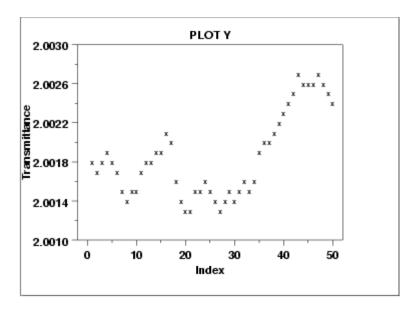

This sample run sequence plot shows that the location shifts up for the last third of the data.

Definition: y(i) Versus i

Run sequence plots are formed by:

- Vertical axis: Response variable Y(i)
- Horizontal axis: Index i (i = 1, 2, 3, ...)

Questions

The run sequence plot can be used to answer the following questions

- 1. Are there any shifts in location?
- 2. Are there any shifts in variation?
- 3. Are there any outliers?

The run sequence plot can also give the analyst an excellent feel for the data.

*Importance:* Check Univariate Assumptions For univariate data, the default model is

Y = constant + error

where the error is assumed to be random, from a fixed distribution, and with constant location and scale. The validity of this model depends on the validity of these assumptions. The run sequence plot is useful for checking for constant location and scale.

Even for more complex models, the assumptions on the error term are still often the same. That is, a run sequence plot of the residuals (even from very complex models) is still vital for checking for outliers and for detecting shifts in location and scale.

Related *Techniques*  **Scatter Plot Histogram** 

**Autocorrelation Plot** 

Lag Plot

Case Study

The run sequence plot is demonstrated in the <u>Filter</u>

transmittance data case study.

Software

Run sequence plots are available in most general purpose statistical software programs.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH


BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

### **1.3.3.26.** Scatter Plot

Purpose: Check for Relationship A scatter plot (<u>Chambers 1983</u>) reveals relationships or association between two variables. Such relationships manifest themselves by any non-random structure in the plot. Various common types of patterns are demonstrated in the <u>examples</u>.

Sample Plot: Linear Relationship Between Variables Y and X

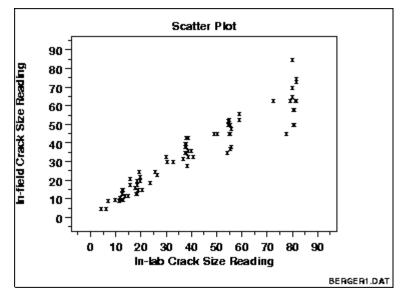

This sample plot reveals a linear relationship between the two variables indicating that a <u>linear regression model</u> might be appropriate.

Definition: Y Versus X

A scatter plot is a plot of the values of Y versus the corresponding values of X:

- Vertical axis: variable Y--usually the response variable
- Horizontal axis: variable X--usually some variable we suspect may ber related to the response

#### Questions

Scatter plots can provide answers to the following questions:

- 1. Are variables X and Y related?
- 2. Are variables X and Y linearly related?
- 3. Are variables X and Y non-linearly related?
- 4. Does the variation in Y change depending on X?
- 5. Are there outliers?

#### Examples

- 1. No relationship
- 2. Strong linear (positive correlation)
- 3. Strong linear (negative correlation)
- 4. Exact linear (positive correlation)
- 5. Quadratic relationship
- 6. Exponential relationship
- 7. Sinusoidal relationship (damped)
- 8. Variation of Y doesn't depend on X (homoscedastic)
- 9. <u>Variation of Y does depend on X (heteroscedastic)</u>
- 10. Outlier

#### Combining Scatter Plots

Scatter plots can also be combined in multiple plots per page to help understand higher-level structure in data sets with more than two variables.

The <u>scatterplot matrix</u> generates all pairwise scatter plots on a single page. The <u>conditioning plot</u>, also called a co-plot or subset plot, generates scatter plots of Y versus X dependent on the value of a third variable.

#### Causality Is Not Proved By Association

The scatter plot uncovers relationships in data.

"Relationships" means that there is some structured association (linear, quadratic, etc.) between X and Y. Note, however, that even though

causality implies association

association does NOT imply causality.

Scatter plots are a useful diagnostic tool for determining association, but if such association exists, the plot may or may not suggest an underlying cause-and-effect mechanism. A scatter plot can never "prove" cause and effect--it is ultimately only the researcher (relying on the underlying science/engineering) who can conclude that causality actually exists.

#### *Appearance*

The most popular rendition of a scatter plot is

- 1. some plot character (e.g., X) at the data points, and
- 2. no line connecting data points.

Other scatter plot format variants include

- 1. an optional plot character (e.g, X) at the data points, but
- 2. a solid line connecting data points.

In both cases, the resulting plot is referred to as a scatter plot, although the former (discrete and disconnected) is the author's personal preference since nothing makes it onto the screen except the data--there are no interpolative artifacts to

bias the interpretation.

Related Run Sequence Plot

Box Plot **Techniques** 

**Block Plot** 

Case Study The scatter plot is demonstrated in the <u>load cell calibration</u>

data case study.

Software Scatter plots are a fundamental technique that should be

available in any general purpose statistical software program.

Scatter plots are also available in most graphics and

spreadsheet programs as well.

NIST SEMATECH

HOME


TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.1. Scatter Plot: No Relationship

Scatter Plot with No Relationship

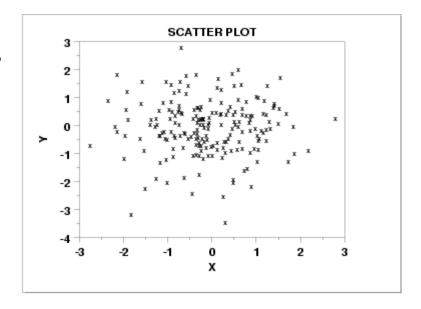

Discussion

Note in the plot above how for a given value of X (say X =0.5), the corresponding values of Y range all over the place from Y = -2 to Y = +2. The same is true for other values of X. This lack of predictablility in determining Y from a given value of X, and the associated amorphous, non-structured appearance of the scatter plot leads to the summary conclusion: no relationship.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.2. Scatter Plot: Strong Linear (positive correlation) Relationship

Scatter Plot Showing Strong Positive Linear Correlation

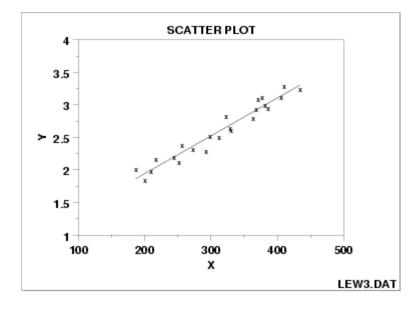

Discussion

Note in the plot above how a straight line comfortably fits through the data; hence a linear relationship exists. The scatter about the line is quite small, so there is a strong linear relationship. The slope of the line is positive (small values of X correspond to small values of Y; large values of X correspond to large values of Y), so there is a positive corelation (that is, a positive correlation) between *X* and *Y*.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.3. Scatter Plot: Strong Linear (negative correlation) Relationship

Scatter Plot Showing a Strong Negative Correlation

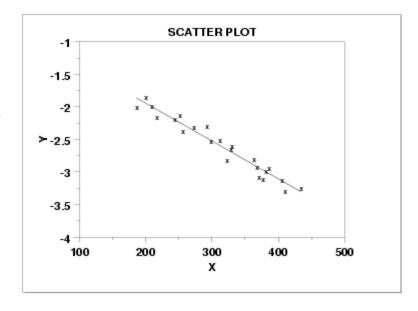

Discussion

Note in the plot above how a straight line comfortably fits through the data; hence there is a linear relationship. The scatter about the line is quite small, so there is a strong linear relationship. The slope of the line is negative (small values of X correspond to large values of Y; large values of X correspond to small values of Y), so there is a negative corelation (that is, a negative correlation) between *X* and *Y*.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.4. Scatter Plot: Exact Linear (positive correlation) Relationship

Scatter Plot Showing an Exact Linear Relationship

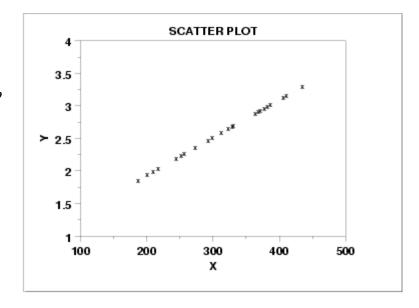

Discussion

Note in the plot above how a straight line comfortably fits through the data; hence there is a linear relationship. The scatter about the line is zero--there is perfect predictability between X and Y), so there is an exact linear relationship. The slope of the line is positive (small values of Xcorrespond to small values of Y; large values of X correspond to large values of Y), so there is a positive co-relation (that is, a positive correlation) between *X* and *Y*.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.5. Scatter Plot: Quadratic Relationship

Scatter Plot Showing Quadratic Relationship

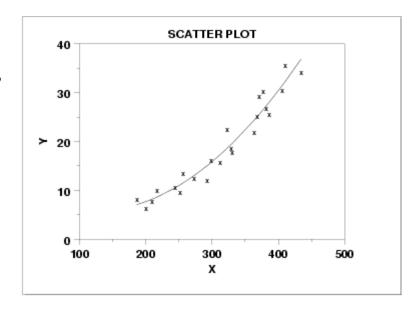

Discussion

Note in the plot above how no imaginable simple straight line could ever adequately describe the relationship between *X* and *Y*--a curved (or curvilinear, or non-linear) function is needed. The simplest such curvilinear function is a quadratic model

$$Y_i = A + BX_i + CX_i^2 + E_i$$

for some A, B, and C. Many other curvilinear functions are possible, but the data analysis principle of parsimony suggests that we try fitting a <u>quadratic function</u> first.



HOME

TOOLS & AIDS

SEARCH




## ENGINEERING STATISTICS HANDBOOK

- TOOLS & AIDS
- SEARCH
- BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

# 1.3.3.26.6. Scatter Plot: Exponential Relationship

Scatter Plot Showing Exponential Relationship

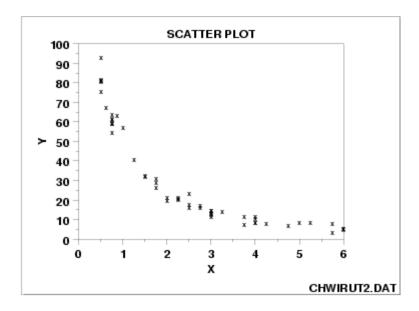

Discussion

Note that a simple straight line is grossly inadequate in describing the relationship between *X* and *Y*. A quadratic model would prove lacking, especially for large values of *X*. In this example, the large values of *X* correspond to nearly constant values of *Y*, and so a non-linear function beyond the quadratic is needed. Among the many other non-linear functions available, one of the simpler ones is the exponential model

$$Y_i = A + Be^{CX_i} + E_i$$

for some A, B, and C. In this case, an exponential function would, in fact, fit well, and so one is led to the summary conclusion of an exponential relationship.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS


SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

# 1.3.3.26.7. Scatter Plot: Sinusoidal Relationship (damped)

Scatter Plot Showing a Sinusoidal Relationship

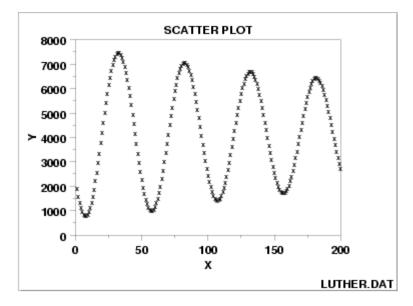

Discussion

The complex relationship between *X* and *Y* appears to be basically oscillatory, and so one is naturally drawn to the trigonometric sinusoidal model:

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

Closer inspection of the scatter plot reveals that the amount of swing (the amplitude  $\alpha$  in the model) does not appear to be constant but rather is decreasing (damping) as X gets large. We thus would be led to the conclusion: damped sinusoidal relationship, with the simplest corresponding model being

$$Y_i = C + (B_0 + B_1 * t_i) \sin(2\pi\omega t_i + \phi) + E_i$$



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## 1.3.3.26.8. Scatter Plot: Variation of Y Does Not **Depend on X (homoscedastic)**

Scatter Plot Showing Homoscedastic **Variability** 

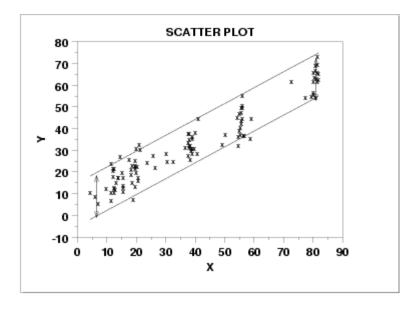

Discussion

This scatter plot reveals a linear relationship between X and Y: for a given value of X, the predicted value of Y will fall on a line. The plot further reveals that the variation in Y about the predicted value is about the same (+- 10 units), regardless of the value of X. Statistically, this is referred to as homoscedasticity. Such homoscedasticity is very important as it is an underlying assumption for regression, and its violation leads to parameter estimates with inflated variances. If the data are homoscedastic, then the usual regression estimates can be used. If the data are not homoscedastic, then the estimates can be improved using weighting procedures as shown in the next example.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

# **1.3.3.26.9.** Scatter Plot: Variation of Y Does Depend on X (heteroscedastic)

Scatter Plot Showing Heteroscedastic Variability

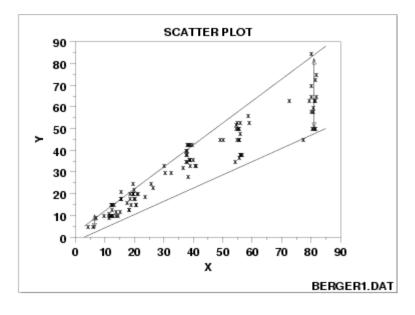

#### Discussion

This scatter plot reveals an approximate linear relationship between *X* and *Y*, but more importantly, it reveals a statistical condition referred to as heteroscedasticity (that is, nonconstant variation in *Y* over the values of *X*). For a heteroscedastic data set, the variation in *Y* differs depending on the value of *X*. In this example, small values of *X* yield small scatter in *Y* while large values of *X* result in large scatter in *Y*.

Heteroscedasticity complicates the analysis somewhat, but its effects can be overcome by:

- 1. proper weighting of the data with noisier data being weighted less, or by
- 2. performing a *Y* variable transformation to achieve homoscedasticity. The <u>Box-Cox normality plot</u> can help determine a suitable transformation.

Impact of Ignoring Unequal Fortunately, unweighted regression analyses on heteroscedastic data produce estimates of the coefficients that are unbiased. However, the coefficients will not be as Variability in the Data

precise as they would be with proper weighting.

Note further that if heteroscedasticity does exist, it is frequently useful to plot and model the local variation  $var(Y_i|X_i)$  as a function of X, as in  $var(Y_i|X_i) = g(X_i)$ . This modeling has two advantages:

- 1. it provides additional insight and understanding as to how the response Y relates to X; and
- 2. it provides a convenient means of forming weights for a weighted regression by simply using

$$w_i = W(Y_i|X_i) = \frac{1}{Var(Y_i|X_i)} = \frac{1}{g(X_i)}$$

The topic of <u>non-constant variation</u> is discussed in some detail in the process modeling chapter.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

### **1.3.3.26.10.** Scatter Plot: Outlier

Scatter
Plot
Showing
Outliers

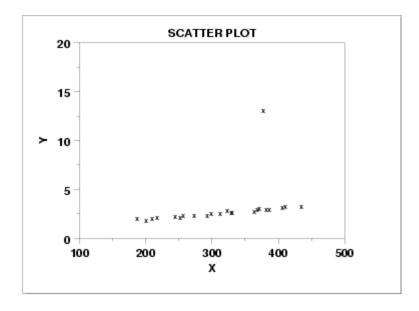

#### Discussion The scatter plot here reveals

- 1. a basic linear relationship between *X* and *Y* for most of the data, and
- 2. a single outlier (at X = 375).

An outlier is defined as a data point that emanates from a different model than do the rest of the data. The data here appear to come from a linear model with a given slope and variation except for the outlier which appears to have been generated from some other model.

Outlier detection is important for effective modeling. Outliers should be excluded from such model fitting. If all the data here are included in a linear regression, then the fitted model will be poor virtually everywhere. If the outlier is omitted from the fitting process, then the resulting fit will be excellent almost everywhere (for all points except the outlying point).



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## **1.3.3.26.11.** Scatterplot Matrix

Purpose: Check Pairwise Relationships Between Variables Given a set of variables  $X_1, X_2, ..., X_k$ , the scatterplot matrix contains all the pairwise scatter plots of the variables on a single page in a matrix format. That is, if there are k variables, the scatterplot matrix will have k rows and k columns and the ith row and jth column of this matrix is a plot of  $X_i$  versus  $X_j$ .


Although the basic concept of the scatterplot matrix is simple, there are numerous alternatives in the details of the plots.

- 1. The diagonal plot is simply a 45-degree line since we are plotting  $X_i$  versus  $X_i$ . Although this has some usefulness in terms of showing the univariate distribution of the variable, other alternatives are common. Some users prefer to use the diagonal to print the variable label. Another alternative is to plot the univariate histogram on the diagonal. Alternatively, we could simply leave the diagonal blank.
- 2. Since  $X_i$  versus  $X_j$  is equivalent to  $X_j$  versus  $X_i$  with the axes reversed, some prefer to omit the plots below the diagonal.
- 3. It can be helpful to overlay some type of fitted curve on the scatter plot. Although a linear or quadratic fit can be used, the most common alternative is to overlay a <u>lowess</u> curve.
- 4. Due to the potentially large number of plots, it can be somewhat tricky to provide the axes labels in a way that is both informative and visually pleasing. One alternative that seems to work well is to provide axis labels on alternating rows and columns. That is, row one will have tic marks and axis labels on the left vertical axis for the first plot only while row two will have the tic marks and axis labels for the right vertical axis for the last plot in the row only. This alternating pattern continues for the remaining rows.

A similar pattern is used for the columns and the horizontal axes labels. Another alternative is to put the minimum and maximum scale value in the diagonal plot with the variable name.

- 5. Some analysts prefer to connect the scatter plots. Others prefer to leave a little gap between each plot.
- 6. Although this plot type is most commonly used for scatter plots, the basic concept is both simple and powerful and extends easily to other plot formats that involve pairwise plots such as the quantile-quantile plot and the bihistogram.

Sample Plot

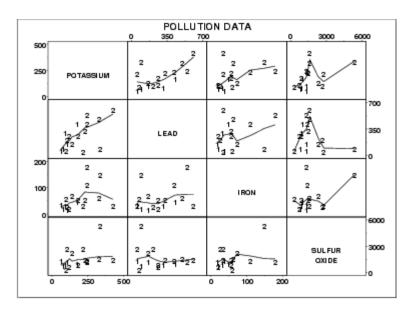

This sample plot was generated from pollution data collected by NIST chemist Lloyd Currie.

There are a number of ways to view this plot. If we are primarily interested in a particular variable, we can scan the row and column for that variable. If we are interested in finding the strongest relationship, we can scan all the plots and then determine which variables are related.

Definition

Given k variables, scatter plot matrices are formed by creating k rows and k columns. Each row and column defines a single scatter plot

The individual plot for row *i* and column *j* is defined as

Vertical axis: Variable X<sub>i</sub>
Horizontal axis: Variable X<sub>i</sub>

Questions

The scatterplot matrix can provide answers to the following questions:

- 1. Are there pairwise relationships between the variables?
- 2. If there are relationships, what is the nature of these relationships?
- 3. Are there outliers in the data?
- 4. Is there clustering by groups in the data?

## Linking and Brushing

The scatterplot matrix serves as the foundation for the concepts of linking and brushing.

By linking, we mean showing how a point, or set of points, behaves in each of the plots. This is accomplished by highlighting these points in some fashion. For example, the highlighted points could be drawn as a filled circle while the remaining points could be drawn as unfilled circles. A typical application of this would be to show how an outlier shows up in each of the individual pairwise plots. Brushing extends this concept a bit further. In brushing, the points to be highlighted are interactively selected by a mouse and the scatterplot matrix is dynamically updated (ideally in real time). That is, we can select a rectangular region of points in one plot and see how those points are reflected in the other plots. Brushing is discussed in detail by Becker, Cleveland, and Wilks in the paper "Dynamic Graphics for Data Analysis" (Cleveland and McGill, 1988).

Related Techniques Star plot Scatter plot

Conditioning plot

Locally weighted least squares

Software

Scatterplot matrices are becoming increasingly common in general purpose statistical software programs. If a software program does not generate scatterplot matrices, but it does provide multiple plots per page and scatter plots, it should be possible to write a macro to generate a scatterplot matrix. Brushing is available in a few of the general purpose statistical software programs that emphasize graphical approaches.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.26. Scatter Plot

## **1.3.3.26.12.** Conditioning Plot

Purpose: Check pairwise relationship between two variables conditional on a third variable

A conditioning plot, also known as a coplot or subset plot, is a plot of two variables conditional on the value of a third variable (called the conditioning variable). The conditioning variable may be either a variable that takes on only a few discrete values or a continuous variable that is divided into a limited number of subsets.

One limitation of the <u>scatterplot matrix</u> is that it cannot show interaction effects with another variable. This is the strength of the conditioning plot. It is also useful for displaying scatter plots for groups in the data. Although these groups can also be plotted on a single plot with different plot symbols, it can often be visually easier to distinguish the groups using the conditioning plot.

Although the basic concept of the conditioning plot matrix is simple, there are numerous alternatives in the details of the plots.

- 1. It can be helpful to overlay some type of fitted curve on the scatter plot. Although a linear or quadratic fit can be used, the most common alternative is to overlay a lowess curve.
- 2. Due to the potentially large number of plots, it can be somewhat tricky to provide the axis labels in a way that is both informative and visually pleasing. One alternative that seems to work well is to provide axis labels on alternating rows and columns. That is, row one will have tic marks and axis labels on the left vertical axis for the first plot only while row two will have the tic marks and axis labels for the right vertical axis for the last plot in the row only. This alternating pattern continues for the remaining rows. A similar pattern is used for the columns and the horizontal axis labels. Note that this approach only works if the axes limits are fixed to common values for all of the plots.
- 3. Some analysts prefer to connect the scatter plots.


  Others prefer to leave a little gap between each plot.

  Alternatively, each plot can have its own labeling with

the plots not connected.

4. Although this plot type is most commonly used for scatter plots, the basic concept is both simple and powerful and extends easily to other plot formats.

Sample Plot

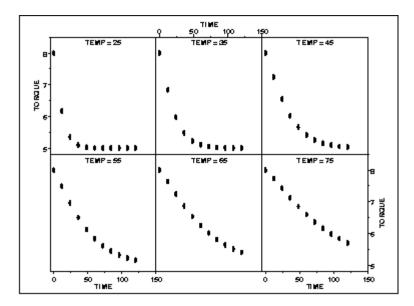

In this case, temperature has six distinct values. We plot torque versus time for each of these temperatures. This example is discussed in more detail in the <u>process modeling</u> chapter.

Definition

Given the variables X, Y, and Z, the conditioning plot is formed by dividing the values of Z into k groups. There are several ways that these groups may be formed. There may be a natural grouping of the data, the data may be divided into several equal sized groups, the grouping may be determined by clusters in the data, and so on. The page will be divided into n rows and c columns where  $nc \ge k$ . Each row and column defines a single scatter plot.

The individual plot for row i and column j is defined as

Vertical axis: Variable *Y*Horizontal axis: Variable *X*

where only the points in the group corresponding to the *i*th row and *j*th column are used.

**Questions** 

The conditioning plot can provide answers to the following questions:

- 1. Is there a relationship between two variables?
- 2. If there is a relationship, does the nature of the relationship depend on the value of a third variable?
- 3. Are groups in the data similar?
- 4. Are there outliers in the data?

Related Scatter plot

Scatterplot matrix *Techniques* 

Locally weighted least squares

*Software* Scatter plot matrices are becoming increasingly common in

general purpose statistical software programs, including. If a software program does not generate conditioning plots, but it does provide multiple plots per page and scatter plots, it

should be possible to write a macro to generate a

conditioning plot.



HOME

TOOLS & AIDS

SEARCH



## TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## **1.3.3.27.** Spectral Plot

Purpose: Examine Cyclic Structure A spectral plot (<u>Jenkins and Watts 1968</u> or <u>Bloomfield 1976</u>) is a graphical technique for examining cyclic structure in the frequency domain. It is a smoothed Fourier transform of the autocovariance function.

The frequency is measured in cycles per unit time where unit time is defined to be the distance between 2 points. A frequency of 0 corresponds to an infinite cycle while a frequency of 0.5 corresponds to a cycle of 2 data points. Equispaced time series are inherently limited to detecting frequencies between 0 and 0.5.


Trends should typically be removed from the time series before applying the spectral plot. Trends can be detected from a <u>run sequence plot</u>. Trends are typically removed by differencing the series or by <u>fitting a straight line</u> (or some other polynomial curve) and applying the spectral analysis to the residuals.

Spectral plots are often used to find a starting value for the frequency,  $\omega$ , in the sinusoidal model

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

See the beam deflection case study for an example of this.

Sample Plot

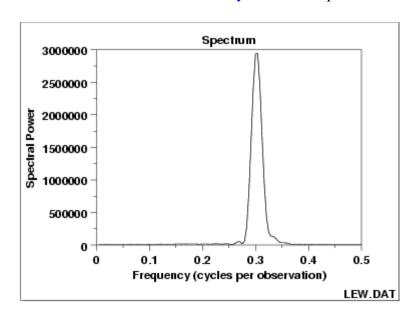

This spectral plot shows one dominant frequency of approximately 0.3 cycles per observation.

Definition: Variance Versus Frequency The spectral plot is formed by:

- Vertical axis: Smoothed variance (power)
- Horizontal axis: Frequency (cycles per observation)

The computations for generating the smoothed variances can be involved and are not discussed further here. The details can be found in the Jenkins and Bloomfield references and in most texts that discuss the frequency analysis of time series.

#### Questions

The spectral plot can be used to answer the following questions:

- 1. How many cyclic components are there?
- 2. Is there a dominant cyclic frequency?
- 3. If there is a dominant cyclic frequency, what is it?

Importance
Check
Cyclic
Behavior
of Time
Series

The spectral plot is the primary technique for assessing the cyclic nature of univariate time series in the frequency domain. It is almost always the second plot (after a run sequence plot) generated in a frequency domain analysis of a time series.

#### Examples

- 1. Random (= White Noise)
- 2. Strong autocorrelation and autoregressive model
- 3. Sinusoidal model

Related Techniques **Autocorrelation Plot** 

Complex Demodulation Amplitude Plot

Complex Demodulation Phase Plot

Case Study

The spectral plot is demonstrated in the <u>beam deflection</u> data case study.

Software

Spectral plots are a fundamental technique in the frequency analysis of time series. They are available in many general purpose statistical software programs.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.27. Spectral Plot

## 1.3.3.27.1. Spectral Plot: Random Data

Spectral Plot of 200 Normal Random Numbers

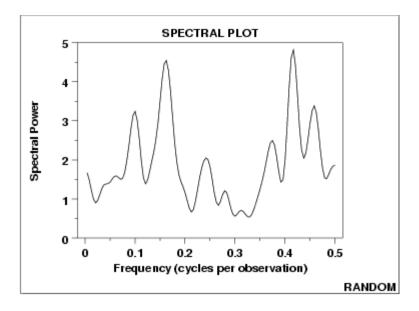

#### **Conclusions**

We can make the following conclusions from the above plot.

- 1. There are no dominant peaks.
- 2. There is no identifiable pattern in the spectrum.
- 3. The data are random.

#### Discussion

For random data, the spectral plot should show no dominant peaks or distinct pattern in the spectrum. For the sample plot above, there are no clearly dominant peaks and the peaks seem to fluctuate at random. This type of appearance of the spectral plot indicates that there are no significant cyclic patterns in the data.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.27. Spectral Plot

# 1.3.3.27.2. Spectral Plot: Strong Autocorrelation and Autoregressive Model

Spectral Plot for Random Walk Data

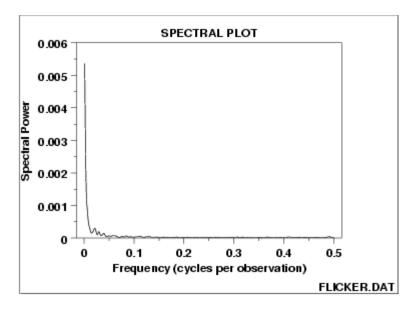

**Conclusions** 

We can make the following conclusions from the above plot.

- 1. Strong dominant peak near zero.
- 2. Peak decays rapidly towards zero.
- 3. An autoregressive model is an appropriate model.

Discussion

This spectral plot starts with a dominant peak near zero and rapidly decays to zero. This is the spectral plot signature of a process with strong positive autocorrelation. Such processes are highly non-random in that there is high association between an observation and a succeeding observation. In short, if you know  $Y_i$  you can make a strong guess as to what  $Y_{i+1}$  will be.

Recommended Next Step The next step would be to determine the parameters for the autoregressive model:

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Such estimation can be done by <u>linear regression</u> or by

fitting a Box-Jenkins autoregressive (AR) model.

The residual standard deviation for this autoregressive model will be much smaller than the residual standard deviation for the default model

$$Y_i = A_0 + E_i$$

Then the system should be reexamined to find an explanation for the strong autocorrelation. Is it due to the

- 1. phenomenon under study; or
- 2. drifting in the environment; or
- 3. contamination from the data acquisition system (DAS)?

Oftentimes the source of the problem is item (3) above where contamination and carry-over from the data acquisition system result because the DAS does not have time to electronically recover before collecting the next data point. If this is the case, then consider slowing down the sampling rate to re-achieve randomness.



HOME

TOOLS & AIDS


SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.27. Spectral Plot

## 1.3.3.27.3. Spectral Plot: Sinusoidal Model

Spectral Plot for Sinusoidal Model

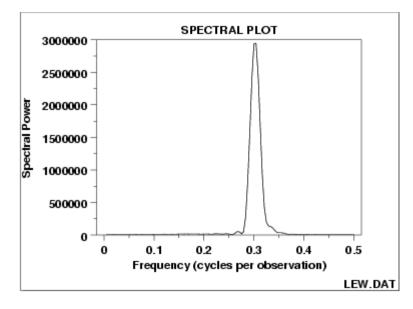

**Conclusions** 

We can make the following conclusions from the above plot.

- 1. There is a single dominant peak at approximately 0.3.
- 2. There is an underlying single-cycle sinusoidal model.

Discussion

This spectral plot shows a single dominant frequency. This indicates that a single-cycle sinusoidal model might be appropriate.

If one were to naively assume that the data represented by the graph could be fit by the model

$$Y_i = A_0 + E_i$$

and then estimate the constant by the sample mean, the analysis would be incorrect because

- the sample mean is biased;
- the confidence interval for the mean, which is valid only for random data, is meaningless and too small.

On the other hand, the choice of the proper model

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$

where  $\alpha$  is the amplitude,  $\omega$  is the frequency (between 0 and .5 cycles per observation), and  $\phi$  is the phase can be fit by non-linear least squares. The beam deflection data case study demonstrates fitting this type of model.

Recommended Next Steps

The recommended next steps are to:

- 1. Estimate the frequency from the spectral plot. This will be helpful as a starting value for the subsequent non-linear fitting. A complex demodulation phase plot can be used to fine tune the estimate of the frequency before performing the non-linear fit.
- 2. Do a complex demodulation amplitude plot to obtain an initial estimate of the amplitude and to determine if a constant amplitude is justified.
- 3. Carry out a non-linear fit of the model

$$Y_i = C + \alpha \sin(2\pi\omega t_i + \phi) + E_i$$



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.28. Standard Deviation Plot

Purpose:
Detect
Changes in
Scale
Between
Groups


Standard deviation plots are used to see if the standard deviation varies between different groups of the data. The grouping is determined by the analyst. In most cases, the data provide a specific grouping variable. For example, the groups may be the levels of a factor variable. In the sample plot below, the months of the year provide the grouping.

Standard deviation plots can be used with ungrouped data to determine if the standard deviation is changing over time. In this case, the data are broken into an arbitrary number of equal-sized groups. For example, a data series with 400 points can be divided into 10 groups of 40 points each. A standard deviation plot can then be generated with these groups to see if the standard deviation is increasing or decreasing over time.

Although the standard deviation is the most commonly used measure of scale, the same concept applies to other measures of scale. For example, instead of plotting the standard deviation of each group, the <u>median absolute deviation</u> or the <u>average absolute deviation</u> might be plotted instead. This might be done if there were significant outliers in the data and a more robust measure of scale than the standard deviation was desired.

Standard deviation plots are typically used in conjunction with <u>mean plots</u>. The mean plot would be used to check for shifts in location while the standard deviation plot would be used to check for shifts in scale.

Sample Plot

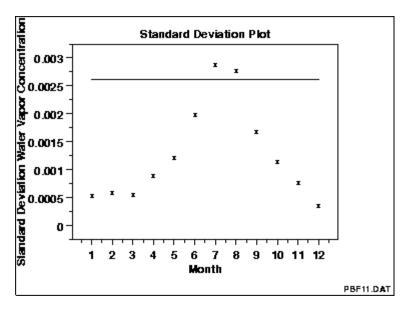

This sample standard deviation plot shows

- 1. there is a shift in variation;
- 2. greatest variation is during the summer months.

Definition: Group Standard Deviations Versus Group ID Standard deviation plots are formed by:

- Vertical axis: Group standard deviations
- · Horizontal axis: Group identifier

A reference line is plotted at the overall standard deviation.

Questions

The standard deviation plot can be used to answer the following questions.

- 1. Are there any shifts in variation?
- 2. What is the magnitude of the shifts in variation?
- 3. Is there a distinct pattern in the shifts in variation?

Importance: Checking Assumptions A common assumption in 1-factor analyses is that of equal variances. That is, the variance is the same for different levels of the factor variable. The standard deviation plot provides a graphical check for that assumption. A common assumption for univariate data is that the variance is constant. By grouping the data into equi-sized intervals, the standard deviation plot can provide a graphical test of this assumption.

Related Techniques Mean Plot

**DOE Standard Deviation Plot** 

Software

Most general purpose statistical software programs do not support a standard deviation plot. However, if the statistical program can generate the standard deviation for a group, it should be feasible to write a macro to generate this plot.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.29. Star Plot


Purpose: Display Multivariate Data The star plot (<u>Chambers 1983</u>) is a method of displaying multivariate data. Each star represents a single observation. Typically, star plots are generated in a multi-plot format with many stars on each page and each star representing one observation.

Star plots are used to examine the relative values for a single data point (e.g., point 3 is large for variables 2 and 4, small for variables 1, 3, 5, and 6) and to locate similar points or dissimilar points.

#### Sample Plot

The plot below contains the star plots of 16 cars. The data file actually contains 74 cars, but we restrict the plot to what can reasonably be shown on one page. The variable list for the sample star plot is

- 1 Price
- 2 Mileage (MPG)
- $3\ 1978\ Repair\ Record\ (1 = Worst,\ 5 = Best)$
- 4 1977 Repair Record (1 = Worst, 5 = Best)
- 5 Headroom
- 6 Rear Seat Room
- 7 Trunk Space
- 8 Weight
- 9 Length

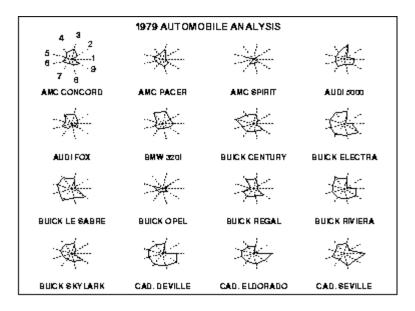

We can look at these plots individually or we can use them to identify clusters of cars with similar features. For example, we can look at the star plot of the Cadillac Seville and see that it is one of the most expensive cars, gets below average (but not among the worst) gas mileage, has an average repair record, and has average-to-above-average roominess and size. We can then compare the Cadillac models (the last three plots) with the AMC models (the first three plots). This comparison shows distinct patterns. The AMC models tend to be inexpensive, have below average gas mileage, and are small in both height and weight and in roominess. The Cadillac models are expensive, have poor gas mileage, and are large in both size and roominess.

#### Definition

The star plot consists of a sequence of equi-angular spokes, called radii, with each spoke representing one of the variables. The data length of a spoke is proportional to the magnitude of the variable for the data point relative to the maximum magnitude of the variable across all data points. A line is drawn connecting the data values for each spoke. This gives the plot a star-like appearance and the origin of the name of this plot.

#### **Questions**

The star plot can be used to answer the following questions:

- 1. What variables are dominant for a given observation?
- 2. Which observations are most similar, i.e., are there clusters of observations?
- 3. Are there outliers?

Weakness in Technique Star plots are helpful for small-to-moderate-sized multivariate data sets. Their primary weakness is that their effectiveness is limited to data sets with less than a few hundred points. After that, they tend to be overwhelming.

Graphical techniques suited for large data sets are discussed

by **Scott**.

Related Alternative ways to plot multivariate data are discussed in

Techniques Chambers, du Toit, and Everitt.

Star plots are available in some general purpose statistical Software

software progams.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



## **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## **1.3.3.30.** Weibull Plot

Purpose:
Graphical
Check To See
If Data Come
From a
Population
That Would
Be Fit by a
Weibull
Distribution


The Weibull plot (Nelson 1982) is a graphical technique for determining if a data set comes from a population that would logically be fit by a 2-parameter Weibull distribution (the location is assumed to be zero).

The Weibull plot has special scales that are designed so that if the data do in fact follow a Weibull distribution, the points will be linear (or nearly linear). The least squares fit of this line yields estimates for the shape and scale parameters of the Weibull distribution (the location is assumed to be zero).

Specifically, the shape parameter is the reciprocal of the slope of the fitted line and the scale parameter is the exponent of the intercept of the fitted line.

The Weibull distribution also has the property that the scale parameter falls at the 63.2% point irrespective of the value of the shape parameter. The plot shows a horizontal line at this 63.2% point and a vertical line where the horizontal line intersects the least squares fitted line. This vertical line shows the value of scale parameter.

Sample Plot

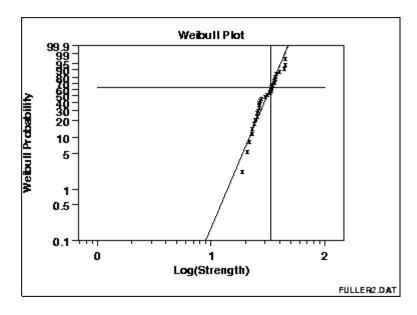

This Weibull plot shows that:

1. the assumption of a Weibull distribution is

reasonable;

- 2. the scale parameter estimate is computed to be 33.32;
- 3. the shape parameter estimate is computed to be 5.28; and
- 4. there are no outliers.

Note that the values on the x-axis ("0", "1", and "2") are the exponents. These actually denote the value  $10^0 = 1$ ,  $10^1 = 10$ , and  $10^2 = 100$ .

Definition:
Weibull
Cumulative
Probability
Versus
LN(Ordered
Response)

The Weibull plot is formed by:

- Vertical axis: Weibull cumulative probability expressed as a percentage
- Horizontal axis: ordered failure times (in a LOG10 scale)

The vertical scale is  $\ln(-\ln(1-p))$  where p=(i-0.3)/(n+0.4) and i is the rank of the observation. This scale is chosen in order to linearize the resulting plot for Weibull data.

Questions

The Weibull plot can be used to answer the following questions:

- 1. Do the data follow a 2-parameter Weibull distribution?
- 2. What is the best estimate of the shape parameter for the 2-parameter Weibull distribution?
- 3. What is the best estimate of the scale (= variation) parameter for the 2-parameter Weibull distribution?

Importance: Check Distributional Assumptions Many statistical analyses, particularly in the field of reliability, are based on the assumption that the data follow a Weibull distribution. If the analysis assumes the data follow a Weibull distribution, it is important to verify this assumption and, if verified, find good estimates of the Weibull parameters.

Related Techniques Weibull Probability Plot Weibull PPCC Plot Weibull Hazard Plot

The Weibull probability plot (in conjunction with the Weibull PPCC plot), the Weibull hazard plot, and the Weibull plot are all similar techniques that can be used for assessing the adequacy of the Weibull distribution as a model for the data, and additionally providing estimation for the shape, scale, or location parameters.

The Weibull hazard plot and Weibull plot are designed to handle censored data (which the Weibull probability plot does not).

Case Study The Weibull plot is demonstrated in the fatigue life of

aluminum alloy specimens case study.

Weibull plots are generally available in statistical software *Software* 

programs that are designed to analyze reliability data.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT


- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.31. Youden Plot

Purpose: Interlab Comparisons Youden plots are a graphical technique for analyzing interlab data when each lab has made two runs on the same product or one run on two different products.

The Youden plot is a simple but effective method for comparing both the within-laboratory variability and the between-laboratory variability.

#### Sample Plot

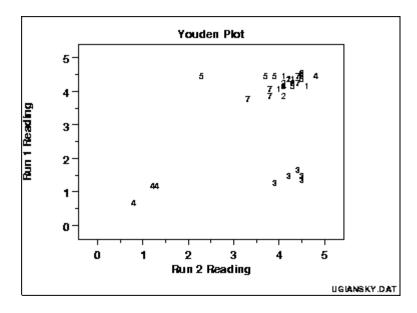

#### This plot shows:

- 1. Not all labs are equivalent.
- 2. Lab 4 is biased low.
- 3. Lab 3 has within-lab variability problems.
- 4. Lab 5 has an outlying run.

Definition: Response 1 Versus Response 2 Coded by Lab Youden plots are formed by:

- 1. Vertical axis: Response variable 1 (i.e., run 1 or product 1 response value)
- 2. Horizontal axis: Response variable 2 (i.e., run 2 or product 2 response value)

In addition, the plot symbol is the lab id (typically an integer from 1 to *k* where *k* is the number of labs).

Sometimes a 45-degree reference line is drawn. Ideally, a lab generating two runs of the same product should produce reasonably similar results. Departures from this reference line indicate inconsistency from the lab. If two different products are being tested, then a 45-degree line may not be appropriate. However, if the labs are consistent, the points should lie near some fitted straight line.

Questions

The Youden plot can be used to answer the following questions:

- 1. Are all labs equivalent?
- 2. What labs have between-lab problems (reproducibility)?
- 3. What labs have within-lab problems (repeatability)?
- 4. What labs are outliers?

*Importance* 

In interlaboratory studies or in comparing two runs from the same lab, it is useful to know if consistent results are generated. Youden plots should be a routine plot for analyzing this type of data.

DOE Youden Plot The <u>DOE Youden plot</u> is a specialized Youden plot used in the design of experiments. In particular, it is useful for <u>full</u> and <u>fractional</u> designs.

Related Techniques **Scatter Plot** 

*Software* 

The Youden plot is essentially a scatter plot, so it should be feasible to write a macro for a Youden plot in any general purpose statistical program that supports scatter plots.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

http://www.itl.nist.gov/div898/handbook/eda/section3/eda3331.htm[6/27/2012 2:01:38 PM]

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic
- 1.3.3.31. <u>Youden Plot</u>

## **1.3.3.31.1. DOE Youden Plot**

DOE Youden
Plot:
Introduction

The DOE (Design of Experiments) Youden plot is a specialized Youden plot used in the analysis of <u>full</u> and <u>fractional</u> experiment designs. In particular, it is used in conjunction with the <u>Yates algorithm</u>. These designs may have a low level, coded as "-1" or "-", and a high level, coded as "+1" or "+", for each factor. In addition, there can optionally be one or more center points. Center points are at the midpoint between the low and high levels for each factor and are coded as "0".

The Yates agorithm and the the DOE Youden plot only use the "-1" and "+1" points. The Yates agorithm is used to estimate factor effects. The DOE Youden plot can be used to help determine the approriate model to based on the effect estimates from the Yates algorithm.

Construction of DOE Youden Plot

The following are the primary steps in the construction of the DOE Youden plot.

- 1. For a given factor or interaction term, compute the mean of the response variable for the low level of the factor and for the high level of the factor. Any center points are omitted from the computation.
- 2. Plot the point where the *y*-coordinate is the mean for the high level of the factor and the *x*-coordinate is the mean for the low level of the factor. The character used for the plot point should identify the factor or interaction term (e.g., "1" for factor 1, "13" for the interaction between factors 1 and 3).
- 3. Repeat steps 1 and 2 for each factor and interaction term of the data.


The high and low values of the interaction terms are obtained by multiplying the corresponding values of the main level factors. For example, the interaction term  $X_{13}$  is obtained by multiplying the values for  $X_1$  with the corresponding values of  $X_3$ . Since the values for  $X_1$  and  $X_3$  are either "-1" or "+1", the resulting values for  $X_{13}$  are also either "-1" or "+1".

In summary, the DOE Youden plot is a plot of the mean of the response variable for the high level of a factor or interaction term against the mean of the response variable for the low level of that factor or interaction term.

For unimportant factors and interaction terms, these mean values should be nearly the same. For important factors and interaction terms, these mean values should be quite different. So the interpretation of the plot is that unimportant factors should be clustered together near the grand mean. Points that stand apart from this cluster identify important factors that should be included in the model.

Sample DOE The following is a DOE Youden plot for the data used in the Eddy current case study. The

Youden Plot analysis in that case study demonstrated that X1 and X2 were the most important factors.

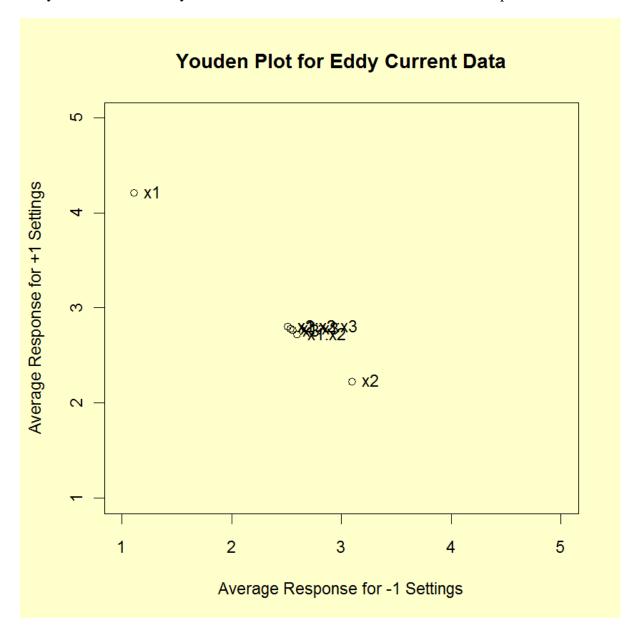

Interpretation of the Sample DOE Youden Plot

From the above DOE Youden plot, we see that factors 1 and 2 stand out from the others. That is, the mean response values for the low and high levels of factor 1 and factor 2 are quite different. For factor 3 and the 2 and 3-term interactions, the mean response values for the low and high levels are similar.

We would conclude from this plot that factors 1 and 2 are important and should be included in our final model while the remaining factors and interactions should be omitted from the final model.

Case Study

The <u>Eddy current</u> case study demonstrates the use of the DOE Youden plot in the context of the analysis of a full factorial design.

Software

DOE Youden plots are not typically available as built-in plots in statistical software programs. However, it should be relatively straightforward to write a macro to generate this plot in most general purpose statistical software programs.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic

## 1.3.3.32. 4-Plot

Purpose: Check Underlying Statistical Assumptions The 4-plot is a collection of 4 specific EDA graphical techniques whose purpose is to test the assumptions that underlie most measurement processes. A 4-plot consists of a

- 1. run sequence plot;
- 2. <u>lag plot</u>;
- 3. histogram;
- 4. normal probability plot.


If the 4 underlying assumptions of a typical measurement process hold, then the above 4 plots will have a characteristic appearance (see the normal random numbers case study below); if any of the underlying assumptions fail to hold, then it will be revealed by an anomalous appearance in one or more of the plots. Several commonly encountered situations are demonstrated in the case studies below.

Although the 4-plot has an obvious use for univariate and time series data, its usefulness extends far beyond that. Many statistical <u>models</u> of the form

$$Y_i = f(X_1, ..., X_k) + E_i$$

have the same underlying assumptions for the error term. That is, no matter how complicated the functional fit, the assumptions on the underlying error term are still the same. The 4-plot can and should be routinely applied to the residuals when fitting models regardless of whether the model is simple or complicated.

Sample Plot: Process Has Fixed Location, Fixed Variation, Non-Random (Oscillatory), Non-Normal U-Shaped

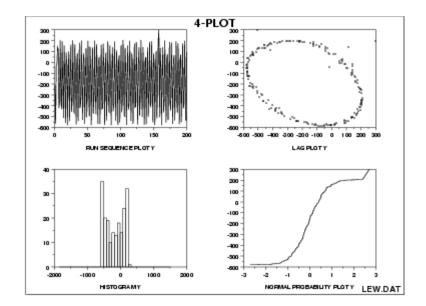

Distribution. and Has 3 Outliers.

This 4-plot reveals the following:

- 1. the fixed location assumption is justified as shown by the run sequence plot in the upper left corner.
- 2. the fixed variation assumption is justified as shown by the run sequence plot in the upper left corner.
- 3. the randomness assumption is violated as shown by the non-random (oscillatory) lag plot in the upper right corner.
- 4. the assumption of a common, normal distribution is violated as shown by the histogram in the lower left corner and the normal probability plot in the lower right corner. The distribution is non-normal and is a U-shaped distribution.
- 5. there are several outliers apparent in the lag plot in the upper right corner.

Definition:

1. Run

Sequence *Plot;* 

- 4. Normal

2. Lag Plot; 3. Histogram; **Probability** Plot

The 4-plot consists of the following:

- 1. Run sequence plot to test fixed location and variation.
  - Vertically:  $Y_i$
  - Horizontally: i
- 2. Lag Plot to test randomness.
  - Vertically:  $Y_i$
  - Horizontally:  $Y_{i-1}$
- 3. Histogram to test (normal) distribution.
  - Vertically: Counts
  - Horizontally: Y
- 4. Normal probability plot to test normal distribution.
  - $\circ$  Vertically: Ordered  $Y_i$
  - Horizontally: Theoretical values from a normal N(0,1) distribution for ordered  $Y_i$

**Questions** 

4-plots can provide answers to many questions:

- 1. Is the process in-control, stable, and predictable?
- 2. Is the process drifting with respect to location?
- 3. Is the process drifting with respect to variation?
- 4. Are the data random?
- 5. Is an observation related to an adjacent observation?
- 6. If the data are a time series, is is white noise?
- 7. If the data are a time series and not white noise, is it sinusoidal, autoregressive, etc.?
- 8. If the data are non-random, what is a better model?
- 9. Does the process follow a normal distribution?
- 10. If non-normal, what distribution does the process follow?
- 11. Is the model

$$Y_i = A_0 + E_i$$

valid and sufficient?

- 12. If the default model is insufficient, what is a better model?
- 13. Is the formula  $s_{\bar{Y}} = s/\sqrt{N}$  valid?
- 14. Is the sample mean a good estimator of the process location?
- 15. If not, what would be a better estimator?
- 16. Are there any outliers?

Importance:
Testing
Underlying
Assumptions
Helps Ensure
the Validity of
the Final
Scientific and
Engineering
Conclusions

There are 4 assumptions that typically underlie all measurement processes; namely, that the data from the process at hand "behave like":

- 1. random drawings;
- 2. from a fixed distribution:
- 3. with that distribution having a fixed location; and
- 4. with that distribution having fixed variation.

Predictability is an all-important goal in science and engineering. If the above 4 assumptions hold, then we have achieved probabilistic predictability--the ability to make probability statements not only about the process in the past, but also about the process in the future. In short, such processes are said to be "statistically in control". If the 4 assumptions do not hold, then we have a process that is drifting (with respect to location, variation, or distribution), is unpredictable, and is out of control. A simple characterization of such processes by a location estimate, a variation estimate, or a distribution "estimate" inevitably leads to optimistic and grossly invalid engineering conclusions.

Inasmuch as the validity of the final scientific and engineering conclusions is inextricably linked to the validity of these same 4 underlying assumptions, it naturally follows that there is a real necessity for all 4 assumptions to be routinely tested. The 4-plot (run sequence plot, lag plot, histogram, and normal probability plot) is seen as a simple, efficient, and powerful way of carrying out this routine checking.

Interpretation: Flat, Equi-Banded, Random, Bell-Shaped, and Linear Of the 4 underlying assumptions:

- 1. If the fixed location assumption holds, then the run sequence plot will be flat and non-drifting.
- 2. If the fixed variation assumption holds, then the vertical spread in the run sequence plot will be approximately the same over the entire horizontal axis.
- 3. If the randomness assumption holds, then the lag plot will be structureless and random.
- 4. If the fixed distribution assumption holds (in particular, if the fixed normal distribution assumption holds), then the histogram will be bellshaped and the normal probability plot will be approximatelylinear.

If all 4 of the assumptions hold, then the process is "statistically in control". In practice, many processes fall short of achieving this ideal.

## Related Techniques

Run Sequence Plot
Lag Plot
Histogram
Normal Probability Plot

Autocorrelation Plot Spectral Plot PPCC Plot

#### Case Studies

The 4-plot is used in most of the case studies in this chapter:

- 1. Normal random numbers (the ideal)
- 2. <u>Uniform random numbers</u>
- 3. Random walk
- 4. Josephson junction cryothermometry
- 5. Beam deflections
- 6. Filter transmittance
- 7. Standard resistor
- 8. Heat flow meter 1

#### Software

It should be feasible to write a macro for the 4-plot in any general purpose statistical software program that supports the capability for multiple plots per page and supports the underlying plot techniques.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



## **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.3. Graphical Techniques: Alphabetic


## 1.3.3.33. 6-Plot

Purpose: Graphical Model Validation The 6-plot is a collection of 6 specific graphical techniques whose purpose is to assess the validity of a Y versus X fit. The fit can be a linear fit, a non-linear fit, a LOWESS (locally weighted least squares) fit, a spline fit, or any other fit utilizing a single independent variable.

#### The 6 plots are:

- 1. Scatter plot of the response and predicted values versus the independent variable;
- 2. Scatter plot of the residuals versus the independent variable;
- 3. Scatter plot of the residuals versus the predicted values;
- 4. Lag plot of the residuals;
- 5. Histogram of the residuals:
- 6. Normal probability plot of the residuals.

#### Sample Plot

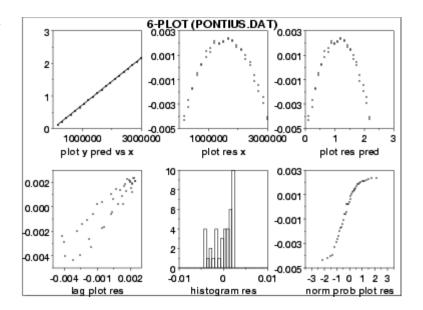

This 6-plot, which followed a linear fit, shows that the linear model is not adequate. It suggests that a quadratic model would be a better model.

Definition:

The 6-plot consists of the following:

6

Component Plots

- 1. Response and predicted values
  - Vertical axis: Response variable, predicted values
  - Horizontal axis: Independent variable
- 2. Residuals versus independent variable
  - Vertical axis: Residuals
  - Horizontal axis: Independent variable
- 3. Residuals versus predicted values
  - Vertical axis: Residuals
  - Horizontal axis: Predicted values
- 4. Lag plot of residuals
  - Vertical axis: RES(I)
  - Horizontal axis: RES(I-1)
- 5. Histogram of residuals
  - Vertical axis: Counts
  - Horizontal axis: Residual values
- 6. Normal probability plot of residuals
  - Vertical axis: Ordered residuals
  - Horizontal axis: Theoretical values from a normal N(0,1) distribution for ordered residuals

Questions

The 6-plot can be used to answer the following questions:

- 1. Are the residuals approximately normally distributed with a fixed location and scale?
- 2. Are there outliers?
- 3. Is the fit adequate?
- 4. Do the residuals suggest a better fit?

Importance: Validating Model A model involving a response variable and a single independent variable has the form:

$$Y_i = f(X_i) + E_i$$

where Y is the response variable, X is the independent variable, f is the linear or non-linear fit function, and E is the random component. For a good model, the error component should behave like:

- 1. random drawings (i.e., independent);
- 2. from a fixed distribution;
- 3. with fixed location; and
- 4. with fixed variation.

In addition, for fitting models it is usually further assumed that the fixed distribution is normal and the fixed location is zero. For a good model the fixed variation should be as small as possible. A necessary component of fitting models is to verify these assumptions for the error component and to assess whether the variation for the error component is sufficiently small. The histogram, lag plot, and normal probability plot are used to verify the fixed distribution,

location, and variation assumptions on the error component. The plot of the response variable and the predicted values versus the independent variable is used to assess whether the variation is sufficiently small. The plots of the residuals versus the independent variable and the predicted values is used to assess the independence assumption.

Assessing the validity and quality of the fit in terms of the above assumptions is an absolutely vital part of the model-fitting process. No fit should be considered complete without an adequate model validation step.

Related Techniques <u>Linear Least Squares</u> <u>Non-Linear Least Squares</u>

**Scatter Plot** 

Run Sequence Plot

Lag Plot

Normal Probability Plot

<u>Histogram</u>

Case Study

The 6-plot is used in the Alaska pipeline data case study.

Software

It should be feasible to write a macro for the 6-plot in any general purpose statistical software program that supports the capability for multiple plots per page and supports the underlying plot techniques.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH


BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques


## 1.3.4. Graphical

**Techniques: By Problem Category** 


Univariate y = c + e




Run Sequence Plot: 1.3.3.25



Lag Plot: 1.3.3.15




**Histogram:** 1.3.3.14



**Normal Probability Plot:** 1.3.3.21



<u>4-Plot:</u> 1.3.3.32




**PPCC Plot:** 1.3.3.23



Weibull Plot: 1.3.3.30




**Probability** Plot: 1.3.3.22



**Box-Cox Linearity Plot:** 1.3.3.5



**Box-Cox Normality Plot:** 1.3.3.6



**Bootstrap** Plot: 1.3.3.4


Time Series y = f(t) + e




Run Sequence Plot: 1.3.3.25



**Spectral Plot:** 1.3.3.27



**Autocorrelation** Plot: 1.3.3.1



Complex
Demodulation
Amplitude Plot:
1.3.3.8



Complex
Demodulation
Phase Plot:
1.3.3.9

$$1 Factor$$
$$y = f(x) + e$$



Scatter Plot: 1.3.3.26



Box Plot: 1.3.3.7




Bihistogram: 1.3.3.2



Quantile-Quantile Plot: 1.3.3.24




Mean Plot: 1.3.3.20



Standard
Deviation Plot:
1.3.3.28

Multi-Factor/Comparative

$$y = f(xp, x1,x2,...,xk) + e$$



Block Plot: 1.3.3.3


Multi-Factor/Screening y = f(x1,x2,x3,...,xk) +



DOE Scatter Plot: 1.3.3.11




DOE Mean Plot: 1.3.3.12





DOE Standard Deviation Plot: 1.3.3.13




Contour Plot: 1.3.3.10

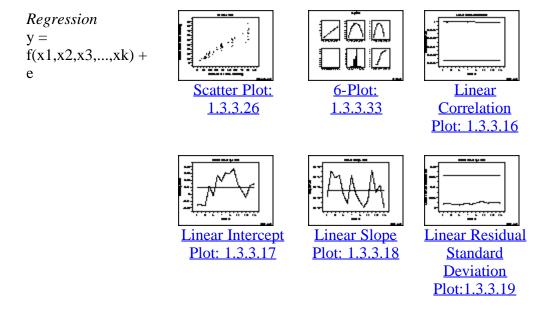









Star Plot: 1.3.3.29



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques

## **1.3.5.** Quantitative Techniques

#### Confirmatory Statistics

The techniques discussed in this section are classical statistical methods as opposed to EDA techniques. EDA and classical techniques are not mutually exclusive and can be used in a complementary fashion. For example, the analysis can start with some simple graphical techniques such as the 4-plot followed by the classical confirmatory methods discussed herein to provide more rigorous statements about the conclusions. If the classical methods yield different conclusions than the graphical analysis, then some effort should be invested to explain why. Often this is an indication that some of the assumptions of the classical techniques are violated.

Many of the quantitative techniques fall into two broad categories:

- 1. Interval estimation
- 2. Hypothesis tests

#### Interval Estimates

It is common in statistics to estimate a parameter from a sample of data. The value of the parameter using all of the possible data, not just the sample data, is called the population parameter or true value of the parameter. An estimate of the true parameter value is made using the sample data. This is called a point estimate or a sample estimate.

For example, the most commonly used measure of location is the mean. The population, or true, mean is the sum of all the members of the given population divided by the number of members in the population. As it is typically impractical to measure every member of the population, a random sample is drawn from the population. The sample mean is calculated by summing the values in the sample and dividing by the number of values in the sample. This sample mean is then used as the point estimate of the population mean.

Interval estimates expand on point estimates by incorporating the uncertainty of the point estimate. In the example for the mean above, different samples from the same population will generate different values for the

sample mean. An interval estimate quantifies this uncertainty in the sample estimate by computing lower and upper values of an interval which will, with a given level of confidence (i.e., probability), contain the population parameter.

#### Hypothesis Tests

Hypothesis tests also address the uncertainty of the sample estimate. However, instead of providing an interval, a hypothesis test attempts to refute a specific claim about a population parameter based on the sample data. For example, the hypothesis might be one of the following:

- the population mean is equal to 10
- the population standard deviation is equal to 5
- the means from two populations are equal
- the standard deviations from 5 populations are equal

To reject a hypothesis is to conclude that it is false. However, to accept a hypothesis does not mean that it is true, only that we do not have evidence to believe otherwise. Thus hypothesis tests are usually stated in terms of both a condition that is doubted (null hypothesis) and a condition that is believed (alternative hypothesis).

A common format for a hypothesis test is:

H<sub>0</sub>: A statement of the null hypothesis, e.g., two

population means are equal.

H<sub>a</sub>: A statement of the alternative hypothesis, e.g.,

two population means are not equal.

Test The test statistic is based on the specific

Statistic: hypothesis test.

Significance The significance level,  $\alpha$ , defines the Level: sensitivity of the test. A value of  $\alpha = 0.05$ 

means that we inadvertently reject the null hypothesis 5% of the time when it is in fact true. This is also called the type I error. The choice of  $\alpha$  is somewhat arbitrary, although in practice values of 0.1, 0.05, and 0.01 are

commonly used.

The probability of rejecting the null hypothesis when it is in fact false is called the power of the test and is denoted by  $1 - \beta$ . Its complement, the probability of accepting the null hypothesis when the alternative hypothesis is, in fact, true (type II error), is called  $\beta$  and can only be computed for a specific alternative hypothesis.

specific afternative hypothesis

Critical The critical region encompasses those values Region: of the test statistic that lead to a rejection of the null hypothesis. Based on the distribution of the test statistic and the significance level,

a cut-off value for the test statistic is computed. Values either above or below or both (depending on the direction of the test) this cut-off define the critical region.

Practical Versus Statistical Significance

It is important to distinguish between statistical significance and practical significance. Statistical significance simply means that we reject the null hypothesis. The ability of the test to detect differences that lead to rejection of the null hypothesis depends on the sample size. For example, for a particularly large sample, the test may reject the null hypothesis that two process means are equivalent. However, in practice the difference between the two means may be relatively small to the point of having no real engineering significance. Similarly, if the sample size is small, a difference that is large in engineering terms may not lead to rejection of the null hypothesis. The analyst should not just blindly apply the tests, but should combine engineering judgement with statistical analysis.

Bootstrap Uncertainty Estimates In some cases, it is possible to mathematically derive appropriate uncertainty intervals. This is particularly true for intervals based on the assumption of a normal distribution. However, there are many cases in which it is not possible to mathematically derive the uncertainty. In these cases, the bootstrap provides a method for empirically determining an appropriate interval.

Table of Contents

Some of the more common classical quantitative techniques are listed below. This list of quantitative techniques is by no means meant to be exhaustive. Additional discussions of classical statistical techniques are contained in the <u>product comparisons</u> chapter.

- Location
  - 1. Measures of Location
  - 2. Confidence Limits for the Mean and One Sample t-Test
  - 3. Two Sample t-Test for Equal Means
  - 4. One Factor Analysis of Variance
  - 5. Multi-Factor Analysis of Variance
- Scale (or variability or spread)
  - 1. Measures of Scale
  - 2. Bartlett's Test
  - 3. Chi-Square Test
  - 4. F-Test
  - 5. Levene Test
- Skewness and Kurtosis
  - 1. Measures of Skewness and Kurtosis
- Randomness
  - 1. Autocorrelation
  - 2. Runs Test

#### Distributional Measures

- 1. Anderson-Darling Test
- 2. Chi-Square Goodness-of-Fit Test
- 3. Kolmogorov-Smirnov Test
- Outliers
  - 1. Detection of Outliers
  - 2. Grubbs Test
  - 3. <u>Tietjen-Moore Test</u>
  - 4. Generalized Extreme Deviate Test
- 2-Level Factorial Designs
  - 1. Yates Algorithm



TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

### 1.3.5.1. Measures of Location

Location

A fundamental task in many statistical analyses is to estimate a location parameter for the distribution; i.e., to find a typical or central value that best describes the data.

Definition of Location

The first step is to define what we mean by a typical value. For univariate data, there are three common definitions:

1. mean - the mean is the sum of the data points divided by the number of data points. That is,

$$ar{Y} = \sum_{i=1}^N Y_i/N$$

The mean is that value that is most commonly referred to as the average. We will use the term average as a synonym for the mean and the term typical value to refer generically to measures of location.

2. median - the median is the value of the point which has half the data smaller than that point and half the data larger than that point. That is, if  $X_1, X_2, ..., X_N$  is a random sample sorted from smallest value to largest value, then the median is defined as:

$$ilde{Y}=Y_{(N+1)/2} \qquad ext{if $N$ is odd}$$
 
$$ilde{Y}=(Y_{N/2}+Y_{(N/2)+1})/2 \qquad ext{if $N$ is even}$$


3. mode - the mode is the value of the random sample that occurs with the greatest frequency. It is not necessarily unique. The mode is typically used in a qualitative fashion. For example, there may be a single dominant hump in the data perhaps two or more smaller humps in the data. This is usually evident from a histogram of the data.

When taking samples from continuous populations, we need to be somewhat careful in how we define the mode. That is, any specific value may not occur more than once if the data are continuous. What may be a more meaningful, if less exact measure, is the midpoint

of the class interval of the histogram with the highest peak.

Why Different Measures A natural question is why we have more than one measure of the typical value. The following example helps to explain why these alternative definitions are useful and necessary.

This plot shows histograms for 10,000 random numbers generated from a normal, an exponential, a Cauchy, and a lognormal distribution.

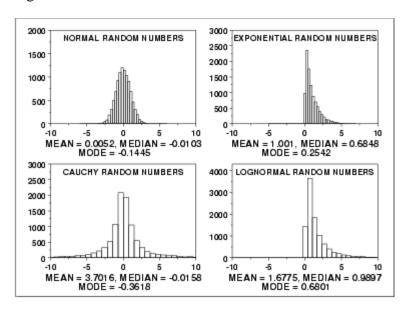

Normal Distribution The first histogram is a sample from a <u>normal distribution</u>. The mean is 0.005, the median is -0.010, and the mode is -0.144 (the mode is computed as the midpoint of the histogram interval with the highest peak).

The normal distribution is a symmetric distribution with well-behaved tails and a single peak at the center of the distribution. By symmetric, we mean that the distribution can be folded about an axis so that the 2 sides coincide. That is, it behaves the same to the left and right of some center point. For a normal distribution, the mean, median, and mode are actually equivalent. The histogram above generates similar estimates for the mean, median, and mode. Therefore, if a histogram or normal probability plot indicates that your data are approximated well by a normal distribution, then it is reasonable to use the mean as the location estimator.

Exponential Distribution

The second histogram is a sample from an <u>exponential</u> <u>distribution</u>. The mean is 1.001, the median is 0.684, and the mode is 0.254 (the mode is computed as the midpoint of the histogram interval with the highest peak).

The exponential distribution is a skewed, i. e., not symmetric, distribution. For skewed distributions, the mean and median are not the same. The mean will be pulled in the direction of

the skewness. That is, if the right tail is heavier than the left tail, the mean will be greater than the median. Likewise, if the left tail is heavier than the right tail, the mean will be less than the median.

For skewed distributions, it is not at all obvious whether the mean, the median, or the mode is the more meaningful measure of the typical value. In this case, all three measures are useful.

#### Cauchy Distribution

The third histogram is a sample from a <u>Cauchy distribution</u>. The mean is 3.70, the median is -0.016, and the mode is -0.362 (the mode is computed as the midpoint of the histogram interval with the highest peak).

For better visual comparison with the other data sets, we restricted the histogram of the Cauchy distribution to values between -10 and 10. The full Cauchy data set in fact has a minimum of approximately -29,000 and a maximum of approximately 89,000.

The Cauchy distribution is a symmetric distribution with heavy tails and a single peak at the center of the distribution. The Cauchy distribution has the interesting property that collecting more data does not provide a more accurate estimate of the mean. That is, the sampling distribution of the mean is equivalent to the sampling distribution of the original data. This means that for the Cauchy distribution the mean is useless as a measure of the typical value. For this histogram, the mean of 3.7 is well above the vast majority of the data. This is caused by a few very extreme values in the tail. However, the median does provide a useful measure for the typical value.

Although the Cauchy distribution is an extreme case, it does illustrate the importance of heavy tails in measuring the mean. Extreme values in the tails distort the mean. However, these extreme values do not distort the median since the median is based on ranks. In general, for data with extreme values in the tails, the median provides a better estimate of location than does the mean.

# Lognormal Distribution

The fourth histogram is a sample from a <u>lognormal</u> <u>distribution</u>. The mean is 1.677, the median is 0.989, and the mode is 0.680 (the mode is computed as the midpoint of the histogram interval with the highest peak).

The lognormal is also a skewed distribution. Therefore the mean and median do not provide similar estimates for the location. As with the exponential distribution, there is no obvious answer to the question of which is the more meaningful measure of location.

Robustness

There are various alternatives to the mean and median for

measuring location. These alternatives were developed to address non-normal data since the mean is an optimal estimator if in fact your data are normal.

<u>Tukey and Mosteller</u> defined two types of robustness where robustness is a lack of susceptibility to the effects of nonnormality.

- 1. Robustness of validity means that the confidence intervals for the population location have a 95% chance of covering the population location regardless of what the underlying distribution is.
- 2. Robustness of efficiency refers to high effectiveness in the face of non-normal tails. That is, confidence intervals for the population location tend to be almost as narrow as the best that could be done if we knew the true shape of the distributuion.

The mean is an example of an estimator that is the best we can do if the underlying distribution is normal. However, it lacks robustness of validity. That is, confidence intervals based on the mean tend not to be precise if the underlying distribution is in fact not normal.

The median is an example of a an estimator that tends to have robustness of validity but not robustness of efficiency.

The alternative measures of location try to balance these two concepts of robustness. That is, the confidence intervals for the case when the data are normal should be almost as narrow as the confidence intervals based on the mean. However, they should maintain their validity even if the underlying data are not normal. In particular, these alternatives address the problem of heavy-tailed distributions.

Alternative Measures of Location A few of the more common alternative location measures are:

- 1. Mid-Mean computes a mean using the data between the 25th and 75th percentiles.
- 2. Trimmed Mean similar to the mid-mean except different percentile values are used. A common choice is to trim 5% of the points in both the lower and upper tails, i.e., calculate the mean for data between the 5th and 95th percentiles.
- 3. Winsorized Mean similar to the trimmed mean. However, instead of trimming the points, they are set to the lowest (or highest) value. For example, all data below the 5th percentile are set equal to the value of the 5th percentile and all data greater than the 95th percentile are set equal to the 95th percentile.
- 4. Mid-range = (smallest + largest)/2.

The first three alternative location estimators defined above have the advantage of the median in the sense that they are not unduly affected by extremes in the tails. However, they generate estimates that are closer to the mean for data that are normal (or nearly so).

The mid-range, since it is based on the two most extreme points, is not robust. Its use is typically restricted to situations in which the behavior at the extreme points is relevant.

Case Study

The <u>uniform random numbers</u> case study compares the performance of several different location estimators for a particular non-normal distribution.

Software

Most general purpose statistical software programs can compute at least some of the measures of location discussed above.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

### 1.3.5.2. Confidence Limits for the Mean

Purpose: Interval Estimate for Mean Confidence limits for the mean (Snedecor and Cochran, 1989) are an interval estimate for the mean. Interval estimates are often desirable because the estimate of the mean varies from sample to sample. Instead of a single estimate for the mean, a confidence interval generates a lower and upper limit for the mean. The interval estimate gives an indication of how much uncertainty there is in our estimate of the true mean. The narrower the interval, the more precise is our estimate.

Confidence limits are expressed in terms of a confidence coefficient. Although the choice of confidence coefficient is somewhat arbitrary, in practice 90 %, 95 %, and 99 % intervals are often used, with 95 % being the most commonly used.

As a technical note, a 95 % confidence interval does **not** mean that there is a 95 % probability that the interval contains the true mean. The interval computed from a given sample either contains the true mean or it does not. Instead, the level of confidence is associated with the method of calculating the interval. The confidence coefficient is simply the proportion of samples of a given size that may be expected to contain the true mean. That is, for a 95 % confidence interval, if many samples are collected and the confidence interval computed, in the long run about 95 % of these intervals would contain the true mean.

Definition: Confidence Interval Confidence limits are defined as:

$$\overline{Y} \pm t_{1-lpha/2,N-1} \; rac{s}{\sqrt{N}}$$

where  $\bar{Y}$  is the sample mean, s is the sample standard deviation, N is the sample size,  $\alpha$  is the desired significance level, and  $t_{1-\alpha/2, N-1}$  is the  $100(1-\alpha/2)$  percentile of the <u>t distribution</u> with N-1 degrees of freedom. Note that the confidence coefficient is  $1-\alpha$ .

From the formula, it is clear that the width of the interval is controlled by two factors:

1. As *N* increases, the interval gets narrower from the  $\sqrt{N}$  term.

That is, one way to obtain more precise estimates for the mean is to increase the sample size.

2. The larger the sample standard deviation, the larger the confidence interval. This simply means that noisy data, i.e., data with a large standard deviation, are going to generate wider intervals than data with a smaller standard deviation.

Definition: Hypothesis Test To test whether the population mean has a specific value,  $\mu_0$ , against the two-sided alternative that it does not have a value  $\mu_0$ , the confidence interval is converted to hypothesis-test form. The test is a one-sample *t*-test, and it is defined as:

 $H_0$ :  $\mu = \mu_0$ 

 $H_a$ :  $\mu \neq \mu_0$ 

Test Statistic:  $T=(ar{Y}-\mu_0)/(s/\sqrt{N})$ 

where  $\bar{\boldsymbol{Y}}$ , N, and  $\boldsymbol{s}$  are defined as above.

Significance Level:  $\alpha$ . The most commonly used value for  $\alpha$  is 0.05.

Critical Region: Reject the null hypothesis that the mean is a specified value,  $\mu_0$ , if

$$T < t_{\alpha/2, N-1}$$

or

$$T > t_{1-\alpha/2, N-1}$$

#### Confidence Interval Example

We generated a 95 %, two-sided confidence interval for the <u>ZARR13.DAT</u> data set based on the following information.

```
N = 195

MEAN = 9.261460

STANDARD DEVIATION = 0.022789

t_{1-0.025,N-1} = 1.9723

LOWER LIMIT = 9.261460 - 1.9723*0.022789/\sqrt{195}

UPPER LIMIT = 9.261460 + 1.9723*0.022789/\sqrt{195}
```

Thus, a 95 % confidence interval for the mean is (9.258242, 9.264679).

#### t-Test Example

We performed a two-sided, one-sample *t*-test using the <u>ZARR13.DAT</u> data set to test the null hypothesis that the population mean is equal to 5.

```
H<sub>0</sub>: \mu = 5

H<sub>a</sub>: \mu \neq 5

Test statistic: T = 2611.284

Degrees of freedom: \nu = 194

Significance level: \alpha = 0.05

Critical value: t_{1-\alpha/2,\nu} = 1.9723

Critical region: Reject H<sub>0</sub> if |T| > 1.9723
```


We reject the null hypotheses for our two-tailed t-test because the absolute value of the test statistic is greater than the critical value. If we were to perform an upper, one-tailed test, the critical value would be  $t_{1-a,y} = 1.6527$ , and we would still reject the null hypothesis.

The confidence interval provides an alternative to the hypothesis test. If the confidence interval contains 5, then  $H_0$  cannot be rejected. In our example, the confidence interval (9.258242, 9.264679) does not contain 5, indicating that the population mean does not equal 5 at the 0.05 level of significance.

In general, there are three possible alternative hypotheses and rejection regions for the one-sample *t*-test:

<b>Alternative Hypothesis</b>	Rejection Region
$H_a$ : $\mu \neq \mu_0$	$ T  > t_{1-\alpha/2,\nu}$
$H_a: \mu > \mu_0$	$T > t_{1-\alpha, \nu}$
$H_a$ : $\mu < \mu_0$	$T < t_{\alpha, v}$

The rejection regions for three posssible alternative hypotheses using our example data are shown in the following graphs.

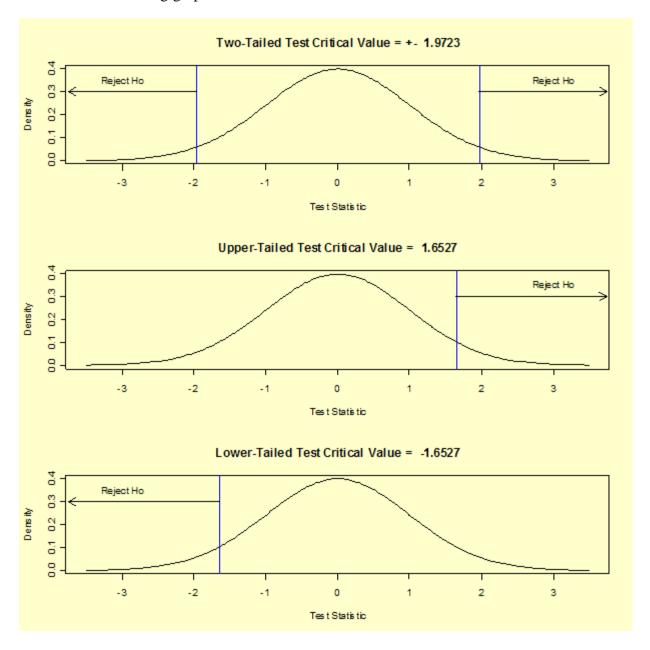

Questions Confidence limits for the mean can be used to answer the following questions:

- 1. What is a reasonable estimate for the mean?
- 2. How much variability is there in the estimate of the mean?
- 3. Does a given target value fall within the confidence limits?

Related Techniques

Two-Sample *t*-Test

Case Study

Heat flow meter data.

*Software* 

Confidence limits for the mean and one-sample *t*-tests are available in just about all general purpose statistical software programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## **1.3.5.3.** Two-Sample *t*-Test for Equal Means

Purpose: Test if two population means are egual

The two-sample t-test (Snedecor and Cochran, 1989) is used to determine if two population means are equal. A common application is to test if a new process or treatment is superior to a current process or treatment.

There are several variations on this test.

- 1. The data may either be paired or not paired. By paired, we mean that there is a one-toone correspondence between the values in the two samples. That is, if  $X_1, X_2, ..., X_n$  and  $Y_1, Y_2, \dots, Y_n$  are the two samples, then  $X_i$  corresponds to  $Y_i$ . For paired samples, the difference  $X_i$  -  $Y_i$  is usually calculated. For unpaired samples, the sample sizes for the two samples may or may not be equal. The formulas for paired data are somewhat simpler than the formulas for unpaired data.
- 2. The variances of the two samples may be assumed to be equal or unequal. Equal variances yields somewhat simpler formulas, although with computers this is no longer a significant issue.
- 3. In some applications, you may want to adopt a new process or treatment only if it exceeds the current treatment by some threshold. In this case, we can state the null hypothesis in the form that the difference between the two populations means is equal to some constant  $(\mu_1 - \mu_2 = d_0)$  where the constant is the desired threshold.

Definition

The two-sample *t*-test for unpaired data is defined as:

 $H_0$ :  $\mu_1 = \mu_2$ 

Ha:  $\mu_1 \neq \mu_2$ 

Test Statistic: 
$$T = \frac{\bar{Y_1} - \bar{Y_2}}{\sqrt{s_1^2/N_1 + s_2^2/N_2}}$$

where  $N_1$  and  $N_2$  are the sample sizes,  $\bar{Y}_1$  and  $\bar{Y}_2$  are the sample means, and  $s_1^2$ and  $s_2^2$  are the sample variances.

If equal variances are assumed, then the formula reduces to:

$$T = \frac{\bar{Y_1} - \bar{Y_2}}{s_p \sqrt{1/N_1 + 1/N_2}}$$

where

$$s_p^2 = \frac{(N_1 - 1)s_1^2 + (N_2 - 1)s_2^2}{N_1 + N_2 - 2}$$

Significance  $\alpha$ .

Level:

Critical Reject the null hypothesis that the two means are equal if

Region:

$$|T| > t_{1-\alpha/2}$$

where  $t_{1-\alpha/2,\nu}$  is the <u>critical value</u> of the <u>t distribution</u> with  $\nu$  degrees of freedom where

$$v = \frac{(s_1^2/N_1 + s_2^2/N_2)^2}{(s_1^2/N_1)^2/(N_1 - 1) + (s_2^2/N_2)^2/(N_2 - 1)}$$

If equal variances are assumed, then

$$v = N_1 + N_2 - 2$$

Two-Sample t-Test Example The following two-sample *t*-test was generated for the <u>AUTO83B.DAT</u> data set. The data set contains miles per gallon for U.S. cars (sample 1) and for Japanese cars (sample 2); the summary statistics for each sample are shown below.

We are testing the hypothesis that the population means are equal for the two samples. We assume that the variances for the two samples are equal.

```
H<sub>0</sub>: \mu_1 = \mu_2

H<sub>a</sub>: \mu_1 \neq \mu_2

Test statistic: T = -12.62059

Pooled standard deviation: s_p = 6.34260

Degrees of freedom: \nu = 326

Significance level: \alpha = 0.05

Critical value (upper tail): t_{1-\alpha/2,\nu} = 1.9673

Critical region: Reject H<sub>0</sub> if |T| > 1.9673
```


The absolute value of the test statistic for our example, 12.62059, is greater than the critical value of 1.9673, so we reject the null hypothesis and conclude that the two population means are different at the 0.05 significance level.

In general, there are three possible alternative hypotheses and rejection regions for the one-sample t-test:

Alternative Hypothesis	Rejection Region

$H_a$ : $\mu_1 \neq \mu_2$	$ T  > t_{1-\alpha/2,\nu}$
$H_a: \mu_1 > \mu_2$	$T > t_{1-\alpha,\nu}$
$H_a$ : $\mu_1 < \mu_2$	$T < t_{\alpha, \nu}$

For our two-tailed *t*-test, the critical value is  $t_{1-\alpha/2,\nu} = 1.9673$ , where  $\alpha = 0.05$  and  $\nu = 326$ . If we were to perform an upper, one-tailed test, the critical value would be  $t_{1-\alpha,\nu} = 1.6495$ . The rejection regions for three posssible alternative hypotheses using our example data are shown below.

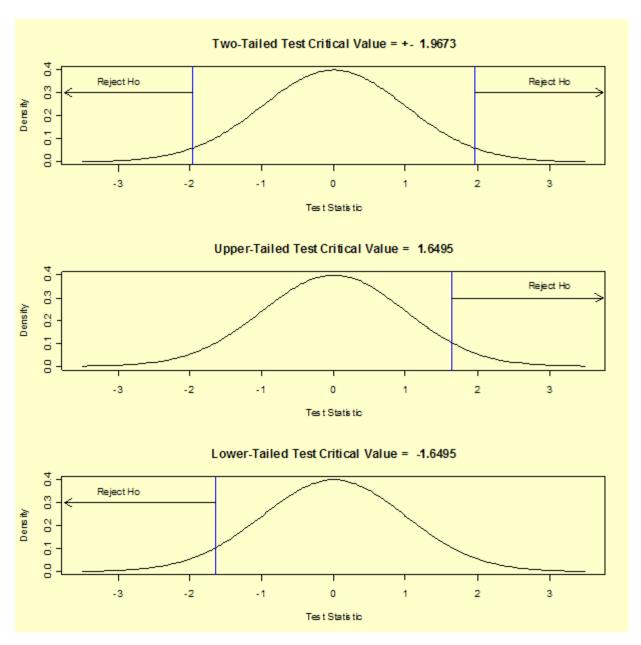

Questions Two-sample t-tests can be used to answer the following questions:

- 1. Is process 1 equivalent to process 2?
- 2. Is the new process better than the current process?
- 3. Is the new process better than the current process by at least some pre-determined threshold amount?

Related Confidence Limits for the Mean

Techniques Analysis of Variance

Case Study Ceramic strength data.

Software Two-sample t-tests are available in just about all general purpose statistical software

programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques
- 1.3.5.3. Two-Sample t-Test for Equal Means

## **1.3.5.3.1.** Data Used for Two-Sample *t*-Test

Data Used for Two-Sample t-Test Example The following is the data used for the two-sample *t*-test example. The first column is miles per gallon for U.S. cars and the second column is miles per gallon for Japanese cars. For the *t*-test example, rows with the second column equal to -999 were deleted.

18 15 18 16 17 15 14 14	24 27 27 25 31 35 24
14 15 15 14 15 14 22 18 21 21 10	24 27 27 25 31 32 24 29 24 26 29 24 24 33 32 28 29 24 24 33 33 22 22 33 34 26 32 22 33 33 34 36 36 37 37 37 37 37 37 37 37 37 37 37 37 37
10 11 9 28 25 19 16 17	32 24 26 29 24 24 33 32 28
18 14 14 14 12 13 13 18 22	19 32 34 26 30 22 22 33 39 36
11 9 28 25 19 16 17 18 14 14 14 11 13 18 22 21 21 21 21 21 21 21 21 21 21 21 21	28 27 21 24 30 34 32 38 37 30 31
17 11 13 12	31 37 32 47 41

13 15 13	45 34
13 13 14 22 28 13	33 24 32
22	39
28	35
13	32
14	37
13	38
14	34
15	34
12	32
13	33
13	32
14	25
13	24
12	37
13	31
18	36
16	36
18	34
23	32
11	38
13	-999
12	-999
16	-999
21	-999
19	-999
15 16	-999 -999 -999
15 11 20	-999 -999 -999 -999 -999 -999 -999
21	-999
19	-999
15	-999
26	-999
25	-999
16	-999
13 14 12 13 14 12 13 14 13 14 14 14 15 13 13 14 14 14 14 14 14 14 14 14 16 16 16 16 16 16 16 16 16 16 16 16 16	$\begin{array}{c} 44434295227844332224716648282999999999999999999999999999999999$
13	-999
14	-999
14	-999
14	-999
28	-999
19	-999
18	-999
15	-999
15	-999
16	-999
15	-999
16	-999
14	-999
17	-999
16	-999
21	-999 -999 -999
20 13 23 20	-999 -999 -999
20	-999
23	-999
18	-999
19	-999
25	-999
26	-999
18	-999
16	-999
16	-999
23 18 19 25 26 18 16 16 15 22 22	-9999 -99999-99999-9999999999999999999
24	-999
23	-999

29 25	-999
25 20	-999
20	-999 -999
18 19	-999
19 1Ω	-999 -999
27	-999
19 18 27 13 17	-999
17	-999
13	-999 -999
13	-999
13 13	-999
30	-999
26	-999 -999
18	-999
1 / 1 <i>c</i>	-999
10 15	-999 -999
18	-999
21	-999
19	-999
19	-999 -999
16	-999
16	-999
16 16	-999 -999
7.P	-999
45 26	-999 -999
31	-999
34	-999 -999
36	-999
13 30 26 18 17 16 15 18 21 19 16 16 16 16 16 22 31 34 33 36	-999
19	-999
20	-999 -999
19	-999
21	-999
∠U 25	-999 -999
25 21	-999 -999
19	-999
21	-999
21	-999 -999
19	-999
18	-999
19	-999 -999
18 10	-999
10 18	-999 -999
30	-999
31	-999
23	-999
24	-999
22	-999 -999
20	-999
22	-999 -999
∠U 21	-999 -000
17	-999 -999
18	-999
	-999 -999
18	-999 -999
17	-999
16	-999 -999
19	-999
19	-999 -999
30 27	-999 -000
23	-999 -999
24	-999
34	-999 -999
35	-999
28	-999 -999
29	-999 -999
∠ / ⊃ /	-999
34 39	- 999 - aaa
28	-999 -999 -999
19 19 19 19 19 19 19 20 19 19 19 19 19 19 19 19 19 19 19 19 19	99999999999999999999999999999999999999
24	-999
19	-999 -999
28	-999

24 27 27 26 24 30 35 34 30 22 27 20 18 27 24 23 36 27 27 27 24 23 36 27 27 27 27 27 27 27 27 27 27 27 27 27	999999999999999999999999999999999999999
28 31	-999 -999



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

### 1.3.5.4. One-Factor ANOVA

Purpose: Test for Equal Means Across Groups One factor analysis of variance (Snedecor and Cochran, 1989) is a special case of analysis of variance (ANOVA), for one factor of interest, and a generalization of the two-sample *t*-test. The two-sample *t*-test is used to decide whether two groups (levels) of a factor have the same mean. One-way analysis of variance generalizes this to levels where *k*, the number of levels, is greater than or equal to 2.

For example, data collected on, say, five instruments have one factor (instruments) at five levels. The ANOVA tests whether instruments have a significant effect on the results.

Definition

The <u>Product and Process Comparisons</u> chapter (chapter 7) contains a more extensive discussion of <u>one-factor ANOVA</u>, including the details for the mathematical computations of one-way analysis of variance.

The model for the analysis of variance can be stated in two mathematically equivalent ways. In the following discussion, each level of each factor is called a cell. For the one-way case, a cell and a level are equivalent since there is only one factor. In the following, the subscript i refers to the level and the subscript j refers to the observation within a level. For example,  $Y_{23}$  refers to the third observation in the second level.

The first model is

$$Y_{ij} = \mu_i + E_{ij}$$

This model decomposes the response into a mean for each cell and an error term. The analysis of variance provides estimates for each cell mean. These estimated cell means are the predicted values of the model and the differences between the response variable and the estimated cell means are the residuals. That is

$$\hat{Y}_{ij} = \hat{\mu}_i$$

$$R_{ij} = Y_{ij} - \hat{\mu}_i$$

The second model is

$$Y_{ij} = \mu + \alpha_i + E_{ij}$$

This model decomposes the response into an overall (grand) mean, the effect of the *i*th factor level, and an error term. The analysis of variance provides estimates of the grand mean and the effect of the *i*th factor level. The predicted values and the residuals of the model are

$$\hat{Y}_{ij} = \hat{\mu} + \hat{lpha}_i$$
  $R_{ij} = Y_{ij} - \hat{\mu} - \hat{lpha}_i$ 

The distinction between these models is that the second model divides the cell mean into an overall mean and the effect of the *i*th factor level. This second model makes the factor effect more explicit, so we will emphasize this approach.

Model Validation Note that the ANOVA model assumes that the error term,  $E_{ij}$ , should follow the <u>assumptions</u> for a univariate measurement process. That is, after performing an analysis of variance, the model should be validated by <u>analyzing the residuals</u>.

One-Way ANOVA Example A one-way analysis of variance was generated for the <u>GEAR.DAT</u> data set. The data set contains 10 measurements of gear diameter for ten different batches for a total of 100 measurements.

SOURCE F STATISTIC		GREES OF REEDOM	SUM OF SQUARES	MEAN SQUARE
BATCH		9	0.000729	
0.000081	2.2969	9	0.000729	
RESIDUAL	2.2202	90	0.003174	
0.000035				
TOTAL (CORREC	CTED)	99	0.003903	
0.000039				

RESIDUAL STANDARD DEVIATION = 0.00594

BATCH	N	MEAN	SD(MEAN)
1 2 3 4 5 6 7 8	10 10 10 10 10 10 10 10	0.99800 0.99910 0.99540 0.99820 0.99190 0.99880 1.00150 1.00040 0.99830	0.00178 0.00178 0.00178 0.00178 0.00178 0.00178 0.00178 0.00178
10	10	0.99480	0.00178

The ANOVA table decomposes the variance into the following component <u>sum of squares</u>:

• Total sum of squares. The degrees of freedom for this

- entry is the number of observations minus one.
- Sum of squares for the factor. The degrees of freedom for this entry is the number of levels minus one. The mean square is the sum of squares divided by the number of degrees of freedom.
- Residual sum of squares. The degrees of freedom is the total degrees of freedom minus the factor degrees of freedom. The mean square is the sum of squares divided by the number of degrees of freedom.

The sums of squares summarize how much of the variance in the data (total sum of squares) is accounted for by the factor effect (batch sum of squares) and how much is random error (residual sum of squares). Ideally, we would like most of the variance to be explained by the factor effect.

The ANOVA table provides a formal *F* test for the factor effect. For our example, we are testing the following hypothesis.

 $H_0$ : All individual batch means are equal.

H<sub>a</sub>: At least one batch mean is not equal to the others.

The F statistic is the batch mean square divided by the residual mean square. This statistic follows an F distribution with (k-1) and (N-k) degrees of freedom. For our example, the critical F value (upper tail) for  $\alpha = 0.05$ , (k-1) = 10, and (N-k) = 90 is 1.9376. Since the F statistic, 2.2969, is greater than the critical value, we conclude that there is a significant batch effect at the 0.05 level of significance.

Once we have determined that there is a significant batch effect, we might be interested in comparing individual batch means. The batch means and the standard errors of the batch means provide some information about the individual batches, however, we may want to employ multiple comparison methods for a more formal analysis. (See <a href="Box, Hunter">Box, Hunter</a>, and Hunter for more information.)

In addition to the quantitative ANOVA output, it is recommended that any analysis of variance be complemented with model validation. At a minimum, this should include:

- 1. a <u>run sequence plot</u> of the residuals,
- 2. a <u>normal probability plot</u> of the residuals, and
- 3. a <u>scatter plot</u> of the predicted values against the residuals.

Question

The analysis of variance can be used to answer the following question

• Are means the same across groups in the data?

The analysis of uncertainty depends on whether the factor Importance

significantly affects the outcome.

Two-sample *t*-test Related

Multi-factor analysis of variance **Techniques** 

Regression Box plot

Software Most general purpose statistical software programs can

generate an analysis of variance. Both <u>Dataplot code</u> and <u>R</u> code can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.5. Multi-factor Analysis of Variance

Purpose: Detect significant factors The analysis of variance (ANOVA) (Neter, Wasserman, and Kunter, 1990) is used to detect significant factors in a multifactor model. In the multi-factor model, there is a response (dependent) variable and one or more factor (independent) variables. This is a common model in designed experiments where the experimenter sets the values for each of the factor variables and then measures the response variable.

Each factor can take on a certain number of values. These are referred to as the levels of a factor. The number of levels can vary between factors. For designed experiments, the number of levels for a given factor tends to be small. Each factor and level combination is a cell. Balanced designs are those in which the cells have an equal number of observations and unbalanced designs are those in which the number of observations varies among cells. It is customary to use balanced designs in designed experiments.

Definition

The <u>Product and Process Comparisons</u> chapter (chapter 7) contains a more extensive discussion of <u>two-factor ANOVA</u>, including the details for the mathematical computations.

The model for the analysis of variance can be stated in two mathematically equivalent ways. We explain the model for a two-way ANOVA (the concepts are the same for additional factors). In the following discussion, each combination of factors and levels is called a cell. In the following, the subscript i refers to the level of factor 1, j refers to the level of factor 2, and the subscript k refers to the kth observation within the (i,j)th cell. For example,  $Y_{235}$  refers to the fifth observation in the second level of factor 1 and the third level of factor 2.

The first model is

$$Y_{ijk} = \mu_{ij} + E_{ijk}$$

This model decomposes the response into a mean for each cell and an error term. The analysis of variance provides estimates for each cell mean. These cell means are the predicted values of the model and the differences between the response variable and the estimated cell means are the residuals. That is

$$egin{aligned} \hat{Y}_{ijk} &= \hat{\mu}_{ij} \ R_{ijk} &= Y_{ijk} - \hat{\mu}_{ij} \end{aligned}$$

The second model is

$$Y_{ijk} = \mu + \alpha_i + \beta_j + E_{ijk}$$

This model decomposes the response into an overall (grand) mean, factor effects ( $\hat{\alpha}_i$  and  $\hat{\beta}_j$  represent the effects of the *i*th level of the first factor and the *j*th level of the second factor, respectively), and an error term. The analysis of variance provides estimates of the grand mean and the factor effects. The predicted values and the residuals of the model are

$$egin{aligned} \hat{Y}_{ijk} &= \hat{\mu} + \hat{lpha}_i + \hat{eta}_j \ & R_{ijk} &= Y_{ijk} - \hat{\mu} - \hat{lpha}_i - \hat{eta}_j \end{aligned}$$

The distinction between these models is that the second model divides the cell mean into an overall mean and factor effects. This second model makes the factor effect more explicit, so we will emphasize this approach.

Model Validation Note that the ANOVA model assumes that the error term,  $E_{ijk}$ , should follow the <u>assumptions</u> for a univariate measurement process. That is, after performing an analysis of variance, the model should be validated by <u>analyzing the residuals</u>.

Multi-Factor ANOVA Example An analysis of variance was performed for the <u>JAHANMI2.DAT</u> data set. The data contains four, two-level factors: table speed, down feed rate, wheel grit size, and batch. There are 30 measurements of ceramic strength for each factor combination for a total of 480 measurements.

SOURCE SOUARE F STATIST	DF SUM OF SQUARES	MEAN
DOME I SIMISI		
TABLE SPEED	1 26672.726562	
26672.726562	6.7080	
DOWN FEED RATE	1 11524.053711	
11524.053711	2.8982	
WHEEL GRIT SIZE	1 14380.633789	
14380.633789	3.6166	
BATCH	1 727143.125000	
727143.125000	182.8703	
RESIDUAL	475 1888731.500000	
3976.276855		
TOTAL (CORRECTED)	479 2668446.000000	
5570.868652		

RESIDUAL STANDARD DEVIATION = 63.05772781

FACTOR	LEVEL	N	MEAN	SD(MEAN)
TABLE SPEED	-1	240	657.53168	2.87818
	1	240	642.62286	2.87818
DOWN FEED RATE	-1	240	645.17755	2.87818
	1	240	654.97723	2.87818

WHEEL GRIT	SIZE -1	. 240	655.55084	2.87818
	1	. 240	644.60376	2.87818
BATCH	1	. 240	688.99890	2.87818
	2	240	611.15594	2.87818

The ANOVA decomposes the variance into the following component <u>sum of squares</u>:

- Total sum of squares. The degrees of freedom for this entry is the number of observations minus one.
- Sum of squares for each of the factors. The degrees of freedom for these entries are the number of levels for the factor minus one. The mean square is the sum of squares divided by the number of degrees of freedom.
- Residual sum of squares. The degrees of freedom is the total degrees of freedom minus the sum of the factor degrees of freedom. The mean square is the sum of squares divided by the number of degrees of freedom.

The analysis of variance summarizes how much of the variance in the data (total sum of squares) is accounted for by the factor effects (factor sum of squares) and how much is due to random error (residual sum of squares). Ideally, we would like most of the variance to be explained by the factor effects. The ANOVA table provides a formal *F* test for the factor effects. To test the overall batch effect in our example we use the following hypotheses.

H<sub>0</sub>: All individual batch means are equal.

H<sub>a</sub>: At least one batch mean is not equal to the others.

The F statistic is the mean square for the factor divided by the residual mean square. This statistic follows an F distribution with (k-1) and (N-k) degrees of freedom where k is the number of levels for the given factor. Here, we see that the size of the "direction" effect dominates the size of the other effects. For our example, the critical F value (upper tail) for  $\alpha = 0.05$ , (k-1) = 1, and (N-k) = 475 is 3.86111. Thus, "table speed" and "batch" are significant at the 5 % level while "down feed rate" and "wheel grit size" are not significant at the 5 % level.

In addition to the quantitative ANOVA output, it is recommended that any analysis of variance be complemented with <u>model validation</u>. At a minimum, this should include

- 1. A <u>run sequence plot</u> of the residuals.
- 2. A <u>normal probability plot</u> of the residuals.
- 3. A <u>scatter plot</u> of the predicted values against the residuals.

**Questions** 

The analysis of variance can be used to answer the following questions:

1. Do any of the factors have a significant effect?

- 2. Which is the most important factor?
- 3. Can we account for most of the variability in the data?

Related One-factor analysis of variance

Two-sample *t*-test *Techniques* 

> Box plot **Block** plot DOE mean plot

Case Study The quantitative ANOVA approach can be contrasted with the

more graphical EDA approach in the ceramic strength case

study.

*Software* Most general purpose statistical software programs can

perform multi-factor analysis of variance. Both <u>Dataplot code</u>

and R code can be used to generate the analyses in this

section.

NIST SEMATECH

HOME TOOLS & AIDS SEARCH



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

### 1.3.5.6. Measures of Scale

Scale. Variability, or Spread

A fundamental task in many statistical analyses is to characterize the *spread*, or variability, of a data set. Measures of scale are simply attempts to estimate this variability.

When assessing the variability of a data set, there are two key components:

- 1. How spread out are the data values near the center?
- 2. How spread out are the tails?

Different numerical summaries will give different weight to these two elements. The choice of scale estimator is often driven by which of these components you want to emphasize.

The <u>histogram</u> is an effective graphical technique for showing both of these components of the spread.

**Definitions** of **Variability** 

For univariate data, there are several common numerical measures of the spread:

1. variance - the variance is defined as 
$$s^2 = \sum_{i=1}^N (Y_i - \bar{Y})^2 / (N-1)$$

where  $ar{Y}$  is the mean of the data

The variance is roughly the arithmetic average of the squared distance from the mean. Squaring the distance from the mean has the effect of giving greater weight to values that are further from the mean. For example, a point 2 units from the mean adds 4 to the above sum while a point 10 units from the mean adds 100 to the sum. Although the variance is intended to be an overall measure of spread, it can be greatly affected by the tail behavior.

2. standard deviation - the standard deviation is the square root of the variance. That is,

$$s = \sqrt{\sum_{i=1}^N (Y_i - \bar{Y})^2/(N-1)}$$

The standard deviation restores the units of the spread to the original data units (the variance squares the units).

- 3. range the range is the largest value minus the smallest value in a data set. Note that this measure is based only on the lowest and highest extreme values in the sample. The spread near the center of the data is not captured at all.
- 4. average absolute deviation the average absolute deviation (AAD) is defined as

$$AAD = \sum_{i=1}^{N} (|Y_i - \bar{Y}|)/N$$

where  $\bar{Y}$  is the mean of the data and |Y| is the absolute value of Y. This measure does not square the distance from the mean, so it is less affected by extreme observations than are the variance and standard deviation.

5. median absolute deviation - the median absolute deviation (MAD) is defined as

$$MAD = median(|Y_i - \tilde{Y}|)$$

where  $\tilde{Y}$  is the median of the data and |Y| is the absolute value of Y. This is a variation of the average absolute deviation that is even less affected by extremes in the tail because the data in the tails have less influence on the calculation of the median than they do on the mean.


6. interquartile range - this is the value of the 75th percentile minus the value of the 25th percentile. This measure of scale attempts to measure the variability of points near the center.

In summary, the variance, standard deviation, average absolute deviation, and median absolute deviation measure both aspects of the variability; that is, the variability near the center and the variability in the tails. They differ in that the average absolute deviation and median absolute deviation do not give undue weight to the tail behavior. On the other hand, the range only uses the two most extreme points and the interquartile range only uses the middle portion of the data.

Why Different The following example helps to clarify why these alternative defintions of spread are useful and necessary.

Measures?

This plot shows histograms for 10,000 random numbers generated from a normal, a double exponential, a Cauchy, and a Tukey-Lambda distribution.

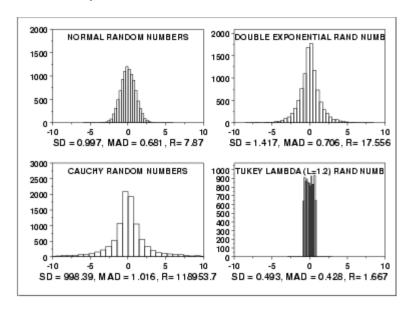

Normal Distribution The first histogram is a sample from a <u>normal distribution</u>. The standard deviation is 0.997, the median absolute deviation is 0.681, and the range is 7.87.

The normal distribution is a symmetric distribution with well-behaved tails and a single peak at the center of the distribution. By symmetric, we mean that the distribution can be folded about an axis so that the two sides coincide. That is, it behaves the same to the left and right of some center point. In this case, the median absolute deviation is a bit less than the standard deviation due to the downweighting of the tails. The range of a little less than 8 indicates the extreme values fall within about 4 standard deviations of the mean. If a histogram or normal probability plot indicates that your data are approximated well by a normal distribution, then it is reasonable to use the standard deviation as the spread estimator.

Double Exponential Distribution The second histogram is a sample from a <u>double exponential</u> <u>distribution</u>. The standard deviation is 1.417, the median absolute deviation is 0.706, and the range is 17.556.

Comparing the double exponential and the normal histograms shows that the double exponential has a stronger peak at the center, decays more rapidly near the center, and has much longer tails. Due to the longer tails, the standard deviation tends to be inflated compared to the normal. On the other hand, the median absolute deviation is only slightly larger than it is for the normal data. The longer tails are clearly reflected in the value of the range, which shows that the extremes fall about 6 standard deviations from the mean compared to about 4 for the normal data.

Cauchy Distribution The third histogram is a sample from a <u>Cauchy distribution</u>. The standard deviation is 998.389, the median absolute deviation is 1.16, and the range is 118,953.6.

The Cauchy distribution is a symmetric distribution with heavy tails and a single peak at the center of the distribution. The Cauchy distribution has the interesting property that collecting more data does not provide a more accurate estimate for the mean or standard deviation. That is, the sampling distribution of the means and standard deviation are equivalent to the sampling distribution of the original data. That means that for the Cauchy distribution the standard deviation is useless as a measure of the spread. From the histogram, it is clear that just about all the data are between about -5 and 5. However, a few very extreme values cause both the standard deviation and range to be extremely large. However, the median absolute deviation is only slightly larger than it is for the normal distribution. In this case, the median absolute deviation is clearly the better measure of spread.

Although the Cauchy distribution is an extreme case, it does illustrate the importance of heavy tails in measuring the spread. Extreme values in the tails can distort the standard deviation. However, these extreme values do not distort the median absolute deviation since the median absolute deviation is based on ranks. In general, for data with extreme values in the tails, the median absolute deviation or interquartile range can provide a more stable estimate of spread than the standard deviation.

Tukey-Lambda Distribution

The fourth histogram is a sample from a <u>Tukey lambda</u> distribution with shape parameter  $\alpha = 1.2$ . The standard deviation is 0.49, the median absolute deviation is 0.427, and the range is 1.666.

The Tukey lambda distribution has a range limited to  $(-1/\lambda, 1/\lambda)$ . That is, it has truncated tails. In this case the standard deviation and median absolute deviation have closer values than for the other three examples which have significant tails.

Robustness

<u>Tukey and Mosteller</u> defined two types of robustness where robustness is a lack of susceptibility to the effects of nonnormality.

1. Robustness of validity means that the confidence intervals for a measure of the population spread (e.g., the standard deviation) have a 95 % chance of covering the true value (i.e., the population value) of that measure of spread regardless of the underlying distribution.

2. Robustness of efficiency refers to high effectiveness in the face of non-normal tails. That is, confidence intervals for the measure of spread tend to be almost as narrow as the best that could be done if we knew the true shape of the distribution.

The standard deviation is an example of an estimator that is the best we can do if the underlying distribution is normal. However, it lacks robustness of validity. That is, confidence intervals based on the standard deviation tend to lack precision if the underlying distribution is in fact not normal.

The median absolute deviation and the interquartile range are estimates of scale that have robustness of validity. However, they are not particularly strong for robustness of efficiency.

If histograms and probability plots indicate that your data are in fact reasonably approximated by a normal distribution, then it makes sense to use the standard deviation as the estimate of scale. However, if your data are not normal, and in particular if there are long tails, then using an alternative measure such as the median absolute deviation, average absolute deviation, or interquartile range makes sense. The range is used in some applications, such as quality control, for its simplicity. In addition, comparing the range to the standard deviation gives an indication of the spread of the data in the tails.

Since the range is determined by the two most extreme points in the data set, we should be cautious about its use for large values of N.

<u>Tukey and Mosteller</u> give a scale estimator that has both robustness of validity and robustness of efficiency. However, it is more complicated and we do not give the formula here.

Software

Most general purpose statistical software programs can generate at least some of the measures of scale discussed above.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

### 1.3.5.7. Bartlett's Test

Purpose: Test for Homogeneity of Variances Bartlett's test (Snedecor and Cochran, 1983) is used to test if *k* samples have equal variances. Equal variances across samples is called homogeneity of variances. Some statistical tests, for example the analysis of variance, assume that variances are equal across groups or samples. The Bartlett test can be used to verify that assumption.

Bartlett's test is sensitive to departures from normality. That is, if your samples come from non-normal distributions, then Bartlett's test may simply be testing for non-normality. The <u>Levene test</u> is an alternative to the Bartlett test that is less sensitive to departures from normality.

Definition

The Bartlett test is defined as:

 $H_0$ :  $\sigma_1^2 = \sigma_2^2 = ... = \sigma_k^2$ 

 $H_a$ :  $\sigma_i^2 \neq \sigma_j^2$  for at least one pair (i,j).

Test The Bartlett test statistic is designed to test for equality of variances across Statistic: groups against the alternative that variances are unequal for at least two groups.

$$T = \frac{(N-k) \ln s_p^2 - \Sigma_{i=1}^k (N_i-1) \ln s_i^2}{1 + (1/(3(k-1)))((\Sigma_{i=1}^k \, 1/(N_i-1)) - 1/(N-k))}$$

In the above,  $s_i^2$  is the variance of the ith group, N is the total sample size,  $N_i$  is the sample size of the ith group, k is the number of groups, and  $s_p^2$  is the pooled variance. The pooled variance is a weighted average of the group variances and is defined as:

$$s_p^2=\sum\limits_{i=1}^k(N_i-1)s_i^2/(N-k)$$

Significance  $\alpha$ 

Level:

Critical The variances are judged to be unequal if,

Region:  $T>\chi^2_{1-\alpha,\,k-1}$ 

where  $\chi^2_{1-\alpha, k-1}$  is the <u>critical value</u> of the <u>chi-square</u> distribution with k-1degrees of freedom and a significance level of  $\alpha$ .

An alternate definition (Dixon and Massey, 1969) is based on an approximation to the F distribution. This definition is given in the <u>Product and Process Comparisons</u> chapter (chapter 7).

#### Example

Bartlett's test was performed for the **GEAR.DAT** data set. The data set contains 10 measurements of gear diameter for ten different batches for a total of 100 measurements.

```
H_0: \sigma_1^2 = \sigma_2^2 = \dots = \sigma_{10}^2
H_a: At least one \sigma_i^2 is not equal to the others.
Test statistic: T = 20.78580
Degrees of freedom: k-1=9
Significance level: \alpha=0.05
Critical value: X^2_{1-\alpha,k-1}=16.919
Critical region: Reject H<sub>0</sub> if T>16.919
```

We are testing the null hypothesis that the batch variances are all equal. Because the test statistic is larger than the critical value, we reject the null hypotheses at the 0.05 significance level and conclude that at least one batch variance is different from the others.

#### Question

Bartlett's test can be used to answer the following question:

• Is the assumption of equal variances valid?

#### *Importance*

Bartlett's test is useful whenever the assumption of equal variances is made. In particular, this assumption is made for the frequently used one-way analysis of variance. In this case, Bartlett's or Levene's test should be applied to verify the assumption.

## Related

**Standard Deviation Plot** 

**Box Plot** *Techniques* 

Levene Test **Chi-Square Test Analysis of Variance** 

Case Study

Heat flow meter data

Software

The Bartlett test is available in many general purpose statistical software programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.8. Chi-Square Test for the Variance

Purpose: Test if the variance is equal to a specified value A chi-square test (Snedecor and Cochran, 1983) can be used to test if the variance of a population is equal to a specified value. This test can be either a two-sided test or a one-sided test. The two-sided version tests against the alternative that the true variance is either less than or greater than the specified value. The one-sided version only tests in one direction. The choice of a two-sided or one-sided test is determined by the problem. For example, if we are testing a new process, we may only be concerned if its variability is greater than the variability of the current process.

Definition The chi-square hypothesis test is defined as:

$$H_0$$
:  $\sigma^2=\sigma_0^2$   $H_a$ :  $\sigma^2<\sigma_0^2$  for a lower one-tailed test  $\sigma^2>\sigma_0^2$  for an upper one-tailed test  $\sigma^2\neq\sigma_0^2$  for a two-tailed test

Test Statistic: 
$$T = (N-1)/(s/\sigma_0)^2$$

where N is the sample size and s is the sample standard deviation. The key element of this formula is the ratio  $s/\sigma_0$  which compares the ratio of the sample standard deviation to the target standard deviation. The more this ratio deviates from 1, the more likely we are to reject the null hypothesis.

Significance  $\alpha$ .

Level:

Critical Reject the null hypothesis that the variance is a specified value,  $\sigma_0^2$ , if

$$T>\chi^2_{1-lpha,N-1}$$
 for an upper one-tailed alternative  $T<\chi^2_{lpha,N-1}$  for a lower one-tailed alternative  $T<\chi^2_{lpha/2,N-1}$  for a two-tailed test or  $T>\chi^2_{1-lpha/2,N-1}$ 

where  $\chi^2_{\cdot, N-1}$  is the <u>critical value</u> of the <u>chi-square distribution</u> with N-1 degrees of freedom.

The formula for the hypothesis test can easily be converted to form an interval estimate for the variance:

$$rac{(N-1)s^2}{\chi^2_{1-lpha/2,\,N-1}} \leq \sigma^2 \leq rac{(N-1)s^2}{\chi^2_{lpha/2,\,N-1}}$$

A confidence interval for the standard deviation is computed by taking the square root of the upper and lower limits of the confidence interval for the variance.

Chi-Square Test Example A chi-square test was performed for the <u>GEAR.DAT</u> data set. The observed variance for the 100 measurements of gear diameter is 0.00003969 (the standard deviation is 0.0063). We will test the null hypothesis that the true variance is equal to 0.01.

$$H_a$$
:  $\sigma^2 \neq 0.01$ 

Test statistic:  $T = 0.3903$ 

Degrees of freedom:  $N - 1 = 99$ 

Significance level:  $\alpha = 0.05$ 

Critical values:  $X^2_{\alpha/2,N-1} = 73.361$ 

Critical values:  $X^2_{\alpha/2,N-1} = 73.361$   $X^2_{1-\alpha/2,N-1} = 128.422$ Critical region: Reject H<sub>0</sub> if T < 73.361 or T > 128.422

The test statistic value of 0.3903 is much smaller than the lower critical value, so we reject the null hypothesis and conclude that the variance is not equal to 0.01.

**Questions** 

The chi-square test can be used to answer the following questions:

- 1. Is the variance equal to some pre-determined threshold value?
- 2. Is the variance greater than some pre-determined threshold value?
- 3. Is the variance less than some pre-determined threshold value?

Related Techniques F Test
Bartlett Test
Levene Test

 $H_0: \sigma^2 = 0.01$ 

Software

The chi-square test for the variance is available in many general purpose statistical software programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the

analyses in this section.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques
- 1.3.5.8. Chi-Square Test for the Variance

# 1.3.5.8.1. Data Used for Chi-Square Test for the Variance

Data Used for Chi-Square Test for The following are the data used for the <u>chi-square test for the variance</u> example. The first column is gear diameter and the second column is batch number. Only the first column is used for this example.

the Variance Example

1.006 0.998 1.000 0.998 1.000 0.993 1.002 0.999 1.000 1.002 0.998 1.000 1.002 0.998 0.997 0.998 0.998 0.998 0.999 0.9996 1.000 1.002 0.9996 1.000 1.002 0.9996 1.000 1.002 0.9996 1.000 1.002 0.9996 0.9996 1.000 0.9996 0.9996 1.000 0.9996 0.9996 0.9996 1.000 0.9996 0.9996 0.9996 1.000 0.9996 0.9996 0.9996 1.000 0.9996 0.9966 0.9966 0.9966 0.9966 0.9966 0.9966 0.9966 0.996	1.000 1.000 1.000 1.000 1.000 1.000 1.000 1.000 2.000 2.000 2.000 2.000 2.000 2.000 3.000 3.000 3.000 3.000 3.000 3.000 4.000 4.000 4.000 4.000 4.000 4.000 5.000 5.000 5.000
0.998 0.998 0.982 0.990 1.002 0.984 0.996 0.993 0.980 0.996 1.009	5.000 5.000

1.009 0.997 0.988 1.002 0.998 0.998 0.998 0.999 1.009 1.018 1.010 0.990 1.018 1.010 1.020 1.000	6.000 6.000 6.000 6.000 6.000 7.000 7.000 7.000 7.000 7.000 7.000 7.000 8.000 8.000 8.000 8.000 8.000 8.000 9.000 9.000 9.000 9.000 9.000 9.000 9.000
0.998 0.999 0.991	9.000 9.000 9.000 10.000 10.000 10.000 10.000 10.000 10.000 10.000 10.000



HOME

TOOLS & AIDS

SEARCH



## **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

# **1.3.5.9.** *F*-Test for Equality of Two Variances

Purpose: Test if variances from two populations are equal An *F*-test (Snedecor and Cochran, 1983) is used to test if the variances of two populations are equal. This test can be a two-tailed test or a one-tailed test. The two-tailed version tests against the alternative that the variances are not equal. The one-tailed version only tests in one direction, that is the variance from the first population is either greater than or less than (but not both) the second population variance. The choice is determined by the problem. For example, if we are testing a new process, we may only be interested in knowing if the new process is less variable than the old process.

Definition

The *F* hypothesis test is defined as:

$$H_0$$
:  $\sigma_1^2 = \sigma_2^2$ 

$$H_a$$
:  $\sigma_1^2 < \sigma_2^2$  for a lower one-tailed test

$$\sigma_1^2 > \sigma_2^2$$
 for an upper one-tailed test

$$\sigma_1^2 \neq \sigma_2^2$$
 for a two-tailed test

Test  $F = s_1^2/s_2^2$ 

Statistic:

where  $s_1^2$  and  $s_2^2$  are the sample variances. The more this ratio deviates from 1, the stronger the evidence for unequal population variances.

Significance a

Level:

Critical The hypothesis that the two variances are equal

Region: is rejected if

$$F > F_{\alpha, N_1-1, N_2-1}$$
 for an upper one-tailed test

$$F < F_{1-\alpha, N_1-1, N_2-1}$$
 for a lower one-tailed

$$F < F_{1-\alpha/2, N_1-1, N_2-1}$$
 for a two-tailed test

or

$$F > F_{\alpha/2, N_1-1, N_2-1}$$

where  $F_{\alpha, N_1-1, N_2-1}$  is the <u>critical value</u> of the <u>F</u> <u>distribution</u> with  $N_1$ -1 and  $N_2$ -1 degrees of freedom and a significance level of  $\alpha$ .

In the above formulas for the critical regions, the Handbook follows the convention that  $F_{\alpha}$  is the upper critical value from the F distribution and  $F_{1-\alpha}$  is the lower critical value from the F distribution. Note that this is the opposite of the designation used by some texts and software programs.

F Test Example The following *F*-test was generated for the <u>AUTO83B.DAT</u> data set. The data set contains 480 ceramic strength measurements for two batches of material. The summary statistics for each batch are shown below.

```
BATCH 1:
    NUMBER OF OBSERVATIONS = 240
    MEAN = 688.9987
    STANDARD DEVIATION = 65.54909

BATCH 2:
    NUMBER OF OBSERVATIONS = 240
    MEAN = 611.1559
    STANDARD DEVIATION = 61.85425
```

We are testing the null hypothesis that the variances for the two batches are equal.

```
\begin{array}{lll} {\rm H_0:} & {\sigma_1}^2 = {\sigma_2}^2 \\ {\rm H_a:} & {\sigma_1}^2 \neq {\sigma_2}^2 \\ \\ \\ {\rm Test\ statistic:} & F = 1.123037 \\ {\rm Numerator\ degrees\ of\ freedom:} & N_1 - 1 = 239 \\ \\ {\rm Denominator\ degrees\ of\ freedom:} & N_2 - 1 = 239 \\ \\ {\rm Significance\ level:} & \alpha = 0.05 \\ {\rm Critical\ values:} & F(1-\alpha/2,N_1-1,N_2-1) = 0.7756 \\ & F(\alpha/2,N_1-1,N_2-1) = 1.2894 \\ \\ {\rm Rejection\ region:} & {\rm Reject\ H_0\ if\ } F < 0.7756\ {\rm or\ } F > 1.2894 \\ \\ \end{array}
```

The *F* test indicates that there is not enough evidence to reject the null hypothesis that the two batch variancess are equal at the 0.05 significance level.

Questions

The *F*-test can be used to answer the following questions:

- 1. Do two samples come from populations with equal variancess?
- 2. Does a new process, treatment, or test reduce the variability of the current process?

Related **Quantile-Quantile Plot** 

**Bihistogram Techniques** 

**Chi-Square Test** Bartlett's Test Levene Test

Case Study Ceramic strength data.

Software The F-test for equality of two variances is available in many

general purpose statistical software programs. Both Dataplot code and R code can be used to generate the analyses in this

section.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

# **1.3.5.10.** Levene Test for Equality of Variances

Purpose: Test for Homogeneity of Variances Levene's test (Levene 1960) is used to test if k samples have equal variances. Equal variances across samples is called homogeneity of variance. Some statistical tests, for example the analysis of variance, assume that variances are equal across groups or samples. The Levene test can be used to verify that assumption.

Levene's test is an alternative to the <u>Bartlett test</u>. The Levene test is less sensitive than the Bartlett test to departures from normality. If you have strong evidence that your data do in fact come from a normal, or nearly normal, distribution, then Bartlett's test has better performance.

Definition

The Levene test is defined as:

$$H_0$$
:  $\sigma_1^2 = \sigma_2^2 = ... = \sigma_k^2$ 

$$H_a$$
:  $\sigma_i^2 \neq \sigma_j^2$  for at least one pair  $(i,j)$ .

Test Given a variable Y with sample of size N divided into k subgroups, where  $N_i$  is the sample size of the ith subgroup, the Levene test statistic is defined as:

$$W = \frac{(N-k)}{(k-1)} \frac{\sum_{i=1}^{k} N_i (\bar{Z}_{i.} - \bar{Z}_{..})^2}{\sum_{i=1}^{k} \sum_{i=1}^{N_i} (Z_{ij} - \bar{Z}_{i.})^2}$$

where  $Z_{ij}$  can have one of the following three definitions:

1. 
$$Z_{ij} = |Y_{ij} - \bar{Y}_{i.}|$$

where  $ar{Y}_i$  is the mean of the ith subgroup.

2. 
$$Z_{ij} = |Y_{ij} - \tilde{Y}_{ij}|$$

where  $\tilde{Y}_i$  is the median of the *i*th subgroup.

3. 
$$Z_{ij} = |Y_{ij} - \bar{Y}'_{i_i}|$$

where  $\bar{Y}_{i}^{l}$  is the 10% trimmed mean of the *i*th subgroup.

 $ar{Z}_{i.}$  are the group means of the  $Z_{ij}$  and  $ar{Z}_{..}$  is the overall mean of the  $Z_{ij}$ .

The three choices for defining  $Z_{ij}$  determine the robustness and power of Levene's test. By robustness, we mean the ability of the test to not falsely detect unequal variances when the underlying data are not normally distributed and the variables are in fact equal. By power, we mean the ability of the test to detect unequal variances when the variances are in fact unequal.

Levene's original paper only proposed using the mean. Brown and Forsythe (1974)) extended Levene's test to use either the median or the trimmed mean in addition to the mean. They performed Monte Carlo studies that indicated that using the trimmed mean performed best when the underlying data followed a Cauchy distribution (i.e., heavy-tailed) and the median performed best when the underlying data followed a  $\chi_4^2$  (i.e., skewed) distribution. Using the mean provided the best power for symmetric, moderate-tailed, distributions.

Although the optimal choice depends on the underlying distribution, the definition based on the median is recommended as the choice that provides good robustness against many types of non-normal data while retaining good power. If you have knowledge of the underlying distribution of the data, this may indicate using one of the other choices.

Significance  $\alpha$ 

Level:

Critical The Levene test rejects the hypothesis that the Region: variances are equal if

$$W > F_{\alpha, k-1, N-k}$$

where  $F_{\alpha, k-1, N-k}$  is the <u>upper critical value</u> of the <u>F distribution</u> with k-1 and N-k degrees of freedom at a significance level of  $\alpha$ .

In the above formulas for the critical regions, the Handbook follows the convention that  $F_{\alpha}$  is the upper critical value from the F distribution

and  $F_{1-\alpha}$  is the lower critical value. Note that this is the opposite of some texts and software programs.

Levene's Test Example

Levene's test, based on the median, was performed for the <u>GEAR.DAT</u> data set. The data set includes ten measurements of gear diameter for each of ten batches for a total of 100 measurements.

```
H_0: \sigma_1^2 = \dots = \sigma_{10}^2

H_a: \sigma_1^2 \neq \dots \neq \sigma_{10}^2
```

```
Test statistic: W = 1.705910
Degrees of freedom: k-1 = 10-1 = 9

N-k = 100-10 = 90
Significance level: \alpha = 0.05
Critical value (upper tail): F_{\alpha,k-1,N-k} = 1.9855
Critical region: Reject H_0 if F > 1.9855
```

We are testing the hypothesis that the group variances are equal. We fail to reject the null hypothesis at the 0.05 significance level since the value of the Levene test statistic is less than the critical value. We conclude that there is insufficient evidence to claim that the variances are not equal.

Question

Levene's test can be used to answer the following question:

• Is the assumption of equal variances valid?

Related *Techniques*  **Standard Deviation Plot Box Plot Bartlett Test Chi-Square Test Analysis of Variance** 

Software

The Levene test is available in some general purpose statistical software programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEX

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.11. Measures of Skewness and Kurtosis

Skewness and Kurtosis A fundamental task in many statistical analyses is to characterize the *location* and *yariability* of a data set. A further characterization of the data includes skewness and kurtosis.

Skewness is a measure of symmetry, or more precisely, the lack of symmetry. A distribution, or data set, is symmetric if it looks the same to the left and right of the center point.

Kurtosis is a measure of whether the data are peaked or flat relative to a normal distribution. That is, data sets with high kurtosis tend to have a distinct peak near the mean, decline rather rapidly, and have heavy tails. Data sets with low kurtosis tend to have a flat top near the mean rather than a sharp peak. A uniform distribution would be the extreme case.

The <u>histogram</u> is an effective graphical technique for showing both the skewness and kurtosis of data set.

Definition of Skewness

For univariate data  $Y_1, Y_2, ..., Y_N$ , the formula for skewness is:

$$skewness = \frac{\sum_{i=1}^{N}(Y_i - \bar{Y})^3}{(N-1)s^3}$$

where  $\bar{Y}$  is the mean, s is the standard deviation, and N is the number of data points. The skewness for a <u>normal distribution</u> is zero, and any symmetric data should have a skewness near zero. Negative values for the skewness indicate data that are skewed left and positive values for the skewness indicate data that are skewed right. By skewed left, we mean that the left tail is long relative to the right tail. Similarly, skewed right means that the right tail is long relative to the left tail. Some measurements have a lower bound and are skewed right. For example, in reliability studies, failure times cannot be negative.

Definition of Kurtosis

For univariate data  $Y_1, Y_2, ..., Y_N$ , the formula for kurtosis is:

$$kurtosis = \frac{\sum_{i=1}^{N} (Y_i - \bar{Y})^4}{(N-1)s^4}$$

where  $\bar{Y}$  is the mean, s is the standard deviation, and N is the number of data points.

Alternative Definition of Kurtosis The kurtosis for a <u>standard normal distribution</u> is three. For this reason, some sources use the following definition of kurtosis (often referred to as "excess kurtosis"):


$$kurtosis = \frac{\sum_{i=1}^{N} (Y_i - \bar{Y})^4}{(N-1)s^4} - 3$$

This definition is used so that the standard normal distribution has a kurtosis of zero. In addition, with the second definition positive kurtosis indicates a "peaked" distribution and negative kurtosis indicates a "flat" distribution.

Which definition of kurtosis is used is a matter of convention (this handbook uses the original definition). When using software to compute the sample kurtosis, you need to be aware of which convention is being followed. Many sources use the term kurtosis when they are actually computing "excess kurtosis", so it may not always be clear.

Examples

The following example shows histograms for 10,000 random numbers generated from a normal, a double exponential, a Cauchy, and a Weibull distribution.

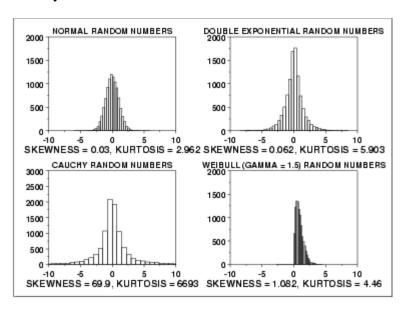

Normal Distribution The first histogram is a sample from a <u>normal distribution</u>. The normal distribution is a symmetric distribution with well-behaved tails. This is indicated by the skewness of 0.03. The kurtosis of 2.96 is near the expected value of 3. The histogram verifies the symmetry.

Double Exponential Distribution The second histogram is a sample from a <u>double exponential</u> <u>distribution</u>. The double exponential is a symmetric distribution. Compared to the normal, it has a stronger peak, more rapid decay, and heavier tails. That is, we would expect a skewness near zero and a kurtosis higher than 3. The skewness is 0.06 and the kurtosis is 5.9.

#### Cauchy Distribution

The third histogram is a sample from a <u>Cauchy distribution</u>.

For better visual comparison with the other data sets, we restricted the histogram of the Cauchy distribution to values between -10 and 10. The full data set for the Cauchy data in fact has a minimum of approximately -29,000 and a maximum of approximately 89,000.

The Cauchy distribution is a symmetric distribution with heavy tails and a single peak at the center of the distribution. Since it is symmetric, we would expect a skewness near zero. Due to the heavier tails, we might expect the kurtosis to be larger than for a normal distribution. In fact the skewness is 69.99 and the kurtosis is 6,693. These extremely high values can be explained by the heavy tails. Just as the mean and standard deviation can be distorted by extreme values in the tails, so too can the skewness and kurtosis measures.

### Weibull Distribution

The fourth histogram is a sample from a Weibull distribution with shape parameter 1.5. The Weibull distribution is a skewed distribution with the amount of skewness depending on the value of the shape parameter. The degree of decay as we move away from the center also depends on the value of the shape parameter. For this data set, the skewness is 1.08 and the kurtosis is 4.46, which indicates moderate skewness and kurtosis.

Dealing with Skewness and Kurtosis

Many classical statistical tests and intervals depend on normality assumptions. Significant skewness and kurtosis clearly indicate that data are not normal. If a data set exhibits significant skewness or kurtosis (as indicated by a histogram or the numerical measures), what can we do about it?

One approach is to apply some type of transformation to try to make the data normal, or more nearly normal. The <u>Box-Cox transformation</u> is a useful technique for trying to normalize a data set. In particular, taking the log or square root of a data set is often useful for data that exhibit moderate right skewness.

Another approach is to use techniques based on distributions other than the normal. For example, in reliability studies, the exponential, Weibull, and lognormal distributions are typically used as a basis for modeling rather than using the normal distribution. The <u>probability plot correlation</u> coefficient plot and the <u>probability plot</u> are useful tools for determining a good distributional model for the data.

Software

The skewness and kurtosis coefficients are available in most general purpose statistical software programs.



HOME

TOOLS & AIDS

SEARCH



## **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.12. Autocorrelation

Purpose: Detect Non-Randomness, Time Series Modeling The autocorrelation ( <u>Box and Jenkins, 1976</u>) function can be used for the following two purposes:

- 1. To detect non-randomness in data.
- 2. To identify an appropriate time series model if the data are not random.

Definition

Given measurements,  $Y_1$ ,  $Y_2$ , ...,  $Y_N$  at time  $X_1$ ,  $X_2$ , ...,  $X_N$ , the lag k autocorrelation function is defined as

$$r_k = \frac{\sum_{i=1}^{N-k} (Y_i - \bar{Y}) (Y_{i+k} - \bar{Y})}{\sum_{i=1}^{N} (Y_i - \bar{Y})^2}$$

Although the time variable, X, is not used in the formula for autocorrelation, the assumption is that the observations are equi-spaced.

Autocorrelation is a correlation coefficient. However, instead of correlation between two different variables, the correlation is between two values of the same variable at times  $X_i$  and  $X_{i+k}$ .

When the autocorrelation is used to detect non-randomness, it is usually only the first (lag 1) autocorrelation that is of interest. When the autocorrelation is used to identify an appropriate time series model, the autocorrelations are usually <u>plotted</u> for many lags.

Autocorrelation Example Lag-one autocorrelations were computed for the the LEW.DAT data set.

lag autocorrelation
0. 1.00
1. -0.31
2. -0.74
3. 0.77
4. 0.21
5. -0.90
6. 0.38
7. 0.63
8. -0.77
9. -0.12
10. 0.82
11. -0.40
12. -0.55
13. 0.73
14. 0.77
15. -0.76

111122222222233333333334444444444444444	0.40 0.48 -0.70 -0.03 0.70 -0.41 0.67 0.00 -0.66 0.39	3
24. 25.	0.00	5
26.	0.42	
27.	0.39	
20. 29.	0.03	
30.	0.63	
31.	-0.42	2
32. 32.	-0.36	)
34.	-0.05	5
35.	-0.60	)
36.	0.43	١
3/. 38	-0.32	1
39.	0.08	
40.	0.58	
41.	-0.45	
42. 43	0.62	)
44.	-0.10	)
45.	0.03 0.63 -0.36 0.64 -0.05 0.32 -0.64 0.58 -0.22 -0.15 0.25 -0.16	
46. 17	0.45	
48.	-0.61	
49	0 14	

### Questions

The autocorrelation function can be used to answer the following questions.

- 1. Was this sample data set generated from a random process?
- 2. Would a non-linear or time series model be a more appropriate model for these data than a simple constant plus error model?

#### *Importance*

Randomness is one of the key <u>assumptions</u> in determining if a univariate statistical process is in control. If the assumptions of constant location and scale, randomness, and fixed distribution are reasonable, then the univariate process can be modeled as:

$$Y_i = A_0 + E_i$$

where  $E_i$  is an error term.

If the randomness assumption is not valid, then a different model needs to be used. This will typically be either a <u>time series model</u> or a <u>non-linear model</u> (with time as the independent variable).

## Related Techniques

Autocorrelation Plot Run Sequence Plot

Lag Plot Runs Test

#### Case Study

The <u>heat flow meter</u> data demonstrate the use of autocorrelation in determining if the data are from a random process.

Software The autocorrelation capability is available in most general

purpose statistical software programs. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

# 1.3.5.13. Runs Test for Detecting Nonrandomness

Purpose: Detect Non-Randomness The runs test (<u>Bradley</u>, <u>1968</u>) can be used to decide if a data set is from a random process.

A run is defined as a series of increasing values or a series of decreasing values. The number of increasing, or decreasing, values is the length of the run. In a random data set, the probability that the (I+1)th value is larger or smaller than the Ith value follows a binomial distribution, which forms the basis of the runs test.

Typical Analysis and Test Statistics The first step in the runs test is to count the number of runs in the data sequence. There are several ways to define runs in the literature, however, in all cases the formulation must produce a dichotomous sequence of values. For example, a series of 20 coin tosses might produce the following sequence of heads (H) and tails (T).

#### HHTTHTHHHHHTHHTTTTTHH

The number of runs for this series is nine. There are 11 heads and 9 tails in the sequence.

Definition

We will code values above the median as positive and values below the median as negative. A run is defined as a series of consecutive positive (or negative) values. The runs test is defined as:

 $H_0$ : the sequence was produced in a random manner

H<sub>a</sub>: the sequence was not produced in a random

manner

Test The test statistic is

Statistic:

$$Z=rac{R-ar{R}}{s_R}$$

where R is the observed number of runs,  $\overline{R}$ , is the expected number of runs, and  $s_R$  is the standard deviation of the number of runs. The values of  $\overline{R}$ 

and  $s_R$  are computed as follows:

$$ar{R} = rac{2n_1n_2}{n_1 + n_2} + 1$$

$$s_R^2 = rac{2n_1n_2(2n_1n_2-n_1-n_2)}{(n_1+n_2)^2(n_1+n_2-1)}$$

where  $n_1$  and  $n_2$  are the number of positive and negative values in the series.

Significance  $\alpha$ 

Level:

Critical

The runs test rejects the null hypothesis if

Region:

$$|Z| > Z_{1-\alpha/2}$$

For a large-sample runs test (where  $n_1 > 10$  and  $n_2 > 10$ ), the test statistic is compared to a <u>standard normal table</u>. That is, at the 5 % significance level, a test statistic with an absolute value greater than 1.96 indicates non-randomness. For a small-sample runs test, there are tables to determine critical values that depend on values of  $n_1$  and  $n_2$  (<u>Mendenhall</u>, 1982).

### Runs Test Example

A runs test was performed for 200 measurements of beam deflection contained in the <u>LEW.DAT</u> data set.

 $\mbox{H}_0\colon$  the sequence was produced in a random manner  $\mbox{H}_a\colon$  the sequence was not produced in a random manner

Test statistic: Z=2.6938 Significance level:  $\alpha=0.05$  Critical value (upper tail):  $Z_{1-\alpha/2}=1.96$  Critical region: Reject  $H_0$  if |Z|>1.96

Since the test statistic is greater than the critical value, we conclude that the data are not random at the 0.05 significance level.

#### Question

The runs test can be used to answer the following question:

• Were these sample data generated from a random process?

#### *Importance*

Randomness is one of the key <u>assumptions</u> in determining if a univariate statistical process is in control. If the assumptions of constant location and scale, randomness, and fixed distribution

are reasonable, then the univariate process can be modeled as:

$$Y_i = A_0 + E_i$$

where  $E_i$  is an error term.

If the randomness assumption is not valid, then a different model needs to be used. This will typically be either a times series model or a non-linear model (with time as the independent variable).

Related **Techniques**  **Autocorrelation** Run Sequence Plot

Lag Plot

Case Study

Heat flow meter data

*Software* 

Most general purpose statistical software programs support a runs test. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

1. Exploratory Data Analysis

1.3. EDA Techniques

1.3.5. Quantitative Techniques

# 1.3.5.14. Anderson-Darling Test

Purpose: Test for Distributional Adequacy

The Anderson-Darling test (Stephens, 1974) is used to test if a sample of data came from a population with a specific distribution. It is a modification of the Kolmogorov-Smirnov (K-S) test and gives more weight to the tails than does the K-S test. The K-S test is distribution free in the sense that the critical values do not depend on the specific distribution being tested. The Anderson-Darling test makes use of the specific distribution in calculating critical values. This has the advantage of allowing a more sensitive test and the disadvantage that critical values must be calculated for each distribution. Currently, tables of critical values are available for the normal, lognormal, exponential, Weibull, extreme value type I, and logistic distributions. We do not provide the tables of critical values in this Handbook (see <u>Stephens 1974, 1976, 1977, and 1979</u>) since this test is usually applied with a statistical software program that will print the relevant critical values.

BACK NEXT

The Anderson-Darling test is an alternative to the <u>chi-square</u> and Kolmogorov-Smirnov goodness-of-fit tests.

Definition

The Anderson-Darling test is defined as:

 $H_0$ : The data follow a specified distribution.

H<sub>a</sub>: The data do not follow the specified distribution

Test The Anderson-Darling test statistic is defined as

Statistic:

$$A^2 = -N - S$$

where

$$S = \sum_{i=1}^{N} rac{(2i-1)}{N} [\ln F(Y_i) + \ln (1 - F(Y_{N+1-i}))]$$

**F** is the <u>cumulative distribution function</u> of the specified distribution. Note that the  $Y_i$  are the *ordered* 

Significance \( \alpha \)

Level:

Critical The critical values for the Anderson-Darling test are Region: dependent on the specific distribution that is being

tested. Tabulated values and formulas have been published (Stephens, 1974, 1976, 1977, 1979) for a few specific distributions (normal, lognormal, exponential, Weibull, logistic, extreme value type 1). The test is a one-sided test and the hypothesis that the distribution is of a specific form is rejected if the test statistic, A, is greater than the critical value.

Note that for a given distribution, the Anderson-Darling statistic may be multiplied by a constant (which usually depends on the sample size, n). These constants are given in the various papers by Stephens. In the sample output below, the test statistic values are adjusted. Also, be aware that different constants (and therefore critical values) have been published. You just need to be aware of what constant was used for a given set of critical values (the needed constant is typically given with the critical values).

# Sample Output

We generated 1,000 random numbers for normal, double exponential, Cauchy, and lognormal distributions. In all four cases, the Anderson-Darling test was applied to test for a normal distribution.

The normal random numbers were stored in the variable Y1, the double exponential random numbers were stored in the variable Y2, the Cauchy random numbers were stored in the variable Y3, and the lognormal random numbers were stored in the variable Y4.

Distribution Deviation	Mean	Standard
Normal (Y1)  1.001816 Double Exponential (Y2)  1.321627 Cauchy (Y3)  35.130590 Lognormal (Y4)  1.719969	0.004360 0.020349 1.503854 1.518372	
${\rm H_0}\colon$ the data are normally ${\rm H_a}\colon$ the data are not normal		ced
Y1 adjusted test statistic: Y2 adjusted test statistic: Y3 adjusted test statistic: Y4 adjusted test statistic:	$A^2 = 5.84$ $A^2 = 288.78$ $A^2 = 83.39$	192 363
Significance level: $\alpha$ = 0. Critical value: 0.752 Critical region: Reject $H_0$		52

When the data were generated using a normal distribution, the test statistic was small and the hypothesis of normality was not rejected. When the data were generated using the double exponential, Cauchy, and lognormal distributions, the test statistics were large, and the hypothesis of an underlying normal distribution was

rejected at the 0.05 significance level.

Questions

The Anderson-Darling test can be used to answer the following questions:

- Are the data from a normal distribution?
- Are the data from a log-normal distribution?
- Are the data from a Weibull distribution?
- Are the data from an exponential distribution?
- Are the data from a logistic distribution?

*Importance* 

Many statistical tests and procedures are based on specific distributional assumptions. The assumption of normality is particularly common in classical statistical tests. Much reliability modeling is based on the assumption that the data follow a Weibull distribution.

There are many non-parametric and robust techniques that do not make strong distributional assumptions. However, techniques based on specific distributional assumptions are in general more powerful than non-parametric and robust techniques. Therefore, if the distributional assumptions can be validated, they are generally preferred.

Related *Techniques*  Chi-Square goodness-of-fit Test Kolmogorov-Smirnov Test **Shapiro-Wilk Normality Test Probability Plot** 

Probability Plot Correlation Coefficient Plot

Case Study

<u>Josephson junction cryothermometry</u> case study.

Software

The Anderson-Darling goodness-of-fit test is available in some general purpose statistical software programs. Both <u>Dataplot code</u> and R code can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

# 1.3.5.15. Chi-Square Goodness-of-Fit Test

Purpose: Test for distributional adequacy The chi-square test (<u>Snedecor and Cochran, 1989</u>) is used to test if a sample of data came from a population with a specific distribution.

An attractive feature of the chi-square goodness-of-fit test is that it can be applied to any univariate distribution for which you can calculate the <u>cumulative distribution</u> function. The chi-square goodness-of-fit test is applied to binned data (i.e., data put into classes). This is actually not a restriction since for non-binned data you can simply calculate a histogram or frequency table before generating the chi-square test. However, the value of the chi-square test statistic are dependent on how the data is binned. Another disadvantage of the chi-square test is that it requires a sufficient sample size in order for the chi-square approximation to be valid.

The chi-square test is an alternative to the <u>Anderson-Darling</u> and <u>Kolmogorov-Smirnov</u> goodness-of-fit tests. The chi-square goodness-of-fit test can be applied to discrete distributions such as the <u>binomial</u> and the <u>Poisson</u>. The Kolmogorov-Smirnov and Anderson-Darling tests are restricted to continuous distributions.

Additional discussion of the chi-square goodness-of-fit test is contained in the <u>product and process comparisons</u> chapter (chapter 7).

Definition The chi-square test is defined for the hypothesis:

 $H_0$ : The data follow a specified distribution.

H<sub>a</sub>: The data do not follow the specified

distribution.

Test For the chi-square goodness-of-fit

Statistic: computation, the data are divided into k bins

and the test statistic is defined as

$$\chi^2 = \sum_{i=1}^k (O_i - E_i)^2 / E_i$$

where  $O_i$  is the observed frequency for bin i and  $E_i$  is the expected frequency for bin i. The expected frequency is calculated by

$$E_i = N(F(Y_u) - F(Y_l))$$

where F is the <u>cumulative Distribution</u> function for the distribution being tested,  $Y_u$  is the upper limit for class i,  $Y_l$  is the lower limit for class i, and N is the sample size.

This test is sensitive to the choice of bins. There is no optimal choice for the bin width (since the optimal bin width depends on the distribution). Most reasonable choices should produce similar, but not identical, results. For the chi-square approximation to be valid, the expected frequency should be at least 5. This test is not valid for small samples, and if some of the counts are less than five, you may need to combine some bins in the tails.

Significance  $\alpha$ .

Level:

Critical Region:

The test statistic follows, approximately, a chi-square distribution with (k - c) degrees of freedom where k is the number of non-empty cells and c = the number of estimated parameters (including location and scale parameters and shape parameters) for the distribution + 1. For example, for a 3-parameter Weibull distribution, c = 4.

Therefore, the hypothesis that the data are from a population with the specified distribution is rejected if

$$\chi^2>\chi^2_{1-\alpha,\,k-c}$$

where  $\chi^2_{1-\alpha, k-c}$  is the chi-square critical value with k - c degrees of freedom and significance level  $\alpha$ .

Chi-Square Test Example We generated 1,000 random numbers for normal, double exponential, t with 3 degrees of freedom, and lognormal distributions. In all cases, a chi-square test with k = 32 bins was applied to test for normally distributed data. Because the normal distribution has two parameters, c = 2 + 1 = 3

The normal random numbers were stored in the variable Y1, the double exponential random numbers were stored in the variable Y2, the *t* random numbers were stored in the

variable Y3, and the lognormal random numbers were stored in the variable Y4.

```
H<sub>0</sub>: the data are normally distributed H<sub>a</sub>: the data are not normally distributed Y1 Test statistic: X^2 = 32.256 Y2 Test statistic: X^2 = 91.776 Y3 Test statistic: X^2 = 101.488 Y4 Test statistic: X^2 = 1085.104 Significance level: \alpha = 0.05 Degrees of freedom: k - c = 32 - 3 = 29 Critical value: X^2_{1-\alpha}, x = 42.557 Critical region: Reject H<sub>0</sub> if X^2 > 42.557
```

As we would hope, the chi-square test fails to reject the null hypothesis for the normally distributed data set and rejects the null hypothesis for the three non-normal data sets.

Questions

The chi-square test can be used to answer the following types of questions:

- Are the data from a normal distribution?
- Are the data from a log-normal distribution?
- Are the data from a Weibull distribution?
- Are the data from an exponential distribution?
- Are the data from a logistic distribution?
- Are the data from a binomial distribution?

*Importance* 

Many statistical tests and procedures are based on specific distributional <u>assumptions</u>. The assumption of normality is particularly common in classical statistical tests. Much reliability modeling is based on the assumption that the distribution of the data follows a Weibull distribution.

There are many non-parametric and robust techniques that are not based on strong distributional assumptions. By non-parametric, we mean a technique, such as the sign test, that is not based on a specific distributional assumption. By robust, we mean a statistical technique that performs well under a wide range of distributional assumptions. However, techniques based on specific distributional assumptions are in general more powerful than these non-parametric and robust techniques. By power, we mean the ability to detect a difference when that difference actually exists. Therefore, if the distributional assumption can be confirmed, the parametric techniques are generally preferred.

If you are using a technique that makes a normality (or some other type of distributional) assumption, it is important to confirm that this assumption is in fact justified. If it is, the more powerful parametric techniques can be used. If the distributional assumption is not justified, a non-parametric or robust technique may be required.

Related Anderson-Darling Goodness-of-Fit Test

Kolmogorov-Smirnov Test **Techniques** 

Shapiro-Wilk Normality Test

**Probability Plots** 

Probability Plot Correlation Coefficient Plot

*Software* Some general purpose statistical software programs provide

> a chi-square goodness-of-fit test for at least some of the common distributions. Both Dataplot code and R code can

be used to generate the analyses in this section.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.16. Kolmogorov-Smirnov Goodness-of-Fit Test


Purpose: Test for Distributional Adequacy The Kolmogorov-Smirnov test (<u>Chakravart, Laha, and Roy, 1967</u>) is used to decide if a sample comes from a population with a specific distribution.

The Kolmogorov-Smirnov (K-S) test is based on the empirical distribution function (ECDF). Given *N* ordered data points  $Y_I$ ,  $Y_2$ , ...,  $Y_N$ , the ECDF is defined as

$$E_N=n(i)/N$$

where n(i) is the number of points less than  $Y_i$  and the  $Y_i$  are ordered from smallest to largest value. This is a step function that increases by 1/N at the value of each ordered data point.

The graph below is a plot of the empirical distribution function with a normal cumulative distribution function for 100 normal random numbers. The K-S test is based on the maximum distance between these two curves.

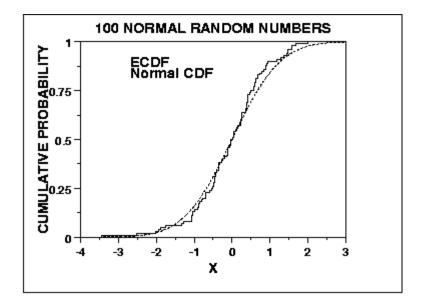

Characteristics and Limitations of

An attractive feature of this test is that the distribution of the K-S test statistic itself does not depend on the underlying cumulative distribution function being tested. Another advantage is that it is

the K-S Test

an exact test (the chi-square goodness-of-fit test depends on an adequate sample size for the approximations to be valid). Despite these advantages, the K-S test has several important limitations:

- 1. It only applies to continuous distributions.
- 2. It tends to be more sensitive near the center of the distribution than at the tails.
- 3. Perhaps the most serious limitation is that the distribution must be fully specified. That is, if location, scale, and shape parameters are estimated from the data, the critical region of the K-S test is no longer valid. It typically must be determined by simulation.

Due to limitations 2 and 3 above, many analysts prefer to use the Anderson-Darling goodness-of-fit test. However, the Anderson-Darling test is only available for a few specific distributions.

Definition

The Kolmogorov-Smirnov test is defined by:

H<sub>0</sub>: The data follow a specified distribution

H<sub>a</sub>: The data do not follow the specified distribution

Test The Kolmogorov-Smirnov test statistic is defined as Statistic:

$$D = \max_{1 \leq i \leq N} \left( F(Y_i) - \frac{i-1}{N}, \frac{i}{N} - F(Y_i) \right)$$

where *F* is the theoretical cumulative distribution of the distribution being tested which must be a continuous distribution (i.e., no discrete distributions such as the binomial or Poisson), and it must be fully specified (i.e., the <u>location</u>, <u>scale</u>, and <u>shape</u> parameters cannot be estimated from the data).

Significance  $\alpha$ .

Level:

Critical Values:

The hypothesis regarding the distributional form is rejected if the test statistic, D, is greater than the critical value obtained from a table. There are several variations of these tables in the literature that use somewhat different scalings for the K-S test statistic and critical regions. These alternative formulations should be equivalent, but it is necessary to ensure that the test statistic is calculated in a way that is consistent with how the critical values were tabulated.

We do not provide the K-S tables in the Handbook since software programs that perform a K-S test will provide the relevant critical values.

Technical Note

Previous editions of e-Handbook gave the following formula for the computation of the Kolmogorov-Smirnov goodness of fit statistic:

$$D = \max_{1 \leq i \leq N} |F(Y_i) - \frac{i}{N}|$$

This formula is in fact not correct. Note that this formula can be rewritten as:

$$D = \max_{1 \leq i \leq N} \left( F(Y_i) - rac{i}{N}, rac{i}{N} - F(Y_i) 
ight)$$

This form makes it clear that an upper bound on the difference between these two formulas is i/N. For actual data, the difference is likely to be less than the upper bound.

For example, for N = 20, the upper bound on the difference between these two formulas is 0.05 (for comparison, the 5% critical value is 0.294). For N = 100, the upper bound is 0.001. In practice, if you have moderate to large sample sizes (say  $N \ge 50$ ), these formulas are essentially equivalent.

Kolmogorov-Smirnov Test Example We generated 1,000 random numbers for normal, double exponential, *t* with 3 degrees of freedom, and lognormal distributions. In all cases, the Kolmogorov-Smirnov test was applied to test for a normal distribution.

The normal random numbers were stored in the variable Y1, the double exponential random numbers were stored in the variable Y2, the *t* random numbers were stored in the variable Y3, and the lognormal random numbers were stored in the variable Y4.

```
\rm H_0\colon the data are normally distributed \rm H_a\colon the data are not normally distributed Y1 test statistic: D=0.0241492 Y2 test statistic: D=0.0514086 Y3 test statistic: D=0.0611935 Y4 test statistic: D=0.5354889 Significance level: \alpha=0.05 Critical value: 0.04301 Critical region: Reject \rm H_0 if D>0.04301
```

As expected, the null hypothesis is not rejected for the normally distributed data, but is rejected for the remaining three data sets that are not normally distributed.

Questions

The Kolmogorov-Smirnov test can be used to answer the following types of questions:

- Are the data from a normal distribution?
- Are the data from a log-normal distribution?
- Are the data from a Weibull distribution?
- Are the data from an exponential distribution?
- Are the data from a logistic distribution?

*Importance* 

Many statistical tests and procedures are based on specific distributional <u>assumptions</u>. The assumption of normality is particularly common in classical statistical tests. Much reliability modeling is based on the assumption that the data follow a Weibull distribution.

There are many non-parametric and robust techniques that are not based on strong distributional assumptions. By non-parametric, we mean a technique, such as the sign test, that is not based on a specific distributional assumption. By robust, we mean a statistical technique that performs well under a wide range of distributional assumptions. However, techniques based on specific distributional assumptions are in general more powerful than these non-parametric and robust techniques. By power, we mean the ability to detect a difference when that difference actually exists. Therefore, if the distributional assumptions can be confirmed, the parametric techniques are generally preferred.

If you are using a technique that makes a normality (or some other type of distributional) assumption, it is important to confirm that this assumption is in fact justified. If it is, the more powerful parametric techniques can be used. If the distributional assumption is not justified, using a non-parametric or robust technique may be required.

Related *Techniques*  Anderson-Darling goodness-of-fit Test

Chi-Square goodness-of-fit Test Shapiro-Wilk Normality Test

**Probability Plots** 

Probability Plot Correlation Coefficient Plot

Software

Some general purpose statistical software programs support the Kolmogorov-Smirnov goodness-of-fit test, at least for the more common distributions. Both <u>Dataplot code</u> and <u>R code</u> can be used to generate the analyses in this section.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## 1.3.5.17. Detection of Outliers

#### Introduction

An outlier is an observation that appears to deviate markedly from other observations in the sample.

Identification of potential outliers is important for the following reasons.

- 1. An outlier may indicate bad data. For example, the data may have been coded incorrectly or an experiment may not have been run correctly. If it can be determined that an outlying point is in fact erroneous, then the outlying value should be deleted from the analysis (or corrected if possible).
- 2. In some cases, it may not be possible to determine if an outlying point is bad data. Outliers may be due to random variation or may indicate something scientifically interesting. In any event, we typically do not want to simply delete the outlying observation. However, if the data contains significant outliers, we may need to consider the use of robust statistical techniques.

Labeling, Accomodation, Identification <u>Iglewicz and Hoaglin</u> distinguish the three following issues with regards to outliers.

- 1. outlier labeling flag potential outliers for further investigation (i.e., are the potential outliers erroneous data, indicative of an inappropriate distributional model, and so on).
- 2. outlier accomodation use robust statistical techniques that will not be unduly affected by outliers. That is, if we cannot determine that potential outliers are erroneous observations, do we need modify our statistical analysis to more appropriately account for these observations?
- 3. outlier identification formally test whether observations are outliers.

This section focuses on the labeling and identification

issues.

### Normality Assumption

Identifying an observation as an outlier depends on the underlying distribution of the data. In this section, we limit the discussion to univariate data sets that are assumed to follow an approximately normal distribution. If the normality assumption for the data being tested is not valid, then a determination that there is an outlier may in fact be due to the non-normality of the data rather than the prescence of an outlier.

For this reason, it is recommended that you generate a normal probability plot of the data before applying an outlier test. Although you can also perform formal tests for normality, the prescence of one or more outliers may cause the tests to reject normality when it is in fact a reasonable assumption for applying the outlier test.

In addition to checking the normality assumption, the lower and upper tails of the normal probability plot can be a useful graphical technique for identifying potential outliers. In particular, the plot can help determine whether we need to check for a single outlier or whether we need to check for multiple outliers.

The box plot and the histogram can also be useful graphical tools in checking the normality assumption and in identifying potential outliers.

## Single Versus Multiple Outliers

Some outlier tests are designed to detect the prescence of a single outlier while other tests are designed to detect the prescence of multiple outliers. It is not appropriate to apply a test for a single outlier sequentially in order to detect multiple outliers.

In addition, some tests that detect multiple outliers may require that you specify the number of suspected outliers exactly.

# Masking and Swamping

Masking can occur when we specify too few outliers in the test. For example, if we are testing for a single outlier when there are in fact two (or more) outliers, these additional outliers may influence the value of the test statistic enough so that no points are declared as outliers.

On the other hand, swamping can occur when we specify too many outliers in the test. For example, if we are testing for two or more outliers when there is in fact only a single outlier, both points may be declared outliers (many tests will declare either all or none of the tested points as outliers).

Due to the possibility of masking and swamping, it is useful to complement formal outlier tests with graphical methods. Graphics can often help identify cases where masking or swamping may be an issue. Swamping and masking are also the reason that many tests require that the exact number of outliers being tested must be specified.

Also, masking is one reason that trying to apply a single outlier test sequentially can fail. For example, if there are multiple outliers, masking may cause the outlier test for the first outlier to return a conclusion of no outliers (and so the testing for any additional outliers is not performed).

Z-Scores and Modified Z-Scores The Z-score of an observation is defined as

$$Z_i = rac{Y_i - ar{Y}}{s}$$

with  $\bar{\mathbf{Y}}$  and s denoting the sample mean and sample standard deviation, respectively. In other words, data is given in units of how many standard deviations it is from the mean.

Although it is common practice to use Z-scores to identify possible outliers, this can be misleading (partiucarly for small sample sizes) due to the fact that the maximum Z-score is at most  $(n-1)/\sqrt{n}$ .

<u>Iglewicz and Hoaglin</u> recommend using the modified Z-score

$$M_i = \frac{0.6745(x_i - \tilde{x})}{\text{MAD}}$$

with MAD denoting the <u>median absolute deviation</u> and  $\tilde{x}$  denoting the median.

These authors recommend that modified Z-scores with an absolute value of greater than 3.5 be labeled as potential outliers.

Formal
Outlier Tests

A number of formal outlier tests have proposed in the literature. These can be grouped by the following characteristics:

- What is the distributional model for the data? We restrict our discussion to tests that assume the data follow an approximately normal distribution.
- Is the test designed for a single outlier or is it designed for multiple outliers?
- If the test is designed for multiple outliers, does the number of outliers need to be specified exactly or can we specify an upper bound for the number of outliers?

The following are a few of the more commonly used outlier tests for normally distributed data. This list is not exhaustive (a large number of outlier tests have been proposed in the literature). The tests given here are essentially based on the criterion of "distance from the mean". This is not the only criterion that could be used. For example, the Dixon test, which is not discussed here, is based a value being too large (or small) compared to its nearest neighbor.

- 1. <u>Grubbs' Test</u> this is the recommended test when testing for a single outlier.
- 2. <u>Tietjen-Moore Test</u> this is a generalization of the Grubbs' test to the case of more than one outlier. It has the limitation that the number of outliers must be specified exactly.
- 3. Generalized Extreme Studentized Deviate (ESD)

  Test this test requires only an upper bound on the suspected number of outliers and is the recommended test when the exact number of outliers is not known.

# Lognormal Distribution

The tests discussed here are specifically based on the assumption that the data follow an approximately normal disribution. If your data follow an approximately lognormal distribution, you can transform the data to normality by taking the logarithms of the data and then applying the outlier tests discussed here.

# Further Information

Iglewicz and Hoaglin provide an extensive discussion of the outlier tests given above (as well as some not given above) and also give a good tutorial on the subject of outliers. Barnett and Lewis provide a book length treatment of the subject.

In addition to discussing additional tests for data that follow an approximately normal distribution, these sources also discuss the case where the data are not normally distributed.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques

## **1.3.5.18.** Yates Algorithm

Purpose: Estimate Factor Effects in a 2-Level Factorial Design <u>Full factorial</u> and <u>fractional factorial</u> designs are common in <u>designed experiments</u> for engineering and scientific applications.

In these designs, each factor is assigned two levels. These are typically called the low and high levels. For computational purposes, the factors are scaled so that the low level is assigned a value of -1 and the high level is assigned a value of +1. These are also commonly referred to as "-" and "+".

A full factorial design contains all possible combinations of low/high levels for all the factors. A fractional factorial design contains a carefully chosen subset of these combinations. The criterion for <u>choosing the subsets</u> is discussed in detail in the process improvement chapter.

The Yates algorithm exploits the special structure of these designs to generate least squares estimates for factor effects for all factors and all relevant interactions.

The mathematical details of the Yates algorithm are given in chapter 10 of Box, Hunter, and Hunter (1978). Natrella (1963) also provides a procedure for testing the significance of effect estimates.

The effect estimates are typically complemented by a number of graphical techniques such as the <u>DOE mean</u> plot and the <u>DOE contour plot</u> ("DOE" represents "design of experiments"). These are demonstrated in the <u>eddy current</u> case study.

Yates Order

Before performing the Yates algorithm, the data should be arranged in "Yates order". That is, given k factors, the kth column consists of  $2^{k-1}$  minus signs (i.e., the low level of the factor) followed by  $2^{k-1}$  plus signs (i.e., the high level of the factor). For example, for a full factorial design with three factors, the design matrix is

+ - -

+ + -- - + + - + - + +

Determining the Yates order for fractional factorial designs requires knowledge of the <u>confounding structure</u> of the fractional factorial design.

Yates Algorithm The Yates algorithm is demonstrated for the <u>eddy current</u> data set. The data set contains eight measurements from a two-level, full factorial design with three factors. The purpose of the experiment is to identify factors that have the most effect on eddy current measurements.

In the "Effect" column, we list the main effects and interactions from our factorial experiment in standard order. In the "Response" column, we list the measurement results from our experiment in Yates order.

Effect Estimate	Response	Col 1	Col 2	Col 3	
Mean 2.65875	1.70	6.27	10.21	21.27	
X1 1.55125	4.57	3.94	11.06	12.41	
X2 0.43375	0.55	6.10	5.71	-3.47	-
X1*X2 0.06375	3.39	4.96	6.70	0.51	
X3 0.10625	1.51	2.87	-2.33	0.85	
X1*X3 0.12375	4.59	2.84	-1.14	0.99	
X2*X3 0 0.14875	0.67	3.08	-0.03	1.19	
	4.29	3.62	0.54	0.57	
	sponses: uared resp uared Col		21.27 77.7707 622.1656		

The first four values in Col 1 are obtained by adding adjacent pairs of responses, for example 4.57 + 1.70 = 6.27, and 3.39 + 0.55 = 3.94. The second four values in Col 1 are obtained by subtracting the same adjacent pairs of responses, for example, 4.57 - 1.70 = 2.87, and 3.39 - 0.55 = 2.84. The values in Col 2 are calculated in the same way, except that we are adding and subtracting adjacent values from Col 1. Col 3 is computed using adjacent values from Col 2. Finally, we obtain the "Estimate" column by dividing the values in Col 3 by the total number of responses, 8.

We can check our calculations by making sure that the first value in Col 3 (21.27) is the sum of all the responses. In addition, the sum-of-squared responses (77.7707) should equal the sum-of-squared Col 3 values divided by 8 (622.1656/8 = 77.7707).

Practical Considerations The Yates algorithm provides a convenient method for computing effect estimates; however, the same information is easily obtained from statistical software using either an analysis of variance or regression procedure. The methods for analyzing data from a designed experiment are discussed more fully in the chapter on <a href="Process Improvement">Process Improvement</a>.

Graphical Presentation The following plots may be useful to complement the quantitative information from the Yates algorithm.

- 1. Ordered data plot
- 2. Ordered absolute effects plot
- 3. Cumulative residual standard deviation plot

Questions

The Yates algorithm can be used to answer the following question.

1. What is the estimated effect of a factor on the response?

Related Techniques Multi-factor analysis of variance

DOE mean plot

**Block** plot

**DOE** contour plot

Case Study

The analysis of a full factorial design is demonstrated in

the eddy current case study.

*Software* 

All statistical software packages are capable of estimating effects using an analysis of variance or least squares regression procedure.



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques
- 1.3.5.18. Yates Algorithm

# **1.3.5.18.1.** Defining Models and Prediction Equations

For
Orthogonal
Designs,
Parameter
Estimates
Don't
Change as
Additional
Terms Are
Added

In most cases of least-squares fitting, the model coefficients for previously added terms change depending on what was successively added. For example, the X1 coefficient might change depending on whether or not an X2 term was included in the model. This is **not** the case when the design is orthogonal, as is a 2<sup>3</sup> full factorial design. For orthogonal designs, the estimates for the previously included terms do not change as additional terms are added. This means the ranked list of parameter estimates are the least-squares coefficient estimates for progressively more complicated models.

Example Prediction Equation

We use the parameter estimates derived from a least-squares analysis for the <u>eddy current</u> data set to create an example prediction equation.

Parameter	Estimate
Mean	2.65875
X1	1.55125
X2	-0.43375
X1*X2	0.06375
Х3	0.10625
X1*X3	0.12375
X2*X3	0.14875
X1*X2*X3	0 07125

A prediction equation predicts a value of the reponse variable for given values of the factors. The equation we select can include all the factors shown above, or it can include a subset of the factors. For example, one possible prediction equation using only two factors, X1 and X2, is:

$$\hat{Y} = 2.65875 + 1.55125 \cdot X_1 - 0.43375 \cdot X_2$$

The least-squares parameter estimates in the prediction equation reflect the change in response for a one-unit change in the factor value. To obtain "full" effect estimates (as computed using the Yates algorithm) for the change in factor levels from -1 to +1, the effect estimates (except for the intercept) would be multiplied by two.

Remember that the Yates algorithm is just a convenient

method for computing effects, any statistical software package with least-squares regression capabilities will produce the same effects as well as many other useful analyses.

## Model Selection

We want to select the most appropriate model for our data while balancing the following two goals.

- 1. We want the model to include all important factors.
- 2. We want the model to be parsimonious. That is, the model should be as simple as possible.

Note that the residual standard deviation alone is insufficient for determining the most appropriate model as it will always be decreased by adding additional factors. The next section describes a number of approaches for determining which factors (and interactions) to include in the model.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.5. Quantitative Techniques
- 1.3.5.18. Yates Algorithm

# **1.3.5.18.2. Important Factors**

Identify
Important
Factors

We want to select the most appropriate model to represent our data. This requires balancing the following two goals.

- 1. We want the model to include all important factors.
- 2. We want the model to be parsimonious. That is, the model should be as simple as possible.

In short, we want our model to include all the important factors and interactions and to omit the unimportant factors and interactions.

Seven criteria are utilized to define important factors. These seven criteria are not all equally important, nor will they yield identical subsets, in which case a consensus subset or a weighted consensus subset must be extracted. In practice, some of these criteria may not apply in all situations.

These criteria will be examined in the context of the <u>eddy current</u> data set. The parameter estimates computed using least-squares analysis are shown below.

Parameter	Estimate
Mean	2.65875
X1	1.55125
X2	-0.43375
X1*X2	0.06375
X3	0.10625
X1*X3	0.12375
X2*X3	0.14875
X1*X2*X3	0.07125

In practice, not all of these criteria will be used with every analysis (and some analysts may have additional criteria). These critierion are given as useful guidelines. Most analysts will focus on those criteria that they find most useful.

Criteria for Including Terms in the Model The seven criteria that we can use in determining whether to keep a factor in the model can be summarized as follows.

- 1. Parameters: Engineering Significance
- 2. Parameters: Order of Magnitude
- 3. Parameters: Statistical Significance
- 4. Parameters: Probability Plots
- 5. Effects: Youden Plot
- 6. Residual Standard Deviation: Engineering Significance
- 7. Residual Standard Deviation: Statistical Significance

The first four criteria focus on parameter estimates with three numeric criteria and one

graphical criteria. The fifth criteria focuses on effects, which are twice the parameter estimates. The last two criteria focus on the residual standard deviation of the model. We discuss each of these seven criteria in detail in the sections that following.

Parameters: Engineering Significance The minimum engineering significant difference is defined as

$$|\hat{\beta}_i| > \Delta$$

where  $|\hat{\beta}_i|$  is the absolute value of the parameter estimate and  $\Delta$  is the minimum engineering significant difference.

That is, declare a factor as "important" if the parameter estimate is greater than some a priori declared engineering difference. This implies that the engineering staff have in fact stated what a minimum difference will be. Oftentimes this is not the case. In the absence of an a priori difference, a good rough rule for the minimum engineering significant  $\Delta$  is to keep only those factors whose parameter estimate is greater than, say, 10% of the current production average. In this case, let's say that the average detector has a sensitivity of 2.5 ohms. This would suggest that we would declare all factors whose parameter is greater than 10 % of 2.5 ohms = 0.25 ohm to be significant (from an engineering point of view).

Based on this minimum engineering significant difference criterion, we conclude that we should keep two terms: X1 and X2.

Parameters: Order of Magnitude The order of magnitude criterion is defined as

$$|\hat{\beta}_i| < 0.10 * max |\hat{\beta}_i|$$

That is, exclude any factor that is less than 10 % of the maximum parameter size. We may or may not keep the other factors. This criterion is neither engineering nor statistical, but it does offer some additional numerical insight. For the current example, the largest parameter is from X1 (1.55125 ohms), and so 10 % of that is 0.155 ohms, which suggests keeping all factors whose parameters exceed 0.155 ohms.

Based on the order-of-magnitude criterion, we thus conclude that we should keep two terms: X1 and X2. A third term, X2\*X3 (0.14875), is just slightly under the cutoff level, so we may consider keeping it based on the other criterion.

Parameters: Statistical Significance

Statistical significance is defined as

$$|\hat{eta}_i| > 2 ext{ s.e.}(\hat{eta}_i)$$

That is, declare a factor as important if its parameter is more than 2 standard deviations away from 0 (0, by definition, meaning "no effect").

The "2" comes from normal theory (more specifically, a value of 1.96 yields a 95 % confidence interval). More precise values would come from *t*-distribution theory.

The difficulty with this is that in order to invoke this criterion we need the standard deviation,  $\sigma$ , of an observation. This is problematic because

- 1. the engineer may not know  $\sigma$ ;
- 2. the experiment might not have replication, and so a model-free estimate of  $\sigma$  is not obtainable;

3. obtaining an estimate of  $\sigma$  by assuming the sometimes- employed assumption of ignoring 3-term interactions and higher may be incorrect from an engineering point of view.

For the eddy current example:

- 1. the engineer did **not** know  $\sigma$ ;
- 2. the design (a  $2^3$  full factorial) did **not** have replication;
- 3. ignoring 3-term interactions and higher interactions leads to an estimate of  $\sigma$  based on omitting only a single term: the X1\*X2\*X3 interaction.

For the eddy current example, if one assumes that the 3-term interaction is nil and hence represents a single drawing from a population centered at zero, then an estimate of the standard deviation of a parameter is simply the estimate of the 3-factor interaction (0.07125). Two standard deviations is thus 0.1425. For this example, the rule is thus to keep all  $|\hat{\beta}_i| > 0.1425$ .

This results in keeping three terms: X1 (1.55125), X2 (-0.43375), and X1\*X2 (0.14875).


Parameters: Probability Plots <u>Probability plots</u> can be used in the following manner.

- 1. Normal Probability Plot: Keep a factor as "important" if it is well off the line through zero on a normal probability plot of the parameter estimates.
- 2. Half-Normal Probability Plot: Keep a factor as "important" if it is well off the line near zero on a half-normal probability plot of the absolute value of parameter estimates.

Both of these methods are based on the fact that the least-squares estimates of parameters for these two-level orthogonal designs are simply half the difference of averages and so the central limit theorem, loosely applied, suggests that (if no factor were important) the parameter estimates should have approximately a normal distribution with mean zero and the absolute value of the estimates should have a half-normal distribution.

Since the half-normal probability plot is only concerned with parmeter magnitudes as opposed to signed parameters (which are subject to the vagaries of how the initial factor codings +1 and -1 were assigned), the half-normal probability plot is preferred by some over the normal probability plot.


Normal Probablity Plot of Parameters The following normal probability plot shows the parameter estimates for the eddy current data.

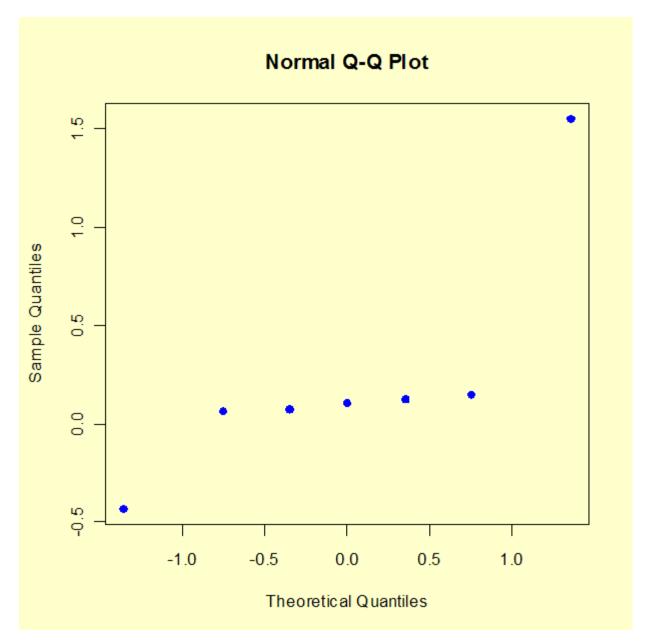

For the example at hand, the probability plot clearly shows two factors (X1 and X2) displaced off the line. All of the remaining five parameters are behaving like random drawings from a normal distribution centered at zero, and so are deemed to be statistically non-significant. In conclusion, this rule keeps two factors: X1 (1.55125) and X2 (-0.43375).

Averages: Youden Plot A <u>Youden plot</u> can be used in the following way. Keep a factor as "important" if it is displaced away from the central-tendancy "bunch" in a Youden plot of high and low averages. By definition, a factor is important when its average response for the low (-1) setting is significantly different from its average response for the high (+1) setting. (Note that effects are twice the parameter estimates.) Conversely, if the low and high averages are about the same, then what difference does it make which setting to use and so why would such a factor be considered important? This fact in combination with the intrinsic benefits of the Youden plot for comparing pairs of items leads to the technique of generating a Youden plot of the low and high averages.

Youden Plot of Effect Estimates The following is the Youden plot of the effect estimatess for the eddy current data.

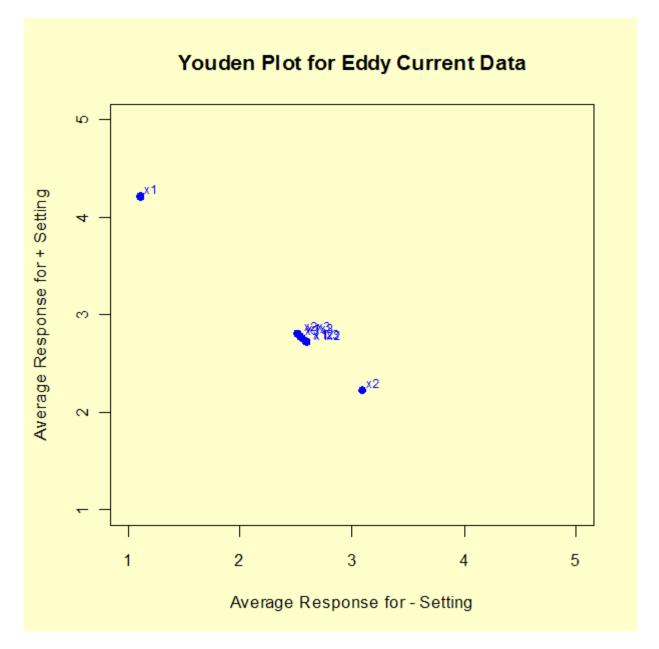

For the example at hand, the Youden plot clearly shows a cluster of points near the grand average (2.65875) with two displaced points above (factor 1) and below (factor 2). Based on the Youden plot, we conclude to keep two factors: X1 (1.55125) and X2 (-0.43375).

Residual Standard Deviation: Engineering Significance

This criterion is defined as

#### Residual Standard Deviation > Cutoff

That is, declare a factor as "important" if the cumulative model that includes the factor (and all larger factors) has a residual standard deviation smaller than an a priori engineering-specified minimum residual standard deviation.

This criterion is different from the others in that it is model focused. In practice, this criterion states that starting with the largest parameter, we cumulatively keep adding terms to the model and monitor how the residual standard deviation for each progressively more complicated model becomes smaller. At some point, the cumulative model will become complicated enough and comprehensive enough that the resulting residual standard deviation will drop below the pre-specified engineering cutoff for the residual standard deviation. At that point, we stop adding terms and declare all of the model-included terms to be "important" and

everything not in the model to be "unimportant".

This approach implies that the engineer has considered what a minimum residual standard deviation should be. In effect, this relates to what the engineer can tolerate for the magnitude of the typical residual (the difference between the raw data and the predicted value from the model). In other words, how good does the engineer want the prediction equation to be. Unfortunately, this engineering specification has not always been formulated and so this criterion can become moot.

In the absence of a prior specified cutoff, a good rough rule for the minimum engineering residual standard deviation is to keep adding terms until the residual standard deviation just dips below, say, 5 % of the current production average. For the eddy current data, let's say that the average detector has a sensitivity of 2.5 ohms. Then this would suggest that we would keep adding terms to the model until the residual standard deviation falls below 5 % of 2.5 ohms = 0.125 ohms.

Model	Residual Std. Dev.
Manage v V1	0 57070
Mean + X1	0.57272
Mean + X1 + X2	0.30429
Mean + $X1 + X2 + X2*X3$	0.26737
Mean + $X1 + X2 + X2*X3 + X1*X3$	0.23341
Mean + $X1 + X2 + X2*X3 + X1*X3 + X3$	0.19121
Mean + $X1 + X2 + X2*X3 + X1*X3 + X3 + X1*X2*X3$	0.18031
Mean + $X1$ + $X2$ + $X2*X3$ + $X1*X3$ + $X3$ + $X1*X2*X3$ + $X1*X2$	NA

Based on the minimum residual standard deviation criteria, and we would include **all** terms in order to drive the residual standard deviation below 0.125. Again, the 5 % rule is a rough-and-ready rule that has no basis in engineering or statistics, but is simply a "numerics". Ideally, the engineer has a better cutoff for the residual standard deviation that is based on how well he/she wants the equation to peform in practice. If such a number were available, then for this criterion and data set we would select something less than the entire collection of terms.

Residual Standard Deviation: Statistical Significance This criterion is defined as

Residual Standard Deviation  $> \sigma$ 

where  $\sigma$  is the standard deviation of an observation under replicated conditions.

That is, declare a term as "important" until the cumulative model that includes the term has a residual standard deviation smaller than  $\sigma$ . In essence, we are allowing that we cannot demand a model fit any better than what we would obtain if we had replicated data; that is, we cannot demand that the residual standard deviation from any fitted model be any smaller than the (theoretical or actual) replication standard deviation. We can drive the fitted standard deviation down (by adding terms) until it achieves a value close to  $\sigma$ , but to attempt to drive it down further means that we are, in effect, trying to fit noise.

In practice, this criterion may be difficult to apply because

- 1. the engineer may not know  $\sigma$ ;
- 2. the experiment might not have replication, and so a model-free estimate of  $\sigma$  is not obtainable.

For the current case study:

1. the engineer did **not** know  $\sigma$ ;

2. the design (a  $2^3$  full factorial) did **not** have replication. The most common way of having replication in such designs is to have replicated center points at the center of the cube ((X1,X2,X3) = (0,0,0)).

Thus for this current case, this criteria could **not** be used to yield a subset of "important" factors.

## Conclusions

In summary, the seven criteria for specifying "important" factors yielded the following for the eddy current data:

- 1. Parameters, Engineering Significance: X1, X2
- 2. Parameters, Numerically Significant: X1, X2
- 3. Parameters, Statistically Significant: X1, X2, X2\*X3
- 4. Parameters, Probability Plots: X1, X2
- 5. Effects, Youden Plot: X1, X2
- 6. Residual SD, Engineering Significance: all 7 terms
- 7. Residual SD, Statistical Significance: not applicable

Such conflicting results are common. Arguably, the three most important criteria (listed in order of most important) are:

- 4. Parameters, Probability Plots: X1, X2
- 1. Parameters, Engineering Significance: X1, X2
- 3. Residual SD, Engineering Significance: all 7 terms

Scanning all of the above, we thus declare the following consensus for the eddy current data:

- 1. Important Factors: X1 and X2
- 2. Parsimonious Prediction Equation:

$$\hat{Y} = 2.65875 + 1.55125 \cdot X_1 - 0.43375 \cdot X_2$$

(with a residual standard deviation of 0.30429 ohms)

Note that this is the initial model selection. We still need to perform model validation with a residual analysis.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques

# **1.3.6.** Probability Distributions

**Probability** Distributions Probability distributions are a fundamental concept in statistics. They are used both on a theoretical level and a practical level.

Some practical uses of probability distributions are:

- To calculate confidence intervals for parameters and to calculate critical regions for hypothesis tests.
- For univariate data, it is often useful to determine a reasonable distributional model for the data.
- Statistical intervals and hypothesis tests are often based on specific distributional assumptions. Before computing an interval or test based on a distributional assumption, we need to verify that the assumption is justified for the given data set. In this case, the distribution does not need to be the best-fitting distribution for the data, but an adequate enough model so that the statistical technique yields valid conclusions.
- Simulation studies with random numbers generated from using a specific probability distribution are often needed.

Table of **Contents** 

- 1. What is a probability distribution?
- 2. Related probability functions
- 3. Families of distributions
- 4. Location and scale parameters
- 5. Estimating the parameters of a distribution
- 6. A gallery of common distributions
- 7. Tables for probability distributions



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

# **1.3.6.1.** What is a Probability Distribution

Discrete Distributions The mathematical definition of a discrete probability function, p(x), is a function that satisfies the following properties.

1. The probability that x can take a specific value is p(x). That is

$$P[X=x] = p(x) = p_x$$

- 2. p(x) is non-negative for all real x.
- 3. The sum of p(x) over all possible values of x is 1, that is

$$\sum_{j} p_{j} = 1$$

where j represents all possible values that x can have and  $p_i$  is the probability at  $x_i$ .

One consequence of properties 2 and 3 is that  $0 \le p(x) \le 1$ .

What does this actually mean? A discrete probability function is a function that can take a discrete number of values (not necessarily finite). This is most often the nonnegative integers or some subset of the nonnegative integers. There is no mathematical restriction that discrete probability functions only be defined at integers, but in practice this is usually what makes sense. For example, if you toss a coin 6 times, you can get 2 heads or 3 heads but not 2 1/2 heads. Each of the discrete values has a certain probability of occurrence that is between zero and one. That is, a discrete function that allows negative values or values greater than one is not a probability function. The condition that the probabilities sum to one means that at least one of the values has to occur.

Continuous Distributions

The mathematical definition of a continuous probability function, f(x), is a function that satisfies the following properties.

1. The probability that x is between two points a and b is

$$p[a \le x \le b] = \int_a^b f(x) dx$$

- 2. It is non-negative for all real x.
- 3. The integral of the probability function is one, that is

$$\int_{-\infty}^{\infty} f(x)dx = 1$$

What does this actually mean? Since continuous probability functions are defined for an infinite number of points over a continuous interval, the probability at a single point is always zero. Probabilities are measured over intervals, not single points. That is, the area under the curve between two distinct points defines the probability for that interval. This means that the height of the probability function can in fact be greater than one. The property that the integral must equal one is equivalent to the property for discrete distributions that the sum of all the probabilities must equal one.

Probability
Mass
Functions
Versus
Probability
Density
Functions

Discrete probability functions are referred to as probability mass functions and continuous probability functions are referred to as probability density functions. The term probability functions covers both discrete and continuous distributions. When we are referring to probability functions in generic terms, we may use the term probability density functions to mean both discrete and continuous probability functions.



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

## 1.3.6.2. Related Distributions

Probability distributions are typically defined in terms of the probability density function. However, there are a number of probability functions used in applications.

Probability
Density
Function


For a continuous function, the probability density function (pdf) is the probability that the variate has the value x. Since for continuous distributions the probability at a single point is zero, this is often expressed in terms of an integral between two points.

$$\int_a^b f(x)dx = Pr[a \le X \le b]$$

For a discrete distribution, the pdf is the probability that the variate takes the value x.

$$f(x) = Pr[X = x]$$

The following is the plot of the normal probability density function.

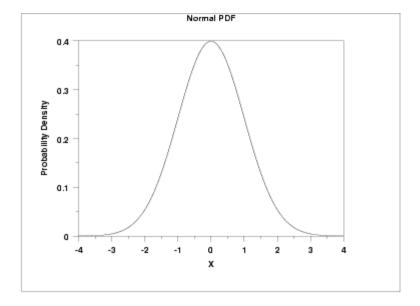

Cumulative Distribution Function The cumulative distribution function (cdf) is the probability that the variable takes a value less than or equal to x. That is

$$F(x) = Pr[X \le x] = \alpha$$


For a continuous distribution, this can be expressed mathematically as

$$F(x) = \int_{-\infty}^{x} f(\mu) d\mu$$

For a discrete distribution, the cdf can be expressed as

$$F(x) = \sum_{i=0}^x f(i)$$

The following is the plot of the normal cumulative distribution function.

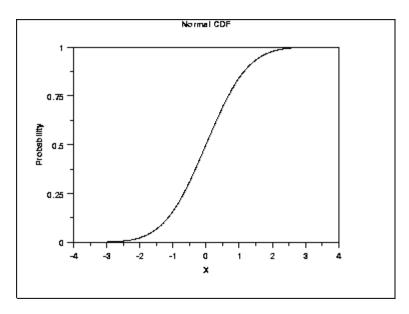

The horizontal axis is the allowable domain for the given probability function. Since the vertical axis is a probability, it must fall between zero and one. It increases from zero to one as we go from left to right on the horizontal axis.


Percent Point Function The percent point function (ppf) is the inverse of the cumulative distribution function. For this reason, the percent point function is also commonly referred to as the inverse distribution function. That is, for a distribution function we calculate the probability that the variable is less than or equal to x for a given x. For the percent point function, we start with the probability and compute the corresponding x for the cumulative distribution. Mathematically, this can be expressed as

$$Pr[X \leq G(\alpha)] = \alpha$$

or alternatively

$$x = G(\alpha) = G(F(x))$$

The following is the plot of the normal percent point function.

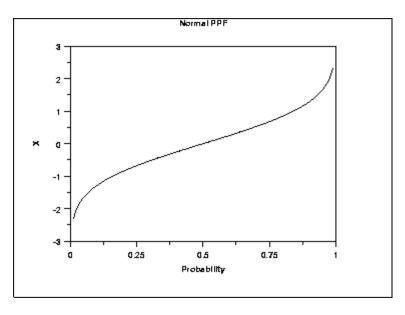


Since the horizontal axis is a probability, it goes from zero to one. The vertical axis goes from the smallest to the largest value of the cumulative distribution function.

Hazard Function The hazard function is the ratio of the probability density function to the survival function, S(x).

$$h(x) = \frac{f(x)}{S(x)} = \frac{f(x)}{1 - F(x)}$$

The following is the plot of the normal distribution hazard function.

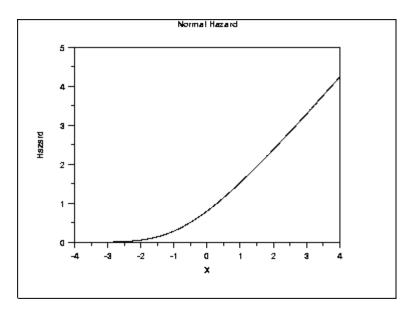

Hazard plots are most commonly used in reliability applications. Note that <u>Johnson</u>, <u>Kotz</u>, <u>and Balakrishnan</u> refer to this as the conditional failure density function rather than the hazard function.

Cumulative Hazard The cumulative hazard function is the integral of the hazard function.


**Function** 

$$H(x)=\int_{-\infty}^x h(\mu)d\mu$$

This can alternatively be expressed as

$$H(x) = -\ln\left(1 - F(x)\right)$$

The following is the plot of the normal cumulative hazard function.

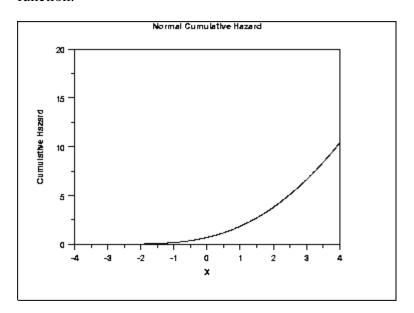


Cumulative hazard plots are most commonly used in reliability applications. Note that <u>Johnson</u>, <u>Kotz</u>, <u>and</u> <u>Balakrishnan</u> refer to this as the hazard function rather than the cumulative hazard function.

Survival Function Survival functions are most often used in reliability and related fields. The survival function is the probability that the variate takes a value greater than x.

$$S(x) = Pr[X > x] = 1 - F(x)$$

The following is the plot of the normal distribution survival function.

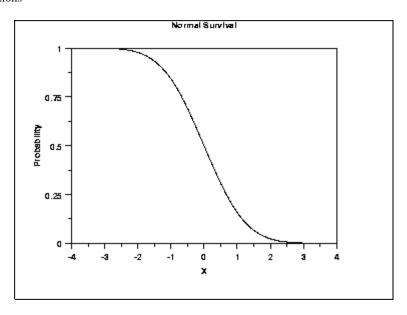


For a survival function, the y value on the graph starts at 1 and monotonically decreases to zero. The survival function should be compared to the cumulative distribution function.

Inverse Survival Function Just as the percent point function is the inverse of the cumulative distribution function, the survival function also has an inverse function. The inverse survival function can be defined in terms of the percent point function.

$$Z(\alpha) = G(1 - \alpha)$$

The following is the plot of the normal distribution inverse survival function.

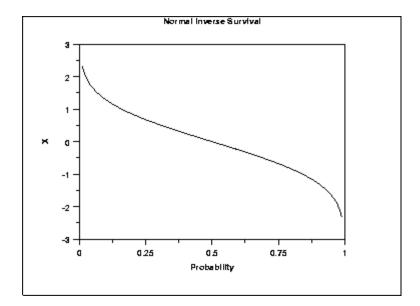

As with the percent point function, the horizontal axis is a probability. Therefore the horizontal axis goes from 0 to 1 regardless of the particular distribution. The appearance is similar to the percent point function. However, instead of going from the smallest to the largest value on the vertical axis, it goes from the largest to the smallest value.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

## 1.3.6.3. Families of Distributions


## Shape Parameters

Many probability distributions are not a single distribution, but are in fact a family of distributions. This is due to the distribution having one or more shape parameters.

Shape parameters allow a distribution to take on a variety of shapes, depending on the value of the shape parameter. These distributions are particularly useful in modeling applications since they are flexible enough to model a variety of data sets.

Example: Weibull Distribution

The <u>Weibull distribution</u> is an example of a distribution that has a shape parameter. The following graph plots the Weibull pdf with the following values for the shape parameter: 0.5, 1.0, 2.0, and 5.0.

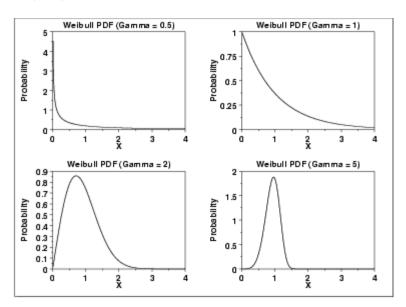

The shapes above include an exponential distribution, a right-skewed distribution, and a relatively symmetric distribution.

The Weibull distribution has a relatively simple distributional form. However, the shape parameter allows the Weibull to assume a wide variety of shapes. This combination of simplicity and flexibility in the shape of the Weibull distribution has made it an effective distributional model in reliability applications. This ability to model a wide variety of distributional shapes using a relatively simple distributional form is possible with many other distributional

families as well.

PPCC Plots

The PPCC plot is an effective graphical tool for selecting the member of a distributional family with a single shape parameter that best fits a given set of data.



HOME

TOOLS & AIDS

SEARCH




- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions


## 1.3.6.4. Location and Scale Parameters

Normal PDF A probability distribution is characterized by location and scale parameters. Location and scale parameters are typically used in modeling applications.

For example, the following graph is the probability density function for the standard normal distribution, which has the location parameter equal to zero and scale parameter equal to one.

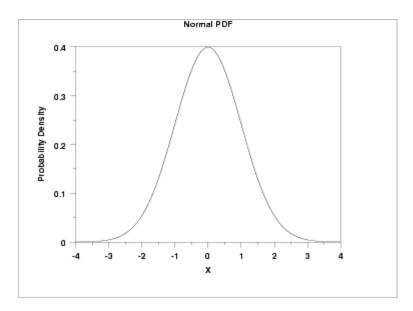


Location Parameter The next plot shows the probability density function for a normal distribution with a location parameter of 10 and a scale parameter of 1.

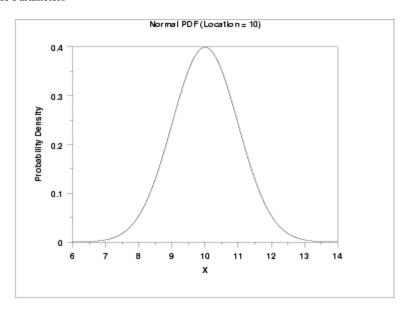


The effect of the location parameter is to translate the graph, relative to the standard normal distribution, 10 units to the right on the horizontal axis. A location parameter of -10 would have shifted the graph 10 units to the left on the horizontal axis.

That is, a location parameter simply shifts the graph left or right on the horizontal axis.

Scale Parameter The next plot has a scale parameter of 3 (and a location parameter of zero). The effect of the scale parameter is to stretch out the graph. The maximum y value is approximately 0.13 as opposed 0.4 in the previous graphs. The y value, i.e., the vertical axis value, approaches zero at about (+/-) 9 as opposed to (+/-) 3 with the first graph.

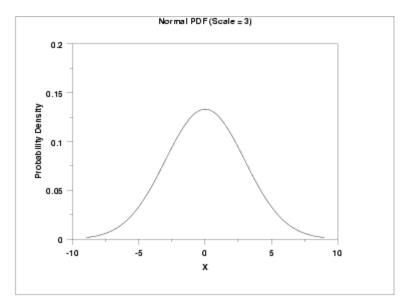


In contrast, the next graph has a scale parameter of 1/3 (=0.333). The effect of this scale parameter is to squeeze the pdf. That is, the maximum y value is approximately 1.2 as opposed to 0.4 and the y value is near zero at (+/-) 1 as opposed to (+/-) 3.

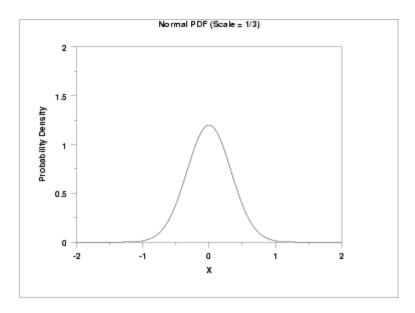

The effect of a scale parameter greater than one is to stretch the pdf. The greater the magnitude, the greater the stretching. The effect of a scale parameter less than one is to compress the pdf. The compressing approaches a spike as the scale parameter goes to zero. A scale parameter of 1 leaves the pdf unchanged (if the scale parameter is 1 to begin with) and non-positive scale parameters are not allowed.

Location and Scale Together The following graph shows the effect of both a location and a scale parameter. The plot has been shifted right 10 units and stretched by a factor of 3.

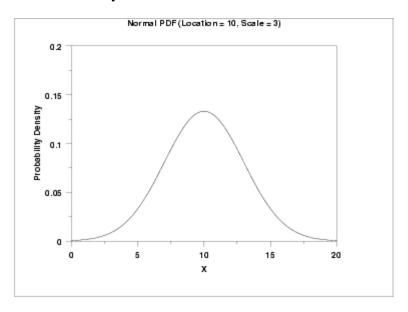

Standard Form The standard form of any distribution is the form that has location parameter zero and scale parameter one.

It is common in statistical software packages to only compute the standard form of the distribution. There are formulas for converting from the standard form to the form with other location and scale parameters. These formulas are independent of the particular probability distribution. Formulas for Location and Scale Based on the Standard Form The following are the formulas for computing various probability functions based on the standard form of the distribution. The parameter *a* refers to the location parameter and the parameter *b* refers to the scale parameter. Shape parameters are not included.

<u>Cumulative Distribution</u>	F(x;a,b) = F((x-a)/b;0,1	)
Function		

Probability Density Function f(x;a,b) = (1/b)f((x-a)/b;0,1)Percent Point Function  $G(\alpha;a,b) = a + bG(\alpha;0,1)$ Hazard Function h(x;a,b) = (1/b)h((x-a)/b;0,1)Cumulative Hazard Function H(x;a,b) = H((x-a)/b;0,1)Survival Function S(x;a,b) = S((x-a)/b;0,1)Inverse Survival Function  $Z(\alpha;a,b) = a + bZ(\alpha;0,1)$ Random Numbers Y(a,b) = a + bY(0,1)

Relationship to Mean and Standard Deviation For the normal distribution, the location and scale parameters correspond to the mean and standard deviation, respectively. However, this is not necessarily true for other distributions. In fact, it is not true for most distributions.



HOME TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

# 1.3.6.5. Estimating the Parameters of a **Distribution**

Model a univariate data set with a probability distribution

One common application of probability distributions is modeling univariate data with a specific probability distribution. This involves the following two steps:

- 1. Determination of the "best-fitting" distribution.
- 2. Estimation of the parameters (shape, location, and scale parameters) for that distribution.

Various Methods

There are various methods, both numerical and graphical, for estimating the parameters of a probability distribution.

- 1. Method of moments
- 2. Maximum likelihood
- 3. Least squares
- 4. PPCC and probability plots



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.5. Estimating the Parameters of a Distribution

## **1.3.6.5.1. Method of Moments**

#### Method of Moments

The method of moments equates sample moments to parameter estimates. When moment methods are available, they have the advantage of simplicity. The disadvantage is that they are often not available and they do not have the desirable optimality properties of maximum likelihood and least squares estimators.

The primary use of moment estimates is as starting values for the more precise <u>maximum likelihood</u> and <u>least squares</u> estimates.

#### Software

Most general purpose statistical software does not include explicit method of moments parameter estimation commands. However, when utilized, the method of moment formulas tend to be straightforward and can be easily implemented in most statistical software programs.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.5. Estimating the Parameters of a Distribution

## 1.3.6.5.2. Maximum Likelihood

#### Maximum Likelihood

Maximum likelihood estimation begins with the mathematical expression known as a likelihood function of the sample data. Loosely speaking, the likelihood of a set of data is the probability of obtaining that particular set of data given the chosen probability model. This expression contains the unknown parameters. Those values of the parameter that maximize the sample likelihood are known as the maximum likelihood estimates.

The <u>reliability chapter</u> contains some examples of the likelihood functions for a few of the commonly used distributions in reliability analysis.

#### Advantages

The advantages of this method are:

- Maximum likelihood provides a consistent approach to parameter estimation problems. This means that maximum likelihood estimates can be developed for a large variety of estimation situations. For example, they can be applied in reliability analysis to censored data under various censoring models.
- Maximum likelihood methods have desirable mathematical and optimality properties. Specifically,
  - 1. They become minimum variance unbiased estimators as the sample size increases. By unbiased, we mean that if we take (a very large number of) random samples with replacement from a population, the average value of the parameter estimates will be theoretically exactly equal to the population value. By minimum variance, we mean that the estimator has the smallest variance, and thus the narrowest confidence interval, of all estimators of that type.
  - 2. They have approximate normal distributions and approximate sample variances that can be used to generate confidence bounds and hypothesis tests for the parameters.
- Several popular statistical software packages provide

excellent algorithms for maximum likelihood estimates for many of the commonly used distributions. This helps mitigate the computational complexity of maximum likelihood estimation.

## Disadvantages The disadvantages of this method are:

- The likelihood equations need to be specifically worked out for a given distribution and estimation problem. The mathematics is often non-trivial, particularly if confidence intervals for the parameters are desired.
- The numerical estimation is usually non-trivial. Except for a few cases where the maximum likelihood formulas are in fact simple, it is generally best to rely on high quality statistical software to obtain maximum likelihood estimates. Fortunately, high quality maximum likelihood software is becoming increasingly common.
- Maximum likelihood estimates can be heavily biased for small samples. The optimality properties may not apply for small samples.
- Maximum likelihood can be sensitive to the choice of starting values.

#### Software

Most general purpose statistical software programs support maximum likelihood estimation (MLE) in some form. MLE estimation can be supported in two ways.

1. A software program may provide a generic function minimization (or equivalently, maximization) capability. This is also referred to as function optimization. Maximum likelihood estimation is essentially a function optimization problem.

This type of capability is particularly common in mathematical software programs.

2. A software program may provide MLE computations for a specific problem. For example, it may generate ML estimates for the parameters of a Weibull distribution.

Statistical software programs will often provide ML estimates for many specific problems even when they do not support general function optimization.

The advantage of function minimization software is that it can be applied to many different MLE problems. The drawback is that you have to specify the maximum

likelihood equations to the software. As the functions can be non-trivial, there is potential for error in entering the equations.

The advantage of the specific MLE procedures is that greater efficiency and better numerical stability can often be obtained by taking advantage of the properties of the specific estimation problem. The specific methods often return explicit confidence intervals. In addition, you do not have to know or specify the likelihood equations to the software. The disadvantage is that each MLE problem must be specifically coded.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.5. Estimating the Parameters of a Distribution

# **1.3.6.5.3.** Least Squares

Least Squares Non-linear least squares provides an alternative to

maximum likelihood.

Advantages The advantages of this method are:

- Non-linear least squares software may be available in many statistical software packages that do not support maximum likelihood estimates.
- It can be applied more generally than maximum likelihood. That is, if your software provides nonlinear fitting and it has the ability to specify the probability function you are interested in, then you can generate least squares estimates for that distribution. This will allow you to obtain reasonable estimates for distributions even if the software does not provide maximum likelihood estimates.

Disadvantages The disadvantages of this method are:

- It is not readily applicable to censored data.
- It is generally considered to have less desirable optimality properties than maximum likelihood.
- It can be quite sensitive to the choice of starting values.

Software Non-linear least squares fitting is available in many general purpose statistical software programs.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.5. Estimating the Parameters of a Distribution

# **1.3.6.5.4. PPCC and Probability Plots**

PPCC and Probability Plots The <u>PPCC plot</u> can be used to estimate the shape parameter of a distribution with a single shape parameter. After finding the best value of the shape parameter, the <u>probability plot</u> can be used to estimate the location and scale parameters of a probability distribution.

Advantages

The advantages of this method are:

- It is based on two well-understood concepts.
  - 1. The linearity (i.e., straightness) of the probability plot is a good measure of the adequacy of the distributional fit.
  - 2. The correlation coefficient between the points on the probability plot is a good measure of the linearity of the probability plot.
- It is an easy technique to implement for a wide variety of distributions with a single shape parameter. The basic requirement is to be able to compute the <u>percent point function</u>, which is needed in the computation of both the probability plot and the PPCC plot.
- The PPCC plot provides insight into the sensitivity of the shape parameter. That is, if the PPCC plot is relatively flat in the neighborhood of the optimal value of the shape parameter, this is a strong indication that the fitted model will not be sensitive to small deviations, or even large deviations in some cases, in the value of the shape parameter.
- The maximum correlation value provides a method for comparing across distributions as well as identifying the best value of the shape parameter for a given distribution. For example, we could use the PPCC and probability fits for the Weibull, lognormal, and possibly several other distributions. Comparing the maximum correlation coefficient achieved for each distribution can help in selecting which is the best distribution to use.

Disadvantages The disadvantages of this method are:

- It is limited to distributions with a single shape parameter.
- PPCC plots are not widely available in statistical software packages other than Dataplot (Dataplot provides PPCC plots for 40+ distributions). Probability plots are generally available. However, many statistical software packages only provide them for a limited number of distributions.
- Significance levels for the correlation coefficient (i.e., if the maximum correlation value is above a given value, then the distribution provides an adequate fit for the data with a given confidence level) have only been worked out for a limited number of distributions.

Other Graphical Methods For reliability applications, the <u>hazard plot</u> and the <u>Weibull plot</u> are alternative graphical methods that are commonly used to estimate parameters.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

# **1.3.6.6.** Gallery of Distributions


Gallery of
Common
Distributions

Detailed information on a few of the most common distributions is available below. There are a large number of distributions used in statistical applications. It is beyond the scope of this Handbook to discuss more than a few of these. Two excellent sources for additional detailed information on a large array of distributions are Johnson, Kotz, and Balakrishnan and Evans, Hastings, and Peacock. Equations for the probability functions are given for the standard form of the distribution. Formulas exist for defining the functions with location and scale parameters in terms of the standard form of the distribution.


The sections on parameter estimation are restricted to the method of moments and maximum likelihood. This is because the <u>least squares</u> and <u>PPCC and probability plot</u> estimation procedures are generic. The maximum likelihood equations are not listed if they involve solving simultaneous equations. This is because these methods require sophisticated computer software to solve. Except where the maximum likelihood estimates are trivial, you should depend on a statistical software program to compute them. References are given for those who are interested.

Be aware that different sources may give formulas that are different from those shown here. In some cases, these are simply mathematically equivalent formulations. In other cases, a different parameterization may be used.

Continuous Distributions

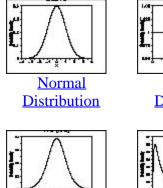




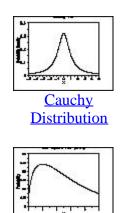

Discrete

NIST

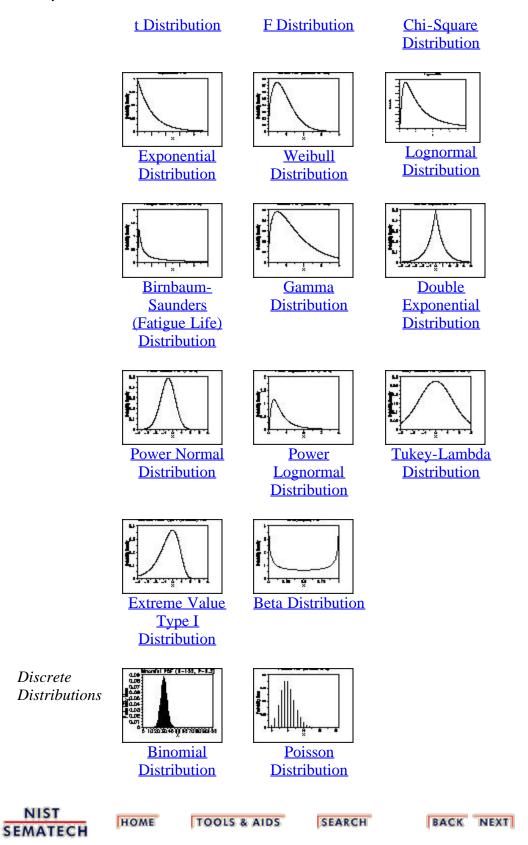



## **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.1. Normal Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the normal distribution is


$$f(x) = \frac{e^{-(x-\mu)^2/(2\sigma^2)}}{\sigma\sqrt{2\pi}}$$

where  $\mu$  is the <u>location parameter</u> and  $\sigma$  is the <u>scale</u> parameter. The case where  $\mu = 0$  and  $\sigma = 1$  is called the **standard normal distribution**. The equation for the standard normal distribution is

$$f(x) = \frac{e^{-x^2/2}}{\sqrt{2\pi}}$$

Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the standard normal probability density function.

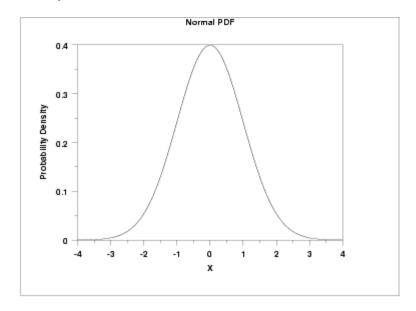


Cumulative

The formula for the cumulative distribution function of the

Distribution Function


normal distribution does not exist in a simple closed formula. It is computed numerically.

The following is the plot of the normal cumulative distribution function.

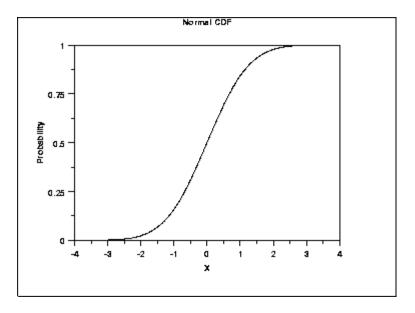

Percent Point Function The formula for the <u>percent point function</u> of the normal distribution does not exist in a simple closed formula. It is computed numerically.

The following is the plot of the normal percent point function.

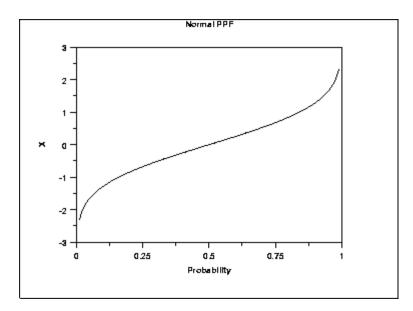


Hazard Function The formula for the <u>hazard function</u> of the normal distribution is

$$h(x) = \frac{\phi(x)}{\Phi(-x)}$$

where  $\Phi$  is the cumulative distribution function of the


standard normal distribution and is the probability density function of the standard normal distribution.

The following is the plot of the normal hazard function.

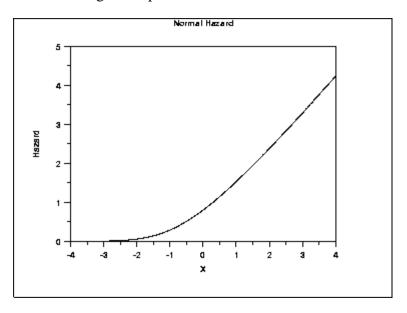


Cumulative Hazard Function The normal <u>cumulative hazard function</u> can be computed from the normal cumulative distribution function.

The following is the plot of the normal cumulative hazard function.

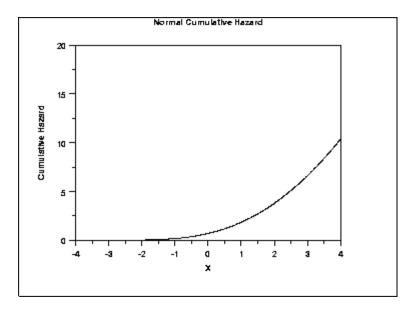


Survival Function The normal <u>survival function</u> can be computed from the normal cumulative distribution function.

The following is the plot of the normal survival function.

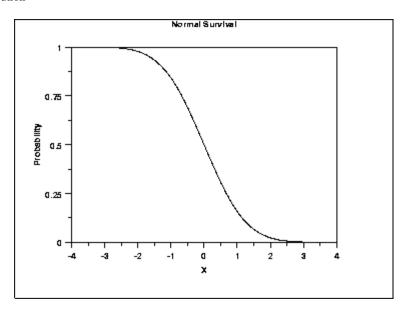

Inverse Survival Function The normal inverse survival function can be computed from the normal percent point function.

The following is the plot of the normal inverse survival function.

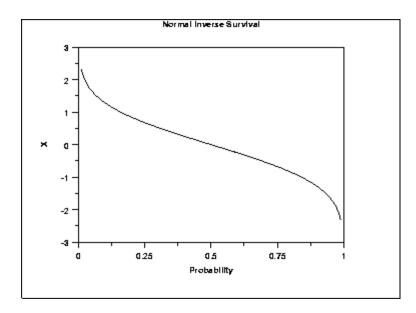

Common Statistics

Mean The location parameter  $\mu$ . The location parameter  $\mu$ . Median The location parameter  $\mu$ . Mode Infinity in both directions. Range Standard The scale parameter  $\sigma$ . Deviation

 $\sigma/\mu$ Coefficient of Variation Skewness 0 3 **Kurtosis** 

Parameter

The location and scale parameters of the normal distribution

Estimation

can be estimated with the sample mean and sample standard deviation, respectively.

Comments

For both theoretical and practical reasons, the normal distribution is probably the most important distribution in statistics. For example,

- Many classical statistical tests are based on the assumption that the data follow a normal distribution.
   This assumption should be tested before applying these tests.
- In modeling applications, such as linear and non-linear regression, the error term is often assumed to follow a normal distribution with fixed location and scale.
- The normal distribution is used to find significance levels in many hypothesis tests and confidence intervals.

Theroretical
Justification
- Central
Limit
Theorem

The normal distribution is widely used. Part of the appeal is that it is well behaved and mathematically tractable. However, the central limit theorem provides a theoretical basis for why it has wide applicability.

The central limit theorem basically states that as the sample size (N) becomes large, the following occur:

- 1. The sampling distribution of the mean becomes approximately normal regardless of the distribution of the original variable.
- 2. The sampling distribution of the mean is centered at the population mean,  $\mu$ , of the original variable. In addition, the standard deviation of the sampling distribution of the mean approaches  $\sigma/\sqrt{N}$ .

Software

Most general purpose statistical software programs support at least some of the probability functions for the normal distribution.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.2. Uniform Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the uniform distribution is


$$f(x) = \frac{1}{B-A}$$
 for  $A \le x \le B$ 

where A is the <u>location parameter</u> and (B - A) is the <u>scale parameter</u>. The case where A = 0 and B = 1 is called the **standard uniform distribution**. The equation for the standard uniform distribution is

$$f(x) = 1$$
 for  $0 \le x \le 1$ 

Since the general form of probability functions can be <u>expressed in terms of the standard distribution</u>, all subsequent formulas in this section are given for the standard form of the function.


The following is the plot of the uniform probability density function.

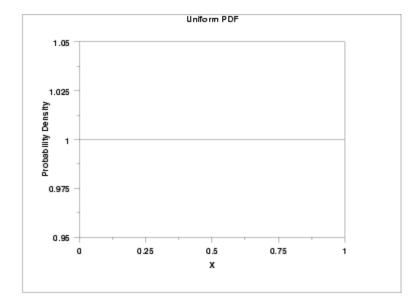

Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the uniform distribution is

$$F(x) = x$$
 for  $0 \le x \le 1$ 


The following is the plot of the uniform cumulative distribution function.

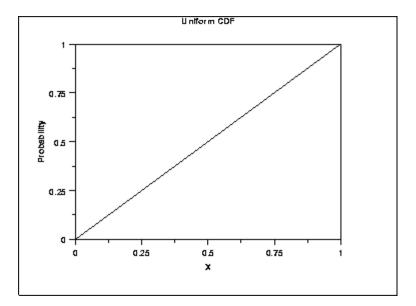

Percent Point Function The formula for the percent point function of the uniform distribution is

$$G(p) = p$$
 for  $0 \le p \le 1$ 


The following is the plot of the uniform percent point function.

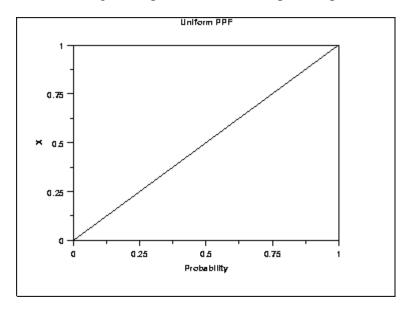

Hazard Function The formula for the <u>hazard function</u> of the uniform distribution is

$$h(x) = \frac{1}{1-x} \quad \text{for } 0 \le x < 1$$


The following is the plot of the uniform hazard function.

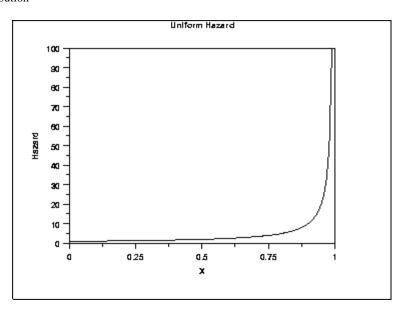

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the uniform distribution is


$$H(x) = -ln(1-x) \qquad \text{for } 0 \le x < 1$$

The following is the plot of the uniform cumulative hazard function.

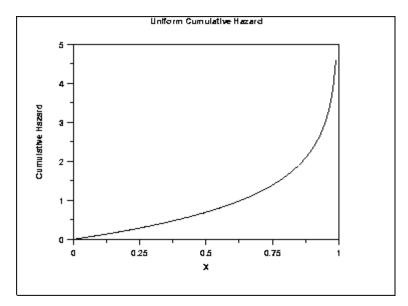


Survival Function The uniform <u>survival function</u> can be computed from the uniform cumulative distribution function.

The following is the plot of the uniform survival function.

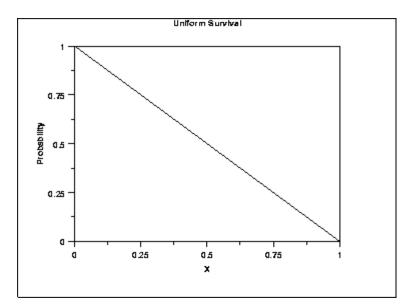

Inverse Survival Function The uniform <u>inverse survival function</u> can be computed from the uniform percent point function.

The following is the plot of the uniform inverse survival function.

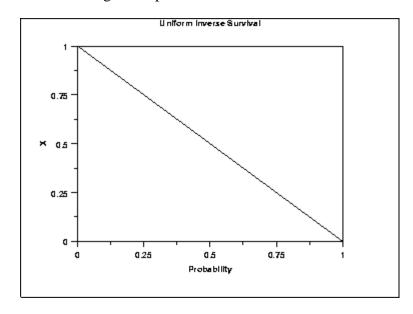

Common Statistics

Mean (A + B)/2Median (A + B)/2Range B - AStandard Deviation  $\sqrt{\frac{(B - A)^2}{12}}$ Coefficient of (B - A)Variation  $\sqrt{3}(B + A)$ Skewness 0
Kurtosis 9/5

Parameter Estimation The method of moments estimators for A and B are

$$\hat{A} = \bar{x} - \sqrt{3}s$$

$$\hat{B} = \bar{x} + \sqrt{3}s$$

The maximum likelihood estimators are usually given in terms of the parameters a and h where

$$A = a - h$$
$$B = a + h$$

The maximum likelihood estimators for a and h are

$$\hat{a} = \text{midrange}(Y_1, Y_2, ..., Y_n)$$
  
 $\hat{h} = 0.5[\text{range}(Y_1, Y_2, ..., Y_n)]$ 

This gives the following maximum likelihood estimators for A and B

$$\hat{A} = \text{midrange}(Y_1, Y_2, ..., Y_n) - 0.5[\text{range}(Y_1, Y_2, ..., Y_n)] = Y_1$$

$$\hat{B} = \operatorname{midrange}(Y_1, Y_2, ..., Y_n) + 0.5[\operatorname{range}(Y_1, Y_2, ..., Y_n)] = Y_n$$

**Comments** 

The uniform distribution defines equal probability over a given range for a continuous distribution. For this reason, it is important as a reference distribution.

One of the most important applications of the uniform distribution is in the generation of random numbers. That is, almost all random number generators generate random numbers on the (0,1) interval. For other distributions, some transformation is applied to the uniform random numbers.

Software

Most general purpose statistical software programs support at least some of the probability functions for the uniform distribution.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

# 1.3.6.6.3. Cauchy Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the Cauchy distribution is


$$f(x) = \frac{1}{s\pi(1 + ((x-t)/s)^2)}$$

where t is the <u>location parameter</u> and s is the <u>scale parameter</u>. The case where t = 0 and s = 1 is called the **standard** Cauchy distribution. The equation for the standard Cauchy distribution reduces to

$$f(x) = \frac{1}{\pi(1+x^2)}$$

Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the standard Cauchy probability density function.

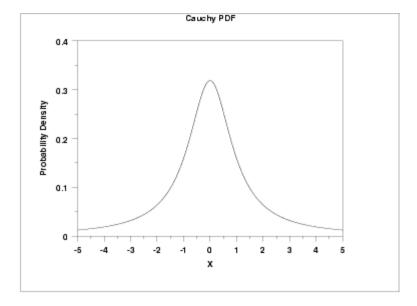


Cumulative Distribution

The formula for the <u>cumulative distribution function</u> for the Cauchy distribution is

**Function** 

$$F(x) = 0.5 + \frac{\arctan(x)}{\pi}$$


The following is the plot of the Cauchy cumulative distribution function.

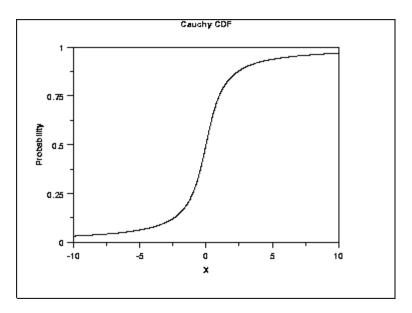

Percent Point Function The formula for the <u>percent point function</u> of the Cauchy distribution is


$$G(p) = -\cot(\pi p)$$

The following is the plot of the Cauchy percent point function.

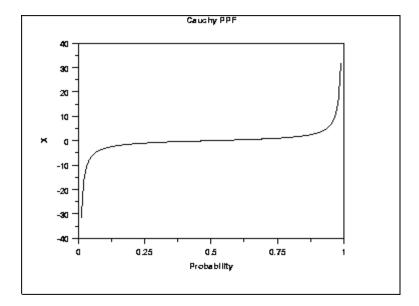


Hazard Function The Cauchy <u>hazard function</u> can be computed from the Cauchy probability density and cumulative distribution functions.

The following is the plot of the Cauchy hazard function.

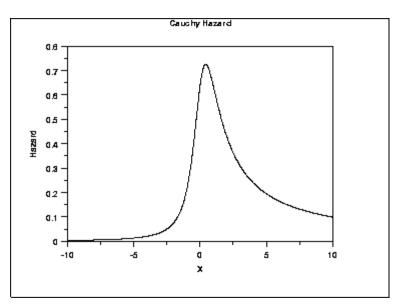


Cumulative Hazard Function The Cauchy <u>cumulative hazard function</u> can be computed from the Cauchy cumulative distribution function.

The following is the plot of the Cauchy cumulative hazard function.

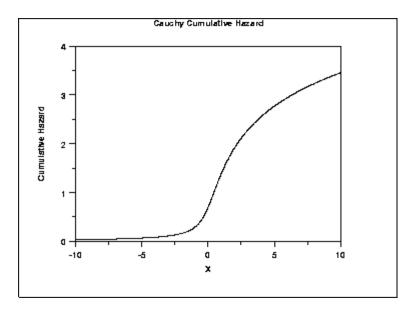


Survival Function The Cauchy <u>survival function</u> can be computed from the Cauchy cumulative distribution function.

The following is the plot of the Cauchy survival function.

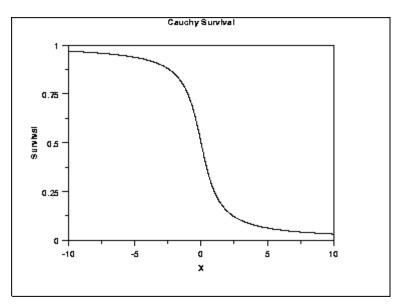

Inverse Survival Function The Cauchy <u>inverse survival function</u> can be computed from the Cauchy percent point function.

The following is the plot of the Cauchy inverse survival function.

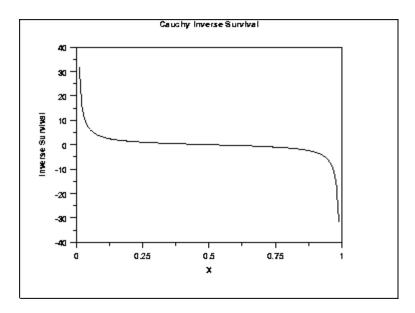

Common Statistics

MeanThe mean is undefined.MedianThe location parameter t.ModeThe location parameter t.RangeInfinity in both directions.

Standard The standard deviation is undefined.

Deviation

Coefficient of The coefficient of variation is undefined.

Variation

Skewness The skewness is undefined. Kurtosis The kurtosis is undefined.

Parameter

The likelihood functions for the Cauchy maximum likelihood

Estimation

estimates are given in chapter 16 of Johnson, Kotz, and Balakrishnan. These equations typically must be solved numerically on a computer.

Comments

The Cauchy distribution is important as an example of a pathological case. Cauchy distributions look similar to a normal distribution. However, they have much heavier tails. When studying hypothesis tests that assume normality, seeing how the tests perform on data from a Cauchy distribution is a good indicator of how sensitive the tests are to heavy-tail departures from normality. Likewise, it is a good check for robust techniques that are designed to work well under a wide variety of distributional assumptions.

The mean and standard deviation of the Cauchy distribution are undefined. The practical meaning of this is that collecting 1,000 data points gives no more accurate an estimate of the mean and standard deviation than does a single point.

Software

Many general purpose statistical software programs support at least some of the probability functions for the Cauchy distribution.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## **1.3.6.6.4.** t Distribution

Probability
Density
Function

The formula for the <u>probability density function</u> of the *t* distribution is


$$f(x) = \frac{\left(1 + \frac{x^2}{\nu}\right)^{\frac{-(\nu+1)}{2}}}{B(0.5, 0.5\nu)\sqrt{\nu}}$$

where  $\boldsymbol{B}$  is the beta function and  $\boldsymbol{\nu}$  is a positive integer shape parameter. The formula for the beta function is

$$B(\alpha,\beta) = \int_0^1 t^{\alpha-1} (1-t)^{\beta-1} dt$$

In a testing context, the t distribution is treated as a "standardized distribution" (i.e., no location or scale parameters). However, in a distributional modeling context (as with other probability distributions), the t distribution itself can be transformed with a location parameter,  $\mu$ , and a scale parameter,  $\sigma$ .

The following is the plot of the *t* probability density function for 4 different values of the shape parameter.

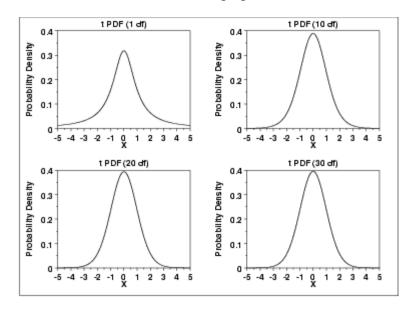


These plots all have a similar shape. The difference is in the heaviness of the tails. In fact, the t distribution with  $\nu$  equal

to 1 is a <u>Cauchy</u> distribution. The t distribution approaches a <u>normal</u> distribution as  $\nu$  becomes large. The approximation is quite good for values of  $\nu > 30$ .


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the *t* distribution is complicated and is not included here. It is given in the <u>Evans</u>, <u>Hastings</u>, and <u>Peacock</u> book.

The following are the plots of the t cumulative distribution function with the same values of  $\nu$  as the pdf plots above.

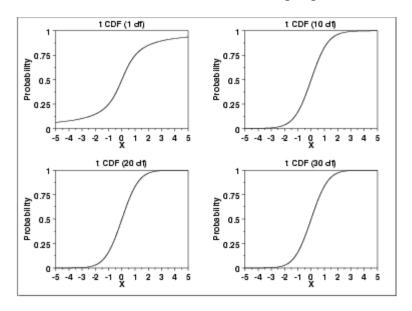

Percent Point Function The formula for the <u>percent point function</u> of the *t* distribution does not exist in a simple closed form. It is computed numerically.

The following are the plots of the t percent point function with the same values of  $\nu$  as the pdf plots above.

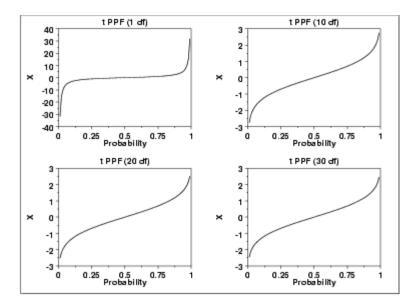

Other Probability Functions Since the *t* distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit the formulas and plots for the hazard,

cumulative hazard, survival, and inverse survival probability functions.

Common **Statistics** 

Mean 0 (It is undefined for  $\nu$  equal to 1.)

Median 0 Mode 0

Infinity in both directions. Range

Standard Deviation

It is undefined for  $\nu$  equal to 1 or 2.

Coefficient of

Undefined

Variation

Skewness 0. It is undefined for  $\nu$  less than or equal

to 3. However, the t distribution is

symmetric in all cases.

**Kurtosis** 

It is undefined for  $\nu$  less than or equal to

Parameter Estimation Since the *t* distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit any discussion of parameter estimation.

**Comments** 

The t distribution is used in many cases for the critical regions for hypothesis tests and in determining confidence intervals. The most common example is testing if data are consistent with the assumed process mean.

Software

Most general purpose statistical software programs support at least some of the probability functions for the *t* distribution.



HOME TOOLS & AIDS SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## **1.3.6.6.5.** F Distribution

Probability
Density
Function

The F distribution is the ratio of two <u>chi-square</u> distributions with degrees of freedom  $\nu_1$  and  $\nu_2$ , respectively, where each chi-square has first been divided by its degrees of freedom. The formula for the <u>probability density function</u> of the F distribution is


$$f(x) = \frac{\Gamma(\frac{\nu_1 + \nu_2}{2})(\frac{\nu_1}{\nu_2})^{\frac{\nu_1}{2}}x^{\frac{\nu_1}{2} - 1}}{\Gamma(\frac{\nu_1}{2})\Gamma(\frac{\nu_2}{2})(1 + \frac{\nu_1 x}{\nu_2})^{\frac{\nu_1 + \nu_2}{2}}}$$

where  $\nu_1$  and  $\nu_2$  are the shape parameters and  $\Gamma$  is the gamma function. The formula for the gamma function is

$$\Gamma(a)=\int_0^\infty t^{a-1}e^{-t}dt$$

In a testing context, the F distribution is treated as a "standardized distribution" (i.e., no location or scale parameters). However, in a distributional modeling context (as with other probability distributions), the F distribution itself can be transformed with a location parameter,  $\mu$ , and a scale parameter,  $\sigma$ .

The following is the plot of the F probability density function for 4 different values of the shape parameters.

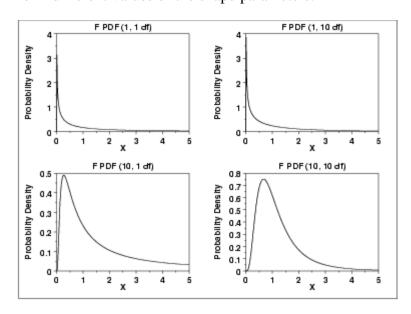

Cumulative Distribution Function The formula for the <u>Cumulative distribution function</u> of the F distribution is

$$F(x) = 1 - I_k(\frac{\nu_2}{2}, \frac{\nu_1}{2})$$


where  $k = \nu_2 / (\nu_2 + \nu_1^* x)$  and  $I_k$  is the incomplete beta function. The formula for the incomplete beta function is

$$I_k(x, \alpha, \beta) = rac{\int_0^x t^{lpha - 1} (1 - t)^{eta - 1} dt}{B(lpha, eta)}$$

where  $\boldsymbol{B}$  is the beta function


$$B(\alpha,\beta) = \int_0^1 t^{\alpha-1} (1-t)^{\beta-1} dt$$

The following is the plot of the F cumulative distribution function with the same values of  $\nu_1$  and  $\nu_2$  as the pdf plots above.

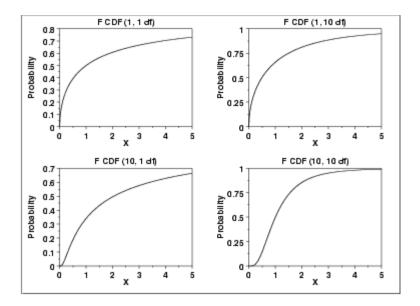

Percent Point Function The formula for the <u>percent point function</u> of the F distribution does not exist in a simple closed form. It is computed numerically.

The following is the plot of the F percent point function with the same values of  $\nu_1$  and  $\nu_2$  as the pdf plots above.

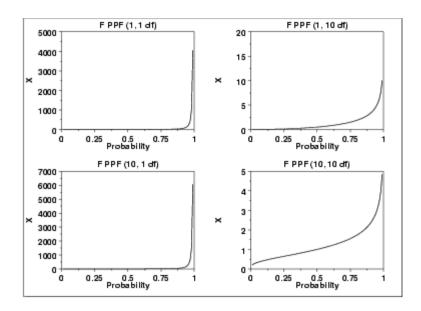

Other Probability Functions Since the F distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit the formulas and plots for the hazard, cumulative hazard, survival, and inverse survival probability functions.

Common Statistics

The formulas below are for the case where the location parameter is zero and the scale parameter is one.

Mean 
$$\frac{\nu_2}{(\nu_2-2)}$$
  $\nu_2>2$ 

Mode  $\frac{\nu_2(\nu_1-2)}{\nu_1(\nu_2+2)}$   $\nu_1>2$ 

Range 0 to positive infinity

Standard Deviation  $\sqrt{\frac{2\nu_2^2(\nu_1+\nu_2-2)}{\nu_1(\nu_2-2)^2(\nu_2-4)}}$   $\nu_2>4$ 

Coefficient of Variation  $\sqrt{\frac{2(\nu_1+\nu_2-2)}{\nu_1(\nu_2-4)}}$   $\nu_2>4$ 

Skewness  $\frac{(2\nu_1+\nu_2-2)\sqrt{8(\nu_2-4)}}{\sqrt{\nu_1}(\nu_2-6)\sqrt{(\nu_1+\nu_2-2)}}$   $\nu_2>6$ 

Parameter Estimation

Since the F distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit any discussion of parameter estimation.

**Comments** 

The F distribution is used in many cases for the critical regions for hypothesis tests and in determining confidence intervals. Two common examples are the <u>analysis of variance</u> and the <u>F test</u> to determine if the variances of two populations are equal.

Software

Most general purpose statistical software programs support at least some of the probability functions for the F distribution.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.6. Chi-Square Distribution

Probability
Density
Function

The chi-square distribution results when  $\nu$  independent variables with <u>standard normal</u> distributions are squared and summed. The formula for the <u>probability density function</u> of the chi-square distribution is


$$f(x)=rac{e^{rac{-x}{2}}x^{rac{
u}{2}-1}}{2^{rac{
u}{2}}\Gamma(rac{
u}{2})} \qquad ext{for } x\geq 0$$

where  $\nu$  is the shape parameter and  $\Gamma$  is the gamma function. The formula for the gamma function is

$$\Gamma(a)=\int_0^\infty t^{a-1}e^{-t}dt$$

In a testing context, the chi-square distribution is treated as a "standardized distribution" (i.e., no location or scale parameters). However, in a distributional modeling context (as with other probability distributions), the chi-square distribution itself can be transformed with a <u>location parameter</u>,  $\mu$ , and a <u>scale parameter</u>,  $\sigma$ .

The following is the plot of the chi-square probability density function for 4 different values of the shape parameter.

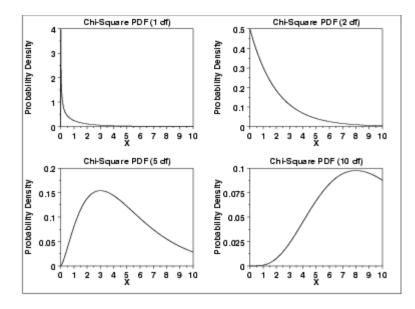


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the chi-square distribution is

$$F(x) = rac{\gamma(rac{
u}{2},rac{x}{2})}{\Gamma(rac{
u}{2})} \qquad ext{for } x \geq 0$$

where  $\Gamma$  is the gamma function defined above and  $\gamma$  is the incomplete gamma function. The formula for the incomplete gamma function is

$$\Gamma_x(a) = \int_0^x t^{a-1} e^{-t} dt$$


The following is the plot of the chi-square cumulative distribution function with the same values of  $\nu$  as the pdf plots above.

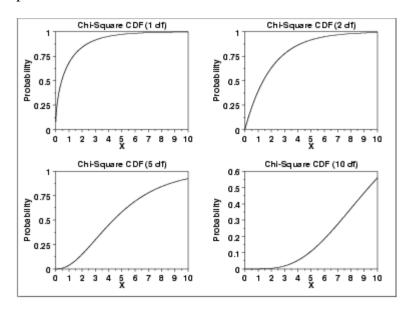

Percent
Point
Function

The formula for the <u>percent point function</u> of the chi-square distribution does not exist in a simple closed form. It is computed numerically.

The following is the plot of the chi-square percent point function with the same values of  $\nu$  as the pdf plots above.

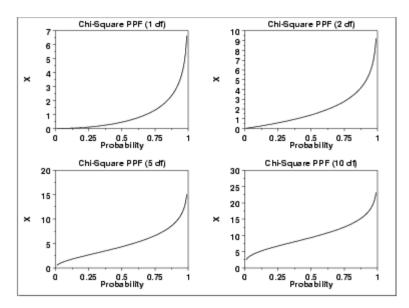

Other Probability Functions Since the chi-square distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit the formulas and plots for the hazard, cumulative hazard, survival, and inverse survival probability functions.

Common Statistics

Mean	υ
Median	approximately $\nu$ - 2/3 for large $\nu$
Mode	$ u-2 \qquad \text{for } \nu>2$
Range	0 to positive infinity
Standard Deviation	$\sqrt{2\nu}$
Coefficient of Variation	$\sqrt{\frac{2}{ u}}$
Skewness	$\frac{2^{1.5}}{\sqrt{5}}$
Kurtosis	$3 + \frac{12}{\nu}$

Parameter Estimation Since the chi-square distribution is typically used to develop hypothesis tests and confidence intervals and rarely for modeling applications, we omit any discussion of parameter estimation.

**Comments** 

The chi-square distribution is used in many cases for the critical regions for hypothesis tests and in determining confidence intervals. Two common examples are the chi-square test for independence in an *RxC* contingency table and the chi-square test to determine if the standard deviation of a population is equal to a pre-specified value.

Software

Most general purpose statistical software programs support at least some of the probability functions for the chi-square distribution.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

# 1.3.6.6.7. Exponential Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the exponential distribution is


$$f(x) = \frac{1}{\beta}e^{-(x-\mu)/\beta}$$
  $x \ge \mu; \beta > 0$ 

where  $\mu$  is the <u>location parameter</u> and  $\beta$  is the <u>scale</u> parameter (the scale parameter is often referred to as  $\lambda$  which equals  $1/\beta$ ). The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard exponential distribution**. The equation for the standard exponential distribution is

$$f(x) = e^{-x}$$
 for  $x \ge 0$ 

The general form of probability functions can be <u>expressed</u> in terms of the <u>standard distribution</u>. Subsequent formulas in this section are given for the 1-parameter (i.e., with scale parameter) form of the function.

The following is the plot of the exponential probability density function.

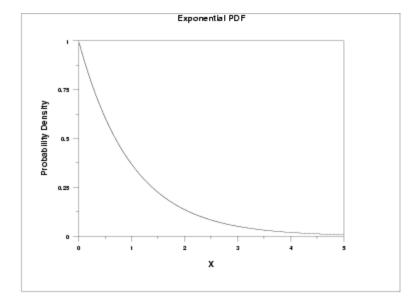


Cumulative Distribution

The formula for the <u>cumulative distribution function</u> of the exponential distribution is

**Function** 

$$F(x)=1-e^{-x/\beta} \qquad x\geq 0; \beta>0$$


The following is the plot of the exponential cumulative distribution function.

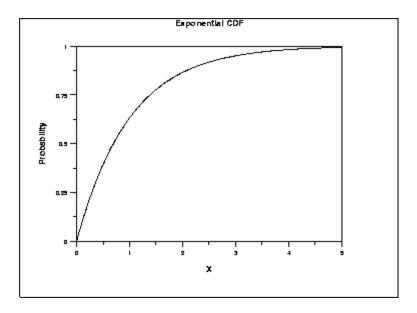

Percent Point Function The formula for the <u>percent point function</u> of the exponential distribution is

$$G(p) = -\beta \ln(1-p) \qquad 0 \le p < 1; \beta > 0$$


The following is the plot of the exponential percent point function.

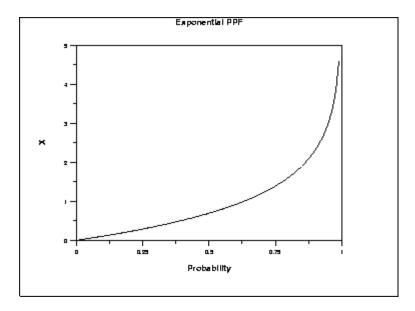

Hazard Function The formula for the <u>hazard function</u> of the exponential distribution is

$$h(x) = \frac{1}{\beta}$$
  $x \ge 0; \beta > 0$ 


The following is the plot of the exponential hazard function.

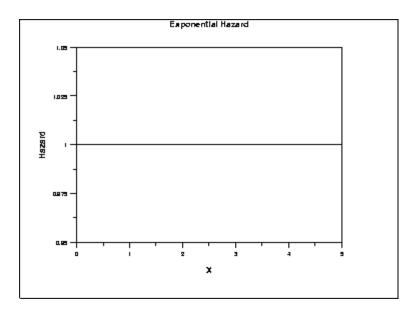

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the exponential distribution is

$$H(x)=\frac{x}{\beta} \qquad x\geq 0; \beta>0$$


The following is the plot of the exponential cumulative hazard function.

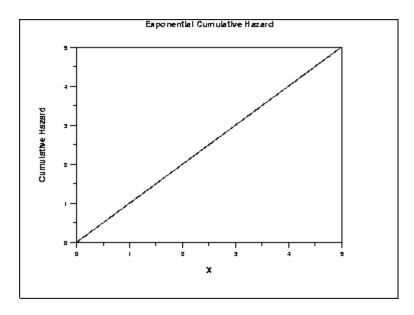

Survival Function The formula for the <u>survival function</u> of the exponential distribution is

$$S(x)=e^{-x/\beta} \qquad x\geq 0; \beta>0$$


The following is the plot of the exponential survival function.

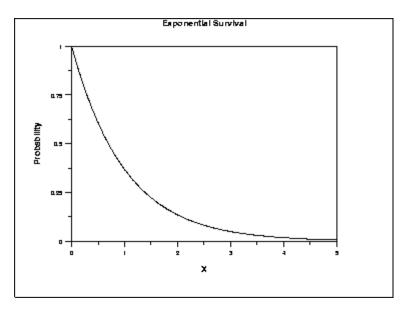

Inverse Survival Function The formula for the <u>inverse survival function</u> of the exponential distribution is

$$Z(p) = -\beta \ln(p) \qquad 0 \le p < 1; \beta > 0$$

The following is the plot of the exponential inverse survival function.

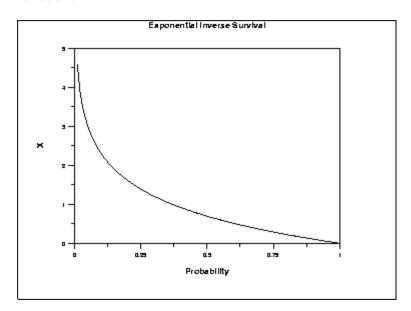

Common Statistics

Range Zero to plus infinity

Standard  $\beta$ 

Deviation

Coefficient of 1

Variation

Skewness 2

Kurtosis 9

Parameter Estimation For the full sample case, the maximum likelihood estimator of the scale parameter is the sample mean. Maximum likelihood estimation for the exponential distribution is discussed in the chapter on reliability (Chapter 8). It is also discussed in chapter 19 of Johnson, Kotz, and Balakrishnan.

Comments

The exponential distribution is primarily used in <u>reliability</u> applications. The exponential distribution is used to model data with a constant failure rate (indicated by the hazard plot which is simply equal to a constant).

*Software* 

Most general purpose statistical software programs support at least some of the probability functions for the exponential distribution.



HOME

TOOLS & AIDS

SEARCH



### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.8. Weibull Distribution

Probability
Density
Function

The formula for the <u>probability density function</u> of the general Weibull distribution is


$$f(x) = \frac{\gamma}{\alpha} (\frac{x-\mu}{\alpha})^{(\gamma-1)} \exp\left(-((x-\mu)/\alpha)^{\gamma}\right) \qquad x \ge \mu; \gamma, \alpha > 0$$

where  $\gamma$  is the <u>shape parameter</u>,  $\mu$  is the <u>location parameter</u> and  $\alpha$  is the <u>scale parameter</u>. The case where  $\mu = 0$  and  $\alpha = 1$  is called the **standard Weibull distribution**. The case where  $\mu = 0$  is called the 2-parameter Weibull distribution. The equation for the standard Weibull distribution reduces to

$$f(x) = \gamma x^{(\gamma-1)} \exp(-(x^{\gamma}))$$
  $x \ge 0; \gamma > 0$ 

Since the general form of probability functions can be <u>expressed in terms of the standard distribution</u>, all subsequent formulas in this section are given for the standard form of the function.


The following is the plot of the Weibull probability density function.

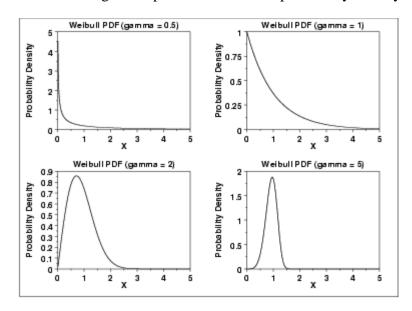

Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the Weibull distribution is

$$F(x) = 1 - e^{-(x^{\gamma})}$$
  $x \ge 0; \gamma > 0$ 


The following is the plot of the Weibull cumulative distribution function with the same values of  $\gamma$  as the pdf plots above.

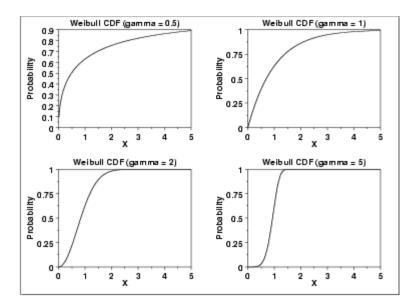

Percent Point Function The formula for the <u>percent point function</u> of the Weibull distribution is

$$G(p) = (-\ln(1-p))^{1/\gamma} \qquad 0 \le p < 1; \gamma > 0$$


The following is the plot of the Weibull percent point function with the same values of  $\gamma$  as the pdf plots above.

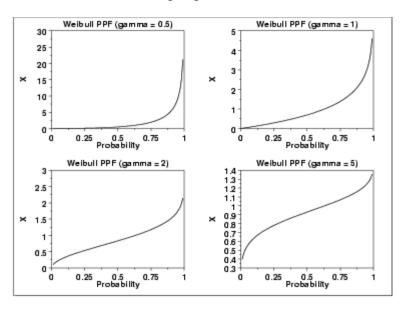

Hazard Function The formula for the <u>hazard function</u> of the Weibull distribution is

$$h(x) = \gamma x^{(\gamma - 1)}$$
  $x \ge 0; \gamma > 0$ 


The following is the plot of the Weibull hazard function with the same values of  $\gamma$  as the pdf plots above.

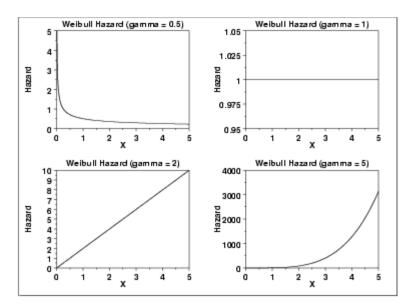

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the Weibull distribution is

$$H(x) = x^{\gamma}$$
  $x \ge 0; \gamma > 0$ 

The following is the plot of the Weibull cumulative hazard function with the same values of  $\gamma$  as the pdf plots above.

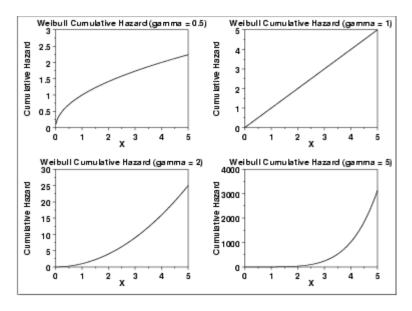


Survival Function

The formula for the <u>survival function</u> of the Weibull distribution is

$$S(x) = \exp{-(x^{\gamma})} \qquad x \ge 0; \gamma > 0$$


The following is the plot of the Weibull survival function with the same values of  $\gamma$  as the pdf plots above.

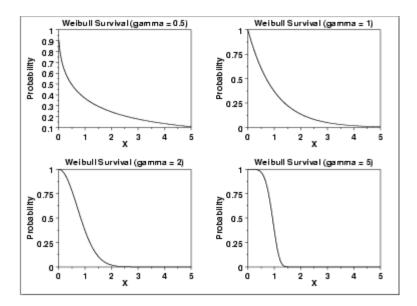

Inverse Survival Function The formula for the <u>inverse survival function</u> of the Weibull distribution is

$$Z(p) = (-\ln(p))^{1/\gamma}$$
  $0 \le p < 1; \gamma > 0$ 

The following is the plot of the Weibull inverse survival function with the same values of  $\gamma$  as the pdf plots above.

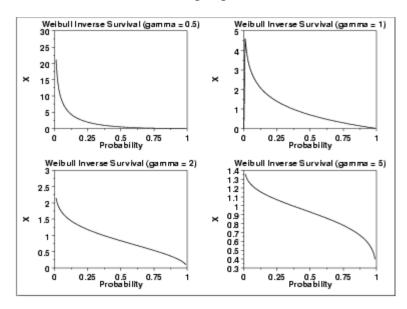

Common Statistics

The formulas below are with the location parameter equal to zero and the scale parameter equal to one.

Mean

 $\Gamma(\frac{\gamma+1}{\gamma})$ 

where  $\Gamma$  is the gamma function

 $\Gamma(a)=\int_0^\infty t^{a-1}e^{-t}dt \ \ln(2)^{1/\gamma}$ 

Median

Mode

$$(1-\frac{1}{\gamma})^{1/\gamma} \qquad \gamma > 1$$

$$0 \qquad \gamma \leq 1$$
Range Standard Deviation 
$$\sqrt{\Gamma(\frac{\gamma+2}{\gamma}) - (\Gamma(\frac{\gamma+1}{\gamma}))^2}$$
Coefficient of Variation 
$$\sqrt{\frac{\Gamma(\frac{\gamma+2}{\gamma})}{(\Gamma(\frac{\gamma+1}{\gamma}))^2} - 1}$$

Parameter Estimation Maximum likelihood estimation for the Weibull distribution is discussed in the Reliability chapter (Chapter 8). It is also discussed in Chapter 21 of Johnson, Kotz, and Balakrishnan.

**Comments** 

The Weibull distribution is used extensively in <u>reliability</u> applications to model failure times.

*Software* 

Most general purpose statistical software programs support at least some of the probability functions for the Weibull distribution.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.9. Lognormal Distribution

Probability
Density
Function

A variable X is lognormally distributed if Y = LN(X) is normally distributed with "LN" denoting the natural logarithm. The general formula for the <u>probability density function</u> of the lognormal distribution is

$$f(x) = \frac{e^{-((\ln((x-\theta)/m))^2/(2\sigma^2))}}{(x-\theta)\sigma\sqrt{2\pi}} \qquad x \ge \theta; m, \sigma > 0$$


where  $\sigma$  is the <u>shape parameter</u>,  $\theta$  is the <u>location parameter</u> and m is the <u>scale parameter</u>. The case where  $\theta = 0$  and m = 1 is called the **standard lognormal distribution**. The case where  $\theta$  equals zero is called the 2-parameter lognormal distribution.

The equation for the standard lognormal distribution is

$$f(x) = \frac{e^{-((\ln x)^2/2\sigma^2)}}{x\sigma\sqrt{2\pi}} \qquad x \ge 0; \sigma > 0$$

Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the lognormal probability density function for four values of  $\sigma$ .

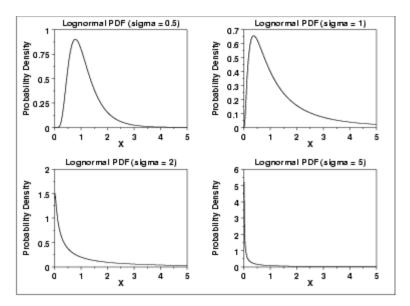


There are several common parameterizations of the lognormal distribution. The form given here is from <u>Evans</u>, <u>Hastings</u>, and <u>Peacock</u>.

Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the lognormal distribution is

$$F(x) = \Phi(\frac{\ln(x)}{\sigma}) \qquad x \ge 0; \sigma > 0$$

where  $\Phi$  is the <u>cumulative distribution function of the normal distribution</u>.

The following is the plot of the lognormal cumulative distribution function with the same values of  $\sigma$  as the pdf plots above.

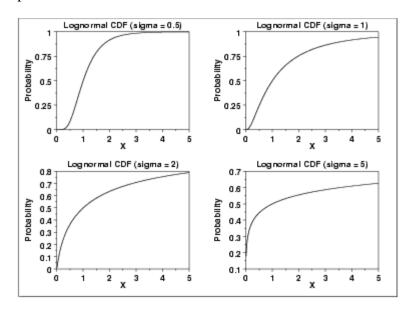


Percent Point Function The formula for the <u>percent point function</u> of the lognormal distribution is

$$G(p) = \exp(\sigma \Phi^{-1}(p))$$
  $0 \le p < 1; \sigma > 0$ 

where  $\Phi^{-1}$  is the percent point function of the normal distribution.

The following is the plot of the lognormal percent point function with the same values of  $\sigma$  as the pdf plots above.

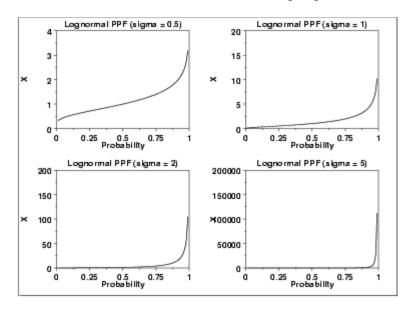


Hazard Function The formula for the <u>hazard function</u> of the lognormal distribution is

$$h(x,\sigma) = \frac{(\frac{1}{x\sigma})\phi(\frac{\ln x}{\sigma})}{\Phi(\frac{-\ln x}{\sigma})} \qquad x>0; \sigma>0$$

where  $\phi$  is the probability density function of the normal distribution and  $\Phi$  is the cumulative distribution function of the normal distribution.

The following is the plot of the lognormal hazard function with the same values of  $\sigma$  as the pdf plots above.

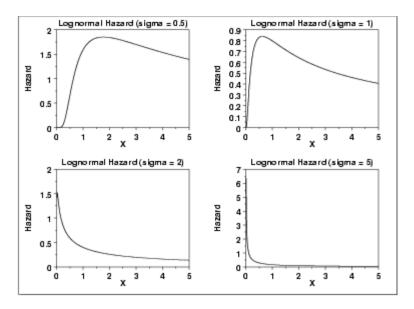


Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the lognormal distribution is

$$H(x) = -\ln(1 - \Phi(\frac{\ln(x)}{\sigma}))$$
  $x \ge 0; \sigma > 0$ 

where  $\Phi$  is the <u>cumulative distribution function of the normal</u> distribution.

The following is the plot of the lognormal cumulative hazard function with the same values of  $\sigma$  as the pdf plots above.

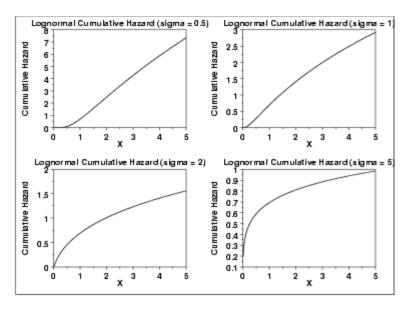


Survival Function The formula for the <u>survival function</u> of the lognormal distribution is

$$S(x) = 1 - \Phi(\frac{\ln(x)}{\sigma}) \qquad x \ge 0; \sigma > 0$$

where  $\Phi$  is the <u>cumulative distribution function of the normal distribution</u>.

The following is the plot of the lognormal survival function with the same values of  $\sigma$  as the pdf plots above.

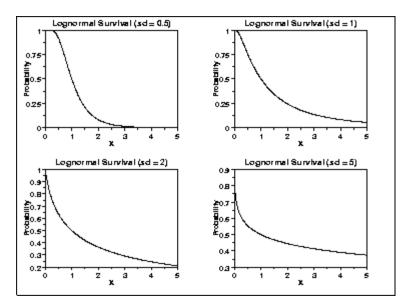


Inverse Survival Function The formula for the <u>inverse survival function</u> of the lognormal distribution is

$$Z(p) = \exp(\sigma\Phi^{-1}(1-p)) \qquad 0 \le p < 1; \sigma > 0$$

where  $\Phi^{-1}$  is the percent point function of the normal distribution.

The following is the plot of the lognormal inverse survival function with the same values of  $\sigma$  as the pdf plots above.

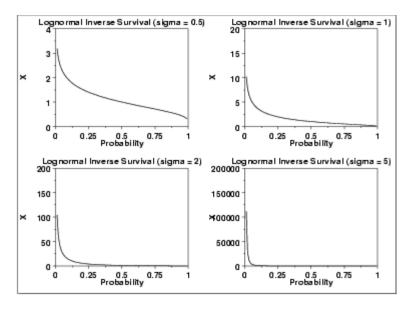

Common Statistics

The formulas below are with the location parameter equal to zero and the scale parameter equal to one.

Mean	$e^{0.5\sigma^2}$
Median	Scale parameter $m$ (= 1 if scale parameter
	not specified).
Mode	1
	$\overline{e^{\sigma^2}}$
Range	Zero to positive infinity

Standard Deviation	$\sqrt{e^{\sigma^2}(e^{\sigma^2}-1)}$
Skewness	$(e^{\sigma^2}+2)\sqrt{e^{\sigma^2}-1}$
Kurtosis	$(e^{\sigma^2})^4 + 2(e^{\sigma^2})^3 + 3(e^{\sigma^2})^2 - 3$
Coefficient of	$\sqrt{e^{\sigma^2}-1}$
Variation	$\Lambda_c$ – 1

Parameter Estimation The maximum likelihood estimates for the scale parameter, m, and the shape parameter,  $\sigma$ , are

$$\hat{m} = \exp \hat{\mu}$$

and

$$\hat{\sigma} = \sqrt{\frac{\sum_{i=1}^{N} (\ln(X_i) - \hat{\mu})^2}{N}}$$

where

$$\hat{\mu} = \frac{\sum_{i=1}^{N} \ln X_i}{N}$$

If the location parameter is known, it can be subtracted from the original data points before computing the maximum likelihood estimates of the shape and scale parameters.

Comments

The lognormal distribution is used extensively in <u>reliability</u> applications to model failure times. The lognormal and <u>Weibull</u> distributions are probably the most commonly used distributions in reliability applications.

*Software* 

Most general purpose statistical software programs support at least some of the probability functions for the lognormal distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

# 1.3.6.6.10. Birnbaum-Saunders (Fatigue Life) Distribution

Probability
Density
Function

The Birnbaum-Saunders distribution is also commonly known as the fatigue life distribution. There are several alternative formulations of the Birnbaum-Saunders distribution in the literature.

The general formula for the <u>probability density function</u> of the Birnbaum-Saunders distribution is


$$f(x) = (\frac{\sqrt{\frac{x-\mu}{\beta}} + \sqrt{\frac{\beta}{x-\mu}}}{2\gamma(x-\mu)})\phi(\frac{\sqrt{\frac{x-\mu}{\beta}} - \sqrt{\frac{\beta}{x-\mu}}}{\gamma}) \qquad x > \mu; \gamma, \beta > 0$$

where  $\gamma$  is the <u>shape parameter</u>,  $\mu$  is the <u>location parameter</u>,  $\beta$  is the <u>scale parameter</u>,  $\phi$  is the probability density function of the <u>standard normal</u> distribution, and  $\Phi$  is the cumulative distribution function of the <u>standard normal</u> distribution. The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard Birnbaum-Saunders distribution**. The equation for the standard Birnbaum-Saunders distribution reduces to

$$f(x)=(\frac{\sqrt{x}+\sqrt{\frac{1}{x}}}{2\gamma x})\phi(\frac{\sqrt{x}-\sqrt{\frac{1}{x}}}{\gamma}) \qquad x>0; \gamma>0$$

Since the general form of probability functions can be <u>expressed in terms of the standard distribution</u>, all subsequent formulas in this section are given for the standard form of the function.


The following is the plot of the Birnbaum-Saunders probability density function.

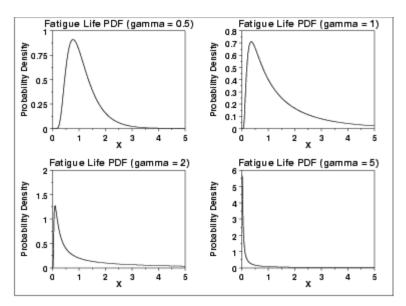

Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the Birnbaum-Saunders distribution is

$$F(x)=\Phi(rac{\sqrt{x}-\sqrt{rac{1}{x}}}{\gamma}) \qquad x>0; \gamma>0$$

where  $\Phi$  is the cumulative distribution function of the <u>standard normal</u> distribution. The following is the plot of the Birnbaum-Saunders cumulative distribution function with the same values of  $\gamma$  as the pdf plots above.

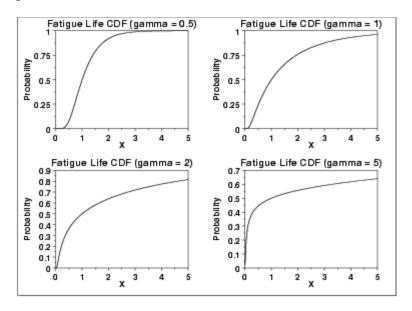


Percent Point Function The formula for the <u>percent point function</u> of the Birnbaum-Saunders distribution is

$$G(p) = rac{1}{4} \left[ \gamma \Phi^{-1}(p) + \sqrt{4 + (\gamma \Phi^{-1}(p))^2} 
ight]^2$$


where  $\Phi^{-1}$  is the percent point function of the <u>standard normal</u> distribution. The following is the plot of the Birnbaum-Saunders percent point function with the same values of  $\gamma$  as the pdf plots

above.

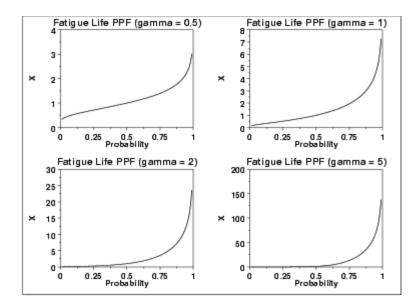


Hazard Function The Birnbaum-Saunders <u>hazard function</u> can be computed from the Birnbaum-Saunders probability density and cumulative distribution functions.

The following is the plot of the Birnbaum-Saunders hazard function with the same values of  $\gamma$  as the pdf plots above.

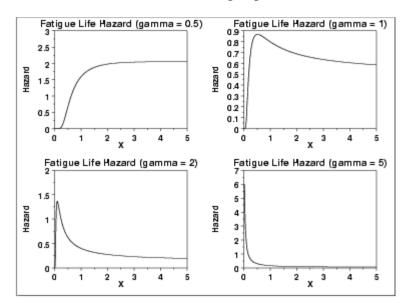

Cumulative Hazard Function The Birnbaum-Saunders <u>cumulative hazard function</u> can be computed from the Birnbaum-Saunders cumulative distribution function.


The following is the plot of the Birnbaum-Saunders cumulative hazard function with the same values of  $\gamma$  as the pdf plots above.

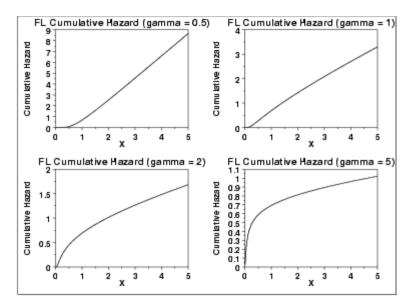

Survival Function

The Birnbaum-Saunders <u>survival function</u> can be computed from the Birnbaum-Saunders cumulative distribution function.


The following is the plot of the Birnbaum-Saunders survival function with the same values of  $\gamma$  as the pdf plots above.

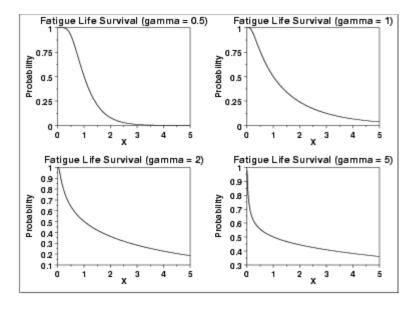

Inverse Survival Function

The Birnbaum-Saunders <u>inverse survival function</u> can be computed from the Birnbaum-Saunders percent point function.

The following is the plot of the gamma inverse survival function with the same values of  $\gamma$  as the pdf plots above.

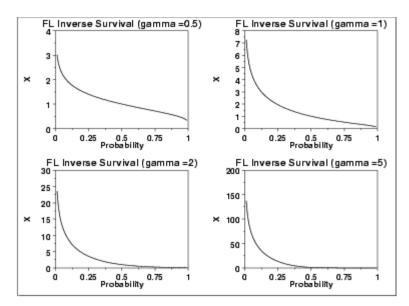

Common Statistics

The formulas below are with the location parameter equal to zero and the scale parameter equal to one.

$$\begin{array}{ll} \text{Mean} & 1+\frac{\gamma^2}{2} \\ \text{Range} & \text{Zero to positive infinity.} \\ \text{Standard Deviation} & \gamma\sqrt{1+\frac{5\gamma^2}{4}} \\ \text{Coefficient of Variation} & \frac{2+\gamma^2}{\gamma\sqrt{1+5\gamma^2}} \end{array}$$

Parameter Estimation Maximum likelihood estimation for the Birnbaum-Saunders distribution is discussed in the Reliability chapter.

**Comments** 

The Birnbaum-Saunders distribution is used extensively in <u>reliability</u> applications to model failure times.

*Software* 

Some general purpose statistical software programs, including <u>Dataplot</u>, support at least some of the probability functions for the Birnbaum-Saunders distribution. Support for this distribution is likely to be available for statistical programs that emphasize reliability applications.

The "bs" package implements support for the Birnbaum-Saunders distribution for the R package. See

Leiva, V., Hernandez, H., and Riquelme, M. (2006). A New Package for the Birnbaum-Saunders Distribution. *Rnews*, 6/4, 35-40. (<a href="http://www.r-project.org">http://www.r-project.org</a>)



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

#### 1.3.6.6.11. Gamma Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the gamma distribution is

$$f(x) = \frac{\left(\frac{x-\mu}{\beta}\right)^{\gamma-1} \exp\left(-\frac{x-\mu}{\beta}\right)}{\beta \Gamma(\gamma)} \qquad x \ge \mu; \gamma, \beta > 0$$

where  $\gamma$  is the <u>shape parameter</u>,  $\mu$  is the <u>location parameter</u>,  $\beta$  is the <u>scale parameter</u>, and  $\Gamma$  is the gamma function which has the formula


$$\Gamma(a)=\int_0^\infty t^{a-1}e^{-t}dt$$

The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard** gamma distribution. The equation for the standard gamma distribution reduces to

$$f(x) = \frac{x^{\gamma-1}e^{-x}}{\Gamma(\gamma)} \qquad x \ge 0; \gamma > 0$$

Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the gamma probability density function.

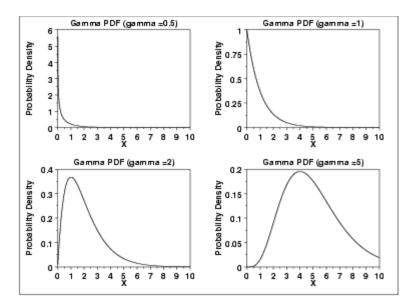


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the gamma distribution is

$$F(x) = rac{\Gamma_x(\gamma)}{\Gamma(\gamma)} \qquad x \geq 0; \gamma > 0$$

where  $\Gamma$  is the gamma function defined above and  $\Gamma_x(a)$  is the incomplete gamma function. The incomplete gamma function has the formula

$$\Gamma_x(a)=\int_0^x t^{a-1}e^{-t}dt$$


The following is the plot of the gamma cumulative distribution function with the same values of  $\gamma$  as the pdf plots above.

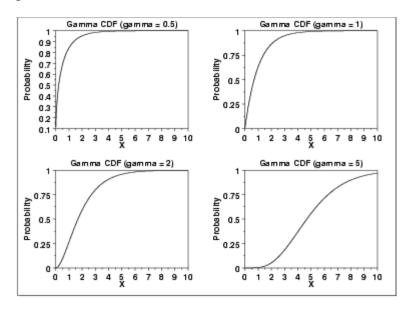

Percent Point Function

The formula for the <u>percent point function</u> of the gamma distribution does not exist in a simple closed form. It is computed numerically.


The following is the plot of the gamma percent point function with the same values of  $\gamma$  as the pdf plots above.

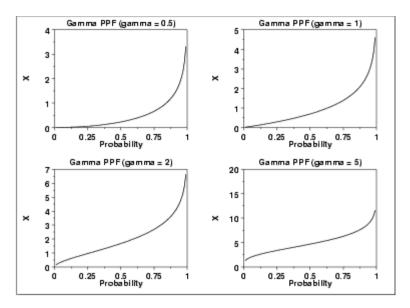

Hazard Function The formula for the <u>hazard function</u> of the gamma distribution is

$$h(x) = \frac{x^{\gamma-1}e^{-x}}{\Gamma(\gamma) - \Gamma_x(\gamma)} \qquad x \ge 0; \gamma > 0$$

The following is the plot of the gamma hazard function with the same values of  $\gamma$  as the pdf plots above.

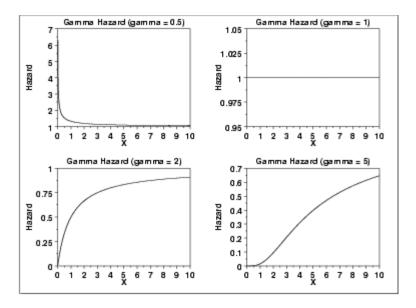


Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the gamma distribution is

$$H(x) = -\log{(1 - \frac{\Gamma_x(\gamma)}{\Gamma(\gamma)})} \qquad x \ge 0; \gamma > 0$$

where  $\Gamma$  is the gamma function defined above and  $\Gamma_x(a)$  is the incomplete gamma function defined above.

The following is the plot of the gamma cumulative hazard function with the same values of  $\gamma$  as the pdf plots above.

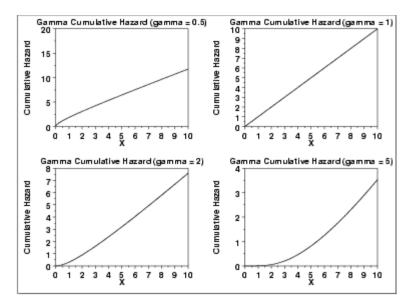


Survival Function The formula for the <u>survival function</u> of the gamma distribution is

$$S(x) = 1 - rac{\Gamma_x(\gamma)}{\Gamma(\gamma)} \qquad x \ge 0; \gamma > 0$$


where  $\Gamma$  is the gamma function defined above and  $\Gamma_x(a)$  is the incomplete gamma function defined above.

The following is the plot of the gamma survival function with the same values of  $\gamma$  as the pdf plots above.

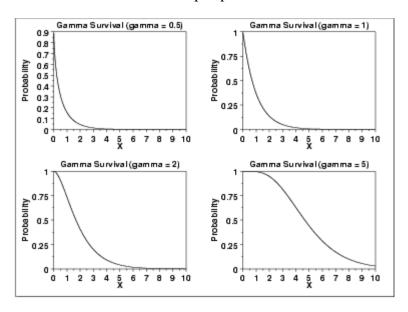

Inverse Survival Function The gamma <u>inverse survival function</u> does not exist in simple closed form. It is computed numberically.

The following is the plot of the gamma inverse survival function with the same values of  $\gamma$  as the pdf plots above.

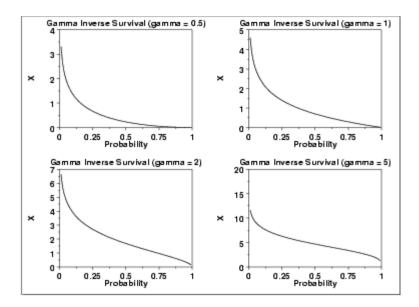

# Common Statistics

The formulas below are with the location parameter equal to zero and the scale parameter equal to one.

Mean	$\gamma$
Mode	$\gamma - 1$ $\gamma \ge 1$
Range	Zero to positive infinity.
Standard Deviation	$\sqrt{\gamma}$
Skewness	$\frac{2}{\sqrt{\gamma}}$
Kurtosis	$3+\frac{6}{\gamma}$
Coefficient of Variation	$\frac{1}{\sqrt{\gamma}}$

#### Parameter Estimation

The method of moments estimators of the gamma distribution are

$$\hat{\gamma}=(\frac{\bar{x}}{s})^2$$

$$\hat{eta} = rac{s^2}{ar{x}}$$

where  $\bar{x}$  and s are the sample mean and standard deviation, respectively.

The equations for the maximum likelihood estimation of the shape and scale parameters are given in Chapter 18 of Evans, Hastings, and Peacock and Chapter 17 of Johnson, Kotz, and Balakrishnan. These equations need to be solved numerically; this is typically accomplished by using statistical software packages.

Software

Some general purpose statistical software programs support at least some of the probability functions for the gamma distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

# 1.3.6.6.12. Double Exponential Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the double exponential distribution is


$$f(x) = \frac{e^{-|\frac{x-\mu}{\beta}|}}{2\beta}$$

where  $\mu$  is the <u>location parameter</u> and  $\beta$  is the <u>scale</u> <u>parameter</u>. The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard double exponential distribution**. The equation for the standard double exponential distribution is

$$f(x)=rac{e^{-|x|}}{2}$$

Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the double exponential probability density function.

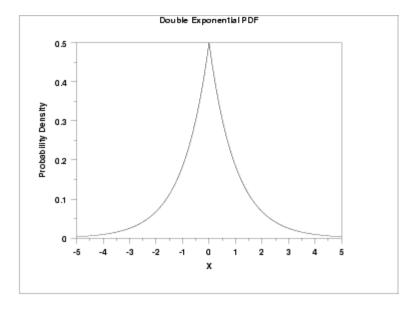


Cumulative Distribution

The formula for the <u>cumulative distribution function</u> of the double exponential distribution is

**Function** 

$$F(x) = \begin{array}{cc} \frac{e^x}{2} & \text{for } x < 0 \\ 1 - \frac{e^{-x}}{2} & \text{for } x \ge 0 \end{array}$$


The following is the plot of the double exponential cumulative distribution function.

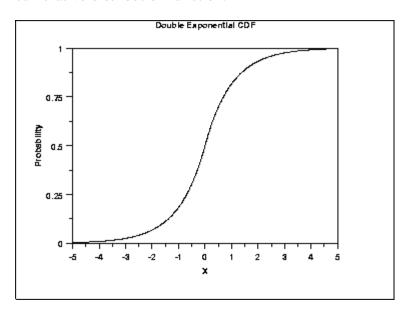

Percent Point Function The formula for the <u>percent point function</u> of the double exponential distribution is

$$G(P) = \begin{array}{ll} \log(2p) & \text{for } p \leq 0.5 \\ -\log(2(1-p)) & \text{for } p > 0.5 \end{array}$$


The following is the plot of the double exponential percent point function.

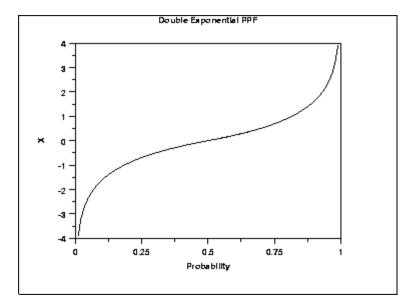

Hazard Function The formula for the <u>hazard function</u> of the double exponential distribution is

$$h(x) = \begin{array}{cc} \frac{e^{\mathbf{X}}}{2-e^{\mathbf{X}}} & \text{for } x < 0 \\ 1 & \text{for } x \ge 0 \end{array}$$


The following is the plot of the double exponential hazard function.

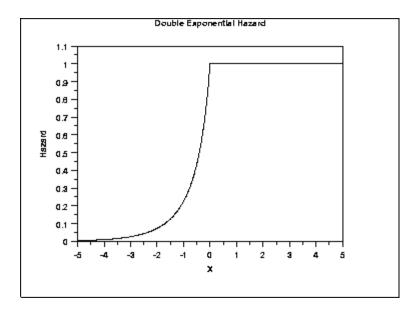

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the double exponential distribution is

$$H(x) = \begin{array}{ll} -log(1 - \frac{e^{\mathbf{X}}}{2}) & \text{for } x < 0 \\ x + \log(2) & \text{for } x \ge 0 \end{array}$$


The following is the plot of the double exponential cumulative hazard function.

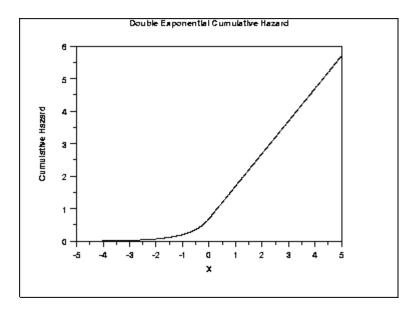

Survival Function The double exponential <u>survival function</u> can be computed from the cumulative distribution function of the double exponential distribution.

The following is the plot of the double exponential survival


function.

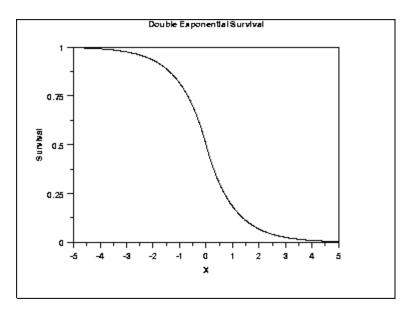

Inverse Survival Function The formula for the <u>inverse survival function</u> of the double exponential distribution is

$$Z(P) = egin{array}{ll} \log(2(1-p)) & \mbox{for } p \leq 0.5 \\ -\log(2p) & \mbox{for } p > 0.5 \end{array}$$

The following is the plot of the double exponential inverse survival function.

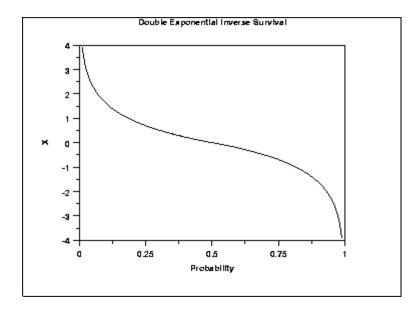

Common Statistics

Mean  $\mu$  Median  $\mu$  Mode  $\mu$ 

Range Negative infinity to positive infinity Standard  $\sqrt{2}\beta$ 

Standard Deviation

Skewness 0 Kurtosis 6

Coefficient of Variation 
$$\sqrt{2}(\frac{\beta}{\mu})$$

Parameter Estimation The maximum likelihood estimators of the location and scale parameters of the double exponential distribution are

$$\hat{\mu} = \tilde{X}$$

$$\hat{\beta} = \frac{\sum_{i=1}^{N} |X_i - \tilde{X}|}{N}$$

where  $\tilde{X}$  is the sample median.

Software

Some general purpose statistical software programs support at least some of the probability functions for the double exponential distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

#### 1.3.6.6.13. Power Normal Distribution

Probability
Density
Function


The formula for the <u>probability density function</u> of the standard form of the power normal distribution is

$$f(x,p) = p\phi(x)(\Phi(-x))^{p-1}$$
  $x, p > 0$ 

where p is the <u>shape parameter</u> (also referred to as the power parameter),  $\Phi$  is the cumulative distribution function of the <u>standard normal</u> distribution, and  $\phi$  is the probability density function of the <u>standard normal</u> distribution.

As with other probability distributions, the power normal distribution can be transformed with a location parameter,  $\mu$ , and a scale parameter,  $\sigma$ . We omit the equation for the general form of the power normal distribution. Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the power normal probability density function with four values of p.

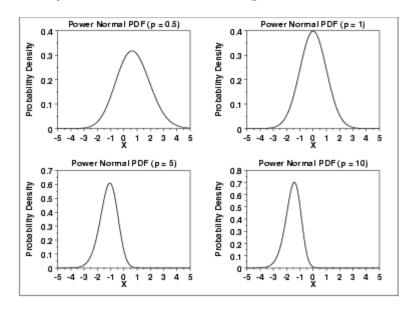


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the power normal distribution is

$$F(x,p) = 1 - (\Phi(-x))^p$$
  $x, p > 0$ 

where  $\Phi$  is the cumulative distribution function of the standard <u>normal</u> distribution.

The following is the plot of the power normal cumulative distribution function with the same values of p as the pdf plots above.

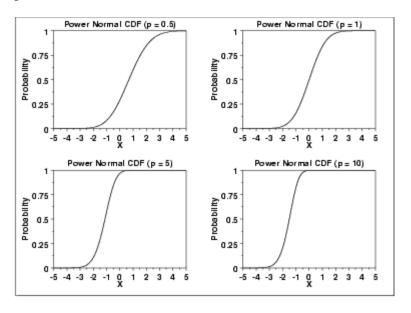


Percent Point Function The formula for the <u>percent point function</u> of the power normal distribution is

$$G(f) = \Phi^{-1}(1 - (1-f)^{1/p}) \qquad 0 < f < 1; p > 0$$

where  $\Phi^{-1}$  is the percent point function of the standard normal distribution.

The following is the plot of the power normal percent point function with the same values of p as the pdf plots above.

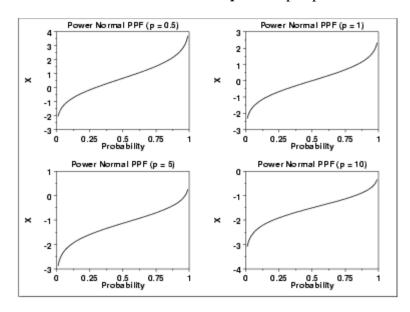

Hazard


The formula for the <u>hazard function</u> of the power normal

Function

distribution is

$$h(x,p)=\frac{p\phi(x)}{\Phi(-x)} \qquad x,p>0$$


The following is the plot of the power normal hazard function with the same values of p as the pdf plots above.

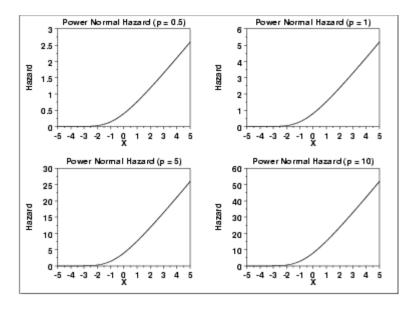

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the power normal distribution is

$$H(x,p) = -\log\left((\Phi(-x))^p\right) \qquad x,p > 0$$


The following is the plot of the power normal cumulative hazard function with the same values of p as the pdf plots above.

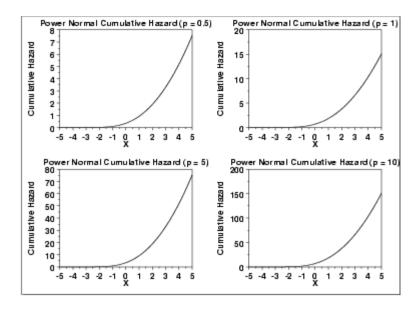

Survival Function The formula for the <u>survival function</u> of the power normal distribution is

$$S(x,p) = (\Phi(-x))^p \qquad x, p > 0$$


The following is the plot of the power normal survival function with the same values of p as the pdf plots above.

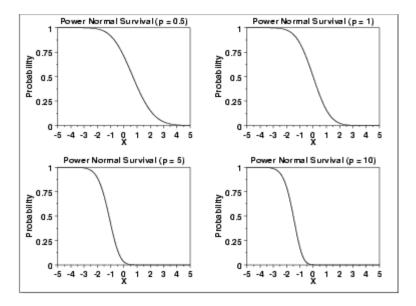

Inverse Survival Function The formula for the <u>inverse survival function</u> of the power normal distribution is

$$Z(f) = \Phi^{-1}(1 - f^{1/p})$$
  $0 < f < 1; p > 0$ 

The following is the plot of the power normal inverse survival function with the same values of p as the pdf plots above.

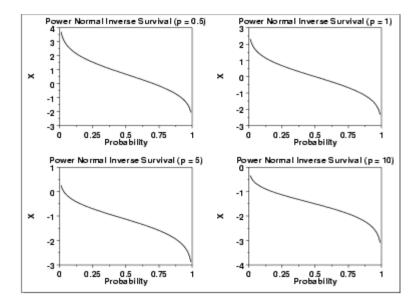

Common Statistics

The statistics for the power normal distribution are complicated and require tables. <u>Nelson</u> discusses the mean, median, mode, and standard deviation of the power normal distribution and provides references to the appropriate tables.

Software

Most general purpose statistical software programs do not support the probability functions for the power normal distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

## 1.3.6.6.14. Power Lognormal Distribution

Probability
Density
Function


The formula for the <u>probability density function</u> of the standard form of the power lognormal distribution is

$$f(x,p,\sigma) = (rac{p}{x\sigma})\phi(rac{\log x}{\sigma})(\Phi(rac{-\log x}{\sigma}))^{p-1} \qquad x,p,\sigma>0$$

where p (also referred to as the power parameter) and  $\sigma$  are the <u>shape parameters</u>,  $\Phi$  is the cumulative distribution function of the <u>standard normal</u> distribution, and  $\phi$  is the probability density function of the <u>standard normal</u> distribution.

As with other probability distributions, the power lognormal distribution can be transformed with a <u>location parameter</u>,  $\mu$ , and a <u>scale parameter</u>, B. We omit the equation for the general form of the power lognormal distribution. Since the general form of probability functions can be <u>expressed in terms of the standard distribution</u>, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the power lognormal probability density function with four values of p and  $\sigma$  set to 1.

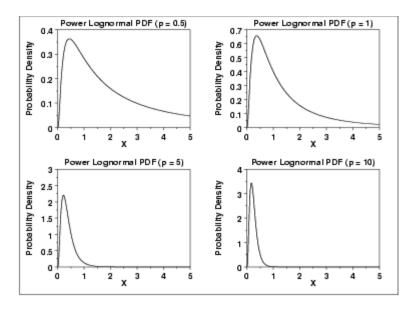


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the power lognormal distribution is

$$F(x, p, \sigma) = 1 - (\Phi(\frac{-\log x}{\sigma}))^p$$
  $x, p, \sigma > 0$ 

where  $\Phi$  is the cumulative distribution function of the standard <u>normal</u> distribution.

The following is the plot of the power lognormal cumulative distribution function with the same values of p as the pdf plots above.

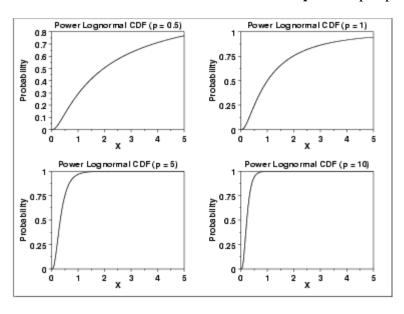


Percent Point Function The formula for the <u>percent point function</u> of the power lognormal distribution is

$$G(f,p,\sigma) = \exp{(\Phi^{-1}(1-(1-f)^{1/p})\sigma)} \qquad 0 0$$

where  $\Phi^{-1}$  is the percent point function of the standard <u>normal</u> distribution.

The following is the plot of the power lognormal percent point function with the same values of p as the pdf plots above.

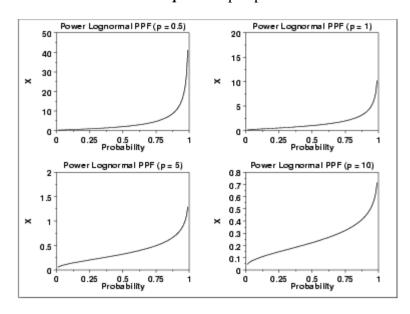

Hazard The formula for the <u>hazard function</u> of the power lognormal distribution

**Function** 


is

$$h(x,p,\sigma) = rac{p(rac{1}{x\sigma})\phi(rac{\log x}{\sigma})}{\Phi(rac{-\log x}{\sigma})} \qquad x,p,\sigma > 0$$

where  $\Phi$  is the cumulative distribution function of the standard normal distribution, and  $\phi$  is the probability density function of the standard normal distribution.

Note that this is simply a multiple (p) of the <u>lognormal hazard function</u>.


The following is the plot of the power lognormal hazard function with the same values of p as the pdf plots above.

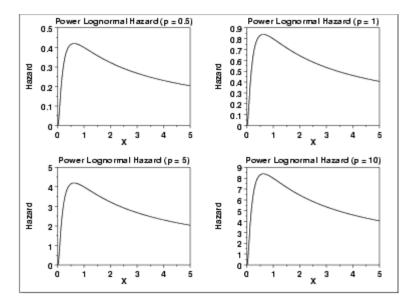

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the power lognormal distribution is

$$H(x,p,\sigma) = -\log ((\Phi(\frac{-\log x}{\sigma}))^p) \qquad x,p,\sigma > 0$$


The following is the plot of the power lognormal cumulative hazard function with the same values of p as the pdf plots above.

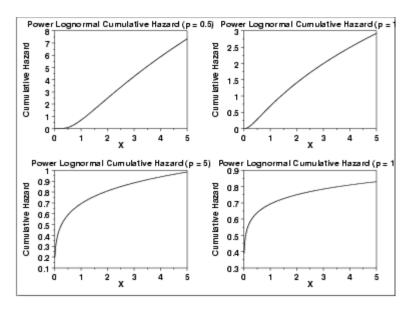

Survival Function The formula for the <u>survival function</u> of the power lognormal distribution is

$$S(x,p,\sigma) = (\Phi(\frac{-\log x}{\sigma}))^p \qquad x,p,\sigma > 0$$


The following is the plot of the power lognormal survival function with the same values of p as the pdf plots above.

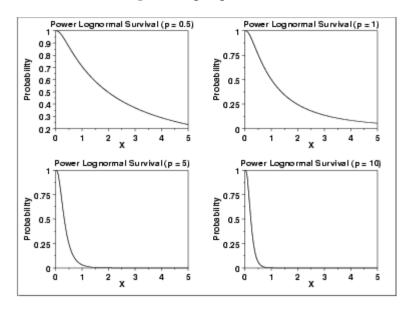

Inverse Survival Function The formula for the <u>inverse survival function</u> of the power lognormal distribution is

$$Z(f,p,\sigma) = \exp\left(\Phi^{-1}(1-f^{1/p})\sigma\right) \qquad 0 0$$

The following is the plot of the power lognormal inverse survival function with the same values of p as the pdf plots above.

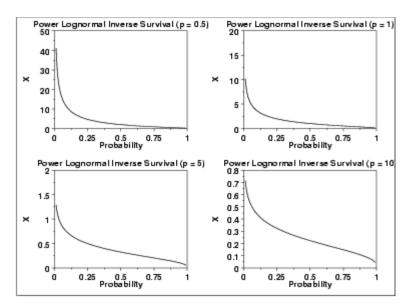

Common Statistics

The statistics for the power lognormal distribution are complicated and require tables. <u>Nelson</u> discusses the mean, median, mode, and standard deviation of the power lognormal distribution and provides references to the appropriate tables.

Parameter Estimation Nelson discusses maximum likelihood estimation for the power lognormal distribution. These estimates need to be performed with computer software. Software for maximum likelihood estimation of the parameters of the power lognormal distribution is not as readily available as for other reliability distributions such as the exponential, Weibull, and lognormal.

*Software* 

Most general purpose statistical software programs do not support the probability functions for the power lognormal distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions


## 1.3.6.6.15. Tukey-Lambda Distribution

Probability
Density
Function

The Tukey-Lambda density function does not have a simple, closed form. It is computed numerically.


The Tukey-Lambda distribution has the <u>shape parameter</u>  $\lambda$ . As with other probability distributions, the Tukey-Lambda distribution can be transformed with a <u>location parameter</u>,  $\mu$ , and a <u>scale parameter</u>,  $\sigma$ . Since the general form of probability functions can be <u>expressed in terms of the standard distribution</u>, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the Tukey-Lambda probability density function for four values of  $\lambda$ .

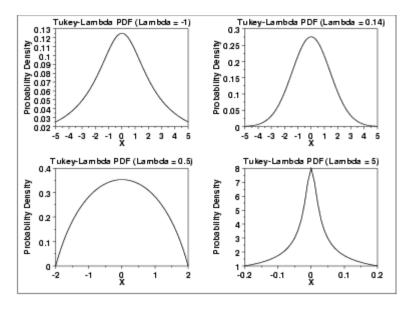

Cumulative Distribution Function The Tukey-Lambda distribution does not have a simple, closed form. It is computed numerically.


The following is the plot of the Tukey-Lambda cumulative distribution function with the same values of  $\lambda$  as the pdf plots above.

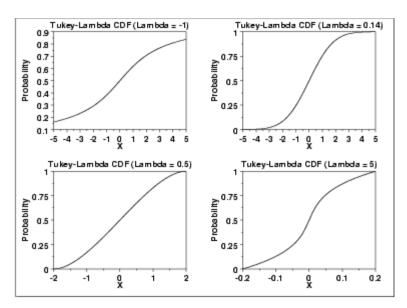

Percent Point Function The formula for the <u>percent point function</u> of the standard form of the Tukey-Lambda distribution is

$$G(p) = \frac{p^{\lambda} - (1-p)^{\lambda}}{\lambda}$$

The following is the plot of the Tukey-Lambda percent point function with the same values of  $\lambda$  as the pdf plots above.

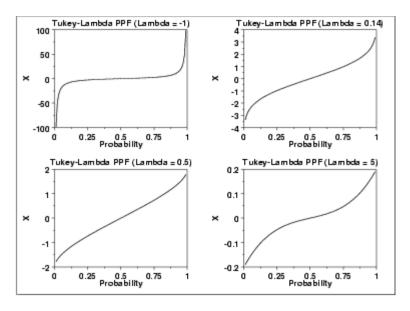

Other Probability Functions The Tukey-Lambda distribution is typically used to identify an appropriate distribution (see the comments below) and not used in statistical models directly. For this reason, we omit the formulas, and plots for the hazard, cumulative hazard, survival, and inverse survival functions. We also omit the common statistics and parameter estimation sections.

**Comments** 

The Tukey-Lambda distribution is actually a family of distributions that can approximate a number of common distributions. For example,

 $\lambda = -1$  approximately Cauchy

 $\lambda = 0$ exactly logistic

 $\lambda = 0.14$  approximately normal

 $\lambda = 0.5$  U-shaped

 $\lambda = 1$ exactly uniform (from -1 to +1)

The most common use of this distribution is to generate a Tukey-Lambda PPCC plot of a data set. Based on the ppcc plot, an appropriate model for the data is suggested. For example, if the maximum correlation occurs for a value of  $\lambda$ at or near 0.14, then the data can be modeled with a normal distribution. Values of  $\lambda$  less than this imply a heavy-tailed distribution (with -1 approximating a Cauchy). That is, as the optimal value of  $\lambda$  goes from 0.14 to -1, increasingly heavy tails are implied. Similarly, as the optimal value of  $\lambda$  becomes greater than 0.14, shorter tails are implied.

As the Tukey-Lambda distribution is a symmetric distribution, the use of the Tukey-Lambda PPCC plot to determine a reasonable distribution to model the data only applies to symmetric distributuins. A histogram of the data should provide evidence as to whether the data can be reasonably modeled with a symmetric distribution.

Software

Most general purpose statistical software programs do not support the probability functions for the Tukey-Lambda distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

# 1.3.6.6.16. Extreme Value Type I Distribution

Probability
Density
Function

The extreme value type I distribution has two forms. One is based on the smallest extreme and the other is based on the largest extreme. We call these the minimum and maximum cases, respectively. Formulas and plots for both cases are given. The extreme value type I distribution is also referred to as the Gumbel distribution.


The general formula for the <u>probability density function</u> of the Gumbel (minimum) distribution is

$$f(x) = \frac{1}{\beta}e^{\frac{x-\mu}{\beta}}e^{-e^{\frac{x-\mu}{\beta}}}$$

where  $\mu$  is the <u>location parameter</u> and  $\beta$  is the <u>scale</u> parameter. The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard Gumbel distribution**. The equation for the standard Gumbel distribution (minimum) reduces to

$$f(x) = e^x e^{-e^x}$$

The following is the plot of the Gumbel probability density function for the minimum case.

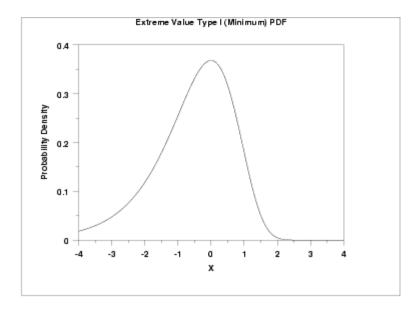

The general formula for the probability density function of


the Gumbel (maximum) distribution is

$$f(x) = rac{1}{eta}e^{-rac{x-\mu}{eta}}e^{-e^{-rac{x-\mu}{eta}}}$$

where  $\mu$  is the <u>location parameter</u> and  $\beta$  is the <u>scale</u> parameter. The case where  $\mu = 0$  and  $\beta = 1$  is called the **standard Gumbel distribution**. The equation for the standard Gumbel distribution (maximum) reduces to

$$f(x) = e^{-x}e^{-e^{-x}}$$

The following is the plot of the Gumbel probability density function for the maximum case.

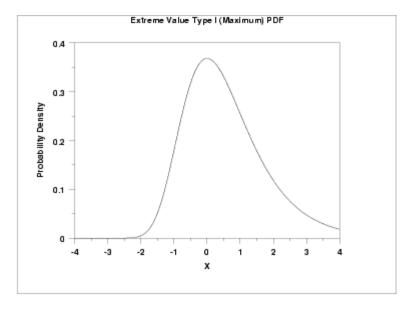


Since the general form of probability functions can be expressed in terms of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the Gumbel distribution (minimum) is

$$F(x) = 1 - e^{-e^x}$$


The following is the plot of the Gumbel cumulative distribution function for the minimum case.

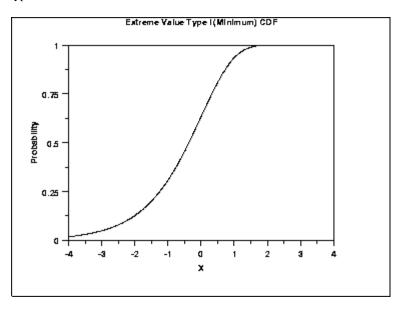

The formula for the <u>cumulative distribution function</u> of the Gumbel distribution (maximum) is

$$F(x) = e^{-e^{-x}}$$


The following is the plot of the Gumbel cumulative distribution function for the maximum case.

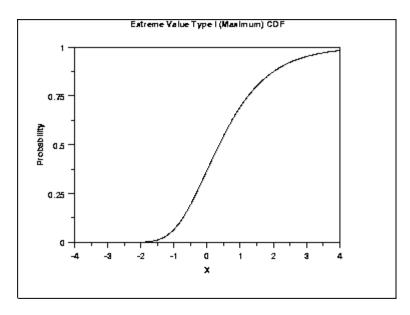

Percent Point Function The formula for the <u>percent point function</u> of the Gumbel distribution (minimum) is

$$G(p) = \ln(\ln(\frac{1}{1-p}))$$


The following is the plot of the Gumbel percent point function for the minimum case.

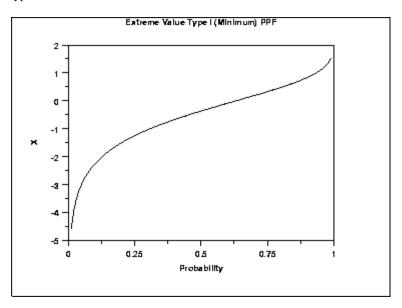

The formula for the <u>percent point function</u> of the Gumbel distribution (maximum) is

$$G(p) = -\ln(\ln(\frac{1}{p}))$$


The following is the plot of the Gumbel percent point function for the maximum case.

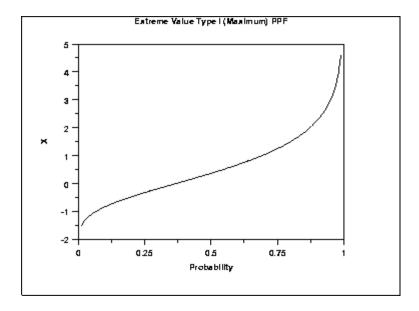

Hazard Function The formula for the <u>hazard function</u> of the Gumbel distribution (minimum) is

$$h(x)=e^x$$


The following is the plot of the Gumbel hazard function for the minimum case.

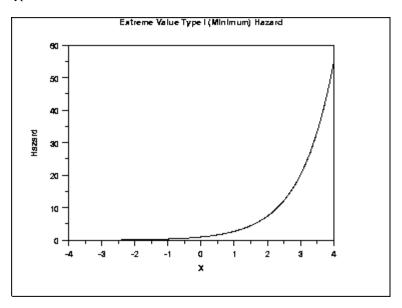

The formula for the <u>hazard function</u> of the Gumbel distribution (maximum) is

$$h(x) = \frac{e^{-x}}{e^{e^{-x}} - 1}$$


The following is the plot of the Gumbel hazard function for the maximum case.

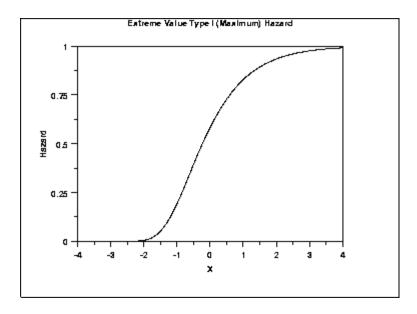

Cumulative Hazard Function The formula for the <u>cumulative hazard function</u> of the Gumbel distribution (minimum) is

$$H(x)=e^x$$


The following is the plot of the Gumbel cumulative hazard function for the minimum case.

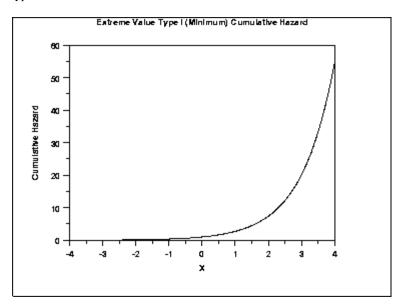

The formula for the <u>cumulative hazard function</u> of the Gumbel distribution (maximum) is

$$H(x) = -\ln(1 - e^{-e^{-x}})$$


The following is the plot of the Gumbel cumulative hazard function for the maximum case.

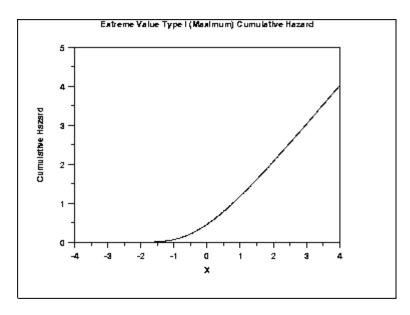

Survival Function The formula for the <u>survival function</u> of the Gumbel distribution (minimum) is

$$S(x) = e^{-e^x}$$


The following is the plot of the Gumbel survival function for the minimum case.

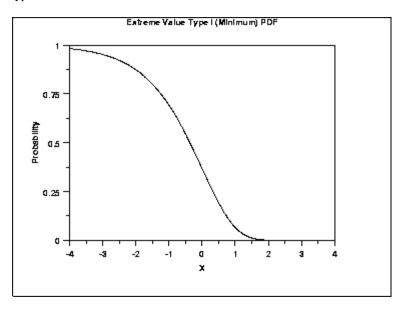

The formula for the <u>survival function</u> of the Gumbel distribution (maximum) is

$$S(x) = 1 - e^{-e^{-x}}$$


The following is the plot of the Gumbel survival function for the maximum case.

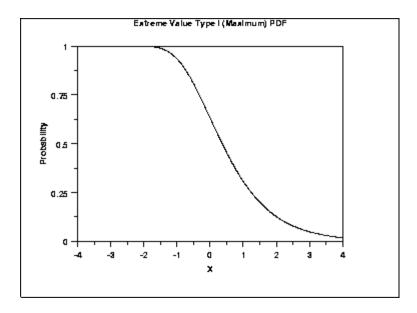

Inverse Survival Function The formula for the <u>inverse survival function</u> of the Gumbel distribution (minimum) is

$$Z(p) = \ln(\ln(\frac{1}{p}))$$


The following is the plot of the Gumbel inverse survival function for the minimum case.

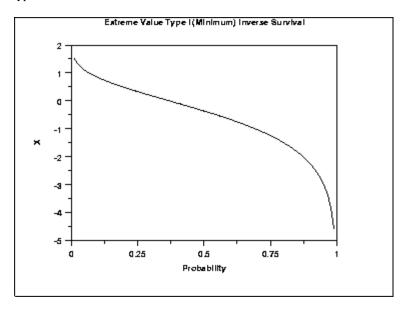

The formula for the <u>inverse survival function</u> of the Gumbel distribution (maximum) is

$$Z(p) = -\ln(\ln(\frac{1}{1-p}))$$

The following is the plot of the Gumbel inverse survival function for the maximum case.

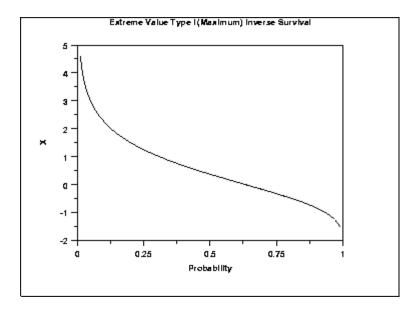

Common Statistics

The formulas below are for the maximum order statistic case.

Mean  $\mu + 0.5772\beta$ 

The constant 0.5772 is Euler's number.

Median  $\mu - \beta \ln(\ln(2))$ 

Mode #

Range Negative infinity to positive infinity.

Standard  $\beta\pi$ Deviation  $\sqrt{6}$ 

Skewness 1.13955 Kurtosis 5.4

 $\frac{\beta\pi}{\sqrt{6}(\mu + 0.5772\beta)}$ Coefficient of Variation

Parameter Estimation The method of moments estimators of the Gumbel (maximum) distribution are

$$ilde{eta} = rac{s\sqrt{6}}{\pi}$$
  $ilde{\mu} = ar{X} - 0.5772 ilde{eta}$ 

where  $ar{X}$  and s are the sample mean and standard deviation, respectively.

The equations for the maximum likelihood estimation of the shape and scale parameters are discussed in Chapter 15 of Evans, Hastings, and Peacock and Chapter 22 of Johnson, Kotz, and Balakrishnan. These equations need to be solved numerically and this is typically accomplished by using statistical software packages.

Software

Some general purpose statistical software programs support at least some of the probability functions for the extreme value type I distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

### **1.3.6.6.17.** Beta Distribution

Probability
Density
Function

The general formula for the <u>probability density function</u> of the beta distribution is

$$f(x) = \frac{(x-a)^{p-1}(b-x)^{q-1}}{B(p,q)(b-a)^{p+q-1}} \qquad a \le x \le b; p,q > 0$$

where p and q are the <u>shape parameters</u>, a and b are the lower and upper bounds, respectively, of the distribution, and B(p,q) is the beta function. The beta function has the formula

$$B(\alpha,\beta) = \int_0^1 t^{\alpha-1} (1-t)^{\beta-1} dt$$

The case where a = 0 and b = 1 is called the **standard beta distribution**. The equation for the standard beta distribution is


$$f(x) = \frac{x^{p-1}(1-x)^{q-1}}{B(p,q)} \qquad 0 \le x \le 1; p,q > 0$$

Typically we define the general form of a distribution in terms of location and scale parameters. The beta is different in that we define the general distribution in terms of the lower and upper bounds. However, the location and scale parameters can be defined in terms of the lower and upper limits as follows:

location = 
$$a$$
 scale =  $b - a$ 

Since the general form of probability functions can be <u>expressed in terms</u> of the standard distribution, all subsequent formulas in this section are given for the standard form of the function.

The following is the plot of the beta probability density function for four different values of the shape parameters.

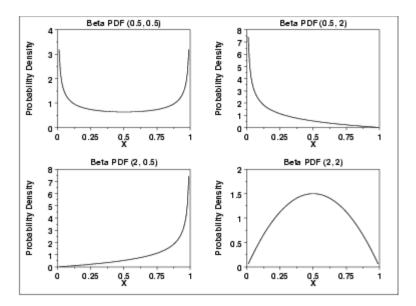


Cumulative Distribution Function The formula for the <u>cumulative distribution function</u> of the beta distribution is also called the incomplete beta function ratio (commonly denoted by  $I_x$ ) and is defined as

$$F(x) = I_x(p,q) = rac{\int_0^x t^{p-1} (1-t)^{q-1} dt}{B(p,q)} \qquad 0 \le x \le 1; p,q > 0$$


where  $\boldsymbol{B}$  is the beta function defined above.

The following is the plot of the beta cumulative distribution function with the same values of the shape parameters as the pdf plots above.

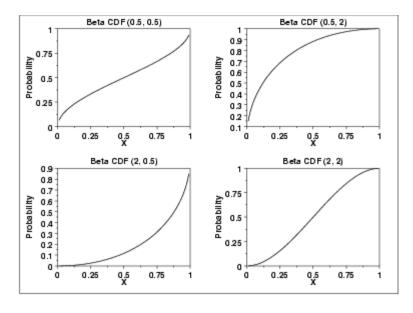

Percent Point Function The formula for the <u>percent point function</u> of the beta distribution does not exist in a simple closed form. It is computed numerically.

The following is the plot of the beta percent point function with the same values of the shape parameters as the pdf plots above.

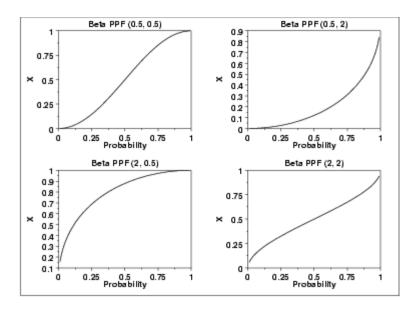

Other Probability Functions Since the beta distribution is not typically used for reliability applications, we omit the formulas and plots for the hazard, cumulative hazard, survival, and inverse survival probability functions.

Common Statistics

The formulas below are for the case where the lower limit is zero and the upper limit is one.

Mean	
	p+q
Mode	$\frac{p-1}{p-1}$ $p,q>1$
	p+q-2 $p,q>1$
Range	0 to 1
Standard Deviation	$\sqrt{pq}$
	$\sqrt{(P+q)^2(p+q+1)}$
Coefficient of	$\sqrt{q}$
Variation	$\sqrt{p(p+q+1)}$
Skewness	$2(q-p)\sqrt{p+q+1}$
	$\overline{(p+q+2)\sqrt{pq}}$

Parameter Estimation First consider the case where a and b are assumed to be known. For this case, the method of moments estimates are

$$p = \bar{x}(\frac{\bar{x}(1-\bar{x})}{s^2} - 1)$$
  $q = (1-\bar{x})(\frac{\bar{x}(1-\bar{x})}{s^2} - 1)$ 

where  $\bar{x}$  is the sample mean and  $s^2$  is the sample variance. If a and b are not 0 and 1, respectively, then replace  $\bar{x}$  with  $\frac{\bar{x}-a}{b-a}$  and  $s^2$  with  $\frac{s^2}{(b-a)^2}$  in the above equations.

For the case when a and b are known, the maximum likelihood estimates

can be obtained by solving the following set of equations

$$\psi(\hat{p}) - \psi(\hat{p} + \hat{q}) = \frac{1}{n} \sum_{i=1}^n \log(\frac{Y_i - a}{b - a})$$

$$\psi(\hat{q}) - \psi(\hat{p} + \hat{q}) = \frac{1}{n} \sum_{i=1}^n \log(\frac{b - Y_i}{b - a})$$

The maximum likelihood equations for the case when a and b are not known are given in pages 221-235 of Volume II of <u>Johnson</u>, <u>Kotz</u>, <u>and Balakrishan</u>.

*Software* 

Most general purpose statistical software programs support at least some of the probability functions for the beta distribution.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. <u>Probability Distributions</u>
- 1.3.6.6. Gallery of Distributions

### 1.3.6.6.18. Binomial Distribution

Probability
Mass
Function

The binomial distribution is used when there are exactly two mutually exclusive outcomes of a trial. These outcomes are appropriately labeled "success" and "failure". The binomial distribution is used to obtain the probability of observing *x* successes in *N* trials, with the probability of success on a single trial denoted by *p*. The binomial distribution assumes that *p* is fixed for all trials.


The formula for the binomial probability mass function is

$$P(x,p,n)=\left(egin{array}{c} n \ x \end{array}
ight)(p)^x(1-p)^{(n-x)} \qquad ext{for } x=0,1,2,\cdots,n$$

where

$$\left(\begin{array}{c} n \\ x \end{array}\right) = \frac{n!}{x!(n-x)!}$$


The following is the plot of the binomial probability density function for four values of p and n = 100.

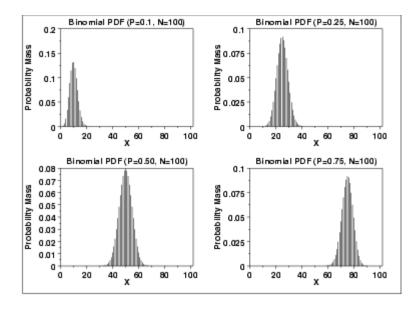

Cumulative Distribution Function The formula for the binomial cumulative probability function is


$$F(x,p,n) = \sum_{i=0}^x \left(egin{array}{c} n \ i \end{array}
ight) (p)^i (1-p)^{(n-i)}$$

The following is the plot of the binomial cumulative distribution function with the same values of p as the pdf plots above.

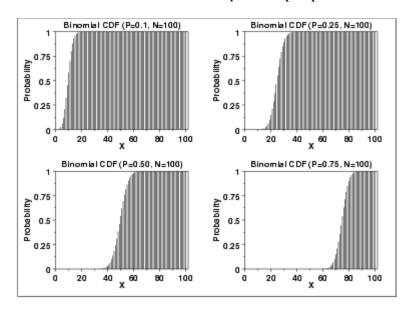

Percent Point Function The binomial percent point function does not exist in simple closed form. It is computed numerically. Note that because this is a discrete distribution that is only defined for integer values of x, the percent point function is not smooth in the way the percent point function typically is for a continuous distribution.

The following is the plot of the binomial percent point function with the same values of *p* as the pdf plots above.

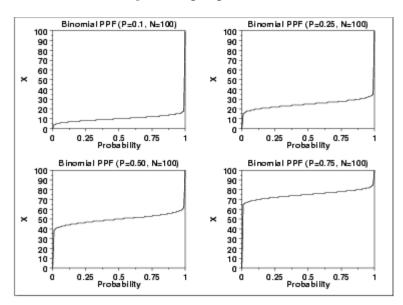

Common Statistics

Mean npMode  $p(n+1)-1 \le x \le p(n+1)$ Range 0 to NStandard Deviation  $\sqrt{np(1-p)}$ 

Coefficient of Variation 
$$\sqrt{\frac{(1-p)}{np}}$$
 Skewness 
$$\frac{(1-2p)}{\sqrt{np(1-p)}}$$
 Kurtosis 
$$3-\frac{6}{n}+\frac{1}{np(1-p)}$$

Comments The binomial distribution is probably the most commonly used

discrete distribution.

Parameter The maximum likelihood estimator of p (n is fixed) is

Estimation  $ilde{p} = rac{x}{n}$ 

Software Most general purpose statistical software programs support at least

some of the probability functions for the binomial distribution.

NIST SEMATECH TOOLS & AIDS SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.6. Gallery of Distributions

### 1.3.6.6.19. Poisson Distribution

Probability
Mass
Function


The Poisson distribution is used to model the number of events occurring within a given time interval.

The formula for the Poisson probability mass function is

$$p(x,\lambda) = rac{e^{-\lambda}\lambda^x}{x!}$$
 for  $x = 0, 1, 2, \cdots$ 

 $\lambda$  is the shape parameter which indicates the average number of events in the given time interval.


The following is the plot of the Poisson probability density function for four values of  $\lambda$ .

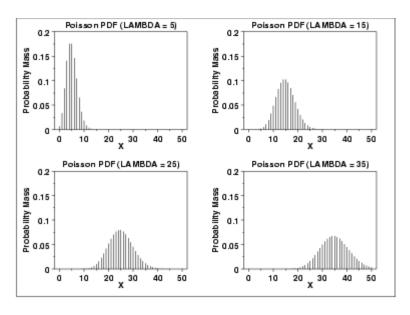

Cumulative Distribution Function The formula for the Poisson cumulative probability function is


$$F(x,\lambda) = \sum_{i=0}^{x} \frac{e^{-\lambda}\lambda^{i}}{i!}$$

The following is the plot of the Poisson cumulative distribution function with the same values of  $\lambda$  as the pdf plots above.

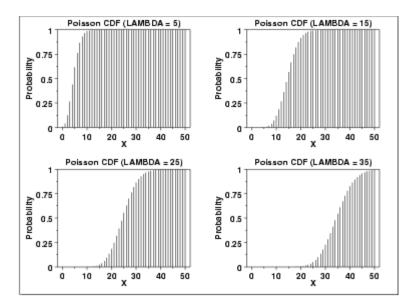

Percent Point Function The Poisson percent point function does not exist in simple closed form. It is computed numerically. Note that because this is a discrete distribution that is only defined for integer values of x, the percent point function is not smooth in the way the percent point function typically is for a continuous distribution.

The following is the plot of the Poisson percent point function with the same values of  $\lambda$  as the pdf plots above.

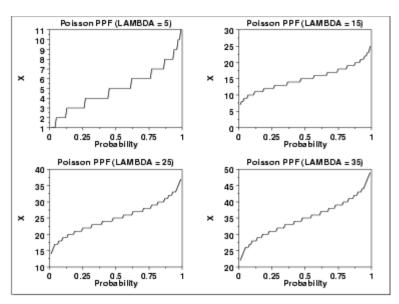

Common Statistics

Mean  $\lambda$ Mode For non-integer  $\lambda$ , it is the largest integer less than  $\lambda$ . For integer  $\lambda$ ,  $x = \lambda$  and  $x = \lambda$ - 1 are both the mode.

Range 0 to positive infinity

Standard  $\sqrt{\lambda}$ Deviation Coefficient of Variation  $\frac{1}{\sqrt{\lambda}}$ 

Skewness 
$$\frac{1}{\sqrt{\lambda}}$$
 Kurtosis  $3 + \frac{1}{\lambda}$ 

Parameter Estimation The maximum likelihood estimator of  $\lambda$  is

$$ilde{\lambda}=ar{X}$$

where  $\bar{X}$  is the sample mean.

Software

Most general purpose statistical software programs support at least some of the probability functions for the Poisson distribution.



HOME TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions

### **1.3.6.7.** Tables for Probability Distributions

**Tables** 

Several commonly used tables for probability distributions can be referenced below.

The values from these tables can also be obtained from most general purpose statistical software programs. Most introductory statistics textbooks (e.g., Snedecor and Cochran) contain more extensive tables than are included here. These tables are included for convenience.

- 1. <u>Cumulative distribution function for the standard normal</u> distribution
- 2. Upper critical values of Student's t-distribution with  $\nu$ degrees of freedom
- 3. Upper critical values of the F-distribution with  $\nu_1$  and  $\nu_2$ degrees of freedom
- 4. Upper critical values of the chi-square distribution with  $\nu$  degrees of freedom
- 5. Critical values of t\* distribution for testing the output of a linear calibration line at 3 points
- 6. Upper critical values of the normal PPCC distribution



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



### TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions


# **1.3.6.7.1.** Cumulative Distribution Function of the Standard Normal Distribution

How to Use This Table The table below contains the area under the standard normal curve from 0 to z. This can be used to compute the <u>cumulative</u> <u>distribution function</u> values for the <u>standard normal</u> <u>distribution</u>.

The table utilizes the symmetry of the normal distribution, so what in fact is given is

$$P[0 \le x \le |a|]$$

where a is the value of interest. This is demonstrated in the graph below for a = 0.5. The shaded area of the curve represents the probability that x is between 0 and a.

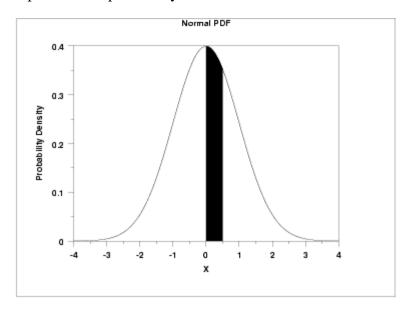

This can be clarified by a few simple examples.

- 1. What is the probability that *x* is less than or equal to 1.53? Look for 1.5 in the X column, go right to the 0.03 column to find the value 0.43699. Now add 0.5 (for the probability less than zero) to obtain the final result of 0.93699.
- 2. What is the probability that x is less than or equal to -

1.53? For negative values, use the relationship

$$P[x \le a] = 1 - P[x \le |a|] \quad \text{ for } x < 0$$

From the first example, this gives 1 - 0.93699 = 0.06301.

3. What is the probability that x is between -1 and 0.5? Look up the values for 0.5 (0.5 + 0.19146 = 0.69146) and -1 (1 - (0.5 + 0.34134) = 0.15866). Then subtract the results (0.69146 - 0.15866) to obtain the result 0.5328.

To use this table with a non-standard normal distribution (either the location parameter is not 0 or the scale parameter is not 1), standardize your value by subtracting the mean and dividing the result by the standard deviation. Then look up the value for this standardized value.

A few particularly important numbers derived from the table below, specifically numbers that are commonly used in significance tests, are summarized in the following table:

p 0.001	0.005	0.010	0.025	0.050	0.100
$Z_p$ $-3.090$	-2.576	-2.326	-1.960	-1.645	-1.282

p	0.999	0.995	0.990	0.975	0.950	0.900
$Z_p$	+3.090	+2.576	+2.326	+1.960	+1.645	+1.282

These are critical values for the normal distribution.

Area under the Normal Curve from 0

to X							
X 0.07		0.01 0.09	0.02	0.03	0.04	0.05	0.06
0.0	0.0000	0.00200	0 00500	0 01105	0 01505	0.01004	0 00300
	0.00000		0.00798	0.01197	0.01595	0.01994	0.02392
0.02/90		0.03380	0 04776	0 05172	0 05567	0.05062	0 06356
	0.03363		0.04770	0.03172	0.05507	0.03902	0.00550
0.2		0.08317	0.08706	0.09095	0.09483	0.09871	0.10257
	0.11026				0000		
0.3	0.11791	0.12172	0.12552	0.12930	0.13307	0.13683	0.14058
0.14431	0.14803	0.15173					
0.4	0.15542	0.15910	0.16276	0.16640	0.17003	0.17364	0.17724
0.18082	0.18439	0.18793					
0.5	0.19146	0.19497	0.19847	0.20194	0.20540	0.20884	0.21226
0.21566	0.21904	0.22240					
0.6		0.22907	0.23237	0.23565	0.23891	0.24215	0.24537
0.24857	0.25175	0.25490					
0.7		0.26115	0.26424	0.26730	0.27035	0.27337	0.27637
0.27935	0.28230						
0.8		0.29103	0.29389	0.29673	0.29955	0.30234	0.30511
	0.31057						
0.9		0.31859	0.32121	0.32381	0.32639	0.32894	0.33147
0.33398	0.33646	0.33891					

1.0		0.34375	0.34614	0.34849	0.35083	0.35314	0.35543
0.35769 1.1	0.35993	0.36214	0.36864	0.37076	0.37286	0.37493	0.37698
	0.38100		0.50001	0.57070	0.57200	0.57155	0.37030
1.2		0.38686	0.38877	0.39065	0.39251	0.39435	0.39617
1.3	0.39973	0.40147	0.40658	0.40824	0.40988	0.41149	0.41308
	0.41621					*******	***
1.4		0.42073	0.42220	0.42364	0.42507	0.42647	0.42785
1.5	0.43056 0.43319	0.43169	0.43574	0.43699	0.43822	0.43943	0.44062
	0.44295	0.44408					
1.6	0.44520 0.45352	0.44630	0.44738	0.44845	0.44950	0.45053	0.45154
1.7		0.45637	0.45728	0.45818	0.45907	0.45994	0.46080
	0.46246						
1.8	0.46407 0.46995	0.46485	0.46562	0.46638	0.46712	0.46784	0.46856
1.9		0.47193	0.47257	0.47320	0.47381	0.47441	0.47500
	0.47615						
2.0 0.48077	0.47725 0.48124	0.47778	0.47831	0.47882	0.47932	0.47982	0.48030
2.1		0.48257	0.48300	0.48341	0.48382	0.48422	0.48461
	0.48537						
2.2 0.48840	0.48610	0.48645	0.48679	0.48713	0.48745	0.48778	0.48809
2.3		0.48956	0.48983	0.49010	0.49036	0.49061	0.49086
	0.49134		0 40004	0 40045	0 40066	0 40006	0 40305
2.4 0.49324	0.49180	0.49202 0.49361	0.49224	0.49245	0.49266	0.49286	0.49305
2.5	0.49379	0.49396	0.49413	0.49430	0.49446	0.49461	0.49477
	0.49506		0 40560	0 40553	0 40505	0 40500	0 40600
2.6 0.49621	0.49534	0.49547 0.49643	0.49560	0.49573	0.49585	0.49598	0.49609
2.7	0.49653	0.49664	0.49674	0.49683	0.49693	0.49702	0.49711
	0.49728		0 40760	0 40767	0 40774	0 40701	0 40700
2.8 0.49795	0.49744	0.49752 0.49807	0.49/60	0.49/6/	0.49//4	0.49/61	0.49/00
2.9	0.49813	0.49819	0.49825	0.49831	0.49836	0.49841	0.49846
0.49851 3.0	0.49856	0.49861 0.49869	n 49874	0 49878	0.49882	n 49886	0 49889
	0.49896		0.490/4	0.49070	0.49002	0.49000	0.49009
3.1		0.49906	0.49910	0.49913	0.49916	0.49918	0.49921
0.49924 3.2	0.49926	0.49929	n 49936	n 49938	n 4994n	0 49942	0 49944
	0.49948		0.15550	0.13330	0.15510	0.13312	0.13311
3.3		0.49953	0.49955	0.49957	0.49958	0.49960	0.49961
0.49962 3.4	0.49964	0.49968	0.49969	0.49970	0.49971	0.49972	0.49973
0.49974	0.49975	0.49976					
3.5	0.49977 0.49983	0.49978	0.49978	0.49979	0.49980	0.49981	0.49981
3.6		0.49985	0.49985	0.49986	0.49986	0.49987	0.49987
	0.49988						
3.7 n 49992	0.49989 0.49992	0.49990	0.49990	0.49990	0.49991	0.49991	0.49992
3.8		0.49993	0.49993	0.49994	0.49994	0.49994	0.49994
	0.49995						
3.9 0.49996	0.49995 0.49997	0.49995	0.49996	0.49996	0.49996	0.49996	0.49996
4.0	0.49997	0.49997	0.49997	0.49997	0.49997	0.49997	0.49998
0.49998	0.49998	0.49998					





TOOLS & AIDS

SEARCH

BACK NEXT



### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions

# **1.3.6.7.2.** Critical Values of the Student's *t* Distribution


How to Use This Table

This table contains critical values of the <u>Student's *t*</u> <u>distribution</u> computed using the <u>cumulative distribution</u> <u>function</u>. The *t* distribution is symmetric so that

$$t_{1-\alpha, \nu} = -t_{\alpha, \nu}$$
.

The t table can be used for both one-sided (lower and upper) and two-sided tests using the appropriate value of  $\alpha$ .

The significance level,  $\alpha$ , is demonstrated in the graph below, which displays a t distribution with 10 degrees of freedom. The most commonly used significance level is  $\alpha = 0.05$ . For a two-sided test, we compute  $1 - \alpha/2$ , or 1 - 0.05/2 = 0.975 when  $\alpha = 0.05$ . If the absolute value of the test statistic is greater than the critical value (0.975), then we reject the null hypothesis. Due to the symmetry of the t distribution, we only tabulate the positive critical values in the table below.

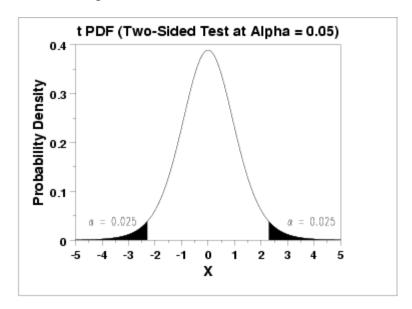

Given a specified value for  $\alpha$ :

1. For a two-sided test, find the column corresponding to  $1-\alpha/2$  and reject the null hypothesis if the absolute value

- of the test statistic is greater than the value of  $t_{1-\alpha/2,\nu}$  in the table below.
- 2. For an upper, one-sided test, find the column corresponding to  $1-\alpha$  and reject the null hypothesis if the test statistic is greater than the table value.
- 3. For a lower, one-sided test, find the column corresponding to  $1-\alpha$  and reject the null hypothesis if the test statistic is less than the negative of the table value.

## Critical values of Student's t distribution with v degrees of freedom

Probal $(t_{1-\alpha, \nu})$	bility l	ess thar	n the cri	tical va	alue
<b>v</b> 0.999	0.90	0.95	0.975	0.99	0.995
1. 318.313	3.078	6.314	12.706	31.821	63.657
2.	1.886	2.920	4.303	6.965	9.925
22.327	1.638	2.353	3.182	4.541	5.841
10.215	1.533	2.132	2.776	3.747	4.604
7.173	1.476	2.015	2.571	3.365	4.032
5.893	1.440	1.943	2.447	3.143	3.707
5.208	1.415	1.895	2.365	2.998	3.499
4.782	1.397	1.860	2.306	2.896	3.355
4.499	1.383	1.833	2.262	2.821	3.250
4.296 10.	1.372	1.812	2.228	2.764	3.169
4.143 11.	1.363	1.796	2.201	2.718	3.106
4.024 12.	1.356	1.782	2.179	2.681	3.055
3.929 13.	1.350	1.771	2.160	2.650	3.012
3.852 14.	1.345	1.761	2.145	2.624	2.977
3.787 15.	1.341	1.753	2.131	2.602	2.947
3.733 16.	1.337	1.746	2.120	2.583	2.921
3.686 17.	1.333	1.740	2.110	2.567	2.898
3.646 18.	1.330	1.734	2.101	2.552	2.878
3.610 19.	1.328	1.729	2.093	2.539	2.861
3.579 20.	1.325	1.725	2.086	2.528	2.845

2 552					
3.552 21.	1.323	1.721	2.080	2.518	2.831
3.527	1.321	1.717	2.074	2.508	2.819
3.505	1.319	1.714	2.069	2.500	2.807
3.485	1.318	1.711	2.064	2.492	2.797
3.467 25.	1.316	1.708	2.060	2.485	2.787
3.450 26.	1.315	1.706	2.056	2.479	2.779
3.435	1.314	1.703	2.052	2.473	2.771
3.421 28.	1.313	1.701	2.048	2.467	2.763
3.408 29.	1.311	1.699	2.045	2.462	2.756
3.396 30.	1.310	1.697	2.042	2.457	2.750
3.385 31.	1.309	1.696	2.040	2.453	2.744
3.375 32.	1.309	1.694	2.037	2.449	2.738
3.365 33.	1.308	1.692	2.035	2.445	2.733
3.356 34.	1.307	1.691	2.032	2.441	2.728
3.348 35.	1.306	1.690	2.030	2.438	2.724
3.340 36.	1.306	1.688	2.028	2.434	2.719
3.333 37.	1.305	1.687	2.026	2.431	2.715
3.326 38.	1.304	1.686	2.024	2.429	2.712
3.319 39.	1.304	1.685	2.023	2.426	2.708
3.313 40.	1.303	1.684	2.021	2.423	2.704
3.307 41.	1.303	1.683	2.020	2.421	2.701
3.301 42.	1.302	1.682	2.018	2.418	2.698
3.296 43.	1.302	1.681	2.017	2.416	2.695
3.291 44.	1.301	1.680	2.015	2.414	2.692
3.286 45.	1.301	1.679	2.014	2.412	2.690
3.281 46.	1.300	1.679			
3.277 47.	1.300	1.678			
3.273 48.	1.299				
3.269 49.	1.299				
3.265 50.	1.299	1.676			
3.261 51.	1.298				
3.258 52.	1.298				
- <del>- •</del>	,		,		

2 055					
3.255 53.	1.298	1.674	2.006	2.399	2.672
3.251 54.	1.297	1.674	2.005	2.397	2.670
3.248	1.297	1.673	2.004	2.396	2.668
3.245 56.	1.297	1.673	2.003	2.395	2.667
3.242	1.297	1.672	2.002	2.394	2.665
3.239	1.296	1.672	2.002	2.392	2.663
3.237 59.	1.296	1.671	2.001	2.391	2.662
3.234	1.296	1.671	2.000	2.390	2.660
3.232 61.	1.296	1.670	2.000	2.389	2.659
3.229 62.	1.295	1.670	1.999	2.388	2.657
3.227 63.	1.295	1.669	1.998	2.387	2.656
3.225 64.	1.295	1.669	1.998	2.386	2.655
3.223 65.	1.295	1.669	1.997	2.385	2.654
3.220 66.	1.295	1.668	1.997	2.384	2.652
3.218 67.	1.294	1.668	1.996	2.383	2.651
3.216 68.	1.294	1.668	1.995	2.382	2.650
3.214 69.	1.294	1.667	1.995	2.382	2.649
3.213 70.	1.294	1.667	1.994	2.381	2.648
3.211 71.	1.294	1.667	1.994	2.380	2.647
3.209 72.	1.293	1.666	1.993	2.379	2.646
3.207 73.	1.293	1.666	1.993	2.379	2.645
3.206 74.	1.293	1.666	1.993	2.378	2.644
3.204 75.	1.293	1.665	1.992	2.377	2.643
3.202 76.	1.293	1.665	1.992	2.376	2.642
3.201 77.	1.293	1.665	1.991	2.376	2.641
3.199 78.	1.292	1.665	1.991	2.375	2.640
3.198 79.	1.292	1.664	1.990	2.374	2.640
3.197 80.	1.292	1.664	1.990	2.374	2.639
3.195 81.	1.292	1.664	1.990	2.373	2.638
3.194 82.	1.292	1.664	1.989	2.373	2.637
3.193 83.	1.292	1.663	1.989	2.372	2.636
3.191 84.	1.292	1.663	1.989	2.372	2.636

3.190					
85. 3.189	1.292	1.663	1.988	2.371	2.635
86.	1.291	1.663	1.988	2.370	2.634
3.188 87. 3.187	1.291	1.663	1.988	2.370	2.634
88. 3.185	1.291	1.662	1.987	2.369	2.633
89.	1.291	1.662	1.987	2.369	2.632
3.184 90.	1.291	1.662	1.987	2.368	2.632
3.183 91.	1.291	1.662	1.986	2.368	2.631
3.182 92.	1.291	1.662	1.986	2.368	2.630
3.181 93.	1.291	1.661	1.986	2.367	2.630
3.180 94.	1.291	1.661	1.986	2.367	2.629
3.179 95.	1.291	1.661	1.985	2.366	2.629
3.178 96.	1.290	1.661	1.985	2.366	2.628
3.177 97.	1.290	1.661	1.985	2.365	2.627
3.176 98.	1.290	1.661	1.984	2.365	2.627
3.175 99.	1.290	1.660	1.984	2.365	2.626
3.175 100.	1.290	1.660	1.984	2.364	2.626
3.174 ∞ 3.090	1.282	1.645	1.960	2.326	2.576



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

 $http://www.itl.nist.gov/div898/handbook/eda/section3/eda3672.htm \cite{beta} (6/27/2012~2:02:54~PM) \cite{beta} (1/2012~2:02:54~PM) \cite{beta} (1/2012~2:02$ 




### TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions

## **1.3.6.7.3.** Upper Critical Values of the F Distribution

How to Use This Table This table contains the upper critical values of the  $\underline{F}$  distribution. This table is used for one-sided F tests at the  $\alpha = 0.05, 0.10$ , and 0.01 levels.

More specifically, a test statistic is computed with  $\nu_1$  and  $\nu_2$  degrees of freedom, and the result is compared to this table. For a one-sided test, the null hypothesis is rejected when the test statistic is greater than the tabled value. This is demonstrated with the graph of an F distribution with  $\nu_1 = 10$  and  $\nu_2 = 10$ . The shaded area of the graph indicates the rejection region at the  $\alpha$  significance level. Since this is a one-sided test, we have  $\alpha$  probability in the upper tail of exceeding the critical value and zero in the lower tail. Because the F distribution is asymmetric, a two-sided test requires a set of of tables (not included here) that contain the rejection regions for both the lower and upper tails.

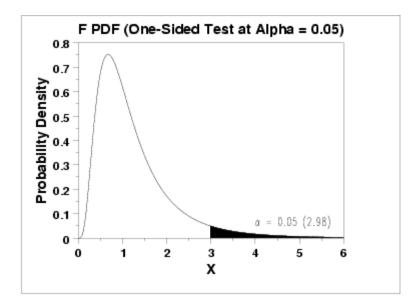

Contents The following tables for  $\nu_2$  from 1 to 100 are included:

- 1. One sided, 5% significance level,  $\nu_1 = 1 10$
- 2. One sided, 5% significance level,  $\nu_1 = 11 20$
- 3. One sided, 10% significance level,  $\nu_1 = 1 10$
- 4. One sided, 10% significance level,  $\nu_1 = 11 20$

- 5. One sided, 1% significance level, ν<sub>1</sub> = 1 10
  6. One sided, 1% significance level, ν<sub>1</sub> = 11 20

### Upper critical values of the F distribution

### for $v_1$ numerator degrees of freedom and $v_2$ denominator degrees of freedom

### 5% significance level

 $F_{.05}(\nu_1,\nu_2)$ 

6 <b>v</b> <sub>2</sub>	v <sub>1</sub> 1	8	9	3 10	4	5
	236.768	238.882	2 240.	543 241	.882	230.162
2 19.330		.3 19.0 19.371				19.296
3 8.941	10.12	8 9.5	52 9	.277	9.117	9.013
4	7.70	8.845 9 6.9	44 6	.591	6.388	6.256
6.163 5		6.041 8 5.7				5.050
4.950	4.876	4.818	4.77	2 4.	735	
6 4.284		37 5.1 4.147				4.387
7	5.59	1 4.7	37 4	.347	4.120	3.972
3.866 8		3.726 .8 4.4				3.687
3.581	3.500	3.438	3.38	8 3.	347	2 402
9 3.374	3.293	.7 4.2 3.230	3.17	9 3.	137	3.482
10 3.217		55 4.1 3.072				3.326
11	4.84	4 3.9	82 3	.587	3.357	3.204
3.095 12		2.948 7 3.8				3.106
2.996	2.913	2.849	2.79	6 2.	753	
13 2.915	2.832	7 3.8 2.767	2.71	4 2.	3.179 671	3.025
14 2.848	4.60	0 3.7 2.699	39 3	.344	3.112	2.958
15	4.54	3 3.6	82 3	.287	3.056	2.901
2.790 16		2.641 04 3.6				2.852
2.741	2.657	2.591	2.53	8 2.	494	
17 2.699	4.45 2.614	3.5 2.548	92 3 2.49	.197 4 2.	2.965 450	2.810
18	4.41	4 3.5	55 3	.160	2.928	2.773
19	2.577 4.38	2.510 3.5	2.45 22 3	6 ∠.· .127	2.895	2.740
2.628	4.38 2.544 4 35	2.477	2.42	3 2.	378	2.711
2.599	4.35 2.514	2.447	2.39	3 2.	348	<b>2 • / 1</b> 1
	4.32 2.488					2.685

22	4.301 3.443 3.049 2.817	2.661
2.549 23	2.464 2.397 2.342 2.297 4.279 3.422 3.028 2.796	2.640
2.528	2.442 2.375 2.320 2.275	
24 2.508	4.260 3.403 3.009 2.776 2.423 2.355 2.300 2.255	2.621
25	4.242 3.385 2.991 2.759 2.405 2.337 2.282 2.236	2.603
2.490 26	2.405 2.337 2.282 2.236 4.225 3.369 2.975 2.743	2.587
2.474	2.388 2.321 2.265 2.220	
27 2.459	4.210 3.354 2.960 2.728 2.373 2.305 2.250 2.204	2.572
28	4.196 3.340 2.947 2.714	2.558
2.445 29	2.359 2.291 2.236 2.190 4.183 3.328 2.934 2.701	2.545
2.432	4.183 3.328 2.934 2.701 2.346 2.278 2.223 2.177	
30 2.421	4.171 3.316 2.922 2.690 2.334 2.266 2.211 2.165	2.534
31	4.160 3.305 2.911 2.679	2.523
2.409 32	2.323 2.255 2.199 2.153 4.149 3.295 2.901 2.668	2.512
2.399	2.313 2.244 2.189 2.142	
33 2.389	4.139 3.285 2.892 2.659 2.303 2.235 2.179 2.133	2.503
34	4.130 3.276 2.883 2.650	2.494
2.380 35	2.294 2.225 2.170 2.123 4.121 3.267 2.874 2.641	2.485
2.372	2.285 2.217 2.161 2.114	
36 2.364	4.113 3.259 2.866 2.634 2.277 2.209 2.153 2.106	2.477
37	4.105 3.252 2.859 2.626 2.270 2.201 2.145 2.098	2.470
2.356 38	2.270 2.201 2.145 2.098 4.098 3.245 2.852 2.619	2.463
2.349	2.262 2.194 2.138 2.091	
39 2.342	4.091 3.238 2.845 2.612 2.255 2.187 2.131 2.084	2.456
40	4.085 3.232 2.839 2.606	2.449
2.336 41	2.249 2.180 2.124 2.077 4.079 3.226 2.833 2.600	2.443
2.330	2.243 2.174 2.118 2.071	
42 2.324	4.073 3.220 2.827 2.594 2.237 2.168 2.112 2.065	2.438
43	4.067 3.214 2.822 2.589	2.432
2.318 44	2.232 2.163 2.106 2.059 4.062 3.209 2.816 2.584	2.427
2.313 45	2.226 2.157 2.101 2.054 4.057 3.204 2.812 2.579	2 422
2.308	2.221 2.152 2.096 2.049	
46 2.304	4.052 3.200 2.807 2.574 2.216 2.147 2.091 2.044	2.417
47	4.047 3.195 2.802 2.570	2.413
2.299 48	2.212 2.143 2.086 2.039 4.043 3.191 2.798 2.565	2.409
2.295	2.207 2.138 2.082 2.035	
49 2.290	4.038 3.187 2.794 2.561 2.203 2.134 2.077 2.030	2.404
50	4.034 3.183 2.790 2.557	2.400
2.286 51	2.199 2.130 2.073 2.026 4.030 3.179 2.786 2.553	2.397
2.283	2.195 2.126 2.069 2.022	
52 2.279	4.027 3.175 2.783 2.550 2.192 2.122 2.066 2.018	2.393
53	4.023 3.172 2.779 2.546	2.389
2.275	2.188 2.119 2.062 2.015	

54	4.020 3.168 2.776 2.543	2.386
2.272 55	2.185 2.115 2.059 2.011 4.016 3.165 2.773 2.540	
2.269	2.181 2.112 2.055 2.008	
56 2.266	4.013 3.162 2.769 2.537 2.178 2.109 2.052 2.005	2.380
57 2.263	4.010 3.159 2.766 2.534 2.175 2.106 2.049 2.001	2.377
58	4.007 3.156 2.764 2.531	2.374
2.260 59	2.172 2.103 2.046 1.998 4.004 3.153 2.761 2.528	2.371
2.257	2.169 2.100 2.043 1.995	
60 2.254	4.001 3.150 2.758 2.525 2.167 2.097 2.040 1.993	
61 2.251	3.998 3.148 2.755 2.523 2.164 2.094 2.037 1.990	2.366
62	3.996 3.145 2.753 2.520	2.363
2.249 63	2.161 2.092 2.035 1.987 3.993 3.143 2.751 2.518 2.159 2.089 2.032 1.985	2.361
2.246 64	2.159 2.089 2.032 1.985 3.991 3.140 2.748 2.515	2.358
2.244	2.156 2.087 2.030 1.982	
65 2.242	3.989 3.138 2.746 2.513 2.154 2.084 2.027 1.980	2.356
66 2.239	3.986 3.136 2.744 2.511 2.152 2.082 2.025 1.977	2.354
67	3.984 3.134 2.742 2.509	2.352
2.237 68	2.150 2.080 2.023 1.975 3.982 3.132 2.740 2.507	2.350
2.235 69	2.148	2.348
2.233	2.145 2.076 2.019 1.971	
70 2.231	3.978 3.128 2.736 2.503 2.143 2.074 2.017 1.969	
71 2.229	3.976 3.126 2.734 2.501 2.142 2.072 2.015 1.967	2.344
72	3.974 3.124 2.732 2.499	2.342
2.227 73	3.972 3.122 2.730 2.497	2.340
2.226 74	2.138	2 338
2.224	2.136 2.066 2.009 1.961	
75 2.222	3.968 3.119 2.727 2.494 2.134 2.064 2.007 1.959	2.337
76 2.220	3.967 3.117 2.725 2.492 2.133 2.063 2.006 1.958	2.335
77	3.965 3.115 2.723 2.490	2.333
2.219 78	3.963 3.114 2.722 2.489	2.332
2.217 79	2.129 2.059 2.002 1.954 3.962 3.112 2.720 2.487	2.330
2.216	2.128 2.058 2.001 1.953	
80 2.214	3.960 3.111 2.719 2.486 2.126 2.056 1.999 1.951	
81 2.213	3.959 3.109 2.717 2.484 2.125 2.055 1.998 1.950	2.327
82 2.211	3.957 3.108 2.716 2.483	2.326
83	2.123 2.053 1.996 1.948 3.956 3.107 2.715 2.482	2.324
2.210 84	2.122 2.052 1.995 1.947 3.955 3.105 2.713 2.480	2.323
2.209	2.121 2.051 1.993 1.945	
85 2.207	3.953 3.104 2.712 2.479 2.119 2.049 1.992 1.944	4.322

```
86
          3.952
                 3.103
                        2.711
                                        2.321
                                2.478
                     1.991 1.943
2.206
       2.118 2.048
                        2.709 2.476
87
          3.951
                 3.101
                                        2.319
               2.047
                     1.989 1.941
2.205
       2.117
          3.949 3.100
                        2.708 2.475
88
                                        2.318
2.203
       2.115
               2.045 1.988 1.940
                 3.099
                        2.707
89
          3.948
                                 2.474
                                        2.317
                     1.987
       2.114
              2.044
2.202
                             1.939
          3.947
                3.098 2.706 2.473
                                        2.316
90
                     1.986
2.201
       2.113
             2.043
                             1.938
          3.946 3.097
                        2.705
91
                                 2.472
                                        2.315
       2.112 2.042
                     1.984
2.200
                             1.936
          3.945 3.095 2.704 2.471
                                        2.313
92
2.199
       2.111 2.041 1.983 1.935
93
          3.943 3.094 2.703
                               2.470
                                        2.312
2.198
                    1.982
       2.110 2.040
                            1.934
94
          3.942 3.093 2.701 2.469
                                        2.311
2.197
       2.109
              2.038
                     1.981
                            1.933
          3.941
                        2.700 2.467
95
                 3.092
                                        2.310
2.196
       2.108
               2.037
                      1.980 1.932
          3.940 3.091 2.699 2.466
96
                                        2.309
       2.106
               2.036
                      1.979
2.195
                              1.931
          3.939
                 3.090
                        2.698
                                        2.308
97
                                2.465
2.194
       2.105
               2.035
                     1.978 1.930
                        2.697
          3.938
                 3.089
                                 2.465
                                        2.307
98
       2.104
              2.034
                     1.977
2.193
                              1.929
          3.937
                 3.088 2.696 2.464
                                        2.306
99
2.192
       2.103 2.033 1.976 1.928
          3.936 3.087 2.696 2.463
100
                                        2.305
2.191
       2.103
             2.032
                    1.975
      oldsymbol{v}_1
           11
                                         15
                  12
                          13
                                  14
16
       17
               18
                      19
                              20
```

242.983 243.906 244.690 245.364 245.950 246.464 246.918 247.323 247.686 248.013 2 19.405 19.413 19.419 19.424 19.429 19.433 19.437 19.440 19.443 19.446 3 8.763 8.745 8.729 8.715 8.703 8.692 8.683 8.675 8.667 8.660 4 5.936 5.912 5.891 5.873 5.858 5.811 5.803 5.844 5.832 5.821 5 4.704 4.678 4.655 4.636 4.619 4.590 4.604 4.579 4.568 4.558 6 4.027 4.000 3.976 3.956 3.938 3.896 3.922 3.908 3.884 3.874 7 3.603 3.575 3.550 3.511 3.529 3.455 3.494 3.480 3.467 3.445 8 3.313 3.284 3.259 3.237 3.218 3.202 3.187 3.173 3.161 3.150 3.102 3.073 3.048 9 3.025 3.006 2.936 2.989 2.974 2.960 2.948 2.943 2.913 2.887 10 2.865 2.845 2.798 2.785 2.828 2.812 2.774 11 2.818 2.788 2.761 2.739 2.719 2.658 2.701 2.685 2.671 2.646 2.717 2.687 2.660 2.637 12 2.617 2.599 2.583 2.568 2.555 2.544 2.577 2.554 13 2.635 2.604 2.533 2.471 2.515 2.499 2.484 2.459

14	2.565 2.534 2.507 2.484	2.463
2.445 15	2.428 2.413 2.400 2.388 2.507 2.475 2.448 2.424	2.403
2.385 16	2.368 2.353 2.340 2.328 2.456 2.425 2.397 2.373	2.352
2.333 17	2.317 2.302 2.288 2.276 2.413 2.381 2.353 2.329	
2.289	2.272 2.257 2.243 2.230	
18 2.250	2.374 2.342 2.314 2.290 2.233 2.217 2.203 2.191	2.269
19 2.215	2.340 2.308 2.280 2.256 2.198 2.182 2.168 2.155	2.234
20	2.310 2.278 2.250 2.225	2.203
2.184 21	2.167 2.151 2.137 2.124 2.283 2.250 2.222 2.197	2.176
2.156 22	2.139 2.123 2.109 2.096 2.259 2.226 2.198 2.173	2.151
2.131	2.259 2.226 2.198 2.173 2.114 2.098 2.084 2.071	2.132
23 2.109	2.236 2.204 2.175 2.150 2.091 2.075 2.061 2.048	2.128
24 2.088	2.216 2.183 2.155 2.130 2.070 2.054 2.040 2.027	2.108
25 2.069	2.198 2.165 2.136 2.111	2.089
26	2.051 2.035 2.021 2.007 2.181 2.148 2.119 2.094	2.072
2.052 27	2.034 2.018 2.003 1.990 2.166 2.132 2.103 2.078	2.056
2.036 28	2.018 2.002 1.987 1.974 2.151 2.118 2.089 2.064	2.041
2.021	2.003 1.987 1.972 1.959	
29 2.007	2.138 2.104 2.075 2.050 1.989 1.973 1.958 1.945	2.027
30 1.995	2.126 2.092 2.063 2.037 1.976 1.960 1.945 1.932	2.015
31 1.983	2.114 2.080 2.051 2.026 1.965 1.948 1.933 1.920	2.003
32	2.103 2.070 2.040 2.015	1.992
1.972 33	1.953 1.937 1.922 1.908 2.093 2.060 2.030 2.004	1.982
1.961 34	1.943 1.926 1.911 1.898 2.084 2.050 2.021 1.995	
1.952	1.933 1.917 1.902 1.888	
35 1.942	2.075 2.041 2.012 1.986 1.924 1.907 1.892 1.878	
36 1.934	2.067 2.033 2.003 1.977 1.915 1.899 1.883 1.870	1.954
37	2.059 2.025 1.995 1.969	1.946
1.926 38	1.907 1.890 1.875 1.861 2.051 2.017 1.988 1.962	1.939
1.918 39	1.899 1.883 1.867 1.853 2.044 2.010 1.981 1.954	1.931
1.911 40	1.892 1.875 1.860 1.846 2.038 2.003 1.974 1.948	
1.904	1.885 1.868 1.853 1.839	
41 1.897	2.031 1.997 1.967 1.941 1.879 1.862 1.846 1.832	1.918
42 1.891	2.025 1.991 1.961 1.935 1.872 1.855 1.840 1.826	1.912
43	2.020 1.985 1.955 1.929	1.906
1.885 44	1.866 1.849 1.834 1.820 2.014 1.980 1.950 1.924	1.900
1.879 45	1.861 1.844 1.828 1.814 2.009 1.974 1.945 1.918	1.895
1.874		

46	2.004 1.969 1.940 1.913	1.890
1.869	1.850 1.833 1.817 1.803	
47	1.999 1.965 1.935 1.908	1.885
1.864	1.845 1.828 1.812 1.798	
48	1.995 1.960 1.930 1.904	1.880
1.859	1.840 1.823 1.807 1.793	
	1.990 1.956 1.926 1.899	1 076
49	1.990 1.950 1.920 1.899	1.876
1.855	1.836 1.819 1.803 1.789	
50	1.986 1.952 1.921 1.895	1.871
1.850	1.831 1.814 1.798 1.784	
51	1.982 1.947 1.917 1.891	1.867
1.846	1.827 1.810 1.794 1.780	
52	1.978 1.944 1.913 1.887	1.863
1.842	1.823 1.806 1.790 1.776	1.003
		1 050
53	1.975 1.940 1.910 1.883	1.859
1.838	1.819 1.802 1.786 1.772	
54	1.971 1.936 1.906 1.879	1.856
1.835	1.816 1.798 1.782 1.768	
55	1.968 1.933 1.903 1.876	1.852
1.831	1.812 1.795 1.779 1.764	
56	1.964 1.930 1.899 1.873	1.849
	1.504 1.550 1.055 1.075	1.043
1.828	1.809 1.791 1.775 1.761	
57	1.961 1.926 1.896 1.869	1.846
1.824	1.805 1.788 1.772 1.757	
58	1.958 1.923 1.893 1.866	1.842
1.821	1.802 1.785 1.769 1.754	
59	1.955 1.920 1.890 1.863	1.839
1.818	1.799 1.781 1.766 1.751	1.000
	1.799 1.701 1.700 1.731	1 026
60	1.952 1.917 1.887 1.860	1.836
1.815	1.796 1.778 1.763 1.748	
61	1.949 1.915 1.884 1.857	1.834
1.812	1.793 1.776 1.760 1.745	
62	1.947 1.912 1.882 1.855	1.831
1.809	1.790 1.773 1.757 1.742	_,,,
63	1.944 1.909 1.879 1.852	1.828
		1.020
1.807	1.787 1.770 1.754 1.739	1 006
64	1.942 1.907 1.876 1.849	1.826
1.804	1.785 1.767 1.751 1.737	
65	1.939 1.904 1.874 1.847	1.823
1.802	1.782 1.765 1.749 1.734	
66	1.937 1.902 1.871 1.845	1.821
1.799	1.780 1.762 1.746 1.732	
67	1.935 1.900 1.869 1.842	1.818
1.797	1.777 1.760 1.744 1.729	1.010
		1 016
68	1.932 1.897 1.867 1.840	1.816
1.795	1.775 1.758 1.742 1.727	
69	1.930 1.895 1.865 1.838	1.814
1.792	1.773 1.755 1.739 1.725	
70	1.928 1.893 1.863 1.836	1.812
1.790	1.771 1.753 1.737 1.722	
71	1.926 1.891 1.861 1.834	1.810
1.788	1.769 1.751 1.735 1.720	
		1 000
72	1.924 1.889 1.859 1.832	1.808
1.786	1.767 1.749 1.733 1.718	
73	1.922 1.887 1.857 1.830	1.806
1.784	1.765 1.747 1.731 1.716	
74	1.921 1.885 1.855 1.828	1.804
1.782	1.763 1.745 1.729 1.714	
75	1.919 1.884 1.853 1.826	1.802
1.780	1.761 1.743 1.727 1.712	
76		1.800
	1.917 1.882 1.851 1.824	T.800
1.778	1.759 1.741 1.725 1.710	1 500
77	1.915 1.880 1.849 1.822	T./98
1.777	1.757 1.739 1.723 1.708	

78	1.914 1.878 1.848 1.821	1.797
1.775	1.755 1.738 1.721 1.707	
79	1.912 1.877 1.846 1.819	1.795
1.773	1.754 1.736 1.720 1.705	
80	1.910 1.875 1.845 1.817	1.793
1.772	1.752 1.734 1.718 1.703	
81	1.909 1.874 1.843 1.816 1.750 1.733 1.716 1.702	1.792
1.770	1.750 1.733 1.716 1.702	
82	1.907 1.872 1.841 1.814	1.790
1.768	1.749 1.731 1.715 1.700	
83	1.906 1.871 1.840 1.813	1.789
1.767	1.747 1.729 1.713 1.698	
84	1.905 1.869 1.838 1.811	1.787
1.765	1.746 1.728 1.712 1.697	
85	1.903 1.868 1.837 1.810	1.786
1.764	1.744 1.726 1.710 1.695	
86	1.902 1.867 1.836 1.808	1.784
1.762	1.902 1.867 1.836 1.808 1.743 1.725 1.709 1.694	
87	1.900 1.865 1.834 1.807	1.783
1.761	1.741 1.724 1.707 1.692	
88	1.899 1.864 1.833 1.806	1.782
1.760	1.740 1.722 1.706 1.691	
89	1.898 1.863 1.832 1.804	1.780
1.758	1.739 1.721 1.705 1.690	
90	1.897 1.861 1.830 1.803 1.737 1.720 1.703 1.688	1.779
1.757	1.737 1.720 1.703 1.688	
91	1.895 1.860 1.829 1.802	1.778
1.756	1.736 1.718 1.702 1.687	
92	1.894 1.859 1.828 1.801	1.776
1.755	1.735 1.717 1.701 1.686	4 885
93	1.893 1.858 1.827 1.800	1.775
1.753	1.734 1.716 1.699 1.684	1 884
94	1.892 1.857 1.826 1.798 1.733 1.715 1.698 1.683	1.774
1.752	1./33 1./15 1.698 1.683	1 553
95 1 751	1.891 1.856 1.825 1.797 1.731 1.713 1.697 1.682	1.773
1.751		1 770
96 1 750	1.890 1.854 1.823 1.796	1.772
1.750 97	1.730 1.712 1.696 1.681 1.889 1.853 1.822 1.795	1.771
1.749	1.729 1.711 1.695 1.680	1.//1
98	1.888 1.852 1.821 1.794	1.770
1.748	1.728 1.710 1.694 1.679	1.//0
99	1.887 1.851 1.820 1.793	1.769
1.747	1.727 1.709 1.693 1.678	1.709
100	1.886 1.850 1.819 1.792	1.768
1.746	1.726 1.708 1.691 1.676	1.700
<b></b> / <b>-</b> /	,	

### Upper critical values of the F distribution for $v_1$ numerator degrees of freedom and $v_2$ denominator

### degrees of freedom

### 10% significance level

$$F_{.10}(
u_1,
u_2)$$
  $V_1$  1 2 3 4 5  $V_2$  7 8 9 10

 $v_2$ 

1	39.863 49.500 53.593 55.833	57.240
2	58.906 59.439 59.858 60.195 8.526 9.000 9.162 9.243	9.293
9.326 3	9.349 9.367 9.381 9.392 5.538 5.462 5.391 5.343	5.309
5.285 4	5.266 5.252 5.240 5.230 4.545 4.325 4.191 4.107	
4.010 5	3.979 3.955 3.936 3.920 4.060 3.780 3.619 3.520	
3.405	3.368 3.339 3.316 3.297	
6 3.055	3.776 3.463 3.289 3.181 3.014 2.983 2.958 2.937	
7 2.827	3.589 3.257 3.074 2.961 2.785 2.752 2.725 2.703	2.883
8 2.668	3.458 3.113 2.924 2.806 2.624 2.589 2.561 2.538	2.726
9	3.360 3.006 2.813 2.693	2.611
2.551 10	2.505 2.469 2.440 2.416 3.285 2.924 2.728 2.605 2.414 2.377 2.347 2.323	2.522
2.461 11	2.414 2.377 2.347 2.323 3.225 2.860 2.660 2.536	2.451
2.389 12	2.342 2.304 2.274 2.248 3.177 2.807 2.606 2.480	
2.331	2.283 2.245 2.214 2.188	
13 2.283	3.136 2.763 2.560 2.434 2.234 2.195 2.164 2.138	
14 2.243	3.102 2.726 2.522 2.395 2.193 2.154 2.122 2.095	
15 2.208	3.073 2.695 2.490 2.361 2.158 2.119 2.086 2.059	2.273
16	3.048 2.668 2.462 2.333 2.128 2.088 2.055 2.028	2.244
2.178 17	3.026 2.645 2.437 2.308	2.218
2.152 18	2.102 2.061 2.028 2.001 3.007 2.624 2.416 2.286	2.196
2.130 19	2.079 2.038 2.005 1.977 2.990 2.606 2.397 2.266	2.176
2.109 20	2.058 2.017 1.984 1.956	2.158
2.091	2.040 1.999 1.965 1.937	
21 2.075	2.961 2.575 2.365 2.233 2.023 1.982 1.948 1.920	
22 2.060	2.949 2.561 2.351 2.219 2.008 1.967 1.933 1.904	2.128
23 2.047	2.937 2.549 2.339 2.207 1.995 1.953 1.919 1.890	2.115
24 2.035	2.927 2.538 2.327 2.195 1.983 1.941 1.906 1.877	2.103
25	2.918 2.528 2.317 2.184	2.092
2.024 26	1.971 1.929 1.895 1.866 2.909 2.519 2.307 2.174	2.082
2.014 27	1.961 1.919 1.884 1.855 2.901 2.511 2.299 2.165	2.073
2.005 28	1.952 1.909 1.874 1.845 2.894 2.503 2.291 2.157	2.064
1.996	1.943 1.900 1.865 1.836	
29 1.988	2.887 2.495 2.283 2.149 1.935 1.892 1.857 1.827	
30 1.980	2.881 2.489 2.276 2.142 1.927 1.884 1.849 1.819	
31 1.973	2.875 2.482 2.270 2.136 1.920 1.877 1.842 1.812	2.042

32	2.869 2.477 2.263 2.129	2.036
1.967	1.913 1.870 1.835 1.805	
33	2.864 2.471 2.258 2.123	2.030
1.961	1.907 1.864 1.828 1.799	
34	2.859 2.466 2.252 2.118	2.024
1.955	1.901 1.858 1.822 1.793	0 010
35	2.855 2.461 2.247 2.113	2.019
1.950	1.896 1.852 1.817 1.787	2 014
36 1.945	2.850 2.456 2.243 2.108 1.891 1.847 1.811 1.781	2.014
37	2.846 2.452 2.238 2.103	2.009
1.940	1.886 1.842 1.806 1.776	2.005
38	2.842 2.448 2.234 2.099	2.005
1.935	1.881 1.838 1.802 1.772	_,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
39	2.839 2.444 2.230 2.095	2.001
1.931	1.877 1.833 1.797 1.767	
40	2.835 2.440 2.226 2.091	1.997
1.927	1.873 1.829 1.793 1.763	
41	2.832 2.437 2.222 2.087	1.993
1.923	1.869 1.825 1.789 1.759	
42	2.829 2.434 2.219 2.084	1.989
1.919	1.865 1.821 1.785 1.755	1 000
43	2.826 2.430 2.216 2.080	1.986
1.916	1.861 1.817 1.781 1.751	1 002
44 1.913	2.823 2.427 2.213 2.077 1.858 1.814 1.778 1.747	1.983
45	2.820 2.425 2.210 2.074	1.980
1.909	1.855 1.811 1.774 1.744	1.900
46	2.818 2.422 2.207 2.071	1.977
1.906	1.852 1.808 1.771 1.741	<b>±•</b> <i>5</i> ,,
47	2.815 2.419 2.204 2.068	1.974
1.903	1.849 1.805 1.768 1.738	
48	2.813 2.417 2.202 2.066	1.971
1.901	1.846 1.802 1.765 1.735	
49	2.811 2.414 2.199 2.063	1.968
1.898	1.843 1.799 1.763 1.732	
50	2.809 2.412 2.197 2.061	1.966
1.895		1 064
51	2.807 2.410 2.194 2.058	1.964
1.893 52	1.838 1.794 1.757 1.727	1 061
1.891	2.805 2.408 2.192 2.056 1.836 1.791 1.755 1.724	1.901
53	2.803 2.406 2.190 2.054	1.959
1.888	1.833 1.789 1.752 1.722	1.757
54	2.801 2.404 2.188 2.052	1.957
1.886	1.831 1.787 1.750 1.719	
55	2.799 2.402 2.186 2.050	1.955
1.884	1.829 1.785 1.748 1.717	
56	2.797 2.400 2.184 2.048	1.953
1.882	1.827 1.782 1.746 1.715	
57	2.796 2.398 2.182 2.046	1.951
1.880	1.825 1.780 1.744 1.713	1 040
58 1 070	2.794 2.396 2.181 2.044 1.823 1.779 1.742 1.711	1.949
1.878 59	2.793 2.395 2.179 2.043	1.947
1.876	1.821 1.777 1.740 1.709	1.94/
60	2.791 2.393 2.177 2.041	1.946
1.875	1.819 1.775 1.738 1.707	_,,,
61	2.790 2.392 2.176 2.039	1.944
1.873	1.818 1.773 1.736 1.705	
62	2.788 2.390 2.174 2.038	1.942
1.871	1.816 1.771 1.735 1.703	
63	2.787 2.389 2.173 2.036	1.941
1.870	1.814 1.770 1.733 1.702	

64	2.786 2.387 2.171 2.035	1.939
1.868	1.813 1.768 1.731 1.700	1 000
65	2.784 2.386 2.170 2.033	1.938
1.867	1.811 1.767 1.730 1.699	1 025
66	2.783 2.385 2.169 2.032	1.937
1.865	1.810 1.765 1.728 1.697	1 025
67	2.782 2.384 2.167 2.031	1.935
1.864	1.808 1.764 1.727 1.696	1 024
68 1.863	2.781 2.382 2.166 2.029 1.807 1.762 1.725 1.694	1.934
69	2.780 2.381 2.165 2.028	1.933
1.861	1.806 1.761 1.724 1.693	1.933
70	2.779 2.380 2.164 2.027	1.931
1.860	1.804 1.760 1.723 1.691	1.751
71	2.778 2.379 2.163 2.026	1.930
1.859	1.803 1.758 1.721 1.690	1.750
72		1.929
1.858	2.777 2.378 2.161 2.025 1.802 1.757 1.720 1.689	
73	2.776 2.377 2.160 2.024	1.928
1.856	1.801 1.756 1.719 1.687	
74	2.775 2.376 2.159 2.022	1.927
1.855	1.800 1.755 1.718 1.686	
75	2.774 2.375 2.158 2.021	1.926
1.854	1.798 1.754 1.716 1.685	
76	2.773 2.374 2.157 2.020 1.797 1.752 1.715 1.684	1.925
1.853	1.797 1.752 1.715 1.684	
77	2.772 2.373 2.156 2.019	1.924
1.852	1.796 1.751 1.714 1.683	
78	2.771 2.372 2.155 2.018	1.923
1.851	1.795 1.750 1.713 1.682	
79	2.770 2.371 2.154 2.017	1.922
1.850	1.794 1.749 1.712 1.681	1 001
80	2.769 2.370 2.154 2.016 1.793 1.748 1.711 1.680	1.921
1.849	2.769 2.369 2.153 2.016	1.920
81 1.848	1.792 1.747 1.710 1.679	1.920
82	2.768 2.368 2.152 2.015	1.919
1.847	1.791 1.746 1.709 1.678	1.919
83	2.767 2.368 2.151 2.014	1.918
1.846	1.790 1.745 1.708 1.677	1.710
84	2.766 2.367 2.150 2.013	1.917
1.845	2.766 2.367 2.150 2.013 1.790 1.744 1.707 1.676	
85	2.765 2.366 2.149 2.012	1.916
1.845	1.789 1.744 1.706 1.675	
86	2.765 2.365 2.149 2.011	1.915
1.844	1.788 1.743 1.705 1.674	
87	2.764 2.365 2.148 2.011	1.915
1.843	1.787 1.742 1.705 1.673	
88	2.763 2.364 2.147 2.010	1.914
1.842	1.786 1.741 1.704 1.672	
89	2.763 2.363 2.146 2.009	1.913
1.841	1.785 1.740 1.703 1.671	1 010
90	2.762 2.363 2.146 2.008	1.912
1.841	1.785 1.739 1.702 1.670	1 010
91 1.840	2.761 2.362 2.145 2.008 1.784 1.739 1.701 1.670	1.912
92	2.761 2.361 2.144 2.007	1.911
1.839	1.783 1.738 1.701 1.669	エ・フエエ
93	2.760 2.361 2.144 2.006	1.910
1.838	1.782 1.737 1.700 1.668	±•>±0
94	2.760 2.360 2.143 2.006	1.910
1.838		_,,_,
95	2.759 2.359 2.142 2.005	1.909
	1.781 1.736 1.698 1.667	

96 1.836 97 1.836 98 1.835 99 1.835	2.759 2.359 2.142 2.004 1.780 1.735 1.698 1.666 2.758 2.358 2.141 2.004 1.780 1.734 1.697 1.665 2.757 2.358 2.141 2.003 1.779 1.734 1.696 1.665 2.757 2.357 2.140 2.003 1.778 1.733 1.696 1.664 2.756 2.356 2.139 2.002	1.908 1.907 1.906
1.834	1.778 1.732 1.695 1.663	1.500
16 v <sub>2</sub>	$egin{array}{cccccccccccccccccccccccccccccccccccc$	15
1 61.350	60.473 60.705 60.903 61.073 61.464 61.566 61.658 61.740	61.220
2 9.429	9.401 9.408 9.415 9.420 9.433 9.436 9.439 9.441	9.425
3 5.196	5.222 5.216 5.210 5.205 5.193 5.190 5.187 5.184	5.200
4	3.907 3.896 3.886 3.878	3.870
3.864	3.858 3.853 3.849 3.844 3.282 3.268 3.257 3.247 3.223 3.217 3.212 3.207	3.238
3.230 6	2.920 2.905 2.892 2.881	2.871
2.863 7	2.855 2.848 2.842 2.836 2.684 2.668 2.654 2.643	2.632
2.623 8	2.615 2.607 2.601 2.595 2.519 2.502 2.488 2.475	2.464
2.455 9	2.446 2.438 2.431 2.425 2.396 2.379 2.364 2.351	2.340
2.329 10	2.396 2.379 2.364 2.351 2.320 2.312 2.305 2.298 2.302 2.284 2.269 2.255	2.244
2.233	2.224 2.215 2.208 2.201 2.227 2.209 2.193 2.179	2.167
2.156 12	2.147 2.138 2.130 2.123 2.166 2.147 2.131 2.117	
2.094 13	2.084 2.075 2.067 2.060	
2.042	2.116 2.097 2.080 2.066 2.032 2.023 2.014 2.007	
14 1.998	2.073 2.054 2.037 2.022 1.988 1.978 1.970 1.962	
15 1.961	2.037 2.017 2.000 1.985 1.950 1.941 1.932 1.924	
16 1.928	2.005 1.985 1.968 1.953 1.917 1.908 1.899 1.891	
17 1.900	1.978 1.958 1.940 1.925 1.889 1.879 1.870 1.862	1.912
18 1.875	1.954 1.933 1.916 1.900 1.864 1.854 1.845 1.837	1.887
19 1.852	1.932 1.912 1.894 1.878 1.841 1.831 1.822 1.814	1.865
20 1.833	1.913 1.892 1.875 1.859 1.821 1.811 1.802 1.794	1.845
21 1.815	1.896 1.875 1.857 1.841 1.803 1.793 1.784 1.776	1.827
22	1.880 1.859 1.841 1.825	1.811
1.798 23	1.787 1.777 1.768 1.759 1.866 1.845 1.827 1.811	1.796
1.784	1.772 1.762 1.753 1.744	

24 1.770	1.853 1.832 1.814 1.797 1.759 1.748 1.739 1.730	1.783
25	1.841 1.820 1.802 1.785	1.771
1.758 26	1.746 1.736 1.726 1.718 1.830 1.809 1.790 1.774	1.760
1.747 27	1.735 1.724 1.715 1.706 1.820 1.799 1.780 1.764	1.749
1.736	1.724 1.714 1.704 1.695	
28 1.726	1.811 1.790 1.771 1.754 1.715 1.704 1.694 1.685	1.740
29 1.717	1.802 1.781 1.762 1.745 1.705 1.695 1.685 1.676	1.731
30	1.794 1.773 1.754 1.737	1.722
1.709 31	1.697 1.686 1.676 1.667 1.787 1.765 1.746 1.729	1.714
1.701 32	1.689 1.678 1.668 1.659 1.780 1.758 1.739 1.722	1.707
1.694	1.682 1.671 1.661 1.652	
33 1.687	1.773 1.751 1.732 1.715 1.675 1.664 1.654 1.645	1.700
34 1.680	1.767 1.745 1.726 1.709 1.668 1.657 1.647 1.638	1.694
35	1.761 1.739 1.720 1.703	1.688
1.674 36	1.662 1.651 1.641 1.632 1.756 1.734 1.715 1.697	1.682
1.669 37	1.656 1.645 1.635 1.626 1.751 1.729 1.709 1.692	1.677
1.663 38	1.651 1.640 1.630 1.620 1.746 1.724 1.704 1.687	1.672
1.658	1.646 1.635 1.624 1.615	
39 1.653	1.741 1.719 1.700 1.682 1.641 1.630 1.619 1.610	1.667
40 1.649	1.737 1.715 1.695 1.678 1.636 1.625 1.615 1.605	1.662
41	1.733 1.710 1.691 1.673	1.658
1.644 42	1.632 1.620 1.610 1.601 1.729 1.706 1.687 1.669	1.654
1.640 43	1.628 1.616 1.606 1.596 1.725 1.703 1.683 1.665	1.650
1.636	1.624 1.612 1.602 1.592	
44 1.632	1.721 1.699 1.679 1.662 1.620 1.608 1.598 1.588	
45 1.629	1.718 1.695 1.676 1.658 1.616 1.605 1.594 1.585	1.643
46 1.625	1.715 1.692 1.672 1.655 1.613 1.601 1.591 1.581	1.639
47	1.712 1.689 1.669 1.652	1.636
1.622 48	1.609 1.598 1.587 1.578 1.709 1.686 1.666 1.648	1.633
1.619 49	1.606 1.594 1.584 1.574 1.706 1.683 1.663 1.645	1.630
1.616	1.603 1.591 1.581 1.571	
50 1.613	1.703 1.680 1.660 1.643 1.600 1.588 1.578 1.568	
51 1.610	1.700 1.677 1.658 1.640 1.597 1.586 1.575 1.565	1.624
52	1.698 1.675 1.655 1.637	1.621
1.607 53	1.594 1.583 1.572 1.562 1.695 1.672 1.652 1.635	1.619
1.605 54	1.592 1.580 1.570 1.560 1.693 1.670 1.650 1.632	1.616
1.602 55	1.589 1.578 1.567 1.557	
1.600	1.691 1.668 1.648 1.630 1.587 1.575 1.564 1.555	1.014

56 1.597	1.688 1.666 1.645 1.628 1.585 1.573 1.562 1.552	1.612
57 1.595	1.686 1.663 1.643 1.625 1.582 1.571 1.560 1.550	1.610
58	1.684 1.661 1.641 1.623	1.607
1.593 59	1.580 1.568 1.558 1.548 1.682 1.659 1.639 1.621	1.605
1.591 60	1.578 1.566 1.555 1.546 1.680 1.657 1.637 1.619	1.603
1.589 61	1.576 1.564 1.553 1.543 1.679 1.656 1.635 1.617	1.601
1.587 62	1.574 1.562 1.551 1.541 1.677 1.654 1.634 1.616	1.600
1.585 63	1.572 1.560 1.549 1.540 1.675 1.652 1.632 1.614	1.598
1.583 64	1.570 1.558 1.548 1.538 1.673 1.650 1.630 1.612	1.596
1.582	1.569 1.557 1.546 1.536 1.672 1.649 1.628 1.610	1.594
65 1.580	1.567 1.555 1.544 1.534	
66 1.578	1.670 1.647 1.627 1.609 1.565 1.553 1.542 1.532	1.593
67 1.577	1.669 1.646 1.625 1.607 1.564 1.552 1.541 1.531	1.591
68 1.575	1.667 1.644 1.624 1.606 1.562 1.550 1.539 1.529	1.590
69 1.574	1.666 1.643 1.622 1.604 1.560 1.548 1.538 1.527	1.588
70 1.572	1.665 1.641 1.621 1.603 1.559 1.547 1.536 1.526	1.587
71 1.571	1.663 1.640 1.619 1.601 1.557 1.545 1.535 1.524	1.585
72 1.569	1.662 1.639 1.618 1.600 1.556 1.544 1.533 1.523	1.584
73	1.661 1.637 1.617 1.599	1.583
1.568 74	1.555 1.543 1.532 1.522 1.659 1.636 1.616 1.597	1.581
1.567 75	1.553 1.541 1.530 1.520 1.658 1.635 1.614 1.596	1.580
1.565 76	1.552 1.540 1.529 1.519 1.657 1.634 1.613 1.595	1.579
1.564 77	1.551 1.539 1.528 1.518 1.656 1.632 1.612 1.594	1.578
1.563 78		
1.562 79		
1.561	1.547 1.535 1.524 1.514	
80 1.559	1.653 1.629 1.609 1.590 1.546 1.534 1.523 1.513	
81 1.558	1.652 1.628 1.608 1.589 1.545 1.533 1.522 1.512	
82 1.557	1.651 1.627 1.607 1.588 1.544 1.532 1.521 1.511	
83 1.556	1.650 1.626 1.606 1.587 1.543 1.531 1.520 1.509	
84 1.555	1.649 1.625 1.605 1.586 1.542 1.530 1.519 1.508	1.570
85 1.554	1.648 1.624 1.604 1.585	1.569
86 1.553	1.647 1.623 1.603 1.584	1.568
87	1.646 1.622 1.602 1.583	1.567
1.552	1.539 1.527 1.516 1.505	

88	1.645 1.622 1.601 1.583	1.566
1.551	1.538 1.526 1.515 1.504	
89	1.644 1.621 1.600 1.582	1.565
1.550	1.537 1.525 1.514 1.503	
90	1.643 1.620 1.599 1.581	1.564
1.550	1.536 1.524 1.513 1.503	
91	1.643 1.619 1.598 1.580	1.564
1.549	1.535 1.523 1.512 1.502	
92	1.642 1.618 1.598 1.579	1.563
1.548	1.534 1.522 1.511 1.501	_,,,,
93	1.641 1.617 1.597 1.578	1.562
1.547	1.534 1.521 1.510 1.500	1.302
94	1.640 1.617 1.596 1.578	1.561
1.546	1.533 1.521 1.509 1.499	1.301
	1.640 1.616 1.595 1.577	1.560
95		1.360
1.545	1.532 1.520 1.509 1.498	
96	1.639 1.615 1.594 1.576	1.560
1.545	1.531 1.519 1.508 1.497	
97	1.638 1.614 1.594 1.575	1.559
1.544	1.530 1.518 1.507 1.497	
98	1.637 1.614 1.593 1.575	1.558
1.543	1.530 1.517 1.506 1.496	
99	1.637 1.613 1.592 1.574	1.557
1.542	1.529 1.517 1.505 1.495	
100	1.636 1.612 1.592 1.573	1.557
1.542	1.528 1.516 1.505 1.494	

### Upper critical values of the F distribution

## for $v_1$ numerator degrees of freedom and $v_2$ denominator degrees of freedom

#### 1% significance level

5

5.351

5.257

5.467

5.613

5.802

10 5.386	10.044 7.559 6.552 5.994 5.200 5.057 4.942 4.849	5.636
11	9.646 7.206 6.217 5.668	5.316
5.069 12	4.886 4.744 4.632 4.539 9.330 6.927 5.953 5.412	5.064
4.821	4.640 4.499 4.388 4.296	
13 4.620	9.074 6.701 5.739 5.205 4.441 4.302 4.191 4.100	4.862
14 4.456	8.862 6.515 5.564 5.035 4.278 4.140 4.030 3.939	4.695
15	8.683 6.359 5.417 4.893	4.556
4.318 16	4.142 4.004 3.895 3.805 8.531 6.226 5.292 4.773	4.437
4.202 17	4.026 3.890 3.780 3.691 8.400 6.112 5.185 4.669	4.336
4.102	3.927 3.791 3.682 3.593	
18 4.015	8.285 6.013 5.092 4.579 3.841 3.705 3.597 3.508	4.248
19 3.939	8.185 5.926 5.010 4.500 3.765 3.631 3.523 3.434	4.171
20	8.096 5.849 4.938 4.431	4.103
3.871 21	3.699 3.564 3.457 3.368 8.017 5.780 4.874 4.369	4.042
3.812	3.640 3.506 3.398 3.310	
22 3.758	7.945 5.719 4.817 4.313 3.587 3.453 3.346 3.258	3.988
23 3.710	7.881 5.664 4.765 4.264 3.539 3.406 3.299 3.211	3.939
24	7.823 5.614 4.718 4.218 3.496 3.363 3.256 3.168	3.895
3.667 25	7.770 5.568 4.675 4.177	3.855
3.627 26	3.457 3.324 3.217 3.129 7.721 5.526 4.637 4.140	3.818
3.591	3.421 3.288 3.182 3.094	
27 3.558	7.677 5.488 4.601 4.106 3.388 3.256 3.149 3.062	
28 3.528	7.636 5.453 4.568 4.074 3.358 3.226 3.120 3.032	3.754
29	7.598 5.420 4.538 4.045	3.725
3.499 30	3.330 3.198 3.092 3.005 7.562 5.390 4.510 4.018	3.699
3.473 31	3.305 3.173 3.067 2.979 7.530 5.362 4.484 3.993	3.675
3.449	3.281 3.149 3.043 2.955	
32 3.427	7.499 5.336 4.459 3.969 3.258 3.127 3.021 2.934	
33 3.406	7.471 5.312 4.437 3.948 3.238 3.106 3.000 2.913	3.630
34	7.444 5.289 4.416 3.927	3.611
3.386 35	3.218 3.087 2.981 2.894 7.419 5.268 4.396 3.908	3.592
3.368 36	3.200 3.069 2.963 2.876 7.396 5.248 4.377 3.890	3.574
3.351	3.183 3.052 2.946 2.859	
37 3.334	7.373 5.229 4.360 3.873 3.167 3.036 2.930 2.843	
38 3.319	7.353 5.211 4.343 3.858 3.152 3.021 2.915 2.828	3.542
39 3.305	7.333 5.194 4.327 3.843 3.137 3.006 2.901 2.814	3.528
40	7.314 5.179 4.313 3.828	3.514
3.291 41	3.124 2.993 2.888 2.801 7.296 5.163 4.299 3.815	3.501
	3.111 2.980 2.875 2.788	

42	7.280 5.149 4.285 3.802	3.488
3.266 43	3.099 2.968 2.863 2.776 7.264 5.136 4.273 3.790	3.476
3.254 44	3.087 2.957 2.851 2.764 7.248 5.123 4.261 3.778	3.465
3.243 45	3.076 2.946 2.840 2.754 7.234 5.110 4.249 3.767	
3.232	3.066 2.935 2.830 2.743	
46 3.222	7.220 5.099 4.238 3.757 3.056 2.925 2.820 2.733	
47 3.213	7.207 5.087 4.228 3.747 3.046 2.916 2.811 2.724	3.434
48	7.194 5.077 4.218 3.737 3.037 2.907 2.802 2.715	3.425
3.204 49	7.182 5.066 4.208 3.728	3.416
3.195 50	3.028	3.408
3.186 51	7.171 5.057 4.199 3.720 3.020 2.890 2.785 2.698 7.159 5.047 4.191 3.711	3.400
3.178	3.012 2.882 2.777 2.690	
52 3.171	7.149 5.038 4.182 3.703 3.005 2.874 2.769 2.683	
53 3.163	7.139 5.030 4.174 3.695 2.997 2.867 2.762 2.675	3.384
54 3.156	7.129 5.021 4.167 3.688 2.990 2.860 2.755 2.668	3.377
55	7.119 5.013 4.159 3.681	3.370
3.149 56	2.983 2.853 2.748 2.662 7.110 5.006 4.152 3.674	3.363
3.143 57	2.977 2.847 2.742 2.655 7.102 4.998 4.145 3.667	3.357
3.136 58	2.971 2.841 2.736 2.649	
3.130	7.093 4.991 4.138 3.661 2.965 2.835 2.730 2.643	2.245
59 3.124	7.085 4.984 4.132 3.655 2.959 2.829 2.724 2.637	
60 3.119	7.077 4.977 4.126 3.649 2.953 2.823 2.718 2.632	3.339
61 3.113	7.070 4.971 4.120 3.643 2.948 2.818 2.713 2.626	3.333
62	7.062 4.965 4.114 3.638 2.942 2.813 2.708 2.621	3.328
3.108 63	7.055 4.959 4.109 3.632	3.323
3.103 64	2.937 2.808 2.703 2.616 7.048 4.953 4.103 3.627	3.318
3.098 65	2.932 2.803 2.698 2.611 7.042 4.947 4.098 3.622	
3.093	2.928 2.798 2.693 2.607	
66 3.088	7.035 4.942 4.093 3.618 2.923 2.793 2.689 2.602	
67 3.084	7.029 4.937 4.088 3.613 2.919 2.789 2.684 2.598	3.304
68 3.080	7.023 4.932 4.083 3.608 2.914 2.785 2.680 2.593	3.299
69	7.017 4.927 4.079 3.604	3.295
3.075 70	2.910 2.781 2.676 2.589 7.011 4.922 4.074 3.600	3.291
3.071 71	2.906 2.777 2.672 2.585 7.006 4.917 4.070 3.596	
3.067 72	2.902 2.773 2.668 2.581 7.001 4.913 4.066 3.591	
3.063	2.898 2.769 2.664 2.578	
73 3.060	6.995 4.908 4.062 3.588 2.895 2.765 2.660 2.574	3.279

.v.s. opper cm	real values of the 1 Distribution	
74	6.990 4.904 4.058 3.584	3.275
3.056	2.891 2.762 2.657 2.570	
75	6.985 4.900 4.054 3.580	3.272
3.052	2.887 2.758 2.653 2.567	
76	6.981 4.896 4.050 3.577	3.268
3.049 77	2.884 2.755 2.650 2.563 6.976 4.892 4.047 3.573	3.265
3.046	2.881 2.751 2.647 2.560	3.203
78	6.971 4.888 4.043 3.570	3.261
3.042	2.877 2.748 2.644 2.557	31-0-
79	6.967 4.884 4.040 3.566	3.258
3.039	2.874 2.745 2.640 2.554	
80	6.963 4.881 4.036 3.563	3.255
3.036	2.871 2.742 2.637 2.551	
81	6.958 4.877 4.033 3.560	3.252
3.033 82	2.868 2.739 2.634 2.548 6.954 4.874 4.030 3.557	3.249
3.030	2.865 2.736 2.632 2.545	3.249
83	6.950 4.870 4.027 3.554	3.246
3.027	2.863 2.733 2.629 2.542	30223
84	6.947 4.867 4.024 3.551	3.243
3.025	2.860 2.731 2.626 2.539	
85	6.943 4.864 4.021 3.548	3.240
3.022	2.857 2.728 2.623 2.537	2 220
86 3.019	6.939 4.861 4.018 3.545 2.854 2.725 2.621 2.534	3.238
87	6 935  4 858  4 015  3 543	3.235
3.017	6.935 4.858 4.015 3.543 2.852 2.723 2.618 2.532	3.233
88	6.932 4.855 4.012 3.540	3.233
3.014	2.849 2.720 2.616 2.529	
89	6.928 4.852 4.010 3.538	3.230
3.012	2.847 2.718 2.613 2.527	
90 3.009	6.925 4.849 4.007 3.535	3.228
91	2.845 2.715 2.611 2.524 6.922 4.846 4.004 3.533	3.225
3.007	2.842 2.713 2.609 2.522	3.223
92	6.919 4.844 4.002 3.530	3.223
3.004	2.840 2.711 2.606 2.520	
93	6.915 4.841 3.999 3.528	3.221
3.002	2.838 2.709 2.604 2.518	
94	6.912 4.838 3.997 3.525	3.218
3.000 95	2.835 2.706 2.602 2.515 6.909 4.836 3.995 3.523	3.216
2.998	2.833 2.704 2.600 2.513	3.210
96	6.906 4.833 3.992 3.521	3.214
2.996	2.831 2.702 2.598 2.511	
97	6.904 4.831 3.990 3.519	3.212
2.994	2.829 2.700 2.596 2.509	
98	6.901 4.829 3.988 3.517	3.210
2.992	2.827 2.698 2.594 2.507	2 200
99 2.990	6.898 4.826 3.986 3.515 2.825 2.696 2.592 2.505	3.208
100	6.895 4.824 3.984 3.513	3.206
2.988	2.823 2.694 2.590 2.503	3.200
\	$v_1$ 11 12 13 14	15
16	17 18 19 20	13
$v_2$		

1. 6083.35 6106.35 6125.86 6142.70 6157.28 6170.12 6181.42 6191.52 6200.58 6208.74

2. 99.437	99.408 99.416 99.422 99.428 99.440 99.444 99.447 99.449	99.432
3. 26.827	27.133 27.052 26.983 26.924 26.787 26.751 26.719 26.690	26.872
4.	14.452 14.374 14.307 14.249	14.198
14.154 5.	14.115 14.080 14.048 14.020 9.963 9.888 9.825 9.770	9.722
9.680 6.	9.643 9.610 9.580 9.553 7.790 7.718 7.657 7.605	7.559
7.519 7.	7.483 7.451 7.422 7.396 6.538 6.469 6.410 6.359	6.314
6.275	6.240 6.209 6.181 6.155	
8. 5.477	5.734 5.667 5.609 5.559 5.442 5.412 5.384 5.359	5.515
9. 4.924	5.178 5.111 5.055 5.005 4.890 4.860 4.833 4.808	4.962
10. 4.520	4.772 4.706 4.650 4.601 4.487 4.457 4.430 4.405	4.558
11.	4.462 4.397 4.342 4.293	4.251
4.213 12.	4.180 4.150 4.123 4.099 4.220 4.155 4.100 4.052	4.010
3.972 13.	3.939 3.909 3.883 3.858 4.025 3.960 3.905 3.857	3.815
3.778 14.	3.745 3.716 3.689 3.665 3.864 3.800 3.745 3.698	3.656
3.619 15.	3.586 3.556 3.529 3.505 3.730 3.666 3.612 3.564	3.522
3.485	3.452 3.423 3.396 3.372	
16. 3.372	3.616 3.553 3.498 3.451 3.339 3.310 3.283 3.259	3.409
17. 3.275	3.519 3.455 3.401 3.353 3.242 3.212 3.186 3.162	3.312
18. 3.190	3.434 3.371 3.316 3.269 3.158 3.128 3.101 3.077	3.227
19. 3.116	3.360 3.297 3.242 3.195 3.084 3.054 3.027 3.003	3.153
20.	3.294 3.231 3.177 3.130	3.088
3.051 21.	3.018 2.989 2.962 2.938 3.236 3.173 3.119 3.072	3.030
2.993 22.	2.960 2.931 2.904 2.880 3.184 3.121 3.067 3.019	2.978
2.941 23.	2.908 2.879 2.852 2.827 3.137 3.074 3.020 2.973	
2.894	2.861 2.832 2.805 2.781	
24. 2.852	3.094 3.032 2.977 2.930 2.819 2.789 2.762 2.738	
25. 2.813	3.056 2.993 2.939 2.892 2.780 2.751 2.724 2.699	2.850
26. 2.778	3.021 2.958 2.904 2.857 2.745 2.715 2.688 2.664	2.815
27.	2.988 2.926 2.871 2.824 2.713 2.683 2.656 2.632	2.783
2.746 28.	2.959 2.896 2.842 2.795	2.753
2.716 29.	2.683 2.653 2.626 2.602 2.931 2.868 2.814 2.767	2.726
2.689 30.	2.656 2.626 2.599 2.574 2.906 2.843 2.789 2.742	2.700
2.663 31.	2.630 2.600 2.573 2.549 2.882 2.820 2.765 2.718	
2.640	2.606 2.577 2.550 2.525	
32. 2.618	2.860 2.798 2.744 2.696 2.584 2.555 2.527 2.503	
33. 2.597	2.840 2.777 2.723 2.676 2.564 2.534 2.507 2.482	2.634

34.         2.821         2.758         2.704         2.657         2.615           2.556         2.545         2.515         2.488         2.463         2.597           2.560         2.527         2.490         2.686         2.639         2.597           36.         2.786         2.723         2.669         2.622         2.580           2.527         2.494         2.463         2.483         2.591         2.564           2.527         2.494         2.464         2.437         2.12         2.397           2.512         2.479         2.449         2.421         2.397         2.535           2.498         2.465         2.434         2.407         2.382         2.591         2.535           2.498         2.465         2.434         2.407         2.382         2.552         2.484         2.451         2.562         2.588         2.551         2.509           4.40         2.715         2.652         2.586         2.559         2.542         2.432         2.509         2.446         2.451         2.454         2.572         2.485         2.532         2.497         2.452         2.497         2.454         2.539         2.497			
35.         2.803         2.740         2.686         2.639         2.597           36.         2.786         2.723         2.669         2.622         2.580           2.543         2.510         2.480         2.453         2.428         37.         2.770         2.653         2.606         2.564           2.527         2.494         2.464         2.437         2.412         38.         2.575         2.549         2.421         2.397         39.         2.741         2.678         2.624         2.577         2.535         2.494         2.421         2.397         39.         2.741         2.678         2.611         2.563         2.591         2.549           2.488         2.465         2.434         2.407         2.382         2.522         2.442         2.577         2.535         2.522         2.442         2.577         2.552         2.441         2.563         2.552         2.441         2.563         2.552         2.441         2.563         2.552         2.441         2.561         2.563         2.552         2.447         2.438         2.408         2.381         2.563         2.539         2.497         2.452         2.575         2.552         2.582         2.57			2.615
2.560       2.527       2.497       2.470       2.485       2.580         2.543       2.510       2.480       2.453       2.428       2.37.       2.577       2.653       2.606       2.564         2.527       2.494       2.464       2.437       2.412       2.38.       2.575       2.692       2.638       2.591       2.549         2.512       2.479       2.449       2.421       2.397       2.391       2.512       2.479       2.482       2.577       2.535         2.488       2.465       2.434       2.407       2.382       2.522       2.484       2.451       2.421       2.397       2.484       2.451       2.421       2.394       2.562       2.598       2.551       2.509       2.427       2.665       2.611       2.563       2.598       2.551       2.509       2.447       2.438       2.408       2.381       2.352       2.449       2.427       2.438       2.408       2.381       2.352       2.449       2.446       2.426       2.396       2.369       2.344       2.427       2.438       2.408       2.618       2.564       2.519       2.497         2.440       2.447       2.434       2.434       2.514 <td></td> <td></td> <td></td>			
36.		2.803 2.740 2.686 2.639	2.597
2.543		2.527 2.497 2.470 2.445	0 500
37.         2.770         2.670         2.653         2.606         2.564           2.527         2.449         2.464         2.437         2.412         38.         2.755         2.692         2.638         2.591         2.549           2.512         2.479         2.449         2.421         2.397         2.535           2.498         2.465         2.434         2.407         2.382         40.         2.7715         2.652         2.611         2.563         2.522           2.484         2.451         2.421         2.394         2.369         2.551         2.509           4.4.         2.715         2.682         2.598         2.551         2.509           2.472         2.438         2.408         2.381         2.356         42.           2.400         2.2691         2.652         2.575         2.539         2.497           2.448         2.415         2.385         2.357         2.322         2.475           2.448         2.415         2.385         2.357         2.332         2.475           2.437         2.460         2.518         2.516         2.475           2.437         2.383         2.336         2.33		2.786 2.723 2.669 2.622	2.580
2.527       2.494       2.464       2.437       2.412       2.549       2.512       2.575       2.692       2.638       2.591       2.549         2.512       2.479       2.449       2.421       2.397       77       2.535         2.498       2.465       2.434       2.407       2.382       40.       2.727       2.655       2.611       2.563       2.522         2.484       2.451       2.421       2.394       2.369       2.551       2.509         2.472       2.438       2.408       2.381       2.356       2.497         2.460       2.426       2.396       2.369       2.344       3.       2.691       2.586       2.539       2.497         2.440       2.342       2.396       2.369       2.344       2.312       2.408       2.415       2.385       2.357       2.332       2.485         2.448       2.415       2.385       2.357       2.332       2.466       2.475       2.485         2.437       2.404       2.374       2.346       2.512       2.461       2.475         2.437       2.402       2.538       2.544       2.346       2.347         2.411       2.384<		2.510 2.480 2.453 2.428	2 564
38.       2.755       2.692       2.638       2.591       2.549         39.       2.741       2.678       2.624       2.577       2.535         2.498       2.465       2.434       2.407       2.382         2.484       2.451       2.421       2.394       2.369         41.       2.715       2.652       2.598       2.551       2.509         2.472       2.438       2.408       2.381       2.356       2.344         42.       2.703       2.640       2.586       2.539       2.497         2.460       2.426       2.396       2.369       2.344         43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.334       2.475       2.485         2.448       2.415       2.385       2.357       2.332       2.465       2.516       2.475         2.437       2.404       2.374       2.346       2.321       2.466       2.427         2.339       2.363       2.336       2.311       2.427       2.348       2.357       2.526       2.454         2.417       2.384       2.357		2.//0 2./0/ 2.655 2.606	2.564
2.512       2.479       2.449       2.624       2.577       2.535         2.498       2.465       2.434       2.407       2.382       40.       2.727       2.665       2.611       2.563       2.522         2.484       2.451       2.421       2.394       2.369       41.       2.715       2.652       2.598       2.551       2.509         2.472       2.438       2.408       2.381       2.356       2.539       2.497         2.460       2.426       2.396       2.369       2.344       43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.44       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       2.522       2.485         2.437       2.404       2.374       2.346       2.321       2.462       2.475         2.437       2.404       2.374       2.346       2.321       2.462       2.475         2.427       2.393       2.353       2.326       2.301       2.445       2.447         2.407       2.384       2.316		2.494 2.404 2.43/ 2.412	2 540
39.       2.741       2.678       2.624       2.577       2.535         40.       2.727       2.665       2.611       2.563       2.522         2.484       2.451       2.421       2.394       2.369         41.       2.715       2.652       2.598       2.551       2.509         2.472       2.438       2.408       2.381       2.356       42.       2.579       2.447         2.460       2.426       2.396       2.369       2.344       43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       44.       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       45       2.427       2.393       2.363       2.336       2.311       46       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47       2.452       2.487       2.445         2.417       2.384       2.353       2.534       2.487       2.445         2.408       2.374       2.342 <t< td=""><td></td><td></td><td>2.549</td></t<>			2.549
2.498       2.465       2.434       2.407       2.382       2.484       2.451       2.421       2.394       2.369       41.       2.712       2.665       2.598       2.551       2.509         2.472       2.438       2.408       2.381       2.356       42.       2.703       2.640       2.586       2.539       2.497         2.460       2.426       2.396       2.367       2.322       2.427       2.485         2.448       2.415       2.385       2.357       2.322       2.475         2.448       2.415       2.384       2.346       2.516       2.475         2.437       2.404       2.374       2.346       2.311       45.       2.670       2.608       2.553       2.506       2.464         2.427       2.384       2.353       2.326       2.301       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47.       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.91       4.46       2.478       2.445         2.408       2.352 <td></td> <td></td> <td>2 535</td>			2 535
40.       2.727       2.665       2.611       2.563       2.522         2.484       2.451       2.421       2.394       2.356       2.551       2.509         2.472       2.438       2.408       2.381       2.356       2.497         2.460       2.426       2.396       2.369       2.344       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.44       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       44       2.600       2.598       2.544       2.496       2.454         2.427       2.393       2.363       2.336       2.311       46       2.600       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.91       48       2.625       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.82       2.469		2.711 2.070 2.021 2.377	2.333
2.484       2.451       2.421       2.394       2.369         2.472       2.438       2.408       2.381       2.356         42.       2.703       2.640       2.586       2.539       2.497         2.460       2.426       2.396       2.369       2.344       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.446       2.516       2.475         2.437       2.404       2.374       2.346       2.321       2.464       2.660       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       2.6       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       2.445       2.447       2.445         2.408       2.374       2.344       2.316       2.291       2.445       2.492       2.432       2.447       2.445         2.390       2.365       2.335       2.307       2.282       2.478       2.436       2.31       2.472       2.393       2.365       2.352       2.274       2.272       2.39       2.274       2.			2.522
41.       2.715       2.652       2.598       2.551       2.509         2.472       2.438       2.408       2.381       2.356       42.539       2.449         2.460       2.426       2.396       2.369       2.344       43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       44.       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       45.       2.670       2.608       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47.       2.651       2.588       2.534       2.487       2.445         2.417       2.384       2.344       2.316       2.91       2.445         2.417       2.343       2.344       2.316       2.91         48.       2.622       2.579       2.525       2.478       2.436         2.399       2.365       2.335		2.451 2.421 2.394 2.369	2.322
2.472       2.438       2.408       2.381       2.566       2.539       2.497         2.460       2.396       2.369       2.344       2.426       2.396       2.369       2.575       2.527       2.485         2.448       2.415       2.385       2.577       2.332       2.475       2.437       2.404       2.374       2.346       2.321       45       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       2.492       2.633       2.571       2.517       2.469       2.427         2.390       2.356       2.352       2.502       2.517       2.469       2.427         2.382       2.348       2.318       2.290       2.655       2.51       2.461       2.419 </td <td></td> <td></td> <td>2.509</td>			2.509
42.       2.703       2.640       2.586       2.539       2.344         43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.44       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       2.506       2.464         2.427       2.393       2.363       2.336       2.311       2.66       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       2.45       2.447       2.485       2.447       2.445         2.408       2.374       2.344       2.316       2.291       48       2.625       2.335       2.307       2.427         2.399       2.365       2.335       2.307       2.282       2.478       2.436         2.399       2.365       2.332       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.74       2.50       2.450       2.451       2.419         2.382       2.348       2.310       2.282       2.57		2.438 2.408 2.381 2.356	_,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
2.460       2.426       2.396       2.369       2.344       43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.46       2.564       2.516       2.475         2.437       2.404       2.374       2.368       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       2.454       2.445       2.445       2.445         2.408       2.374       2.344       2.316       2.291       2.445       2.446       2.247       2.426       2.329       2.547       2.282       2.327       2.517       2.517			2.497
43.       2.691       2.629       2.575       2.527       2.485         2.448       2.415       2.385       2.357       2.332       2.475         2.437       2.404       2.374       2.346       2.321       45.       2.670       2.608       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47.       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.625       2.579       2.525       2.478       2.436         2.399       2.365       2.326       2.299       2.274       2.02       2.577       2.469       2.427         2.390       2.356       2.326       2.299       2.274       2.02       2.562       2.502       2.461       2.419         2.382       2.348       2.318       2.290       2.257       2.50       2.253 <td></td> <td></td> <td></td>			
44.       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       45.       2.670       2.608       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       2.445       2.445         2.408       2.374       2.344       2.316       2.291       2.427         2.399       2.365       2.335       2.307       2.282       2.436         2.399       2.356       2.326       2.299       2.274       2.50       2.427         2.390       2.356       2.326       2.299       2.274       2.50       2.451       2.419         2.382       2.348       2.318       2.290       2.265       2.51       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.250       2.424       2.438       2.366       2.333       2.302       2.275       2.250       2.442       2.384       2.389       2.341       2.389		2.691 2.629 2.575 2.527	2.485
44.       2.680       2.618       2.564       2.516       2.475         2.437       2.404       2.374       2.346       2.321       45.       2.670       2.608       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       2.445       2.445         2.408       2.374       2.344       2.316       2.291       2.427         2.399       2.365       2.335       2.307       2.282       2.436         2.399       2.356       2.326       2.299       2.274       2.50       2.427         2.390       2.356       2.326       2.299       2.274       2.50       2.451       2.419         2.382       2.348       2.318       2.290       2.265       2.51       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.250       2.424       2.438       2.366       2.333       2.302       2.275       2.250       2.442       2.384       2.389       2.341       2.389		2.415 2.385 2.357 2.332	
2.437       2.404       2.374       2.346       2.321       45.       2.570       2.608       2.553       2.506       2.464         2.427       2.393       2.363       2.336       2.311       46.       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47.       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       49.       2.633       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274       2.427         2.390       2.362       2.299       2.274       2.551       2.461       2.419         2.382       2.348       2.318       2.290       2.265       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.50       2.443       2.396         2.359       2.325       2.295       2.267       2.242       2.389       2.342       2.353       2.345 </td <td></td> <td>2.680 2.618 2.564 2.516</td> <td>2.475</td>		2.680 2.618 2.564 2.516	2.475
45.       2.670       2.608       2.553       2.506       2.464         2.427       2.383       2.363       2.336       2.311       2.660       2.598       2.544       2.496       2.454         2.417       2.384       2.353       2.326       2.301       47.       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       49.       2.633       2.571       2.469       2.427         2.390       2.356       2.326       2.299       2.274       2.0       2.561       2.419         2.382       2.348       2.318       2.290       2.265       2.461       2.419         2.374       2.340       2.310       2.282       2.257       2.50       2.445       2.403         2.374       2.340       2.310       2.282       2.257       2.50       2.445       2.403         2.356       2.325       2.295       2.267       2.242       2.42       2.32       2.35       2.32       2.295	2.437	2.404 2.374 2.346 2.321	
46.       2.660       2.598       2.544       2.496       2.454         2.417       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       49.       2.633       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274       50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265       2.11       2.517       2.461       2.419         2.374       2.340       2.310       2.282       2.257       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.50       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.445       2.403       2.389         2.352       2.352       2.293       2.247       2.424       2.389       2.352       2.589       2.247       2.424       2.389<	45.	2.670 2.608 2.553 2.506	2.464
46.       2.660       2.598       2.544       2.496       2.454         2.417       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291       48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       49.       2.633       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274       50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265       2.11       2.517       2.461       2.419         2.374       2.340       2.310       2.282       2.257       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.50       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.445       2.403       2.389         2.352       2.352       2.293       2.247       2.424       2.389       2.352       2.589       2.247       2.424       2.389<	2.427	2.393 2.363 2.336 2.311	
47.       2.651       2.588       2.534       2.487       2.445         2.408       2.374       2.344       2.316       2.291         48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.307       2.282       49.       2.427         2.390       2.356       2.326       2.299       2.274       2.619       2.419         2.382       2.348       2.318       2.290       2.265       2.419         2.374       2.340       2.310       2.282       2.257         2.374       2.340       2.310       2.282       2.257         2.366       2.333       2.302       2.275       2.250         2.366       2.333       2.302       2.275       2.250         53.       2.602       2.540       2.486       2.438       2.396         2.359       2.325       2.295       2.267       2.422         54.       2.595       2.533       2.479       2.431       2.389         2.352       2.318       2.288       2.260       2.235       2.55       2.559       2.424       2.382         2.345		2.660 2.598 2.544 2.496	2.454
48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274         50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265         51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.500       2.453       2.411         2.366       2.333       2.302       2.275       2.250       2.500       2.453       2.411         2.366       2.333       2.302       2.275       2.250       2.50       2.32       2.453       2.396         2.359       2.295       2.267       2.242       2.382       2.396       2.325       2.50       2.341       2.389         2.352       2.318       2.288       2.260       2.235       2.55       2.242       2.382         2.345       2.311       2.281       2.253       2.228       2.418       2.376         2.332		2.384 2.353 2.326 2.301	
48.       2.642       2.579       2.525       2.478       2.436         2.399       2.365       2.335       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274         50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265         51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.500       2.453       2.411         2.366       2.333       2.302       2.275       2.250       2.500       2.453       2.411         2.366       2.333       2.302       2.275       2.250       2.50       2.32       2.453       2.396         2.359       2.295       2.267       2.242       2.382       2.396       2.325       2.50       2.341       2.389         2.352       2.318       2.288       2.260       2.235       2.55       2.242       2.382         2.345       2.311       2.281       2.253       2.228       2.418       2.376         2.332		2.651 2.588 2.534 2.487	2.445
2.399       2.365       2.335       2.307       2.282       49.       2.633       2.571       2.177       2.469       2.427         2.390       2.356       2.326       2.299       2.274       2.419         2.382       2.348       2.318       2.290       2.265       51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.455       2.403         2.366       2.333       2.302       2.275       2.250       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.486       2.438       2.396         2.359       2.325       2.295       2.267       2.242       2.42       2.382         2.359       2.325       2.295       2.267       2.242       2.382         2.351       2.288       2.260       2.235       2.582       2.382       2.382         2.345       2.311       2.281       2.253       2.228       2.424       2.382         2.379       2.2576       2.247       2.222       2.775       2.247       2.2424       2.370         2.332       2.2		2.374 2.344 2.316 2.291	
49.       2.633       2.571       2.517       2.469       2.427         2.390       2.356       2.326       2.299       2.274       2.419         50.       2.625       2.522       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265         51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.403         2.366       2.333       2.302       2.275       2.250       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.396       2.359       2.250       2.486       2.438       2.396         2.359       2.325       2.295       2.267       2.242       2.382       2.352       2.318       2.288       2.260       2.235       2.389       2.382       2.352       2.589       2.526       2.472       2.424       2.382       2.362       2.382       2.362       2.418       2.376       2.335       2.281       2.282       2.576       2.247       2.222       2.77       2.222       2.77       2.247       2.242       2.370       2.		2.642 2.579 2.525 2.478	2.436
2.390       2.356       2.326       2.299       2.274         50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265         51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257       2.403         2.366       2.333       2.302       2.275       2.250       2.366       2.438       2.396         2.359       2.540       2.486       2.438       2.396         2.359       2.295       2.267       2.42       2.389         2.359       2.5295       2.267       2.242       2.389         2.352       2.318       2.288       2.260       2.235       2.389         2.355       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.288       2.288       2.288       2.288       2.288       2.288       2.312       2.376         2.339       2.305       2.275       2.247       2.22       2.77       2.22       2.77       2.228       2.412       2.370			
50.       2.625       2.562       2.508       2.461       2.419         2.382       2.348       2.318       2.290       2.265       2.411         2.374       2.340       2.310       2.282       2.257         52.       2.610       2.547       2.493       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.35       2.352       2.295       2.267       2.242       2.382       2.396         2.359       2.325       2.295       2.267       2.242       2.382       2.396       2.352       2.318       2.288       2.260       2.235       2.352       2.318       2.288       2.260       2.235       2.382       2.382       2.342       2.382       2.382       2.342       2.382       2.382       2.382       2.382       2.283       2.288       2.247       2.244       2.382       2.382       2.382       2.364       2.382       2.376       2.382       2.376       2.382       2.376       2.382       2.376       2.382       2.376       2.382       2.370       2.372       2.452       2.412       2.370       2.364       2.372       2.266       2.241       2.215       2.266		2.633 2.571 2.517 2.469	2.427
2.382       2.348       2.318       2.290       2.453       2.411         2.374       2.340       2.310       2.282       2.257         52.       2.610       2.547       2.493       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.35       2.325       2.295       2.267       2.242       2.382       2.352       2.295       2.267       2.242       2.431       2.389         2.352       2.318       2.288       2.260       2.235       2.352       2.382         2.352       2.318       2.288       2.260       2.235       2.424       2.382         2.345       2.311       2.281       2.253       2.242       2.382         2.345       2.311       2.281       2.253       2.228       2.376       2.376       2.376         2.339       2.305       2.275       2.247       2.222       2.77       2.247       2.222       2.77       2.453       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.429       2.364       2.364       2.364         2.332       2.299       2.262       2.235       2.2			
51.       2.617       2.555       2.500       2.453       2.411         2.374       2.340       2.310       2.282       2.257         52.       2.610       2.547       2.493       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.386       2.396         2.359       2.2602       2.540       2.422       2.422       2.422       2.421       2.389         2.359       2.295       2.267       2.242       2.431       2.389         2.352       2.318       2.288       2.260       2.235       2.55       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228       2.56       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228       2.412       2.376         2.339       2.305       2.275       2.247       2.222       2.77       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.364         2.326       2.293       2.262       2.235       2.209       2.358       2.364<		2.625 2.562 2.508 2.461	2.419
52.       2.610       2.547       2.493       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.396         53.       2.602       2.540       2.486       2.438       2.396         2.359       2.225       2.242       2.424       2.389         2.352       2.318       2.288       2.260       2.235       2.556       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228       2.376         2.339       2.305       2.275       2.247       2.222       2.376         2.339       2.305       2.275       2.247       2.222       2.370         2.332       2.299       2.268       2.241       2.215       2.370       2.364         2.326       2.293       2.262       2.235       2.209       2.364       2.364         2.320       2.264       2.507       2.453       2.406       2.358         2.315       2.281       2.552       2.247       2.209       2.358         2.315       2.281       2.256       2.229       2.203       2.329       2.352 <t< td=""><td></td><td>2.348 2.318 2.290 2.265</td><td>0 411</td></t<>		2.348 2.318 2.290 2.265	0 411
52.       2.610       2.547       2.493       2.445       2.403         2.366       2.333       2.302       2.275       2.250       2.396         53.       2.602       2.540       2.486       2.438       2.396         2.359       2.225       2.242       2.424       2.389         2.352       2.318       2.288       2.260       2.235       2.556       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228       2.376         2.339       2.305       2.275       2.247       2.222       2.376         2.339       2.305       2.275       2.247       2.222       2.370         2.332       2.299       2.268       2.241       2.215       2.370       2.364         2.326       2.293       2.262       2.235       2.209       2.364       2.364         2.320       2.264       2.507       2.453       2.406       2.358         2.315       2.281       2.552       2.247       2.209       2.358         2.315       2.281       2.256       2.229       2.203       2.329       2.352 <t< td=""><td></td><td>2.01/ 2.555 2.500 2.455</td><td>2.411</td></t<>		2.01/ 2.555 2.500 2.455	2.411
2.366       2.333       2.302       2.275       2.250         53.       2.602       2.540       2.486       2.438       2.396         2.359       2.325       2.295       2.267       2.242       2.389         2.352       2.318       2.288       2.260       2.235       2.52       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.28       2.56       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.28       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.288       2.246       2.418       2.376         2.339       2.305       2.275       2.247       2.22       2.70       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.245       2.209       2.364         2.326       2.293       2.262       2.235       2.209       2.364       2.364         2.320       2.287       2.256       2.229       2.203       2.358       2.342         2.315       2.281       2.251       2.223 <td></td> <td>2.340 2.310 2.202 2.237</td> <td>2 402</td>		2.340 2.310 2.202 2.237	2 402
53.       2.602       2.540       2.486       2.438       2.396         2.359       2.325       2.295       2.267       2.242       2.389         2.352       2.318       2.288       2.260       2.235       2.382         55.       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.288         56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.77       2.257       2.245       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.364       2.364         2.326       2.293       2.262       2.235       2.209       2.364       2.364       2.364       2.364       2.358         2.320       2.287       2.256       2.229       2.203       2.352       2.358       2.347       2.352       2.349       2.352       2.349       2.352       2.349       2.352       2.349       2.352       2.347       2.369       2.342       2.341       2.342       2.347       2.349       2.342       2.3	2 366	2.010 2.317 2.113 2.113	2.403
2.359       2.325       2.295       2.267       2.242         54.       2.595       2.533       2.479       2.431       2.389         2.352       2.318       2.288       2.260       2.235       2.382         55.       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.28         56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.76       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.358       2.358       2.299       2.203       2.209       2.358       2.358       2.358       2.347       2.352       2.358       2.352       2.299       2.203       2.352       2.358       2.347       2.352       2.354       2.349       2.352       2.347       2.364       2.342       2.342       2.342       2.342	2.300 53	2 602 2 540 2 486 2 438	2 396
54.       2.595       2.533       2.479       2.431       2.389         2.352       2.318       2.288       2.260       2.235       2.382         55.       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.28       2.376         2.339       2.305       2.275       2.247       2.222       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.58.       2.570       2.507       2.453       2.406       2.364         2.326       2.293       2.262       2.235       2.209       2.358         2.320       2.564       2.502       2.447       2.400       2.358         2.315       2.287       2.256       2.229       2.203         61.       2.553       2.496       2.442       2.394       2.352         2.309       2.246       2.243       2.389       2.347         2.309       2.248       2.218       2.192       2.347         2.309       2.246       2.243       2.384       2.342         2.304       2.270		2.325 2.295 2.267 2.242	2.330
2.352       2.318       2.288       2.260       2.235         55.       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228         56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.70       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.364       2.358       2.358       2.358       2.209       2.358       2.358       2.358       2.358       2.358       2.352       2.394       2.352       2.358       2.347       2.364       2.352       2.352       2.394       2.352       2.352       2.394       2.352       2.347       2.362       2.347       2.362       2.347       2.362       2.347       2.362       2.347       2.362       2.347       2.362       2.347       2.362       2.347       2.362       2.362			2.389
55.       2.589       2.526       2.472       2.424       2.382         2.345       2.311       2.281       2.253       2.228         56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.70       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.358       2.358       2.209       2.358       2.358       2.358       2.358       2.358       2.347       2.352       2.352       2.394       2.352       2.352       2.394       2.352       2.347       2.352       2.347       2.346       2.342       2.347       2.348       2.347       2.347       2.347       2.347       2.347       2.347       2.347       2.347       2.342       2.347       2.348       2.347       2.342       2.342       2.342       2.342		2.318 2.288 2.260 2.235	2.303
56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.70       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.358       2.209       2.203       2.203       2.203       2.358       2.358       2.358       2.352       2.352       2.352       2.352       2.352       2.347       2.352       2.347       2.352       2.347       2.352       2.347       2.369       2.347       2.352       2.347       2.342       2.347       2.349       2.347       2.349       2.347       2.342<			2.382
56.       2.582       2.520       2.465       2.418       2.376         2.339       2.305       2.275       2.247       2.222       2.70       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364       2.358       2.209       2.203       2.203       2.203       2.358       2.358       2.358       2.352       2.352       2.352       2.352       2.352       2.347       2.352       2.347       2.352       2.347       2.352       2.347       2.369       2.347       2.352       2.347       2.342       2.347       2.349       2.347       2.349       2.347       2.342<	2.345	2.311 2.281 2.253 2.228	
2.339       2.305       2.275       2.247       2.222         57.       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215         58.       2.570       2.507       2.453       2.406       2.364         2.326       2.293       2.262       2.235       2.209       2.358         2.320       2.564       2.502       2.447       2.400       2.358         2.320       2.287       2.256       2.229       2.203       2.352         2.315       2.281       2.251       2.223       2.198       2.352         2.315       2.281       2.251       2.223       2.198       2.347         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182         64.       2.538       2.476       2.421	56.	2.582 2.520 2.465 2.418	2.376
57.       2.576       2.513       2.459       2.412       2.370         2.332       2.299       2.268       2.241       2.215       2.364         58.       2.570       2.507       2.453       2.406       2.364         2.326       2.293       2.262       2.235       2.209       2.358         2.320       2.564       2.502       2.447       2.400       2.358         2.315       2.281       2.256       2.229       2.203       2.352         2.315       2.281       2.251       2.23       2.198       2.352         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192       2.342         2.304       2.270       2.240       2.212       2.187       2.342         2.304       2.270       2.240       2.212       2.187       2.337         2.299       2.265       2.235       2.207       2.182       2.374       2.332         2.294       2.260       2.230       2.202       2.177       2.369       2.327         65.       2.534       2.471       2.417       2.369		2.305 2.275 2.247 2.222	
2.332       2.299       2.268       2.241       2.215         58.       2.570       2.507       2.453       2.406       2.364         2.326       2.293       2.262       2.235       2.209       2.358         59.       2.564       2.502       2.447       2.400       2.358         2.320       2.287       2.256       2.229       2.203       2.394       2.352         2.315       2.281       2.251       2.223       2.198       2.347         2.309       2.276       2.245       2.218       2.192       2.347         2.309       2.276       2.245       2.218       2.192       2.342         2.304       2.270       2.240       2.212       2.187       2.342         2.304       2.270       2.240       2.212       2.187       2.337         2.299       2.265       2.235       2.207       2.182       2.374       2.332         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327   <			2.370
2.326       2.293       2.262       2.235       2.209         59.       2.564       2.502       2.447       2.400       2.358         2.320       2.287       2.256       2.229       2.203         60.       2.559       2.496       2.442       2.394       2.352         2.315       2.281       2.251       2.223       2.198         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192       2.342       2.342         2.304       2.270       2.240       2.212       2.187       2.337       2.337         2.299       2.265       2.235       2.207       2.182       2.374       2.332         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327	2.332	2.299 2.268 2.241 2.215	
59.       2.564       2.502       2.447       2.400       2.358         2.320       2.287       2.256       2.229       2.203       2.352         60.       2.559       2.496       2.442       2.394       2.352         2.315       2.281       2.251       2.223       2.198       2.347         2.309       2.276       2.245       2.218       2.192       2.347         62.       2.548       2.486       2.431       2.384       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327		2.570 2.507 2.453 2.406	2.364
2.320       2.287       2.256       2.229       2.203         60.       2.559       2.496       2.442       2.394       2.352         2.315       2.281       2.251       2.223       2.198         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192         62.       2.548       2.486       2.431       2.384       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182       2.332         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327			
60.       2.559       2.496       2.442       2.394       2.352         2.315       2.281       2.251       2.223       2.198         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192       2.342       2.342         2.304       2.270       2.240       2.212       2.187       2.337       2.337         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182       2.332         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327		2.564 2.502 2.447 2.400	2.358
2.315       2.281       2.251       2.223       2.198         61.       2.553       2.491       2.436       2.389       2.347         2.309       2.276       2.245       2.218       2.192         62.       2.548       2.486       2.431       2.384       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327		2.287 2.256 2.229 2.203	
61. 2.553 2.491 2.436 2.389 2.347 2.309 2.276 2.245 2.218 2.192 62. 2.548 2.486 2.431 2.384 2.342 2.304 2.270 2.240 2.212 2.187 63. 2.543 2.481 2.426 2.379 2.337 2.299 2.265 2.235 2.207 2.182 64. 2.538 2.476 2.421 2.374 2.332 2.294 2.260 2.230 2.202 2.177 65. 2.534 2.471 2.417 2.369 2.327			2.352
2.309       2.276       2.245       2.218       2.192         62.       2.548       2.486       2.431       2.384       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327			
62.       2.548       2.486       2.431       2.384       2.342         2.304       2.270       2.240       2.212       2.187         63.       2.543       2.481       2.426       2.379       2.337         2.299       2.265       2.235       2.207       2.182         64.       2.538       2.476       2.421       2.374       2.332         2.294       2.260       2.230       2.202       2.177         65.       2.534       2.471       2.417       2.369       2.327			2.347
2.304     2.270     2.240     2.212     2.187       63.     2.543     2.481     2.426     2.379     2.337       2.299     2.265     2.235     2.207     2.182       64.     2.538     2.476     2.421     2.374     2.332       2.294     2.260     2.230     2.202     2.177       65.     2.534     2.471     2.417     2.369     2.327			0 040
63. 2.543 2.481 2.426 2.379 2.337 2.299 2.265 2.235 2.207 2.182 64. 2.538 2.476 2.421 2.374 2.332 2.294 2.260 2.230 2.202 2.177 65. 2.534 2.471 2.417 2.369 2.327			2.342
64. 2.538 2.476 2.421 2.374 2.332 2.294 2.260 2.230 2.202 2.177 65. 2.534 2.471 2.417 2.369 2.327			2 225
64. 2.538 2.476 2.421 2.374 2.332 2.294 2.260 2.230 2.202 2.177 65. 2.534 2.471 2.417 2.369 2.327	2 200	2.545 2.481 2.426 2.379	4.557
2.294 2.260 2.230 2.202 2.177 65. 2.534 2.471 2.417 2.369 2.327	4.499 61	2.400	2 222
65. 2.534 2.471 2.417 2.369 2.327	04. 2 201	2.530 2.470 2.421 2.374 2.260 2.220 2.202 2.177	4.354
		2.200 2.230 2.202 2.1// 2.534 2.471 2.417 2.360	2 227
2.20, 2.20, 2.22, 2.170 2.172			2.541
	2,207		

66. 2.285	2.529 2.466 2.412 2.365 2.251 2.221 2.193 2.168	2.322
67.	2.525 2.462 2.408 2.360	2.318
2.280	2.247 2.216 2.188 2.163 2.520 2.458 2.403 2.356	2.314
2.276 69.	2.242 2.212 2.184 2.159 2.516 2.454 2.399 2.352	2.310
2.272 70.	2.516 2.454 2.399 2.352 2.238 2.208 2.180 2.155 2.512 2.450 2.395 2.348	2.306
2.268	2.234 2.204 2.176 2.150 2.508 2.446 2.391 2.344	2.302
2.264	2.230 2.200 2.172 2.146	
72. 2.260	2.504 2.442 2.388 2.340 2.226 2.196 2.168 2.143	2.298
73. 2.256	2.501 2.438 2.384 2.336 2.223 2.192 2.164 2.139	2.294
74. 2.253	2.497 2.435 2.380 2.333 2.219 2.188 2.161 2.135	2.290
75. 2.249	2.494 2.431 2.377 2.329 2.215 2.185 2.157 2.132	2.287
76.	2.490 2.428 2.373 2.326	2.284
2.246 77.	2.212 2.181 2.154 2.128 2.487 2.424 2.370 2.322	2.280
2.243 78.	2.209 2.178 2.150 2.125 2.484 2.421 2.367 2.319	2.277
2.239 79.	2.206 2.175 2.147 2.122 2.481 2.418 2.364 2.316	2.274
2.236	2.202 2.172 2.144 2.118	
80. 2.233	2.478 2.415 2.361 2.313 2.199 2.169 2.141 2.115	2.271
81. 2.230	2.475 2.412 2.358 2.310 2.196 2.166 2.138 2.112	2.268
82. 2.227	2.472 2.409 2.355 2.307 2.193 2.163 2.135 2.109	2.265
83. 2.224	2.469 2.406 2.352 2.304 2.191 2.160 2.132 2.106	2.262
84. 2.222	2.466 2.404 2.349 2.302 2.188 2.157 2.129 2.104	2.259
85.	2.464 2.401 2.347 2.299	2.257
2.219 86.	2.185 2.154 2.126 2.101 2.461 2.398 2.344 2.296	2.254
2.216 87.	2.182 2.152 2.124 2.098 2.459 2.396 2.342 2.294	2.252
2.214 88.	2.180 2.149 2.121 2.096 2.456 2.393 2.339 2.291	2.249
2.211 89.	2.177 2.147 2.119 2.093 2.454 2.391 2.337 2.289	
2.209	2.175 2.144 2.116 2.091	
90. 2.206	2.451 2.389 2.334 2.286 2.172 2.142 2.114 2.088	
91. 2.204	2.449 2.386 2.332 2.284 2.170 2.139 2.111 2.086	
92. 2.202	2.447 2.384 2.330 2.282 2.168 2.137 2.109 2.083	2.240
93. 2.200	2.444 2.382 2.327 2.280 2.166 2.135 2.107 2.081	2.237
94. 2.197	2.442 2.380 2.325 2.277 2.163 2.133 2.105 2.079	2.235
95.	2.440 2.378 2.323 2.275	2.233
2.195 96.	2.161 2.130 2.102 2.077 2.438 2.375 2.321 2.273	2.231
97.	2.159 2.128 2.100 2.075 2.436 2.373 2.319 2.271	2.229
2.191	2.157 2.126 2.098 2.073	

98.	2.434	2.371	2.317	2.269	2.227
2.189	2.155 2.	.124 2.	096 2.	071	
99.	2.432	2.369	2.315	2.267	2.225
2.187	2.153 2.	.122 2.	094 2.	069	
100.	2.430	2.368	2.313	2.265	2.223
2.185	2.151 2.	.120 2.	.092 2.	067	

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH




- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions

# 1.3.6.7.4. Critical Values of the Chi-Square Distribution

How to Use This Table This table contains the critical values of the <u>chi-square</u> distribution. Because of the lack of symmetry of the chi-square distribution, separate tables are provided for the upper and lower tails of the distribution.

A test statistic with  $\nu$  degrees of freedom is computed from the data. For upper-tail one-sided tests, the test statistic is compared with a value from the table of upper-tail critical values. For two-sided tests, the test statistic is compared with values from both the table for the upper-tail critical values and the table for the lower-tail critical values.

The significance level,  $\alpha$ , is demonstrated with the graph below which shows a chi-square distribution with 3 degrees of freedom for a two-sided test at significance level  $\alpha = 0.05$ . If the test statistic is greater than the upper-tail critical value or less than the lower-tail critical value, we reject the null hypothesis. Specific instructions are given below.

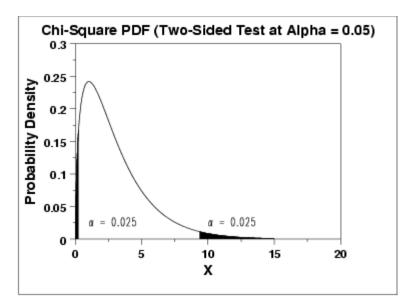

Given a specified value of  $\alpha$ :

1. For a two-sided test, find the column corresponding to  $1-\alpha/2$  in the table for upper-tail critical values and reject

- the null hypothesis if the test statistic is greater than the tabled value. Similarly, find the column corresponding to  $\alpha/2$  in the table for <u>lower-tail critical values</u> and reject the null hypothesis if the test statistic is less than the tabled value.
- 2. For an upper-tail one-sided test, find the column corresponding to  $1-\alpha$  in the table containing upper-tail critical and reject the null hypothesis if the test statistic is greater than the tabled value.
- 3. For a lower-tail one-sided test, find the column corresponding to  $\alpha$  in the <u>lower-tail critical values</u> table and reject the null hypothesis if the computed test statistic is less than the tabled value.

## Upper-tail critical values of chi-square distribution with ${m v}$ degrees of freedom

1	Prob	ability less	than the	critical
value <b>V</b> 0.999	0.90	0.95	0.975	0.99
1 10.828 2 13.816 3 16.266 4 18.467 5 20.515 6 22.458 7 24.322 8 26.125 9 27.877 10 29.588 11	0.90 2.706 4.605 6.251 7.779 9.236 10.645 12.017 13.362 14.684 15.987 17.275	3.841 5.991 7.815 9.488 11.070 12.592 14.067 15.507 16.919 18.307	0.975  5.024  7.378  9.348  11.143  12.833  14.449  16.013  17.535  19.023  20.483  21.920	0.99 6.635 9.210 11.345 13.277 15.086 16.812 18.475 20.090 21.666 23.209 24.725
31.264 12 32.910	18.549		23.337	26.217
13 34.528 14 36.123	19.812 21.064		24.736 26.119	27.688 29.141
15 37.697 16 39.252	22.307		27.488 28.845	30.578

17	24.769	27.587	30.191	33.409
40.790 18	25.989	28.869	31.526	34.805
42.312 19	27.204	30.144	32.852	36.191
43.820 20	28.412	31.410	34.170	37.566
45.315 21	29.615	32.671	35.479	38.932
46.797 22	30.813		36.781	
48.268 23	32.007	35.172		
49.728				
24 51.179	33.196	36.415		
25 52.620	34.382	37.652	40.646	44.314
26 54.052	35.563	38.885	41.923	45.642
27 55.476	36.741	40.113	43.195	46.963
28 56.892	37.916	41.337	44.461	48.278
29 58.301	39.087	42.557	45.722	49.588
30	40.256	43.773	46.979	50.892
59.703 31	41.422	44.985	48.232	52.191
61.098	42.585	46.194	49.480	53.486
62.487	43.745	47.400	50.725	54.776
63.870 34	44.903	48.602	51.966	56.061
65.247 35	46.059	49.802	53.203	57.342
66.619 36	47.212	50.998	54.437	58.619
67.985 37	48.363	52.192	55.668	59.893
69.347 38	49.513	53.384	56.896	61.162
70.703 39	50.660	54.572	58.120	62.428
72.055 40	51.805	55.758	59.342	63.691
73.402 41		56.942	60.561	
74.745	52.949			64.950
42 76.084	54.090	58.124	61.777	66.206
43 77.419	55.230	59.304	62.990	67.459
44 78.750	56.369	60.481	64.201	68.710
45 80.077	57.505	61.656	65.410	69.957
46 81.400	58.641	62.830	66.617	71.201
47 82.720	59.774	64.001	67.821	72.443
48	60.907	65.171	69.023	73.683
84.037				

49	62.038	66.339	70.222	74.919
85.351 50	63.167	67.505	71.420	76.154
86.661 51	64.295	68.669	72.616	77.386
87.968 52	65.422	69.832	73.810	78.616
89.272 53	66.548	70.993	75.002	79.843
90.573 54	67.673	72.153	76.192	81.069
91.872 55	68.796	73.311	77.380	82.292
93.168 56	69.919	74.468	78.567	83.513
94.461 57	71.040	75.624	79.752	84.733
95.751 58	72.160	76.778	80.936	85.950
97.039 59	73.279	77.931	82.117	87.166
98.324 60	74.397	79.082	83.298	88.379
99.607				
61 100.888	75.514	80.232	84.476	89.591
62 102.166	76.630	81.381	85.654	90.802
63 103.442	77.745	82.529	86.830	92.010
64 104.716	78.860	83.675	88.004	93.217
65 105.988	79.973	84.821	89.177	94.422
66 107.258	81.085	85.965	90.349	95.626
67 108.526	82.197	87.108	91.519	96.828
68 109.791	83.308	88.250	92.689	98.028
69 111.055	84.418	89.391	93.856	99.228
70 112.317	85.527	90.531	95.023	100.425
71 113.577	86.635	91.670	96.189	101.621
72	87.743	92.808	97.353	102.816
114.835 73	88.850	93.945	98.516	104.010
116.092 74	89.956	95.081	99.678	105.202
117.346 75	91.061	96.217	100.839	106.393
118.599 76	92.166	97.351	101.999	107.583
119.850 77	93.270	98.484	103.158	108.771
121.100 78	94.374	99.617	104.316	109.958
122.348 79	95.476	100.749	105.473	111.144
123.594 80	96.578	101.879		
124.839				

81 126.083	97.680	103.010	107.783	113.512
82	98.780	104.139	108.937	114.695
127.324 83	99.880	105.267	110.090	115.876
128.565 84	100.980	106.395	111.242	117.057
129.804 85	102.079	107.522	112.393	118.236
131.041 86	103.177	108.648	113.544	119.414
132.277 87	104.275	109.773	114.693	120.591
133.512				
88 134.746	105.372	110.898	115.841	121.767
89	106.469	112.022	116.989	122.942
135.978 90	107.565	113.145	118.136	124.116
137.208 91	108.661	114.268	119.282	125.289
138.438 92	109.756	115.390	120.427	126.462
139.666	100.750	113.370	120.127	120.102
93 140.893	110.850	116.511	121.571	127.633
94	111.944	117.632	122.715	128.803
142.119 95	113.038	118.752	123.858	129.973
143.344 96	114.131	119.871	125.000	131.141
144.567				
97 145.789	115.223	120.990	126.141	132.309
98 147.010	116.315	122.108	127.282	133.476
99	117.407	123.225	128.422	134.642
148.230 100	118.498	124.342	129.561	135.807
149.449 100 149.449	118.498	124.342	129.561	135.807

# Lower-tail critical values of chi-square distribution with $\boldsymbol{\nu}$ degrees of freedom

1	Probak	oility le	ss than the	critical
value ** 0.001	0.10	0.05	0.025	0.01
1	016	0.04	001	000
1.	.016	.004	.001	.000
2. .002	.211	.103	.051	.020

3.	.584	.352	.216	.115
.024	1.064	.711	.484	.297
.091	1.610	1.145	.831	.554
.210 6.	2.204	1.635	1.237	.872
.381	2.833	2.167	1.690	1.239
.598 8.	3.490	2.733	2.180	1.646
.857 9.	4.168	3.325	2.700	2.088
1.152	4.865	3.940	3.247	2.558
1.479	5.578	4.575	3.816	3.053
1.834	6.304	5.226	4.404	3.571
2.214	7.042	5.892	5.009	4.107
2.617	7.790	6.571	5.629	4.660
3.041	8.547	7.261	6.262	5.229
3.483 16.	9.312	7.962	6.908	5.812
3.942 17.	10.085	8.672	7.564	6.408
4.416 18.	10.865	9.390	8.231	7.015
4.905 19.	11.651	10.117	8.907	7.633
5.407 20.	12.443	10.851	9.591	8.260
5.921 21.	13.240	11.591	10.283	8.897
6.447	14.041	12.338	10.982	9.542
6.983 23.	14.848	13.091	11.689	10.196
7.529 24.	15.659	13.848	12.401	10.856
8.085 25.	16.473	14.611	13.120	11.524
8.649 26.	17.292	15.379	13.844	12.198
9.222 27.	18.114	16.151	14.573	12.879
9.803 28.	18.939	16.928	15.308	13.565
10.391 29.	19.768	17.708	16.047	14.256
10.986	20.599	18.493	16.791	14.953
11.588 31.	21.434	19.281	17.539	15.655
12.196 32.	22.271	20.072	18.291	16.362
12.811	23.110	20.867	19.047	17.074
13.431 34.	23.952	21.664	19.806	17.789
14.057				

35.	24.797	22.465	20.569	18.509
14.688 36.	25.643	23.269	21.336	19.233
15.324 37.	26.492	24.075	22.106	19.960
15.965 38.	27.343	24.884	22.878	20.691
16.611 39.	28.196	25.695	23.654	21.426
17.262 40.	29.051	26.509	24.433	22.164
17.916 41.	29.907	27.326	25.215	22.906
18.575 42.	30.765	28.144	25.999	23.650
19.239 43.	31.625	28.965	26.785	24.398
19.906 44.	32.487	29.787	27.575	25.148
20.576 45.	33.350	30.612	28.366	25.901
21.251 46.	34.215	31.439	29.160	26.657
21.929 47.	35.081	32.268	29.956	27.416
22.610 48.	35.949	33.098	30.755	28.177
23.295 49.	36.818	33.930	31.555	28.941
23.983 50.	37.689	34.764	32.357	29.707
24.674 51.	38.560	35.600	33.162	30.475
25.368 52.	39.433	36.437	33.968	31.246
26.065 53.	40.308	37.276	34.776	32.018
26.765 54.	41.183	38.116	35.586	32.793
27.468 55.	42.060	38.958	36.398	33.570
28.173 56.	42.937	39.801	37.212	34.350
28.881 57.	43.816	40.646	38.027	35.131
29.592 58.	44.696	41.492	38.844	35.913
30.305 59.	45.577	42.339	39.662	36.698
31.020 60.	46.459	43.188	40.482	37.485
31.738 61.	47.342	44.038	41.303	38.273
32.459 62.	48.226	44.889	42.126	39.063
33.181 63.	49.111	45.741	42.950	39.855
33.906 64.	49.996	46.595		40.649
34.633 65.	50.883	47.450	44.603	41.444
35.362 66.	51.770	48.305	45.431	
36.093				

67.	52.659	49.162	46.261	43.038
36.826 68.	53.548	50.020	47.092	43.838
37.561 69.	54.438	50.879	47.924	44.639
38.298 70.	55.329	51.739	48.758	45.442
39.036 71.	56.221	52.600	49.592	46.246
39.777 72.	57.113	53.462	50.428	47.051
40.519 73.	58.006	54.325	51.265	47.858
41.264 74.	58.900	55.189	52.103	48.666
42.010 75.	59.795	56.054	52.942	49.475
42.757 76.	60.690	56.920	53.782	50.286
43.507 77.	61.586	57.786	54.623	51.097
44.258 78.	62.483	58.654	55.466	51.910
45.010 79.	63.380	59.522	56.309	52.725
45.764 80.	64.278	60.391	57.153	53.540
46.520 81.	65.176	61.261	57.998	54.357
47.277 82.	66.076	62.132	58.845	55.174
48.036 83.	66.976	63.004	59.692	55.993
48.796 84.	67.876	63.876	60.540	56.813
49.557 85.	68.777	64.749	61.389	57.634
50.320 86.	69.679	65.623	62.239	58.456
51.085 87.	70.581	66.498	63.089	59.279
51.850			63.941	
88. 52.617	71.484	67.373		60.103
89. 53.386	72.387	68.249	64.793	60.928
90. 54.155	73.291	69.126	65.647	61.754
91. 54.926	74.196	70.003	66.501	62.581
92. 55.698	75.100	70.882	67.356	63.409
93. 56.472	76.006	71.760	68.211	64.238
94. 57.246	76.912	72.640	69.068	65.068
95. 58.022	77.818	73.520	69.925	65.898
96. 58.799	78.725	74.401	70.783	66.730
97. 59.577	79.633	75.282	71.642	67.562
98. 60.356	80.541	76.164	72.501	68.396
00.000				

99. 61.137	81.449	77.046	73.361	69.230
100. 61.918	82.358	77.929	74.222	70.065

NIST

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions

### 1.3.6.7.5. Critical Values of the t\* Distribution

How to Use This Table This table contains upper critical values of the  $t^*$  distribution that are appropriate for determining whether or not a calibration line is in a state of statistical control from measurements on a check standard at three points in the calibration interval. A test statistic with  $\nu$  degrees of freedom is compared with the critical value. If the absolute value of the test statistic exceeds the tabled value, the calibration of the instrument is judged to be out of control.

## Upper critical values of t\* distribution at significance level 0.05 for testing the output of a linear calibration line at 3 points

	.* / \		.* / \
$\boldsymbol{v}$	$t_{\infty}^{T}(v)$	$\boldsymbol{v}$	$t_{\infty}^{r}(v)$
1	37.544	61	2.455
2	7.582	62	2.454
3	4.826	63	2.453
4	3.941	64	2.452
5	3.518	65	2.451
6	3.274	66	2.450
7	3.115	67	2.449
8	3.004	68	2.448
9	2.923	69	2.447
10	2.860	70	2.446
11	2.811	71	2.445
12	2.770	72	2.445
13	2.737	73	2.444
14	2.709	<b>74</b>	2.443
15	2.685	75	2.442
16	2.665	76	2.441
17	2.647	77	2.441
18	2.631	78	2.440
19	2.617	79	2.439
20	2.605	80	2.439
21	2.594	81	2.438
22	2.584	82	2.437
23	2.574	83	2.437
24	2.566	84	2.436
25	2.558	85	2.436
26	2.551	86	2.435
27	2.545	87	2.435
28	2.539	88	2.434
29	2.534	89	2.434
30	2.528	90	2.433
31	2.524	91	2.432
32	2.519	92	2.432
33	2.515	93	2.431
34	2.511	94	2.431
35	2.507	95	2.431


36	2.504	96	2.430
37	2.501	97	2.430
38	2.498	98	2.429
39	2.495	99	2.429
40	2.492	100	2.428
41	2.489	101	2.428
42	2.487	102	2.428
43	2.484	103	2.427
44	2.482	104	2.427
45	2.480	105	2.426
46	2.478	106	2.426
47	2.476	107	2.426
48	2.474	108	2.425
49	2.472	109	2.425
50	2.470	110	2.425
51	2.469	111	2.424
52	2.467	112	2.424
53	2.466	113	2.424
54	2.464	114	2.423
55	2.463	115	2.423
56	2.461	116	2.423
57	2.460	117	2.422
58	2.459	118	2.422
59	2.457	119	2.422
60	2.456	120	2.422

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.3. EDA Techniques
- 1.3.6. Probability Distributions
- 1.3.6.7. Tables for Probability Distributions

# 1.3.6.7.6. Critical Values of the Normal PPCC Distribution

How to Use This Table This table contains the critical values of the normal probability plot correlation coefficient (PPCC) distribution that are appropriate for determining whether or not a data set came from a population with approximately a normal distribution. It is used in conjuction with a normal probability plot. The test statistic is the correlation coefficient of the points that make up a normal probability plot. This test statistic is compared with the critical value below. If the test statistic is less than the tabulated value, the null hypothesis that the data came from a population with a normal distribution is rejected.

For example, suppose a set of 50 data points had a correlation coefficient of 0.985 from the normal probability plot. At the 5% significance level, the critical value is 0.9761. Since 0.985 is greater than 0.9761, we cannot reject the null hypothesis that the data came from a population with a normal distribution.

Since perferct normality implies perfect correlation (i.e., a correlation value of 1), we are only interested in rejecting normality for correlation values that are too low. That is, this is a lower one-tailed test.

The values in this table were determined from simulation studies by <u>Filliben</u> and <u>Devaney</u>.

## Critical values of the normal PPCC for testing if data come from a normal distribution

N	0.01	0.05	
,			
3	0.8687	0.8790	
4	0.8234	0.8666	
5	0.8240	0.8786	
6	0.8351	0.8880	
7	0.8474	0.8970	
8	0.8590	0.9043	
9	0.8689	0.9115	
10	0.8765	0.9173	
11	0.8838	0.9223	
12	0.8918	0.9267	
13	0.8974	0.9310	
14	0.9029	0.9343	

390 400 410	0.9948 0.9949 0.9950	0.9962 0.9963 0.9964
420	0.9951	0.9965
430 440	0.9953 0.9954	0.9966 0.9966
450	0.9954	0.9967
460	0.9955	0.9968
470	0.9956	0.9968
480	0.9957	0.9969
490	0.9958	0.9969
500	0.9959	0.9970
525	0.9961	0.9972
550	0.9963	0.9973
575	0.9964	0.9974
600	0.9965	0.9975
625	0.9967	0.9976
650	0.9968	0.9977
675	0.9969	0.9977
700 725	0.9970 0.9971	0.9978 0.9979
725 750	0.9971	0.9980
775	0.9972	0.9980
800	0.9974	0.9981
825	0.9975	0.9981
850	0.9975	0.9982
875	0.9976	0.9982
900	0.9977	0.9983
925	0.9977	0.9983
950	0.9978	0.9984
975	0.9978	0.9984
1000	0.9979	0.9984



HOME

TOOLS & AIDS

SEARCH



1. Exploratory Data Analysis

#### 1.4. EDA Case Studies

Summary

This section presents a series of case studies that demonstrate the application of EDA methods to specific problems. In some cases, we have focused on just one EDA technique that uncovers virtually all there is to know about the data. For other case studies, we need several EDA techniques, the selection of which is dictated by the outcome of the previous step in the analaysis sequence. Note in these case studies how the flow of the analysis is motivated by the focus on underlying assumptions and general EDA principles.

Table of Contents for Section 4

- 1. Introduction
- 2. By Problem Category



HOME

TOOLS & AIDS

SEARCH

#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies

#### 1.4.1. Case Studies Introduction

**Purpose** 

The purpose of the first eight case studies is to show how EDA graphics and quantitative measures and tests are applied to data from scientific processes and to critique those data with regard to the following assumptions that typically underlie a measurement process; namely, that the data behave like:

- random drawings
- from a fixed distribution
- with a fixed location
- with a fixed standard deviation

Case studies 9 and 10 show the use of EDA techniques in distributional modeling and the analysis of a designed experiment, respectively.

 $Y_i = C + E_i$ 

If the above assumptions are satisfied, the process is said to be statistically "in control" with the core characteristic of having "predictability". That is, probability statements can be made about the process, not only in the past, but also in the future.

An appropriate model for an "in control" process is

$$Y_i = C + E_i$$

where C is a constant (the "deterministic" or "structural" component), and where  $E_i$  is the error term (or "random" component).

The constant C is the average value of the process--it is the primary summary number which shows up on any report. Although C is (assumed) fixed, it is unknown, and so a primary analysis objective of the engineer is to arrive at an estimate of C.

This goal partitions into 4 sub-goals:

- 1. Is the most common estimator of C,  $\bar{Y}$ , the best estimator for C? What does "best" mean?
- 2. If  $\bar{Y}$  is best, what is the uncertainty  ${}^{8}\bar{Y}$  for  $\bar{Y}$ . In particular, is the usual formula for the uncertainty of

$$ar{Y}$$
:

$$s_{ar{Y}} = s/\sqrt{N}$$

valid? Here, s is the standard deviation of the data and N is the sample size.

- 3. If  $\overline{Y}$  is **not** the best estimator for C, what is a better estimator for C (for example, median, midrange, midmean)?
- 4. If there is a better estimator,  $\hat{C}$ , what is its uncertainty? That is, what is  $s_{\hat{C}}$ ?

EDA and the routine checking of underlying assumptions provides insight into all of the above.

- 1. <u>Location</u> and <u>variation</u> checks provide information as to whether *C* is really constant.
- 2. Distributional checks indicate whether  $\bar{Y}$  is the best estimator. Techniques for distributional checking include <u>histograms</u>, <u>normal probability plots</u>, and <u>probability plot correlation coefficient plots</u>.
- 3. Randomness checks ascertain whether the usual

$$s_{ar{Y}} = s/\sqrt{N}$$

is valid.

- 4. Distributional tests assist in determining a better estimator, if needed.
- 5. Simulator tools (namely <u>bootstrapping</u>) provide values for the uncertainty of alternative estimators.

## Assumptions not satisfied

If one or more of the above assumptions is not satisfied, then we use EDA techniques, or some mix of EDA and classical techniques, to find a more appropriate model for the data. That is,

$$Y_i = D + E_i$$

where D is the deterministic part and E is an error component.

If the data are not random, then we may investigate fitting some simple time series models to the data. If the constant location and scale assumptions are violated, we may need to investigate the measurement process to see if there is an explanation.

The assumptions on the error term are still quite relevant in the sense that for an appropriate model the error component should follow the assumptions. The criterion for validating the model, or comparing competing models, is framed in terms of these assumptions.

Multivariable data

Although the case studies in this chapter utilize univariate data, the assumptions above are relevant for multivariable data as well.

If the data are not univariate, then we are trying to find a model

$$Y_i = F(X_1, ..., X_k) + E_i$$

where *F* is some function based on one or more variables. The error component, which is a univariate data set, of a good model should satisfy the assumptions given above. The criterion for validating and comparing models is based on how well the error component follows these assumptions.

The <u>load cell calibration</u> case study in the process modeling chapter shows an example of this in the regression context.

First three case studies utilize data with known characteristics

The first three case studies utilize data that are randomly generated from the following distributions:

- normal distribution with mean 0 and standard deviation 1
- uniform distribution with mean 0 and standard deviation  $\sqrt{1/12}$  (uniform over the interval (0,1))
- · random walk

The other univariate case studies utilize data from scientific processes. The goal is to determine if

$$Y_i = C + E_i$$

is a reasonable model. This is done by testing the underlying assumptions. If the assumptions are satisfied, then an estimate of  $\boldsymbol{C}$  and an estimate of the uncertainty of  $\boldsymbol{C}$  are computed. If the assumptions are not satisfied, we attempt to find a model where the error component does satisfy the underlying assumptions.

Graphical methods that are applied to the data

To test the underlying assumptions, each data set is analyzed using four graphical methods that are particularly suited for this purpose:

1. <u>run sequence plot</u> which is useful for detecting shifts of location or scale

- 2. <u>lag plot</u> which is useful for detecting nonrandomness in the data
- 3. <u>histogram</u> which is useful for trying to determine the underlying distribution
- 4. <u>normal probability plot</u> for deciding whether the data follow the normal distribution

There are a number of other techniques for addressing the underlying assumptions. However, the four plots listed above provide an excellent opportunity for addressing all of the assumptions on a single page of graphics.

Additional graphical techniques are used in certain case studies to develop models that do have error components that satisfy the underlying assumptions.

Quantitative methods that are applied to the data

The normal and uniform random number data sets are also analyzed with the following quantitative techniques, which are explained in more detail in an earlier section:

- 1. Summary statistics which include:
  - mean
  - standard deviation
  - <u>autocorrelation coefficient</u> to test for randomness
  - normal and uniform probability plot correlation coefficients (ppcc) to test for a normal or uniform distribution, respectively
  - Wilk-Shapiro test for a normal distribution
- 2. Linear fit of the data as a function of time to assess drift (test for fixed location)
- 3. Bartlett test for fixed variance
- 4. <u>Autocorrelation plot</u> and coefficient to test for randomness
- 5. Runs test to test for lack of randomness
- 6. Anderson-Darling test for a normal distribution
- 7. Grubbs test for outliers
- 8. Summary report

Although the graphical methods applied to the normal and uniform random numbers are sufficient to assess the validity of the underlying assumptions, the quantitative techniques are used to show the different flavor of the graphical and quantitative approaches.

The remaining case studies intermix one or more of these

quantitative techniques into the analysis where appropriate.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS


SEARCH

BACK NEXT


- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies

### 1.4.2. Case Studies










**Numbers** 




**Beam Deflections** 



Josephson Junction Cryothermometry

**Transmittance** 









**Heat Flow Meter** 1

Reliability



Fatigue Life of **Aluminum Alloy Specimens** 

Multi-**Factor** 



Ceramic Strength



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

#### 1.4.2.1. Normal Random Numbers

Normal Random Numbers This example illustrates the univariate analysis of a set of normal random numbers.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.1. Normal Random Numbers

#### 1.4.2.1.1. Background and Data

Generation The normal random numbers used in this case study are from

a Rand Corporation publication.

The motivation for studying a set of normal random numbers is to illustrate the ideal case where all four <u>underlying assumptions</u> hold.

Software The analyses used in this case study can be generated using

both <u>Dataplot code</u> and <u>R code</u>.

Data The following is the set of normal random numbers used for this case study.

-1.2760 -1.2180 -0.4530 -0.3500 0.6760 -1.0990 -0.3140 -0.3940 -0.6330 -0.3180 -0.7990 -1.6640 1.3910 0.3820 0.7330 0.6530 0.2190 -0.6810 1.1290 -1.3770 -1.2570 0.4950 -0.1390 -0.8540 0.4280 - 1.3220 - 0.3150 - 0.7320 - 1.3480-0.4330 0.5450 -1.1360 0.6420 3.4360 -1.6670 0.8470 -1.1730 -0.3550 0.0350 0.3590 0.9300 0.4140 - 0.01100.6660 -1.1320 -0.4100 -1.0770 0.7340 1.4840 -0.34000.7890 -0.4940 0.3640 -1.2370 -0.0440 -0.1110-0.21000.9310 0.6160 -0.3770 -0.4330 1.0480 0.0370 0.7590 0.6090 -2.0430 0.8690 -0.2900 0.4040 -0.54300.4860 2.8160 -0.4640 -0.6320 -1.6140 0.3470 0.3720 -0.0740 -0.9160 1.3140 -0.0380 0.6370 0.5630 -0.1070 0.1310 -1.8080 -1.1260 0.3790 0.6100 -0.3640 -2.6260 2.1760 0.3930 -0.9240 1.9110 -1.0400 0.4850 0.0760 -0.7690 -1.16801.6070 -1.1850 -0.9440 -1.6040 0.1850 -0.2580 0.0180 - 0.48500.9720 2.6820 2.8130 -1.5310 -0.4900 2.0710 1.4440 -1.0920 0.4780 1.2100 1.1030 0.2940 - 0.24800.7190 1.0900 0.2120 -1.1850 -0.3380 -1.1340 1.1510 2.6470 0.7770 0.4500 2.2470 -1.67600.3840 1.1330 1.3930 0.8140 0.3180 -0.9280 0.3980 2.4160 -0.9360 0.0240 -0.5600 1.0360 0.2030 -0.8710 0.8460 -0.6990 -0.3680 0.3440 -0.9260 1.4560 0.7520 -0.4340 0.7460 0.1490 -0.1700 -0.4790 0.4190 0.5220 0.2310 -0.6190 -0.2650 0.5580 - 0.54900.1920 - 0.33401.3730 -1.2880 -0.5390 -0.8240 0.2440 -1.0700 $0.0100 \quad 0.4820 \quad -0.4690 \quad -0.0900$ 1.1710 

```
0.8540 -0.5350
                 1.6070
                          0.4280 - 0.6150
0.3310 -0.3360 -1.1520
                         0.5330 - 0.8330
-0.1480
       -1.1440
                0.9130
                         0.6840
                                  1.0430
0.5540
       -0.0510 -0.9440 -0.4400 -0.2120
                 0.6350 -0.3280 -1.2210
-1.1480
       -1.0560
0.1180
       -2.0450 -1.9770 -1.1330
                                 0.3380
0.3480
        0.9700 -0.0170
                         1.2170
                                -0.9740
-1.2910
        -0.3990
                -1.2090
                        -0.2480
                                  0.4800
                                -0.6290
0.2840
         0.4580
                1.3070
                        -1.6250
-0.5040
        -0.0560 -0.1310
                         0.0480
                                  1.8790
         0.3600 -0.1190
-1.0160
                          2.3310
                                  1.6720
                                -1.3120
-1.0530
         0.8400 -0.2460
                          0.2370
                                 0.4650
1.6030
       -0.9520 -0.5660
                          1.6000
1.9510
         0.1100
                0.2510
                         0.1160 -0.9570
-0.1900
         1.4790
                -0.9860
                         1.2490
                                  1.9340
0.0700
        -1.3580 -1.2460 -0.9590
                                -1.2970
-0.7220
         0.9250
                 0.7830 -0.4020
                                  0.6190
1.8260
         1.2720
                -0.9450
                         0.4940
                                  0.0500
         1.8790
                 0.0630
-1.6960
                         0.1320
                                  0.6820
       -0.4170 -0.6660 -0.1040 -0.2530
0.5440
-2.5430
       -1.3330
                 1.9870
                         0.6680
                                  0.3600
1.9270
                         1.7650
         1.1830
                 1.2110
                                  0.3500
-0.3590
         0.1930
                -1.0230 -0.2220 -0.6160
-0.0600
       -1.3190
                 0.7850 -0.4300 -0.2980
0.2480
       -0.0880
                -1.3790
                         0.2950
                                -0.1150
                         0.9790
-0.6210 -0.6180
                 0.2090
                                 0.9060
-0.0990 -1.3760
                 1.0470 -0.8720 -2.2000
-1.3840
         1.4250 -0.8120
                         0.7480 - 1.0930
-0.4630
       -1.2810 -2.5140
                         0.6750
                                  1.1450
1.0830
        -0.6670 -0.2230 -1.5920 -1.2780
        1.4340
0.5030
                0.2900
                         0.3970 -0.8370
       -0.1200 -1.5940 -0.9960 -1.2440
-0.9730
-0.8570
       -0.3710 -0.2160
                         0.1480 -2.1060
         0.6860 -0.0750 -0.2430 -0.1700
-1.4530
-0.1220
         1.1070 -1.0390 -0.6360 -0.8600
        -1.4580 -0.5390 -0.1590 -0.4200
-0.8950
1.6320
        0.5860 -0.4680 -0.3860 -0.3540
        -1.2340
0.2030
                 2.3810 -0.3880 -0.0630
                         0.2240 -0.1200
       -1.4450 -0.6800
2.0720
1.7530
       -0.5710
                1.2230 -0.1260
                                 0.0340
       -0.3750 -0.9850 -0.5850 -0.2030
-0.4350
-0.5560
         0.0240
                 0.1260
                         1.2500 -0.6150
0.8760
        -1.2270 -2.6470 -0.7450
                                 1.7970
-1.2310
         0.5470 -0.6340 -0.8360 -0.7190
0.8330
         1.2890
                -0.0220 -0.4310
                                  0.5820
0.7660
       -0.5740 -1.1530
                         0.5200
                                -1.0180
-0.8910
        0.3320 -0.4530 -1.1270
                                 2.0850
-0.7220
       -1.5080
                 0.4890 - 0.4960
                                -0.0250
0.6440
       -0.2330
                -0.1530
                         1.0980
                                  0.7570
-0.0390
       -0.4600
                 0.3930
                         2.0120
                                  1.3560
0.1050
       -0.1710 -0.1100 -1.1450
                                  0.8780
-0.9090
        -0.3280
                 1.0210
                        -1.6130
                                  1.5600
         1.7700
-1.1920
                -0.0030
                         0.3690
                                  0.0520
0.6470
         1.0290
                 1.5260
                         0.2370 - 1.3280
-0.0420
         0.5530
                 0.7700
                         0.3240 -0.4890
                        -1.9960 -0.7380
-0.3670
         0.3780
                 0.6010
0.4980
         1.0720
                 1.5670
                         0.3020
                                 1.1570
-0.7200
         1.4030
                 0.6980 -0.3700 -0.5510
```



HOME

TOOLS & AIDS

SEARCH



### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.1. Normal Random Numbers

### 1.4.2.1.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location; and
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

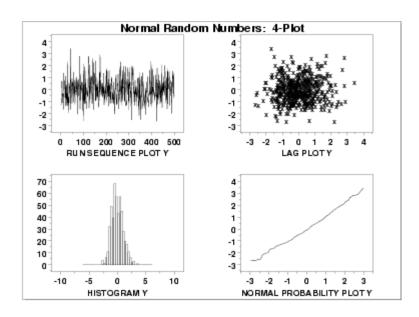

*Interpretation* 


The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location or scale over time. The run sequence plot does not show any obvious outliers.
- 2. The <u>lag plot</u> (upper right) does not indicate any non-random pattern in the data.
- 3. The <u>histogram</u> (lower left) shows that the data are reasonably symmetric, there do not appear to be significant outliers in the tails, and that it is reasonable to assume that the data are from approximately a normal distribution.
- 4. The <u>normal probability plot</u> (lower right) verifies that an assumption of normality is in fact reasonable.


From the above plots, we conclude that the underlying assumptions are valid and the data follow approximately a normal distribution. Therefore, the confidence interval form given previously is appropriate for quantifying the uncertainty of the population mean. The numerical values for this model are given in the Quantitative Output and Interpretation section.

Individual Plots Although it is usually not necessary, the plots can be generated individually to give more detail.


Run Sequence Plot

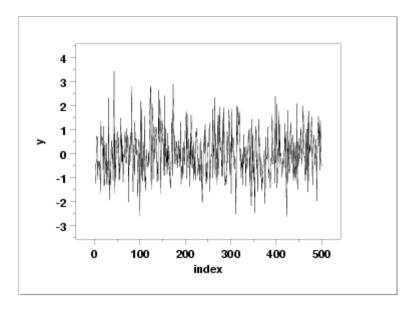


Lag Plot

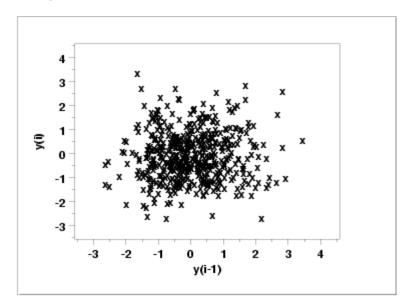

Histogram (with overlaid Normal PDF)

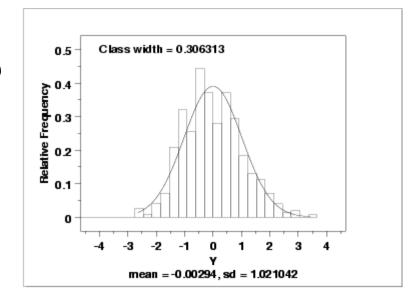

Normal Probability Plot

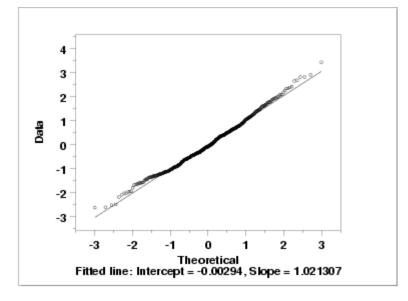

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.1. Normal Random Numbers

# **1.4.2.1.3.** Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics are computed from the data.

Sample size = 500
Mean = -0.2935997E-02
Median = -0.9300000E-01
Minimum = -0.2647000E+01
Maximum = 0.3436000E+01
Range = 0.6083000E+01
Stan. Dev. = 0.1021041E+01

Location

One way to quantify a change in location over time is to <u>fit</u> a <u>straight line</u> to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

t-Valu	Coefficient	Estimate	Stan. Error
	B <sub>0</sub>	0.699127E-02	0.9155E-01
0.0764	В <sub>1</sub>	-0.396298E-04	0.3167E-03
-0.125	1		

Residual Standard Deviation = 1.02205 Residual Degrees of Freedom = 498

The absolute value of the <u>t-value</u> for the slope parameter is smaller than the critical value of  $t_{0.975,498} = 1.96$ . Thus, we conclude that the slope is not different from zero at the 0.05 significance level.

Variation

One simple way to detect a change in variation is with <u>Bartlett's test</u>, after dividing the data set into several equal-sized intervals. The choice of the number of intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.

$$\begin{array}{ll} \text{H}_0\colon & {\sigma_1}^2 = {\sigma_2}^2 = {\sigma_3}^2 = {\sigma_4}^2 \\ & \text{H}_a\colon & \text{At least one } {\sigma_i}^2 \text{ is not equal to the others.} \end{array}$$

```
Test statistic: T = 2.373660

Degrees of freedom: k - 1 = 3

Significance level: \alpha = 0.05

Critical value: X^2_{1-\alpha,k-1} = 7.814728


Critical region: Reject H<sub>0</sub> if T > 7.814728
```

In this case, Bartlett's test indicates that the variances are not significantly different in the four intervals.

Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests including the <u>lag plot</u> shown on the previous page.

Another check is an <u>autocorrelation plot</u> that shows the autocorrelations for various lags. Confidence bands can be plotted at the 95 % and 99 % confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

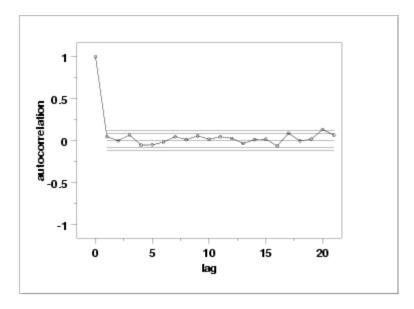

The lag 1 <u>autocorrelation</u>, which is generally the one of most interest, is 0.045. The critical values at the 5% significance level are -0.087 and 0.087. Since 0.045 is within the critical region, the lag 1 autocorrelation is not statistically significant, so there is no evidence of non-randomness.

A common test for randomness is the runs test.

```
H<sub>0</sub>: the sequence was produced in a random manner  \text{H}_a \text{: the sequence was not produced in a random manner}  Test statistic: Z = -1.0744 Significance level: \alpha = 0.05 Critical value: Z_{1-\alpha/2} = 1.96 Critical region: Reject H<sub>0</sub> if |Z| > 1.96
```

The runs test fails to reject the null hypothesis that the data were produced in a random manner.

#### Distributional Analysis

<u>Probability plots</u> are a graphical test for assessing if a particular distribution provides an adequate fit to a data set.

A quantitative enhancement to the probability plot is the correlation coefficient of the points on the probability plot, or PPCC. For this data set the PPCC based on a normal distribution is 0.996. Since the PPCC is greater than the critical value of 0.987 (this is a <u>tabulated value</u>), the normality assumption is not rejected.

<u>Chi-square</u> and <u>Kolmogorov-Smirnov</u> goodness-of-fit tests are alternative methods for assessing distributional adequacy. The <u>Wilk-Shapiro</u> and <u>Anderson-Darling</u> tests can be used to test for normality. The results of the Anderson-Darling test follow.

```
\rm H_0\colon the data are normally distributed \rm H_a\colon the data are not normally distributed Adjusted test statistic: \rm A^2=1.0612 Significance level: \alpha=0.05 Critical value: 0.787 Critical region: Reject \rm H_0 if \rm A^2>0.787
```

The Anderson-Darling test rejects the normality assumption at the 0.05 significance level.

#### Outlier Analysis

A test for outliers is the Grubbs test.

```
H_0: there are no outliers in the data H_a: the maximum value is an outlier

Test statistic: G=3.368068
Significance level: \alpha=0.05
Critical value for an upper one-tailed test: 3.863087
Critical region: Reject H_0 if G>3.863087
```

For this data set, Grubbs' test does not detect any outliers at the 0.05 significance level.

Model

Since the underlying assumptions were validated both graphically and analytically, we conclude that a reasonable model for the data is:

$$Y_i = C + E_i$$

where C is the estimated value of the mean, -0.00294. We can express the uncertainty for C as a 95% confidence interval (-0.09266, 0.08678).

#### Univariate Report

It is sometimes useful and convenient to summarize the above results in a report.

0.00294 Standard Deviation of Mean 0.045663 95% Confidence Interval for Mean 0.09266,0.086779) Drift with respect to location? = NO 3: Variation Standard Deviation 1.021042 95% Confidence Interval for SD (0.961437, 1.088585)Drift with respect to variation? (based on Bartletts test on quarters of the data) = NO 4: Data are Normal? (as tested by Anderson-Darling) = YES 5: Randomness Autocorrelation 0.045059 Data are Random? (as measured by autocorrelation) = YES 6: Statistical Control (i.e., no drift in location or scale, data are random, distribution is fixed, here we are testing only for fixed normal) Data Set is in Statistical Control? 7: Outliers? (as determined by Grubbs' test) = NO



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.1. Normal Random Numbers

# 1.4.2.1.4. Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.
1. Invoke Dataplot and read data.	
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.
2. 4-plot of the data.	
1. 4-plot of Y.	1. Based on the 4- plot, there are no shifts in location or scale, and the data seem to follow a normal distribution.
3. Generate the individual plots.	

Generate a run sequence plot. The run sequence plot indicates that there are no shifts of location or 2. Generate a lag plot. scale. 2. The lag plot does not indicate any significant 3. Generate a histogram with an overlaid normal pdf. patterns (which would show the data were not random). Generate a normal probability 3. The histogram plot. indicates that a normal distribution is a good distribution for these data. 4. The normal probability plot verifies that the normal <u>distribution is a</u> reasonable distribution for these data. 4. Generate summary statistics, quantitative analysis, and print a univariate report. 1. The summary statistics table 1. Generate a table of summary <u>displays</u> statistics. 25+ statistics. Generate the mean, a confidence The mean is interval for the mean, and compute 0.00294 and a 95% a linear fit to detect drift in confidence location. <u>interval is (-</u> 0.093,0.087). The linear fit <u>indicates no drift</u> 3. Generate the standard deviation, a location since confidence interval for the the slope parameter standard <u>is</u> statistically not deviation, and detect drift in significant. variation by dividing the data into quarters <u>and</u> computing Barltett's test for 3. The standard deviation is 1.02 equal standard deviations. <u>with</u> a 95% confidence interval of (0.96,1.09).

Bartlett's test Check for randomness by generating <u>an</u> autocorrelation plot and a runs <u>indicates no</u> significant test. change in variation. 5. Check for normality by computing the 4. The lag 1 normal probability plot correlation <u>autocorrelation is</u> coefficient. 0.04. From the autocorrelation plot, this is 6. Check for outliers using Grubbs' test. within the 95% confidence interval bands.

Print a univariate report (this

assumes
steps 2 thru 6 have already been
run).

5. The normal
probability plot
correlation
coefficient is
0.996. At the 5%
level.
we cannot reject
the normality
assumption.

6. Grubbs' test
detects no outliers
at the
5% level.

7. The results are
summarized in a
convenient
report.

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

### 1.4.2.2. Uniform Random Numbers

Uniform Random Numbers This example illustrates the univariate analysis of a set of uniform random numbers.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.2. <u>Uniform Random Numbers</u>

## 1.4.2.2.1. Background and Data

Generation The uniform random numbers used in this case study are from

a Rand Corporation publication.

The motivation for studying a set of uniform random numbers is to illustrate the effects of a known underlying non-normal distribution.

Software The analyses used in this case study can be generated using

both Dataplot code and R code.

Data The following is the set of uniform random numbers used for this case study.

.100973 .253376 .520135 .863467 .911739 .292749 .375420 .480564 .809590 .894742 .962480 .524037 .206361 .040200 .822916 .895319 .084226 .645093 .032320 .476435 .902560 .159533 .080336 .990190 .153831 .252909 .376707 .131165 .886767 .439704 .128079 .436276 .997080 .157361 .476403 .236653 .989511 .687712 .171768 .072768 .471734 .503669 .660657 .736170 .199291 .658133 .988511 .310601 .080545 .571824 .063530 .342614 .867990 .743923 .926866 .403097 .852697 .760202 .051656 .730538 .574818 .524718 .623885 .635733 .325470 .489055 .213505 .357548 .284682 .870983 .491256 .737964 .575303 .529647 .609352 .273884 .783580 .834282 .034435 .776714 .905686 .072210 .940558 .985201 .609709 .343350 .500739 .118050 .543139 .808277 .325072 .568248 .294052 .420152 .834529 .288980 .775678 .963406 .831374 .670078 .184754 .061068 .711778 .886854 .667951 .507584 .013676 .903647 .020086 .995946 .734887 .649329 .609110 .517649 .608928 .937856 .136823 .699182 .478341 .654811 .767417 .468509 .505804 .776974 .730395 .718640 .218165 .801243 .563517 .154531 .822374 .825314 .727080 .211157 .385537 .743509 .981777 .402772 .144323 .455216 .423796 .286026 .600210 .699162 .680366 .252291 .483693 .687203 .766211 .098932 .399094 .400564 .050514 .225685 .144642 .382145 .756788 .962977 .882254 .914991 .479276 .452368 .864616 .283554 .947508 .992337 .089200 .459826 .803369 .940368 .587029 .734135 .531403 .334042 .157479 .050823 .441048 .194985 .543297 .926575 .088122 .576004 .222064 .125507 .374211 .100020 .401286 .074697 .966448 .943928 .932916 .707258 .636064 .505344 .844021 .952563 .436517 .708207 .207317 .745192 .611969 .044626 .457477 .433729 .653945 .959342 .582605 .154744 .526695



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.2. <u>Uniform Random Numbers</u>

## 1.4.2.2.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location; and
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

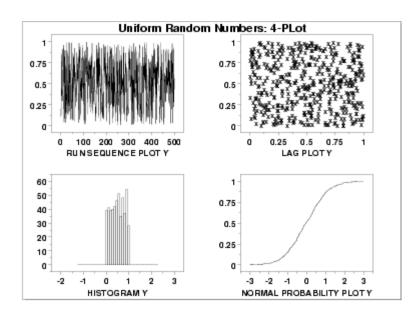

Interpretation


The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location or scale over time.
- 2. The <u>lag plot</u> (upper right) does not indicate any non-random pattern in the data.
- 3. The <u>histogram</u> shows that the frequencies are relatively flat across the range of the data. This suggests that the uniform distribution might provide a better distributional fit than the normal distribution.
- 4. The <u>normal probability plot</u> verifies that an assumption of normality is not reasonable. In this case, the 4-plot should be followed up by a uniform probability plot to determine if it provides a better fit to the data. This is shown below.


From the above plots, we conclude that the underlying assumptions are valid. Therefore, the model  $Y_i = C + E_i$  is valid. However, since the data are not normally distributed, using the mean as an estimate of C and the confidence interval cited above for quantifying its uncertainty are not valid or appropriate.

Individual Plots Although it is usually not necessary, the plots can be generated individually to give more detail.


Run Sequence Plot

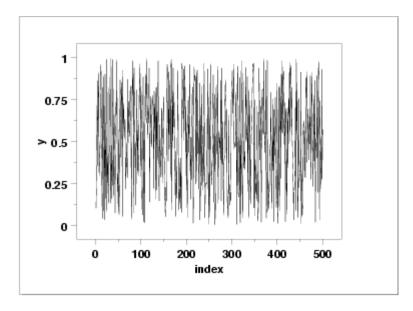

Lag Plot

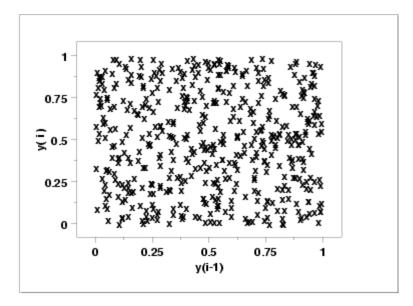


Histogram (with overlaid Normal PDF)

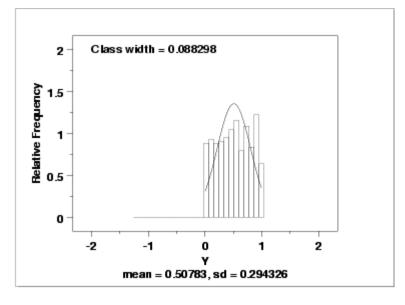


This plot shows that a normal distribution is a poor fit. The flatness of the histogram suggests that a uniform distribution might be a better fit.

Histogram (with overlaid Uniform PDF)

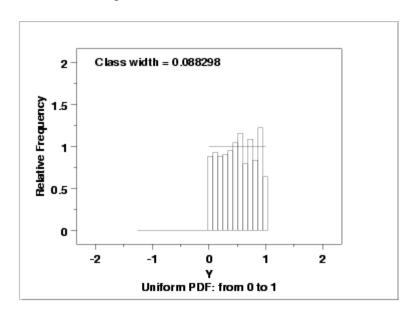


Since the histogram from the 4-plot suggested that the uniform distribution might be a good fit, we overlay a uniform distribution on top of the histogram. This indicates a much better fit than a normal distribution.

Normal Probability Plot

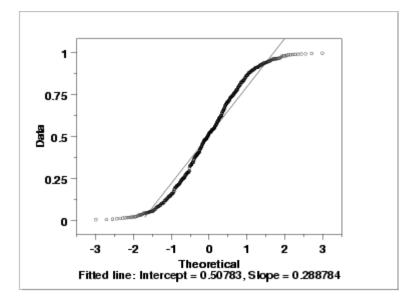

As with the histogram, the normal probability plot shows that the normal distribution does not fit these data well.

Uniform Probability Plot

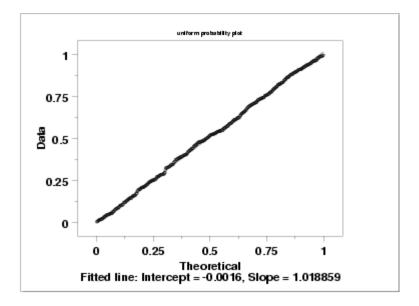

Since the above plots suggested that a uniform distribution might be appropriate, we generate a uniform probability plot. This plot shows that the uniform distribution provides an excellent fit to the data.


Better Model

Since the data follow the underlying assumptions, but with a uniform distribution rather than a normal distribution, we would still like to characterize C by a typical value plus or minus a confidence interval. In this case, we would like to find a <u>location estimator</u> with the smallest variability.

The <u>bootstrap plot</u> is an ideal tool for this purpose. The following plots show the bootstrap plot, with the

corresponding histogram, for the mean, median, mid-range, and median absolute deviation.

Bootstrap Plots

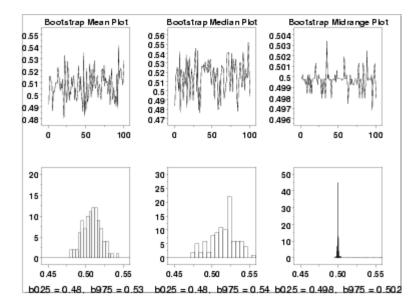

Mid-Range is Best

From the above histograms, it is obvious that for these data, the mid-range is far superior to the mean or median as an estimate for location.

Using the mean, the location estimate is 0.507 and a 95% confidence interval for the mean is (0.482,0.534). Using the mid-range, the location estimate is 0.499 and the 95% confidence interval for the mid-range is (0.497,0.503).

Although the values for the location are similar, the difference in the uncertainty intervals is quite large.

Note that in the case of a uniform distribution it is known theoretically that the mid-range is the best linear unbiased estimator for location. However, in many applications, the most appropriate estimator will not be known or it will be mathematically intractable to determine a valid condfidence interval. The bootstrap provides a method for determining (and comparing) confidence intervals in these cases.



HOME

TOOLS & AIDS

SEARCH

BACK

NEXT



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.2. <u>Uniform Random Numbers</u>

# 1.4.2.2.3. Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics are computed for the data.

```
Sample size = 500
Mean = 0.5078304
Median = 0.5183650
Minimum = 0.0024900
Maximum = 0.9970800
Range = 0.9945900
Stan. Dev. = 0.2943252
```

Because the graphs of the data indicate the data may not be normally distributed, we also compute two other statistics for the data, the normal PPCC and the uniform PPCC.

```
Normal PPCC = 0.9771602
Uniform PPCC = 0.9995682
```

The uniform <u>probability plot correlation coefficient</u> (PPCC) value is larger than the normal PPCC value. This is evidence that the uniform distribution fits these data better than does a normal distribution.

Location

One way to quantify a change in location over time is to <u>fit</u> a <u>straight line</u> to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

£ 77-3-	Coefficie	ent Estimate	S	Stan. Error
t-Valu	1е В <sub>0</sub>	0.522923		0.2638E-01
19.82	В1	-0.602478E-04		0.9125E-04
-0.66	-			
		Standard Deviation Degrees of Freedom		

The <u>t-value</u> of the slope parameter, -0.66, is smaller than the critical value of  $t_{0.975,498} = 1.96$ . Thus, we conclude that the slope is not different from zero at the 0.05

significance level.

Variation

One simple way to detect a change in variation is with a Bartlett test after dividing the data set into several equal-sized intervals. However, the Bartlett test is not robust for non-normality. Since we know this data set is not approximated well by the normal distribution, we use the alternative Levene test. In particular, we use the Levene test based on the median rather the mean. The choice of the number of intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.

```
H_0: {\sigma_1}^2 = {\sigma_2}^2 = {\sigma_3}^2 = {\sigma_4}^2
H_a: At least one {\sigma_i}^2 is not equal to the others.


Test statistic: W = 0.07983
Degrees of freedom: k - 1 = 3
Significance level: \alpha = 0.05
Critical value: F_{\alpha,k-1,N-k} = 2.623
Critical region: Reject H_0 if W > 2.623
```

In this case, the Levene test indicates that the variances are not significantly different in the four intervals.

Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests including the <u>lag plot</u> shown on the previous page.

Another check is an <u>autocorrelation plot</u> that shows the autocorrelations for various lags. Confidence bands can be plotted using 95% and 99% confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

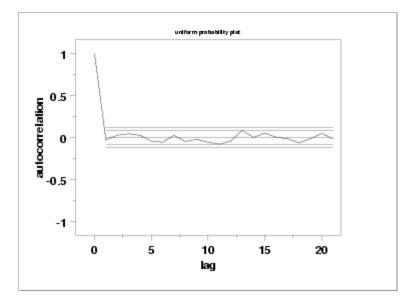

The lag 1 <u>autocorrelation</u>, which is generally the one of most interest, is 0.03. The critical values at the 5 % significance level are -0.087 and 0.087. This indicates that

the lag 1 autocorrelation is not statistically significant, so there is no evidence of non-randomness.

A common test for randomness is the <u>runs test</u>.

The runs test fails to reject the null hypothesis that the data were produced in a random manner.

Distributional Analysis <u>Probability plots</u> are a graphical test of assessing whether a particular distribution provides an adequate fit to a data set.

A quantitative enhancement to the probability plot is the correlation coefficient of the points on the probability plot, or PPCC. For this data set the PPCC based on a normal distribution is 0.977. Since the PPCC is less than the critical value of 0.987 (this is a <u>tabulated value</u>), the normality assumption is rejected.

<u>Chi-square</u> and <u>Kolmogorov-Smirnov</u> goodness-of-fit tests are alternative methods for assessing distributional adequacy. The Wilk-Shapiro and Anderson-Darling tests can be used to test for normality. The results of the Anderson-Darling test follow.

```
\rm H_0\colon the data are normally distributed \rm H_a\colon the data are not normally distributed Adjusted test statistic: \rm A^2=5.765 Significance level: \alpha=0.05 Critical value: 0.787 Critical region: Reject \rm H_0 if \rm A^2>0.787
```

The Anderson-Darling test rejects the normality assumption because the value of the test statistic, 5.765, is larger than the critical value of 0.787 at the 0.05 significance level.

Model

Based on the graphical and quantitative analysis, we use the model

$$Y_i = C + E_i$$

where C is estimated by the mid-range and the uncertainty interval for C is based on a bootstrap analysis. Specifically,

$$C = 0.499$$
  
95% confidence limit for  $C = (0.497, 0.503)$ 

#### Univariate Report

It is sometimes useful and convenient to summarize the above results in a report.

Analysis for 500 uniform random numbers 1: Sample Size = 500 2: Location Mean 0.50783 Standard Deviation of Mean 0.013163 95% Confidence Interval for Mean (0.48197, 0.533692)Drift with respect to location? = NO 3: Variation Standard Deviation 0.294326 95% Confidence Interval for SD (0.277144, 0.313796)Drift with respect to variation? (based on Levene's test on quarters of the data) = NO 4: Distribution Normal PPCC 0.9771602 Data are Normal? (as measured by Normal PPCC) = NO Uniform PPCC 0.9995682 Data are Uniform? (as measured by Uniform PPCC) = YES 5: Randomness Autocorrelation 0.03099 Data are Random? (as measured by autocorrelation) = YES 6: Statistical Control (i.e., no drift in location or scale, data is random, distribution is fixed, here we are testing only for fixed uniform) Data Set is in Statistical Control?



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.2. <u>Uniform Random Numbers</u>

# 1.4.2.2.4. Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.
1. Invoke Dataplot and read data.	
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.
2. 4-plot of the data.	
1. 4-plot of Y.	1. Based on the 4- plot, there are no shifts in location or scale, and the data do not seem to follow a normal distribution.
3. Generate the individual plots.	

1. Generate a run sequence plot.	1. The run sequence plot indicates that there are no
2. Generate a lag plot.	shifts of location or scale.
3. Generate a histogram with an overlaid normal pdf.	2. The lag plot does not indicate any significant patterns (which would show the data were not random).
4. Generate a histogram with an overlaid uniform pdf.	3. The histogram indicates that a normal
5. Generate a normal probabilityplot.	distribution is not a good distribution for
6. Generate a uniform probability plot.	these data.  4. The histogram indicates that a uniform distribution is a good distribution for these data.
	5. The normal probability plot verifies that the normal distribution is not a reasonable distribution for these data.
	6. The uniform probability plot verifies that the uniform distribution is a reasonable distribution for these data.
4. Generate the bootstrap plot.	
1. Generate a bootstrap plot.	1. The bootstrap plot clearly shows the superiority of the mid-range over the mean and median as the location estimator of choice for this problem.
5. Generate summary statistics, quantitative	
analysis, and print a univariate report.  1. Generate a table of summary statistics.	1. The summary statistics table displays 25+ statistics.
2. Generate the mean, a confidence interval for the mean, and compute a linear fit to detect drift in location.	2. The mean is 0.5078 and a 95% confidence interval is (0.482,0.534). The linear fit
3. Generate the standard deviation, a confidence interval for the	indicates no drift in location since the slope parameter

computing Barltetts test for equal standard deviations.

4. Check for randomness by generating an autocorrelation plot and a runs test.

5. Check for normality by computing the normal probability plot correlation coefficient.

6. Print a univariate report (this assumes steps 2 thru 6 have already been run).

is
 statistically not
significant.

3. The standard deviation is 0.29 with a 95% confidence interval of (0.277,0.314).

Levene's test indicates no significant drift in variation.

4. The lag 1
autocorrelation is 0.03.
From the
autocorrelation plot,
this is
within the 95%
confidence interval
bands.

5. The uniform probability plot correlation coefficient is 0.9995. This indicates that the uniform distribution is a good fit.

6. The results are summarized in a convenient report.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

### **1.4.2.3. Random Walk**

Random Walk

This example illustrates the univariate analysis of a set of numbers derived from a random walk.

- 1. Background and Data
- 2. Test Underlying Assumptions
- 3. Develop Better Model
- 4. <u>Validate New Model</u>
- 5. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH

BACK NEXT SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.3. Random Walk

## 1.4.2.3.1. Background and Data

Generation

A random walk can be generated from a set of uniform random numbers by the formula:

$$R_i = \sum_{j=1}^i (U_j - 0.5)$$

where U is a set of uniform random numbers.

The motivation for studying a set of random walk data is to illustrate the effects of a known underlying autocorrelation structure (i.e., non-randomness) in the data.

Software

The analyses used in this case study can be generated using both Dataplot code and R code.

Data

The following is the set of random walk numbers used for this case study.

- -0.399027
- -0.645651
- -0.625516
- -0.262049 -0.407173
- -0.097583
- 0.314156
- 0.106905 -0.017675
- -0.037111
- 0.357631
- 0.820111 0.844148
- 0.550509
- 0.090709
- 0.413625
- -0.002149
- 0.393170
- 0.538263
- 0.070583
- 0.473143 0.132676
- 0.109111
- -0.310553
- 0.179637
- -0.067454
- -0.190747
- -0.536916
- -0.905751
- -0.518984
- -0.579280 -0.643004
- -1.014925
- -0.517845

-0.860484 -0.884081 -1.147428 -0.657917 -0.470205 -0.798437 -0.637780-0.666046 -1.093278 -1.089609-0.853439 -0.695306 -0.206795 -0.507504 -0.696903 -1.116358 -1.044534 -1.481004-1.638390 -1.270400 -1.026477-1.123380 -0.770683 -0.510481-0.958825 -0.531959 -0.457141-0.226603 -0.201885 -0.078000 0.057733 -0.228762-0.403292 -0.414237 -0.556689 -0.772007 -0.401024 -0.409768 -0.171804 -0.096501 -0.066854 0.216726 0.551008 0.660360 0.194795 -0.031321 0.453880 0.730594 1.136280 0.708490 1.149048 1.258757 1.102107 1.102846 0.720896 0.764035 1.072312 0.897384 0.965632 0.759684 0.679836 0.955514 1.290043 1.753449 1.542429 1.873803 2.043881 1.728635 1.289703 1.501481 1.888335 1.408421 1.416005 0.929681 1.097632 1.501279 1.650608 1.759718

2.255664 2.490551 2.508200

2.707382 2.816310 3.254166 2.890989 2.869330 3.024141 3.291558 3.260067 3.265871 3.542845 3.773240 3.991880 3.710045 4.011288 4.074805 4.301885 3.956416 4.278790 3.989947 4.315261 4.200798 4.444307 4.926084 4.828856 4.473179 4.573389 4.528605 4.452401 4.238427 4.437589 4.617955 4.370246 4.353939 4.541142 4.807353 4.706447 4.607011 4.205943 3.756457 3.482142 3.126784 3.383572 3.846550 4.228803 4.110948 4.525939 4.478307 4.457582 4.822199 4.605752 5.053262 5.545598 5.134798 5.438168 5.397993 5.838361 5.925389 6.159525 6.190928 6.024970 5.575793 5.516840 5.211826 4.869306 4.912601 5.339177 5.415182 5.003303 4.725367 4.350873 4.225085 3.825104 3.726391 3.301088 3.767535 4.211463 4.418722 4.554786 4.987701 4.993045

5.789629 5.726147 5.934353 5.641670 5.753639 5.298265 5.255743 5.500935 5.434664 5.588610 6.047952 6.130557 5.785299 5.811995 5.582793 5.618730 5.902576 6.226537 5.738371 5.449965 5.895537 6.252904 6.650447 7.025909 6.770340 7.182244 6.941536 7.368996 7.293807 7.415205 7.259291 6.970976 7.319743 6.850454 6.556378 6.757845 6.493083 6.824855 6.533753 6.410646 6.502063 6.264585 6.730889 6.753715 6.298649 6.048126 5.794463 5.539049 5.290072 5.409699 5.843266 5.680389 5.185889 5.451353 5.003233 5.102844 5.566741 5.613668 5.352791 5.140087 4.999718 5.030444 5.428537 5.471872 5.107334 5.387078 4.889569 4.492962 4.591042 4.930187 4.857455 4.785815 5.235515 4.865727 4.855005 4.920206 4.880794 4.904395 4.795317 5.163044

5.246230 5.111000 5.228429 5.050220 4.610006 4.489258 4.399814 4.606821 4.974252 5.190037 5.084155 5.276501 4.917121 4.534573 4.076168 4.236168 3.923607 3.666004 3.284967 2.980621 2.623622 2.882375 3.176416 3.598001 3.764744 3.945428 4.408280 4.359831 4.353650 4.329722 4.294088 4.588631 4.679111 4.182430 4.509125 4.957768 4.657204 4.325313 4.338800 4.720353 4.235756 4.281361 3.795872 4.276734 4.259379 3.999663 3.544163 3.953058 3.844006 3.684740 3.626058 3.457909 3.581150 4.022659 4.021602 4.070183 4.457137 4.156574 4.205304 4.514814 4.055510 3.938217 4.180232 3.803619 3.553781 3.583675 3.708286 4.005810 4.419880 4.881163 5.348149 4.950740 5.199262 4.753162 4.640757 4.327090 4.080888 3.725953 3.939054 3.463728

2.661061 3.099980 3.340274 3.230551 3.287873 3.497652 3.014771 3.040046 3.342226 3.656743 3.698527 3.759707 4.253078 4.183611 4.196580 4.257851 4.683387 4.224290 3.840934 4.329286 3.909134 3.685072 3.356611 2.956344 2.800432 2.761665 2.744913 3.037743 2.787390 2.387619 2.424489 2.247564 2.502179 2.022278 2.213027 2.126914 2.264833 2.528391 2.432792 2.037974 1.699475 2.048244 1.640126 1.149858 1.475253 1.245675 0.831979 1.165877 1.403341 1.181921 1.582379 1.632130 2.113636 2.163129 2.545126 2.963833 3.078901 3.055547 3.287442 2.808189 2.985451 3.181679 2.746144 2.517390 2.719231 2.581058 2.838745 2.987765 3.459642 3.458684 3.870956 4.324706 4.411899 4.735330 4.775494 4.681160 4.462470 3.992538 3.719936 3.427081

- 3.462766 3.046353 3.537430 3.579857 3.931223 3.590096 3.136285 3.391616 3.114700 2.897760 2.724241 2.557346 2.971397 2.479290 2.305336 1.852930 1.471948 1.510356 1.633737 1.727873 1.512994 1.603284 1.387950 1.767527 2.029734 2.447309 2.321470 2.435092 2.630118 2.520330 2.578147 2.729630 2.713100 3.107260 2.876659 2.774242 3.185503 3.403148 3.392646 3.123339 3.164713 3.439843 3.321929 3.686229 3.203069 3.185843 3.204924 3.102996 3.496552 3.191575 3.409044 3.888246 4.273767 3.803540 4.046417 4.071581 3.916256 3.634441 4.065834 3.844651
- NIST SEMATECH

HOME

3.915219

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.3. Random Walk

# 1.4.2.3.2. Test Underlying Assumptions

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$

is appropriate and valid.

2. Determine if the typical underlying assumptions for an "in control" measurement process are valid.


These assumptions are:

- 1. random drawings;
- 2. from a fixed distribution;
- 3. with the distribution having a fixed location; and
- 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid, with *s* denoting the standard deviation of the original data.

4-Plot of Data

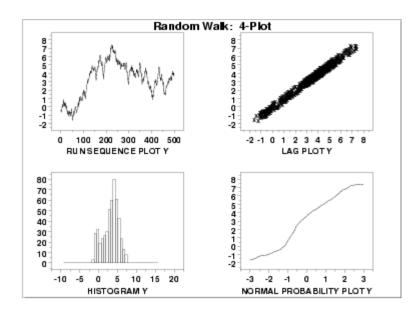

*Interpretation* 

The assumptions are addressed by the graphics shown above:


- 1. The <u>run sequence plot</u> (upper left) indicates significant shifts in location over time.
- 2. The <u>lag plot</u> (upper right) indicates significant non-randomness in the data.
- 3. When the assumptions of randomness and constant location and scale are not satisfied, the distributional assumptions are not meaningful. Therefore we do not attempt to make any interpretation of the <a href="histogram">histogram</a> (lower left) or the normal probability plot (lower right).

From the above plots, we conclude that the underlying assumptions are seriously violated. Therefore the  $Y_i = C + E_i$  model is not valid.

When the randomness assumption is seriously violated, a time series model may be appropriate. The lag plot often suggests a reasonable model. For example, in this case the strongly linear appearance of the lag plot suggests a model fitting  $Y_i$  versus  $Y_{i-1}$  might be appropriate. When the data are non-random, it is helpful to supplement the lag plot with an autocorrelation plot and a spectral plot. Although in this case the lag plot is enough to suggest an appropriate model, we provide the autocorrelation and spectral plots for comparison.

Autocorrelation Plot


When the lag plot indicates significant non-randomness, it can be helpful to follow up with a an <u>autocorrelation plot</u>.

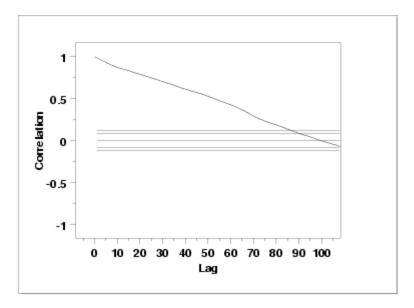

This autocorrelation plot shows significant autocorrelation at lags 1 through 100 in a linearly decreasing fashion.

Spectral Plot

Another useful plot for non-random data is the <u>spectral</u> <u>plot.</u>

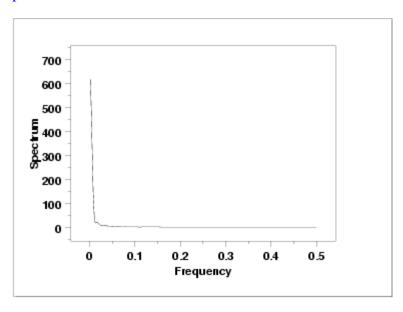

This spectral plot shows a single dominant low frequency peak.

Quantitative Output Although the 4-plot above clearly shows the violation of the assumptions, we supplement the graphical output with some quantitative measures.

Summary Statistics As a first step in the analysis, common summary statistics are computed from the data.

```
Sample size = 500
Mean
                 3.216681
Median
             =
                 3.612030
Minimum
             =
                -1.638390
                 7.415205
Maximum
Range
                 9.053595
             =
Stan. Dev.
                  2.078675
```

We also computed the <u>autocorrelation</u> to be 0.987, which is evidence of a very strong autocorrelation.

Location

One way to quantify a change in location over time is to fit a straight line to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

1	Coefficie	nt Estimate	Stan. Error
t-Valu	.е В <sub>0</sub>	1.83351	0.1721
10.650	_	0 5501645 00	0 50528 02
9.275	В <sub>1</sub>	0.552164E-02	0.5953E-03
	Residual	Standard Deviation	= 1.9214

Residual Degrees of Freedom = 498

The <u>t-value</u> of the slope parameter, 9.275, is larger than the critical value of  $t_{0.975,498} = 1.96$ . Thus, we conclude that the slope is different from zero at the 0.05 significance level.

Variation

One simple way to detect a change in variation is with a Bartlett test after dividing the data set into several equal-sized intervals. However, the Bartlett test is not robust for non-normality. Since we know this data set is not approximated well by the normal distribution, we use the alternative Levene test. In particular, we use the Levene test based on the median rather the mean. The choice of the number of intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.

```
H_0: {\sigma_1}^2 = {\sigma_2}^2 = {\sigma_3}^2 = {\sigma_4}^2
H_a: At least one {\sigma_i}^2 is not equal to the others.

Test statistic: W = 10.459
Degrees of freedom: k-1=3
Significance level: \alpha=0.05
Critical value: F_{\alpha,k-1,N-k}=2.623
Critical region: Reject H_0 if W > 2.623
```

In this case, the Levene test indicates that the variances are significantly different in the four intervals since the test statistic of 10.459 is greater than the 95 % critical value of 2.623. Therefore we conclude that the scale is not constant.

Randomness

Although the lag 1 autocorrelation coefficient above clearly shows the non-randomness, we show the output from a <u>runs test</u> as well.

```
H<sub>0</sub>: the sequence was produced in a random manner  \text{H}_a \colon \text{ the sequence was not produced in a random manner}  Test statistic: Z = -20.3239 Significance level: \alpha = 0.05 Critical value: Z_{1-\alpha/2} = 1.96 Critical region: Reject H<sub>0</sub> if |Z| > 1.96
```

The runs test rejects the null hypothesis that the data were produced in a random manner at the 0.05 significance level.

Distributional Assumptions

Since the quantitative tests show that the assumptions of randomness and constant location and scale are not met, the distributional measures will not be meaningful. Therefore these quantitative tests are omitted.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.3. Random Walk

## 1.4.2.3.3. Develop A Better Model

Lag Plot Suggests Better Model Since the underlying assumptions did not hold, we need to develop a better model.

The lag plot showed a distinct linear pattern. Given the definition of the lag plot,  $Y_i$  versus  $Y_{i-1}$ , a good candidate model is a model of the form

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

Fit Output

The results of a <u>linear fit</u> of this model generated the following results.

_	Coefficient	Estimate	Stan. Error	t-
Value	A <sub>0</sub>	0.050165	0.024171	
2.075	$\mathtt{A}_1$	0.987087	0.006313	
156.35	0			

Residual Standard Deviation = 0.2931 Residual Degrees of Freedom = 497

The slope parameter,  $A_1$ , has a <u>t value</u> of 156.350 which is statistically significant. Also, the residual standard deviation is 0.2931. This can be compared to the standard deviation <u>shown</u> in the <u>summary table</u>, which is 2.078675. That is, the fit to the autoregressive model has reduced the variability by a factor of 7.

Time Series Model This model is an example of a time series model. More extensive discussion of time series is given in the <u>Process Monitoring</u> chapter.



HOME


TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.3. Random Walk

## 1.4.2.3.4. Validate New Model

Plot Predicted with Original Data The first step in <u>verifying the model</u> is to plot the predicted values from the fit with the original data.

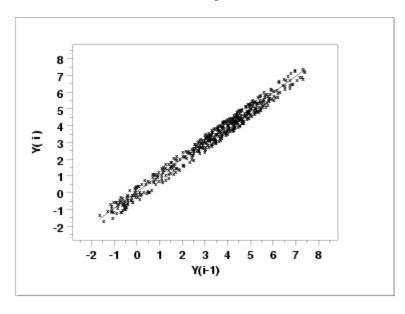


This plot indicates a reasonably good fit.

Test
Underlying
Assumptions
on the
Residuals

4-Plot of Residuals

In addition to the plot of the predicted values, the residual standard deviation from the fit also indicates a significant improvement for the model. The next step is to validate the underlying assumptions for the error component, or residuals, from this model.

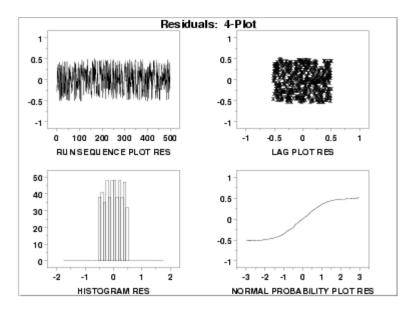


Interpretation

The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates no significant shifts in location or scale over time.
- 2. The <u>lag plot</u> (upper right) exhibits a random appearance.
- 3. The <u>histogram</u> shows a relatively flat appearance. This indicates that a uniform probability distribution may be an appropriate model for the error component (or residuals).
- 4. The <u>normal probability</u> plot clearly shows that the normal distribution is not an appropriate model for the error component.

A uniform probability plot can be used to further test the suggestion that a uniform distribution might be a good model for the error component.

Uniform
Probability
Plot of
Residuals

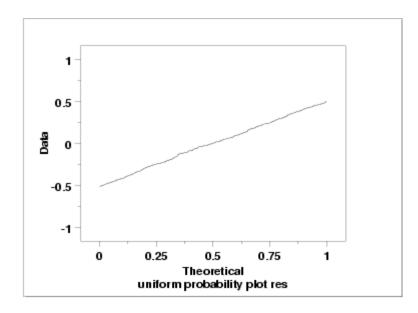

Since the <u>uniform probability plot</u> is nearly linear, this verifies that a uniform distribution is a good model for the error component.

**Conclusions** 

Since the residuals from our model satisfy the underlying assumptions, we conlude that

$$Y_i = 0.0502 + 0.987 * Y_{i-1} + E_i$$

where the  $E_i$  follow a uniform distribution is a good model for this data set. We could simplify this model to

$$Y_i = 1.0 * Y_{i-1} + E_i$$

This has the advantage of simplicity (the current point is simply the previous point plus a uniformly distributed error term).

Using Scientific and Engineering Knowledge

In this case, the above model makes sense based on our definition of the random walk. That is, a random walk is the cumulative sum of uniformly distributed data points. It makes sense that modeling the current point as the previous point plus a uniformly distributed error term is about as good as we can do. Although this case is a bit artificial in that we knew how the data were constructed, it is common and desirable to use scientific and engineering knowledge of the process that generated the data in formulating and testing models for the data. Quite often, several competing models will produce nearly equivalent mathematical results. In this case, selecting the model that best approximates the scientific understanding of the process is a reasonable choice.

Time Series Model

This model is an example of a time series model. More extensive discussion of time series is given in the **Process** Monitoring chapter.



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.3. <u>Random Walk</u>

## **1.4.2.3.5.** Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions	
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.	
1. Invoke Dataplot and read data.		
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.	
2. Validate assumptions.		
1. 4-plot of Y.	1. Based on the 4- plot, there are shifts in location and	
2. Generate a table of summary statistics.	scale and the data are not random.	
3. Generate a linear fit to detect drift in location.	2. The summary statistics table displays	
4. Detect drift in variation by	25+ statistics.	

dividing the data into quarters and computing Levene's test for equal standard deviations.  5. Check for randomness by generating a runs test.	3. The linear fit indicates drift in location since the slope parameter is statistically significant.  4. Levene's test indicates significant drift in variation.  5. The runs test indicates significant non-randomness.
3. Generate the randomness plots.  1. Generate an autocorrelation plot.  2. Generate a spectral plot.	1. The autocorrelation plot shows significant autocorrelation at lag 1.  2. The spectral plot shows a single dominant low frequency peak.
4. Fit Y <sub>i</sub> = A0 + A1*Y <sub>i-1</sub> + E <sub>i</sub> and validate.  1. Generate the fit.  2. Plot fitted line with original data.	1. The residual standard deviation from the fit is 0.29 (compared to the standard deviation of 2.08 from the original data).
3. Generate a 4-plot of the residuals from the fit.	2. The plot of the predicted values with the original data indicates a good fit.
4. Generate a uniform probability plot of the residuals.	3. The 4-plot indicates that the assumptions of constant location and scale are valid.  The lag plot indicates that the data are random. However, the histogram and normal probability plot indicate that the uniform disribution might be a better model for the residuals than the normal distribution.
	disribution might be a better model for the residuals than the normal

probability plot verifies that the residuals can be fit uniform distribution. NIST BACK NEXT HOME TOOLS & AIDS SEARCH

SEMATECH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

# 1.4.2.4. Josephson Junction Cryothermometry

Josephson Junction Cryothermometry

This example illustrates the univariate analysis of Josephson junction cyrothermometry.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.4. <u>Josephson Junction Cryothermometry</u>

## 1.4.2.4.1. Background and Data

#### Generation This data set was collected by Bob Soulen of NIST in

October, 1971 as a sequence of observations collected equispaced in time from a volt meter to ascertain the process temperature in a Josephson junction cryothermometry (low temperature) experiment. The response variable is voltage counts.

Motivation The motivation for studying this data set is to illustrate the

case where there is discreteness in the measurements, but the underlying assumptions hold. In this case, the discreteness is

due to the data being integers.

Software The analyses used in this case study can be generated using

both Dataplot code and R code.

Data The following are the data used for this case study.

```
2899
     2898 2897
                2898
2899
     2899
          2899
                2898
                     2898
2897
     2898 2899
                2897
                     2897
2899
     2898
          2898
                2899
                     2899
          2899
2901
     2899
                2899
                     2897
2900 2896
          2898
                2898
                     2900
          2897
                2896
                     2898
2897 2899
2897
     2898
          2899
                2896
                     2899
2901 2898
          2898
                2896
                     2897
2899 2897
          2898
                2899
                     2898
2898
     2898
          2898
                2898
                     2898
2899 2900 2899
                2901
                     2898
2899 2899
          2898
                2900 2898
2899 2899
          2901
                2900 2901
          2899
2899
     2901
                2901
                     2899
2900 2902
          2899
                2898 2899
2900 2899
          2900
                2900
                     2901
2900
     2899
          2901
                2901
                     2899
2898 2901 2897
                2898 2901
2900 2902
          2899
                2900 2898
2900 2899
          2900
                2899
                     2899
2899 2898 2900
                2898 2899
2899 2899 2899 2898 2900
```



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.4. <u>Josephson Junction Cryothermometry</u>

## 1.4.2.4.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location; and
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

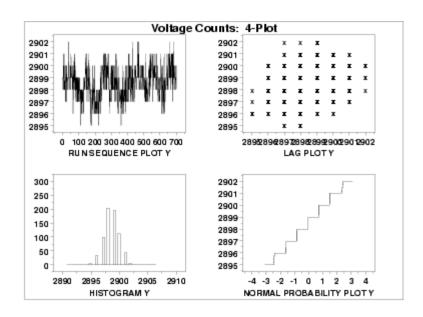

Interpretation

The assumptions are addressed by the graphics shown above:


- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location or scale over time.
- 2. The <u>lag plot</u> (upper right) does not indicate any non-random pattern in the data.
- 3. The <u>histogram</u> (lower left) shows that the data are reasonably symmetric, there does not appear to be significant outliers in the tails, and that it is reasonable to assume that the data can be fit with a normal distribution.
- 4. The <u>normal probability plot</u> (lower right) is difficult to interpret due to the fact that there are only a few distinct values with many repeats.

The integer data with only a few distinct values and many repeats accounts for the discrete appearance of several of the plots (e.g., the lag plot and the normal probability plot). In this case, the nature of the data makes the normal probability plot difficult to interpret, especially since each number is repeated many times. However, the histogram indicates that a normal distribution should provide an adequate model for the data.


From the above plots, we conclude that the underlying assumptions are valid and the data can be reasonably approximated with a normal distribution. Therefore, the commonly used uncertainty standard is valid and appropriate. The numerical values for this model are given in the Quantitative Output and Interpretation section.

Individual Plots Although it is normally not necessary, the plots can be generated individually to give more detail.


Run Sequence Plot

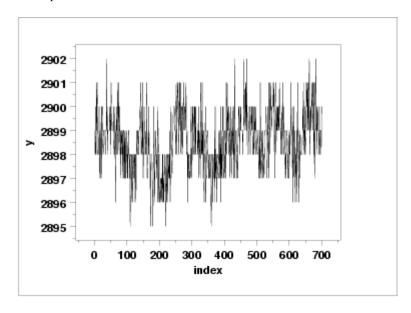


Lag Plot

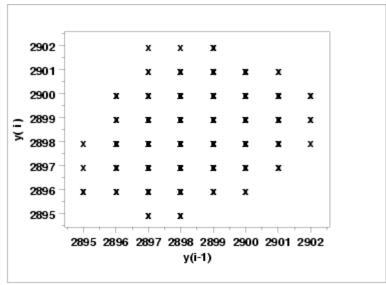

Histogram (with overlaid Normal PDF)

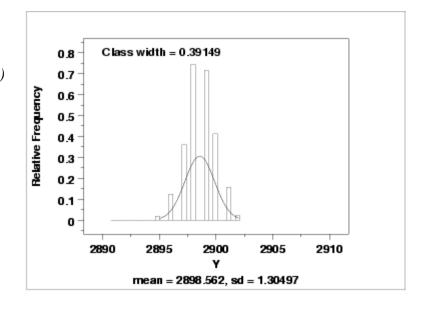

Normal Probability Plot

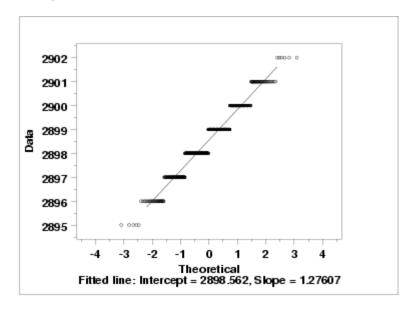



HOME

TOOLS & AIDS

SEARCH



### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.4. <u>Josephson Junction Cryothermometry</u>

# **1.4.2.4.3.** Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics were computed from the data.

```
Sample size = 700
Mean = 2898.562
Median = 2899.000
Minimum = 2895.000
Maximum = 2902.000
Range = 7.000
Stan. Dev. = 1.305
```

Because of the discrete nature of the data, we also compute the normal PPCC.

```
Normal PPCC = 0.97484
```

Location

One way to quantify a change in location over time is to fit a straight line to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

	fficient	Estimate	Stan. Error
t-Value	Во	2.898E+03	9.745E-02
29739.288	B <sub>1</sub>	1.071E-03	2.409e-04
4.445	±		

Residual Standard Deviation = 1.288 Residual Degrees of Freedom = 698

The slope parameter,  $B_1$ , has a <u>t value</u> of 4.445 which is statistically significant (the critical value is 1.96). However, the value of the slope is 1.071E-03. Given that the slope is nearly zero, the assumption of constant location is not seriously violated even though it is statistically significant.

Variation

One simple way to detect a change in variation is with a <u>Bartlett test</u> after dividing the data set into several equal-sized intervals. However, the Bartlett test is not robust for non-normality. Since the nature of the data (a few distinct

points repeated many times) makes the normality assumption questionable, we use the alternative <u>Levene</u> <u>test</u>. In particular, we use the Levene test based on the median rather the mean. The choice of the number of intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.

```
\begin{array}{ll} \text{H}_0\colon & {\sigma_1}^2 = {\sigma_2}^2 = {\sigma_3}^2 = {\sigma_4}^2 \\ & \text{H}_a\colon & \text{At least one } {\sigma_i}^2 \text{ is not equal to the others.} \end{array}
```

```
Test statistic: W = 1.43

Degrees of freedom: k - 1 = 3

Significance level: \alpha = 0.05

Critical value: F_{\alpha,k-1,N-k} = 2.618


Critical region: Reject H_0 if W > 2.618
```

Since the Levene test statistic value of 1.43 is less than the 95 % critical value of 2.618, we conclude that the variances are not significantly different in the four intervals.

Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests. The <u>lag plot in the previous section</u> is a simple graphical technique.

Another check is an autocorrelation plot that shows the <u>autocorrelations</u> for various lags. Confidence bands can be plotted at the 95 % and 99 % confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

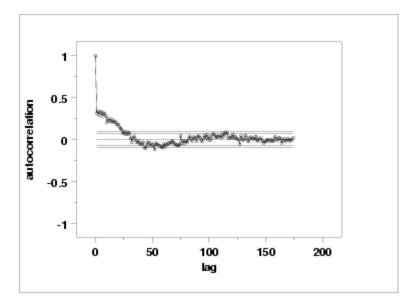

The lag 1 autocorrelation, which is generally the one of most interest, is 0.31. The critical values at the 5 % level of significance are -0.087 and 0.087. This indicates that the lag 1 autocorrelation is statistically significant, so there is some evidence for non-randomness.

A common test for randomness is the <u>runs test</u>.

The runs test indicates non-randomness.

Although the runs test and lag 1 autocorrelation indicate some mild non-randomness, it is not sufficient to reject the  $Y_i = C + E_i$  model. At least part of the non-randomness can be explained by the discrete nature of the data.

#### Distributional Analysis

Probability plots are a graphical test for assessing if a particular distribution provides an adequate fit to a data set.

A quantitative enhancement to the probability plot is the correlation coefficient of the points on the probability plot, or PPCC. For this data set the PPCC based on a normal distribution is 0.975. Since the PPCC is less than the critical value of 0.987 (this is a <u>tabulated value</u>), the normality assumption is rejected.

<u>Chi-square</u> and <u>Kolmogorov-Smirnov</u> goodness-of-fit tests are alternative methods for assessing distributional adequacy. The <u>Wilk-Shapiro</u> and <u>Anderson-Darling</u> tests can be used to test for normality. The results of the Anderson-Darling test follow.

```
\rm H_0\colon the data are normally distributed \rm H_a\colon the data are not normally distributed Adjusted test statistic: \rm A^2=16.858 Significance level: \alpha=0.05 Critical value: 0.787 Critical region: Reject \rm H_0 if \rm A^2>0.787
```

The Anderson-Darling test rejects the normality assumption because the test statistic, 16.858, is greater than the 95 % critical value 0.787.

Although the data are not strictly normal, the violation of the normality assumption is not severe enough to conclude that the  $Y_i = C + E_i$  model is unreasonable. At least part of the non-normality can be explained by the discrete nature of the data.

#### Outlier Analysis

A test for outliers is the <u>Grubbs test</u>.

```
H_0: there are no outliers in the data H_a: the maximum value is an outlier

Test statistic: G=2.729201
Significance level: \alpha=0.05
Critical value for a one-tailed test:
```

```
3.950619 Critical region: Reject H_0 if G > 3.950619
```

For this data set, Grubbs' test does not detect any outliers at the 0.05 significance level.

Model

Although the randomness and normality assumptions were mildly violated, we conclude that a reasonable model for the data is:

$$Y_i = 2898.7 + E_i$$

In addition, a 95 % confidence interval for the mean value is (2898.515, 2898.928).

Univariate Report It is sometimes useful and convenient to summarize the above results in a report.

Analysis for Josephson Junction Cryothermometry 1: Sample Size = 700 2: Location Mean 2898.562 Standard Deviation of Mean 0.049323 95% Confidence Interval for Mean (2898.465,2898.658) Drift with respect to location? = YES (Further analysis indicates that the drift, while statistically significant, is not practically significant) 3: Variation Standard Deviation 1.30497 95% Confidence Interval for SD (1.240007, 1.377169)Drift with respect to variation? (based on Levene's test on quarters of the data) = NO4: Distribution Normal PPCC 0.97484 Data are Normal? (as measured by Normal PPCC) = NO 5: Randomness Autocorrelation 0.314802 Data are Random? (as measured by autocorrelation) = NO 6: Statistical Control (i.e., no drift in location or scale, data are random, distribution is fixed, here we are testing only for fixed normal) Data Set is in Statistical Control? Note: Although we have violations of the assumptions, they are mild enough, and at least partially explained by the discrete nature of the data, so we may model the data as if it were in statistical control 7: Outliers? (as determined by Grubbs test) = NO



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.4. <u>Josephson Junction Cryothermometry</u>

## 1.4.2.4.4. Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.
1. Invoke Dataplot and read data.	
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.
2. 4-plot of the data.	
1. 4-plot of Y.	1. Based on the 4- plot, there are no shifts     in location or scale. Due to the nature     of the data (a few distinct points with     many repeats), the normality assumption is

questionable. 3. Generate the individual plots. 1. Generate a run sequence plot. 1. The run sequence plot indicates that there are no shifts of location or scale. Generate a lag plot. 2. The lag plot does not indicate any significant Generate a histogram with an patterns (which would overlaid normal pdf. show the data were not random). Generate a normal probability 3. The histogram indicates that a plot. normal <u>distribution is a</u> good distribution for these data. 4. The discrete nature of the data <u>masks</u> the normality or non-normality of the data somewhat. The plot indicates that a normal <u>distribution provides</u> <u>a rough</u> approximation for the data. 4. Generate summary statistics, quantitative analysis, and print a univariate 1. The summary report. statistics table 1. Generate a table of summary displays statistics. 25+ statistics. Generate the mean, a confidence interval for the mean, and compute 2. The mean is 2898.56 and a 95% confidence a linear fit to detect drift in interval is (2898.46,2898.66). The linear fit location. <u>indicates no</u> Generate the standard deviation, a confidence interval for the meaningful drift in location since standard the value of the deviation, and detect drift in slope parameter is near variation zero. by dividing the data into quarters <u>and</u> computing Levene's test for equal standard deviations. 3. The standard devaition is 1.30 with a 95% confidence 4. Check for randomness by generating <u>interval</u> of <u>an</u> (1.24, 1.38).autocorrelation plot and a runs test. Levene's test indicates no significant drift in 5. Check for normality by computing variation. <u>the</u> normal probability plot correlation coefficient.

- 6. Check for outliers using Grubbs' test.
- 7. Print a univariate report (this assumes steps 2 thru 6 have already been run).
- 4. The lag 1
  autocorrelation is
  0.31.
  This indicates
  some mild nonrandomness.
- 5. The normal probability plot correlation coefficient is 0.975. At the 5% level, we reject the normality assumption.
- 6. Grubbs' test
  detects no outliers
  at the
  5% level.
- 7. The results are summarized in a convenient report.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

# 1.4.2.5. Beam Deflections

Beam Deflection This example illustrates the univariate analysis of beam deflection data.

- 1. Background and Data
- 2. Test Underlying Assumptions
- 3. <u>Develop a Better Model</u>
- 4. <u>Validate New Model</u>
- 5. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.5. Beam Deflections

## 1.4.2.5.1. Background and Data

Generation

This data set was collected by H. S. Lew of NIST in 1969 to measure steel-concrete beam deflections. The response variable is the deflection of a beam from the center point.

The motivation for studying this data set is to show how the underlying assumptions are affected by periodic data.

Data The following are the data used for this case study.

- -213
- -564
- -35
- -15
- 141
- 115
- -420 -360
- 203
- -338
- -431
- 194
- -220 -513
- 154
- -125 -559
- 92
- -21
- -579
- 99
- -543
- -175
- 162 -457
- -346
- 204
- $-300 \\ -474$
- 164
- -107
- -572
- -8
- 83
- -541 -224
- 180
- -420
- -374 201
- -236
- 83
- 27
- -564
- -112 131
- http://www.itl.nist.gov/div898/handbook/eda/section4/eda4251.htm[6/27/2012 2:03:31 PM]

-507 -254 199 -311 -495 143 -46 -579 -90 136 -472 -338 202 -287 -477 169 -124 -568 17 48 -568 -135 162 -430 -422 172 -74 -577 -13 92 -534 -243 194 -355 -465 156 -81 -578 -64 139 -449 -384 193 -198 -538 110 -44-577 -6 66 -552 -164 161 -460 -344205 -281 -504 134 -28 -576 -118 156 -437 -381 200 -220 -540 83 11 -568 -160 172 -414 -408 188 -125 -572 -32 139

-492

-321 205 -262 -504142 -83 -574 0 48 -571 -106 137 -501 -266 190 -391 -406 194 -186 -553 83 -13 -577 -49 103 -515 -280 201 300 -506 131 -45 -578 -80 138 -462 -361 201 -211 -554 32 74 -533 -235 187 -372 -442 182 -147 -566 25 68 -535 -244 194 -351 -463 174 -125 -570 15 72 -550 -190 172 -424 -385 198 -218 -536 96



HOME

TOOLS & AIDS

SEARCH



## ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.5. Beam Deflections

# 1.4.2.5.2. Test Underlying Assumptions

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$

is appropriate and valid.

2. Determine if the typical underlying assumptions for an "in control" measurement process are valid.


These assumptions are:

- 1. random drawings;
- 2. from a fixed distribution;
- 3. with the distribution having a fixed location; and
- 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

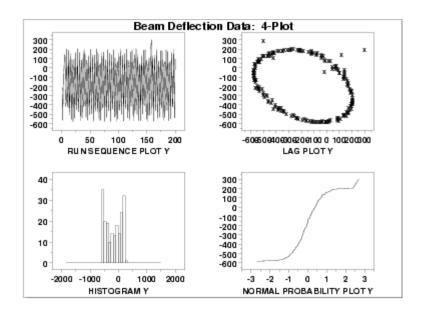

*Interpretation* 

The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location or scale over time.
- 2. The <u>lag plot</u> (upper right) shows that the data are not random. The lag plot further indicates the presence of a few outliers.
- 3. When the randomness assumption is thus seriously violated, the <u>histogram</u> (lower left) and <u>normal probability plot</u> (lower right) are ignored since determining the distribution of the data is only meaningful when the data are random.

From the above plots we conclude that the underlying randomness assumption is not valid. Therefore, the model

$$Y_i = C + E_i$$


is not appropriate.

We need to develop a better model. Non-random data can frequently be modeled using <u>time series</u> mehtodology. Specifically, the circular pattern in the lag plot indicates that a sinusoidal model might be appropriate. The sinusoidal model will be developed in the next section.


Individual Plots

The plots can be generated individually for more detail. In this case, only the run sequence plot and the lag plot are drawn since the distributional plots are not meaningful.

Run Sequence Plot

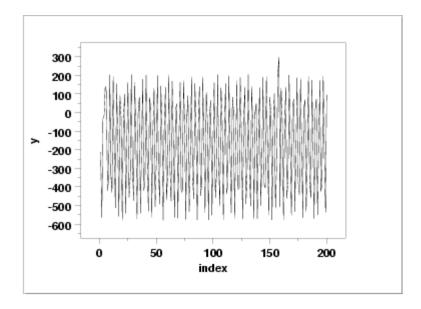

Lag Plot

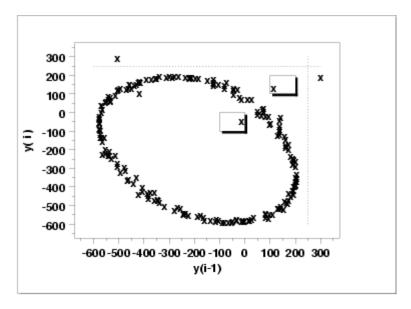


We have drawn some lines and boxes on the plot to better isolate the outliers. The following data points appear to be outliers based on the lag plot.

INDEX	Y(i-1)	Y(i)
158	-506.00	300.00
157	300.00	201.00
3	-15.00	-35.00
5	115.00	141.00

That is, the third, fifth, 157th, and 158th points appear to be outliers.


Autocorrelation Plot When the lag plot indicates significant non-randomness, it can be helpful to follow up with a an <u>autocorrelation plot</u>.

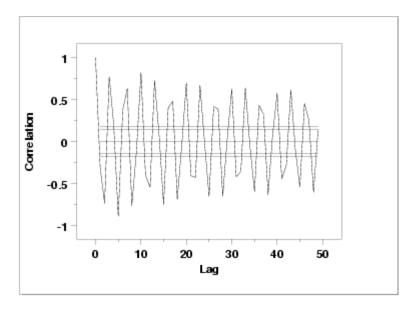

This autocorrelation plot shows a distinct cyclic pattern. As with the lag plot, this suggests a sinusoidal model.

Spectral Plot

Another useful plot for non-random data is the <u>spectral</u> <u>plot</u>.

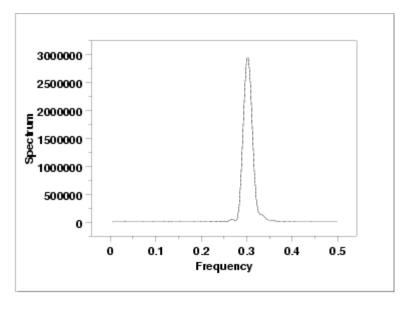

This spectral plot shows a single dominant peak at a frequency of 0.3. This frequency of 0.3 will be used in fitting the sinusoidal model in the next section.

Quantitative Results Although the lag plot, autocorrelation plot, and spectral plot clearly show the violation of the randomness assumption, we supplement the graphical output with some quantitative measures.

Summary Statistics As a first step in the analysis, summary statistics are computed from the data.

```
Sample size = 200
Mean = -177.4350
Median = -162.0000
Minimum = -579.0000
Maximum = 300.0000
Range = 879.0000
Stan. Dev. = 277.3322
```

Location

One way to quantify a change in location over time is to <u>fit a straight line</u> to the data set using the index variable X = 1, 2, ..., N, with N denoting the number of observations. If there is no significant drift in the location, the slope parameter should be zero.

t-Valu	Coefficie	ent Estimate	Stan. Error
	A <sub>0</sub>	-178.175	39.47
-4.514	$\mathtt{A}_1$	0.7366E-02	0.34
0.022			
	Residual	Standard Deviation	= 278.0313

The slope parameter, A1, has a <u>t value</u> of 0.022 which is statistically not significant. This indicates that the slope can in fact be considered zero.

Residual Degrees of Freedom = 198

Variation

One simple way to detect a change in variation is with a <u>Bartlett test</u> after dividing the data set into several equal-

sized intervals. However, the Bartlett the non-randomness of this data does not allows us to assume normality, we use the alternative Levene test. In partiuclar, we use the Levene test based on the median rather the mean. The choice of the number of intervals is somewhat arbitrary, although values of 4 or 8 are reasonable.

```
H_0: \sigma_1^2 = \sigma_2^2 = \sigma_3^2 = \sigma_4^2
        H_a: At least one \sigma_i^2 is not equal to the
others.
```

```
Test statistic: W = 0.09378
Degrees of freedom: k - 1 = 3
Sample size: N = 200
Significance level: \alpha = 0.05
Critical value: F_{\alpha,k-1,N-k} = 2.651
Critical region: Reject H_0 if W > 2.651
```

In this case, the Levene test indicates that the variances are not significantly different in the four intervals since the test statistic value, 0.9378, is less than the critical value of 2.651.

Randomness

A runs test is used to check for randomness

```
the sequence was produced in a random
manner
```

Ha: the sequence was not produced in a random manner

```
Test statistic: Z = 2.6938
Significance level: \alpha = 0.05
Critical value: Z_{1-\alpha/2} = 1.96
Critical region: Reject H_0 if |Z| > 1.96
```

The absolute value of the test statistic is larger than the critical value at the 5 % significance level, so we conclude that the data are not random.

Distributional Assumptions

Since the quantitative tests show that the assumptions of constant scale and non-randomness are not met, the distributional measures will not be meaningful. Therefore these quantitative tests are omitted.



HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.5. Beam Deflections

## 1.4.2.5.3. Develop a Better Model

Sinusoidal Model The lag plot and autocorrelation plot in the previous section strongly suggested a sinusoidal model might be appropriate. The basic sinusoidal model is:

$$Y_i = C + \alpha \sin(2\pi\omega T_i + \phi) + E_i$$

where C is constant defining a mean level,  $\alpha$  is an amplitude for the sine function,  $\omega$  is the frequency,  $T_i$  is a time variable, and  $\phi$  is the phase. This sinusoidal model can be fit using non-linear least squares.

To obtain a good fit, sinusoidal models require good starting values for C, the amplitude, and the frequency.

Good Starting Value for C

A good starting value for C can be obtained by calculating the mean of the data. If the data show a trend, i.e., the assumption of constant location is violated, we can replace C with a <u>linear or quadratic least squares</u> fit. That is, the model becomes

$$Y_i = (B_0 + B_1 * T_i) + \alpha \sin(2\pi\omega T_i + \phi) + E_i$$

or

$$Y_i = (B_0 + B_1 * T_i + B2 * T_i^2) + \alpha \sin(2\pi\omega T_i + \phi) + E_i$$

Since our data did not have any meaningful change of location, we can fit the simpler model with C equal to the mean. From the summary output in the previous page, the mean is -177.44.


Good Starting Value for Frequency The starting value for the frequency can be obtained from the <u>spectral</u> <u>plot</u>, which shows the dominant frequency is about 0.3.

Complex
Demodulation
Phase Plot

The <u>complex demodulation phase plot</u> can be used to refine this initial estimate for the frequency.

For the complex demodulation plot, if the lines slope from left to right, the frequency should be increased. If the lines slope from right to left, it should be decreased. A relatively flat (i.e., horizontal) slope indicates a good frequency. We could generate the demodulation phase plot for 0.3 and then use trial and error to obtain a better estimate for the frequency. To simplify this, we generate 16 of these plots on a single page starting

with a frequency of 0.28, increasing in increments of 0.0025, and stopping at 0.3175.

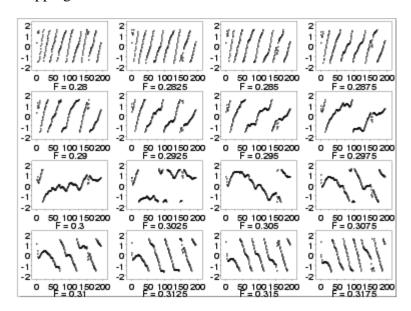

Interpretation


The plots start with lines sloping from left to right but gradually change to a right to left slope. The relatively flat slope occurs for frequency 0.3025 (third row, second column). The complex demodulation phase plot restricts the range from  $\pi/2$  to  $-\pi/2$ . This is why the plot appears to show some breaks.

Good Starting Values for Amplitude The complex demodulation amplitude plot is used to find a good starting value for the amplitude. In addition, this plot indicates whether or not the amplitude is constant over the entire range of the data or if it varies. If the plot is essentially flat, i.e., zero slope, then it is reasonable to assume a constant amplitude in the non-linear model. However, if the slope varies over the range of the plot, we may need to adjust the model to be:

$$Y_i = C + (B_0 + B_1 * T_i) \sin(2\pi\omega T_i + \phi) + E_i$$

That is, we replace  $\alpha$  with a function of time. A linear fit is specified in the model above, but this can be replaced with a more elaborate function if needed.

Complex
Demodulation
Amplitude
Plot

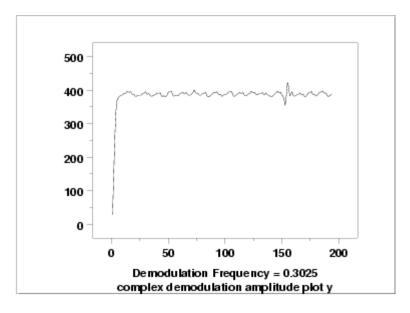

The complex demodulation amplitude plot for this data shows that:

- 1. The amplitude is fixed at approximately 390.
- 2. There is a short start-up effect.
- 3. There is a change in amplitude at around x=160 that should be investigated for an outlier.

In terms of a non-linear model, the plot indicates that fitting a single constant for  $\alpha$  should be adequate for this data set.

Fit Results

Using starting estimates of 0.3025 for the frequency, 390 for the amplitude, and -177.44 for C, the following parameters were estimated.

Coefficient	Estimate	Stan. Error	t-Value
C	-178.786	11.02	-16.22
AMP	-361.766	26.19	-13.81
FREQ	0.302596	0.1510E-03	2005.00
PHASE	1.46536	0.4909E-01	29.85
- '1 7 ~.		155 0404	

Residual Standard Deviation = 155.8484 Residual Degrees of Freedom = 196

Model

From the fit results, our proposed model is:

$$\hat{Y}_i = -178.786 - 361.766[2\pi(0.302596)T_i + 1.46536]$$

We will evaluate the adequacy of this model in the next section.



HOME

TOOLS & AIDS


SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.5. Beam Deflections

## 1.4.2.5.4. Validate New Model

4-Plot of Residuals

The first step in <u>evaluating the fit</u> is to generate a <u>4-plot</u> of the residuals.

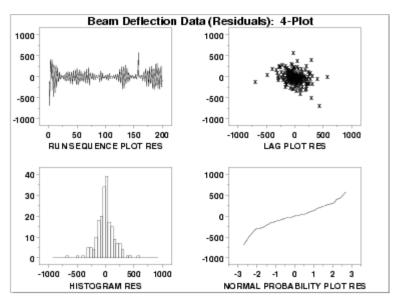

*Interpretation* The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location. There does seem to be some shifts in scale. A start-up effect was detected previously by the complex demodulation amplitude plot. There does appear to be a few outliers.
- 2. The <u>lag plot</u> (upper right) shows that the data are random. The outliers also appear in the lag plot.
- 3. The <u>histogram</u> (lower left) and the <u>normal probability plot</u> (lower right) do not show any serious non-normality in the residuals. However, the bend in the left portion of the normal probability plot shows some cause for concern.

The 4-plot indicates that this fit is reasonably good. However, we will attempt to improve the fit by removing the outliers.

Fit Results with Outliers Removed

The following parameter estimates were obtained after removing three outliers.

Coefficient Estimate Stan. Error t-Value

C AMP FREQ PHASE	-178.788 -361.759 0.302597 1.46533	10.57 25.45 0.1457E-03 0.4715E-01	2	-16.91 -14.22 2077.00 31.08
	Standard Deviation			

New Fit to Edited Data The original fit, with a residual standard deviation of 155.84, was:


$$\hat{Y}_i = -178.786 - 361.766[2\pi(0.302596)T_i + 1.46536]$$

The new fit, with a residual standard deviation of 148.34, is:

$$\hat{Y}_i = -178.788 - 361.759[2\pi(0.302597)T_i + 1.46533]$$

There is minimal change in the parameter estimates and about a 5 % reduction in the residual standard deviation. In this case, removing the residuals has a modest benefit in terms of reducing the variability of the model.

4-Plot for New Fit

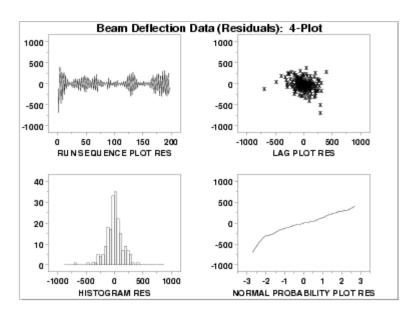

This plot shows that the underlying assumptions are satisfied and therefore the new fit is a good descriptor of the data.

In this case, it is a judgment call whether to use the fit with or without the outliers removed.



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.5. Beam Deflections

## **1.4.2.5.5.** Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions	
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.	
1. Invoke Dataplot and read data.		
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.	
2. Validate assumptions.		
1. 4-plot of Y.	1. Based on the 4- plot, there are no obvious shifts in location and scale, but the data are	
2. Generate a run sequence plot.  3. Generate a lag plot.	not random.  2. Based on the run sequence plot, there are no obvious shifts in location and	

scale. Based on the lag plot, the data are not random. Generate an autocorrelation plot. 4. The autocorrelation plot shows significant 5. Generate a spectral plot. <u>autocorrelation at</u> <u>laq 1.</u> 5. The spectral plot shows a single Generate a table of summary dominant statistics. low frequency peak. 6. The summary Generate a linear fit to detect statistics table drift in location. <u>displays</u> 25+ statistics. The linear fit indicates no drift in 8. Detect drift in variation by location since the slope parameter dividing the data into quarters <u>and</u> is not computing Levene's test statistic statistically for significant. equal standard deviations. 8. Levene's test indicates no significant drift in variation. Check for randomness by generating a runs test. 9. The runs test indicates significant non-randomness. 3. Fit  $Y_i = C + A*SIN(2*PI*omega*t_i+phi).$ 1. Complex demodulation phase Generate a complex demodulation plot phase plot. <u>indicates a</u> starting frequency of 0.3025. Generate a complex demodulation amplitude plot. 2. Complex demodulation amplitude plot indicates an 3. Fit the non-linear model. amplitude of 390 (but there is a short start-up effect). 3. Non-linear fit generates final parameter estimates. residual standard deviation from the fit is 155.85 (compared to the standard deviation of 277.73 from the original <u>data).</u>

4. Validate fit.	
1. Generate a 4-plot of the residuals from the fit.	1. The 4-plot indicates that the assumptions of constant location and scale are valid. The lag plot indicates that the data are random. The histogram and normal
2. Generate a nonlinear fit with outliers removed.	probability plot indicate that the residuals that the normality assumption for the
3. Generate a 4-plot of the residuals from the fit with the outliers removed.	residuals are not seriously violated, although there is a bend on the probablity plot that warrants attention.
	2. The fit after removing 3 outliers shows some marginal improvement in the model (a 5% reduction in the residual standard deviation).
	3. The 4-plot of the model fit after 3 outliers removed shows marginal improvement in satisfying model assumptions.
NIST SEMATECH HOME TOOLS & AIDS SEA	RCH BACK NEXT



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

## 1.4.2.6. Filter Transmittance

Filter **Transmittance**  This example illustrates the univariate analysis of filter transmittance data.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.6. Filter Transmittance

# 1.4.2.6.1. Background and Data

#### Generation

This data set was collected by NIST chemist Radu Mavrodineaunu in the 1970's from an automatic data acquisition system for a filter transmittance experiment. The response variable is transmittance.

The motivation for studying this data set is to show how the underlying autocorrelation structure in a relatively small data set helped the scientist detect problems with his automatic data acquisition system.

Software

The analyses used in this case study can be generated using both <u>Dataplot code</u> and <u>R code</u>.

Data

The following are the data used for this case study.

2.00180 2.00170 2.00180 2.00190 2.00180 2.00170 2.00150 2.00140 2.00150 2.00150 2.00170 2.00180 2.00180 2.00190 2.00190 2.00210 2.00200 2.00160 2.00140 2.00130

2.00150 2.00150 2.00160 2.00150 2.00140 2.00130 2.00140 2.00150

2.00130

2.00160 2.00150 2.00160 2.00190 2.00200 2.00200 2.00210 2.00220 2.00230 2.00240 2.00250 2.00270 2.00260 2.00260 2.00270 2.00260 2.00250 2.00250 2.00240

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.6. Filter Transmittance

# 1.4.2.6.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location; and
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

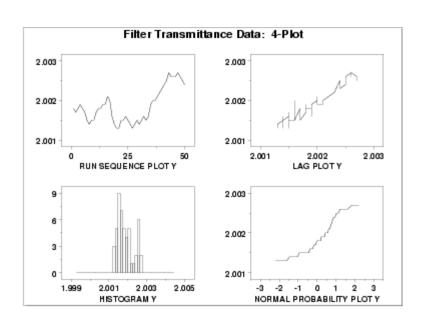

Interpretation

The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates a significant shift in location around x=35.
- 2. The linear appearance in the <u>lag plot</u> (upper right) indicates a non-random pattern in the data.
- 3. Since the lag plot indicates significant non-randomness, we do not make any interpretation of either the <a href="histogram">histogram</a> (lower left) or the <a href="hormal">normal</a> probability plot (lower right).

The serious violation of the non-randomness assumption means that the univariate model

$$Y_i = C + E_i$$

is not valid. Given the linear appearance of the lag plot, the first step might be to consider a model of the type


$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

However, in this case discussions with the scientist revealed that non-randomness was entirely unexpected. An examination of the experimental process revealed that the sampling rate for the automatic data acquisition system was too fast. That is, the equipment did not have sufficient time to reset before the next sample started, resulting in the current measurement being contaminated by the previous measurement. The solution was to rerun the experiment allowing more time between samples.


Simple graphical techniques can be quite effective in revealing unexpected results in the data. When this occurs, it is important to investigate whether the unexpected result is due to problems in the experiment and data collection or is indicative of unexpected underlying structure in the data. This determination cannot be made on the basis of statistics alone. The role of the graphical and statistical analysis is to detect problems or unexpected results in the data. Resolving the issues requires the knowledge of the scientist or engineer.

Individual Plots Although it is generally unnecessary, the plots can be generated individually to give more detail. Since the lag plot indicates significant non-randomness, we omit the distributional plots.

Run Sequence Plot

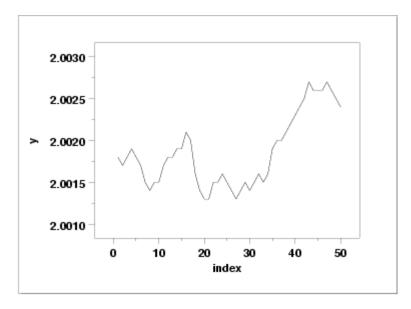



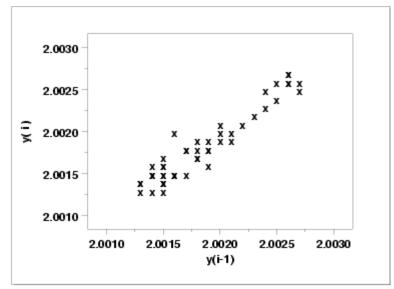



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.6. Filter Transmittance

# **1.4.2.6.3.** Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics are computed from the data.

Sample size = 50
Mean = 2.0019
Median = 2.0018
Minimum = 2.0013
Maximum = 2.0027
Range = 0.0014
Stan. Dev. = 0.0004

Location

One way to quantify a change in location over time is to <u>fit</u> a <u>straight line</u> to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

Coeffi	cient	Estimate	Stan.	Error
t-Value B <sub>0</sub>		2.00138	0.96	95E-04
0.2064E+05 B <sub>1</sub>	C	).185E-04	0.33	09E-05
5.582				
Residu	al Standar	d Deviation	= 0.33	76404E-0

The slope parameter,  $B_1$ , has a <u>t value</u> of 5.582, which is statistically significant. Although the estimated slope, 0.185E-04, is nearly zero, the range of data (2.0013 to 2.0027) is also very small. In this case, we conclude that there is drift in location, although it is relatively small.

Residual Degrees of Freedom = 48

Variation

One simple way to detect a change in variation is with a <u>Bartlett test</u> after dividing the data set into several equal sized intervals. However, the Bartlett test is not robust for non-normality. Since the normality assumption is questionable for these data, we use the alternative <u>Levene test</u>. In particular, we use the Levene test based on the median rather the mean. The choice of the number of intervals is somewhat arbitrary, although values of four or

eight are reasonable. We will divide our data into four intervals.

```
H_0: {\sigma_1}^2 = {\sigma_2}^2 = {\sigma_3}^2 = {\sigma_4}^2

H_a: At least one {\sigma_i}^2 is not equal to the others.
```


```
Test statistic: W = 0.971 Degrees of freedom: k - 1 = 3 Significance level: \alpha = 0.05 Critical value: F_{\alpha,k-1,N-k} = 2.806 Critical region: Reject H_0 if W > 2.806
```

In this case, since the Levene test statistic value of 0.971 is less than the critical value of 2.806 at the 5 % level, we conclude that there is no evidence of a change in variation.

Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests. The lag plot in the 4-plot in the previous seciton is a simple graphical technique.

One check is an autocorrelation plot that shows the <u>autocorrelations</u> for various lags. Confidence bands can be plotted at the 95 % and 99 % confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

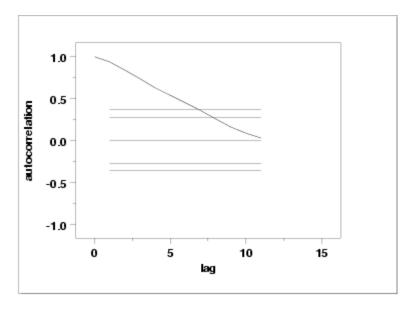

The lag 1 autocorrelation, which is generally the one of most interest, is 0.93. The critical values at the 5 % level are -0.277 and 0.277. This indicates that the lag 1 autocorrelation is statistically significant, so there is strong evidence of non-randomness.

A common test for randomness is the <u>runs test</u>.

```
$\rm H_0\colon$ the sequence was produced in a random manner $\rm H_a\colon$ the sequence was not produced in a random manner
```

Test statistic: Z = -5.3246

```
Significance level: \alpha = 0.05 Critical value: Z_{1-\alpha/2} = 1.96 Critical region: Reject H_0 if |Z| > 1.96
```

Because the test statistic is outside of the critical region, we reject the null hypothesis and conclude that the data are not random.

### Distributional Analysis

Since we rejected the randomness assumption, the distributional tests are not meaningful. Therefore, these quantitative tests are omitted. We also omit Grubbs' outlier test since it also assumes the data are approximately normally distributed.

#### Univariate Report

It is sometimes useful and convenient to summarize the above results in a report.

Analysis for filter transmittance data	
1: Sample Size	= 50
2: Location Mean 2.001857 Standard Deviation of Mean 0.00006 95% Confidence Interval for Mean (2.001735,2.001979) Drift with respect to location?	= = = = NO
3: Variation Standard Deviation 0.00043 95% Confidence Interval for SD (0.000359,0.000535) Change in variation? (based on Levene's test on quarters of the data)	= = = NO
4: Distribution Distributional tests omitted due to non-randomness of the data	
5: Randomness Lag One Autocorrelation 0.937998 Data are Random? (as measured by autocorrelation)	= = NO
6: Statistical Control   (i.e., no drift in location or scale,   data are random, distribution is   fixed, here we are testing only for   normal)   Data Set is in Statistical Control?	= NO
7: Outliers? (Grubbs' test omitted)	= NO



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.6. Filter Transmittance

# 1.4.2.6.4. Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions	
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.	
1. Invoke Dataplot and read data.		
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.	
2. 4-plot of the data.		
1. 4-plot of Y.	1. Based on the 4- plot, there is a shift in location and the data are not random.	
3. Generate the individual plots.		
1. Generate a run sequence plot.	_1. The run sequence	

2. Generate a lag plot.	plot indicates that there is a shift in location.  2. The strong linear pattern of the lag plot indicates significant non-randomness.
4. Generate summary statistics, quantitative analysis, and print a univariate report.  1. Generate a table of summary statistics.	1. The summary statistics table displays 25+ statistics.
2. Compute a linear fit based on quarters of the data to detect drift in location.  3. Compute Levene's test based on quarters of the data to detect changes in variation.	2. The linear fit indicates a slight drift in location since the slope parameter is statistically significant, but small.
4. Check for randomness by generating an autocorrelation plot and a runs test.	3. Levene's test indicates no significant drift in variation.
5. Print a univariate report (this assumes steps 2 thru 4 have already been run).	4. The lag 1 autocorrelation is 0.94. This is outside the 95% confidence interval bands which indicates significant non-randomness.
NIST	5. The results are summarized in a convenient report.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

## 1.4.2.7. Standard Resistor

Standard Resistor

This example illustrates the univariate analysis of standard resistor data.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.7. Standard Resistor

# 1.4.2.7.1. Background and Data

Generation This data set was collected by Ron Dziuba of NIST over a 5-

year period from 1980 to 1985. The response variable is

resistor values.

The motivation for studying this data set is to illustrate data that violate the assumptions of constant location and scale.

Software The analyses used in this case study can be generated using

both Dataplot code and R code.

Data The following are the data used for this case study.

27.8680

27.8929 27.8773

27.8530 27.8876

27.8725

27.8743

27.8879

27.8728

27.8746 27.8863

27.8716

27.8818

27.8872

27.8885

27.8945

27.8797

27.8627 27.8870

27.8895

27.9138

27.8931

27.8852

27.8788 27.8827

27.8939

27.8558

27.8814

27.8479 27.8479

27.8848

27.8809

27.8479

27.8611

27.8630

27.8679 27.8637

27.8985

27.8900

27.8577 27.8848

27.8869

27.8976

27.8610 27.8567 27.8417 27.8280 27.8555 27.8639 27.8702 27.8582 27.8605 27.8900 27.8758 27.8774 27.9008 27.8988 27.8897 27.8990 27.8958 27.8830 27.8967 27.9105 27.9028 27.8977 27.8953 27.8970 27.9190 27.9180 27.8997 27.9204 27.9234 27.9072 27.9152 27.9091 27.8882 27.9035 27.9267 27.9138 27.8955 27.9203 27.9239 27.9199 27.9646 27.9411 27.9345 27.8712 27.9145 27.9259 27.9317 27.9239 27.9247 27.9150 27.9444 27.9457 27.9166 27.9066 27.9088 27.9255 27.9312 27.9439 27.9210 27.9102 27.9083 27.9121 27.9113 27.9091 27.9235 27.9291 27.9253 27.9092 27.9117 27.9194 27.9039 27.9515 27.9143 27.9124 27.9128 27.9260 27.9339 27.9500 27.9530 27.9430 27.9400

27.8850 27.9350 27.9120 27.9260 27.9660 27.9280 27.9450 27.9390 27.9429 27.9207 27.9205 27.9204 27.9198 27.9246 27.9366 27.9234 27.9125 27.9032 27.9285 27.9561 27.9616 27.9530 27.9280 27.9060 27.9380 27.9310 27.9347 27.9339 27.9410 27.9397 27.9472 27.9235 27.9315 27.9368 27.9403 27.9529 27.9263 27.9347 27.9371 27.9129 27.9549 27.9422 27.9423 27.9750 27.9339 27.9629 27.9587 27.9503 27.9573 27.9518 27.9527 27.9589 27.9300 27.9629 27.9630 27.9660 27.9730 27.9660 27.9630 27.9570 27.9650 27.9520 27.9820 27.9560 27.9670 27.9520 27.9470 27.9720 27.9610 27.9437 27.9660 27.9580 27.9660 27.9700 27.9600 27.9660 27.9770 27.9110 27.9690 27.9698 27.9616

27.9371 27.9700 27.9265 27.9964 27.9842 27.9667 27.9610 27.9943 27.9616 27.9397 27.9799 28.0086 27.9709 27.9741 27.9675 27.9826 27.9676 27.9703 27.9789 27.9786 27.9722 27.9831 28.0043 27.9548 27.9875 27.9495 27.9549 27.9469 27.9744 27.9744 27.9449 27.9837 27.9585 28.0096 27.9762 27.9641 27.9854 27.9877 27.9839 27.9817 27.9845 27.9877 27.9880 27.9822 27.9836 28.0030 27.9678 28.0146 27.9945 27.9805 27.9785 27.9791 27.9817 27.9805 27.9782 27.9753 27.9792 27.9704 27.9794 27.9814 27.9794 27.9795 27.9881 27.9772 27.9796 27.9736 27.9772 27.9960 27.9795 27.9779 27.9829 27.9829 27.9815 27.9811 27.9773 27.9778 27.9724 27.9756 27.9699 27.9724 27.9666

27.9666 27.9739 27.9684 27.9861 27.9901 27.9879 27.9865 27.9876 27.9814 27.9842 27.9868 27.9834 27.9892 27.9864 27.9843 27.9838 27.9847 27.9860 27.9872 27.9869 27.9602 27.9852 27.9860 27.9836 27.9813 27.9623 27.9843 27.9802 27.9863 27.9813 27.9881 27.9850 27.9850 27.9830 27.9866 27.9888 27.9841 27.9863 27.9903 27.9961 27.9905 27.9945 27.9878 27.9929 27.9914 27.9914 27.9997 28.0006 27.9999 28.0004 28.0020 28.0029 28.0008 28.0040 28.0078 28.0065 27.9959 28.0073 28.0017 28.0042 28.0036 28.0055 28.0007 28.0066 28.0011 27.9960 28.0083 27.9978 28.0108 28.0088 28.0088 28.0139 28.0092 28.0092 28.0049 28.0111 28.0120 28.0093 28.0116 28.0102 28.0139

28.0113 28.0158 28.0156 28.0137 28.0236 28.0171 28.0224 28.0184 28.0199 28.0190 28.0204 28.0170 28.0183 28.0201 28.0182 28.0183 28.0175 28.0127 28.0211 28.0057 28.0180 28.0183 28.0149 28.0185 28.0182 28.0192 28.0213 28.0216 28.0169 28.0162 28.0167 28.0167 28.0169 28.0169 28.0161 28.0152 28.0179 28.0215 28.0194 28.0115 28.0174 28.0178 28.0202 28.0240 28.0198 28.0194 28.0171 28.0134 28.0121 28.0121 28.0141 28.0101 28.0114 28.0122 28.0124 28.0171 28.0165 28.0166 28.0159 28.0181 28.0200 28.0116 28.0144 28.0141 28.0116 28.0107 28.0169 28.0105 28.0136 28.0138 28.0114 28.0122 28.0122 28.0116 28.0025 28.0097 28.0066 28.0072 28.0066 28.0068 28.0067

28.0130 28.0091 28.0088 28.0091 28.0091 28.0115 28.0087 28.0128 28.0139 28.0095 28.0115 28.0101 28.0121 28.0114 28.0121 28.0122 28.0121 28.0168 28.0212 28.0219 28.0221 28.0204 28.0169 28.0141 28.0142 28.0147 28.0159 28.0165 28.0144 28.0182 28.0155 28.0155 28.0192 28.0204 28.0185 28.0248 28.0185 28.0226 28.0271 28.0290 28.0240 28.0302 28.0243 28.0288 28.0287 28.0301 28.0273 28.0313 28.0293 28.0300 28.0344 28.0308 28.0291 28.0287 28.0358 28.0309 28.0286 28.0308 28.0291 28.0380 28.0411 28.0420 28.0359 28.0368 28.0327 28.0361 28.0334 28.0300 28.0347 28.0359 28.0344 28.0370 28.0355 28.0371 28.0318 28.0390 28.0390 28.0390 28.0376 28.0376 28.0377

28.0345

28.0333 28.0429 28.0379 28.0401 28.0401 28.0423 28.0393 28.0382 28.0424 28.0386 28.0386 28.0373 28.0397 28.0412 28.0565 28.0419 28.0456 28.0426 28.0423 28.0391 28.0403 28.0388 28.0408 28.0457 28.0455 28.0460 28.0456 28.0464 28.0442 28.0416 28.0451 28.0432 28.0434 28.0448 28.0448 28.0373 28.0429 28.0392 28.0469 28.0443 28.0356 28.0474 28.0446 28.0348 28.0368 28.0418 28.0445 28.0533 28.0439 28.0474 28.0435 28.0419 28.0538 28.0538 28.0463 28.0491 28.0441 28.0411 28.0507 28.0459 28.0519 28.0554 28.0512 28.0507 28.0582 28.0471 28.0539 28.0530 28.0502 28.0422 28.0431 28.0395 28.0177 28.0425 28.0484 28.0693 28.0490 28.0453 28.0494 28.0522

28.0393 28.0443 28.0465 28.0450 28.0539 28.0566 28.0585 28.0486 28.0427 28.0548 28.0616 28.0298 28.0726 28.0695 28.0629 28.0503 28.0493 28.0537 28.0613 28.0643 28.0678 28.0564 28.0703 28.0647 28.0579 28.0630 28.0716 28.0586 28.0607 28.0601 28.0611 28.0606 28.0611 28.0066 28.0412 28.0558 28.0590 28.0750 28.0483 28.0599 28.0490 28.0499 28.0565 28.0612 28.0634 28.0627 28.0519 28.0551 28.0696 28.0581 28.0568 28.0572 28.0529 28.0421 28.0432 28.0211 28.0363 28.0436 28.0619 28.0573 28.0499 28.0340 28.0474 28.0534 28.0589 28.0466 28.0448 28.0576 28.0558 28.0522 28.0480 28.0444 28.0429 28.0624 28.0610 28.0461 28.0564 28.0734 28.0565 28.0503 28.0581

28.0519 28.0625 28.0583 28.0645 28.0642 28.0535 28.0510 28.0542 28.0677 28.0416 28.0676 28.0596 28.0635 28.0558 28.0623 28.0718 28.0585 28.0552 28.0684 28.0646 28.0590 28.0465 28.0594 28.0303 28.0533 28.0561 28.0585 28.0497 28.0582 28.0507 28.0562 28.0715 28.0468 28.0411 28.0587 28.0456 28.0705 28.0534 28.0558 28.0536 28.0552 28.0461 28.0598 28.0598 28.0650 28.0423 28.0442 28.0449 28.0660 28.0506 28.0655 28.0512 28.0407 28.0475 28.0411 28.0512 28.1036 28.0641 28.0572 28.0700 28.0577 28.0637 28.0534 28.0461 28.0701 28.0631 28.0575 28.0444 28.0592 28.0684 28.0593 28.0677 28.0512 28.0644 28.0660 28.0542 28.0768 28.0515 28.0579 28.0538 28.0526

28.0833 28.0637 28.0529 28.0535 28.0561 28.0736 28.0635 28.0600 28.0520 28.0695 28.0608 28.0608 28.0590 28.0290 28.0939 28.0618 28.0551 28.0757 28.0698 28.0717 28.0529 28.0644 28.0613 28.0759 28.0745 28.0736 28.0611 28.0732 28.0782 28.0682 28.0756 28.0857 28.0739 28.0840 28.0862 28.0724 28.0727 28.0752 28.0732 28.0703 28.0849 28.0795 28.0902 28.0874 28.0971 28.0638 28.0877 28.0751 28.0904 28.0971 28.0661 28.0711 28.0754 28.0516 28.0961 28.0689 28.1110 28.1062 28.0726 28.1141 28.0913 28.0982 28.0703 28.0654 28.0760 28.0727 28.0850 28.0877 28.0967 28.1185 28.0945 28.0834 28.0764 28.1129 28.0797 28.0707 28.1008 28.0971 28.0826 28.0857 28.0984

28.0869 28.0795 28.0875 28.1184 28.0746 28.0816 28.0879 28.0888 28.0924 28.0979 28.0702 28.0847 28.0917 28.0834 28.0823 28.0917 28.0779 28.0852 28.0863 28.0942 28.0801 28.0817 28.0922 28.0914 28.0868 28.0832 28.0881 28.0910 28.0886 28.0961 28.0857 28.0859 28.1086 28.0838 28.0921 28.0945 28.0839 28.0877 28.0803 28.0928 28.0885 28.0940 28.0856 28.0849 28.0955 28.0955 28.0846 28.0871 28.0872 28.0917 28.0931 28.0865 28.0900 28.0915 28.0963 28.0917 28.0950 28.0898 28.0902 28.0867 28.0843 28.0939 28.0902 28.0911 28.0909 28.0949 28.0867 28.0932 28.0891 28.0932 28.0887 28.0925 28.0928 28.0883 28.0946 28.0977 28.0914 28.0959 28.0926 28.0923 28.0950

28.1006 28.0924 28.0963 28.0893 28.0956 28.0980 28.0928 28.0951 28.0958 28.0912 28.0990 28.0915 28.0957 28.0976 28.0888 28.0928 28.0910 28.0902 28.0950 28.0995 28.0965 28.0972 28.0963 28.0946 28.0942 28.0998 28.0911 28.1043 28.1002 28.0991 28.0959 28.0996 28.0926 28.1002 28.0961 28.0983 28.0997 28.0959 28.0988 28.1029 28.0989 28.1000 28.0944 28.0979 28.1005 28.1012 28.1013 28.0999 28.0991 28.1059 28.0961 28.0981 28.1045 28.1047 28.1042 28.1146 28.1113 28.1051 28.1065 28.1065 28.0985 28.1000 28.1066 28.1041 28.0954 28.1090



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.7. Standard Resistor

# 1.4.2.7.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location;
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

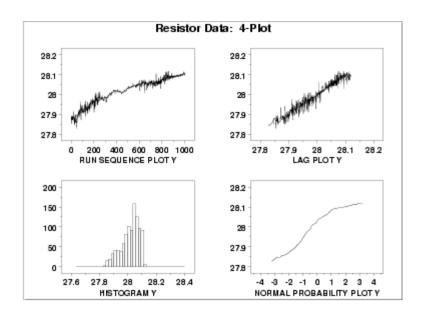

*Interpretation* 

The assumptions are addressed by the graphics shown above:

- 1. The <u>run sequence plot</u> (upper left) indicates significant shifts in both location and variation. Specifically, the location is increasing with time. The variability seems greater in the first and last third of the data than it does in the middle third.
- 2. The <u>lag plot</u> (upper right) shows a significant non-random pattern in the data. Specifically, the strong linear appearance of this plot is indicative of a model that relates  $Y_t$  to  $Y_{t-1}$ .
- 3. The distributional plots, the <u>histogram</u> (lower left) and the <u>normal probability plot</u> (lower right), are not interpreted since the randomness assumption is so clearly violated.

The serious violation of the non-randomness assumption means that the univariate model

$$Y_i = C + E_i$$

is not valid. Given the linear appearance of the lag plot, the first step might be to consider a model of the type

$$Y_i = A_0 + A_1 * Y_{i-1} + E_i$$

However, discussions with the scientist revealed the following:

- 1. the drift with respect to location was expected.
- 2. the non-constant variability was not expected.


The scientist examined the data collection device and determined that the non-constant variation was a seasonal effect. The high variability data in the first and last thirds was collected in winter while the more stable middle third was collected in the summer. The seasonal effect was determined to be caused by the amount of humidity affecting the measurement equipment. In this case, the solution was to modify the test equipment to be less sensitive to environmental factors.

Simple graphical techniques can be quite effective in revealing unexpected results in the data. When this occurs, it is important to investigate whether the unexpected result is due to problems in the experiment and data collection, or is it in fact indicative of an unexpected underlying structure in the data. This determination cannot be made on the basis of statistics alone. The role of the graphical and statistical analysis is to detect problems or unexpected results in the data. Resolving the issues requires the knowledge of the


scientist or engineer.

Individual Plots Although it is generally unnecessary, the plots can be generated individually to give more detail. Since the lag plot indicates significant non-randomness, we omit the distributional plots.

Run Sequence Plot

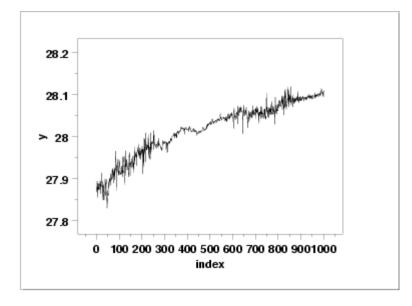

Lag Plot

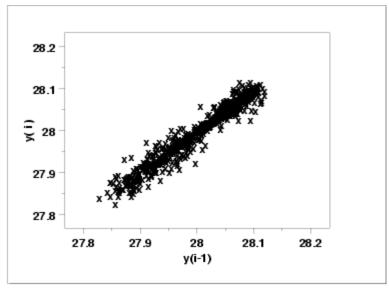



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.7. Standard Resistor

# 1.4.2.7.3. Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics are computed from the data.

Sample size = 1000
Mean = 28.01634
Median = 28.02910
Minimum = 27.82800
Maximum = 28.11850
Range = 0.29050
Stan. Dev. = 0.06349

Location

One way to quantify a change in location over time is to <u>fit</u> a <u>straight line</u> to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

```
Coefficient Estimate Stan. Error t\text{-Value}
B_0 \qquad 27.9114 \qquad 0.1209\text{E}-02
0.2309\text{E}+05
B_1 \qquad 0.20967\text{E}-03 \qquad 0.2092\text{E}-05
100.2
Residual Standard Deviation = 0.1909796\text{E}-01
Residual Degrees of Freedom = 998
```

The slope parameter,  $B_1$ , has a <u>t value</u> of 100.2 which is statistically significant. The value of the slope parameter estimate is 0.00021. Although this number is nearly zero, we need to take into account that the original scale of the data is from about 27.8 to 28.2. In this case, we conclude that there is a drift in location.

Variation

One simple way to detect a change in variation is with a Bartlett test after dividing the data set into several equal-sized intervals. However, the Bartlett test is not robust for non-normality. Since the normality assumption is questionable for these data, we use the alternative Levene test. In particular, we use the Levene test based on the median rather the mean. The choice of the number of

intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.


```
Test statistic: W = 140.85 Degrees of freedom: k-1=3 Significance level: \alpha=0.05 Critical value: F_{\alpha,k-1,N-k}=2.614 Critical region: Reject H_0 if W>2.614
```

In this case, since the Levene test statistic value of 140.85 is greater than the 5 % significance level critical value of 2.614, we conclude that there is significant evidence of nonconstant variation.

#### Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests. The lag plot in the 4-plot in the previous section is a simple graphical technique.

One check is an autocorrelation plot that shows the <u>autocorrelations</u> for various lags. Confidence bands can be plotted at the 95 % and 99 % confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

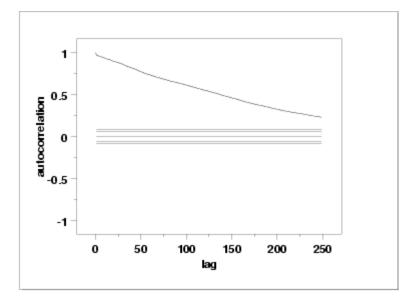

The lag 1 autocorrelation, which is generally the one of greatest interest, is 0.97. The critical values at the 5 % significance level are -0.062 and 0.062. This indicates that the lag 1 autocorrelation is statistically significant, so there is strong evidence of non-randomness.

A common test for <u>randomness</u> is the runs test.

```
\mbox{H}_0\colon the sequence was produced in a random manner \mbox{H}_a\colon the sequence was not produced in a
```

random manner

```
Test statistic: Z=-30.5629 Significance level: \alpha=0.05 Critical value: Z_{1-\alpha/2}=1.96 Critical region: Reject H<sub>0</sub> if |Z|>1.96
```

Because the test statistic is outside of the critical region, we reject the null hypothesis and conclude that the data are not random.

#### Distributional Analysis

Since we rejected the randomness assumption, the distributional tests are not meaningful. Therefore, these quantitative tests are omitted. Since the Grubbs' test for outliers also assumes the approximate normality of the data, we omit Grubbs' test as well.

#### Univariate Report

It is sometimes useful and convenient to summarize the above results in a report.

Analysis for resistor case study 1: Sample Size = 10002: Location Mean 28.01635 Standard Deviation of Mean 0.002008 95% Confidence Interval for Mean (28.0124,28.02029) Drift with respect to location? = NO3: Variation Standard Deviation 0.063495 95% Confidence Interval for SD (0.060829, 0.066407)Change in variation? (based on Levene's test on quarters of the data) = YES 4: Randomness Autocorrelation 0.972158 Data Are Random? (as measured by autocorrelation) = NO 5: Distribution Distributional test omitted due to non-randomness of the data 6: Statistical Control (i.e., no drift in location or scale, data are random, distribution is fixed) Data Set is in Statistical Control? = NO 7: Outliers? (Grubbs' test omitted due to non-randomness of the data)



HOME

TOOLS & AIDS

SEARCH



TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.7. Standard Resistor

# 1.4.2.7.4. Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions	
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.  NOTE: This case study has 1,000 points. For better performance, it is highly recommended that you check the "No Update" box on the Spreadsheet window for this case study. This will suppress subsequent updating of the Spreadsheet window as the data are created or modified.	The links in this column will connect you with more detailed information about each analysis step from the case study description.	
1. Invoke Dataplot and read data.		
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.	
2. 4-plot of the data.		
1. 4-plot of Y.	1. Based on the 4-plot, there are shifts	

	in location and variation and the data are not random.
3. Generate the individual plots.  1. Generate a run sequence plot.  2. Generate a lag plot.	1. The run sequence plot indicates that there are shifts of location and variation.  2. The lag plot shows a strong linear pattern, which indicates significant non-randomness.
4. Generate summary statistics, quantitative analysis, and print a univariate report.  1. Generate a table of summary statistics.  2. Generate the sample mean, a confidence interval for the population mean, and compute a linear fit to detect drift in location.	1. The summary statistics table displays 25+ statistics.  2. The mean is 28.0163 and a 95% confidence interval is (28.0124,28.02029). The linear fit indicates drift in location since
3. Generate the sample standard deviation,	the slope parameter estimate is statistically significant.  3. The standard deviation is 0.0635 with a 95% confidence interval of (0.060829,0.066407). Levene's test indicates significant change in variation.
	4. The lag 1 autocorrelation is 0.97. From the autocorrelation plot, this is outside the 95% confidence interval bands, indicating significant non- randomness.  5. The results are

Summarized in a convenient report.

NIST
SEMATECH HOME TOOLS & AIDS SEARCH BACK NEXT



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

### **1.4.2.8.** Heat Flow Meter 1

Heat Flow Meter Calibration and Stability

This example illustrates the univariate analysis of standard resistor data.

- 1. Background and Data
- 2. Graphical Output and Interpretation
- 3. Quantitative Output and Interpretation
- 4. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.8. <u>Heat Flow Meter 1</u>

### 1.4.2.8.1. Background and Data

Generation This data set was collected by Bob Zarr of NIST in January,

1990 from a heat flow meter calibration and stability analysis.

The response variable is a calibration factor.

The motivation for studying this data set is to illustrate a well-behaved process where the underlying assumptions hold and the process is in statistical control.

the process is in statistical control.

Software The analyses used in this case study can be generated using

both Dataplot code and R code.

Data The following are the data used for this case study.

- 9.206343
- 9.299992
- 9.299992
- 9.305795
- 9.275351
- 9.288729
- 9.287239
- 9.260973
- 9.303111
- 9.275674
- 9.272561 9.288454
- 9.255672
- 9.252141
- 9.297670
- 9.266534 9.256689
- 9.277542
- 9.248205
- 9.252107
- 9.276345
- 9.278694
- 9.267144
- 9.246132 9.238479
- 9.269058
- 9.248239
- 9.257439
- 9.268481
- 9.288454
- 9.258452
- 9.286130 9.251479
- 9.257405
- 9.268343
- 9.291302 9.219460
- 9.270386
- 9.218808
- 9.241185
- 9.269989
- 9.226585

9.258556 9.286184 9.320067 9.327973 9.262963 9.248181 9.238644 9.225073 9.220878 9.271318 9.252072 9.281186 9.270624 9.294771 9.301821 9.278849 9.236680 9.233988 9.244687 9.221601 9.207325 9.258776 9.275708 9.268955 9.257269 9.264979 9.295500 9.292883 9.264188 9.280731 9.267336 9.300566 9.253089 9.261376 9.238409 9.225073 9.235526 9.239510 9.264487 9.244242 9.277542 9.310506 9.261594 9.259791 9.253089 9.245735 9.284058 9.251122 9.275385 9.254619 9.279526 9.275065 9.261952 9.275351 9.252433 9.230263 9.255150 9.268780 9.290389 9.274161 9.255707 9.261663 9.250455 9.261952 9.264041 9.264509 9.242114 9.239674 9.221553 9.241935 9.215265 9.285930 9.271559 9.266046 9.285299 9.268989 9.267987 9.246166 9.231304

9.240768 9.260506 9.274355 9.292376 9.271170 9.267018 9.308838 9.264153 9.278822 9.255244 9.229221 9.253158 9.256292 9.262602 9.219793 9.258452 9.267987 9.267987 9.248903 9.235153 9.242933 9.253453 9.262671 9.242536 9.260803 9.259825 9.253123 9.240803 9.238712 9.263676 9.243002 9.246826 9.252107 9.261663 9.247311 9.306055 9.237646 9.248937 9.256689 9.265777 9.299047 9.244814 9.287205 9.300566 9.256621 9.271318 9.275154 9.281834 9.253158 9.269024 9.282077 9.277507 9.284910 9.239840 9.268344 9.247778 9.225039 9.230750 9.270024 9.265095 9.284308 9.280697 9.263032 9.291851 9.252072 9.244031 9.283269 9.196848 9.231372 9.232963 9.234956 9.216746 9.274107 9.273776



HOME

TOOLS & AIDS

SEARCH



### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.8. Heat Flow Meter 1

### 1.4.2.8.2. Graphical Output and Interpretation

Goal

The goal of this analysis is threefold:

1. Determine if the univariate model:

$$Y_i = C + E_i$$


is appropriate and valid.

- 2. Determine if the typical underlying assumptions for an "in control" measurement process are valid. These assumptions are:
  - 1. random drawings;
  - 2. from a fixed distribution;
  - 3. with the distribution having a fixed location; and
  - 4. the distribution having a fixed scale.
- 3. Determine if the confidence interval

$$\bar{Y} \pm 2s/\sqrt{N}$$

is appropriate and valid where s is the standard deviation of the original data.

4-Plot of Data

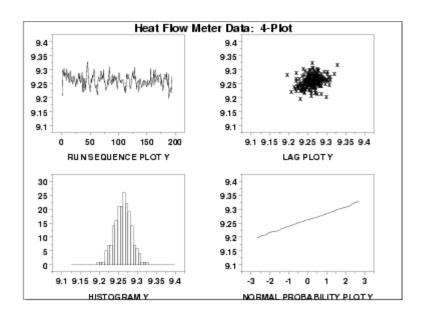


Interpretation

The assumptions are addressed by the graphics shown above:


- 1. The <u>run sequence plot</u> (upper left) indicates that the data do not have any significant shifts in location or scale over time.
- 2. The <u>lag plot</u> (upper right) does not indicate any non-random pattern in the data.
- 3. The <u>histogram</u> (lower left) shows that the data are reasonably symmetric, there does not appear to be significant outliers in the tails, and it seems reasonable to assume that the data are from approximately a normal distribution.
- 4. The <u>normal probability plot</u> (lower right) verifies that an assumption of normality is in fact reasonable.

Individual Plots Although it is generally unnecessary, the plots can be generated individually to give more detail.


Run Sequence Plot

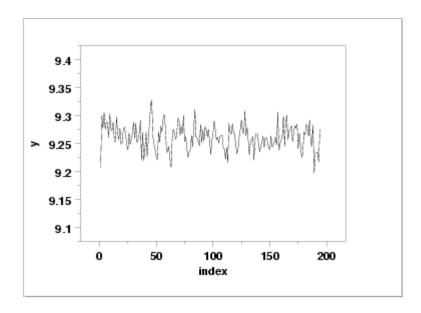


Lag Plot

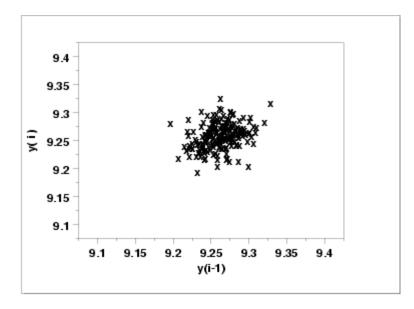

Histogram (with overlaid Normal PDF)

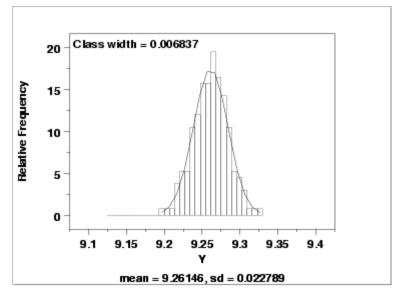

Normal Probability Plot

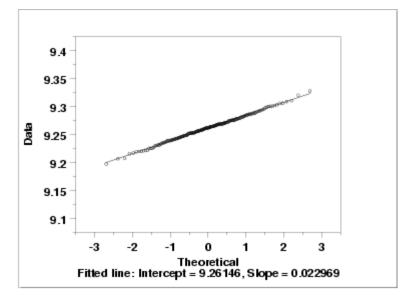



HOME

TOOLS & AIDS

SEARCH



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.8. Heat Flow Meter 1

# 1.4.2.8.3. Quantitative Output and Interpretation

Summary Statistics As a first step in the analysis, common summary statistics are computed from the data.

Sample size = 195
Mean = 9.261460
Median = 9.261952
Minimum = 9.196848
Maximum = 9.327973
Range = 0.131126
Stan. Dev. = 0.022789

Location

One way to quantify a change in location over time is to <u>fit</u> a <u>straight line</u> to the data using an index variable as the independent variable in the regression. For our data, we assume that data are in sequential run order and that the data were collected at equally spaced time intervals. In our regression, we use the index variable X = 1, 2, ..., N, where N is the number of observations. If there is no significant drift in the location over time, the slope parameter should be zero.

	efficient	Estimate	Stan. Error
t-Value	Во	9.26699	0.3253E-02
2849.	B <sub>1</sub>	-0.56412E-04	0.2878E-04
-1.960			

Residual Standard Deviation = 0.2262372E-01 Residual Degrees of Freedom = 193

The slope parameter, B<sub>1</sub>, has a <u>t value</u> of -1.96 which is (barely) statistically significant since it is essentially equal to the 95 % level cutoff of -1.96. However, notice that the value of the slope parameter estimate is -0.00056. This slope, even though statistically significant, can essentially be considered zero.

Variation

One simple way to detect a change in variation is with a <u>Bartlett test</u> after dividing the data set into several equal-sized intervals. The choice of the number of intervals is somewhat arbitrary, although values of four or eight are reasonable. We will divide our data into four intervals.

2 2 2 2

```
H_0: \sigma_1 = \sigma_2 = \sigma_3 = \sigma_4
H_a: At least one {\sigma_i}^2 is not equal to the others.

Test statistic: T = 3.147
Degrees of freedom: k = 1 = 3
```

```
Test statistic: T = 3.147

Degrees of freedom: k - 1 = 3

Significance level: \alpha = 0.05

Critical value: X^2_{1-\alpha,k-1} = 7.815


Critical region: Reject H_0 if T > 7.815
```

In this case, since the Bartlett test statistic of 3.147 is less than the critical value at the 5 % significance level of 7.815, we conclude that the variances are not significantly different in the four intervals. That is, the assumption of constant scale is valid.

#### Randomness

There are many ways in which data can be non-random. However, most common forms of non-randomness can be detected with a few simple tests. The lag plot in the previous section is a simple graphical technique.

Another check is an autocorrelation plot that shows the <u>autocorrelations</u> for various lags. Confidence bands can be plotted at the 95 % and 99 % confidence levels. Points outside this band indicate statistically significant values (lag 0 is always 1).

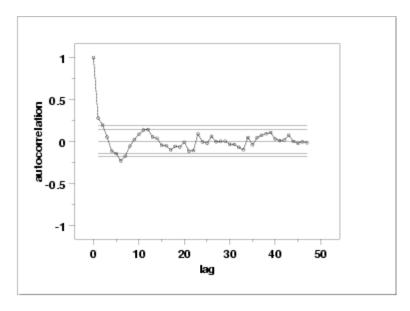

The lag 1 autocorrelation, which is generally the one of greatest interest, is 0.281. The critical values at the 5 % significance level are -0.087 and 0.087. This indicates that the lag 1 autocorrelation is statistically significant, so there is evidence of non-randomness.

A common test for randomness is the <u>runs test</u>.

```
H<sub>0</sub>: the sequence was produced in a random manner

H<sub>a</sub>: the sequence was not produced in a random manner

Test statistic: Z = -3.2306
Significance level: \alpha = 0.05
```

```
Critical value: Z_{1-\alpha/2} = 1.96
Critical region: Reject H<sub>0</sub> if |Z| > 1.96
```

The value of the test statistic is less than -1.96, so we reject the null hypothesis at the 0.05 significant level and conclude that the data are not random.

Although the autocorrelation plot and the runs test indicate some mild non-randomness, the violation of the randomness assumption is not serious enough to warrant developing a more sophisticated model. It is common in practice that some of the assumptions are mildly violated and it is a judgement call as to whether or not the violations are serious enough to warrant developing a more sophisticated model for the data.

#### Distributional Analysis

<u>Probability plots</u> are a graphical test for assessing if a particular distribution provides an adequate fit to a data set.

A quantitative enhancement to the probability plot is the correlation coefficient of the points on the probability plot. For this data set the correlation coefficient is 0.996. Since this is greater than the critical value of 0.987 (this is a tabulated value), the normality assumption is not rejected.

<u>Chi-square</u> and <u>Kolmogorov-Smirnov</u> goodness-of-fit tests are alternative methods for assessing distributional adequacy. The <u>Wilk-Shapiro</u> and <u>Anderson-Darling</u> tests can be used to test for normality. The results of the Anderson-Darling test follow.

```
\rm H_0\colon the data are normally distributed \rm H_a\colon the data are not normally distributed Adjusted test statistic: A ^2 = 0.129 Significance level: \alpha = 0.05 Critical value: 0.787 Critical region: Reject \rm H_0 if A ^2 > 0.787
```

The Anderson-Darling test also does not reject the normality assumption because the test statistic, 0.129, is less than the critical value at the 5 % significance level of 0.787.

#### Outlier Analysis

A test for outliers is the **Grubbs'** test.

```
{\rm H_0:} there are no outliers in the data {\rm H_a:} the maximum value is an outlier 
Test statistic: G=2.918673 Significance level: \alpha=0.05 Critical value for an upper one-tailed test: 3.597898 Critical region: Reject {\rm H_0} if G>3.597898
```

For this data set, Grubbs' test does not detect any outliers at the 0.05 significance level.

Model

Since the underlying assumptions were validated both

graphically and analytically, with a mild violation of the randomness assumption, we conclude that a reasonable model for the data is:

$$Y_i = 9.26146 + E_i$$

We can express the uncertainty for C, here estimated by 9.26146, as the  $\frac{95 \%}{\text{confidence interval}}$  (9.258242,9.26479).

#### Univariate Report

It is sometimes useful and convenient to summarize the above results in a report. The report for the heat flow meter data follows.

Analysis for heat flow meter data	
1: Sample Size	= 195
2: Location Mean 9.26146 Standard Deviation of Mean 0.001632 95 % Confidence Interval for Mean (9.258242,9.264679) Drift with respect to location?	= = = = NO
3: Variation Standard Deviation 0.022789 95 % Confidence Interval for SD (0.02073,0.025307) Drift with respect to variation? (based on Bartlett's test on quarters of the data)	= = = NO
4: Randomness Autocorrelation 0.280579 Data are Random? (as measured by autocorrelation)	= = NO
5: Data are Normal? (as tested by Anderson-Darling)	= YES
6: Statistical Control   (i.e., no drift in location or scale,   data are random, distribution is   fixed, here we are testing only for   fixed normal)   Data Set is in Statistical Control?	= YES
7: Outliers? (as determined by Grubbs' test)	= NO



HOME

TOOLS & AIDS

SEARCH



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.8. <u>Heat Flow Meter 1</u>

### **1.4.2.8.4.** Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to repeat the analysis outlined in the case study description on the previous page using <a href="Dataplot">Dataplot</a>. It is required that you have already <a href="downloaded and installed">downloaded and installed</a>
Dataplot and <a href="configured your browser">configured your browser</a>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.
1. Invoke Dataplot and read data.	
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.
2. 4-plot of the data.	
1. 4-plot of Y.	1. Based on the 4- plot, there are no shifts in location or scale, and the data seem to follow a normal distribution.
3. Generate the individual plots.	

Generate a run sequence plot. The run sequence plot indicates that there are no shifts of location or 2. Generate a lag plot. scale. 2. The lag plot does not indicate any significant 3. Generate a histogram with an overlaid normal pdf. patterns (which would show the data were not random). Generate a normal probability 3. The histogram plot. indicates that a normal distribution is a good distribution for these data. 4. The normal probability plot verifies that the normal <u>distribution is a</u> reasonable distribution for these data. 4. Generate summary statistics, quantitative analysis, and print a univariate report. 1. The summary statistics table 1. Generate a table of summary <u>displays</u> statistics. 25+ statistics. Generate the mean, a confidence The mean is interval for the mean, and compute 9.261 and a 95% a linear fit to detect drift in confidence <u>interval is</u> (9.258,9.265) location. The linear fit <u>indicates no drift</u> 3. Generate the standard deviation, a location since the slope parameter confidence interval for the standard <u>estimate is</u> essentially zero. deviation, and detect drift in variation by dividing the data into quarters 3. The standard <u>and</u> computing Bartlett's test for deviation is 0.023 with equal a 95% confidence standard deviations. interval of (0.0207,0.0253) Bartlett's test Check for randomness by generating indicates no <u>an</u> autocorrelation plot and a runs significant <u>change i</u>n test. variation. 5. Check for normality by computing the 4. The lag 1 autocorrelation is normal probability plot 0.28. correlation coefficient. From the autocorrelation plot, <u>this</u> is statistically 6. Check for outliers using Grubbs' significant at the test. <u>95</u>% level.

Print a univariate report (this

5. The normal probability plot <u>assumes</u> steps 2 thru 6 have already been correlation run). coefficient is 0.999. At the 5% level, we cannot reject the normality assumption. 6. Grubbs' test detects no outliers at the 5% level. 7. The results are summarized in a convenient report. NIST

HOME

TOOLS & AIDS

SEARCH

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

### 1.4.2.9. Fatigue Life of Aluminum Alloy **Specimens**

Fatigue Life of Aluminum Alloy **Specimens**  This example illustrates the univariate analysis of the fatigue life of aluminum alloy specimens.

- 1. Background and Data
- 2. Graphical Output and Interpretation



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.9. Fatigue Life of Aluminum Alloy Specimens

### 1.4.2.9.1. Background and Data

#### Generation

This data set comprises measurements of fatigue life (thousands of cycles until rupture) of rectangular strips of 6061-T6 aluminum sheeting, subjected to periodic loading with maximum stress of 21,000 psi (pounds per square inch), as reported by Birnbaum and Saunders (1958).

#### Purpose of Analysis

The goal of this case study is to select a probabilistic model, from among several reasonable alternatives, to describe the dispersion of the resulting measured values of life-length.

The original study, in the field of statistical reliability analysis, was concerned with the prediction of failure times of a material subjected to a load varying in time. It was well-known that a structure designed to withstand a particular static load may fail sooner than expected under a dynamic load.

If a realistic model for the probability distribution of lifetime can be found, then it can be used to estimate the time by which a part or structure needs to be replaced to guarantee that the probability of failure does not exceed some maximum acceptable value, for example 0.1 %, while it is in service.

The chapter of this eHandbook that is concerned with the assessment of product reliability contains additional material on statistical methods used in reliability analysis. This case study is meant to complement that chapter by showing the use of graphical and other techniques in the model selection stage of such analysis.

When there is no cogent reason to adopt a particular model, or when none of the models under consideration seems adequate for the purpose, one may opt for a non-parametric statistical method, for example to produce tolerance bounds or confidence intervals.

A non-parametric method does not rely on the assumption that the data are like a sample from a particular probability distribution that is fully specified up to the values of some adjustable parameters. For example, the Gaussian probability distribution is a parametric model with two adjustable parameters.

The price to be paid when using non-parametric methods is loss of efficiency, meaning that they may require more data for statistical inference than a parametric counterpart would, if applicable. For example, non-parametric confidence intervals for model parameters may be considerably wider than what a confidence interval would need to be if the underlying distribution could be identified correctly. Such identification is what we will attempt in this case study.

It should be noted --- a point that we will stress later in the development of this case study --- that the very exercise of selecting a model often contributes substantially to the uncertainty of the conclusions derived after the selection has been made.

Software

The analyses used in this case study can be generated using R code.

Data

The following data are used for this case study.

```
370 1016 1235 1419 1567
                          1820
 706 1018 1238
                1420 1578 1868
 716 1020 1252
                1420
                     1594
                          1881
 746 1055 1258
                1450 1602 1890
 785 1085 1262 1452 1604 1893
          1269
 797 1102
                1475
                     1608
                           1895
 844 1102 1270
                     1630
                          1910
                1478
 855 1108 1290
                1481 1642 1923
 858 1115 1293
886 1120 1300
                     1674
                          1940
                1485
                1502
                     1730
                          1945
 886 1134 1310 1505 1750 2023
 930 1140 1313 1513 1750 2100
 960 1199
          1315
                1522
                     1763
                           2130
 988 1200 1330
                     1768
                1522
                          2215
 990 1200 1355 1530 1781 2268
1000 1203 1390 1540 1782 2440
1010 1222 1416 1560 1792
```



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.9. Fatigue Life of Aluminum Alloy Specimens


### 1.4.2.9.2. Graphical Output and Interpretation

Goal

The goal of this analysis is to select a probabilistic model to describe the dispersion of the measured values of fatigue life of specimens of an aluminum alloy described in [1.4.2.9.1], from among several reasonable alternatives.

Initial Plots of the Data

Simple diagrams can be very informative about location, spread, and to detect possibly anomalous data values or particular patterns (clustering, for example). These include dot-charts, boxplots, and histograms. Since building an effective histogram requires that a choice be made of bin size, and this choice can be influential, one may wish to examine a non-parametric estimate of the underlying probability density.

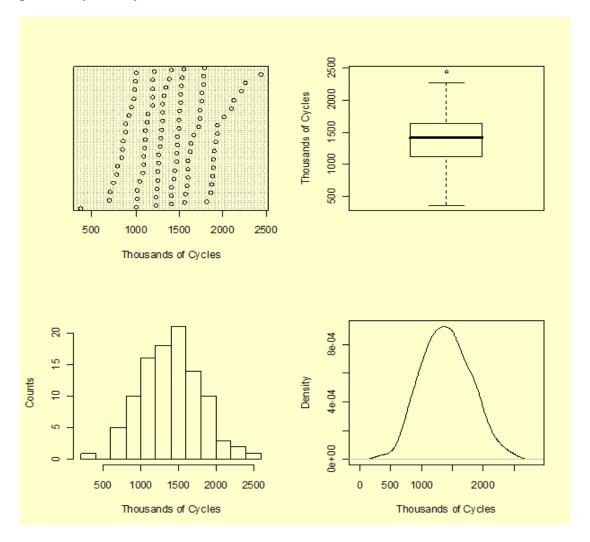


These several plots variously show that the measurements range from a value

slightly greater than 350,000 to slightly less than 2,500,000 cycles. The boxplot suggests that the largest measured value may be an outlier.

A recommended first step is to check consistency between the data and what is to be expected if the data were a sample from a particular probability distribution. Knowledge about the underlying properties of materials and of relevant industrial processes typically offer clues as to the models that should be entertained. Graphical diagnostic techniques can be very useful at this exploratory stage: foremost among these, for univariate data, is the quantile-quantile plot, or QQ-plot (Wilk and Gnanadesikan, 1968).


Each data point is represented by one point in the QQ-plot. The ordinate of each of these points is one data value; if this data value happens to be the kth order statistic in the sample (that is, the kth largest value), then the corresponding abscissa is the "typical" value that the kth largest value should have in a sample of the same size as the data, drawn from a particular distribution. If F denotes the cumulative probability distribution function of interest, and the sample comprises n values, then  $F^{-1}[(k-1/2)/(n+1/2)]$  is a reasonable choice for that "typical" value, because it is an approximation to the median of the kth order statistic in a sample of size n from this distribution.

The following figure shows a QQ-plot of our data relative to the Gaussian (or, normal) probability distribution. If the data matched expectations perfectly, then the points would all fall on a straight line.

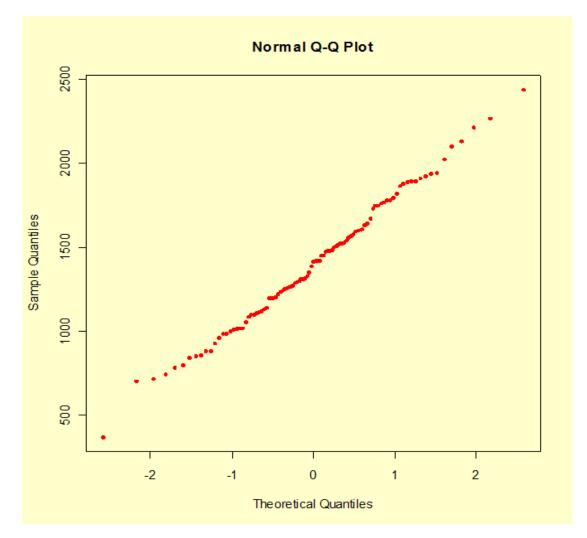

In practice, one needs to gauge whether the deviations from such perfect alignment are commensurate with the natural variability associated with sampling. This can easily be done by examining how variable QQ-plots of samples from the target distribution may be.

The following figure shows, superimposed on the QQ-plot of the data, the QQ-plots of 99 samples of the same size as the data, drawn from a Gaussian distribution with the same mean and standard deviation as the data.

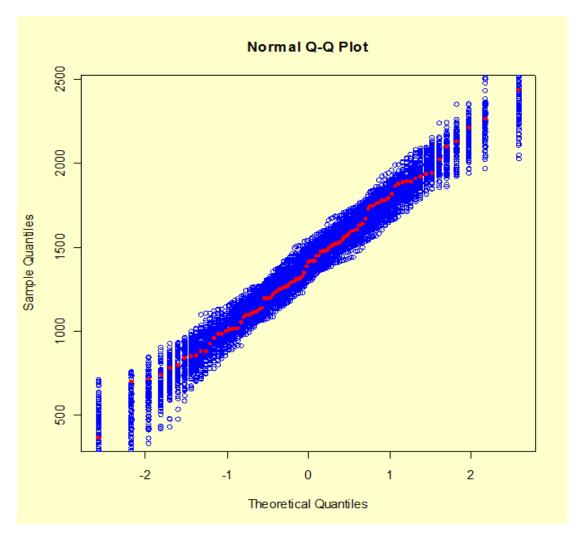

The fact that the cloud of QQ-plots corresponding to 99 samples from the Gaussian distribution effectively covers the QQ-plot for the data, suggests that the chances are better than 1 in 100 that our data are inconsistent with the Gaussian model.

This proves nothing, of course, because even the rarest of events may happen. However, it is commonly taken to be indicative of an acceptable fit for general purposes. In any case, one may naturally wonder if an alternative model might not provide an even better fit.

Knowing the provenance of the data, that they portray strength of a material, strongly suggests that one may like to examine alternative models, because in many studies of reliability non-Gaussian models tend to be more appropriate than Gaussian models.

Candidate Distributions There are many probability distributions that could reasonably be entertained as candidate models for the data. However, we will restrict ourselves to consideration

of the following because these have proven to be useful in reliability studies.

- Normal distribution
- Gamma distribution
- Birnbaum-Saunders distribution
- 3-parameter Weibull distribution


#### Approach

A very simple approach amounts to comparing QQ-plots of the data for the candidate models under consideration. This typically involves first fitting the models to the data, for example employing the method of maximum likelihood [1.3.6.5.2].


The maximum likelihood estimates are the following:

- Gaussian: mean 1401, standard deviation 389
- Gamma: shape 11.85, rate 0.00846
- Birnbaum-Saunders: shape 0.310, scale 1337
- 3-parameter Weibull: location 181, shape 3.43, scale 1357

The following figure shows how close (or how far) the best fitting probability densities of the four distributions approximate the non-parametric probability density estimate. This comparison, however, takes into account neither the fact that our sample is fairly small (101 measured values), nor that the fitted models themselves have been estimated from the same data that the non-parametric estimate was derived from.

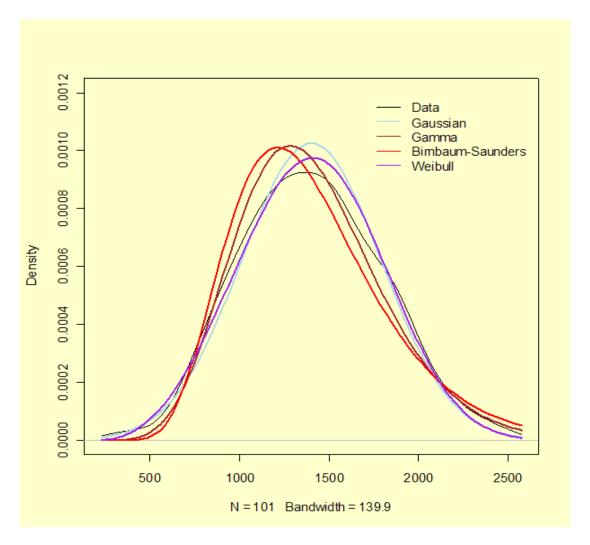

These limitations notwithstanding, it is worth examining the corresponding QQ-plots, shown below, which suggest that the Gaussian and the 3-parameter Weibull may be the best models.

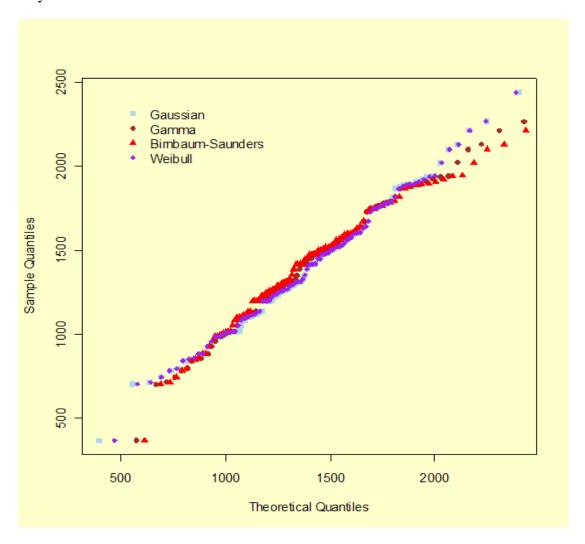

Model Selection A more careful comparison of the merits of the alternative models needs to take into account the fact that the 3-parameter Weibull model (precisely because it has three parameters), may be intrinsically more flexible than the others, which all have two adjustable parameters only.

Two criteria can be employed for a formal comparison: Akaike's Information Criterion (AIC), and the Bayesian Information Criterion (BIC) (Hastie et. al., 2001). The smaller the value of either model selection criterion, the better the model:

	AIC	BIC
GAU	1495	1501
GAM	1499	1504
BS	1507	1512
WEI	1498	1505

On this basis (and according both to AIC and BIC), there seems to be no cogent reason to replace the Gaussian model by any of the other three. The values of BIC can also be used to derive an approximate answer to the question of how strongly the data may support each of these models. Doing this involves the application of Bayesian statistical methods [8.1.10].

We start from an a priori assignment of equal probabilities to all four models,

indicating that we have no reason to favor one over another at the outset, and then update these probabilities based on the measured values of lifetime. The updated probabilities of the four models, called their posterior probabilities, are approximately proportional to exp(-BIC(GAU)/2), exp(-BIC(GAM)/2), exp(-BIC(BS)/2), and exp(-BIC(WEI)/2). The values are 76 % for GAU, 16 % for GAM, 0.27 % for BS, and 7.4 % for WEI.

One possible use for the selected model is to answer the question of the age in service by which a part or structure needs to be replaced to guarantee that the probability of failure does not exceed some maximum acceptable value, for example 0.1 %. The answer to this question is the 0.1st percentile of the fitted distribution, that is  $G^{-1}(0.001) = 198$  thousand cycles, where, in this case,  $G^{-1}$  denotes the inverse of the fitted, Gaussian probability distribution.

To assess the uncertainty of this estimate one may employ the statistical bootstrap [1.3.3.4]. In this case, this involves drawing a suitably large number of bootstrap samples from the data, and for each of them applying the model fitting and model selection exercise described above, ending with the calculation of  $G^{-1}$  (0.001) for the best model (which may vary from sample to sample).

The bootstrap samples should be of the same size as the data, with each being drawn uniformly at random from the data, with replacement. This process, based on 5,000 bootstrap samples, yielded a 95 % confidence interval for the 0.1st percentile ranging from 40 to 366 thousands of cycles. The large uncertainty is not surprising given that we are attempting to estimate the largest value that is exceeded with probability 99.9 %, based on a sample comprising only 101 measured values.

Prediction Intervals

One more application in this analysis is to evaluate prediction intervals for the fatigue life of the aluminum alloy specimens. For example, if we were to test three new specimens using the same process, we would want to know (with 95 % confidence) the minimum number of cycles for these three specimens. That is, we need to find a statistical interval  $[L, \infty]$  that contains the fatigue life of all three future specimens with 95 % confidence. The desired interval is a one-sided, lower 95 % prediction interval. Since tables of factors for constructing L, are widely available for normal models, we use the results corresponding to the normal model here for illustration. Specifically, L is computed as

$$L = \bar{x} + rs$$
  
 $L = 1400.91 - 2.16(391.32) = 555.66 \text{ cycles} \times 1000$ 

where factor r is given in Table A.14 of <u>Hahn and Meeker (1991)</u> or can be obtained from an R program.



HOME

TOOLS & AIDS

SEARCH



- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies

### 1.4.2.10. Ceramic Strength

Ceramic Strength

This case study analyzes the effect of machining factors on the strength of ceramics.

- 1. Background and Data
- 2. Analysis of the Response Variable
- 3. Analysis of Batch Effect
- 4. Analysis of Lab Effect
- 5. Analysis of Primary Factors
- 6. Work This Example Yourself



HOME

TOOLS & AIDS

SEARCH



#### ENGINEERING STATISTICS HANDBOOK

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.10. Ceramic Strength

### **1.4.2.10.1.** Background and Data

#### Generation

The data for this case study were collected by Said Jahanmir of the NIST Ceramics Division in 1996 in connection with a NIST/industry ceramics consortium for strength optimization of ceramic strength

The motivation for studying this data set is to illustrate the analysis of multiple factors from a designed experiment

This case study will utilize only a subset of a full study that was conducted by Lisa Gill and James Filliben of the NIST Statistical Engineering Division

The response variable is a measure of the strength of the ceramic material (bonded  $S_i$  nitrate). The complete data set contains the following variables:

- 1. Factor 1 = Observation ID, i.e., run number (1 to 960)
- 2. Factor 2 = Lab (1 to 8)
- 3. Factor 3 = Bar ID within lab (1 to 30)
- 4. Factor 4 = Test number (1 to 4)
- 5. Response Variable = Strength of Ceramic
- 6. Factor 5 = Table speed (2 levels: 0.025 and 0.125)
- 7. Factor 6 = Down feed rate (2 levels: 0.050 and 0.125)
- 8. Factor 7 = Wheel grit size (2 levels: 150 and 80)
- 9. Factor 8 = Direction (2 levels: longitudinal and transverse)
- 10. Factor 9 = Treatment (1 to 16)
- 11. Factor 10 = Set of 15 within lab (2 levels: 1 and 2)
- 12. Factor 11 = Replication (2 levels: 1 and 2)
- 13. Factor 12 = Bar Batch (1 and 2)

The four primary factors of interest are:

- 1. Table speed (X1)
- 2. Down feed rate (X2)
- 3. Wheel grit size (X3)
- 4. Direction (X4)

For this case study, we are using only half the data. Specifically, we are using the data with the direction longitudinal. Therefore, we have only three primary factors In addition, we are interested in the nuisance factors

- 1. Lab
- 2. Batch

## Purpose of Analysis

The goals of this case study are:

- 1. Determine which of the four primary factors has the strongest effect on the strength of the ceramic material
- 2. Estimate the magnitude of the effects
- 3. Determine the optimal settings for the primary factors
- 4. Determine if the nuisance factors (lab and batch) have an effect on the ceramic strength

This case study is an example of a designed experiment. The Process Improvement chapter contains a detailed discussion of the construction and analysis of designed experiments. This case study is meant to complement the material in that chapter by showing how an EDA approach (emphasizing the use of graphical techniques) can be used in the analysis of designed experiments

*Software* 

The analyses used in this case study can be generated using both <u>Dataplot code</u> and <u>R code</u>.

Data

The following are the data used for this case study

Run	Lab	Batch	Y	X1	X2	X3
1 2 3 4 5	1 1	1 2	608.781 569.670	-1 -1	-1 -1	-1 -1 -1 -1 -1 -1
3	1	1	689.556	-1	-1	-1
4	1	2	747.541	-1 -1 -1	-1 -1 -1	-1
5	1	1	618.134	-1	-1	-1
6 7	1 1	2 1	612.182 680.203	-1 -1	-1 -1	-⊥ _1
8	1	2	607.766	-1	-1	-1
9	1	2 1 2	726.232	-1 -1	-1	-1
10	1 1	2	605.380	-1	-1 -1 -1 -1	-1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1
11 12	1	1 2	518.655 589.226	-1 -1 -1 -1	-1 -1	-1 -1
13	ī	1	740.447	-1	-1	-1
14	1	2 1	588.375	-1	-1	-1
15 16	1 1	2	666.830 531.384	-1 -1	-1 -1	-⊥ _1
17	1	1	710.272	-1	-1	-1
18	1	2 1	633.417	-1	-1	-1
19	1		751.669	-1 -1 -1 -1 -1 -1 -1 -1 -1	-1	-1
20 21	1 1	2 1 2	619.060 697 979	-⊥ -1	-1 -1	-1 -1
21 22 23 24	1	2	697.979 632.447 708.583 624.256	-1	-1 -1 -1 -1 -1 -1 -1	-1
23	1	1 2	708.583	-1	-1	-1
24 25	1 1	2 1	624.256 624.972	-⊥ _1	-⊥ _1	-⊥ _1
26	1	2	575 143	-1	-1	-1
2.7	1	1	695.070	-1	-1	-1
28 29	1	2	695.070 549.278 769.391 624.972	-1	-1	-1
30	1 1	1 2	769.391 624 972	-1 -1	-1 -1	-1 -1
61	ī	1	720.186	-1	ī	ī
62	1	2 1	587.695	-1	1	1
63 64	1 1	2	723.657	-1 -1	1 1	1 1
65	1	1	569.207 703.700	-1	1	1
66	1	2	613.257	-1	1	1
67	1	1	697.626	-1	1	1
68	1	2	565.737	-1	1	1

67777777777777777777777777777777777777	111111111111111111111111111111111111111	$\begin{smallmatrix} 1 & 2 & 1 $	714.91779944 983127779944 983127779944 983127779944 98312777993991 983977079919999999999999999999999999999999			
--	---	--	--	--	--	--

22772277890123456789012345678901234567890123456789012334567890123345678901233456789012334567890123345678901233456789012334567890123345678901233456789012334567890123345678901233456789012333333333333333333333333333333333333	233333333333333333333333333333333333333	21212121212121212121212121212121212121	587.145 589.3193 584.3193 584.3193 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 648.1093 659.1093 659.1093 669.1093 669.1093 669.1093 669.1093 670.109		-11-11-11-11-11-11-11-11-11-11-11-11-11	
---	---	--	--	--	---	--

122
$egin{array}{cccccccccccccccccccccccccccccccccccc$
764.1694.8133333335166955.9217799979977990105.8132.766.3323333333516698.2233639.7672775788.851.932333333351669.7775788.851.9329.7735.982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.1982.37735.37735.1982.37735.
12
444444444444444444444444444444444444444
333333333333333333333333333333333333

627.885 527.8825 628.8833 6396.1382 640.817 671.7496 6709.7796 6709.7796 6709.7796 6709.7796 6709.7796 6709.7796 6709.3797 671.5419
21
$\mathbf{r}$
234567890123456789011234567890112345678901223456789012345678900123456789001234567890012345678900123456789000000000000000000000000000000000000

77777777777777777777777777777777777777
12
730.2172 730.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.5242 7703.8833 7608.992 7608.992 7608.992 7608.333 7608.6673 7608.6673 7608.6673 7608.6673 7608.6673 7608.6673 7608.6673 7608.7673 7608.7673 7608.773 7609.773
$egin{array}{cccccccccccccccccccccccccccccccccccc$

924 925 926 927 928 933 933 933 933 933 933 933 933 933 93	888888888888888888888888888888888888888	2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1	711.667 760.599 639.167 758.333 549.491 682.506 684.167 658.116 672.153 738.213 594.534 681.236 627.650 704.904 551.870 693.623 594.534 624.993 602.660 700.225 585.724 579.167 574.934 720.872 584.625 690.555.724 677.933	-1 -1 -1 -1 -1 1 1 1 1 1 1 1 1 1 1	-1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -	1 1 1 1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1
948 949 950 951 952	8 8 8 8	2 1 2 1 2	574.934 720.872 584.625 690.320 555.724	1 1 1 1	-1 -1 -1 -1	-1 -1 -1 -1



HOME

TOOLS & AIDS

SEARCH



# ENGINEERING STATISTICS HANDBOOK TOOLS & AIDS SEARCH BACK NEXT


- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.10. Ceramic Strength

### 1.4.2.10.2. Analysis of the Response Variable

Numerical Summary As a first step in the analysis, common summary statistics are computed for the response variable.

Sample size = 480 Mean = 650.0773 Median = 646.6275 Minimum = 345.2940 Maximum = 821.6540 Range = 476.3600 Stan. Dev. = 74.6383

4-Plot The next step is generate a 4-plot of the response variable.

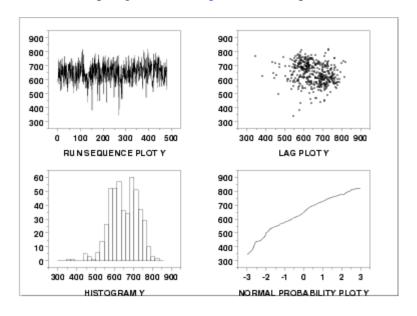

This 4-plot shows:

1. The <u>run sequence plot</u> (upper left corner) shows that the location and scale are relatively constant. It also shows a few outliers on the low side. Most of the points are in the range 500 to 750. However, there are about half a dozen points in the 300 to 450 range that may require special attention.

A run sequence plot is useful for designed experiments in that it can reveal time effects. Time is normally a nuisance factor. That is, the time order on which runs are made should not have a significant effect on the response. If a time effect does appear to exist, this means that there is a potential bias in the experiment that needs to be investigated and resolved.

- 2. The <u>lag plot</u> (the upper right corner) does not show any significant structure. This is another tool for detecting any potential time effect.
- 3. The <u>histogram</u> (the lower left corner) shows the response appears to be reasonably symmetric, but with a bimodal distribution.
- 4. The <u>normal probability plot</u> (the lower right corner) shows some curvature indicating that distributions other than the normal may provide a better fit.



HOME

TOOLS & AIDS

SEARCH


- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.10. Ceramic Strength

## 1.4.2.10.3. Analysis of the Batch Effect

Batch is a Nuisance Factor The two nuisance factors in this experiment are the batch number and the lab. There are two batches and eight labs. Ideally, these factors will have minimal effect on the response variable.

We will investigate the batch factor first.

#### Bihistogram

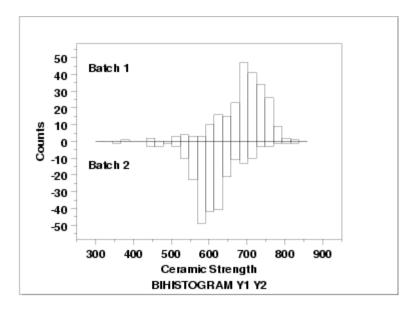


This bihistogram shows the following.

- 1. There does appear to be a batch effect.
- 2. The batch 1 responses are centered at 700 while the batch 2 responses are centered at 625. That is, the batch effect is approximately 75 units.
- 3. The variability is comparable for the 2 batches.
- 4. Batch 1 has some skewness in the lower tail. Batch 2 has some skewness in the center of the distribution, but not as much in the tails compared to batch 1.
- 5. Both batches have a few low-lying points.

Although we could stop with the bihistogram, we will show a few other commonly used two-sample graphical techniques for comparison.


Quantile-Quantile Plot

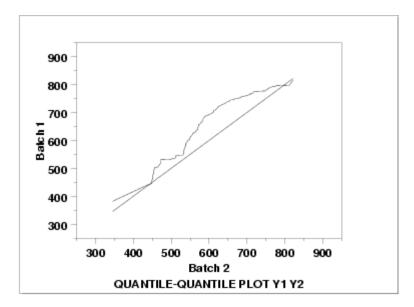

This <u>q-q plot</u> shows the following.

- 1. Except for a few points in the right tail, the batch 1 values have higher quantiles than the batch 2 values. This implies that batch 1 has a greater location value than batch 2.
- 2. The q-q plot is not linear. This implies that the difference between the batches is not explained simply by a shift in location. That is, the variation and/or skewness varies as well. From the bihistogram, it appears that the skewness in batch 2 is the most likely explanation for the non-linearity in the q-q plot.

Box Plot

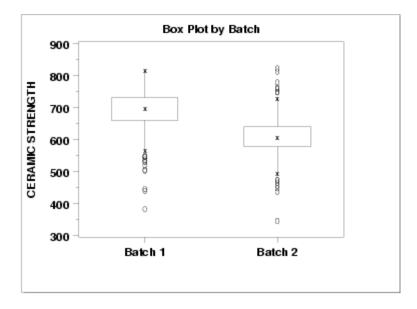


This **box plot** shows the following.

1. The median for batch 1 is approximately 700 while the median for batch 2 is approximately 600.

- 2. The spread is reasonably similar for both batches, maybe slightly larger for batch 1.
- 3. Both batches have a number of outliers on the low side. Batch 2 also has a few outliers on the high side. Box plots are a particularly effective method for identifying the presence of outliers.

**Block Plots** 

A block plot is generated for each of the eight labs, with "1" and "2" denoting the batch numbers. In the first plot, we do not include any of the primary factors. The next 3 block plots include one of the primary factors. Note that each of the 3 primary factors (table speed = X1, down feed rate = X2, wheel grit size = X3) has 2 levels. With 8 labs and 2 levels for the primary factor, we would expect 16 separate blocks on these plots. The fact that some of these blocks are missing indicates that some of the combinations of lab and primary factor are empty.

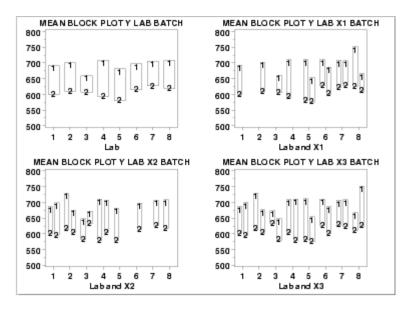

These <u>block plots</u> show the following.

1. The mean for batch 1 is greater than the mean for batch 2 in **all** of the cases above. This is strong evidence that the batch effect is real and consistent across labs and primary factors.

Quantitative Techniques We can confirm some of the conclusions drawn from the above graphics by using quantitative techniques. The <u>F-test</u> can be used to test whether or not the variances from the two batches are equal and the <u>two sample t-test</u> can be used to test whether or not the means from the two batches are equal. Summary statistics for each batch are shown below.

```
Batch 1:

NUMBER OF OBSERVATIONS = 240

MEAN = 688.9987
```

```
STANDARD DEVIATION = 65.5491

VARIANCE = 4296.6845

Batch 2:

NUMBER OF OBSERVATIONS = 240

MEAN = 611.1559

STANDARD DEVIATION = 61.8543

VARIANCE = 3825.9544
```

F-Test

The two-sided *F*-test indicates that the variances for the two batches are not significantly different at the 5 % level.

```
\begin{array}{lll} \text{H}_0\colon & \sigma_1^2 = \sigma_2^2 \\ \text{H}_a\colon & \sigma_1^2 \neq \sigma_2^2 \\ \end{array} Test statistic: F = 1.123 Numerator degrees of freedom: \nu_1 = 239 Denominator degrees of freedom: \nu_2 = 239 Significance level: \alpha = 0.05 Critical values: F_{1-\alpha/2}, \nu_1, \nu_2 = 0.845 F_{\alpha/2}, \nu_1, \nu_2 = 1.289 Critical region: Reject H_0 if F < 0.845 or F > 1.289
```

Two Sample t-Test

Since the *F*-test indicates that the two batch variances are equal, we can pool the variances for the two-sided, two-sample *t*-test to compare batch means.

```
H_0: \mu_1 = \mu_2
H_a: \mu_1 \neq \mu_2

Test statistic: T = 13.3806
Pooled standard deviation: s_p = 63.7285
Degrees of freedom: \nu = 478
Significance level: \alpha = 0.05
Critical value: t_{1-\alpha/2,\nu} = 1.965
Critical region: Reject H_0 if |T| > 1.965
```

The *t*-test indicates that the mean for batch 1 is larger than the mean for batch 2 at the 5 % significance level.

Conclusions

We can draw the following conclusions from the above analysis.

- 1. There is in fact a significant batch effect. This batch effect is consistent across labs and primary factors.
- 2. The magnitude of the difference is on the order of 75 to 100 (with batch 2 being smaller than batch 1). The standard deviations do not appear to be significantly different.
- 3. There is some skewness in the batches.

This batch effect was completely unexpected by the scientific investigators in this study.

Note that although the quantitative techniques support the conclusions of unequal means and equal standard deviations, they do not show the more subtle features of the data such as the presence of outliers and the skewness of the batch 2 data.

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH

BACK NEXT




- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. <u>Case Studies</u>
- 1.4.2.10. Ceramic Strength

## 1.4.2.10.4. Analysis of the Lab Effect

Box Plot

The next matter is to determine if there is a lab effect. The first step is to generate a box plot for the ceramic strength based on the lab.

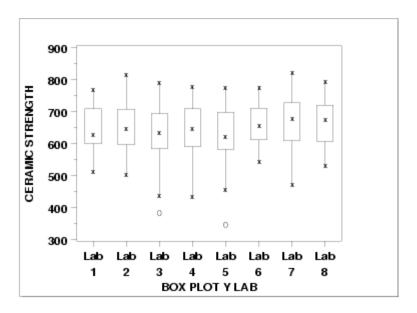


This box plot shows the following.

- 1. There is minor variation in the medians for the 8 labs.
- 2. The scales are relatively constant for the labs.
- 3. Two of the labs (3 and 5) have outliers on the low side.

Box Plot for Batch 1


Given that the previous section showed a distinct batch effect, the next step is to generate the box plots for the two batches separately.

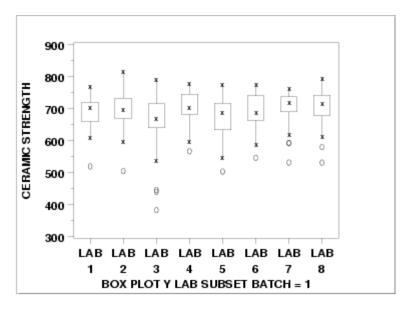

This **box plot** shows the following.

- 1. Each of the labs has a median in the 650 to 700 range.
- 2. The variability is relatively constant across the labs.
- 3. Each of the labs has at least one outlier on the low side.

Box Plot for Batch 2

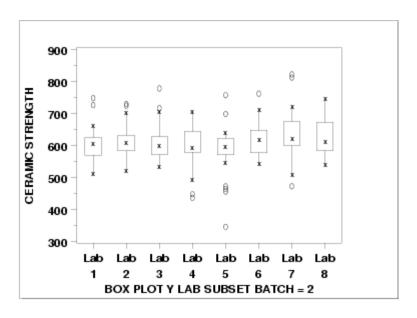

This **box plot** shows the following.

- 1. The medians are in the range 550 to 600.
- 2. There is a bit more variability, across the labs, for batch2 compared to batch 1.
- 3. Six of the eight labs show outliers on the high side. Three of the labs show outliers on the low side.

Conclusions We can draw the following conclusions about a possible lab

effect from the above box plots.

- 1. The batch effect (of approximately 75 to 100 units) on location dominates any lab effects.
- 2. It is reasonable to treat the labs as homogeneous.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.10. Ceramic Strength


## 1.4.2.10.5. Analysis of Primary Factors

Main effects

The first step in analyzing the primary factors is to determine which factors are the most significant. The <u>DOE scatter plot</u>, <u>DOE mean plot</u>, and the <u>DOE standard deviation plots</u> will be the primary tools, with "DOE" being short for "design of experiments".

Since the previous pages showed a significant batch effect but a minimal lab effect, we will generate separate plots for batch 1 and batch 2. However, the labs will be treated as equivalent.



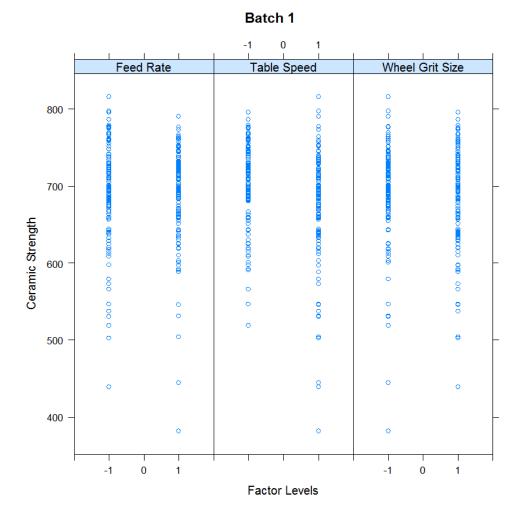


This DOE scatter plot shows the following for batch 1.

1. Most of the points are between 500 and 800.

- 2. There are about a dozen or so points between 300 and 500.
- 3. Except for the outliers on the low side (i.e., the points between 300 and 500), the distribution of the points is comparable for the 3 primary factors in terms of location and spread.


DOE Mean Plot for Batch 1

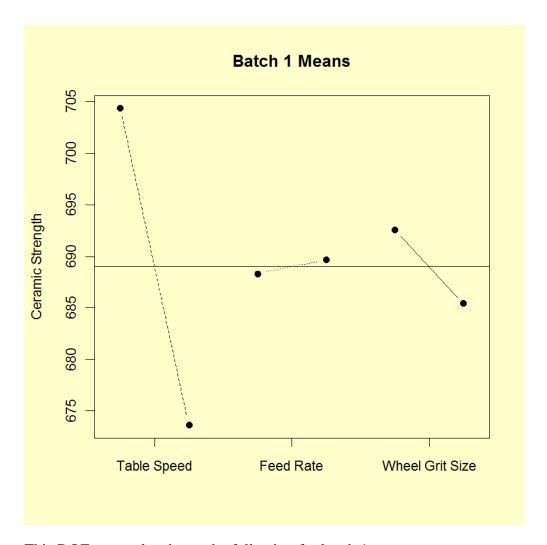

This DOE mean plot shows the following for batch 1.

- 1. The table speed factor (X1) is the most significant factor with an effect, the difference between the two points, of approximately 35 units.
- 2. The wheel grit factor (X3) is the next most significant factor with an effect of approximately 10 units.
- 3. The feed rate factor (X2) has minimal effect.


DOE SD Plot for Batch 1

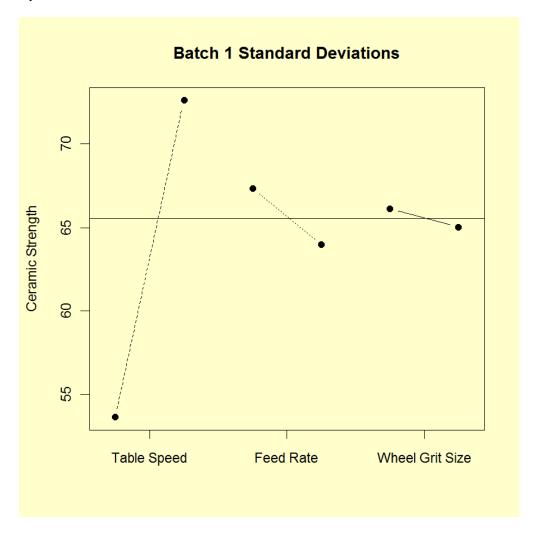

This DOE standard deviation plot shows the following for batch 1.

- 1. The table speed factor (X1) has a significant difference in variability between the levels of the factor. The difference is approximately 20 units.
- 2. The wheel grit factor (X3) and the feed rate factor (X2) have minimal differences in variability.


DOE Scatter Plot for Batch 2

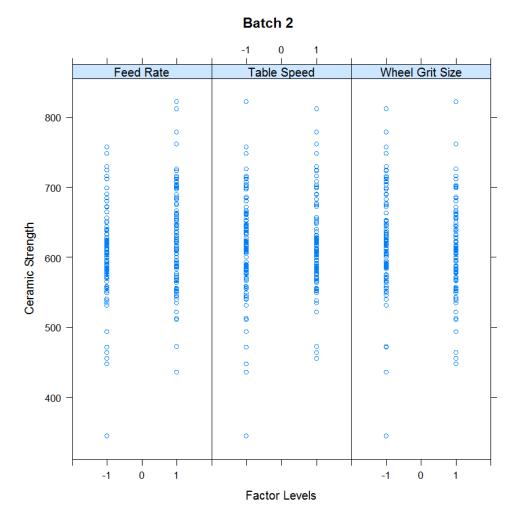

This DOE scatter plot shows the following for batch 2.

- 1. Most of the points are between 450 and 750.
- 2. There are a few outliers on both the low side and the high side.
- 3. Except for the outliers (i.e., the points less than 450 or greater than 750), the distribution of the points is comparable for the 3 primary factors in terms of location and spread.


DOE Mean Plot for Batch 2

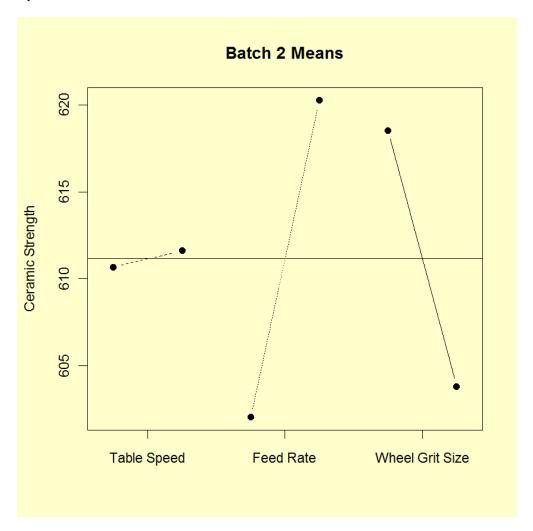

This DOE mean plot shows the following for batch 2.

- 1. The feed rate (X2) and wheel grit (X3) factors have an approximately equal effect of about 15 or 20 units.
- 2. The table speed factor (X1) has a minimal effect.

DOE SD Plot for Batch 2

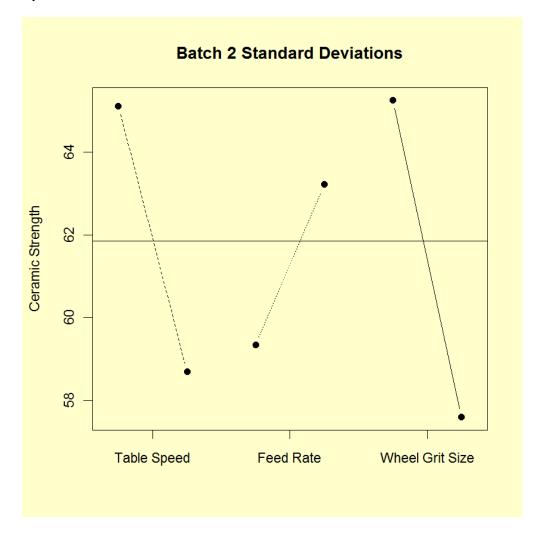

This DOE standard deviation plot shows the following for batch 2.

1. The difference in the standard deviations is roughly comparable for the three factors (slightly less for the feed rate factor).


#### Interaction Effects

The above plots graphically show the main effects. An additional concern is whether or not there any significant interaction effects.

Main effects and 2-term interaction effects are discussed in the chapter on Process Improvement.

In the following <u>DOE</u> interaction plots, the labels on the plot give the variables and the estimated effect. For example, factor 1 is table speed and it has an estimated effect of 30.77 (it is actually -30.77 if the direction is taken into account).


DOE Interaction Plot for Batch 1

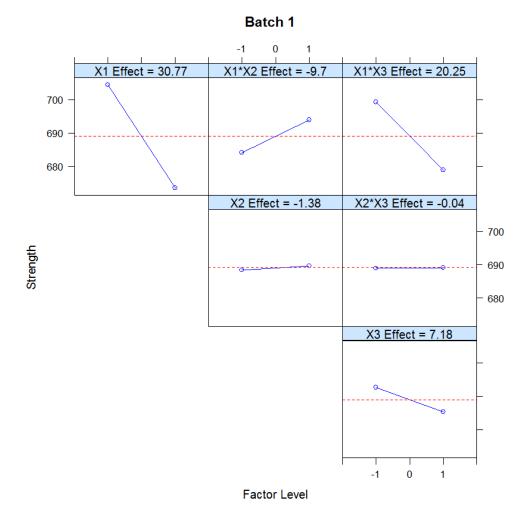

The ranked list of factors for batch 1 is:

- 1. Table speed (X1) with an estimated effect of -30.77.
- 2. The interaction of table speed (X1) and wheel grit (X3) with an estimated effect of -20.25.
- 3. The interaction of table speed (X1) and feed rate (X2) with an estimated effect of 9.7.
- 4. Wheel grit (X3) with an estimated effect of -7.18.
- 5. Down feed (X2) and the down feed interaction with wheel grit (X3) are essentially zero.

DOE Interaction Plot for Batch 2

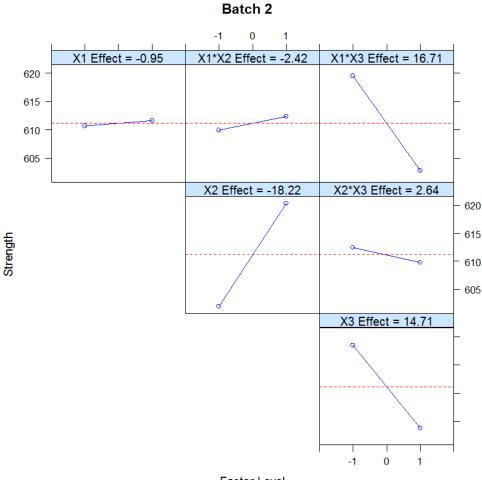

Factor Level

The ranked list of factors for batch 2 is:

- 1. Down feed (X2) with an estimated effect of 18.22.
- 2. The interaction of table speed (X1) and wheel grit (X3) with an estimated effect of -16.71.
- 3. Wheel grit (X3) with an estimated effect of -14.71
- 4. Remaining main effect and 2-factor interaction effects are essentially zero.

Conclusions From the above plots, we can draw the following overall conclusions.

- 1. The batch effect (of approximately 75 units) is the dominant primary factor.
- 2. The most important factors differ from batch to batch. See the above text for the ranked list of factors with the estimated effects.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT



#### **ENGINEERING STATISTICS HANDBOOK**

TOOLS & AIDS

SEARCH

BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies
- 1.4.2. Case Studies
- 1.4.2.10. Ceramic Strength

## **1.4.2.10.6.** Work This Example Yourself

View
Dataplot
Macro for
this Case
Study

This page allows you to use <u>Dataplot</u> to repeat the analysis outlined in the case study description on the previous page. It is required that you have already <u>downloaded</u> and <u>installed</u> Dataplot and <u>configured your browser</u>. to run Dataplot. Output from each analysis step below will be displayed in one or more of the Dataplot windows. The four main windows are the Output window, the Graphics window, the Command History window, and the data sheet window. Across the top of the main windows there are menus for executing Dataplot commands. Across the bottom is a command entry window where commands can be typed in.

Data Analysis Steps	Results and Conclusions
Click on the links below to start Dataplot and run this case study yourself. Each step may use results from previous steps, so please be patient. Wait until the software verifies that the current step is complete before clicking on the next step.	The links in this column will connect you with more detailed information about each analysis step from the case study description.
1. Invoke Dataplot and read data.	
1. Read in the data.	1. You have read 1 column of numbers into Dataplot, variable Y.
2. Plot of the response variable	
1. Numerical summary of Y.  2. 4-plot of Y.	1. The summary shows the mean strength is 650.08 and the standard deviation of the strength is 74.64.
	2. The 4-plot shows no drift in the location and scale and a

	bimodal distribution.
3. Determine if there is a batch effect.	
1. Generate a bihistogram based on the 2 batches.	1. The bihistogram shows a distinct batch effect of approximately
2. Generate a q-q plot.	75 units.  2. The q-q plot
3. Generate a box plot.	shows that batch 1 and batch 2 do not come from a common distribution.
4. Generate block plots.	3. The box plot shows that there is a batch effect of approximately 75 to 100 units
5. Perform a 2-sample t-test for equal means.	and there are some outliers.
6. Perform an F-test for equal standard deviations.	4. The block plot shows that the batch effect is consistent across labs and levels of the primary factor.
	_5. The t-test_confirms the batch_effect with_respect to the means.
	6. The F-test does not indicate any significant batch effect with respect to the standard deviations.
4. Determine if there is a lab effect.	
1. Generate a box plot for the labs with the 2 batches combined.	1. The box plot does not show a significant lab effect.
2. Generate a box plot for the labs for batch 1 only.  3. Generate a box plot for the labs	2. The box plot does not show a significant lab effect for batch 1.
for batch 2 only.	3. The box plot does not show a significant lab effect for batch 2.
5. Analysis of primary factors.	1 The DOT and the
1. Generate a DOE scatter plot for batch 1.	1. The DOE scatter plot shows the range of the points and the

1.4.2.10.6. Work This Example Yourself 2. Generate a DOE mean plot for presence of outliers. batch 1. 2. The DOE mean plot shows that Generate a DOE sd plot for table speed is batch 1. the most significant factor for batch 1. Generate a DOE scatter plot for batch 2. 3. The DOE sd plot shows that table speed has Generate a DOE mean plot for batch 2. the most variability for batch 1. 4. The DOE scatter Generate a DOE sd plot for plot shows the range of the batch 2. points and the presence of 7. Generate a DOE interaction outliers. <u>effects matrix plot for</u> batch 1. 5. The DOE mean plot shows that feed rate and 8. Generate a DOE interaction wheel grit are effects matrix plot for batch 2. the most significant factors for batch 2. 6. The DOE sd plot shows that the variability is comparable for all 3 factors for batch 2. 7. The DOE interaction effects
matrix plot provides a ranked list of factors with the estimated effects. 8. The DOE interaction effects matrix plot

NIST SEMATECH

HOME

TOOLS & AIDS

SEARCH

BACK NEXT

provides a ranked list of factors

estimated

with the

effects.



## ENGINEERING STATISTICS HANDBOOK TOOLS & AIDS SEARCH BACK NEXT

- 1. Exploratory Data Analysis
- 1.4. EDA Case Studies

# 1.4.3. References For Chapter 1: Exploratory Data Analysis

Anscombe, F. (1973), Graphs in Statistical Analysis, *The American Statistician*, pp. 195-199.

Anscombe, F. and Tukey, J. W. (1963), The Examination and Analysis of Residuals, *Technometrics*, pp. 141-160.

Barnett and Lewis (1994), *Outliers in Statistical Data*, 3rd. Ed., John Wiley and Sons.

Birnbaum, Z. W. and Saunders, S. C. (1958), A Statistical Model for Life-Length of Materials, *Journal of the American Statistical Association*, 53(281), pp. 151-160.

Bloomfield, Peter (1976), Fourier Analysis of Time Series, John Wiley and Sons.

Box, G. E. P. and Cox, D. R. (1964), An Analysis of Transformations, *Journal of the Royal Statistical Society*, pp. 211-243, discussion pp. 244-252.

Box, G. E. P., Hunter, W. G., and Hunter, J. S. (1978), *Statistics for Experimenters: An Introduction to Design, Data Analysis, and Model Building*, John Wiley and Sons.

Box, G. E. P., and Jenkins, G. (1976), *Time Series Analysis: Forecasting and Control*, Holden-Day.

Bradley, (1968). Distribution-Free Statistical Tests, Chapter 12.

Brown, M. B. and Forsythe, A. B. (1974), *Journal of the American Statistical Association*, 69, pp. 364-367.

Chakravarti, Laha, and Roy, (1967). *Handbook of Methods of Applied Statistics*, *Volume I*, John Wiley and Sons, pp. 392-394.

Chambers, John, William Cleveland, Beat Kleiner, and Paul Tukey, (1983), *Graphical Methods for Data Analysis*, Wadsworth.

Chatfield, C. (1989). *The Analysis of Time Series: An Introduction*, Fourth Edition, Chapman & Hall, New York, NY.

Cleveland, William (1985), *Elements of Graphing Data*, Wadsworth.

Cleveland, William and Marylyn McGill, Editors (1988), *Dynamic Graphics for Statistics*, Wadsworth.

Cleveland, William (1993), Visualizing Data, Hobart Press.

Devaney, Judy (1997), Equation Discovery Through Global Self-Referenced Geometric Intervals and Machine Learning, Ph.d thesis, George Mason University, Fairfax, VA.

Draper and Smith, (1981). *Applied Regression Analysis*, 2nd ed., John Wiley and Sons.

du Toit, Steyn, and Stumpf (1986), *Graphical Exploratory Data Analysis*, Springer-Verlag.

Efron and Gong (February 1983), A Leisurely Look at the Bootstrap, the Jackknife, and Cross Validation, *The American Statistician*.

Evans, Hastings, and Peacock (2000), *Statistical Distributions*, 3rd. Ed., John Wiley and Sons.

Everitt, Brian (1978), *Multivariate Techniques for Multivariate Data*, North-Holland.

Filliben, J. J. (February 1975), The Probability Plot Correlation Coefficient Test for Normality, *Technometrics*, pp. 111-117.

Fuller Jr., E. R., Frieman, S. W., Quinn, J. B., Quinn, G. D., and Carter, W. C. (1994), Fracture Mechanics Approach to the Design of Glass Aircraft Windows: A Case Study, *SPIE Proceedings*, Vol. 2286, (Society of Photo-Optical Instrumentation Engineers (SPIE), Bellingham, WA).

Gill, Lisa (April 1997), Summary Analysis: High Performance Ceramics Experiment to Characterize the Effect of Grinding Parameters on Sintered Reaction Bonded Silicon Nitride, Reaction Bonded Silicon Nitride, and Sintered Silicon Nitride, presented at the NIST - Ceramic Machining Consortium, 10th Program Review Meeting, April 10, 1997.

Granger and Hatanaka (1964), *Spectral Analysis of Economic Time Series*, Princeton University Press.

Grubbs, Frank (1950), Sample Criteria for Testing Outlying Observations, *Annals of Mathematical Statistics*, 21(1) pp. 27-58.

Grubbs, Frank (February 1969), Procedures for Detecting Outlying Observations in Samples, *Technometrics*, 11(1), pp. 1-21.

Hahn, G. J. and Meeker, W. Q. (1991), *Statistical Intervals*, John Wiley and Sons.

Harris, Robert L. (1996), *Information Graphics*, Management Graphics.

Hastie, T., Tibshirani, R. and Friedman, J. (2001), *The Elements of Statistical Learning: Data Mining, Inference, and Prediction*, Springer-Verlag, New York.

Hawkins, D. M. (1980), *Identification of Outliers*, Chapman and Hall.

Boris Iglewicz and David Hoaglin (1993), "Volume 16: How to Detect and Handle Outliers", *The ASQC Basic References in Quality Control: Statistical Techniques*, Edward F. Mykytka, Ph.D., Editor.

Jenkins and Watts, (1968), *Spectral Analysis and Its Applications*, Holden-Day.

Johnson, Kotz, and Balakrishnan, (1994), *Continuous Univariate Distributions, Volumes I and II*, 2nd. Ed., John Wiley and Sons.

Johnson, Kotz, and Kemp, (1992), *Univariate Discrete Distributions*, 2nd. Ed., John Wiley and Sons.

Kuo, Way and Pierson, Marcia Martens, Eds. (1993), *Quality Through Engineering Design*", specifically, the article Filliben, Cetinkunt, Yu, and Dommenz (1993), *Exploratory Data Analysis Techniques as Applied to a High-Precision Turning Machine*, Elsevier, New York, pp. 199-223.

Levene, H. (1960). In *Contributions to Probability and Statistics: Essays in Honor of Harold Hotelling*, I. Olkin et al. eds., Stanford University Press, pp. 278-292.

McNeil, Donald (1977), Interactive Data Analysis, John Wiley and Sons.

Mendenhall, William and Reinmuth, James (1982), *Statistics for Management and Ecomonics, Fourth Edition*, Duxbury Press.

Mosteller, Frederick and Tukey, John (1977), *Data Analysis and Regression*, Addison-Wesley.

Natrella, Mary (1963), *Experimental Statistics*, National Bureau of Standards Handbook 91.

Nelson, Wayne (1982), Applied Life Data Analysis, Addison-Wesley.

Nelson, Wayne and Doganaksoy, Necip (1992), A Computer Program POWNOR for Fitting the Power-Normal and -Lognormal Models to Life or Strength Data from Specimens of Various Sizes, *NISTIR 4760*, U.S. Department of Commerce, National Institute of Standards and Technology.

Neter, Wasserman, and Kunter (1990). *Applied Linear Statistical Models*, 3rd ed., Irwin.

Pepi, John W., (1994), Failsafe Design of an All BK-7 Glass Aircraft Window, *SPIE Proceedings*, Vol. 2286, (Society of Photo-Optical Instrumentation Engineers (SPIE), Bellingham, WA).

The RAND Corporation (1955), A Million Random Digits with 100,000 Normal Deviates, Free Press.

Rosner, Bernard (May 1983), Percentage Points for a Generalized ESD Many-Outlier Procedure, *Technometrics*, 25(2), pp. 165-172.

Ryan, Thomas (1997), Modern Regression Methods, John Wiley.

Scott, David (1992), Multivariate Density Estimation: Theory, Practice, and Visualization, John Wiley and Sons.

Snedecor, George W. and Cochran, William G. (1989), *Statistical Methods*, Eighth Edition, Iowa State University Press.

Stefansky, W. (1972), Rejecting Outliers in Factorial Designs, *Technometrics*, 14, pp. 469-479.

Stephens, M. A. (1974). EDF Statistics for Goodness of Fit and Some Comparisons, *Journal of the American Statistical Association*, 69, pp. 730-737.

Stephens, M. A. (1976). Asymptotic Results for Goodness-of-Fit Statistics with Unknown Parameters, *Annals of Statistics*, 4, pp. 357-369.

Stephens, M. A. (1977). Goodness of Fit for the Extreme Value Distribution, *Biometrika*, 64, pp. 583-588.

Stephens, M. A. (1977). Goodness of Fit with Special Reference to Tests for Exponentiality, Technical Report No. 262, Department of Statistics, Stanford University, Stanford, CA.

Stephens, M. A. (1979). Tests of Fit for the Logistic Distribution Based on the Empirical Distribution Function, *Biometrika*, 66, pp. 591-595.

Tietjen and Moore (August 1972), Some Grubbs-Type Statistics for the Detection of Outliers, *Technometrics*, 14(3), pp. 583-597.

Tufte, Edward (1983), *The Visual Display of Quantitative Information*, Graphics Press.

Tukey, John (1977), Exploratory Data Analysis, Addison-Wesley.

Velleman, Paul and Hoaglin, David (1981), *The ABC's of EDA: Applications, Basics, and Computing of Exploratory Data Analysis*, Duxbury.

Wainer, Howard (1981), Visual Revelations, Copernicus.

Wilk, M. B. and Gnanadesikan, R. (1968), Probability Plotting Methods for the Analysis of Data, *Biometrika*, 5(5), pp. 1-19.



HOME

TOOLS & AIDS

SEARCH

BACK NEXT