

Japan International Cooperation Agency (JICA)




TRANSITIONAL PROJECT IMPLEMENTATION SUPPORT
FOR
EMERGENCY RECONSTRUCTION PROJECTS
IN NEPAL

TRAINING STRATEGY and HOUSE SURVEY in Target VDCs

JICA Technical Assistance Team
December 2016

● JICA Target 38 VDC/Municipality

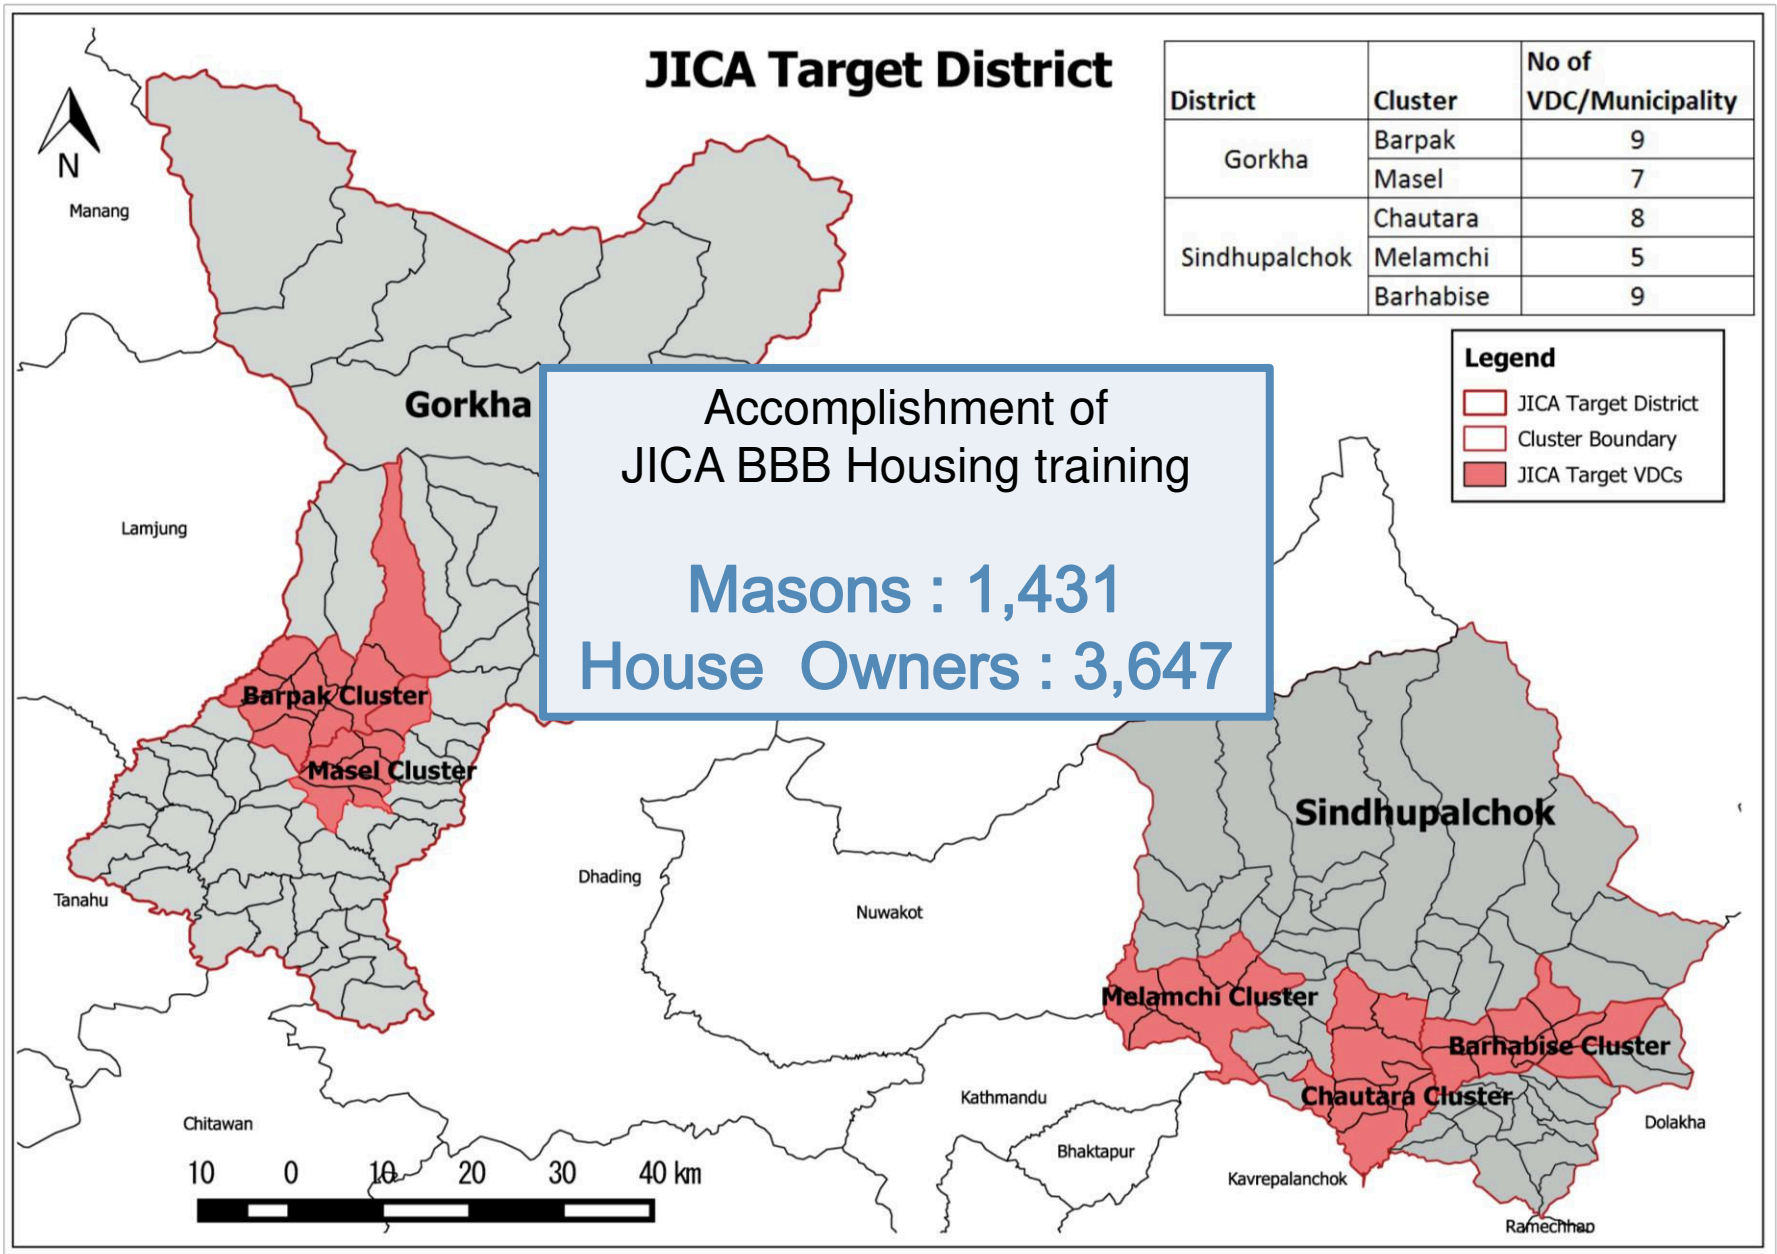

● Monitoring & technical assistance Activities

Mobile team
 (1 engineer + 1 social mobilizer)
 ×
 12 teams

House Survey			
SN	: 6	Ward No.	: 2
House Owner	: Nachar Man Tamang	PA Number	: 23-67-2-0-112
Coordinate	27°51'8.362"N	85°30'20814"E	
Mason	:NA		
HO knows MR	:No	Mason knows MR	: <u>NA</u>
Structure	: SMM	Cost	: 300,000
Ward No.	: Area (30m ²) Length (10m) Breadth (3m) Storey (2) Rooms (2) Attic(yes)		
Start Date	: 1-Jan-17	Completion Date	: 1-Feb-17
Progress	Completed	Compliant	:No
Findings			
• No bands are used. • Two storey house with heavy gable wall			
Photo			
			
Overall 1		Overall 2	
			
No Bands		Heavy material in gable	

● Ratio of Houses Compliant with MR

	Surveyed Houses			
	Total	House Owner knows MR	Mason knows MR	Compliant with MR
Overall	785 (100%)	321 (40.9%)	465 (59.2%)	119 (15.2%)
Constructed by Masons trained by TPIS-ERP	236 (100%)	122 (51.7%)	214 (90.7%)	53 (22.5%)



More than 90% of Mason knows MR but just 22% is compliant
(Overall 15%)

● Compliant and Non-compliant Houses in field



● Compliant and Non-compliant Houses in field



● Compliant and Non-compliant Houses in field



● Compliant and Non-compliant Houses in field



● Compliant and Non-compliant Houses in field



● Ratio of Houses Compliant with MR

	Surveyed Houses			
	Total	House Owner knows MR	Mason knows MR	Compliant with MR
Overall	785 (100%)	321 (40.9%)	465 (59.2%)	119 (15.2%)
Constructed by Masons trained	236 (100%)	122 (51.7%)	214 (90.7%)	53 (22.5%)

More than 90% of Mason knows MR **but just 22% is compliant**
(Overall 15%)

How to increase the number of Compliant houses??

● Ratio of Houses Compliant with MR

Overall			~2015		2016 Jan~Mar		2016 Apr~Jun		2016 Jul~Sep		2016 Oct-Dec	
785	119	(15.2%)	3	(2.3%)	7	(3.6%)	24	(11.9%)	47	(29.7%)	38	(38.0%)



Ratio of compliant Houses are increasing each month

Overall			~Plinth Band			~Roof Band			Completed		
785	119	(15.2%)	132	58	(43.9%)	146	39	(26.7%)	507	22	(4.3%)




Till Plinth Band, compliant Houses are 44%
But when they complete the construction, it became just 4%



**How to keep 44% of compliant ratio
till Completion of the work?**

● Findings

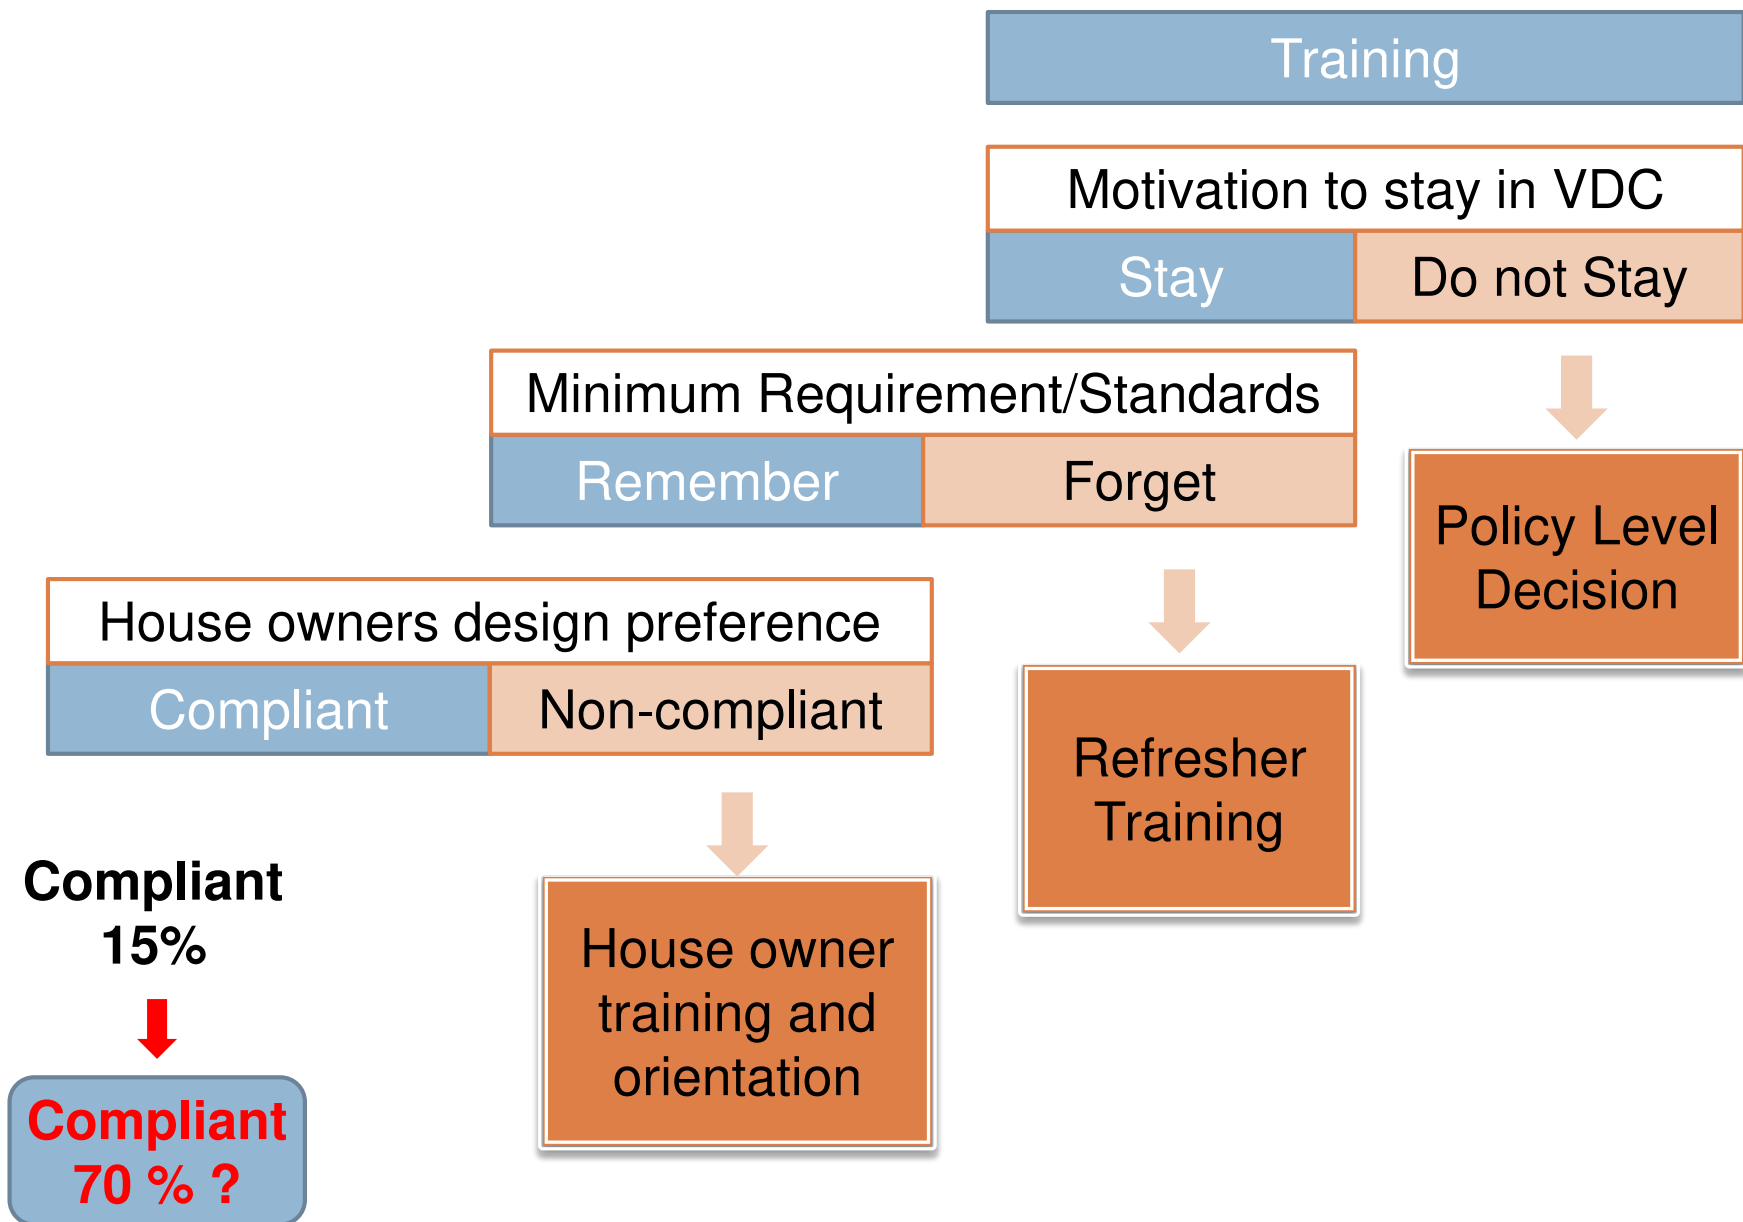

● Refresher Training Schedule

Time		Day 1
9:00	9:15	Registration
9:15	10:00	Course objective/overview, introduction and Pre test
10:00	10:30	Tea Break
10:30	12:00	Minimum Requirement (With Small Scale Demo Model)
12:00	12:45	Lunch Break
12:45	13:30	Non Complaint issues (Photos)
13:30	14:15	Discussion on technical issues
14:15	14:30	Tea Break
14:30	15:15	Training Video with key Information
15:15	16:00	Role of mason and Inspection Guideline
16:00	17:00	Post test, evaluation of the training and Closing



Session 1.2 Minimum Requirements (With Small Scale Demo Model

1



Vertical Member



Vertical Wooden post (75
mmx100 mm)

Wooden post 50 mm x38
mm @500 mm cc

Horizontal member, 2x 75
mm x 38 mm



23



● Refresher Training



JICA BBB Housing Training

Session: 1.3

Compliant and Non Compliant Houses



ORIENTAL CONSULTANTS CO., LTD.
Global Consulting H.Q.