# CHAPTER

# 78

# EXHAUST

# CHAPTER 78
# EXHAUST


| CH-SE-SU | Schem | Page | Sheet | Date |
|---|---|---|---|---|
| **78-EFFECTIVE PAGES** | | | | |
| | | 1 | | Nov 14/2025 |
| | | 2 | | BLANK |
| **78-CONTENTS** | | | | |
| | | 1 | | May 15/2024 |
| | | 2 | | BLANK |
| **78-ALPHABETICAL INDEX** | | | | |
| | | 1 | | May 15/2024 |
| | | 2 | | BLANK |
| **78-32-51** | | | | |
| | | 1 | | May 15/2024 |
| **78-32-61** | | | | |
| | | 1 | 1 | May 15/2024 |
| | | | 2 | May 15/2024 |
| **78-34-11** | | | | |
| | | 1 | | May 15/2024 |
| **78-34-21** | | | | |
| | | 1 | 1 | May 15/2024 |
| | | | 2 | May 15/2024 |
| **78-35-11** | | | | |
| | | 1 | | May 15/2024 |
| **78-35-21** | | | | |
| | | 1 | | May 15/2024 |
| **78-36-11** | | | | |
| | | 1 | | May 15/2024 |
| **78-36-21** | | | | |
| | | 1 | | May 15/2024 |


A = Added, R = Revised, D = Deleted, O = Overflow



ECCN 9E991 BOEING PROPRIETARY - See title page for details

# CHAPTER 78
# EXHAUST


| Title | CH-SE-SU | Schem | Page | Sheet | Date | Effectivity |
|---|---|---|---|---|---|---|
| **THRUST REVERSER SYSTEM** | | | | | | |
| ENGINE 1 THRUST REVERSER SYNCHRONOUS SHAFT LOCKS | 78-32-51 | | 1 | | May 15/2024 | ALL |
| ENGINE 2 THRUST REVERSER SYNCHRONOUS SHAFT LOCKS | 78-32-61 | | 1 | 1 | May 15/2024 | ALL |
| | | | | 2 | May 15/2024 | ALL |
| **THRUST REVERSER CONTROL SYSTEM** | | | | | | |
| ENGINE 1 THRUST REVERSER CONTROL | 78-34-11 | | 1 | | May 15/2024 | ALL |
| ENGINE 2 THRUST REVERSER CONTROL | 78-34-21 | | 1 | 1 | May 15/2024 | ALL |
| | | | | 2 | May 15/2024 | ALL |
| **ENGINE THRUST REVERSER POSITION / THRUST LEVER INTERLOCK** | | | | | | |
| ENGINE 1 THRUST REVERSER POSITION / THRUST LEVER INTERLOCK | 78-35-11 | | 1 | | May 15/2024 | ALL |
| ENGINE 2 THRUST REVERSER POSITION / THRUST LEVER INTERLOCK | 78-35-21 | | 1 | | May 15/2024 | ALL |
| **THRUST REVERSER INDICATING SYSTEM** | | | | | | |
| ENGINE 1 THRUST REVERSER FLIGHT DECK INDICATION | 78-36-11 | | 1 | | May 15/2024 | ALL |
| ENGINE 2 THRUST REVERSER FLIGHT DECK INDICATION | 78-36-21 | | 1 | | May 15/2024 | ALL |




ECCN 9E991 BOEING PROPRIETARY - See title page for details

## CHAPTER 78
## EXHAUST


| CH-SE-SU | Title |
|---|---|
| 78-34-11 | ENGINE 1 THRUST REVERSER CONTROL |
| 78-36-11 | ENGINE 1 THRUST REVERSER FLIGHT DECK INDICATION |
| 78-35-11 | ENGINE 1 THRUST REVERSER POSITION / THRUST LEVER INTERLOCK |
| 78-32-51 | ENGINE 1 THRUST REVERSER SYNCHRONOUS SHAFT LOCKS |
| 78-34-21 | ENGINE 2 THRUST REVERSER CONTROL |
| 78-36-21 | ENGINE 2 THRUST REVERSER FLIGHT DECK INDICATION |
| 78-35-21 | ENGINE 2 THRUST REVERSER POSITION / THRUST LEVER INTERLOCK |
| 78-32-61 | ENGINE 2 THRUST REVERSER SYNCHRONOUS SHAFT LOCKS |



## 78-ALPHABETICAL INDEX



ECCN 9E991 BOEING PROPRIETARY - See title page for details

737-8 WIRING DIAGRAM MANUAL

-B
29

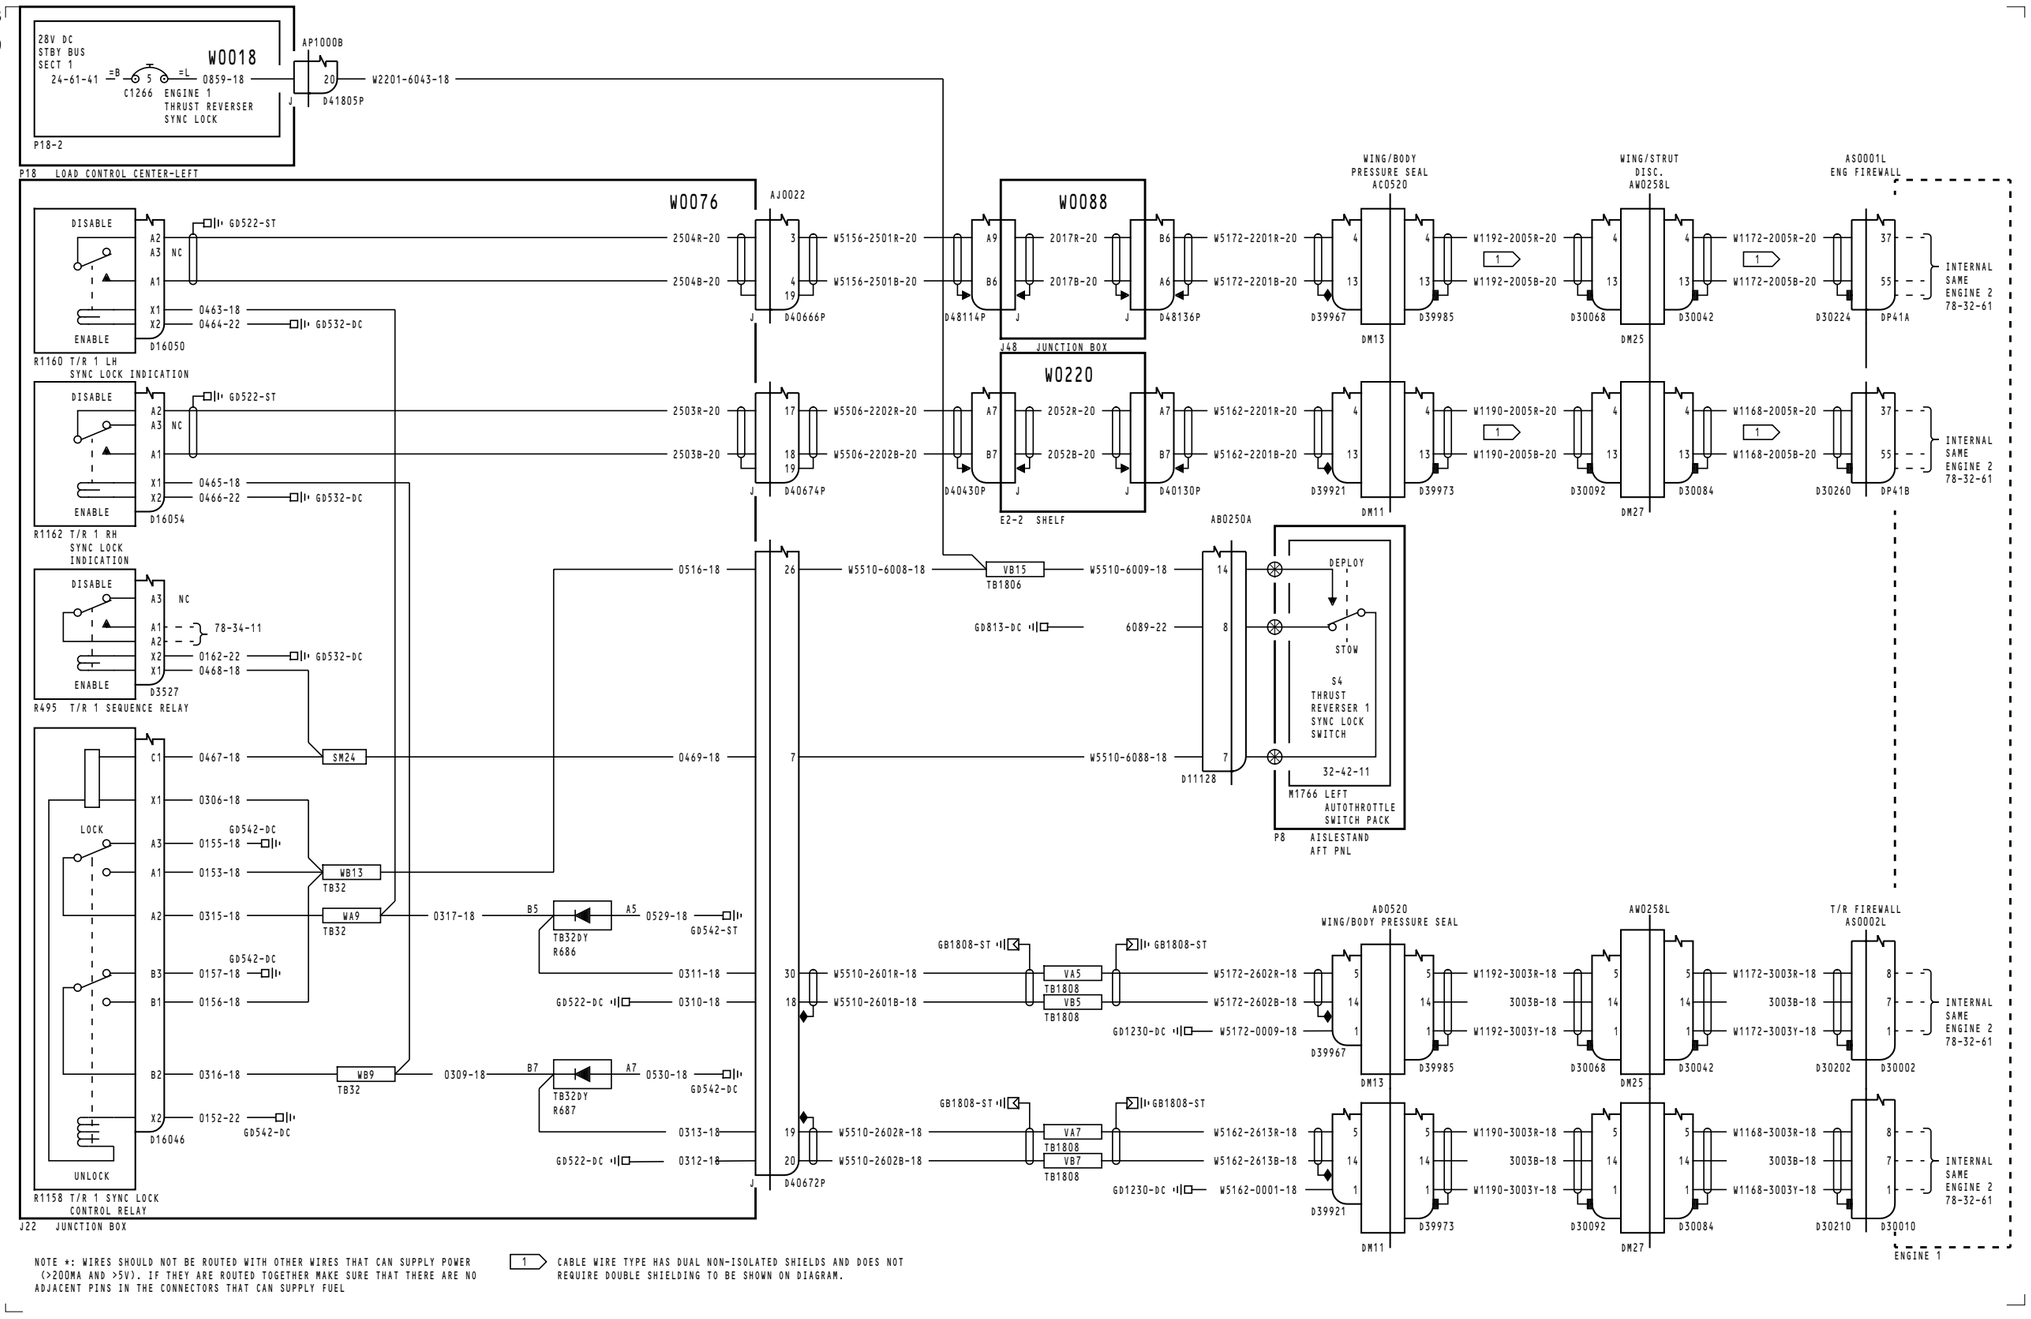





ECCN 9E991 BOEING PROPRIETARY - See title page for details

78-32-51

Page 1

May 15/2024

737-8 WIRING DIAGRAM MANUAL

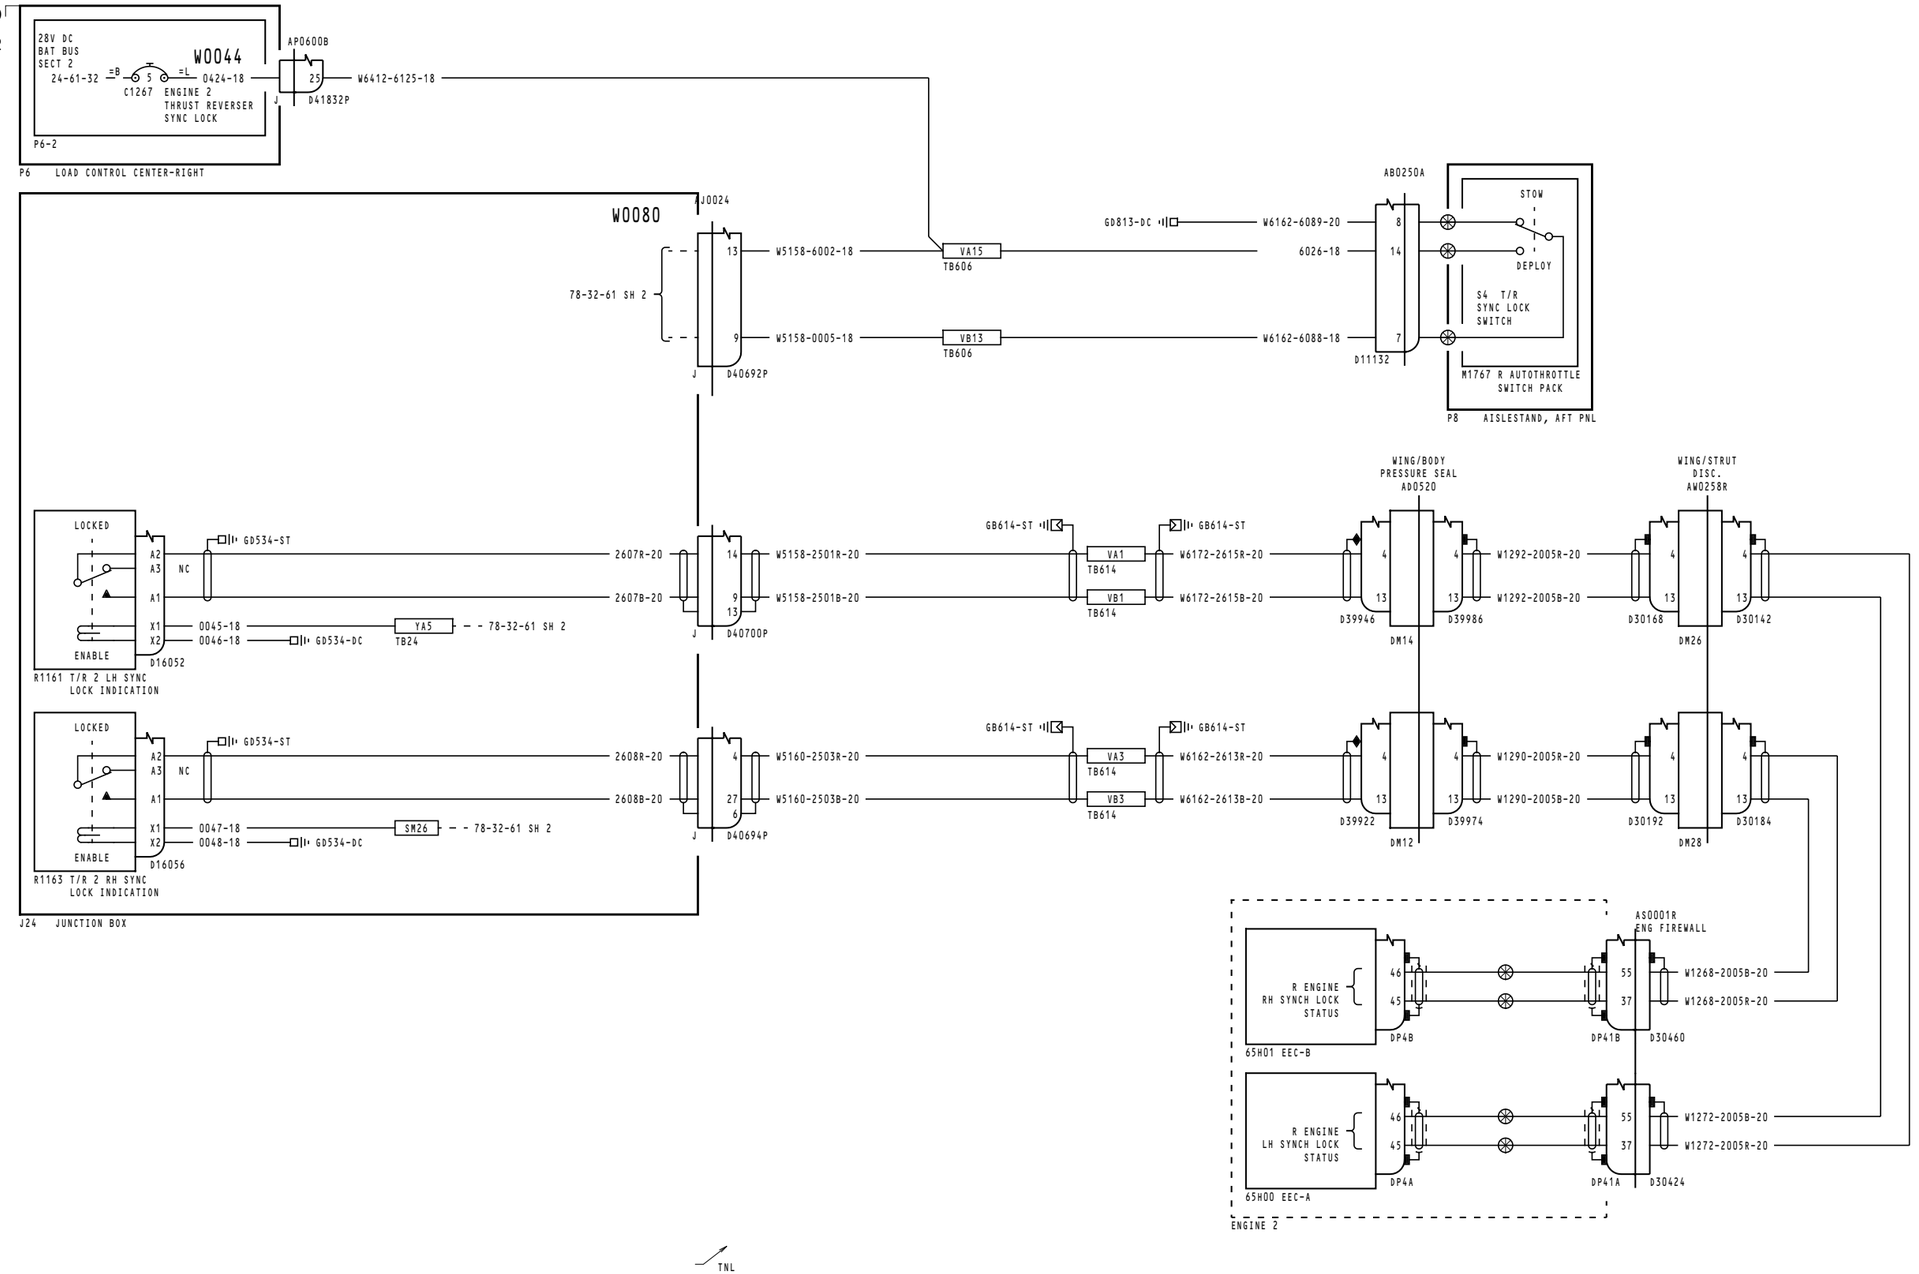





78-32-61

Page 1
Sheet 1
May 15/2024

ECCN 9E991 BOEING PROPRIETARY - See title page for details

737-8 WIRING DIAGRAM MANUAL

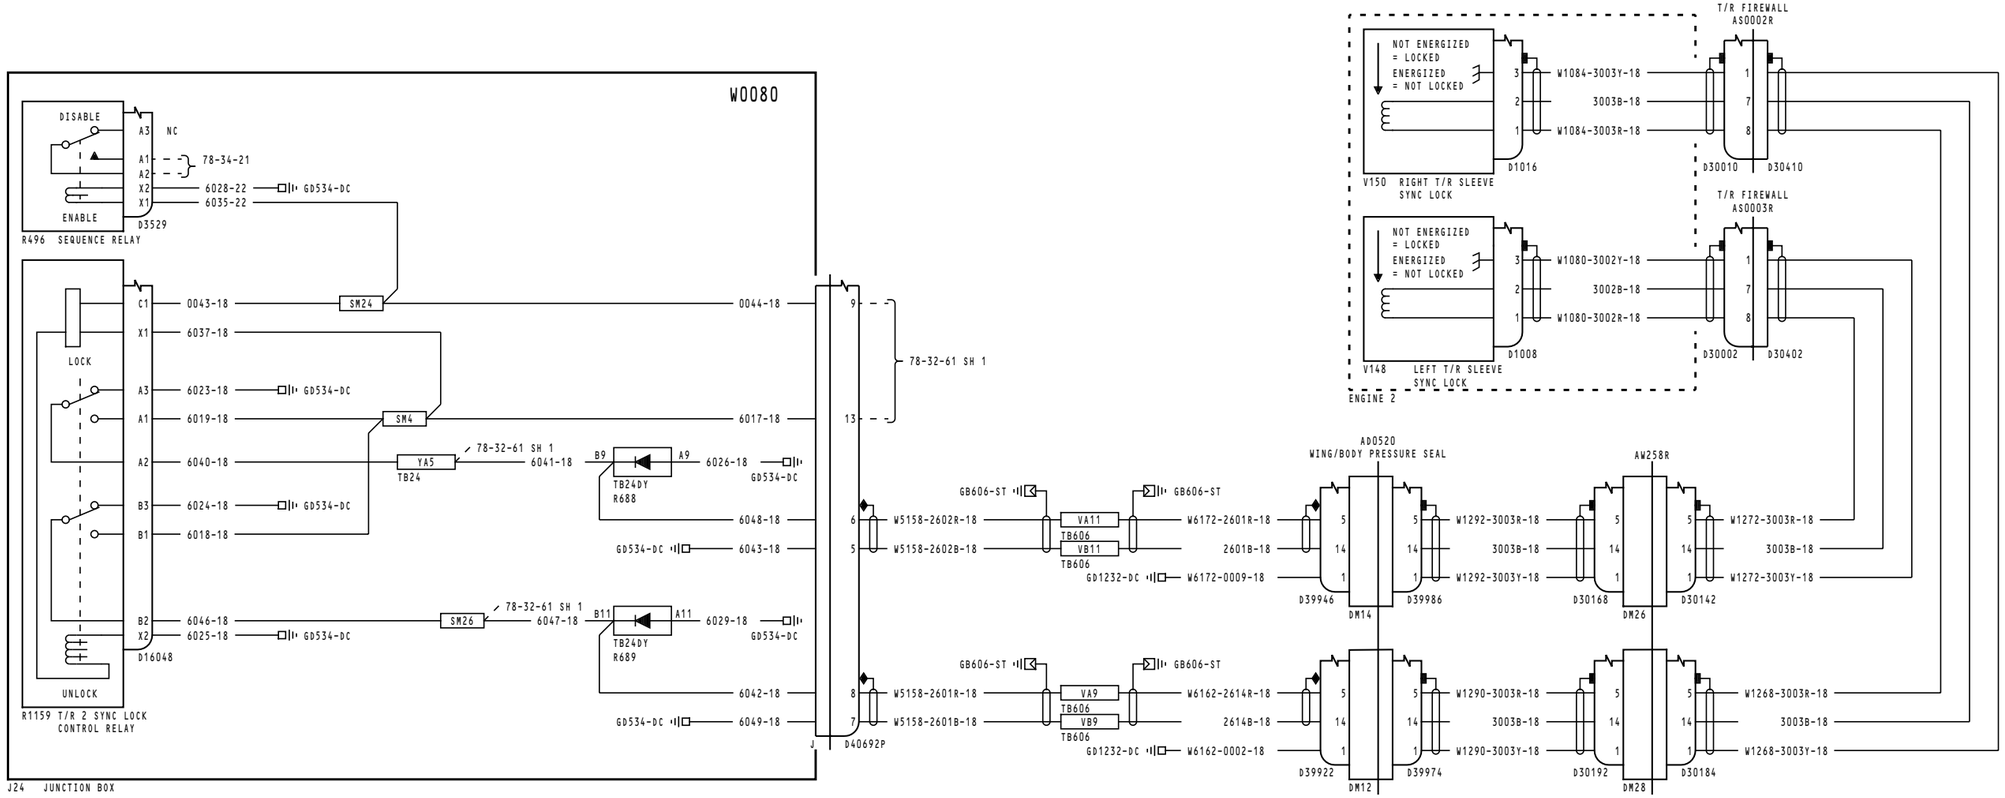


TNL




78-32-61

Page 1
Sheet 2
May 15/2024

ECCN 9E991 BOEING PROPRIETARY - See title page for details

737-8 WIRING DIAGRAM MANUAL

-B
10

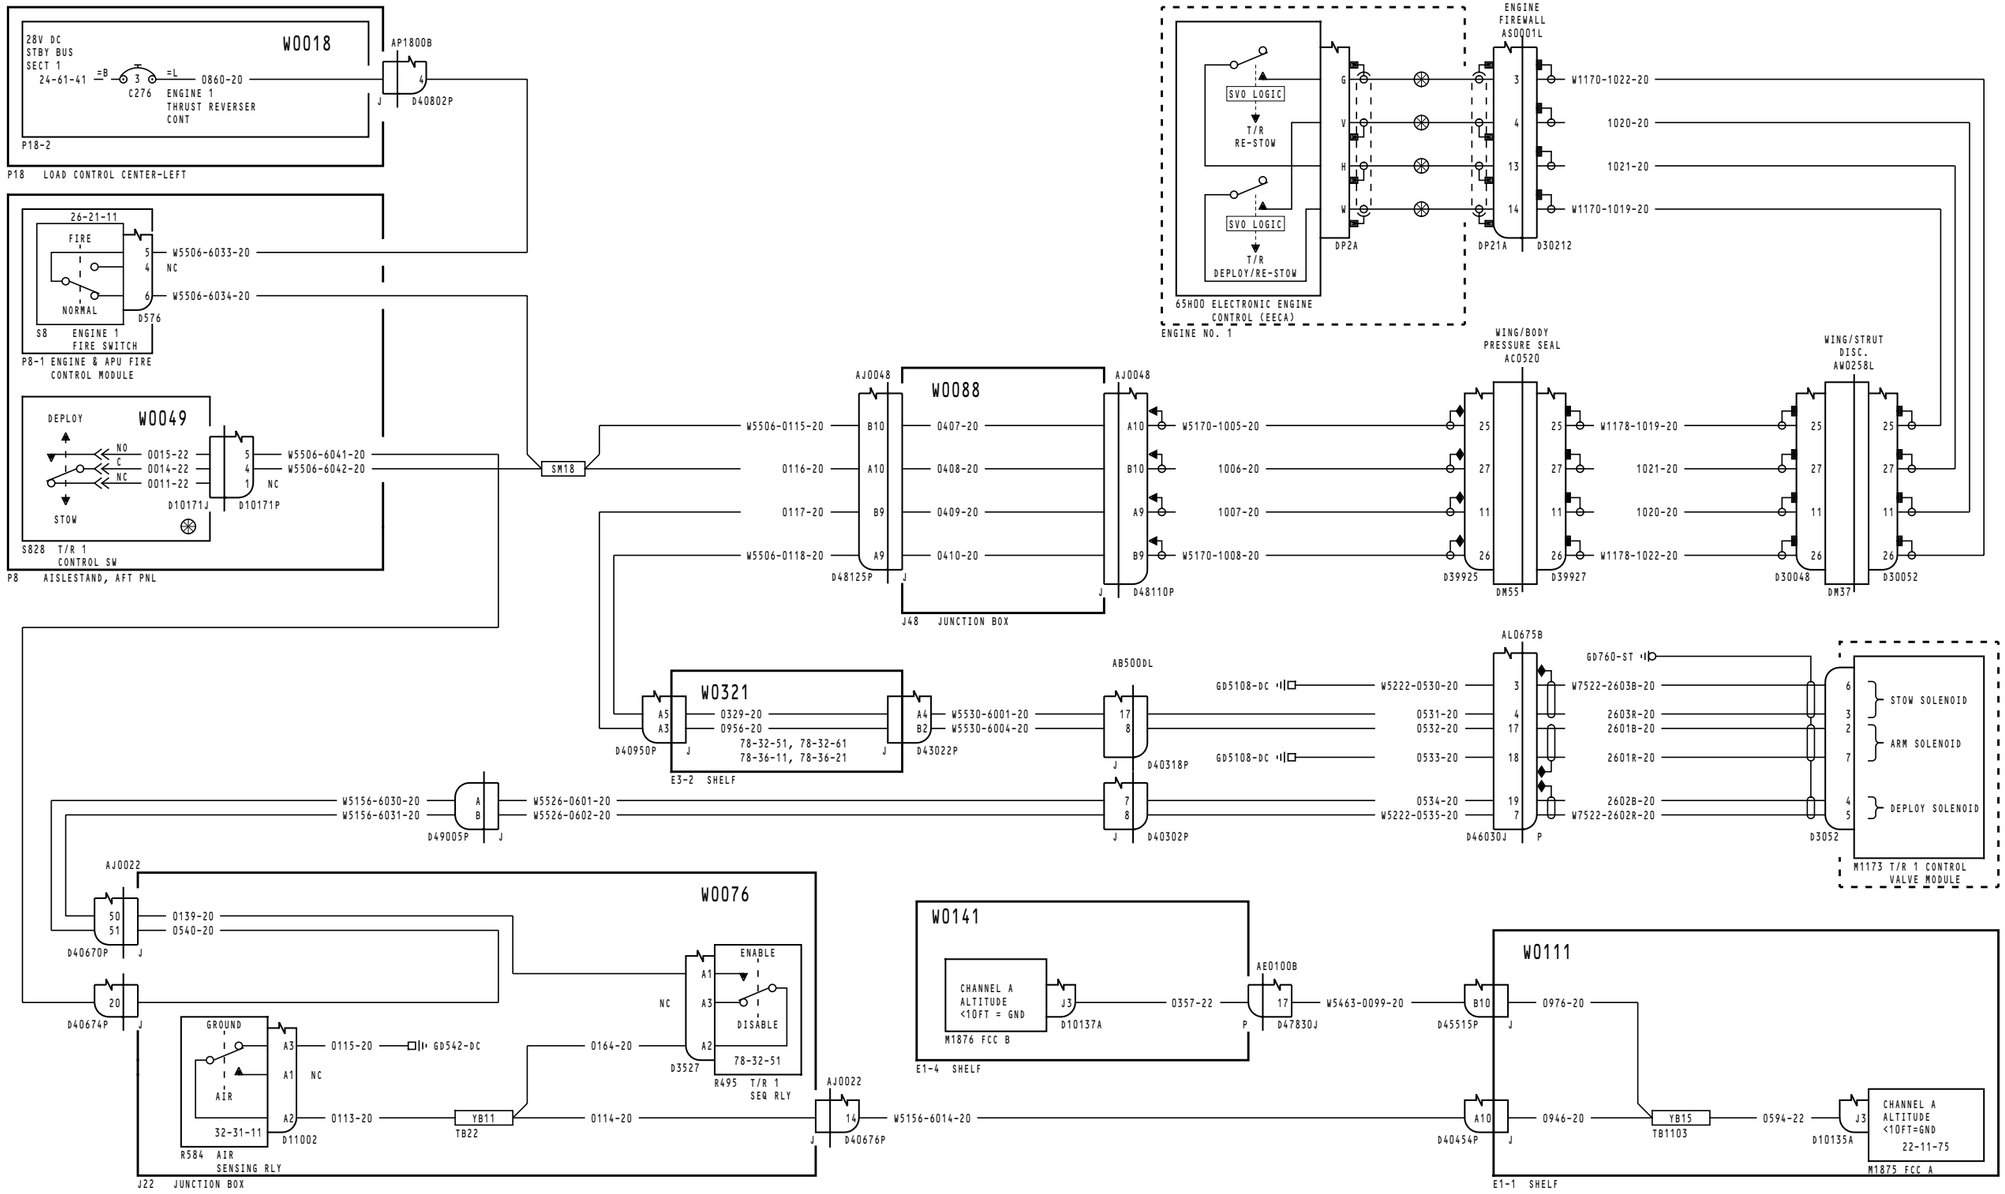


NOTE *: WIRES SHOULD NOT BE ROUTED WITH OTHER WIRES THAT CAN SUPPLY POWER (>200 MA AND > 5V).
IF THEY ARE ROUTED TOGETHER, MAKE SURE THAT THERE ARE NO ADJACENT PINS IN THE CONNECTORS THAT CAN SUPPLY FUEL.



ECCN 9E991 BOEING PROPRIETARY - See title page for details


78-34-11

Page 1

May 15/2024

737-8 WIRING DIAGRAM MANUAL

-C
16

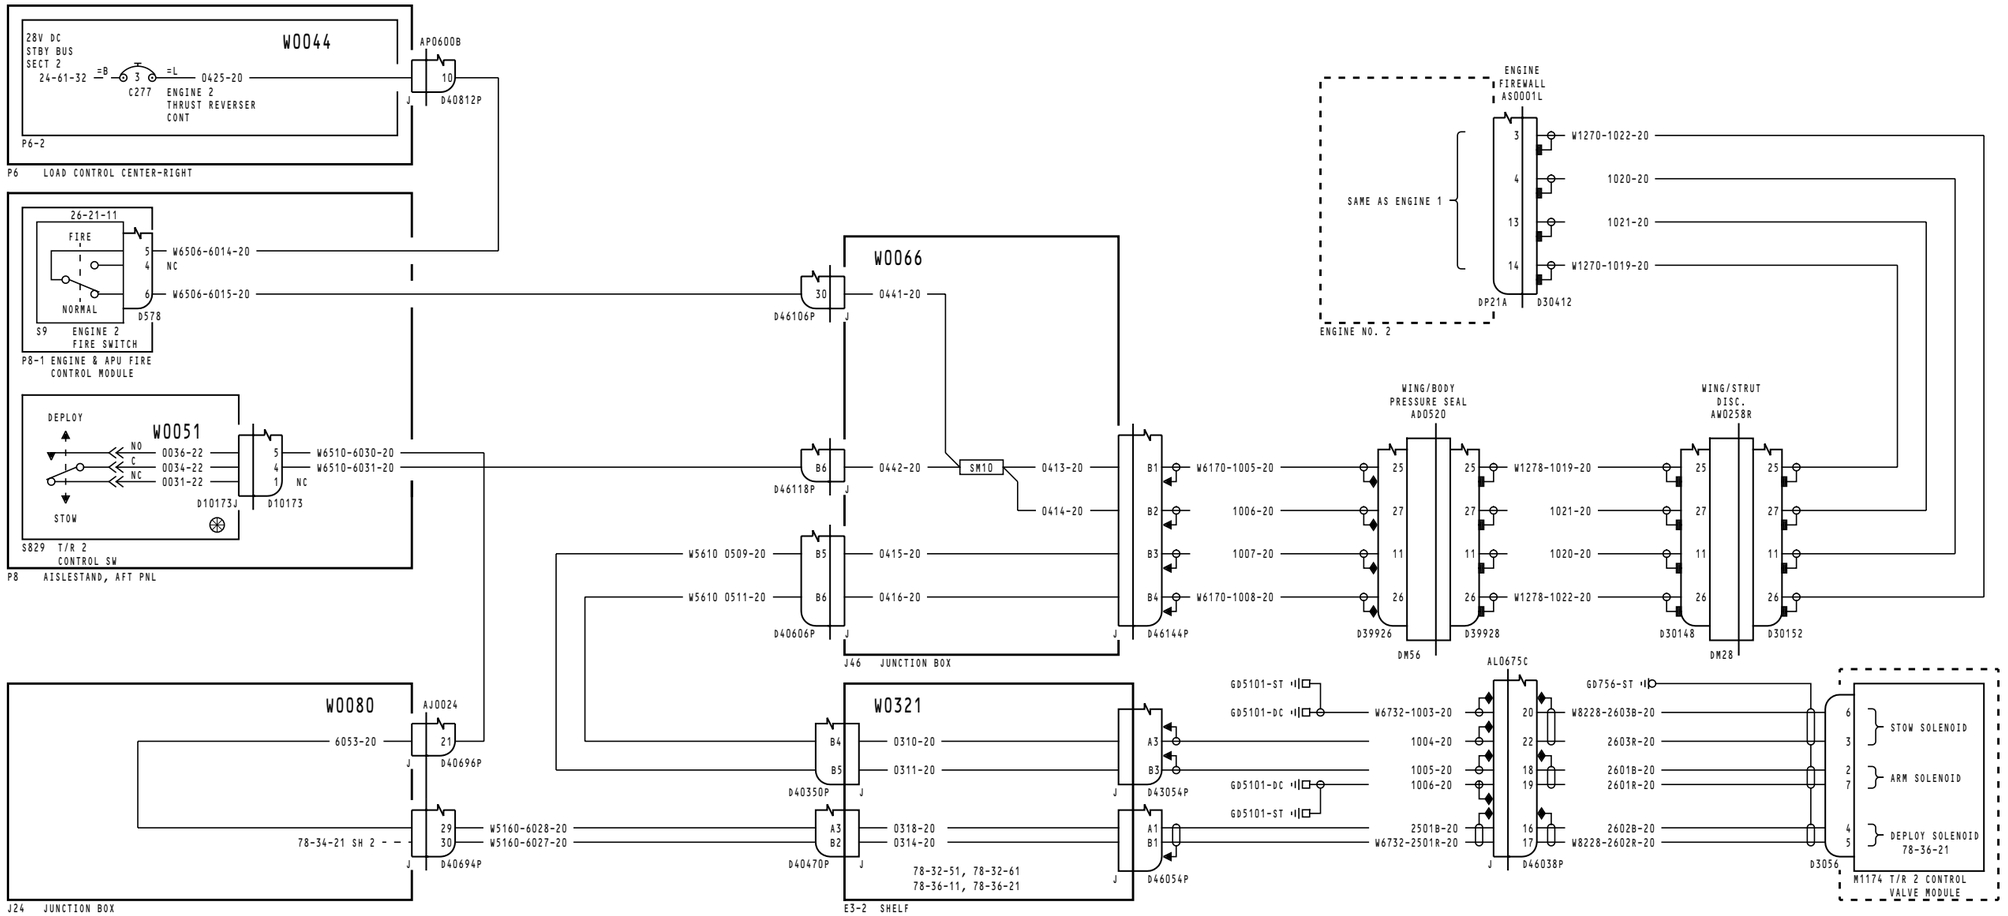


NOTE *: WIRES SHOULD NOT BE ROUTED WITH OTHER WIRES THAT CAN SUPPLY POWER (>200 MA AND > 5V).
IF THEY ARE ROUTED TOGETHER, MAKE SURE THAT THERE ARE NO ADJACENT PINS IN THE CONNECTORS THAT CAN SUPPLY FUEL.




ECCN 9E991 BOEING PROPRIETARY - See title page for details

78-34-21

Page 1
Sheet 1
May 15/2024

737-8 WIRING DIAGRAM MANUAL

2

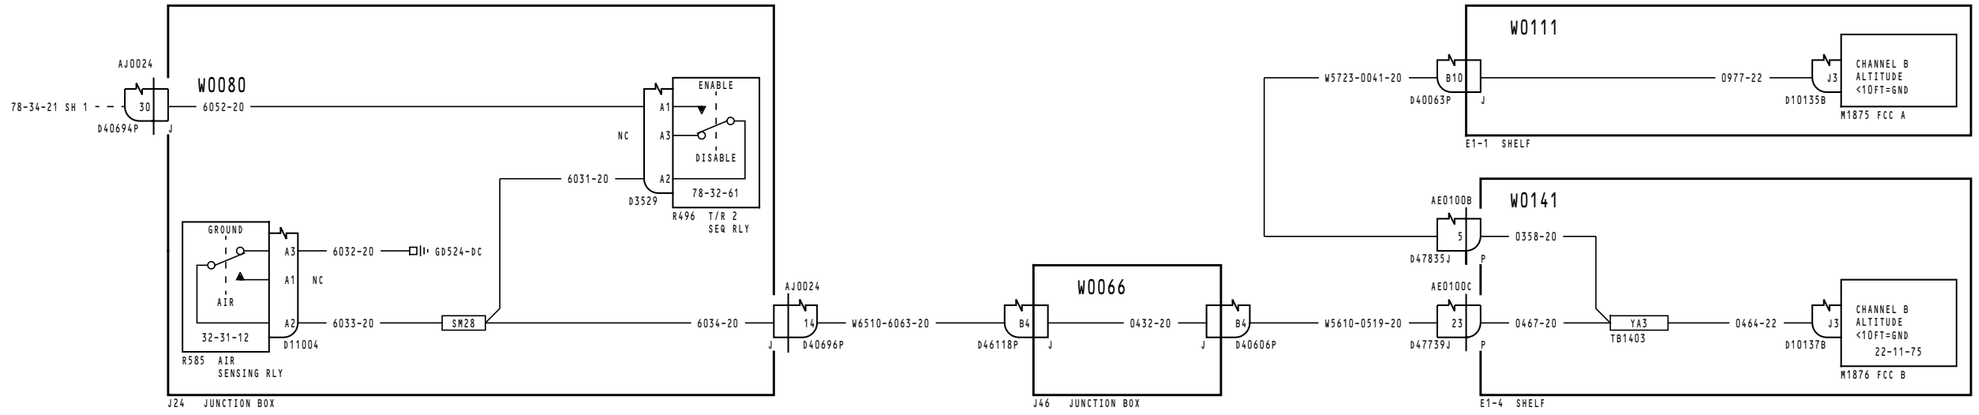


NOTE *: WIRES SHOULD NOT BE ROUTED WITH OTHER WIRES THAT CAN SUPPLY POWER (>200 MA AND > 5V).
IF THEY ARE ROUTED TOGETHER, MAKE SURE THAT THERE ARE NO ADJACENT PINS IN THE CONNECTORS THAT CAN SUPPLY FUEL.




ECCN 9E991 BOEING PROPRIETARY - See title page for details

78-34-21

Page 1
Sheet 2
May 15/2024

737-8 WIRING DIAGRAM MANUAL

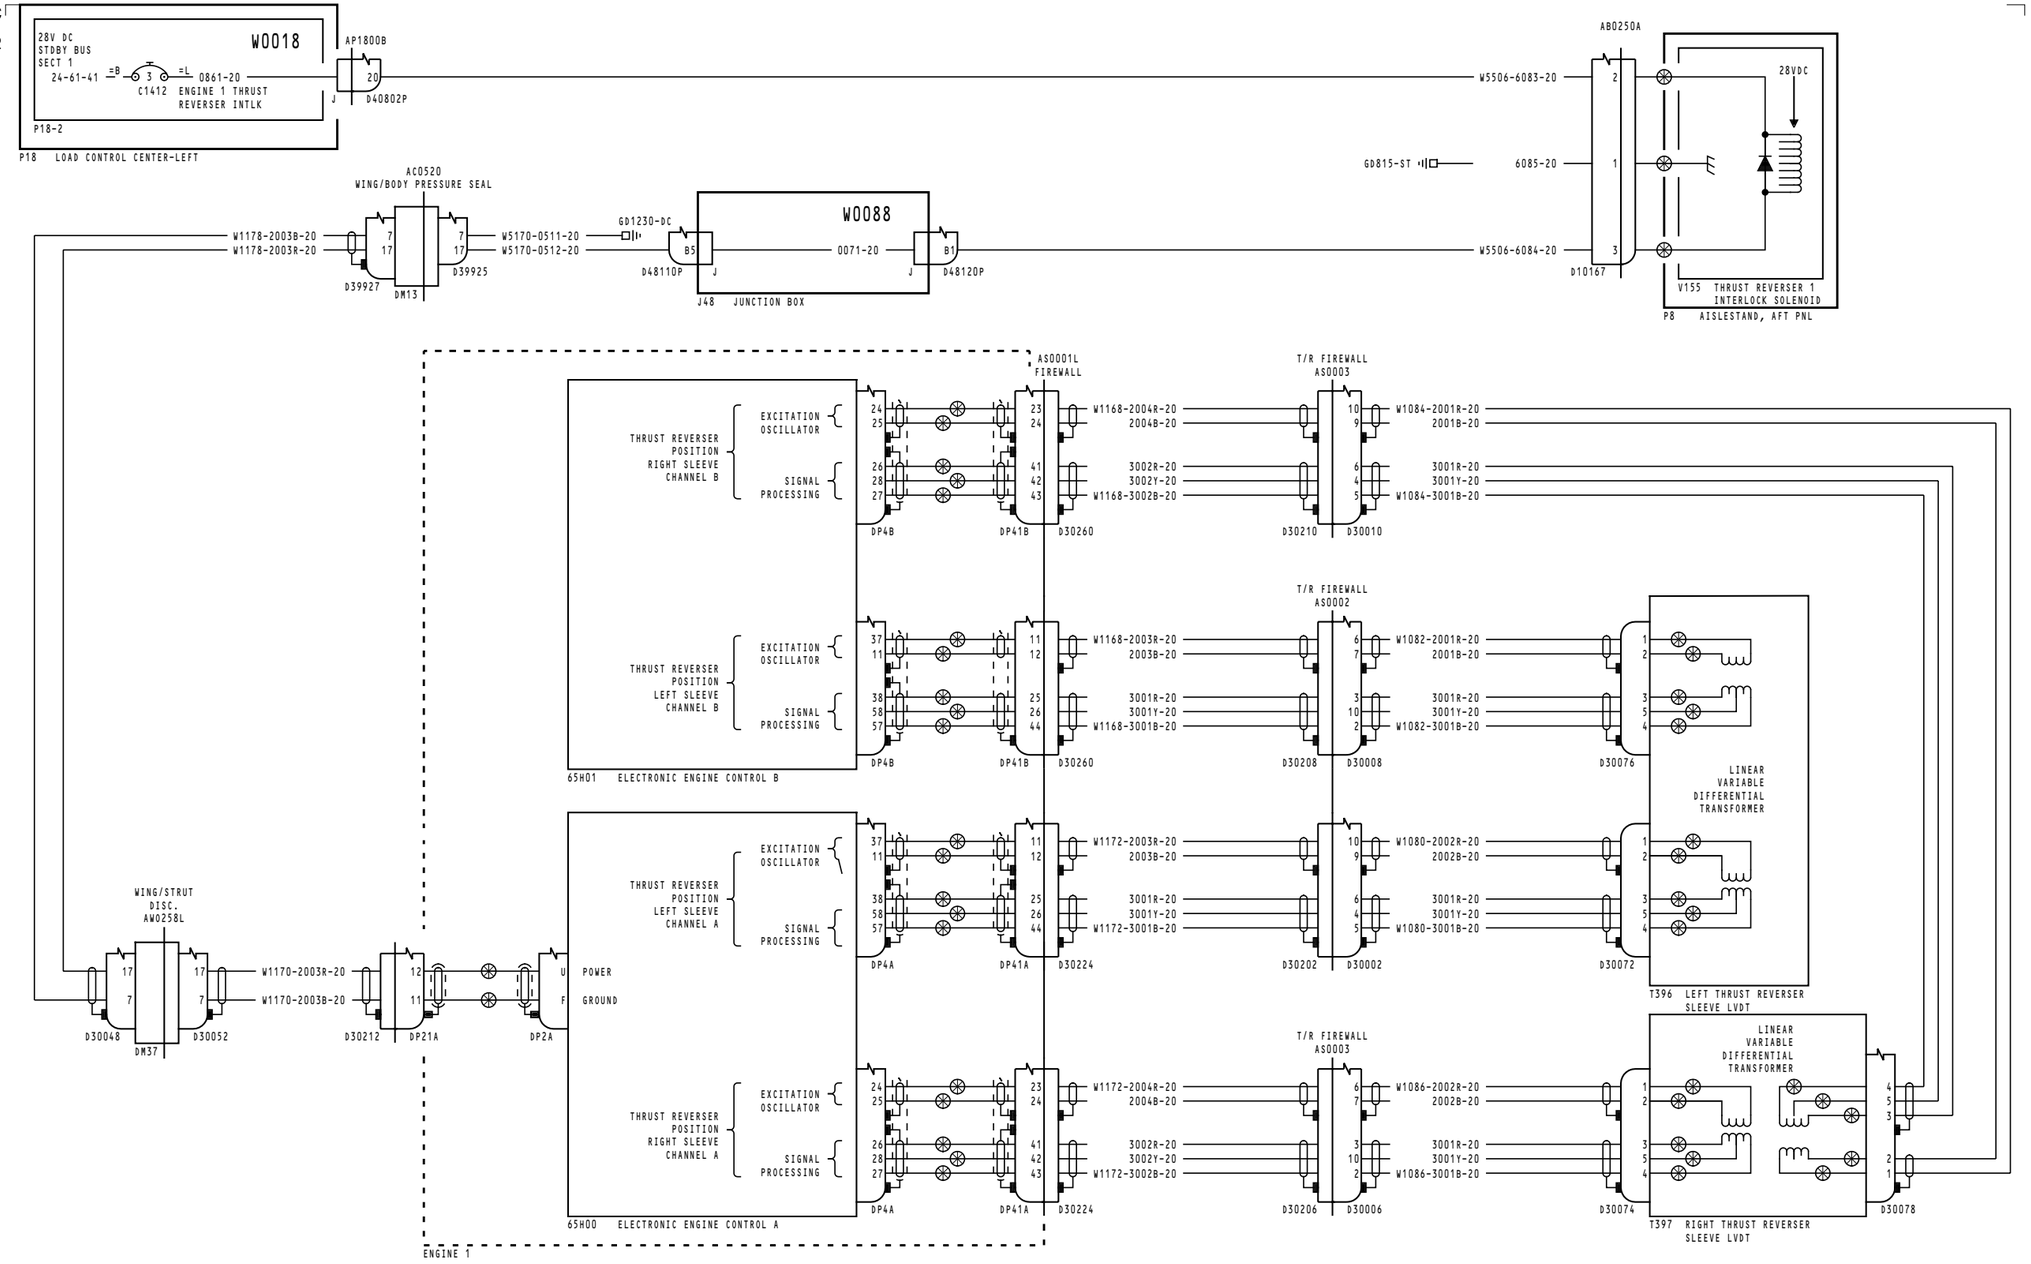





ECCN 9E991 BOEING PROPRIETARY - See title page for details

78-35-11

Page 1

May 15/2024

737-8 WIRING DIAGRAM MANUAL

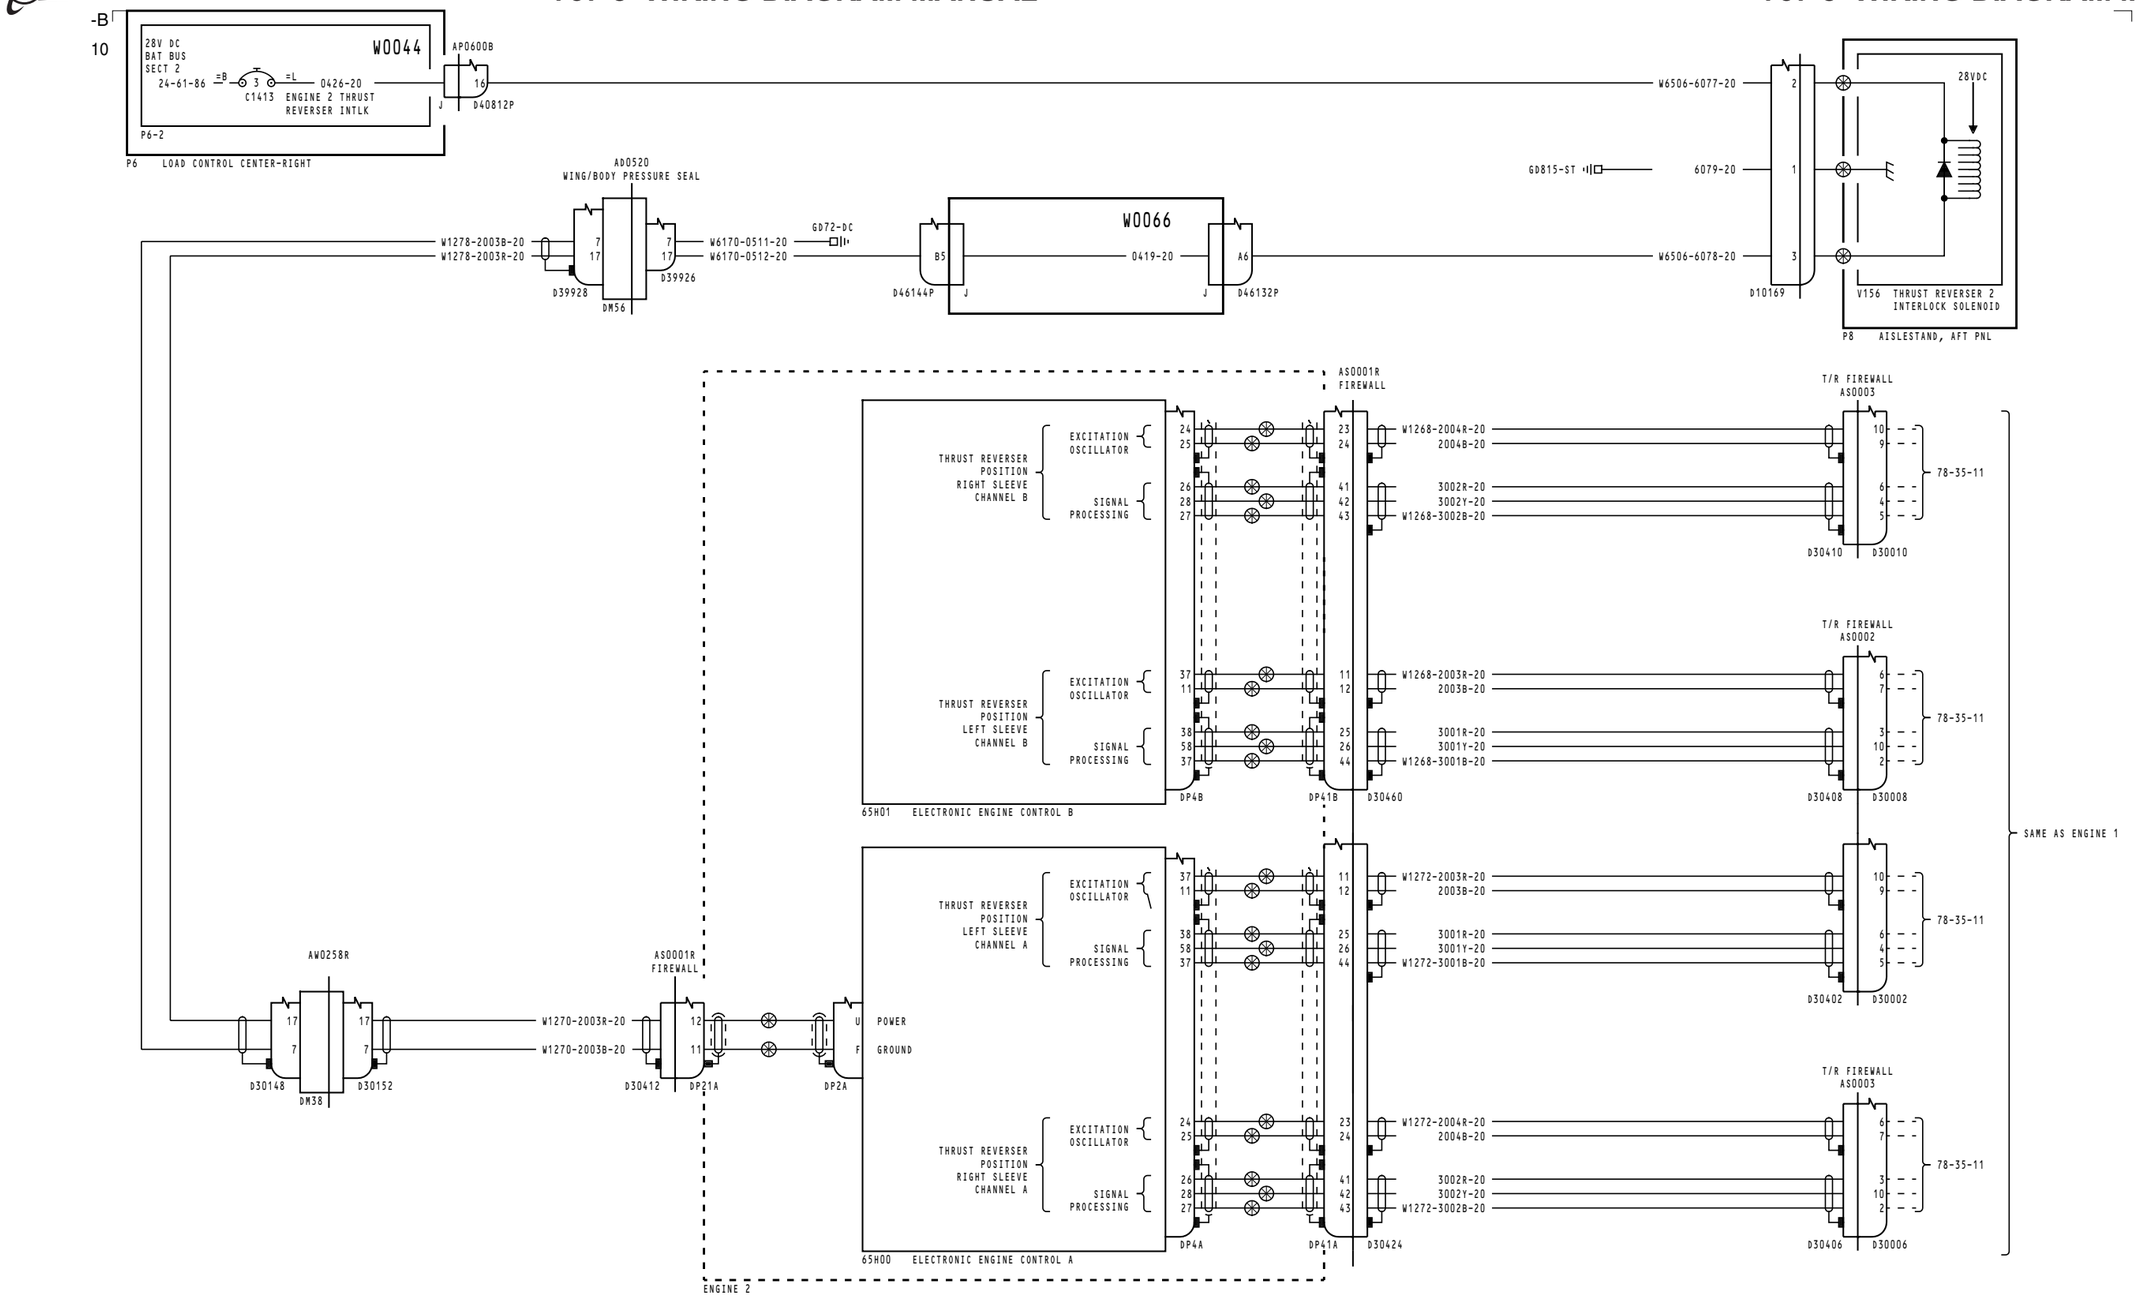



| ALL | ENGINE 2 THRUST REVERSER POSITION / THRUST LEVER INTERLOCK<br>D280AM1215 | 78-35-21<br>Page 1<br>May 15/2024 |
|---|---|---|

ECCN 9E991 BOEING PROPRIETARY - See title page for details

78-35-21
Page 1
May 15/2024

737-8 WIRING DIAGRAM MANUAL

10

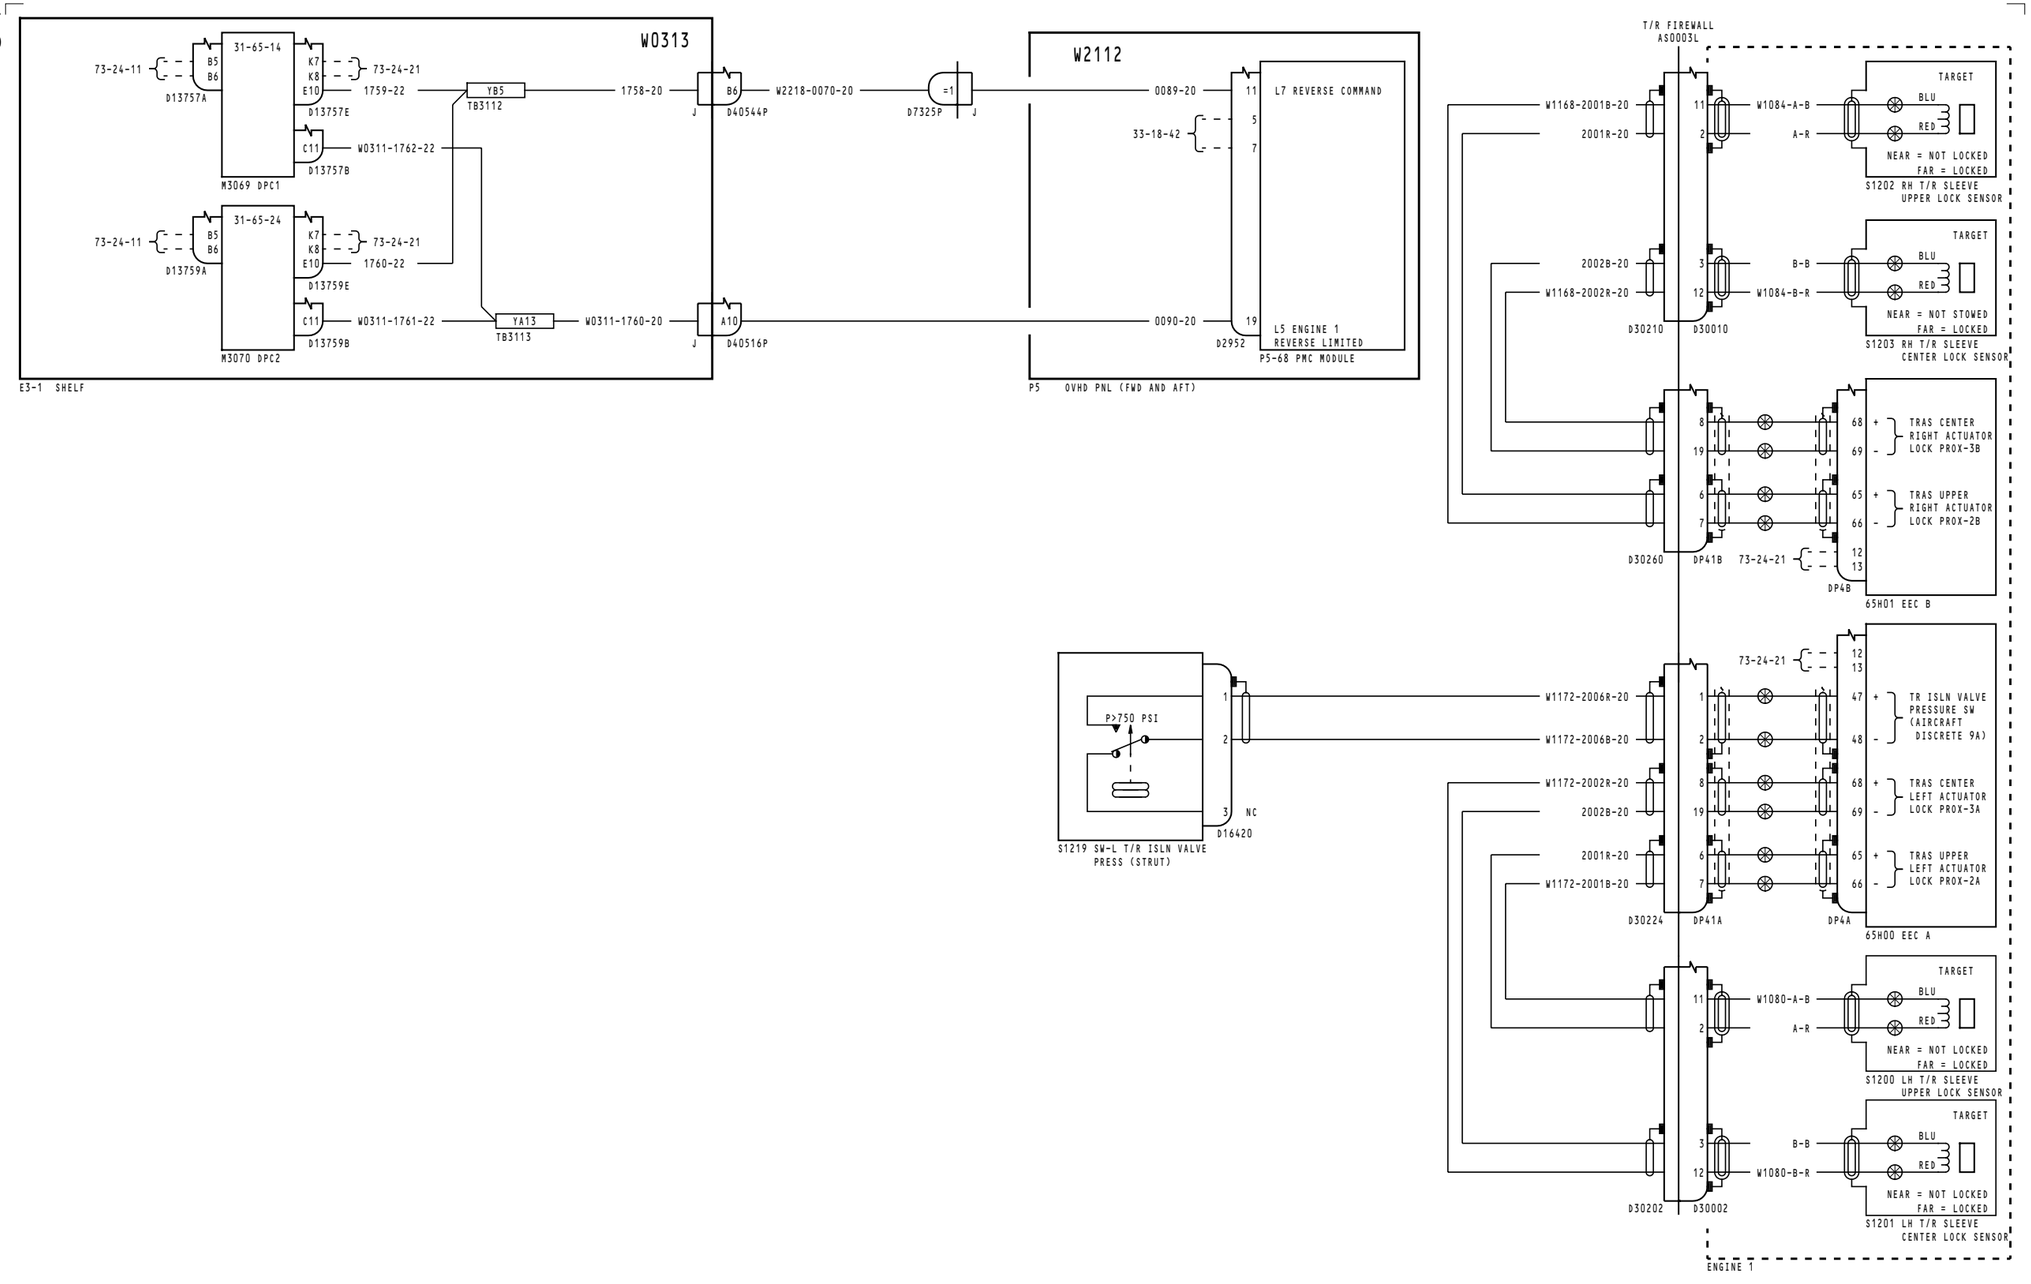


ALL

**ENGINE 1 THRUST REVERSER FLIGHT DECK INDICATION**

D280AM1215



**78-36-11**


Page 1

May 15/2024

ECCN 9E991 BOEING PROPRIETARY - See title page for details

737-8 WIRING DIAGRAM MANUAL

7

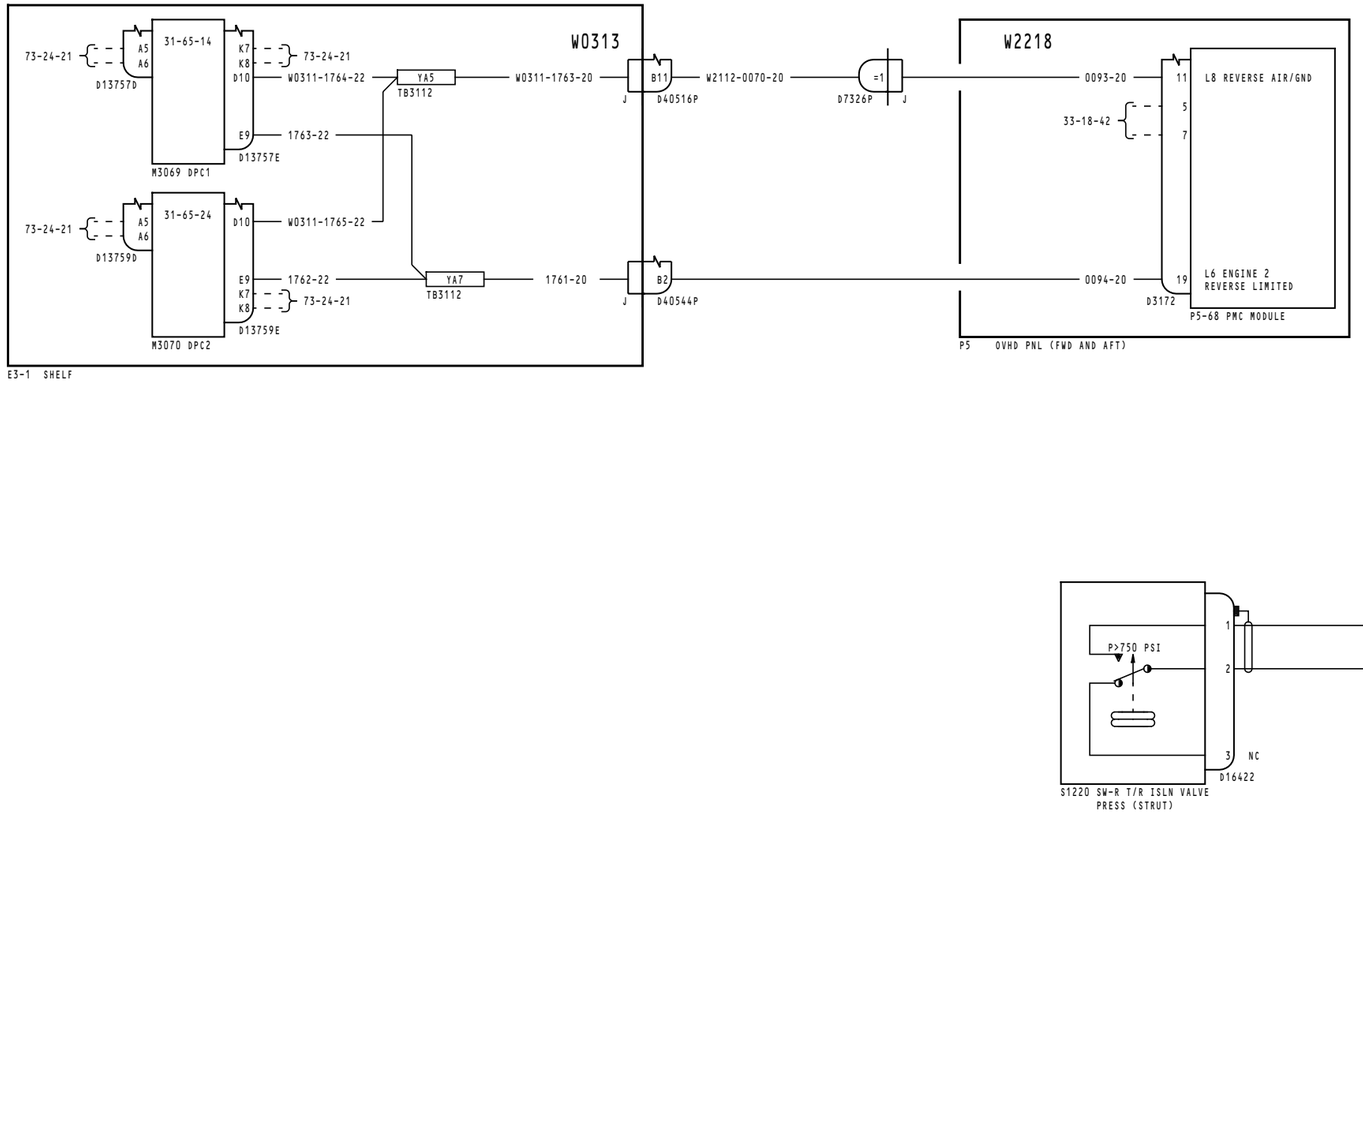




78-36-21

Page 1

May 15/2024

ECCN 9E991 BOEING PROPRIETARY - See title page for details