Apex Electronic Checklist File – Load Procedures

1. General

This document outlines the procedure for loading the APEX Electronic Checklist File.

2. Description

A. This procedure requires the following:

1) Laptop Computer with PCMCIA Card and 10BASE–T Network Adapter with LAN interface cable, or equivalent.

2) Proprietary Honeywell CMC Remote Terminal Software P/N PS7033676_001 V 5.0.2 or later applicable version.

3) APEX Electronic Checklist file as applicable. This file is prepared and edited using the Honeywell Electronic Checklist Designer software.

Refer to the Pilot Operating Handbook and/or Aircraft Flight Manual for details.

Note This procedure requires the COM 1 port of the laptop computer to be available. If problems are encountered disable other applications that may be using the COM 1 port.


3. Apex Electronic Checklist Load Procedure

A. The procedure and photos detailed below are specific to loading the APEX Electronic Checklist.

1) Gain access to the Avionics Maintenance Panel in the forward avionics area.

2) Power up APEX IAW AFM procedures.

3) Plug 10BASE–T Network Adapter into laptop PCMCIA card.

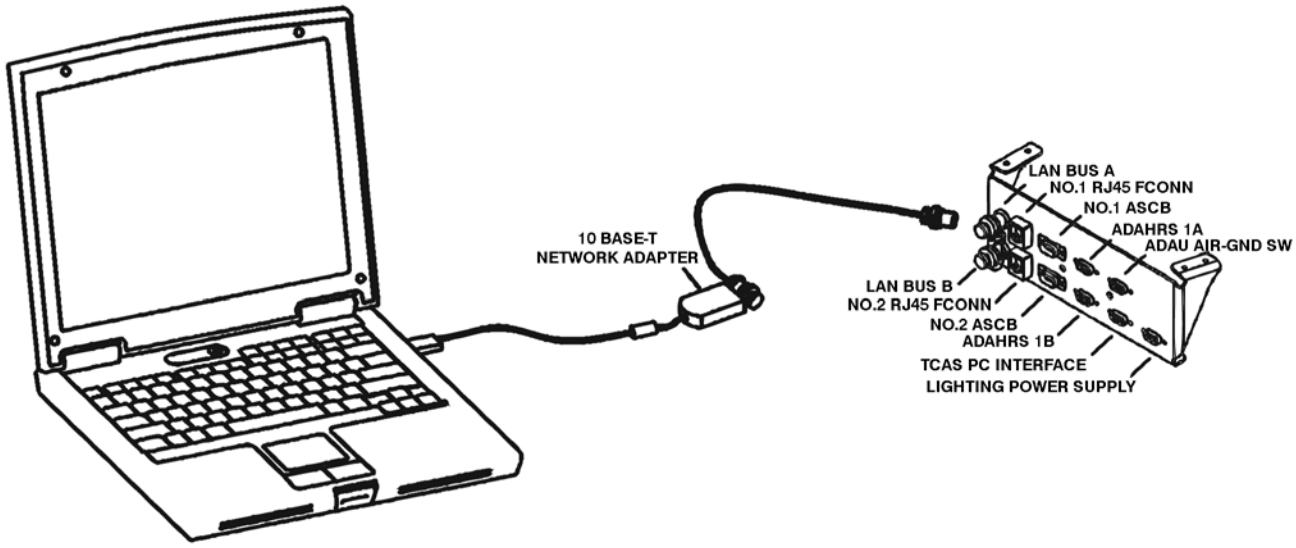


Forward Maintenance Panel
Figure 1

4) Plug the other end of Network Adapter into either LAN BUS A or LAN BUS B connector on the Forward Maintenance Panel.

   Note Either LAN connector will work.


5) On laptop computer open the CMC Remote Terminal Program.

6) Select DATA LOADER twice. A “Connection Failed” message may be displayed after the first selection of DATA LOADER.

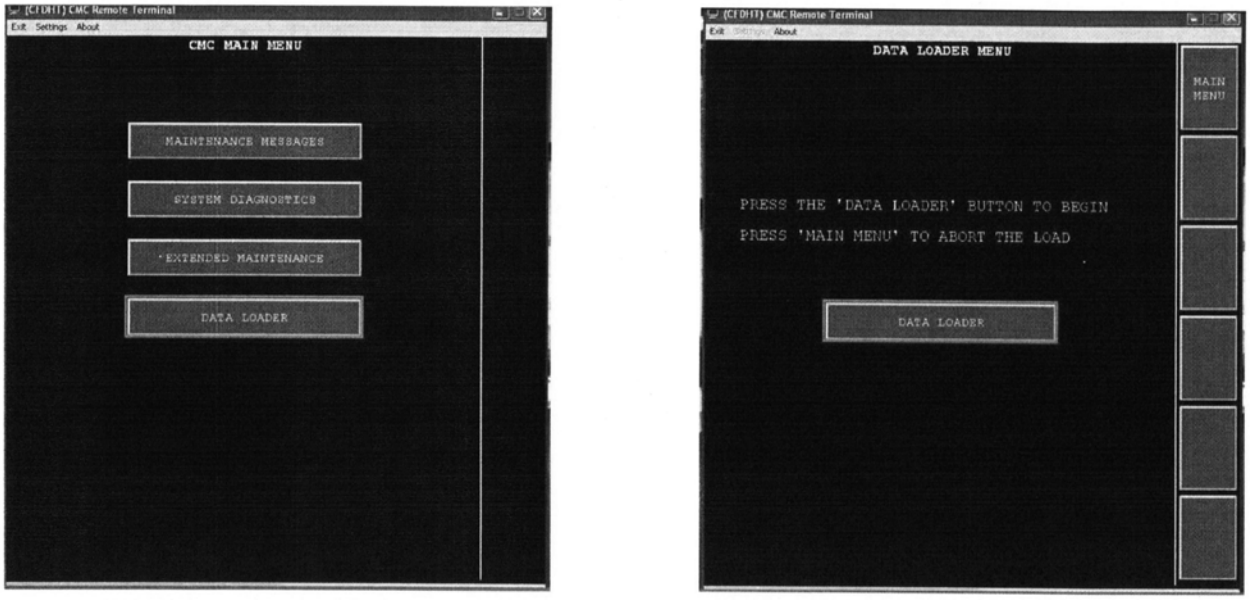

CMC Main Menu
Figure 2

7) The program will search the laptop computer for available drives. PRE-LOADING DRIVES will be displayed. This process may take up to 2 minutes. PRE-LOADING DMU/CDROM DRIVES – DONE will be displayed upon completion of this process.

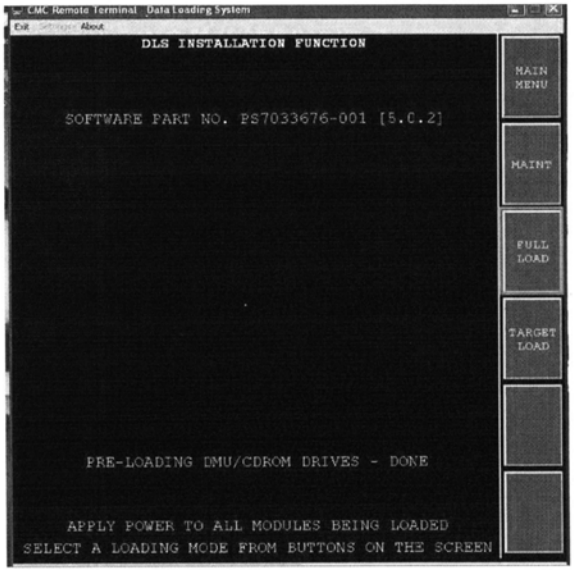

DLS Installation Function
Figure 3


8) Select “FULL LOAD” from menu on RH side of program window.

9) Arrow down and select “AVAILABLE DRIVES” <ENTER>.

10) Arrow down and select desired Database File <ENTER>.

Note The file will be prefixed with [DR].


Note Figure 4 is a typical example only.

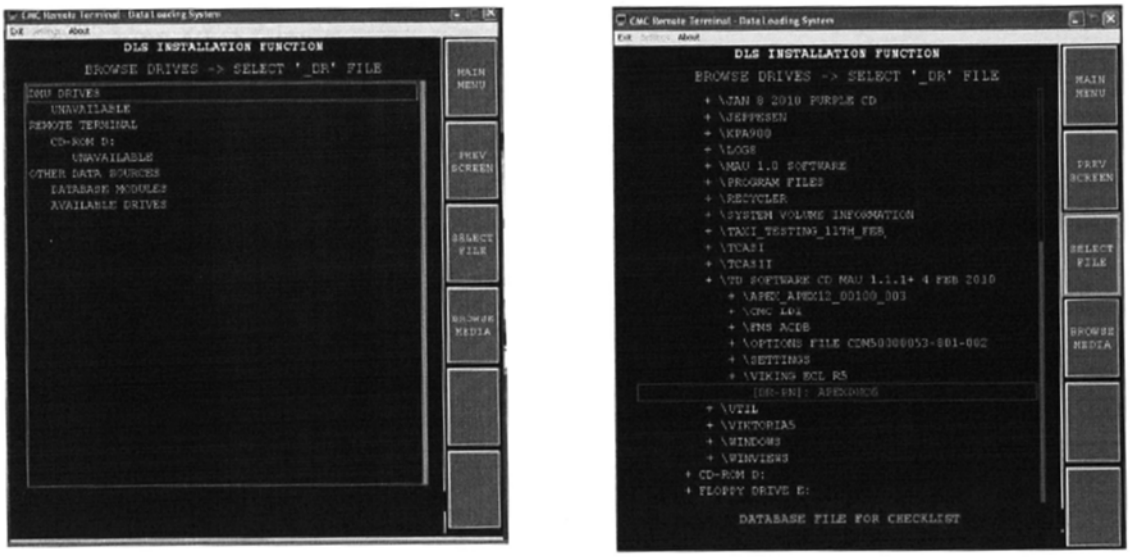

DLS Installation Function
Figure 4

11) Select SELECT FILE from menu on RH side of program window. “CONFIGURATION CHECK IN PROGRESS” will be displayed. Wait until complete. This may take up to two minutes. When complete “CONFIGURATION CHECK COMPLETE” will be displayed.


Note Figure 5 is a typical example only.

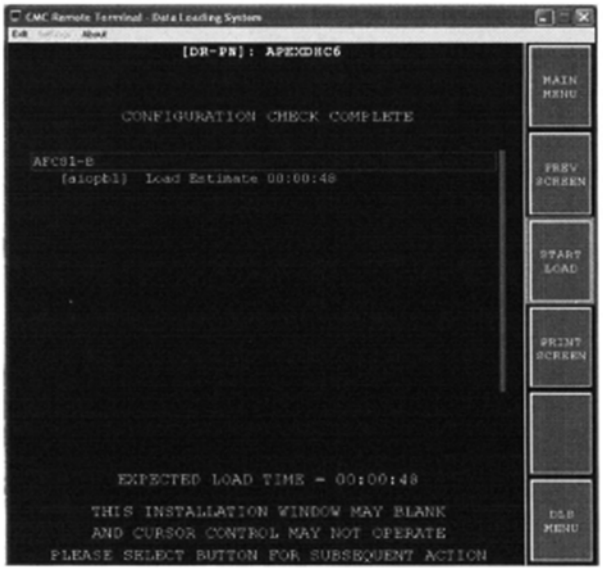

Configuration Complete
Figure 5

12) Select "START LOAD" from menu on RH side of program window. Wait until process is complete. The expected load time will be displayed. Upon process completion “LOADING SEQUENCE COMPLETE” will be displayed.

Note Figure 6 is a typical example only.

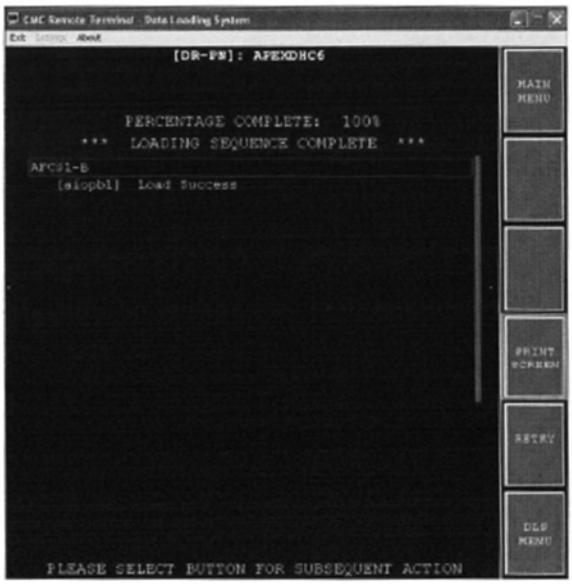

Loading Sequence Complete
Figure 6

13) Reserved.

14) Reserved.

15) Close CMC Remote Terminal Program. Disconnect laptop computer from the maintenance panel.

16) Remove aircraft power from APEX for minimum one minute.

17) Reapply power to APEX.

18) Verify no APEX errors are displayed following initialization. View the APEX Electronic Checklist and verify validity.

19) Via the aircraft cockpit displays and controls, the APEX SCMS/DL page may be used to verify APEX software, config settings and database status.

This Page Intentionally Left Blank