SHEET G-01 · OVERVIEW SCALE: SCHEMATIC, ±10 CM

One 14.5 m² entrance hall where the office and corridor used to be

Take out the plasterboard office wall, rebuild the flood-damaged walls in moisture-resistant board, and add a hall cabinet for coats and shoes. The work starts after Bouchet BTP's drainage works this November, and it has to fit inside Suravenir's 1,800 € cash payout.

INSURANCE PAYOUT	THIS PLAN, AS SELECTED	CONTRACTOR QUOTE YOU TURNED DOWN
1,800 €	**1,867 €**	**3,993 €**
auto-réparation, Suravenir	67 € over the payout	3,630 € HT + 10% VAT, drywall only

What your property file tells us

Taken from the sale agreement and its 2024 diagnostics (EASYDIAGS, 26 June 2024; risk statement, 13 Nov 2024). These facts drive several choices below.

BUILT
Before 1949

OUTER WALLS
50 cm stone (pierre de taille et moellons), uninsulated lining


GROUND FLOOR SLAB
Concrete on ground, uninsulated. **Good for floods**

CEILING HEIGHT
2.50 m

FLOOD PLAN (PPRN)
Approved 2020: not in an exposed zone. Revision prescribed 6 Sep 2023 for the whole commune. **Watch**

FLOOD DISASTERS DECLARED

Existing ground floor

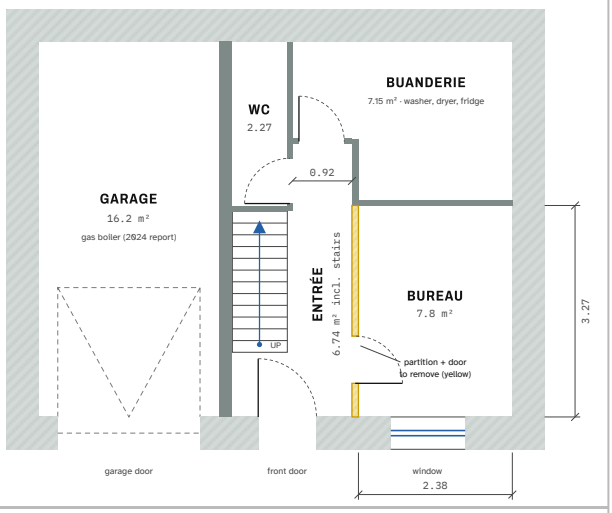

stone wall, 50 cm existing partition
to demolish (French convention: yellow)

Room areas are the surveyor's figures. Dimensions are worked back from those areas and the 2024 sketch, so treat them as ±10 cm and measure before you buy. The 6.74 m² entrance includes the stair footprint: its Carrez area is 5.13 m². Once merged you get about **13 m² of open floor**, and the stairs take the rest.

6 Sep 2008 and 9 Jun 2024 (inondations, coulées de boue)
ASBESTOS / LEAD None found in 2024 (listed materials; paint reads 0 mg/cm²). **Safe to demolish**
ELECTRICS (2024) No anomalies; whole house behind at least one 30 mA RCD
GAS BOILER De Dietrich, **in the garage**. Check how high it sits
NOTARY DESCRIPTION Lists a *cellier* (store room) on the ground floor, not an office. The office was probably fitted out later


The plan in six decisions

1. **Layout E (recommended):** a hall cabinet on the back wall you share with the buanderie: two painted cupboards for coats, an open bench nook between them with a shoe shelf, hooks and a lamp, and a rug. It looks like an entrance hall, not a bedroom wardrobe. It's an inside wall, so there's no cold-wall mould behind the coats. Four other layouts are on A-01.
2. **Strip out now, rebuild after the drainage.** Wet board and insulation come out this month so the walls can dry. Nothing new goes up until the pipe is fixed and moisture readings match a dry wall.
3. **Lay the green BA13 hydro board horizontally, with the first course 1.20 m high and a 1 cm gap at the floor.** After a flood up to 50 cm you replace one strip, not whole walls.
4. **Hire an electrician for half a day** (about 380 €). They confirm the removed circuits are safe, run the new drops from the ceiling, and put the ground floor on its own 30 mA RCD so you can switch it off during a flood. You do the rest yourselves.
5. **Keep the existing floor if it's sound** and fill the strip where the wall stood (about 40 €). Retile the hall in porcelain only if the floor is damaged or mismatched (about 410 €).
6. **Ask Bouchet BTP to fit a backflow valve while the trench is open.** Your flood came from a blocked drain, and this is the cheapest moment to stop it happening again.

A-01

Layout options for the merged hall

Five ways to use the roughly 3.40 × 3.27 m space plus the corridor. Click an option to see its plan. The button under each one loads its wardrobe into the budget on Q-01.

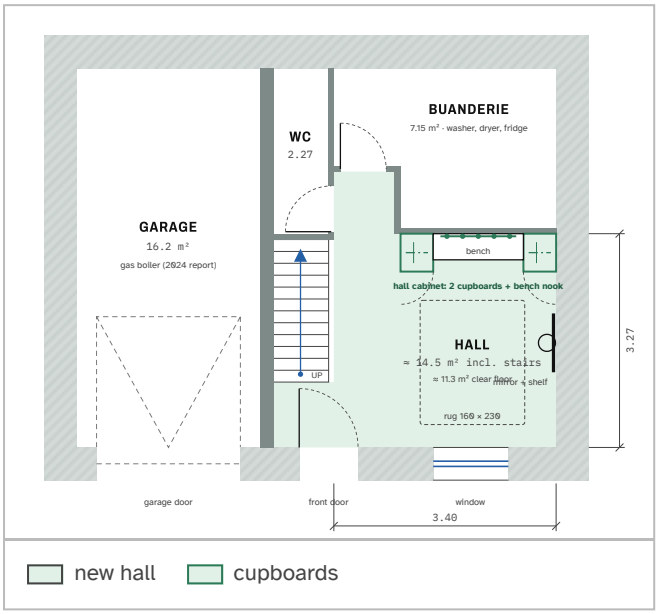

Option E · Hall cabinet + bench nook RECOMMENDED

Same back wall as Option A, but it reads as hall furniture, not a bedroom wardrobe. Two 50 cm cupboards with painted doors and wooden knobs stand on legs either side of an open 1.38 m nook. The nook has a bench to sit on for shoes, a shoe shelf under it, five hooks for everyday coats, and a shelf with baskets and a small lamp. A rug in the middle and a round mirror over a slim shelf by the door finish it.


Cupboards	2 × 50 × 58 × 216 cm on 15 cm legs
Nook	1.38 m: bench at 45 cm, shoe shelf, 5 hooks, shelf at 2.00 m
Coat space	96 cm of rail behind doors (about 16 coats) + 5 hooks
Clear floor	≈ 11.3 m²
Cost	≈ 450 € + ≈ 95 € for the rug, mirror and shelf

For

- Looks like an entrance, not a bedroom
- Everyday coats and shoes have their own place, and the rest hides behind doors
- A seat for putting shoes on
- Cupboards on legs and a wall-hung bench: the floor stays clear for mopping after a flood
- Nothing to build: no cheek wall, no niche

Against

- Less closed storage than A's 2.38 m wardrobe
- About 225 € more than A with a curtain front

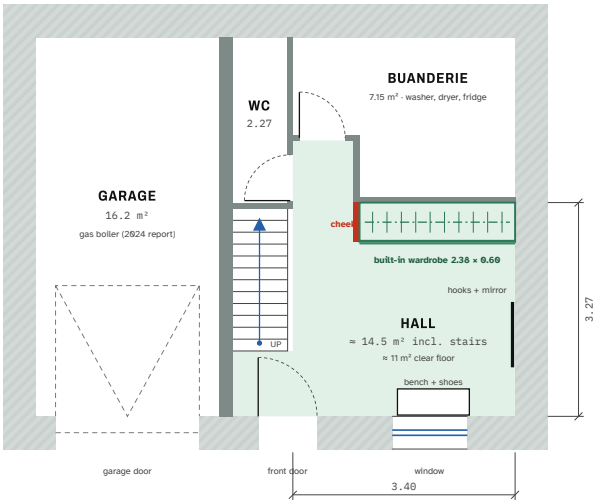

Option A · Storage wall at the back

The wardrobe fills the old office's back wall, the one shared with the buanderie, from floor to ceiling. A bench with shoe space sits under the window, with hooks and a mirror on the stone wall. From the front door you look into one clear, bright room.


Wardrobe	`2.38 × 0.60 × 2.50 m, built-in niche`
Side cheek	`keep the top 60 cm of the old partition frame, re-board it`
Clear floor	`≈ 11 m²`
Wardrobe cost	`225 € (curtain) to 450 € (3 sliding doors)`

For

- Inside wall, so no condensation behind the coats
- The window stays free and the hall stays bright
- Reuses part of the old wall as the niche cheek
- Nothing sticks out into the walkway

Against

- About 3 m from the front door (3–4 steps)
- Rules out a future door from the hall into the buanderie on that wall

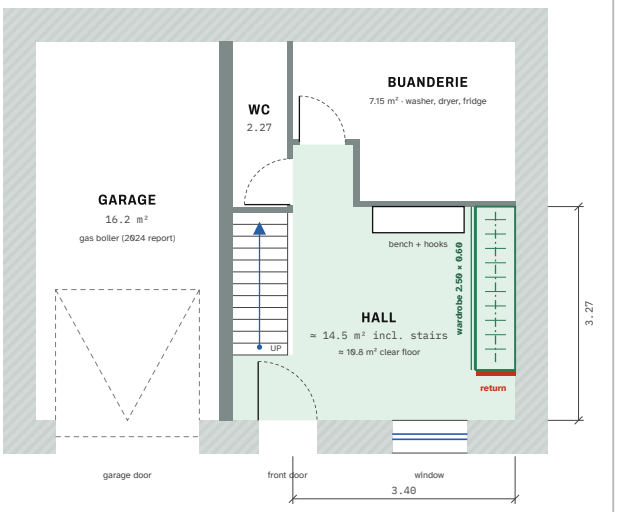

Option B · Long side wardrobe

A 2.50 m wardrobe runs along the right-hand stone wall, closed at the window end by a short stud return. A bench with hooks above goes on the back wall for jackets you wear every day.


Wardrobe	2.50 × 0.60 × 2.50 m
New wall	60 cm stud return at the window end
Clear floor	≈ 10.8 m² (hall narrows to 2.80 m)
Wardrobe cost	≈ 260 € (curtain niche) to 690 € (PAX 250 cm)

For

- The most storage: room for the vacuum, ironing board and overflow from the buanderie
- Bench and hooks catch the daily jackets

Against

- It's a 50 cm stone outside wall or the party wall, so it's colder. Leave a 3 cm air gap and vents top and bottom
- If it's the party wall, screw into the lining only and cut no chases
- Over budget if you choose PAX

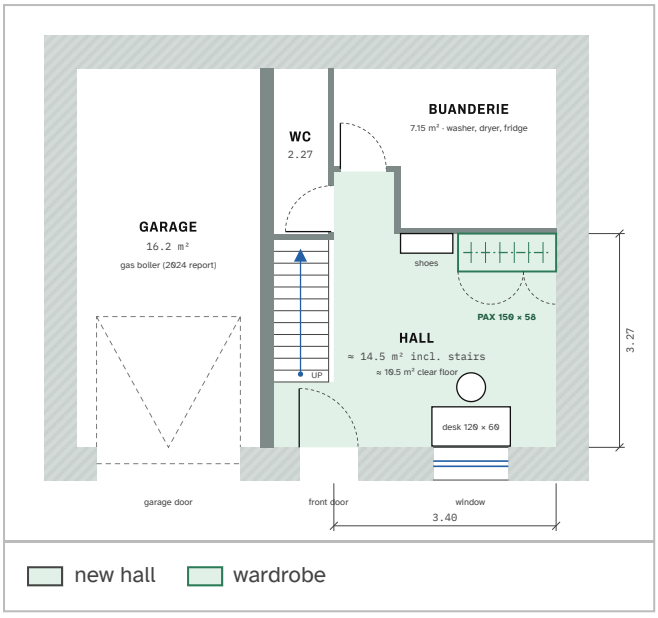

Option C · Hall + work corner

This keeps somewhere to work now the office has gone. A 120 × 60 cm desk sits under the window, a freestanding 1.50 m PAX stands on the back wall, and a shallow shoe cabinet goes by the corridor.


Wardrobe	PAX 150 × 58 × 236 cm (100 + 50)
Desk	120 × 60 cm, daylight from the front
Clear floor	≈ 10.5 m²
Cost	≈ 430 € PAX + 85 € desk

For

- You keep a desk with daylight
- No building work for the wardrobe, and everything can move later

Against

- The desk sits in the entrance: draughts when the door opens, cold by the window in winter
- Least storage of the four
- Doesn't feel like a big hall any more

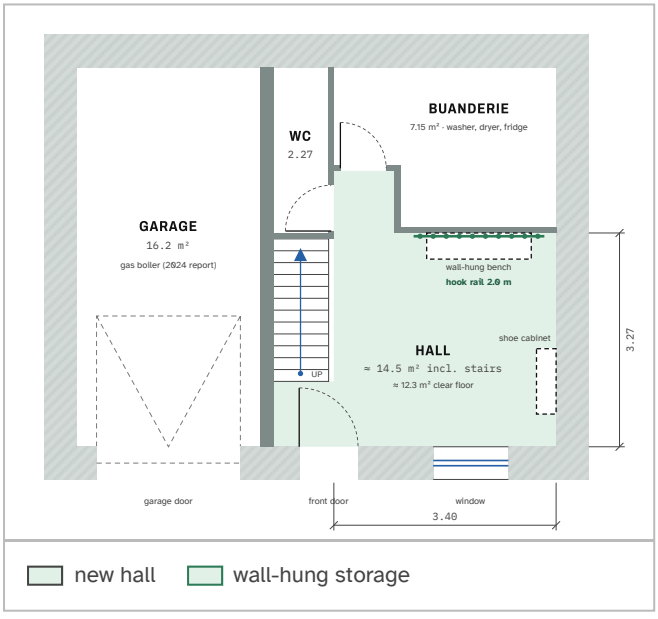

Option D · Open mudroom (budget)

No wardrobe. A long hook rail and a wall-hung bench go on the back wall, with a wall-hung shoe cabinet by the window. Nothing stands on the floor, so there's nothing to swell if water gets in.

Storage	2.0 m hook rail, 1.60 m bench, shoe cabinet
Clear floor	≈ 12.3 m²
Cost	≈ 150 €

For

- Cheapest and quickest
- The most open floor, and the easiest to clean after a flood
- Frees about 300 € for the backflow valve

Against

- Coats are always on show and collect dust
- Nowhere for seasonal things

OTHER IDEAS, NOT DRAWN

- **Under the stairs.** Knock on the side of the stairs. If it sounds hollow, a small door gives a cupboard for shoes or the vacuum. Old stairs are sometimes solid masonry, so check before you plan around it.
- **Doormat well.** A recessed coir mat in an aluminium frame inside the front door traps water and grit. It means cutting into the slab, so do it only if you retile.
- **Mirror door.** In Option A, making one sliding door a mirror gives you a full-length mirror and lights up the hall at no extra space.

S-01 Is the office wall load-bearing?

Almost certainly not. Spend an hour proving it before the first board comes off.

LIKELY VERDICT: NOT LOAD-BEARING

Plasterboard on metal studs (a *cloison de distribution*) is not designed to carry anything. In this house the structure is the 50 cm stone outer walls and the party wall, and the floors span between them. The notary's description lists a *cellier* rather than an office, which suggests the office walls went in later. Old houses still hide surprises, though: a timber post inside a lining, or a beam end resting on a partition. The checks below rule those out.

Eight checks, about an hour

1 **Knock along the wall.**
Hollow everywhere, with solid spots every 40–60 cm (the studs), means plasterboard on a frame. A dull, solid sound everywhere means masonry: stop and look further.

2 **Measure the thickness at the door frame.**
About 72 mm (13 + 48 + 13) or 98 mm means a standard partition. 15 cm or more could be brick or block.

3 **Find the studs.**
A magnet finds the screws, which sit about every 30 cm vertically. A stud finder also works.

STOP AND CALL A STRUCTURAL ENGINEER IF YOU SEE

- a timber or steel post, or a doubled or boxed stud, inside the frame
- a beam end, lintel or trimmer (chevêtre) resting on the wall
- brick, block or carreau de plâtre instead of a hollow frame
- new cracks upstairs, sticking doors or a ceiling that drops as you work

A bureau d'études structure or an architect charges about 300–600 € for a site visit and written note. Prop the ceiling with acrow props (étais, about 10 € per day to hire) while you wait.

THE PARTY WALL IS A SEPARATE MATTER

The right-hand 50 cm stone wall on the plan may be the wall you share with the neighbours (mur mitoyen). You can line it and screw furniture to it. Cutting chases or recesses into it needs their agreement (Code civil, art. 662).

ASBESTOS AND LEAD

The 2024 reports found no asbestos in the listed materials and no lead in the wall and ceiling paint (every reading was 0). A modern plasterboard partition can't contain asbestos anyway. Wear an FFP3 mask all the same, because gypsum dust irritates the lungs.

4 **Look inside.**
Switch the circuit off, unscrew a socket or switch and shine a torch into the box hole. You should see metal C-studs and an empty cavity. A 10 × 10 cm hole at 1 m height is fine too, since the wall is coming out anyway.

5 **Check the top.**
Is there a beam (poutre) running across above the wall? Does the ceiling run continuously over it? A boxed-in beam shows as a bulkhead.

6 **Look at what is directly above on the 1st floor.**
The kitchen (22.6 m²) and living room (20 m²) are large open rooms. If no wall stands on this line upstairs and the floor doesn't sag there, the partition carries no floor load.

7 **Check the joist direction.**
The garage ceiling often shows the floor structure. Joists running parallel to the partition can't rest on it. Joists running across it still won't rest on a plasterboard wall, but look for a post.

8 **Remove boards from one side first.**
Take one face off, look at the bare frame, then take the second face off. Remove the studs last.

C-01

Work sequence, step by step

Do these in order. Tick each step as you finish it; this browser remembers your ticks. Times are for two people.

Phase 0 · Now, before the drainage works NOV 2026

- [ ] **1. Photograph and document everything** YOU 1 h
  Take dated photos and video of every damaged wall. Measure the height of the water marks, because that tells you how high the water rose. Keep Suravenir's letter for the 1,800 € and every receipt from now on.

- [ ] **2. Call Bouchet BTP** YOU call
  Confirm the dates. Ask whether, with the trench open, they can fit a backflow valve (EN 13564) and an inspection chamber on your branch. Ask for a written report or invoice as proof the cause was fixed.

- [ ] **3. Do the structural checks on sheet S-01** — YOU · 1 h
  Knock, measure, look inside a socket box, check upstairs. Stop at any red flag.

- [ ] **4. Measure for real and note what's there** — YOU · 1 h
  Measure every wall and mark it on a print of A-01. Note the radiator position, every socket and switch on both faces of the office wall, and the floor type (tile? the same on both sides?).

- [ ] **5. Get an electrician's quote and a date** — PRO · call
  Half a day: check the removed circuits, new drops, an RDC RCD in the panel. Book it for when the walls are open (December).

Phase 1 · Strip-out WEEKENDS OF 14 AND 21 NOV

- [ ] **6. Protect and make the electrics safe** — YOU · 2 h
  Cover the stairs and floor and tape plastic over the doorways. Switch off the circuits, test every conductor with the VAT tester, photograph each box, disconnect, cap with Wago connectors and label.

- [ ] **7. Remove the office door, frame and skirting** — YOU · 1 h
  Unscrew the frame (huisserie) from the studs. Keep the door if it's undamaged; it can go to a reuse point at the déchetterie.

- [ ] **8. Take down the partition** — YOU · 3 h
  Score the joints, remove one face, inspect the frame (S-01 check 8), then the second face, then cut out the studs and rails. For Option A, keep the top 60 cm of frame as the wardrobe cheek. For Option E, take the whole frame out.

- [ ] **9. Cut out the flood-damaged board on the remaining walls** — YOU · 4 h
  Cut horizontally at 1.20 m, or 30 cm above the highest stain if that's higher. Pull out any wet insulation. Do the buanderie and WC at the same time if they're affected.

- [ ] **10. Sort and take away the waste** — YOU · 2 h
  Plasterboard to the plâtre skip, metal, insulation and wood separately. The déchetterie is free with your badge.

Phase 2 · Drainage works and drying MID NOV TO MID DEC

- [ ] **11. Bouchet BTP lays the Ø200 mm drainage pipe** — EXTERNAL · TBC
  Ask them to show you the connection and any valve before they backfill. Keep their paperwork.

- [ ] **12. Dry and monitor** — YOU · 2–5 wk
  Heat on and the dehumidifier running; open the windows for 10 minutes twice a day. Brush salt deposits off the stone and treat stains with anti-mould. Take readings every week at the same marked points and compare them with a dry wall upstairs. Rebuild only when they match.

Phase 3 · First fix WEEK OF 7 DEC

- [ ] **13. Electrician's first fix** — PRO · ½ day

  New cables down from the ceiling to boxes at 1.10 m, switches by the front door and the buanderie door, a second ceiling point, and the ground floor on its own 30 mA RCD.

- [ ] **14. Patch the floor and ceiling where the rails were** — YOU · 2 h

  Fill the fixing holes. If the ceiling has a gap or a step, screw in a strip of BA13 (add a batten if there's nothing to screw into). On old plaster-on-lath ceilings, cut the joint with a knife before you pull the rail, so the plaster doesn't crack.

Phase 4 · Walls WEEKENDS OF 9 AND 16 JAN

- [ ] **15. Repair and add framing** — YOU · 3 h

  Build the wardrobe cheek (A) or return (B) and replace any rusted bottom rails. Use furrings on the stone walls with an air gap behind.

- [ ] **16. Board with BA13 hydro** — YOU · 1½ days

  Lay it horizontally, first course 1.20 m, with a 1 cm gap at the floor (use an offcut as a spacer). Screws at most 30 cm apart, joints staggered. Never glue the bottom course to the stone with plaster dabs.

- [ ] **17. Tape and joint** — YOU · 3 evenings

  Paper tape and three thin coats (fill, tape, finish), with metal corner tape on outside corners. Feather the ceiling patch 30–40 cm wide. Sand under a raking light.

Phase 5 · Floor WEEK OF 11 JAN

- [ ] **18. Close the floor join, or retile** — YOU · ½–3 days

  Repair the strip with a matching tile, a contrasting inlay or a flat divider profile. If you retile: remove the old covering first, lay porcelain on C2 adhesive with levelling clips and use cement grout. Keep the first stair riser at its current height so the steps stay even.

Phase 6 · Finish LATE JAN TO EARLY FEB

- [ ] **19. Prime and paint** — YOU · 2 days

  Primer on all new board and patches, then two coats of washable paint on the walls. Repaint the whole ceiling.

- [ ] **20. Fit the skirting** — YOU · 3 h

  Tile or PVC, covering the 1 cm gap, sealed to the floor with flexible mastic.

- [ ] **21. Electrician's second fix** — PRO · 2 h

  Faceplates and lights on, RCD test button tried, sign-off.

- [ ] **22. Build and fix the hall cabinet** — YOU · 1 day


  Anchor every tall unit to the wall. Put the water sensor on the floor by the door.

- [ ] **23. Close the file** — YOU · 1 h

  Take final photos and file the receipts and Bouchet BTP's report with your insurance papers. Print the flood-day checklist (F-01) and stick it inside a cupboard door.

E-01 Electrics: what goes, what's new

Electrical plan for Layout A, using French plan symbols. Every socket and switch sits at 1.10 m, with cables dropping from the ceiling.

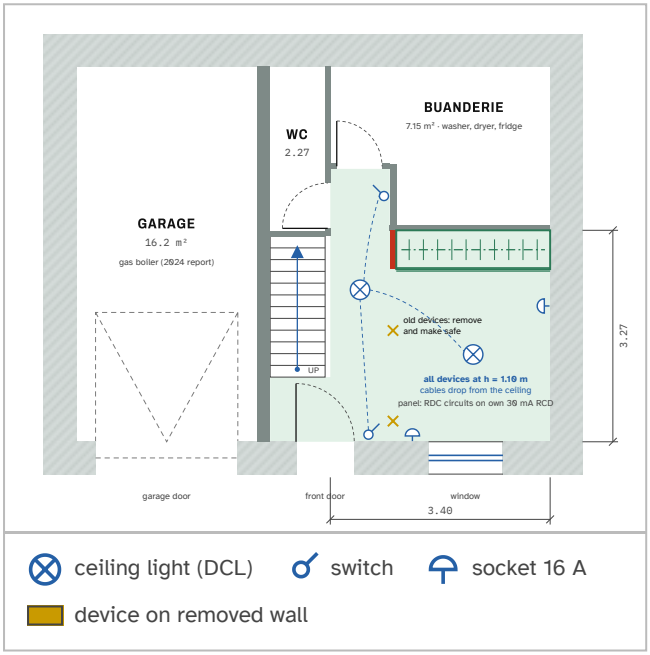

Taking out the old devices

1. Switch off the breaker(s), then test **every** conductor with a VAT voltage tester. A screwdriver tester isn't proof.
2. Photograph each box before you disconnect it. A partition can carry a cable on to another room, such as the buanderie, so trace where each one goes.
3. Cap each live-side cable with a Wago connector inside an accessible junction box, or pull it back to the ceiling. Never bury a junction in a wall or leave it at floor level.
4. Look for anything else in the wall: a radiator pipe, a thermostat cable, the doorbell, TV coax or RJ45.

The new hall

- **Lights:** two ceiling points on DCL boxes, one in the old corridor and one reusing the office point. Wire them on two-way switches or push buttons with a télérupteur.
- **Switches:** one by the front door on the latch side, and one by the buanderie door. Both at 1.10 m.
- **Sockets:** two 2P+T 16 A sockets at 1.10 m, one by the wardrobe for the vacuum and one by the bench for charging.
- **Cable sizes:** 1.5 mm² on a 16 A breaker for lighting and 2.5 mm² on a 20 A breaker for sockets, in ICTA conduit inside the board. The electrician matches them to your existing circuits.

- **Panel:** put every ground-floor circuit behind its own 30 mA RCD (interrupteur différentiel 40 A) and label it "RDC". In a flood you switch off the ground floor and keep power upstairs.


WHAT THE RULES SAY

Under NF C 15-100, socket centres sit between 5 cm and 1.30 m above the finished floor. The 1.30 m limit comes from the accessibility rules for new homes, and 1.10 m fits inside it. DIY electrical work on your own home is legal, but it must meet NF C 15-100, and your insurer can refuse a fire claim caused by faulty work. A partial modification like this doesn't need a Consuel certificate; that applies to new or fully rewired installations.

A-02

Hall cabinet and wardrobe: design and sizes

Coats need 55–60 cm of depth. Allow 25–30 cm of rail per person per season; long coats hang about 1.40–1.50 m and jackets about 1.00 m.

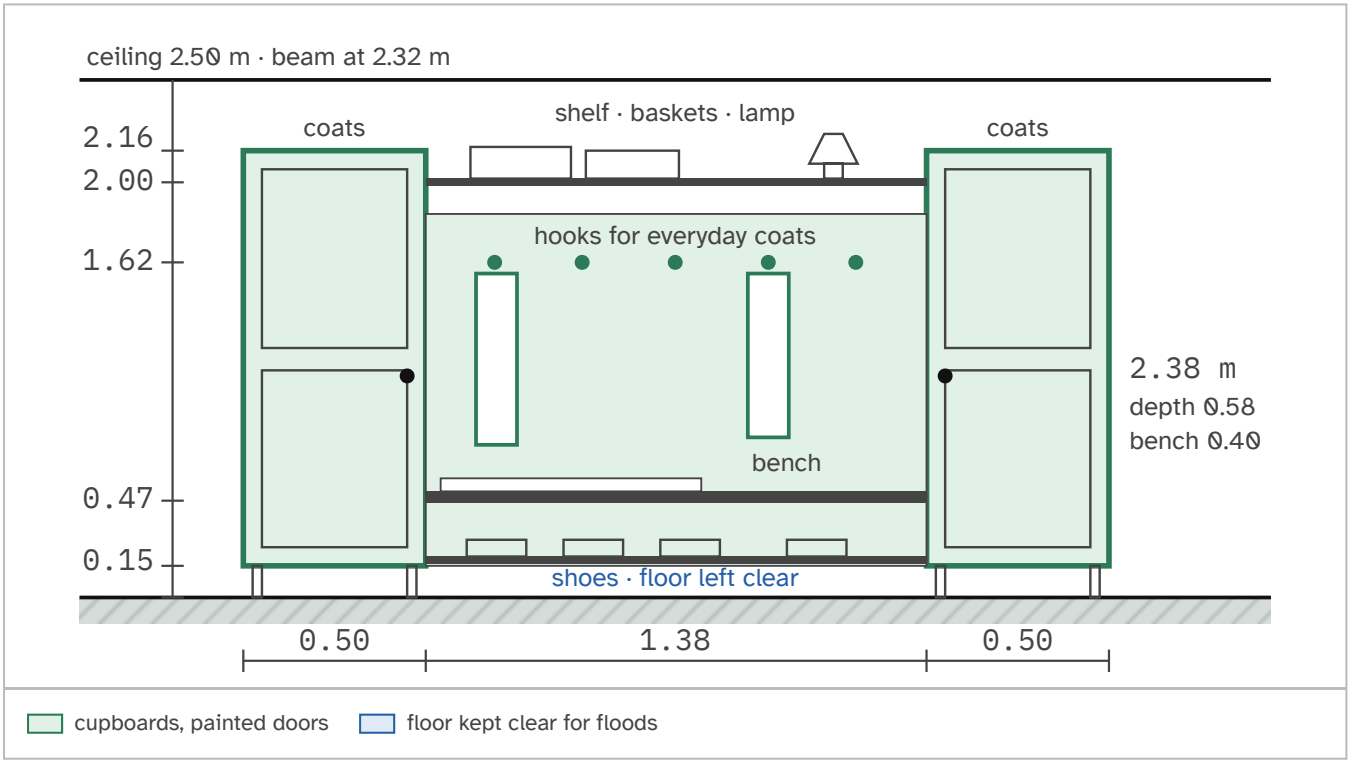

Front view of Option E. Each door gets 6 cm MDF strips glued on before painting, which turns a plain IKEA door into a cabinet door. Knobs face the nook.

Option E · Hall cabinet RECOMMENDED


Choosing the colour

- **Cupboards:** 2 × IKEA PAX frames 50 × 58 × 201 cm on 15 cm galvanised legs with an aluminium kick strip. FORSAND doors painted in your colour, with MDF strips for a shaker look and wooden knobs. Inside: hat shelf at 1.81 m, rail at 1.73 m, shoe shelf. About **350 €**.
- **Nook:** a 140 × 40 cm oak-look bench on a hidden wall batten at 45 cm, a shoe shelf at 18 cm, the back wall painted the door colour, 5 hooks at 1.62 m, and a shelf at 2.00 m with an LED strip under it. About **100 €**. It all hangs on the wall, so you can mop underneath.
- **Finishing touches:** rug 160 × 230 cm, round mirror 60 cm and a slim shelf on the stone wall by the door. About **95 €**, optional.
- **More coats?** Make the right cupboard 100 cm wide (two doors) and the nook 88 cm.

A muted green, terracotta or deep blue on the doors and the nook wall gives the hall character without making it smaller. Keep the walls around it in the washable white. In the 3D model, **Wardrobe front** switches the door colour.

WHY THIS WORKS AS AN ENTRANCE

The open nook with its bench, hooks and lamp is what people see first, so the hall reads as a place to arrive, not a storage room. Everything else hides behind two doors.

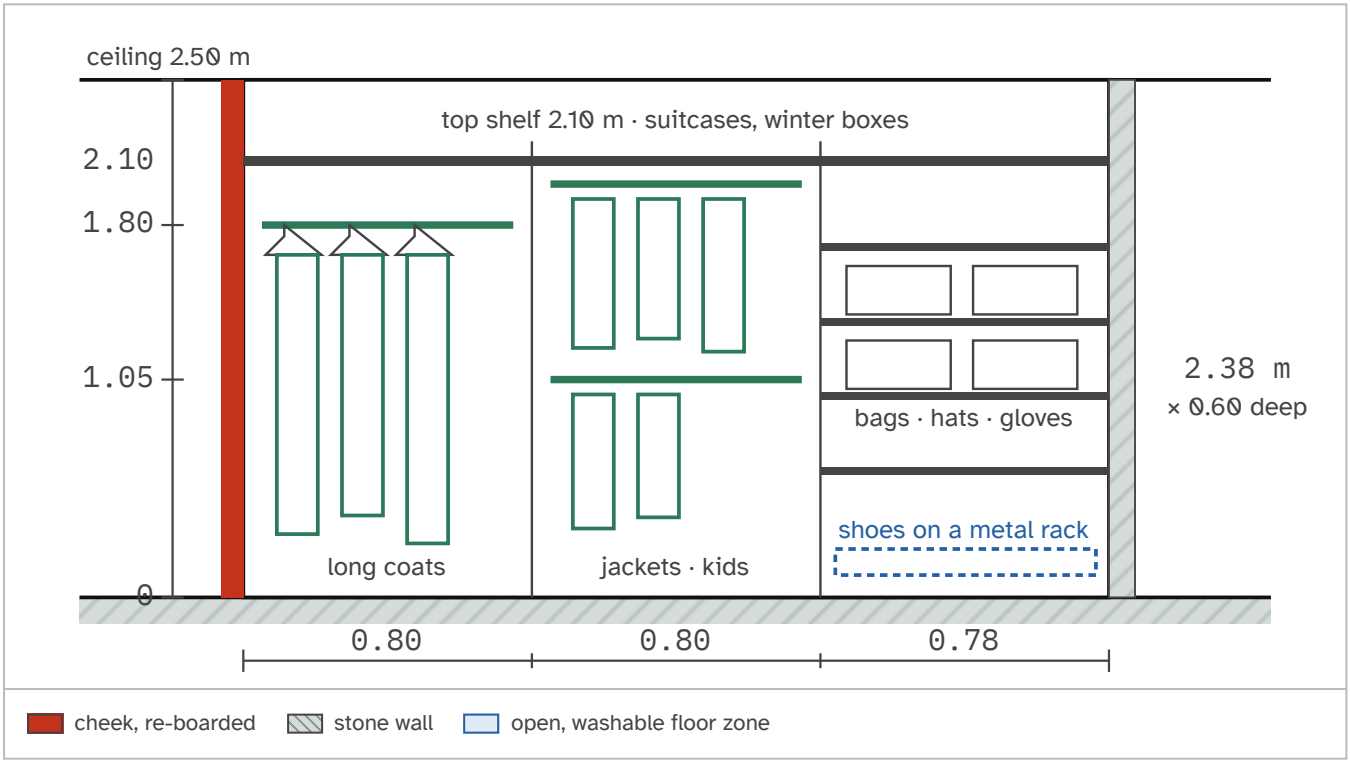

Elevation of the built-in wardrobe in Option A, drawn with doors removed. In Option B the same three-bay logic stretches to 2.50 m (3 × 83 cm).

Route 1 · Built-in niche, wall-hung metal interior (Options A and B)

Build the niche (A: 238 × 60 cm; B: 250 × 60 cm) floor to ceiling and tile its floor along with the hall. Hang the inside on a **wall-mounted rail system** such as IKEA BOAXEL or Leroy Merlin Spaceo

Route 2 · IKEA PAX

- **Height:** 236 cm frames need about 243 cm to tip upright. Your 250 cm ceiling allows that, but only with the frame sitting on the floor.
- **Flood-smart version:** use 201 cm frames on a 15 cm base of galvanised legs, and use the leftover

crémaillères: vertical tracks screwed to the wall carry the shelves and rails. Nothing chipboard touches the floor, so a flood leaves the interior intact and you mop underneath.

- **Front, choice 1:** three sliding doors of about 80 cm on an aluminium track, one of them a mirror. Size the doors with the store's calculator once the niche is built. About 280 € for doors and track.
- **Front, choice 2:** a ceiling track and a heavy washable curtain, about 50 €. You can add doors later without changing anything else.
- Total ≈ 450 € with doors, ≈ 225 € with the curtain.

30 cm above for an open shelf.

- **Sizes:** Option A uses 100 + 100 frames (200 cm) plus a 38 cm filler or open shelf column. Option B uses 100 + 100 + 50 (250 cm). Option C uses 100 + 50 (150 cm).
- **150 cm example:** frames ≈ 195 €, three FORSAND doors ≈ 135 €, hinges ≈ 30 €, KOMPLEMENT rails, shelves and two pull-out shoe shelves ≈ 70 €. About **430 €**. Check current prices on ikea.com/fr; the Vernier store across the border charges Swiss prices.
- **Drawback:** chipboard swells once wet. A flood ruins the bottom panel unless the frame is raised.

Route 3 · Open coat wall


A hook rail at 1.70 m (adults) and 1.10 m (children), a wall-hung bench at 45 cm and a wall-hung shoe cabinet. About 150 €. It's the most flood-proof and the least tidy.

FIXING TO OLD WALLS

Anchor every tall unit to the wall. Into the stone, use 8 mm plugs in the mortar joints or chemical anchors. Into BA13, use metal hollow-wall anchors (chevilles Molly) or screw into the studs. On a cold outside wall, leave a 3 cm air gap behind the unit.

F-01 Flood resilience

Keep water out where you can (barrier, backflow valve). Where you can't, build so the walls dry fast and only cheap parts need replacing.

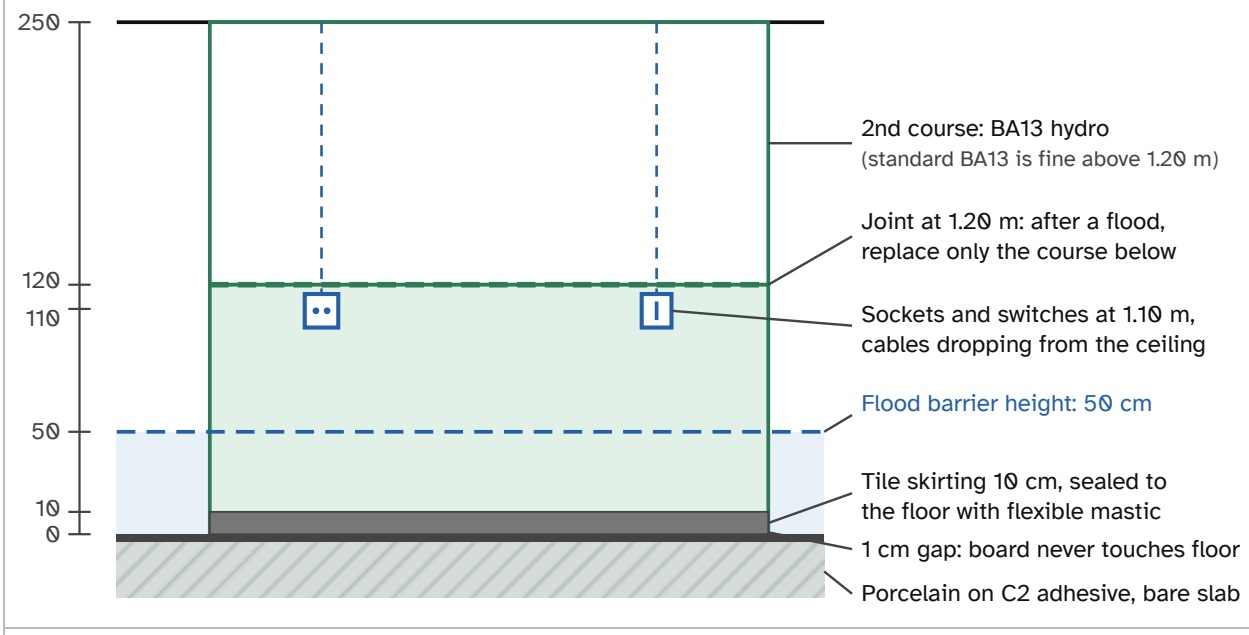

ELEMENT	CHOOSE	AVOID	WHY
Walls	BA13 hydro (H1, green face), laid horizontally and screwed. Upgrade for the most exposed walls: cement board (e.g. Aquapanel) for the first course	Standard BA13 at the bottom; boards glued to stone with plaster dabs	H1 board resists damp but not a soaking. Laid horizontally, you only replace the bottom 1.20 m strip. Cement board survives immersion and costs about 3–4× more.
Base of the wall	1 cm gap above the floor; tile or PVC skirting	MDF or wooden skirting; board resting on the slab	Gypsum wicks water upwards. The gap breaks that path.
Insulation	None below 1.20 m in the hall, or XPS (closed-cell)	Mineral wool low down	Wet mineral wool stays wet, goes mouldy and has to be replaced.
Stone walls	Leave them breathable; lime render if you leave the base bare	Cement render, waterproof paint, plastic membranes	Sealed stone traps moisture and the base never dries.
Floor	Porcelain tile on C2 cement adhesive, cement or epoxy grout, on the uninsulated slab	Laminate, parquet, carpet, click vinyl	Tile and concrete come through a flood with a clean. Click floors trap water underneath.
Electrics	Sockets at 1.10 m, cables from above, ground floor on its own 30 mA RCD	Junction boxes or cables low in the walls	You can cut power to the wet floor only, and nothing live sits in the water.
Wardrobe	Wall-hung metal interior; aluminium door track; PAX only if raised	Chipboard standing on the floor	Chipboard swells permanently after a few hours in water.

ELEMENT	CHOOSE	AVOID	WHY
Doors	If the WC or buanderie doors need replacing: solid, PVC or aluminium	Hollow honeycomb doors	Honeycomb doors delaminate when wet.
Appliances	Washer and dryer on a 40 cm base; fridge socket high	Machines on the floor	A 40 cm base also saves your back.
Drains	Backflow valve (clapet anti-retour, EN 13564) with an inspection chamber	Nothing on the branch	Your flood came from a blocked drain. A valve stops sewage backing up into the WC and buanderie.
Doorways	Removable 50 cm barrier (batardeau) at the front door; flood sacks until you have one	Barriers taller than about 60 cm on old walls	Above that height, water pressure can damage the walls. It's safer to let deeper water in.
Early warning	Battery water sensor on the floor, ideally with a phone alert	Finding out the next morning	It costs about 20 €.

FLOOD-DAY CHECKLIST · PRINT IT AND STICK IT INSIDE A CUPBOARD DOOR

1. Fit the front-door barrier. Store it in a hall cupboard so it's within reach.
2. Switch off the **RDC** RCD in the panel. Upstairs keeps its power.
3. Lift shoes, bags and boxes off the floor. The washer and dryer are already raised.
4. Garage: move the car if it's safe. If water reaches the boiler, shut the gas at the meter.
5. Afterwards, take photos before you clean, then ventilate. Report a water claim to Suravenir within 5 working days. If a natural disaster (CatNat) is declared, you have 30 days from the decree's publication.
6. Don't switch the RDC back on until an electrician has checked any socket or box the water reached.

BEYOND THE HALL: THE BOILER

The 2024 gas report puts the De Dietrich boiler in the garage. Check that its burner, electronics and electrical supply are above 50 cm. If it stands on the floor, plan to raise it when it's next replaced. The same report found no maintenance certificate. A yearly service is a legal requirement and costs about 120–180 €, outside this budget.

Q-01

Materials checklist and budget

Tick the items you'll buy. You can change quantities and prices, and the total in the title block updates as you go. Prices include VAT, are estimates from November 2026, and should be checked in store.

SELECTED TOTAL

1,867 € / 1,800 €

Over the payout by 67 €. Untick extras, switch to a cheaper wardrobe route, or fund the difference yourself.

Strip-out, safety and drying	113 €
Walls in the hall	269 €
Floor and skirting	85 €
Ceiling and paint	165 €
Electrics	514 €
Hall cabinet, wardrobe and furniture	450 €
Flood protection	20 €
Buanderie and WC walls	251 €

- **Recommended** (≈ 1,865 €): Layout E with the hall cabinet and bench nook, electrician for the panel, existing floor kept, buanderie and WC walls repaired too. That's about 65 € over the payout. It drops to ≈ 1,615 € if the buanderie and WC walls turn out sound, or to ≈ 1,765 € if you add the bench nook later. Option A with a curtain front comes to ≈ 1,640 €.
- **Lowest cost** (≈ 1,190 €): open coat wall and no electrician. You'd only swap devices on existing circuits yourselves, with no panel work.
- **Comfort upgrade** (≈ 2,875 €): hall cabinet with the rug, mirror and shelf, full retile, cement board at the base, dehumidifier, raised machines. It shows what the payout *doesn't* cover.
- Items marked CHOOSE ONE are alternatives: ticking one unticks the others.
- The backflow valve and the flood barrier start unticked. They're the most useful flood measures, but they cost more than is left. Ask about Fonds Barnier aid first (G-04) and about who pays for drain work (Bouchet BTP).

Strip-out, safety and drying — 113 €

The déchetterie is free with a residents' badge.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**FFP3 masks, pack of 5**	Brico Dépôt	1	14	**14 €**
☑	**Safety glasses + cut-resistant gloves**	Castorama	1	15	**15 €**
☑	**Floor protection, dust sheeting, tape** cardboard roll for the stairs, plastic over doorways	Leroy Merlin	1	25	**25 €**
☑	**Rubble bags (sacs à gravats), pack of 10**	Brico Dépôt	2	8	**16 €**

☑	**Moisture meter (humidimètre)** tells you when the walls are dry enough to close	Leroy Merlin	1	25	**25 €**
☑	**Anti-mould treatment, 1 L**	Castorama	2	9	**18 €**
☐	**Dehumidifier 20 L/day** or borrow or rent one	Castorama	1	159	~~159 €~~
☑	**Déchetterie drop-off** plasterboard in the plâtre skip	CC du Genevois	1	0	**0 €**

Walls in the hall — 269 €

8 boards cover the 1.20 m course on about 13 m of wall, the niche cheek and 15% waste. Add boards if stains reach higher.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**BA13 hydro H1, 2.50 × 1.20 m** green face, NF; Castorama 20.90 €	Brico Dépôt	8	20.1	**161 €**
☑	**Metal studs M48, rails R48, furrings (3 m)** for the cheek, rusted bottom rails, stone-wall furring	Brico Dépôt	1	45	**45 €**
☑	**Screws TTPC 25 (1000), TRPF 13, frame anchors**	Brico Dépôt	1	26	**26 €**
☑	**Paper joint tape 150 m + metal corner tape**	Castorama	1	15	**15 €**
☑	**Joint compound (enduit à joint) 25 kg**	Brico Dépôt	1	22	**22 €**
☐	**Upgrade: cement board for the bottom course** about 7 boards (1.20 × 0.90) on the 2 most exposed walls, plus screws and tape	Leroy Merlin	1	220	~~220 €~~
☐	**Lime render for a bare stone base** NHL 3.5 × 2 + sand, if you leave the stone exposed	Leroy Merlin	1	45	~~45 €~~

Floor and skirting — 85 €

Repair the strip if the existing floor is sound. Retile only if it's damaged or mismatched.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**Repair the strip where the wall stood** CHOOSE ONE matching or contrasting tile inlay, C2 adhesive, grout, or a flat divider profile	Brico Dépôt	1	40	**40 €**

☐	**Retile the whole hall, porcelain 60 × 60** CHOOSE ONE 11 boxes × 1.44 m² at 15.90 €/m², 4 × C2 adhesive, grout, levelling clips, breaker hire for 1 day	Brico Dépôt	1	410	~~410 €~~
☑	**Skirting 8–10 cm, 14 m** cut from spare tiles, or PVC; adhesive + mastic	Brico Dépôt	1	45	**45 €**

Ceiling and paint — 165 €

Repaint the whole ceiling, because patches always show.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**Primer for plasterboard (sous-couche) 10 L**	Brico Dépôt	1	35	**35 €**
☑	**Washable wall paint, velours 10 L**	Leroy Merlin	1	65	**65 €**
☑	**Ceiling paint, white matt 5 L**	Castorama	1	25	**25 €**
☑	**Rollers, tray, brushes, masking tape, sanding pads**	Brico Dépôt	1	32	**32 €**
☑	**Acrylic mastic for corners**	Castorama	2	4	**8 €**

Electrics — 514 €

Material for 3 sockets, 2 switches and 1 new ceiling point. The electrician does the panel work.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**VAT voltage tester** NF EN 61243-3, not a screwdriver tester	Leroy Merlin	1	22	**22 €**
☑	**3 sockets 2P+T 16 A + 2 switches** e.g. Legrand Mosaic or Schneider Odace	Leroy Merlin	1	34	**34 €**
☑	**Boxes, DCL point, pre-wired conduit, Wago** 6 plasterboard boxes, ICTA 3G2.5 + 3G1.5 (25 m each)	Castorama	1	78	**78 €**
☑	**Electrician, half a day** PRO checks the removed circuits, new drops, own 30 mA RCD for the ground floor, test	local electrician	1	380	**380 €**
☐	**Ceiling lights, simple LED**	Leroy Merlin	2	22	~~44 €~~
☐	**Smoke alarm NF EN 14604** if this floor has none	Castorama	1	15	~~15 €~~

Hall cabinet, wardrobe and furniture — 450 €

Pick one storage route. The bench nook, bench, desk and finishing touches are extras.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**Hall cabinet: two painted cupboards (Option E)** CHOOSE ONE 2 PAX frames 50 × 58 × 201 on 15 cm legs, 2 FORSAND doors with shaker strips, paint, wooden knobs, rails, shelves	IKEA + Leroy Merlin	1	350	**350 €**
☑	**Bench nook between the cupboards (Option E)** wall-hung oak-look bench 140 × 40, shoe shelf, 5 hooks, shelf + LED strip	Leroy Merlin + IKEA	1	100	**100 €**
☐	**Finishing touches: rug, round mirror, slim shelf** rug 160 × 230 ≈ 50 €, mirror 60 cm ≈ 30 €, shelf + brackets ≈ 15 €	IKEA	1	95	~~95 €~~
☐	**Built-in niche, 3 sliding doors (1 mirror)** CHOOSE ONE doors + track ≈ 280 €, wall-hung metal interior ≈ 150 €, cheek ≈ 20 €	Leroy Merlin + IKEA	1	450	~~450 €~~
☐	**Built-in niche, curtain front** CHOOSE ONE ceiling track + curtain ≈ 55 €, wall-hung metal interior ≈ 150 €, cheek ≈ 20 €	IKEA + Brico Dépôt	1	225	~~225 €~~
☐	**IKEA PAX 150 cm (100 + 50, 236 high)** CHOOSE ONE 3 FORSAND doors, hinges, rails, shelves, 2 pull-out shoe shelves	IKEA	1	430	~~430 €~~
☐	**IKEA PAX 250 cm for Option B** CHOOSE ONE 100 + 100 + 50, 5 doors, interior	IKEA	1	690	~~690 €~~
☐	**Open coat wall** CHOOSE ONE hook rail, wall-hung bench, wall-hung shoe cabinet	IKEA	1	150	~~150 €~~
☐	**Wall-hung bench with shoe shelf, 120 cm**	IKEA	1	65	~~65 €~~
☐	**Compact desk 120 × 60 + wall shelf** Option C	IKEA	1	85	~~85 €~~

Flood protection — 20 €

The valve and the barrier start unticked. They matter most, but the payout doesn't stretch to them.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**Water sensor with alarm**	Leroy Merlin	1	20	**20 €**

☐	**Raised base for washer + dryer**	Leroy Merlin	1	45	~~45 €~~
☐	**Absorbent flood sacks, pack of 10** stopgap until you have a barrier	Castorama	1	75	~~75 €~~
☐	**Backflow valve EN 13564, fitted in the trench** STRONGLY ADVISED ask Bouchet BTP during the November works; check who pays	Bouchet BTP / plumber	1	280	~~280 €~~
☐	**Removable 50 cm front-door barrier** AID FIRST tested kit; apply for Fonds Barnier aid first	specialist supplier	1	750	~~750 €~~

Buanderie and WC walls (if damaged) — 251 €

Lower 1.20 m course in both rooms, plus repainting.

	ITEM	STORE	QTY	UNIT €	TOTAL
☑	**BA13 hydro H1, 2.50 × 1.20 m** 1.20 m course in the buanderie and WC	Brico Dépôt	7	20.1	**141 €**
☑	**Extra compound, tape, screws**	Brico Dépôt	1	25	**25 €**
☑	**Paint for damp rooms, 10 L**	Leroy Merlin	1	55	**55 €**
☑	**Skirting 10 m + mastic**	Brico Dépôt	1	30	**30 €**

G-02 What you can do yourselves, and what to hire out

You plus a handy friend can do about 85% of the hours. Hire out the panel work, anything on the gas or sewer, and any structural doubt.

JOB	WHO	DIFFICULTY	NOTES	IF HIRED (TTC)
Structural checks (S-01)	**You**	Easy	An engineer only if you hit a red flag	300–600 €
Make devices safe, remove sockets and switches	**You**	Easy	Breaker off, VAT test, cap with Wago connectors	in electrician visit
Demolish the partition, strip wet board	**You**	Easy	FFP3 mask; sort waste for the déchetterie	400–700 €
New circuits, 30 mA RCD in the panel, testing	**Electrician**	Pro	NF C 15-100 compliance protects your insurance cover	≈ 380 €


JOB	WHO	DIFFICULTY	NOTES	IF HIRED (TTC)
Metal framing, BA13 hydro boarding	**You**	Medium	Two people make handling 2.50 m boards much easier	35–50 €/m²
Taping and jointing, ceiling patch	**You**	Medium	The step that shows: three thin coats, patience, a good light	15–25 €/m²
Painting	**You**	Easy	Primer first on all new board	20–30 €/m²
Floor strip repair	**You**	Easy	Tile inlay or divider profile	100–200 €
Full retile, 60 × 60 porcelain	You or a tiler	Hard	Large tiles need a dead-flat floor and a levelling-clip system	40–60 €/m² labour
Hall cabinet or wardrobe	**You**	Medium	Anchor every tall unit to the wall	—
Backflow valve on the sewer branch	**Bouchet BTP or plumber**	Pro	Cheapest while the trench is open	≈ 280 € in trench
Flood barrier (batardeau)	Supplier, or you for removable kits	Medium	Buy a tested product. Apply for aid *before* you buy	400–900 €
Gas boiler (service, raising it)	**Gas engineer**	Pro only	Never DIY on gas	120–180 € service


VAT TIP

Materials you buy yourself carry 20% VAT. When a professional supplies *and* fits in a home more than two years old, their materials and labour carry 10% VAT. For the electrician or the backflow valve, let them supply the parts.

G-03 Calendar, November 2026 to February 2027

About 8 weekends of work spread over 14 weeks, because the walls must dry. If the walls are still wet in mid-December, push the rebuild to late January. The dates move; the order doesn't.

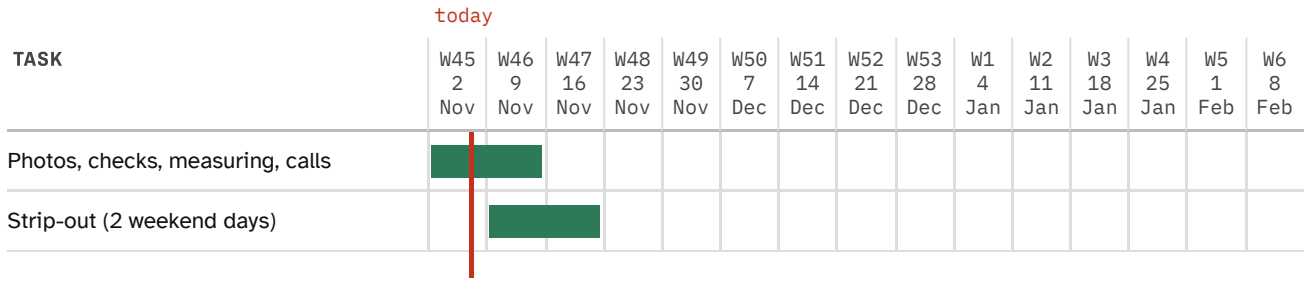

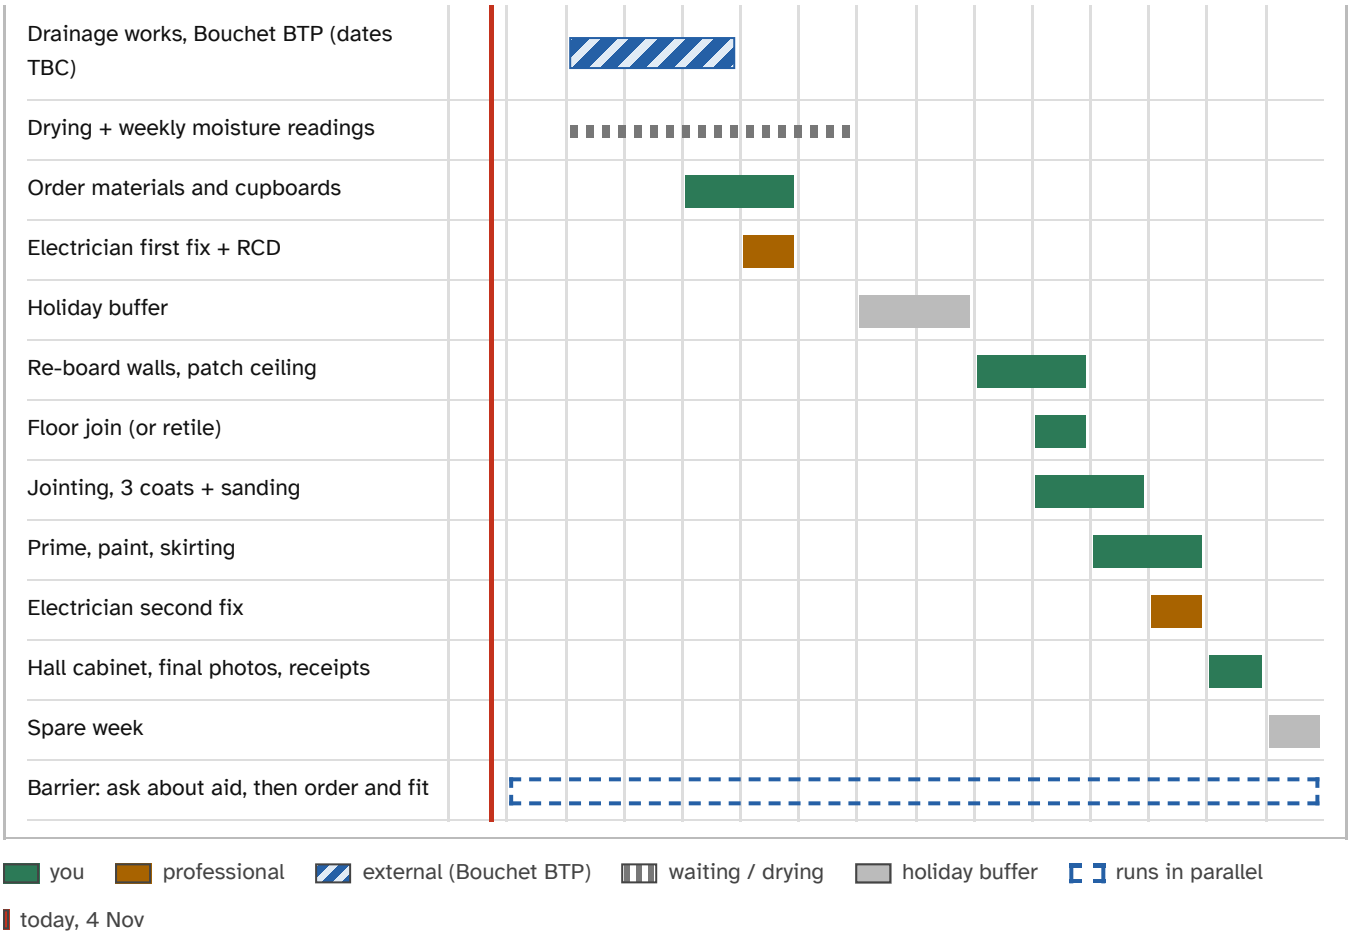

G-04 Permits and rules in France

The hall itself needs no permit. The flood measures and the insurance paperwork are where the rules come in.

NO PLANNING PERMISSION FOR THE HALL

Removing a non-load-bearing interior partition in a house doesn't change the façade, the use or the floor area. It needs no déclaration préalable and no permis de construire. If a professional takes out the partition, they may ask for a *repérage amiante avant travaux* (pre-works asbestos survey) because the house predates 1997. Show them the 2024 report; a targeted survey costs about 150–300 € if they insist.

INSURANCE (AUTO-RÉPARATION)

- You're free to do the work yourself with the 1,800 €. Keep every receipt and the before-and-after photos. If you claim again later, the insurer can reduce the payout for damage that was never repaired.
- Keep Bouchet BTP's invoice or report. It proves the cause was fixed, which matters for future claims and for a future sale, when you'll disclose this claim.
- Water claim: report it within 5 working days. CatNat claim: within 30 days of the decree's publication.

FAÇADE WORK: CHECK FIRST

Anything fixed permanently to the outside, such as barrier frames screwed to the façade or a new window, may need a déclaration préalable. Near a listed monument, the Architecte des Bâtiments de France must also approve it. Ask the Saint-Julien service urbanisme before drilling the façade. Fully removable barriers need nothing.

FLOOD-RISK PLAN (PPRN)

Your November 2024 risk statement says the approved PPRN (15 June 2020) **doesn't place the house in an exposed zone**. A revision was prescribed on 6 Sep 2023 and covers the whole commune until its study area is set. It imposes no works yet, but new rules may follow. Recent disasters: floods and mudslides on 6 Sep 2008 and 9 Jun 2024. Check the commune's page on Géorisques or ask the DDT 74 once a year.

FONDS BARNIER AID

The FPRNM ("Fonds Barnier") can pay up to 80% of flood-proofing works for homeowners, such as barriers or raised equipment. The works must be required by an approved PPR, or identified by a vulnerability survey in an area with a PAPI (flood prevention programme). Your house isn't in an exposed zone of the approved plan, so eligibility depends on a PAPI and a survey. Ask the DDT 74 or the mairie **before** you buy a barrier, because aid usually can't be granted after the purchase.

ELECTRICS

NF C 15-100 applies to the new work. DIY is legal; panel work by an electrician is the safe choice. A partial change needs no Consuel. Keep the 2024 electrical report with your papers.

PARTY WALL

Lining or fixing to a mur mitoyen is fine. Chases, recesses or anything built into it need the neighbours' agreement (Code civil, art. 662).

WASTE, NOISE, SAFETY

- Plasterboard goes in the *plâtre* skip at a Communauté de Communes du Genevois déchetterie, free with a residents' badge. Never put it in household bins.
- Noisy DIY hours are set by Haute-Savoie prefectoral order and the mairie: normal daytime on weekdays, shorter hours on Saturdays, very limited on Sundays. Check before a Sunday session and warn the neighbours.
- Every home must have at least one smoke alarm (NF EN 14604). Refit it if it comes down during the work.
- The gas boiler must be serviced every year.

G-05 Sources and assumptions

What's checked, what's estimated, and where the numbers came from.

Assumptions

- Dimensions are worked back from the surveyor's areas (Garage 16.2, Buanderie 7.15, Bureau 7.8,

Sources

- Your sale agreement and its annexes (promesse de vente): Carrez survey, DPE, gas, electrical, asbestos and lead reports

Entrée 6.74 / Carrez 5.13, WC 2.27 m²) and the 2024 sketch, which isn't to scale. Treat them as ±10 cm.

- The office walls are plasterboard on metal studs, as you describe them. S-01 confirms this.
- Water damage is assumed to reach no higher than the 1.20 m first course. If stains go higher, add boards (about 20 € each).
- Prices include VAT, observed or estimated in November 2026. Brico Dépôt and Castorama prices come from product pages. IKEA, Leroy Merlin and labour prices are estimates; check them before you buy.
- Radiator position, floor type and existing device positions weren't in the file. Check them in step 4 of C-01.

(EASYDIAGS, June 2024); risk statement (Media Immo, 13 Nov 2024).

- Brico Dépôt: BA13 hydrofuge 2.50 × 1.20 m
- Castorama: Pladur BA13 hydrofuge
- Brico Dépôt: rail R48 3 m · montant M48 3 m
- Brico Dépôt: porcelain 60 × 60 (15.90 €/m²)
- ManoMano: PVC backflow valves · Hellopro: Ø100 valve
- Hellopro: flood barrier price ranges
- Legrand: socket heights under NF C 15-100
- les-aides.fr: Fonds Barnier, works to reduce flood vulnerability · Ministry: funding for flood prevention
- Décret 2026-47 (Fonds Barnier application rules)
- Géorisques: Saint-Julien-en-Genevois

Plan prepared for the ground floor of the house in Saint-Julien-en-Genevois. It's a planning aid, not an engineer's or electrician's certificate. Your checklist ticks, quantities and prices are saved in this browser only.