
STEREO COMPONENT AMPLIFIER ASSY REPLACEMENT

67146-01


HINT:

- •□ COMPONENTS: SEE PAGE 75-44.
- •□ LOCATION:\[SEE\[PAGE\[67-2.\]
- Installation is in the reverse order of removal.
- 1. REMOVE[LUGGAGE[COMPARTMENT[FLOOR[MAT[SEE[PAGE]75-47]
- 2. REMOVE DECK TRIM SIDE BOARD RH (SEE PAGE 75-47)
- 3. REMOVE[REAR[FLOOR[FINISH[PLATE][SEE[PAGE]75-47]]
- 4. | SEPARATE|LUGGAGE|COMPARTMENT|TRIM|COVER|FRONT|(SEE|PAGE|75-47)
- 5. REMOVE LUGGAGE COMPARTMENT TRIM COVER ASSY RH SEE PAGE 75-47)
- 6. REMOVE TELEVISION CAMERA ECU (W/TELEVISION CAMERA) (SEE PAGE 67-15)

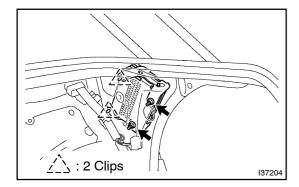


7. REMOVE STEREO COMPONENT AMPRIFIER ASSY W/BRACKET

- (a) Disconnect the connector.
- (b) Remove the 2 nuts.
- (c) Disengage the 2 clips and remove the stereo component amplifier assy with bracket.

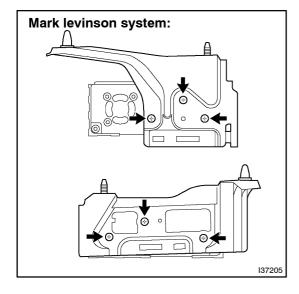

8. REMOVE STEREO COMPONENT AMPLIFIER ASSY

(a) Mark levinson system:Remove the 6 screws and 2 brackets.

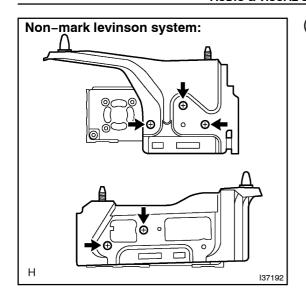

(b) Non-mark levinson system: Remove the 5 screws and 2 brackets.