Typical details: where CAD and Revit draw the same detail differently

55 of the 190 CAD typical details have a Revit version in your templates that is drawn differently.

Each page: your CAD detail on the left, the closest Revit view on the right, and what differs.

The new catalogue makes the CAD detail the master and builds the Revit version from it.


For each page, one answer: CAD is right (keep it), or Revit is newer (we update CAD from it).

Compared by eye on 2026-10-23 from Nelson's CAD blocks and the Concrete Tower R24 / Steel R24 / Container R23 templates.


 CAD: KOR-D201-DET 01 - TYPICAL DETAIL AT JUNCTION OF 60 TO 36 DEEP RAFT

Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

CAD (master)

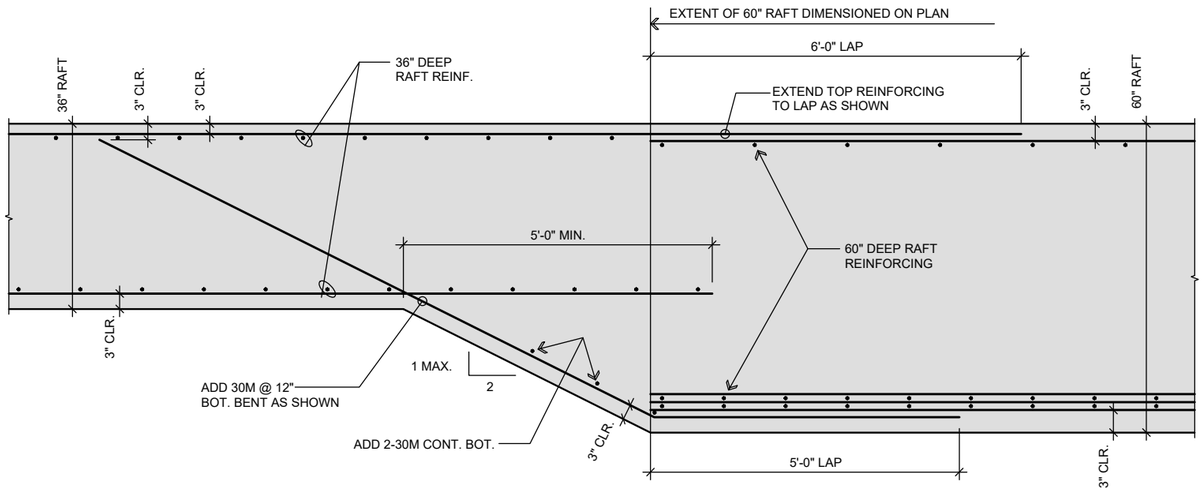

Revit template

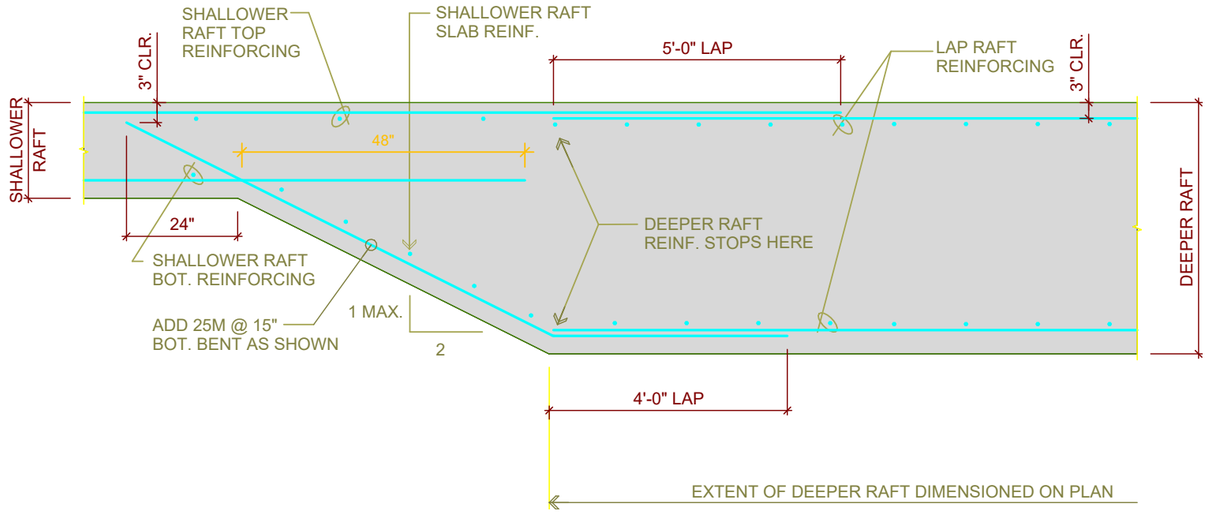


What differs: 60-to-36 junction version: same sloped transition but extra top-bar extension and 60-in raft reinforcing callouts; 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS' is the generic change in thickness.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D201-DET 02 - TYPICAL DETAIL AT JUNCTION OF 48 TO 36 DEEP RAFT

Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

CAD (master)

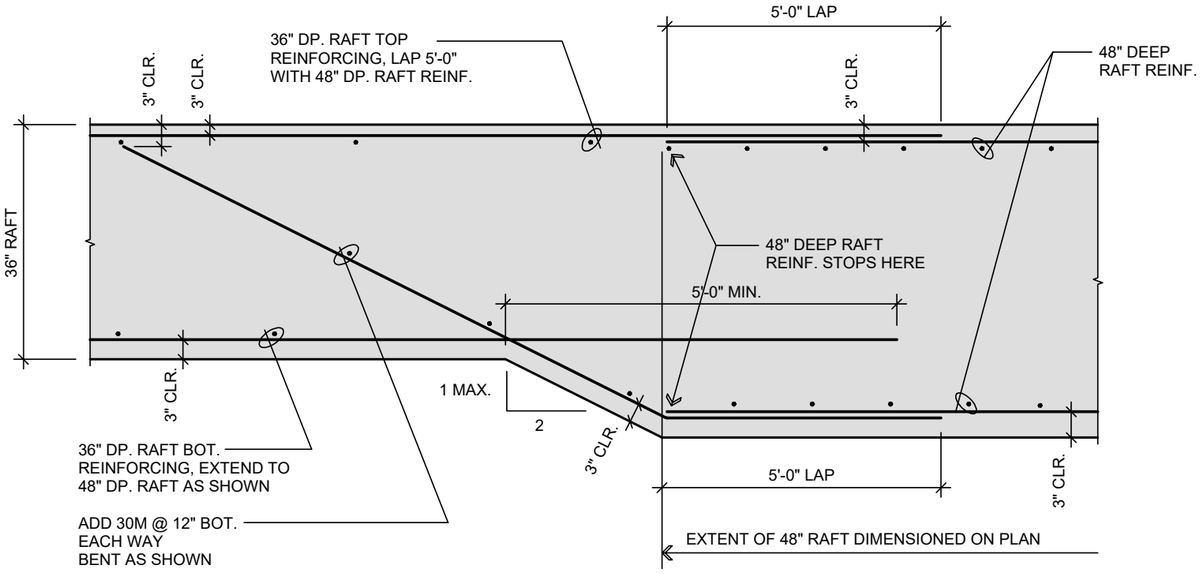

Revit template

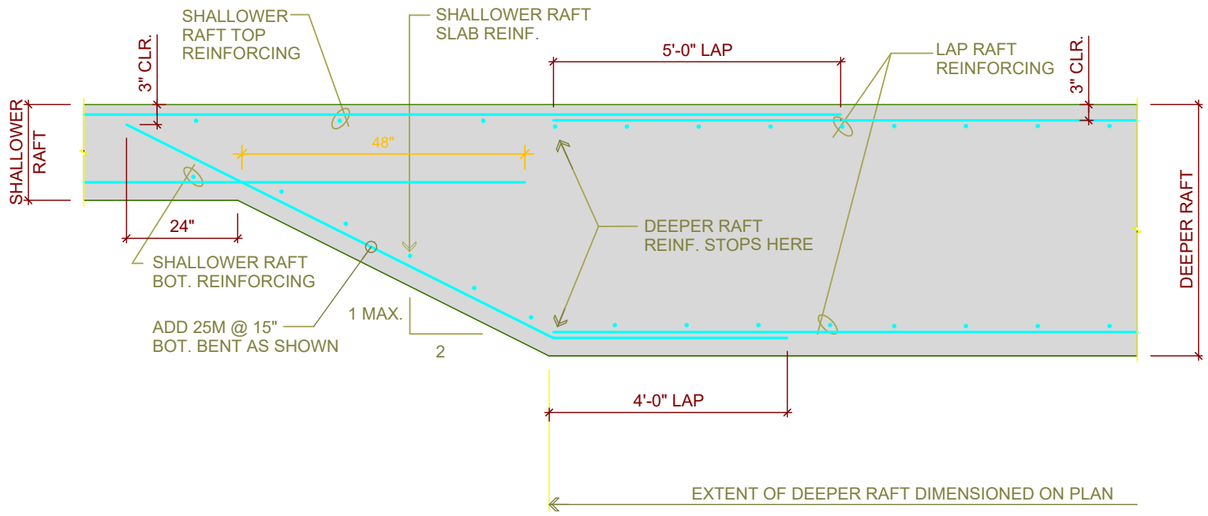


What differs: 48-to-36 junction version of the sloped raft transition; adds 48-in deep reinf callouts and a 30M bent bottom bar vs generic 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D201-DET 03 - TYPICAL BASEMENT WALL

Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

CAD (master)

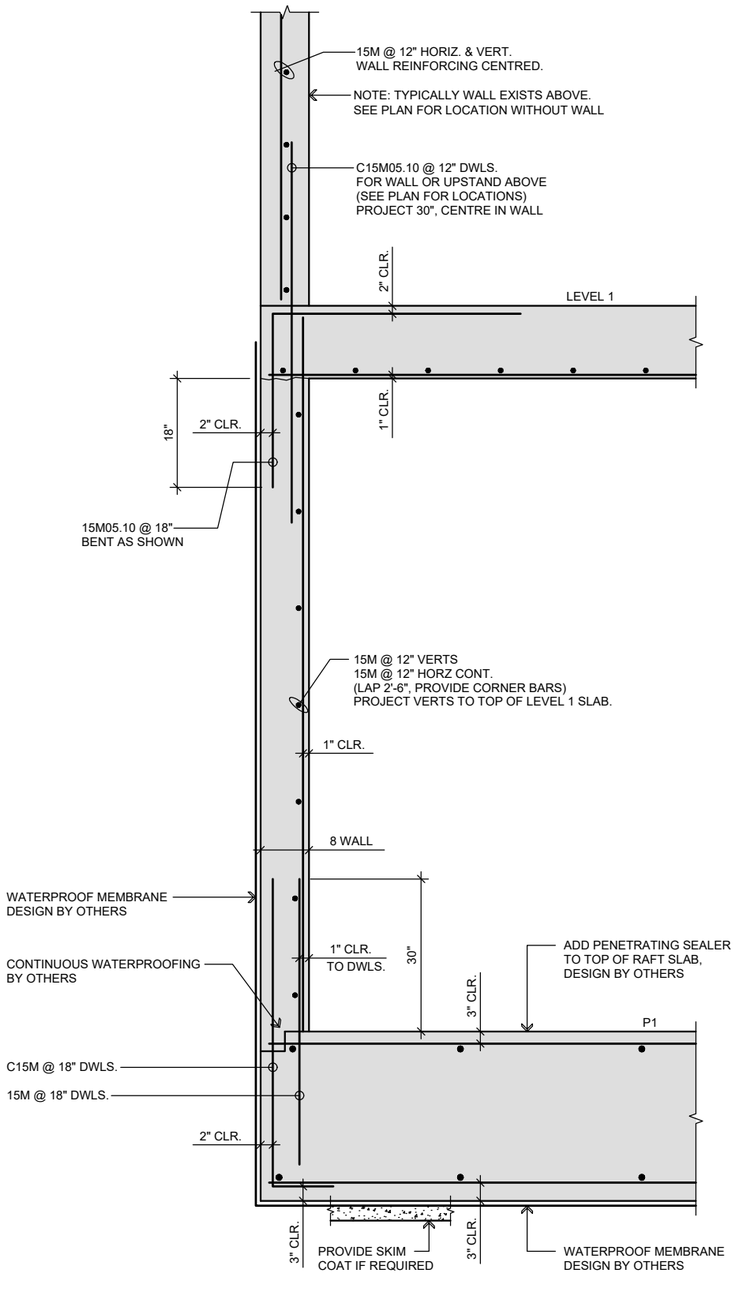

Revit template

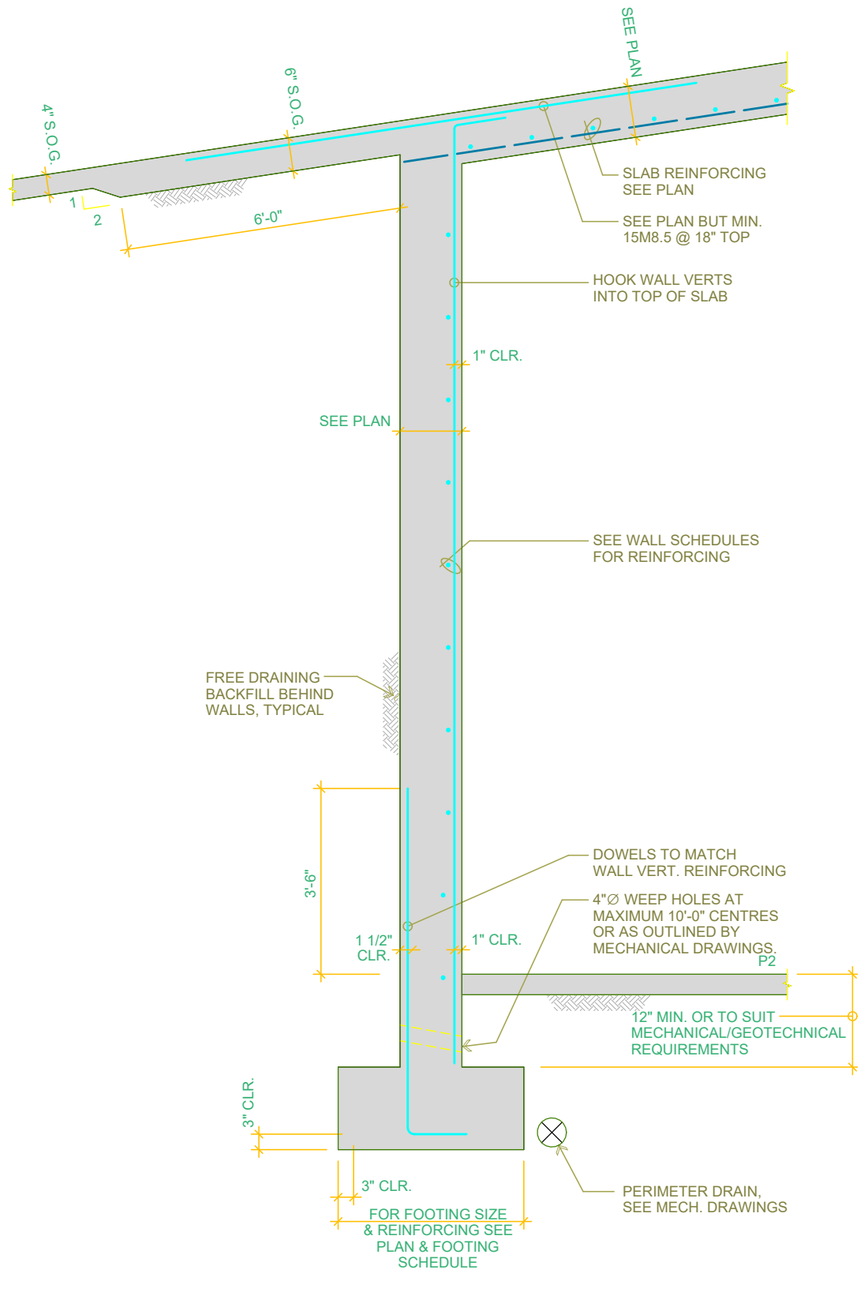


What differs: CAD is a basement wall running from suspended slab down into the raft with an intermediate slab; 'S5.05_1_BASEMENT WALL DETAIL' is a wall with sloped slab over and strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D5.01_1_TRENCH DRAIN ON GRADE DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

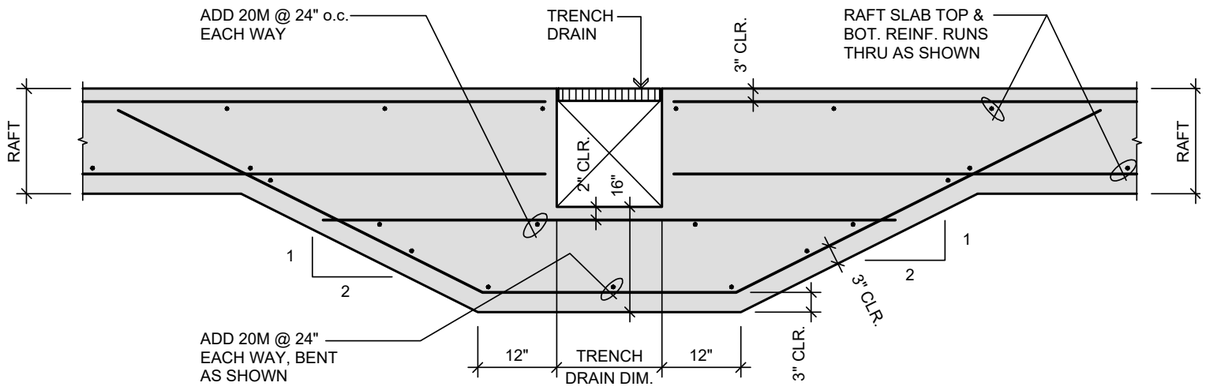

Revit template

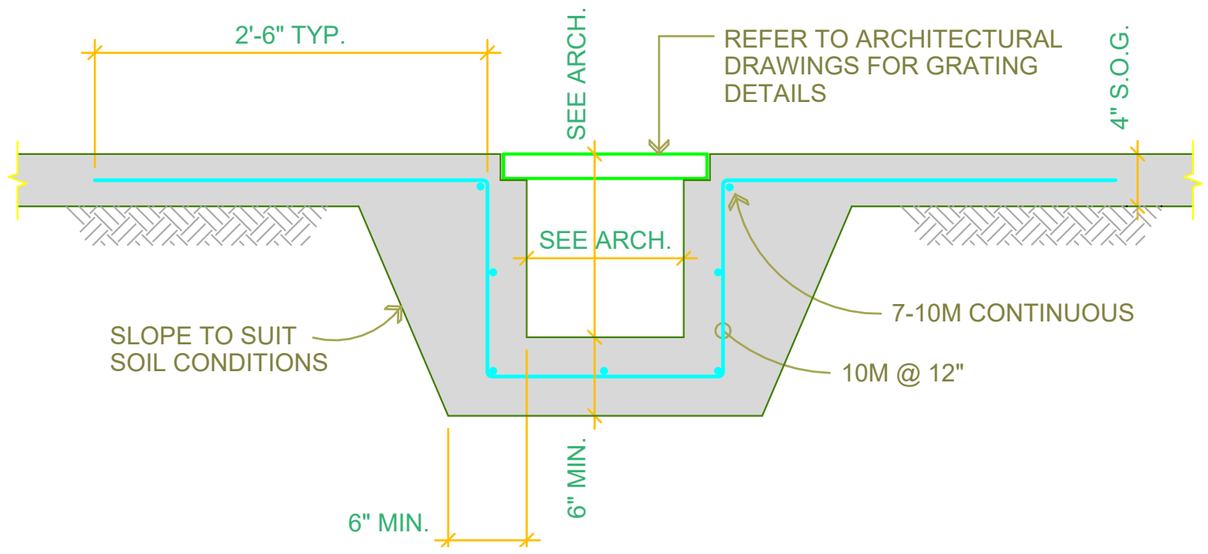


What differs: CAD is a trench drain in a thickened raft with 20M bars; 'D5.01_1_TRENCH DRAIN ON GRADE DETAIL' is the on-grade thickened trench of the same shape but different slab and bars ('D5.01_2_TRENCH DRAIN ON RAFT DETAIL' is a topping-on-raft trench).

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D201-DET 11 - TYPICAL PIT IN STRUCTURAL SLAB

Revit: D2.01_3_TYPICAL DETAIL AT CATCH BASIN OR SUMP IN RAFT SLAB (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

CAD (master)

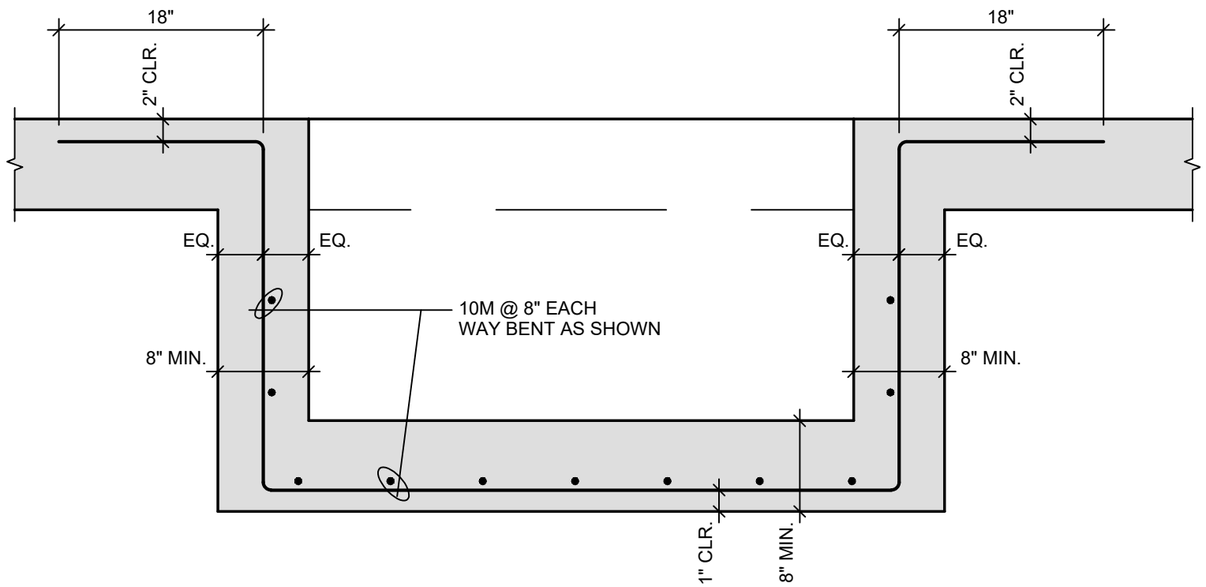

Revit template

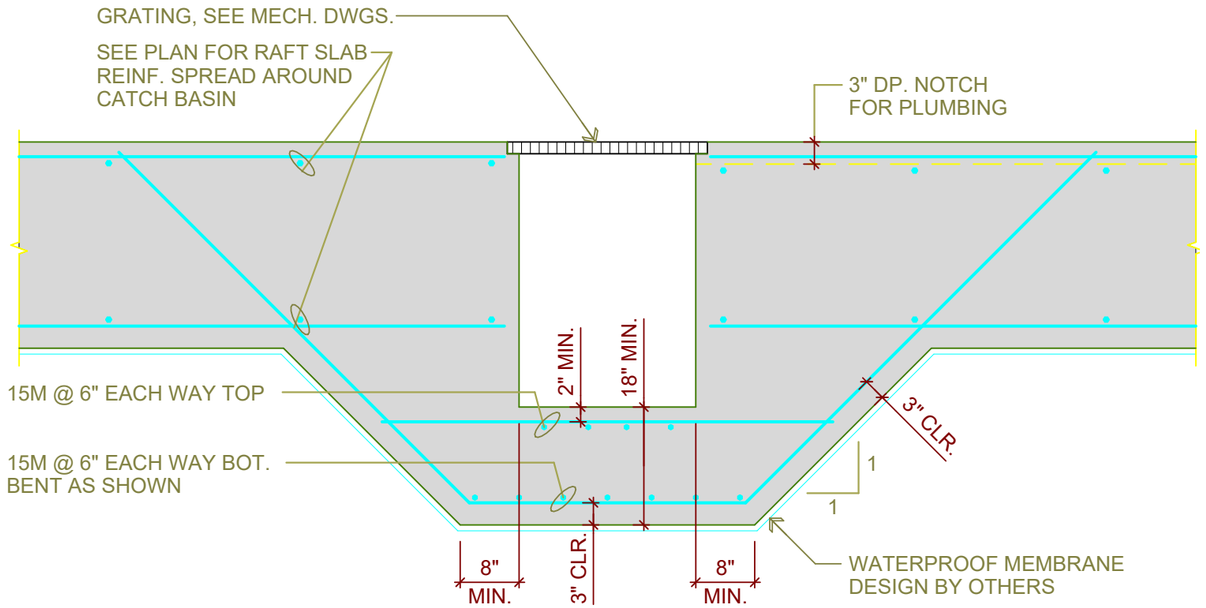


What differs: CAD is a square-sided pit dropped into a structural slab with 10M bent bars; 'D2.01_3_TYPICAL DETAIL AT CATCH BASIN OR SUMP IN RAFT SLAB' is a sloped-sided catch basin sump in raft - same purpose class, different shape and bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 # CAD: KOR-D201-DET 13 - SLOPE BETWEEN SLAB THICKNESS TYPICAL UNO

Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

CAD (master)

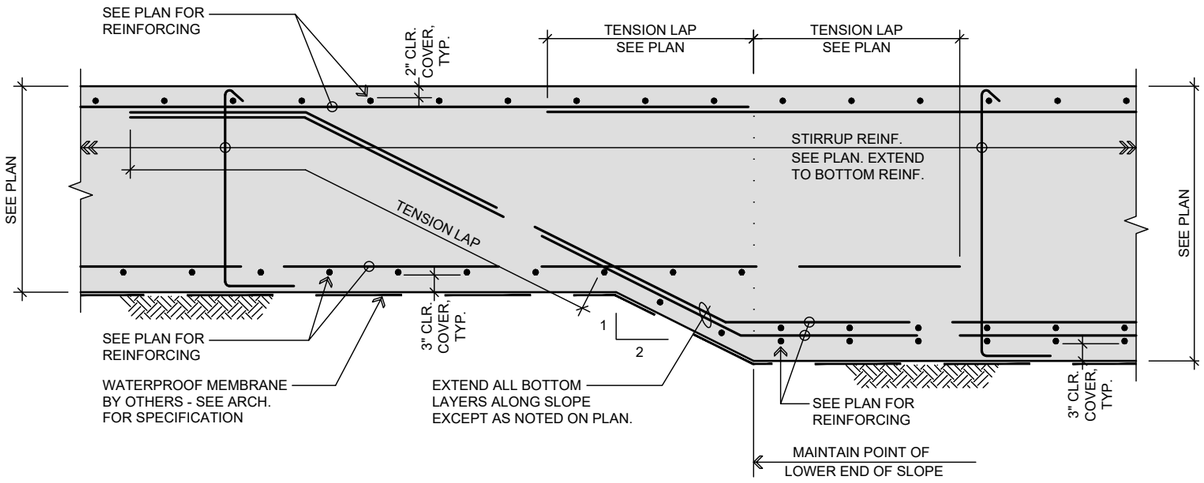

Revit template

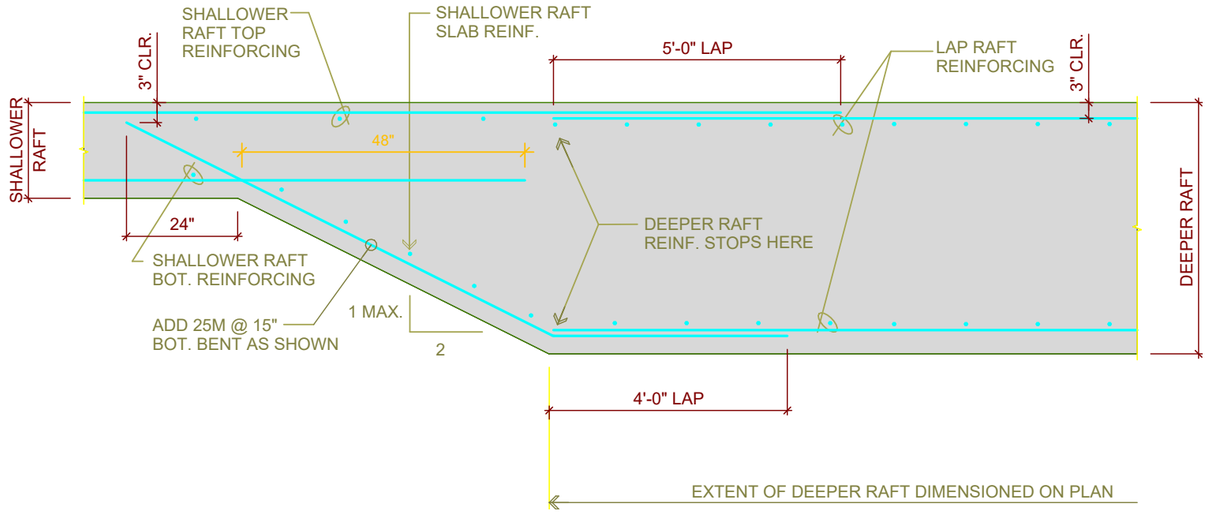


What differs: CAD slope between slab thicknesses has stirrups and tension laps on both layers; 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS' shows a simpler bar arrangement.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D202-DET 02 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

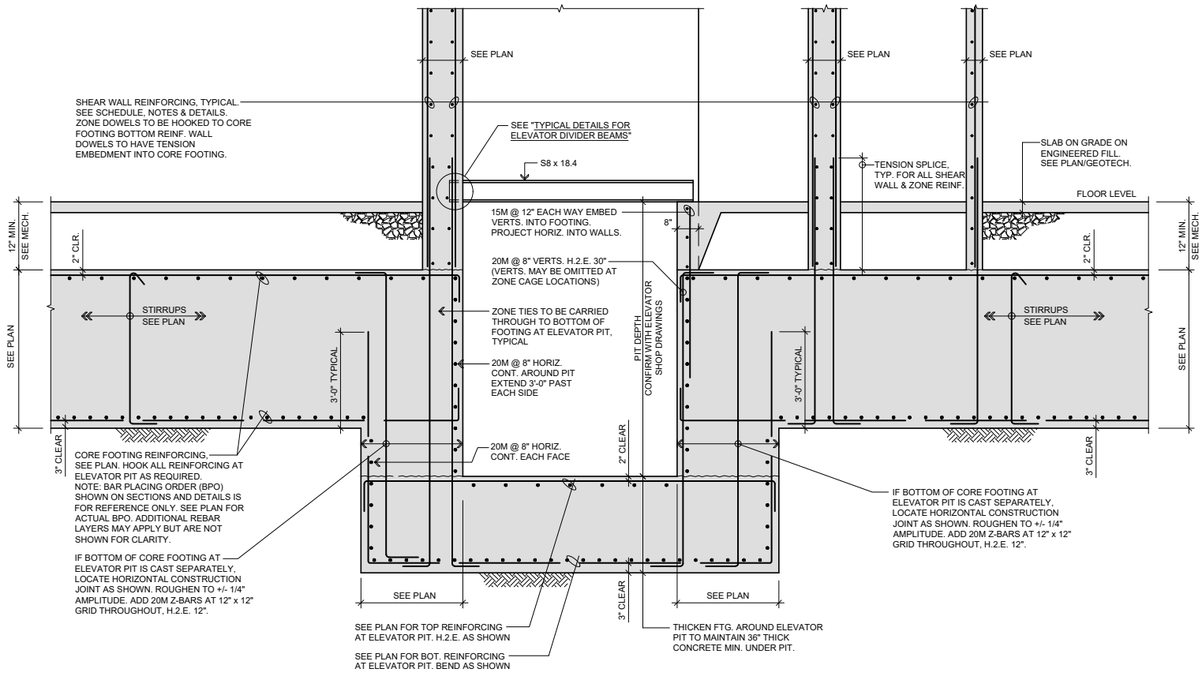

Revit template

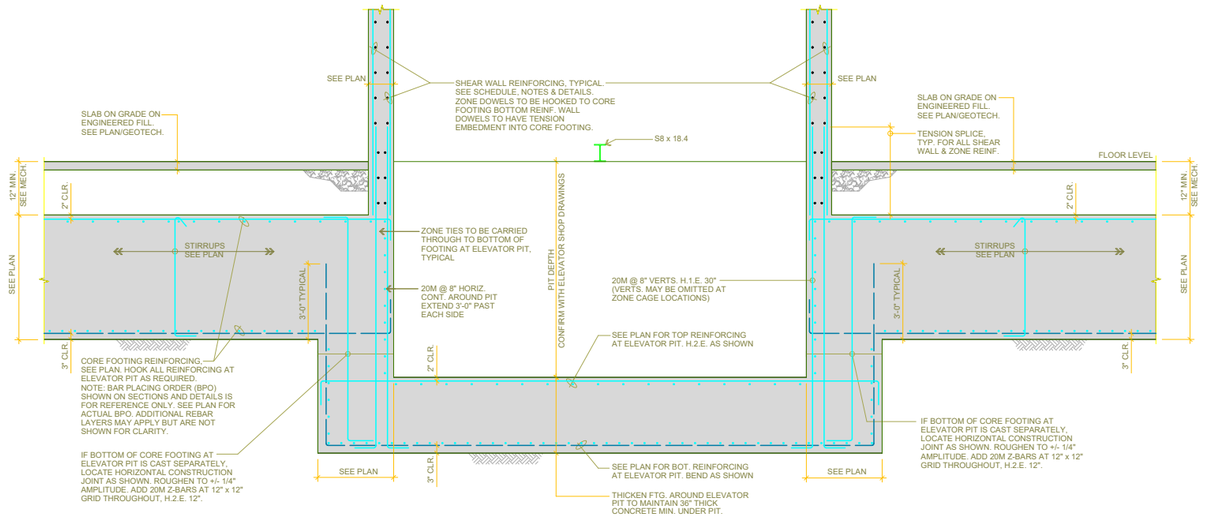


What differs: Core footing at elevator pit with a divider beam and extra horizontal bar callouts not in 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D202-DET 03 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

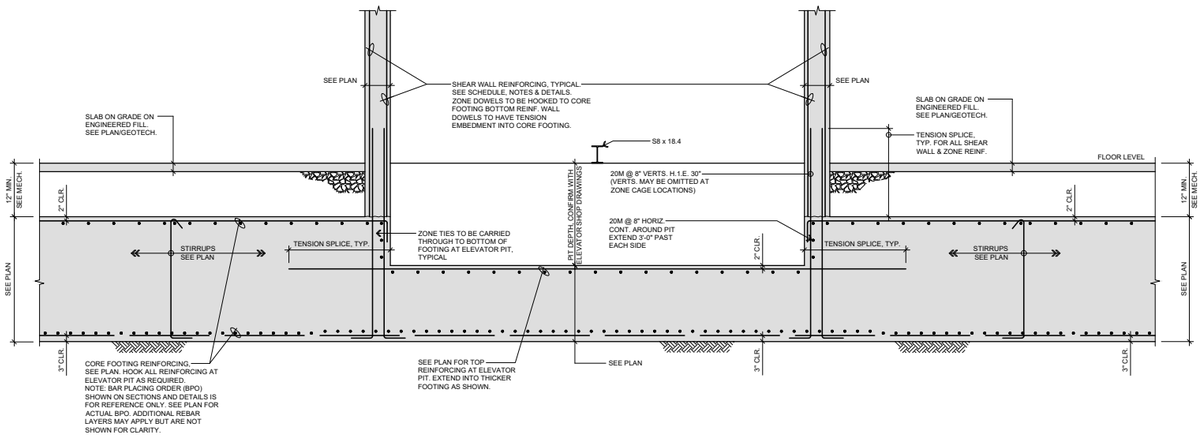

Revit template

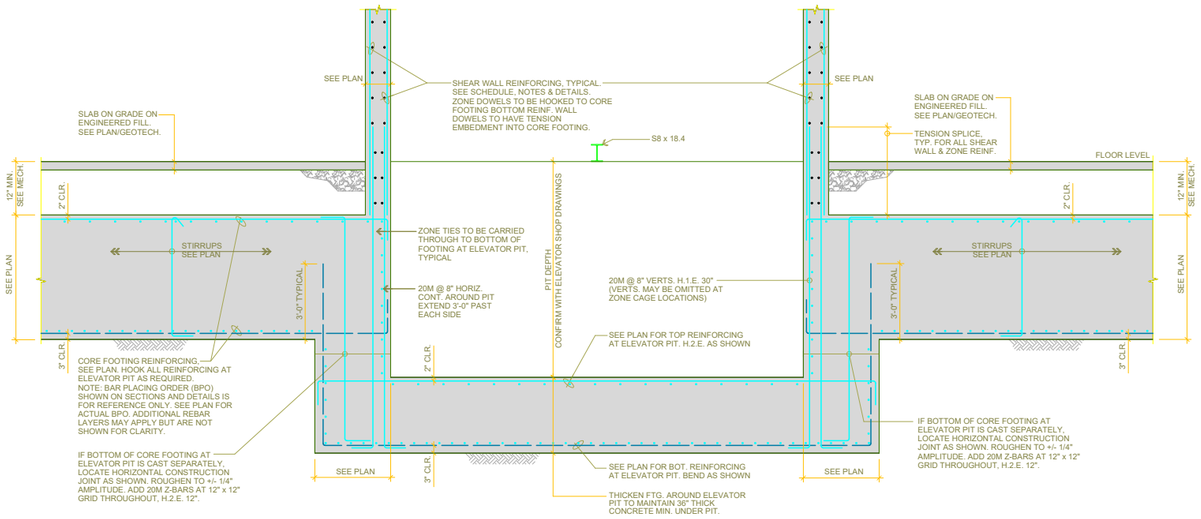


What differs: Core footing at elevator pit variant: flat footing with thicker pit slab, fewer callouts than 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D202-DET 04 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

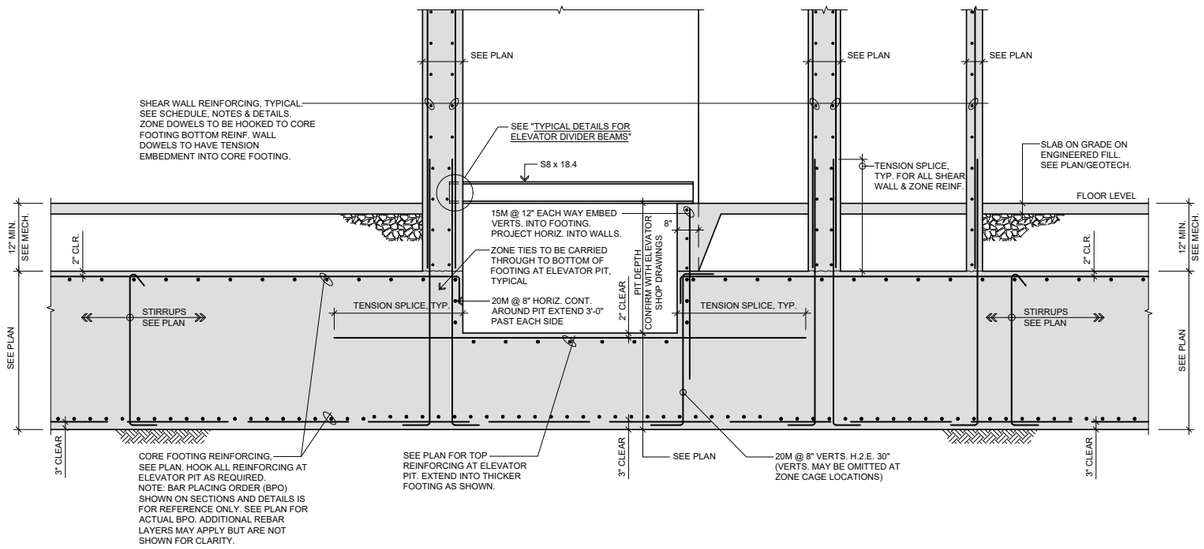

Revit template

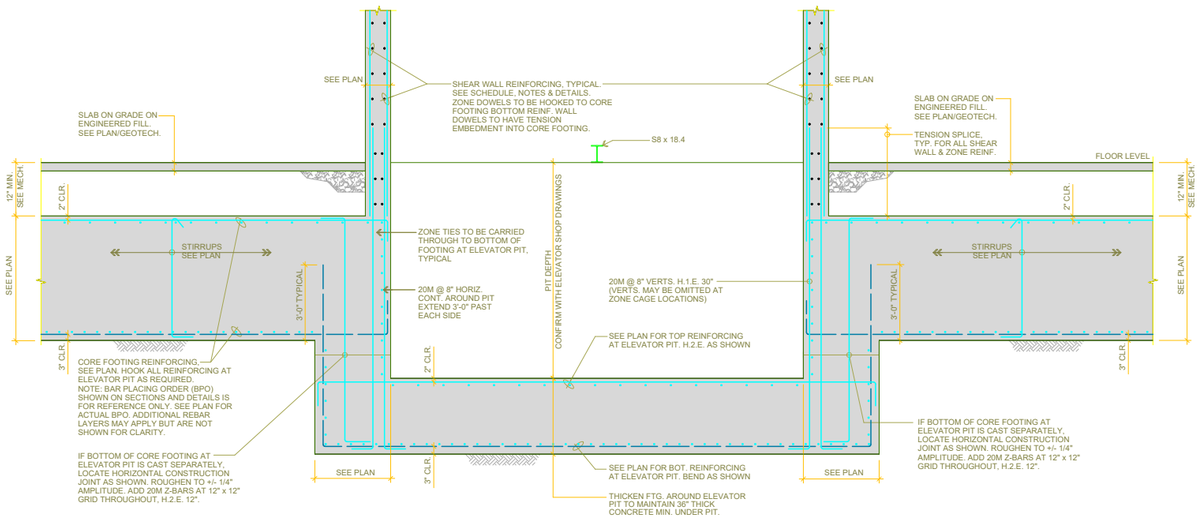


What differs: Core footing at elevator pit variant with an extra divider wall/beam and pit slab arrangement not in 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


10 of 55 CAD: KOR-D202-DET 05 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

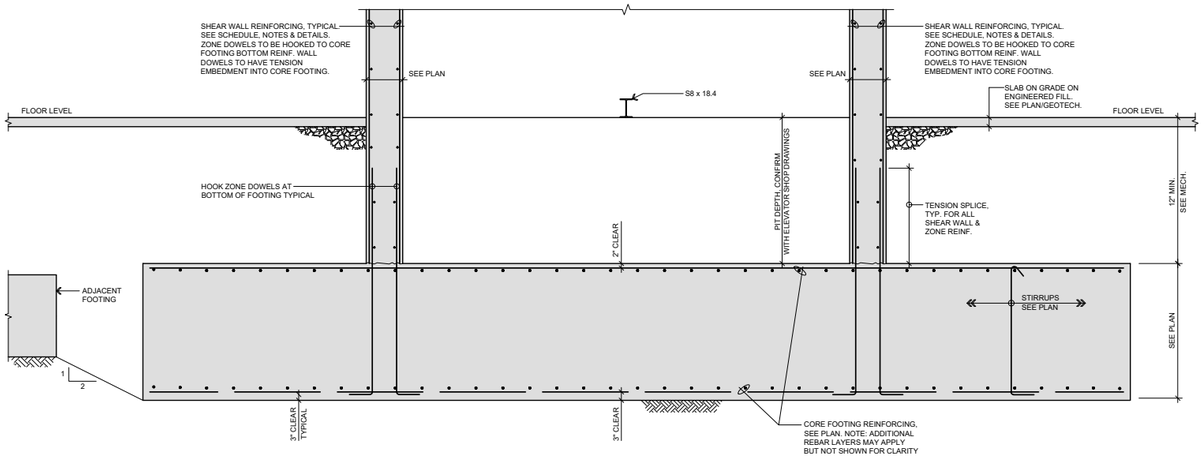

Revit template

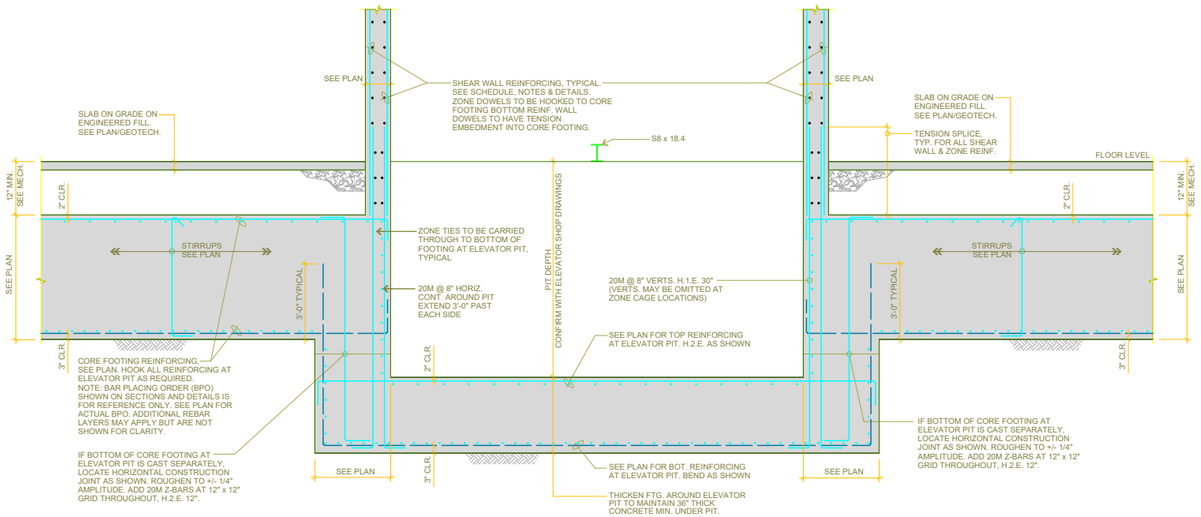


What differs: Flat core footing with adjacent footing and dowels, no stepped pit; same purpose as 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' drawn differently.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


11 of 55 CAD: KOR-D202-DET 06 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

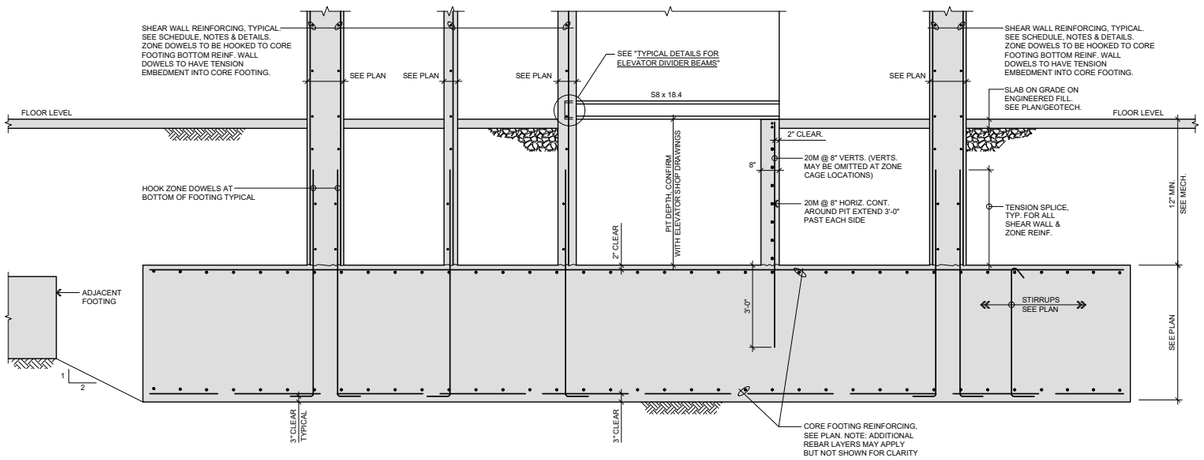

Revit template

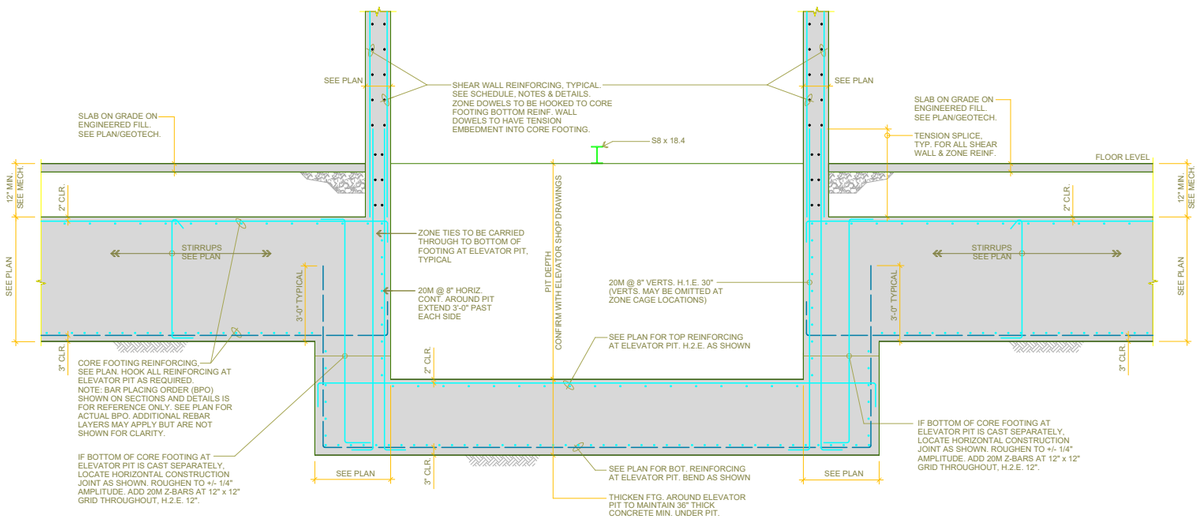


What differs: Flat core footing with divider wall and adjacent footing; differs in geometry from 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D202-DET 07 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

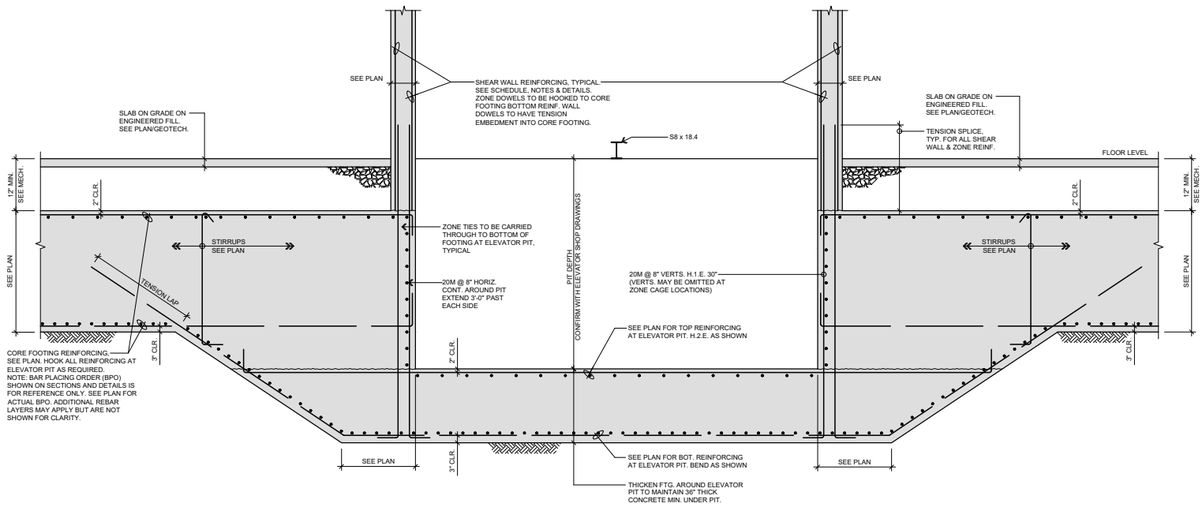

Revit template

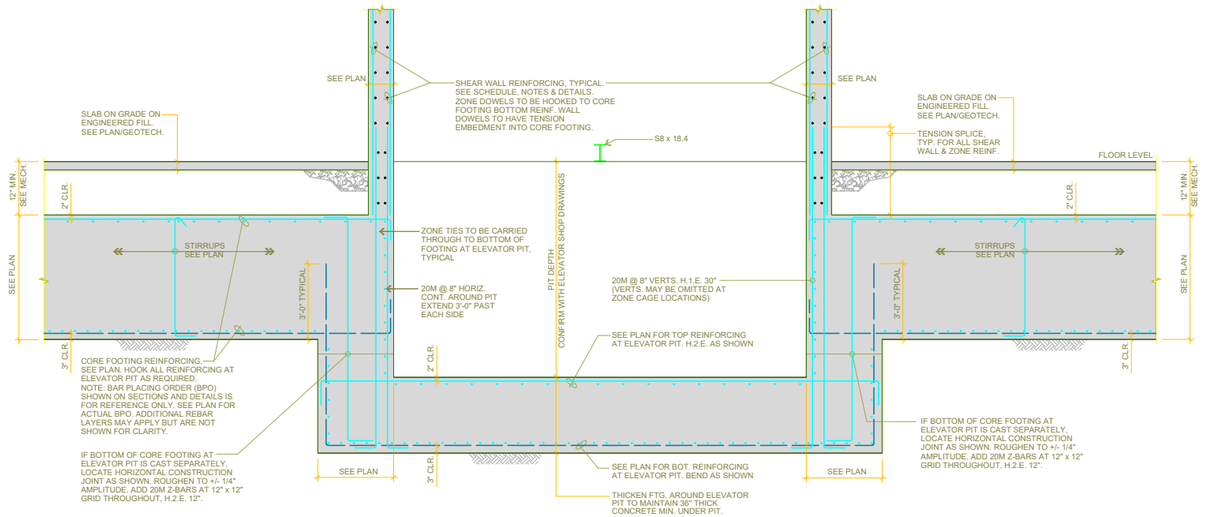


What differs: Core footing with sloped (haunched) sides to the deeper pit; 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' has vertical steps.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D202-DET 08 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT

Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

CAD (master)

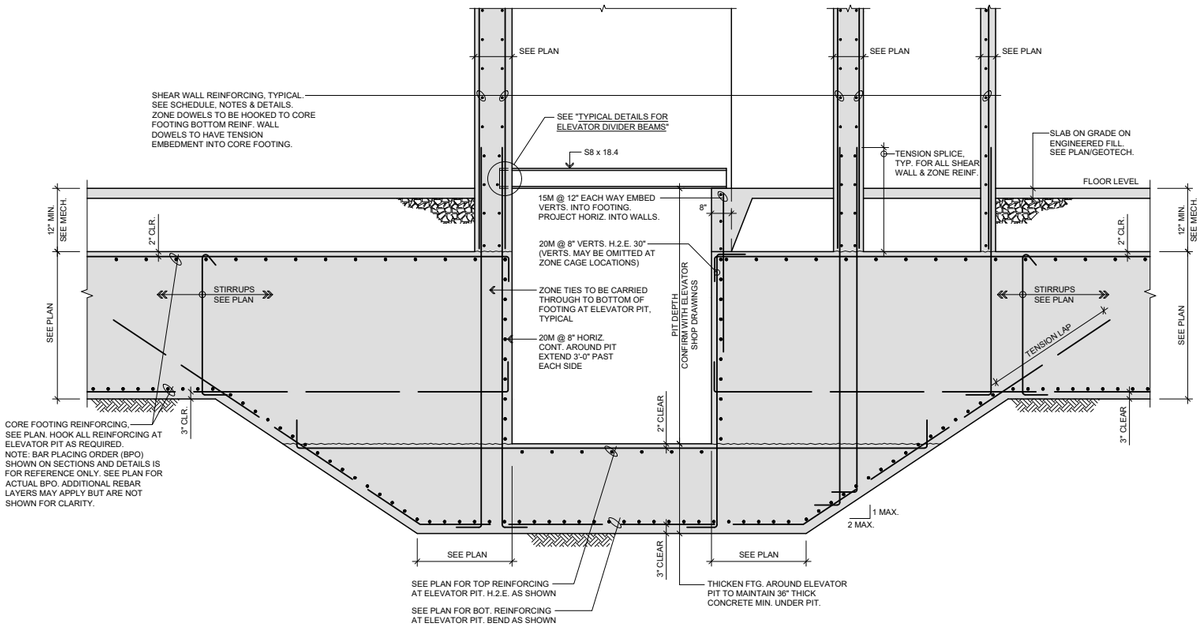

Revit template

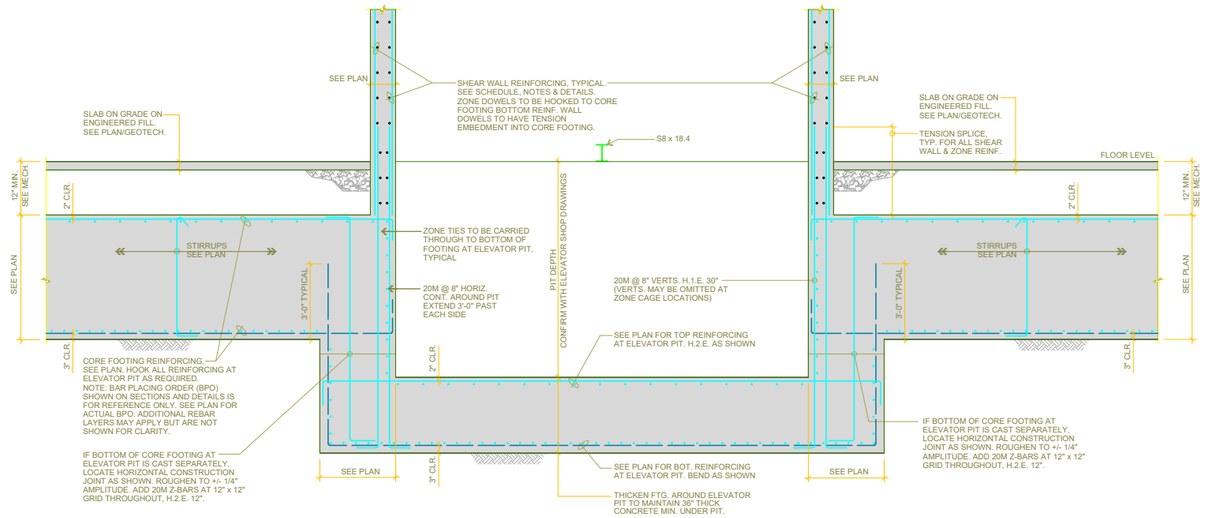


What differs: Core footing with sloped sides, divider beam and lap notes; 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' has vertical steps and no divider.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D301-DET 02 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

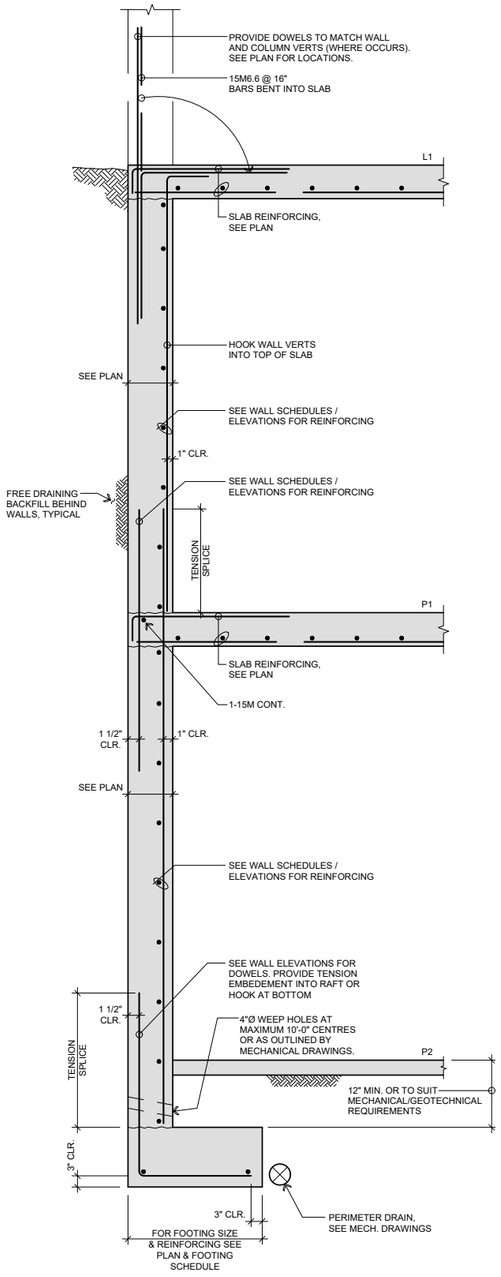

Revit template

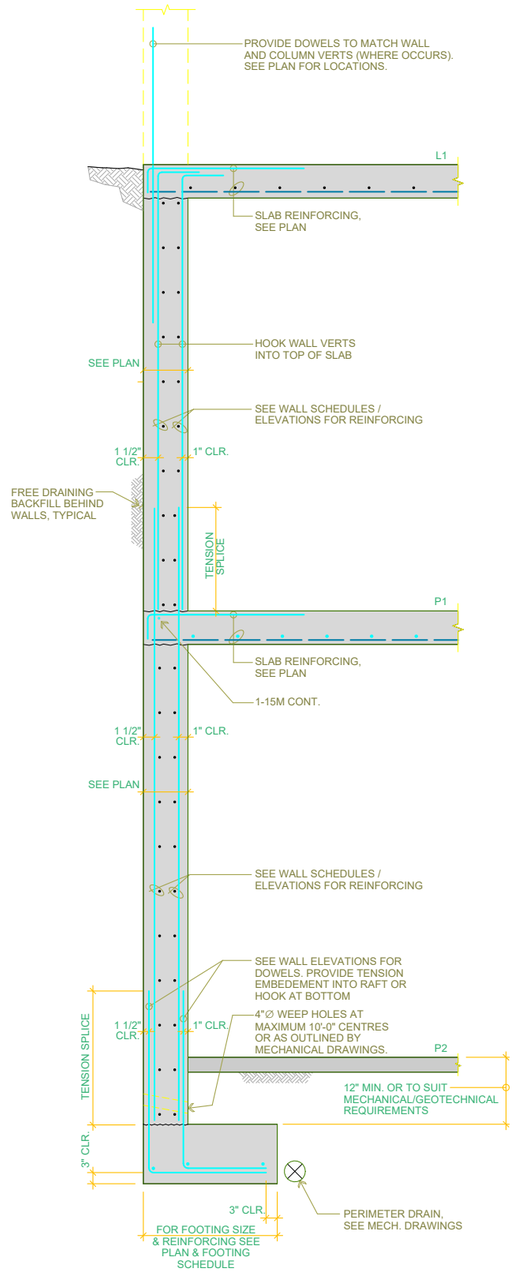


What differs: Same basement wall section but adds a wall-reinforcing-per-schedule callout and 15M bent bars that 'D3.01_1_BASEMENT WALL SECTION' lacks.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D301-DET 03 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

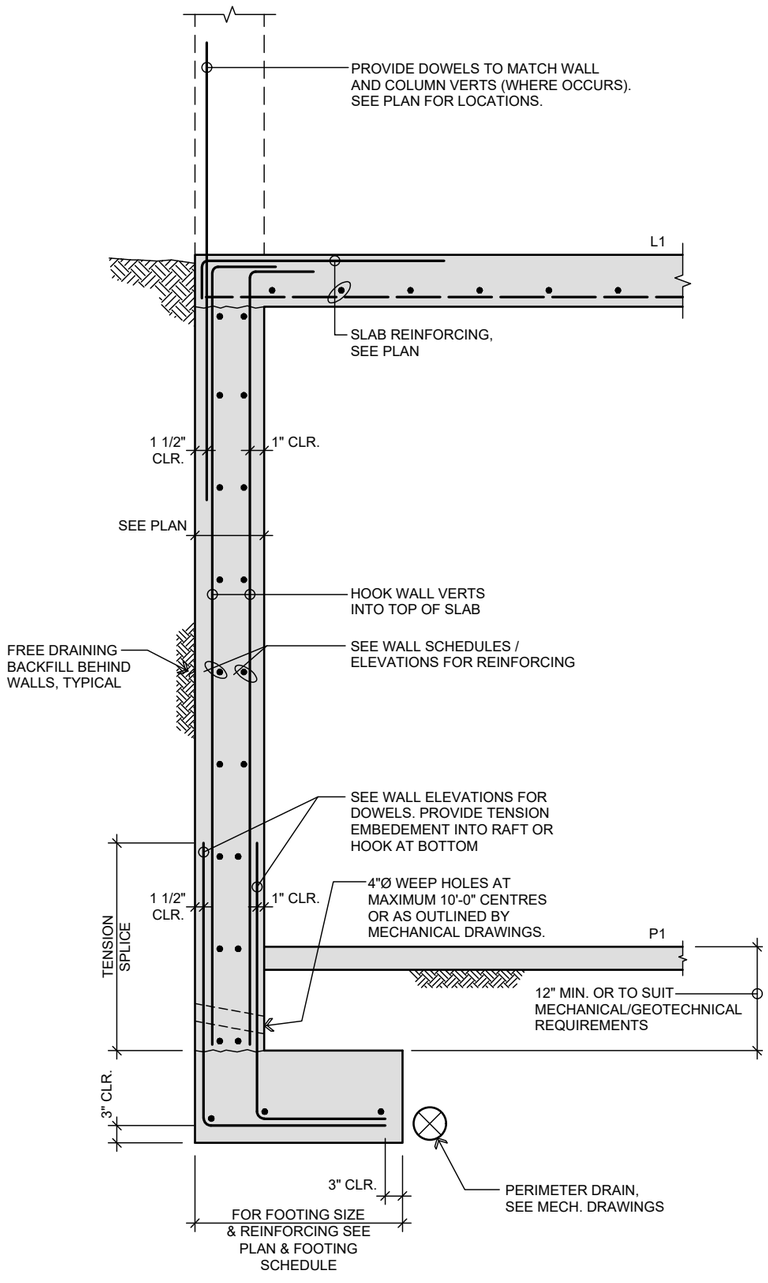

Revit template

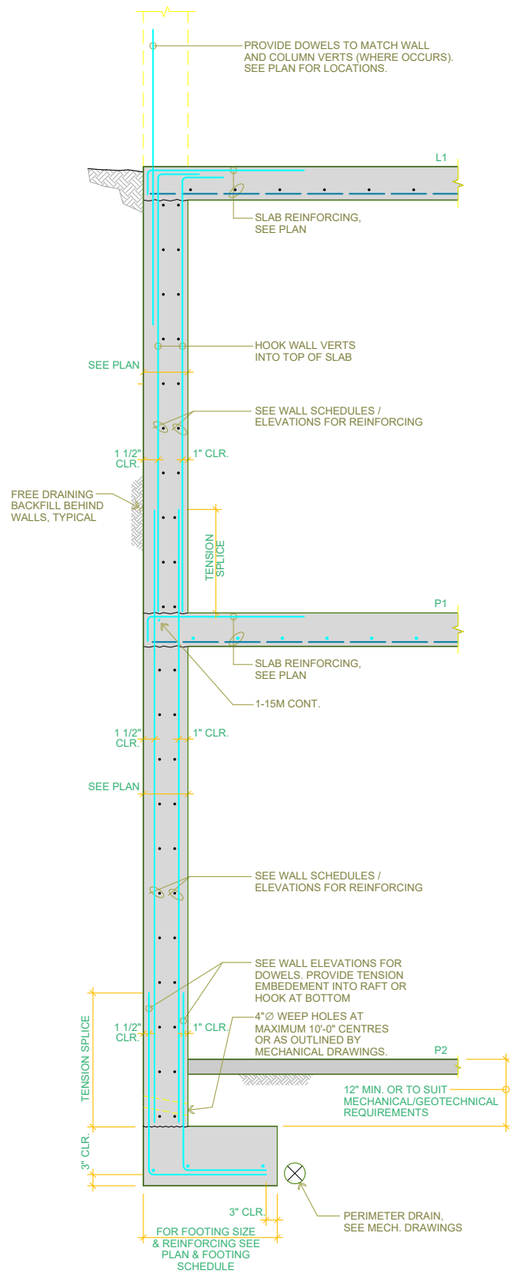


What differs: Single-storey basement wall with one slab and strip footing; 'D3.01_1_BASEMENT WALL SECTION' shows three suspended levels.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D301-DET 04 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

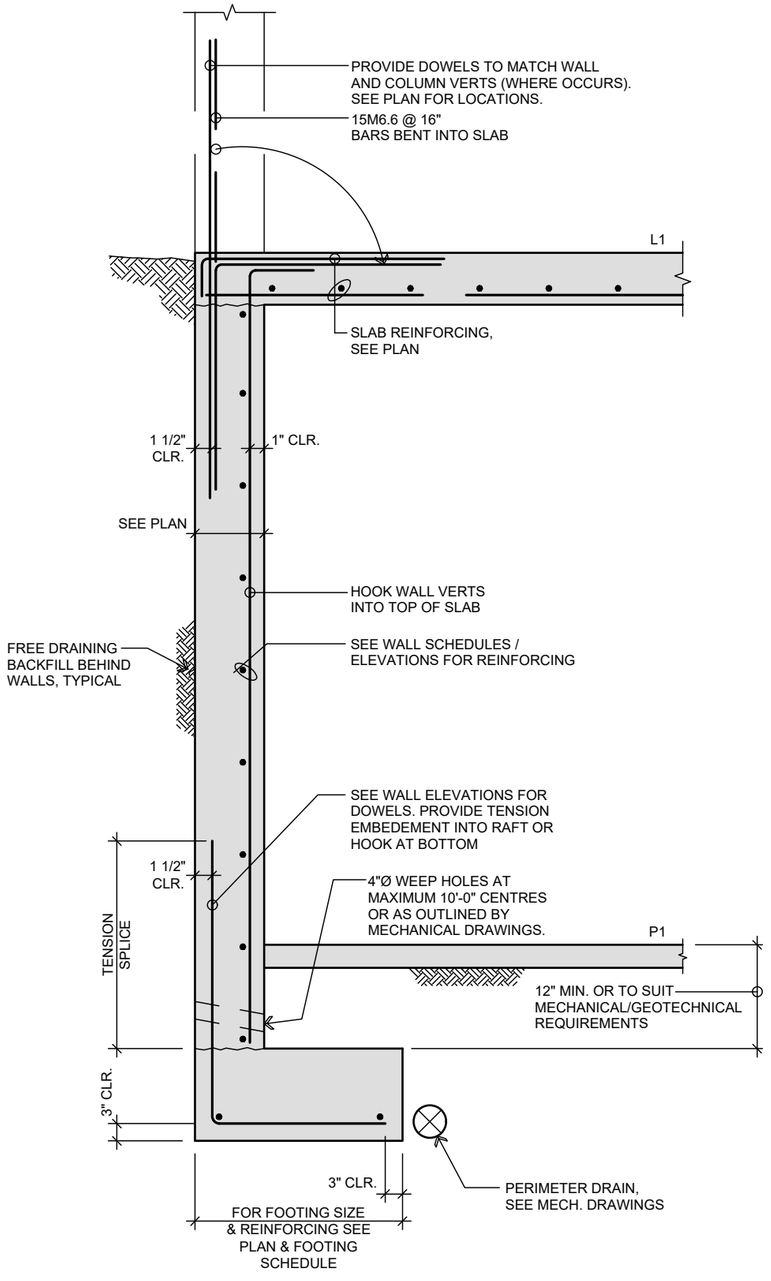

Revit template

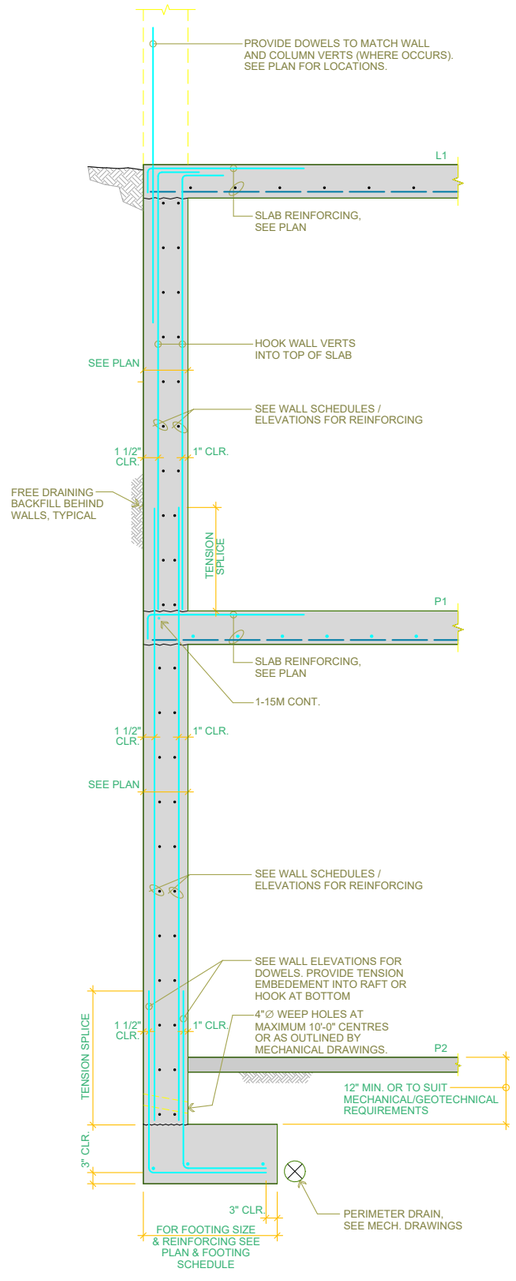


What differs: Single-storey basement wall with slab dowels and footing; 'D3.01_1_BASEMENT WALL SECTION' shows three levels.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D301-DET 05 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

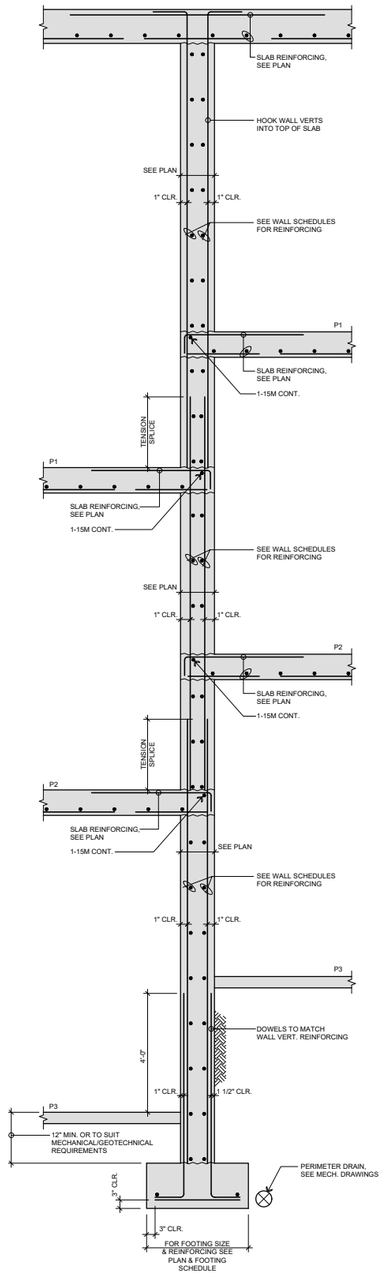

Revit template

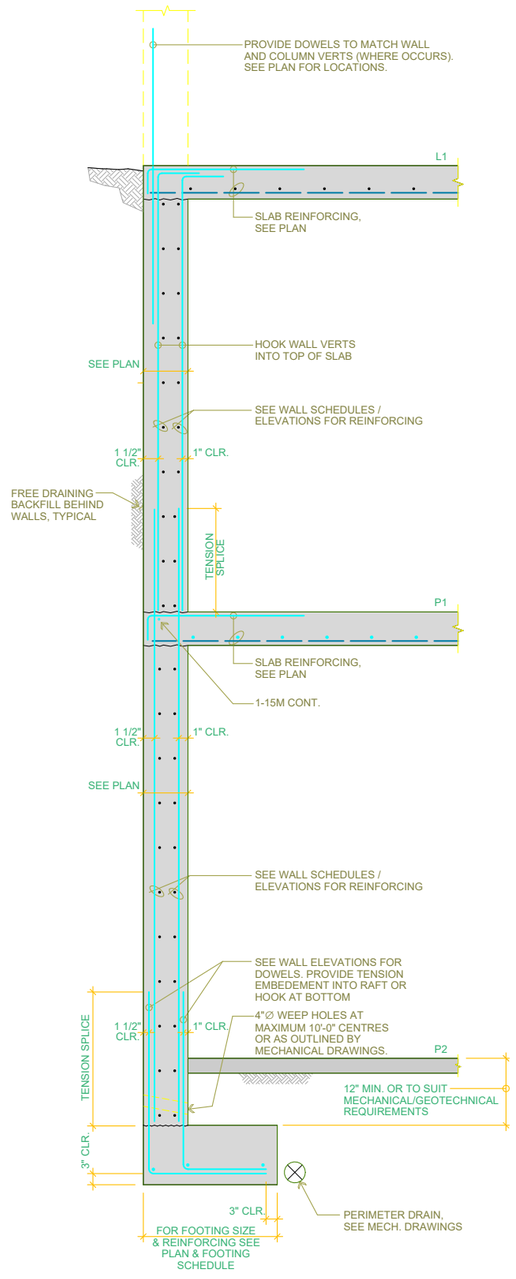


What differs: Tall multi-storey wall with five slabs; 'D3.01_1_BASEMENT WALL SECTION' shows three levels and different callouts.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

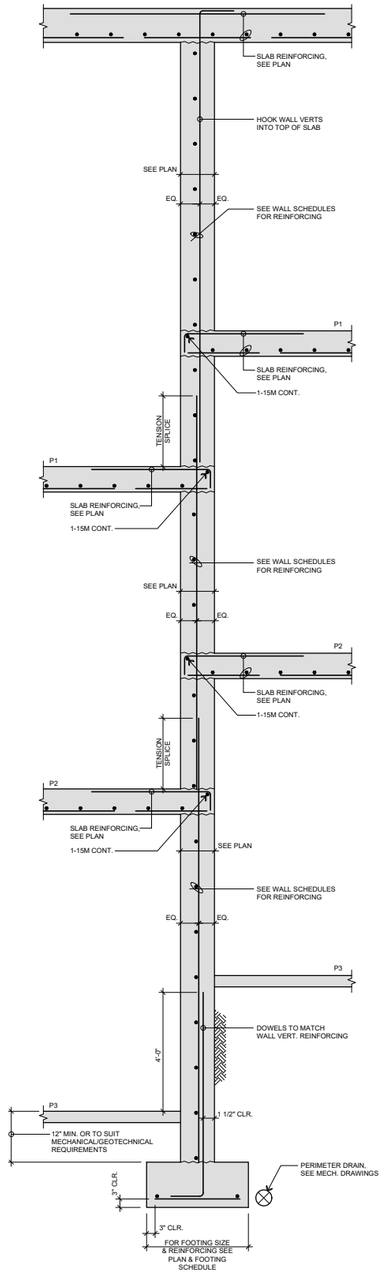

Revit template

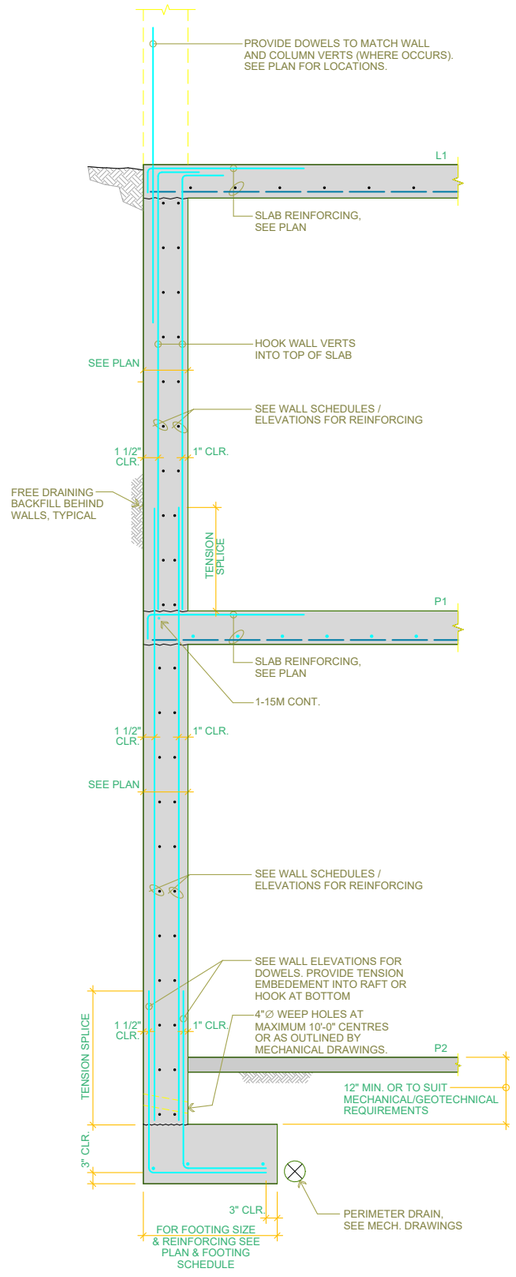


What differs: Tall multi-storey wall with five slabs; 'D3.01_1_BASEMENT WALL SECTION' shows three levels and different callouts.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 01 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

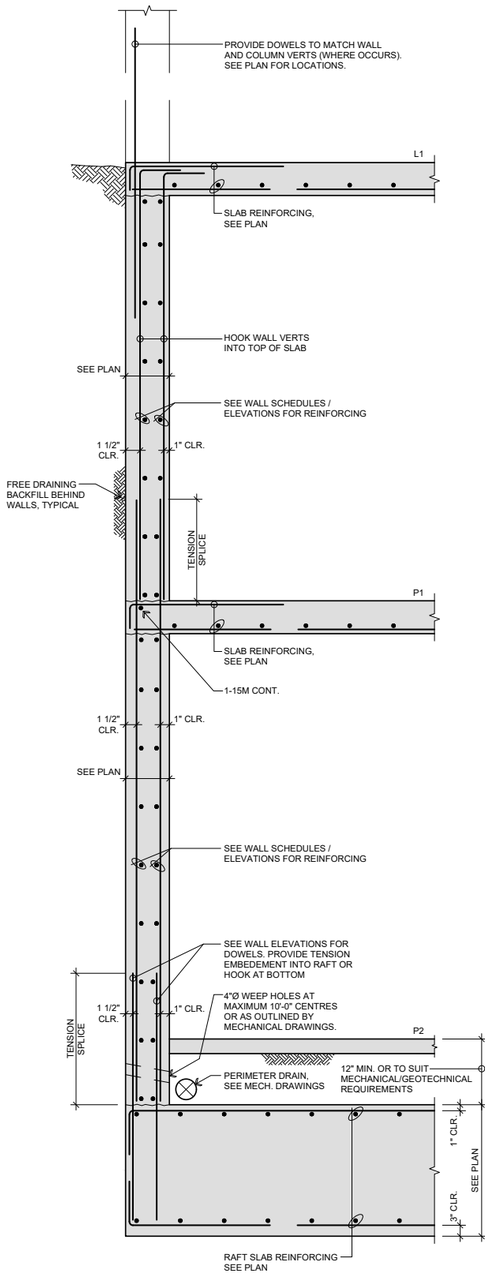

Revit template

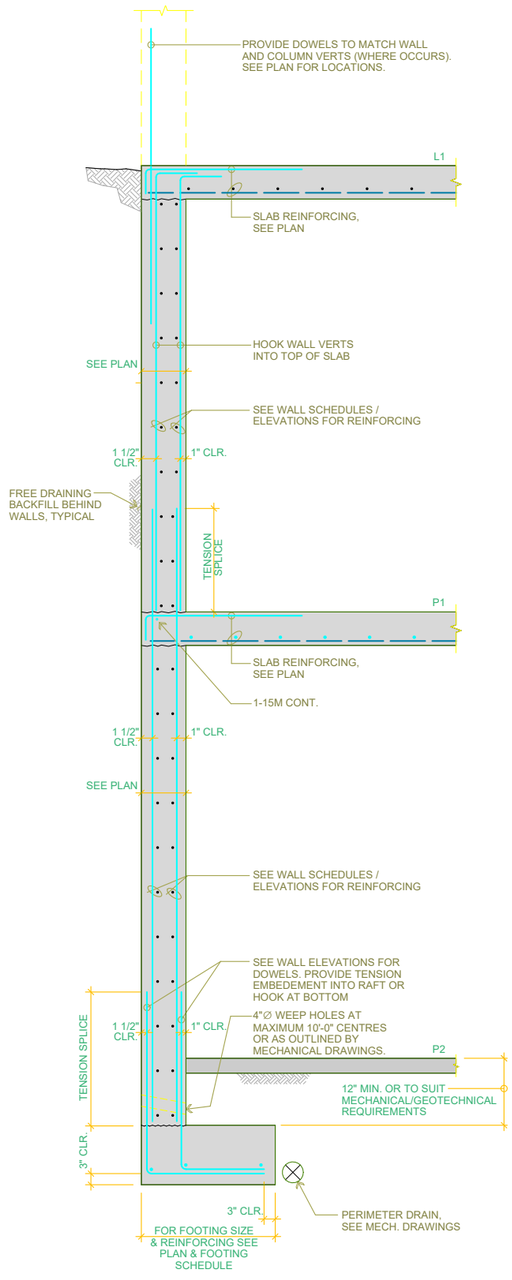


What differs: Basement wall section bearing on a raft instead of a strip footing; otherwise like 'D3.01_1_BASEMENT WALL SECTION'.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 02 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

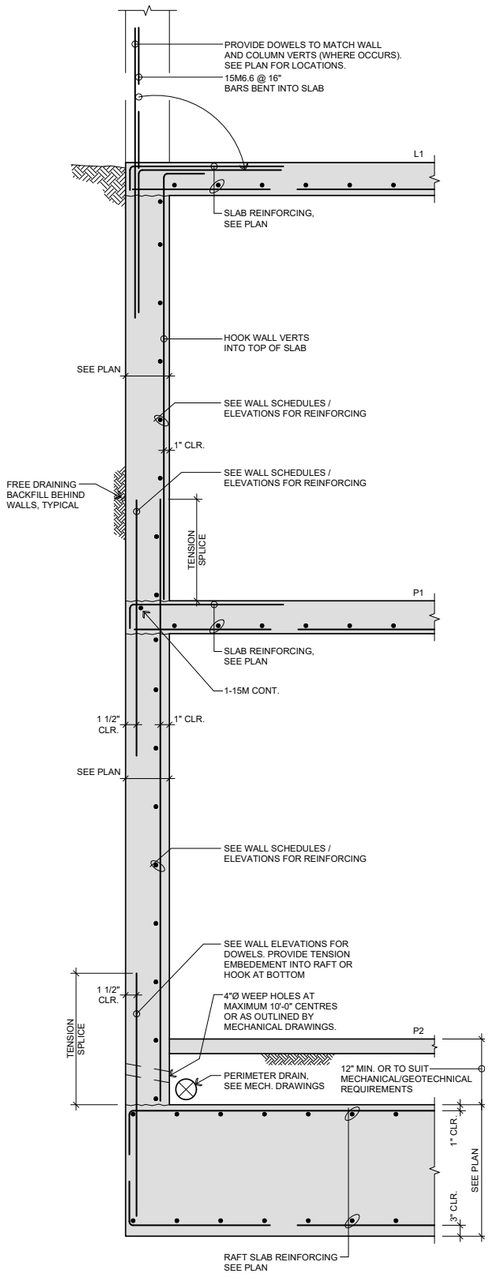

Revit template

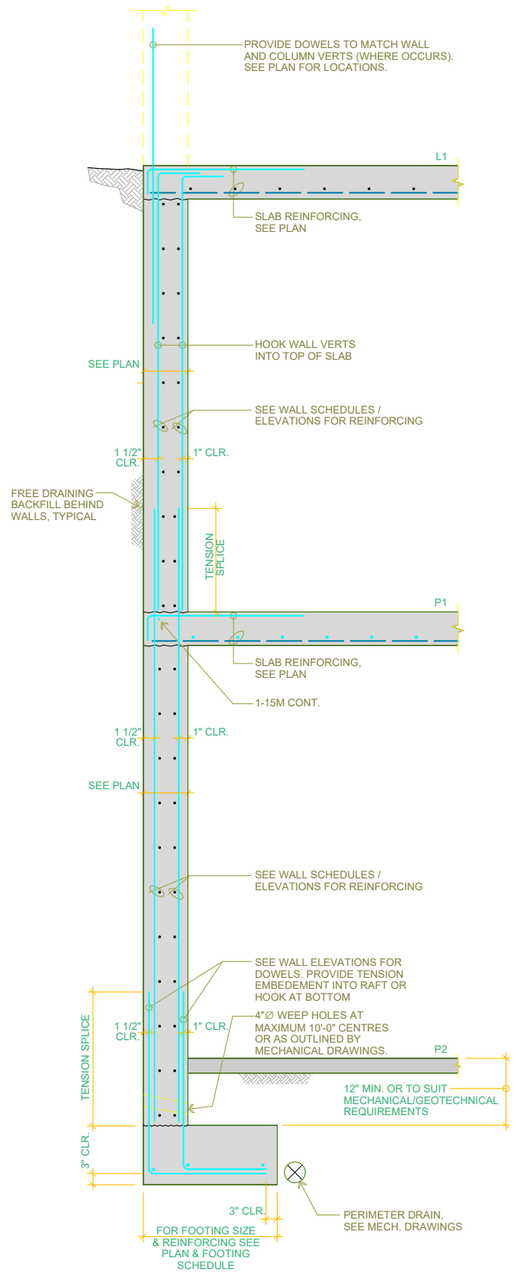


What differs: Basement wall on a raft with extra callouts vs 'D3.01_1_BASEMENT WALL SECTION''s strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D302-DET 03 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

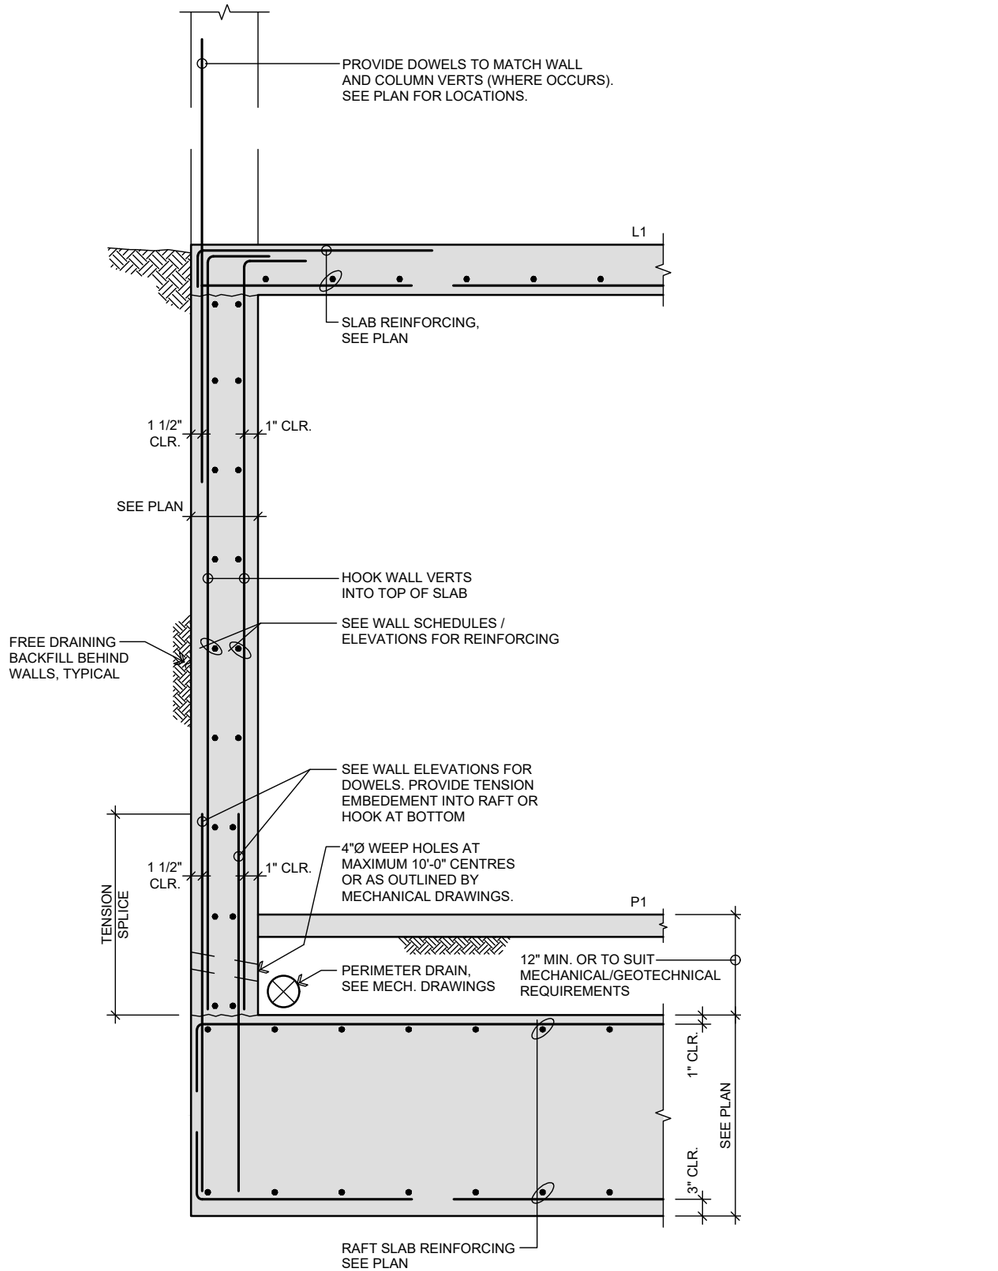

Revit template

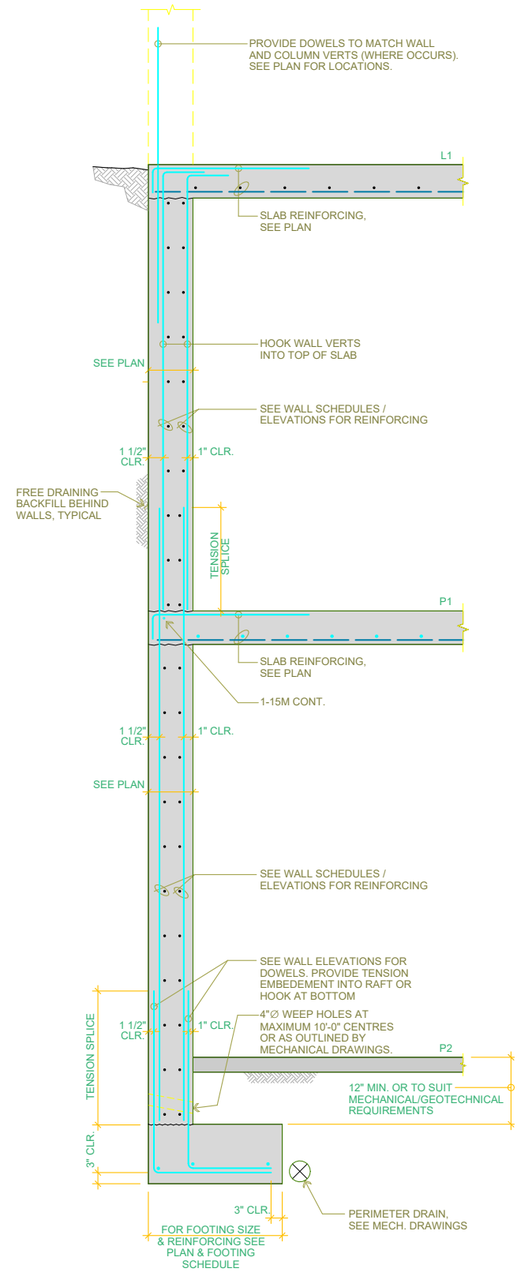


What differs: Single-storey basement wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 04 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

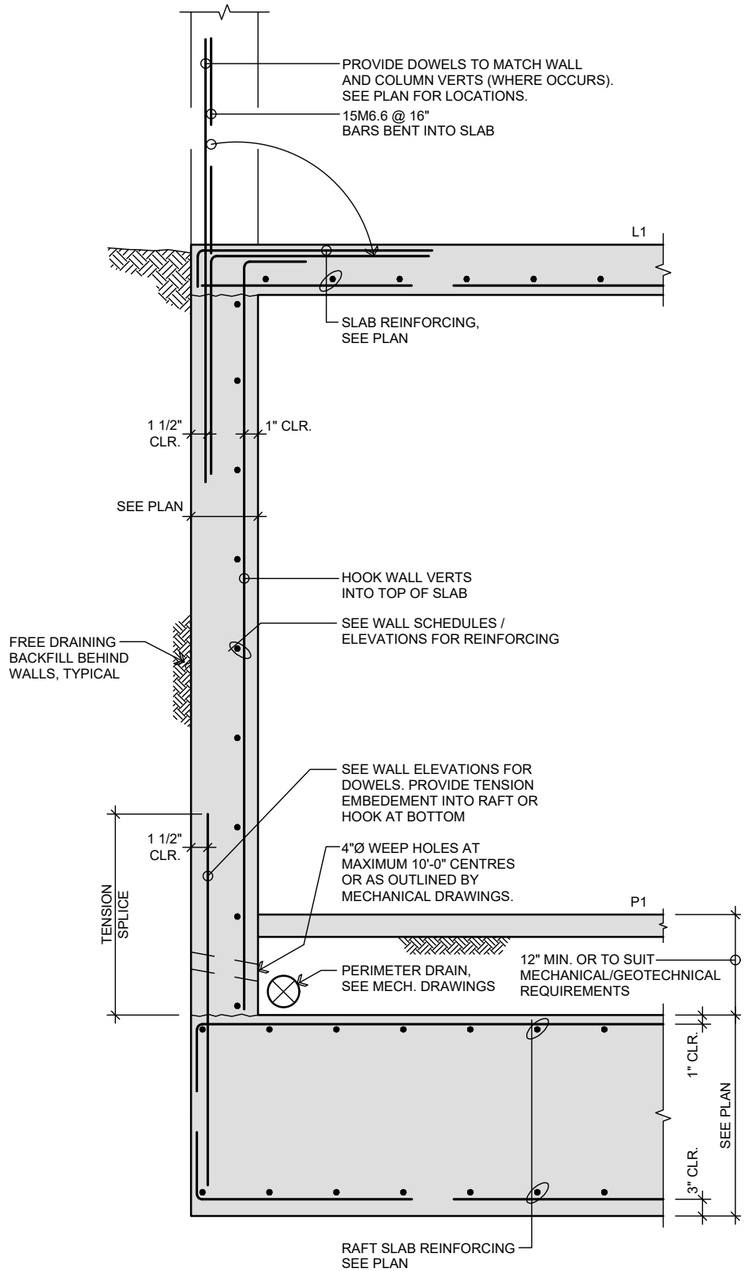

Revit template

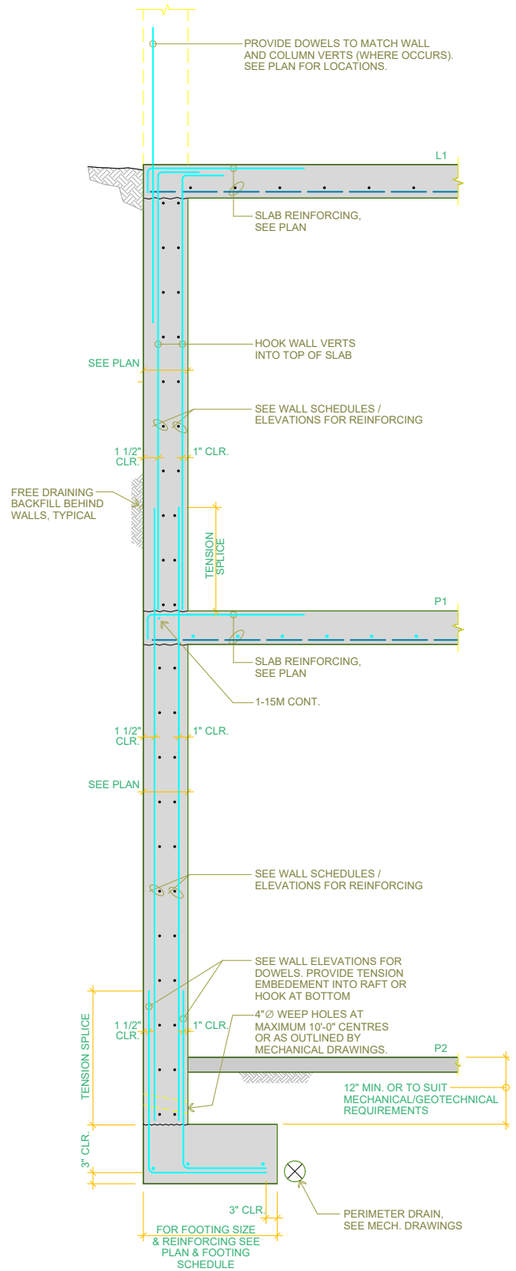


What differs: Single-storey basement wall on raft with slab dowel callout; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


23 of 55 CAD: KOR-D302-DET 05 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

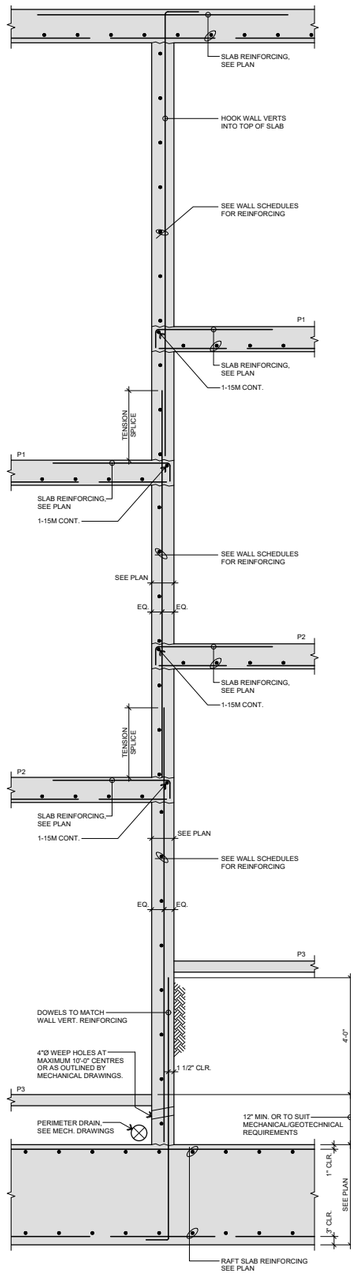

Revit template

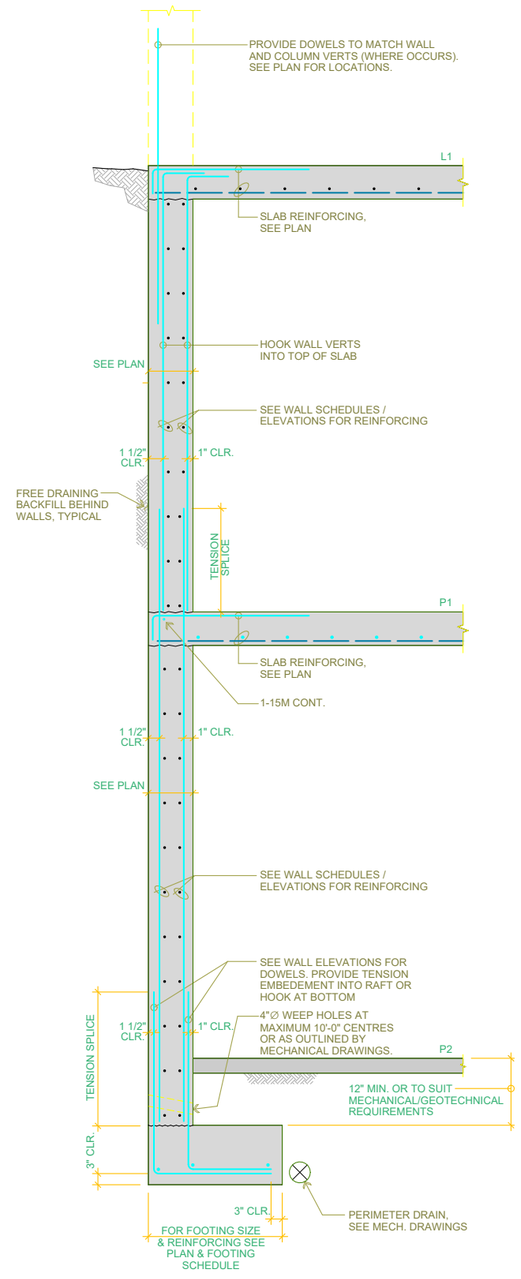


What differs: Tall multi-storey wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 06 - BASEMENT WALL SECTION

Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

CAD (master)

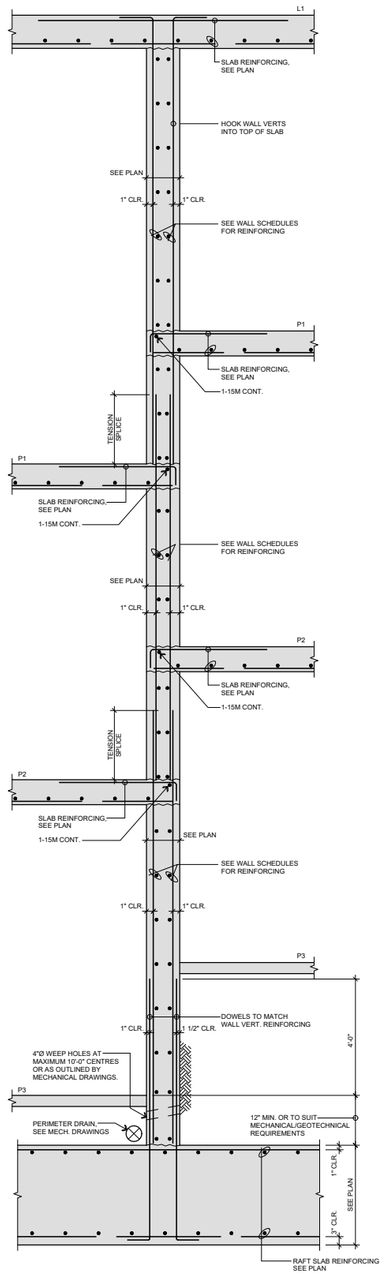

Revit template

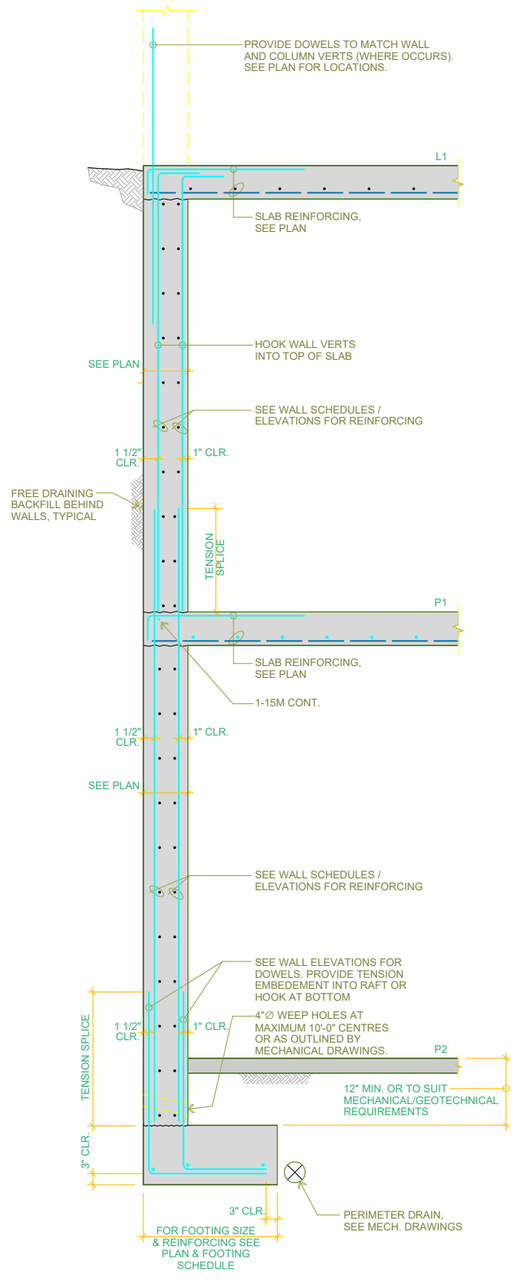


What differs: Tall multi-storey wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 07 - BASEMENT WALL SECTION

Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

CAD (master)

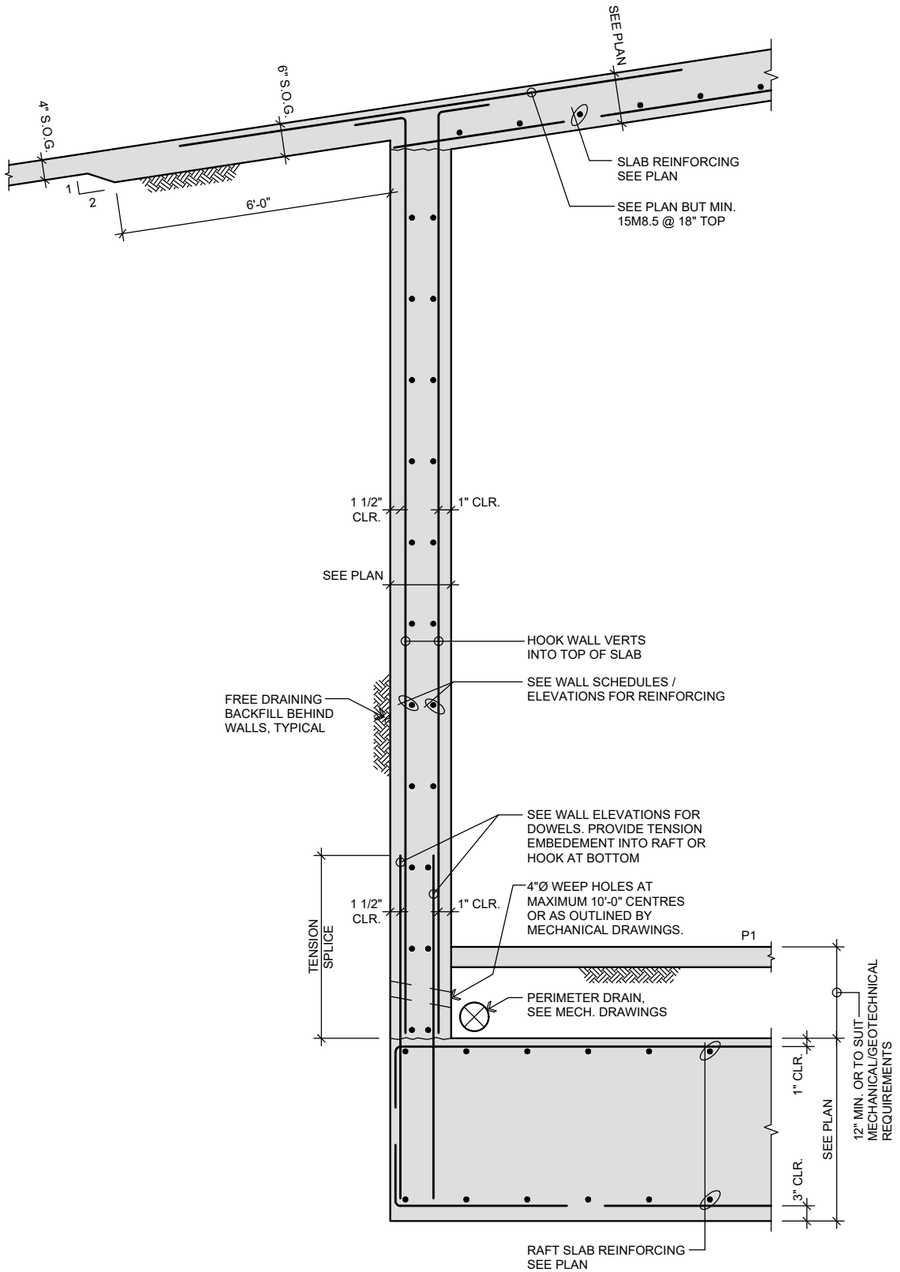

Revit template

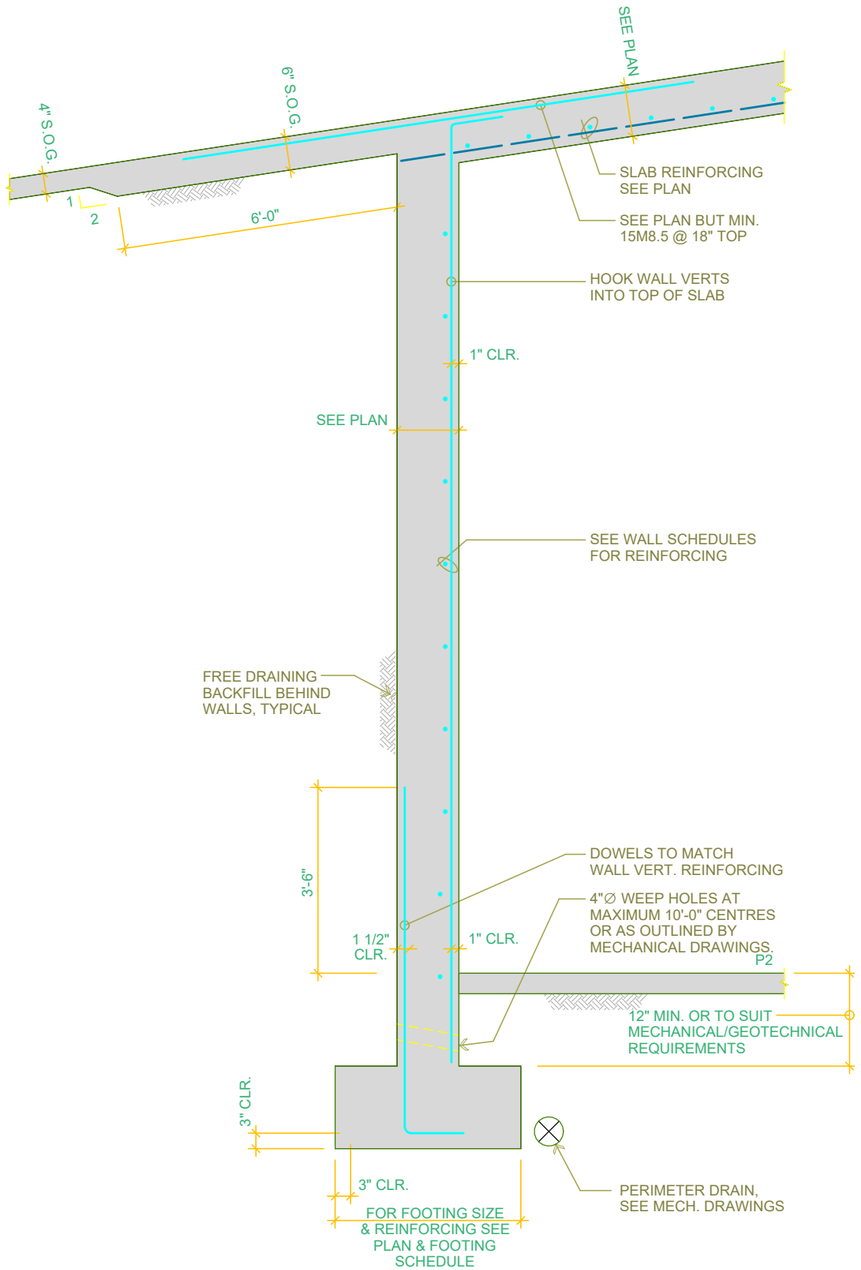


What differs: Wall with sloped slab over as 'S5.05_1_BASEMENT WALL DETAIL' but bearing on a raft rather than a strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D302-DET 08 - BASEMENT WALL SECTION

Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

CAD (master)

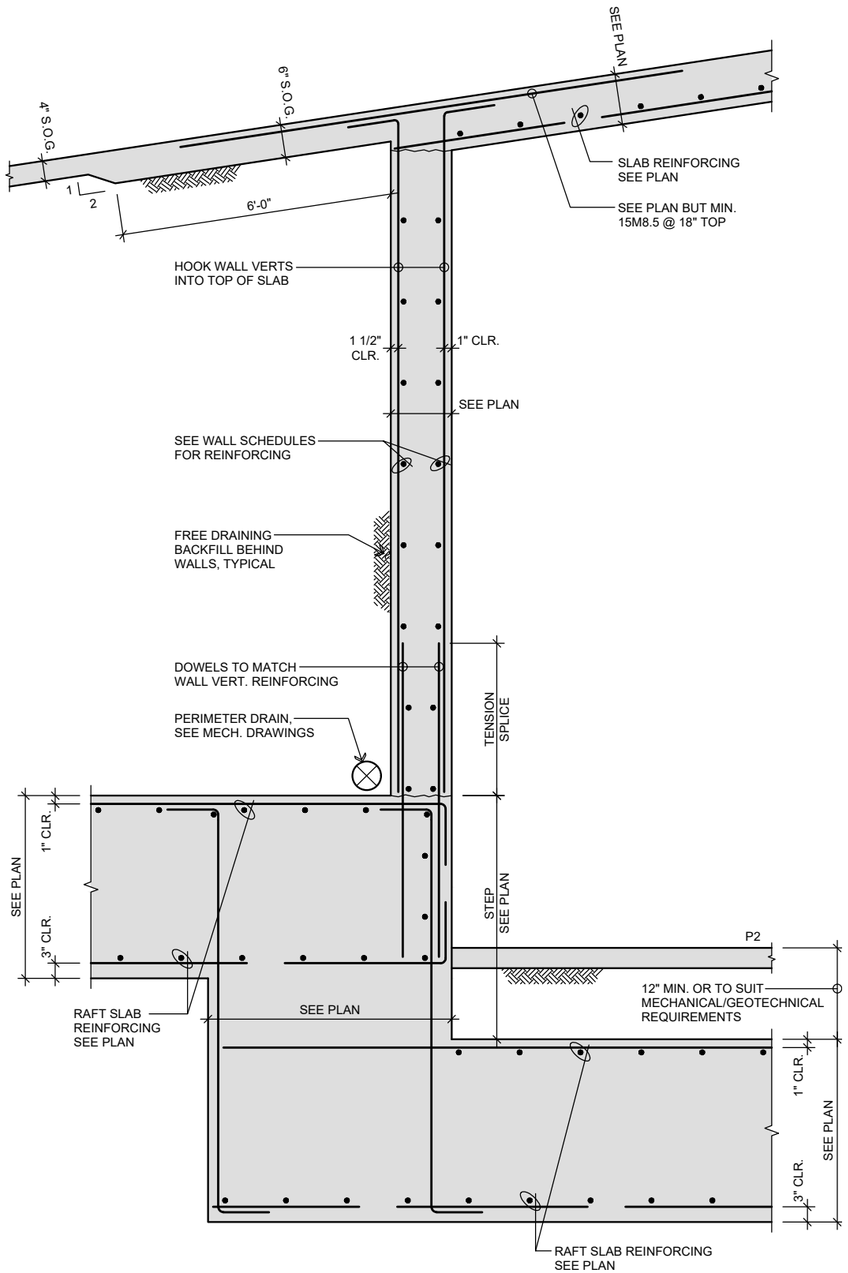

Revit template

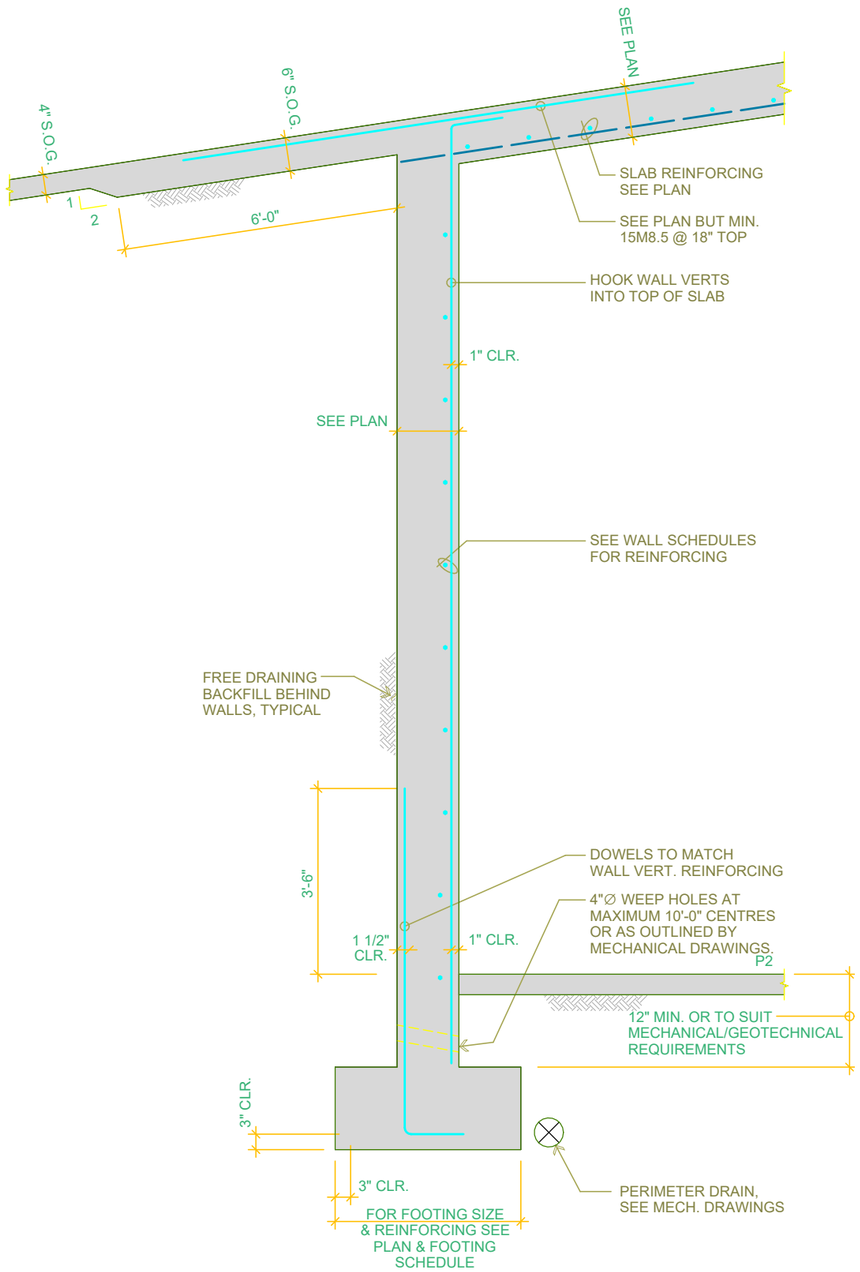


What differs: Wall with sloped slab over as 'S5.05_1_BASEMENT WALL DETAIL' but ending in a stepped raft rather than a strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

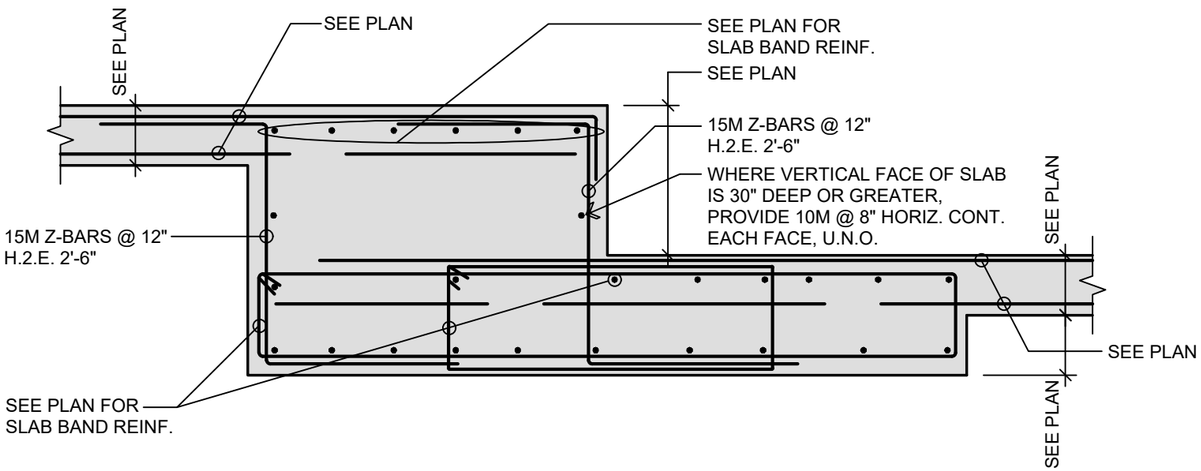

Revit template

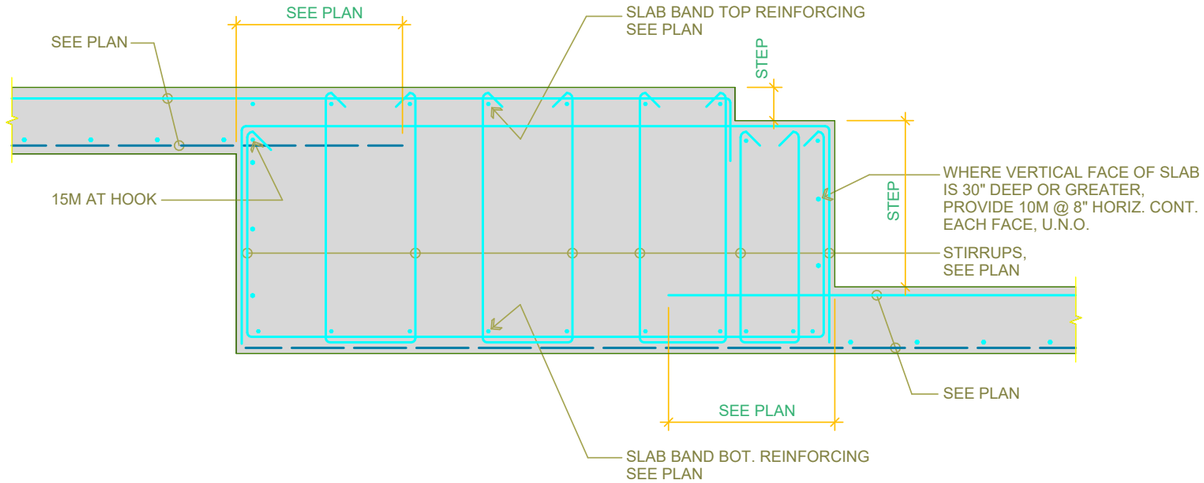


What differs: Slab band step reinforced with 15M Z-bars rather than 'D4.01_1_STEP SECTION''s stirrups and hooks.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D401-DET 04 - STEP SECTION

Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

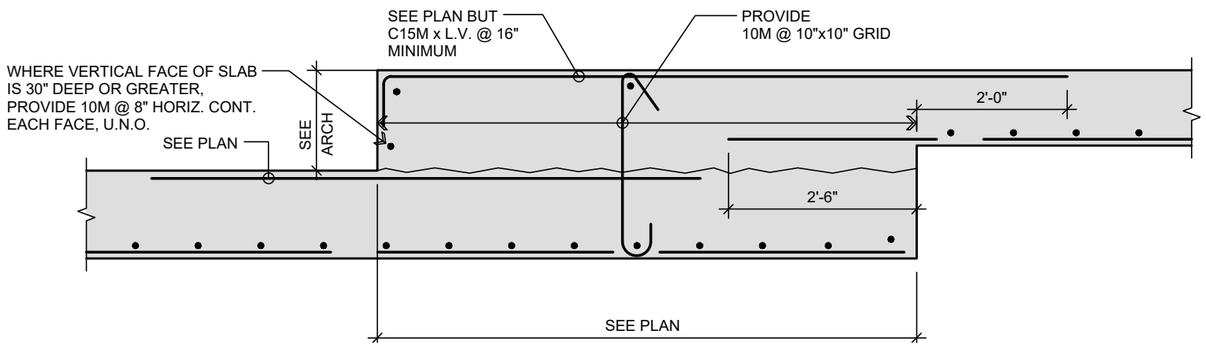

Revit template

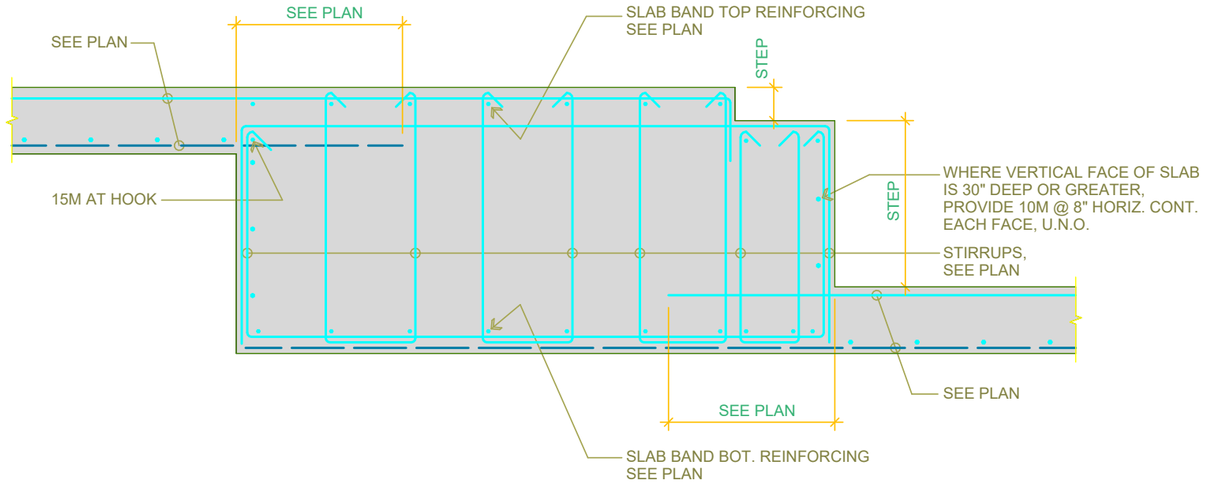


What differs: Top step built as a second pour with 10M grid dowel plus soffit step; 'D4.01_1_STEP SECTION' is a stirruped slab band step - closest only by purpose.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D401-DET 05 - STEP SECTION

Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

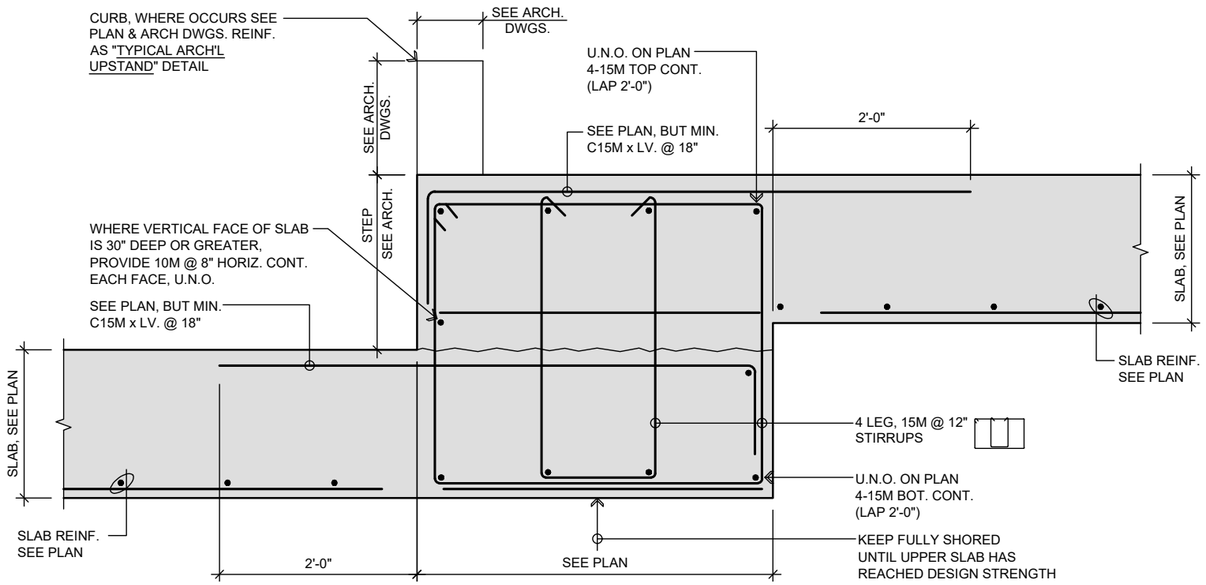

Revit template

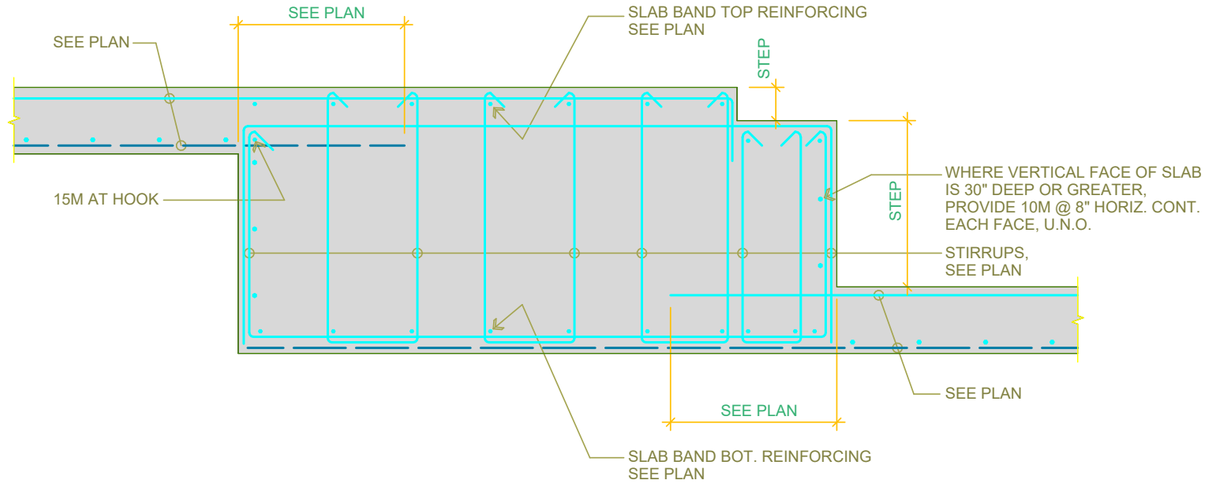


What differs: Step with curb and 4-leg stirruped beam at the step; 'D4.01_1_STEP SECTION' differs in geometry and bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D401-DET 06 - STEP SECTION

Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

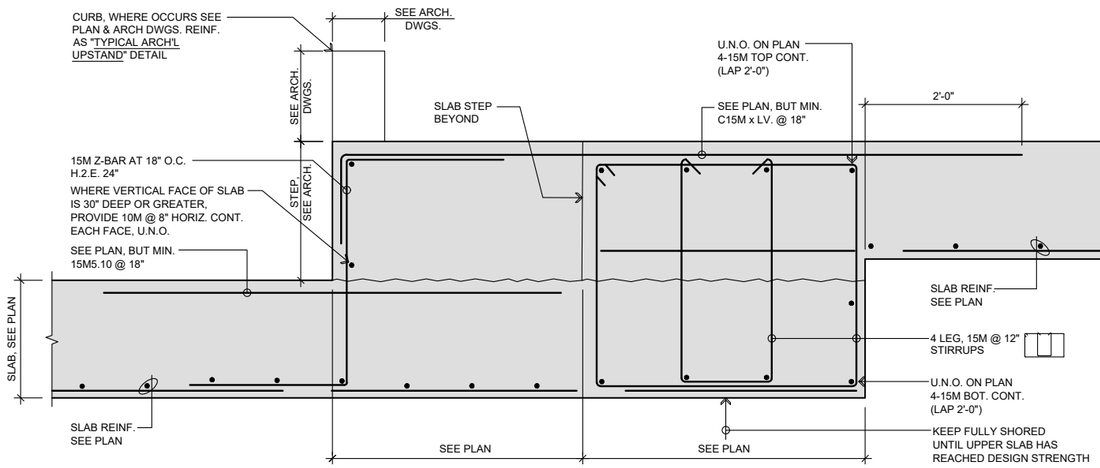

Revit template

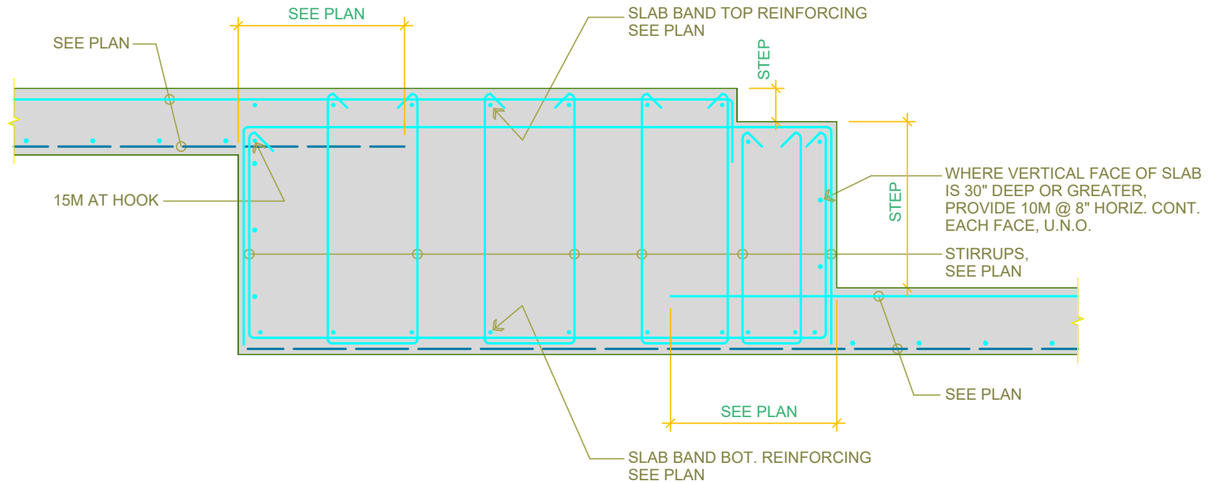


What differs: Step with curb, slab step beyond and stirruped beam; 'D4.01_1_STEP SECTION' differs in geometry and bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D401-DET 07 - STEP SECTION

Revit: D5.01_8_SOFFIT STEP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

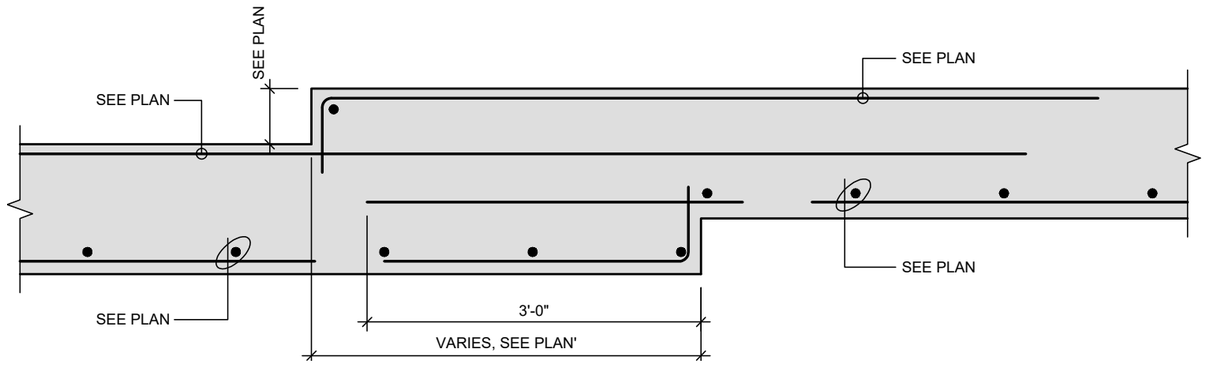

Revit template

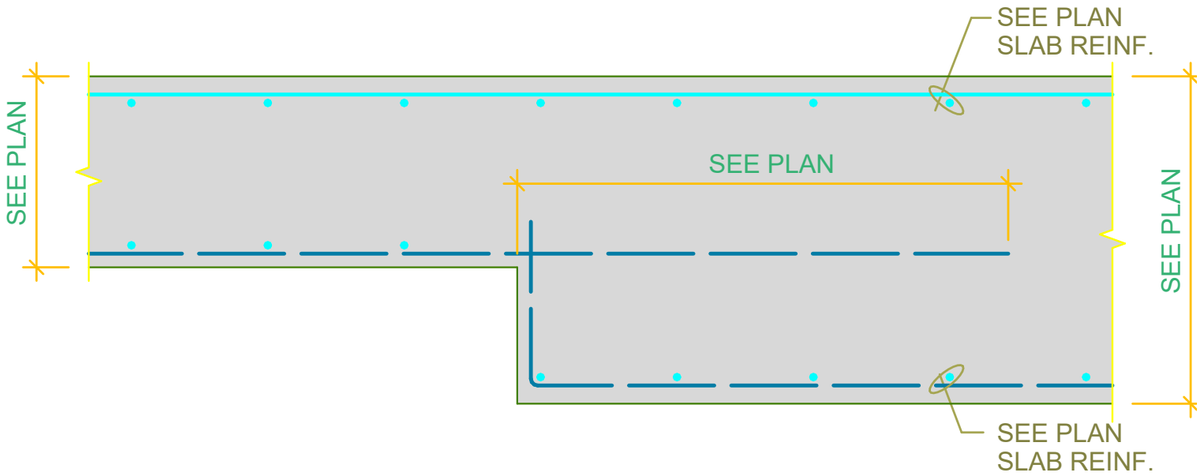


What differs: Combined top step and offset soffit step with hooked bottom bars; 'D5.01_8_SOFFIT STEP DETAIL' has the soffit step only.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

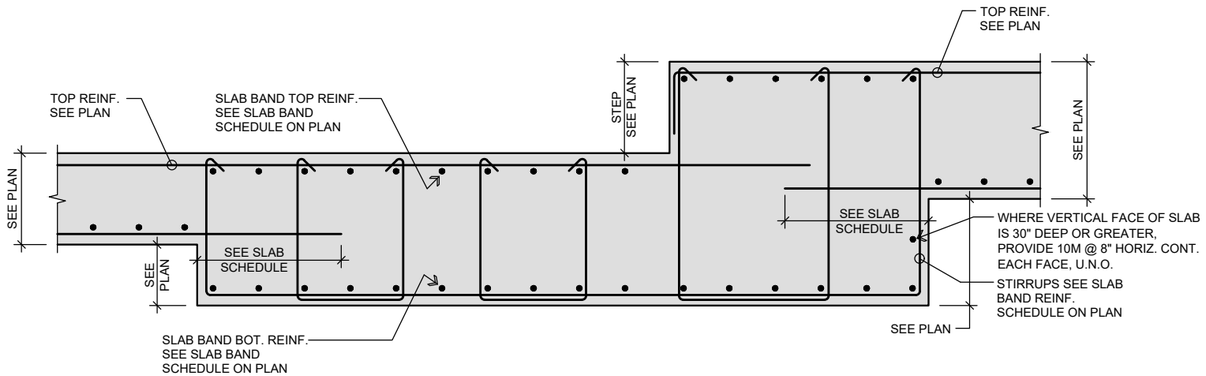

Revit template

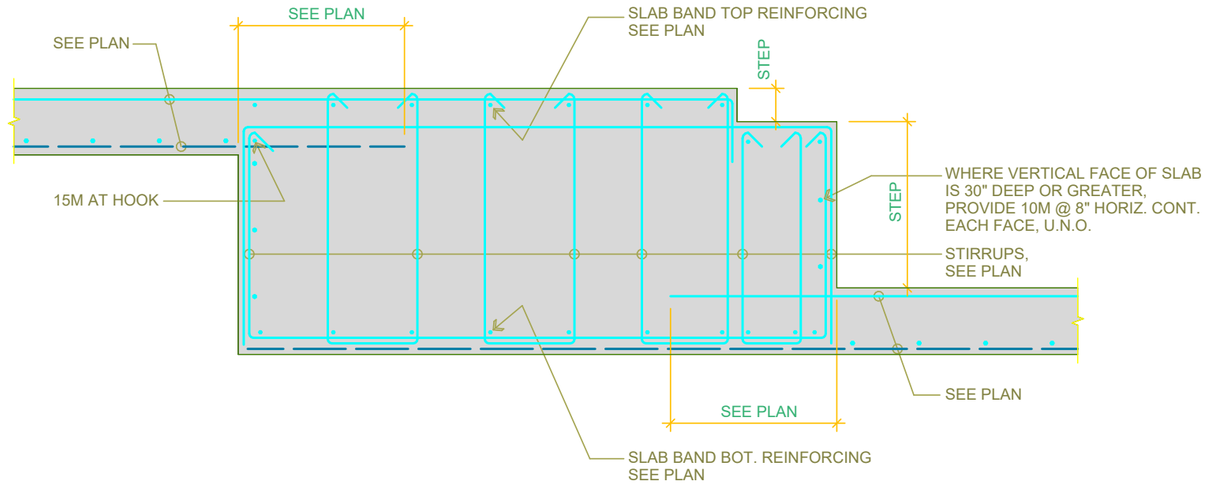


What differs: Slab band stepped on both sides with stirrups through; 'D4.01_1_STEP SECTION' is a single-side step.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D401-DET 10 - SOFFIT AND STEP SECTION

Revit: D4.01_9_SOFFIT STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

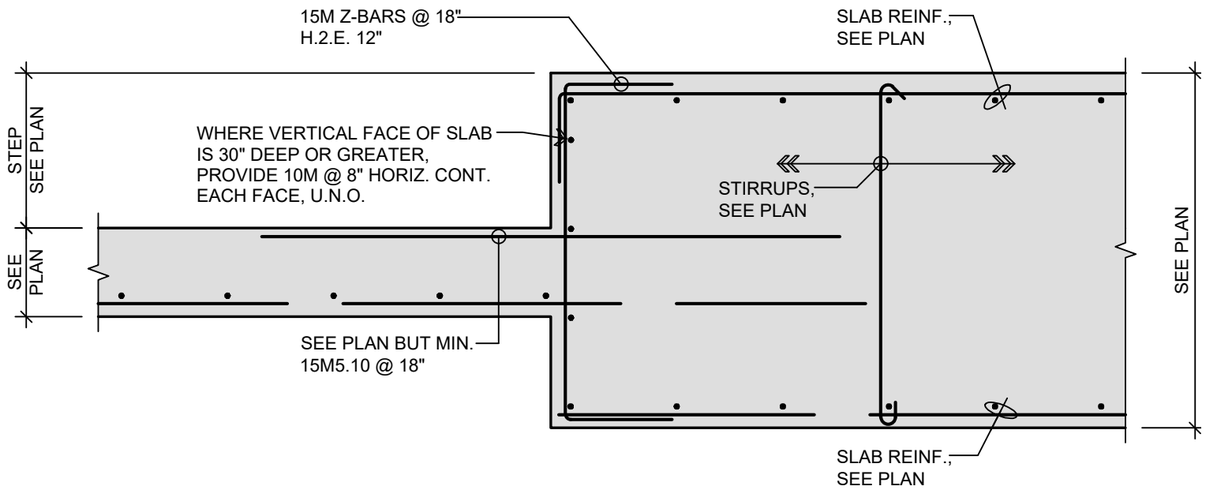

Revit template

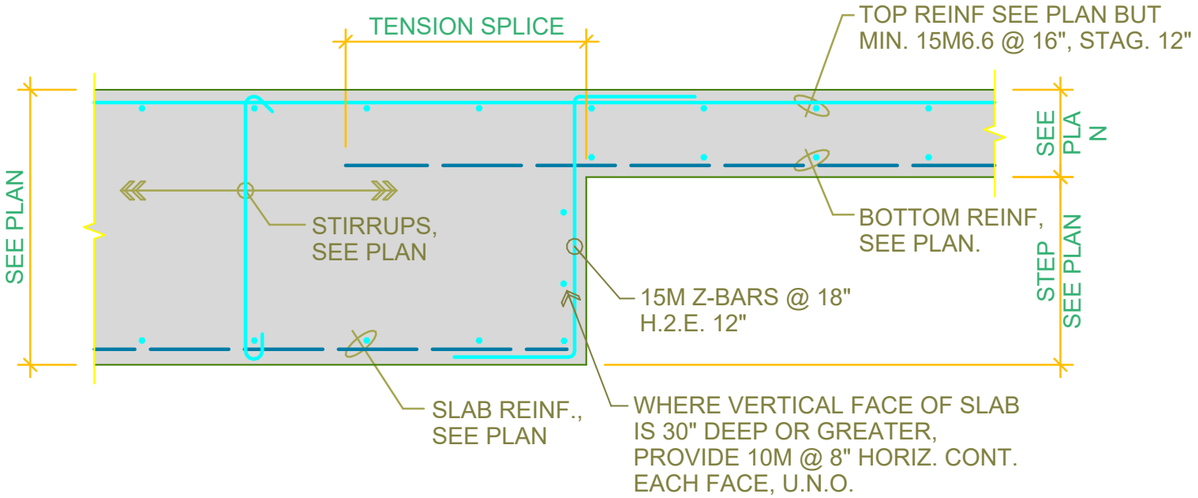


What differs: Soffit step combined with a top step (band higher than slab) using Z-bars; 'D4.01_9_SOFFIT STEP SECTION' has the soffit step only.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D4.01_9_SOFFIT STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

CAD (master)

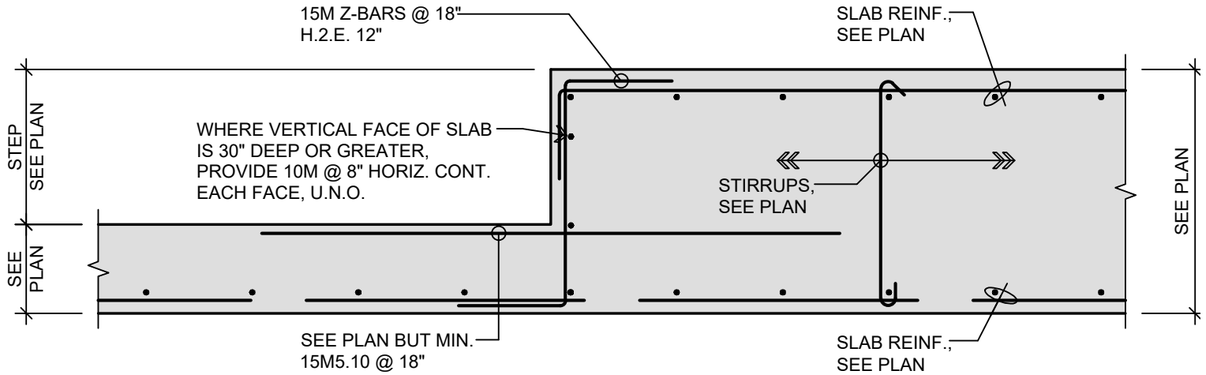

Revit template

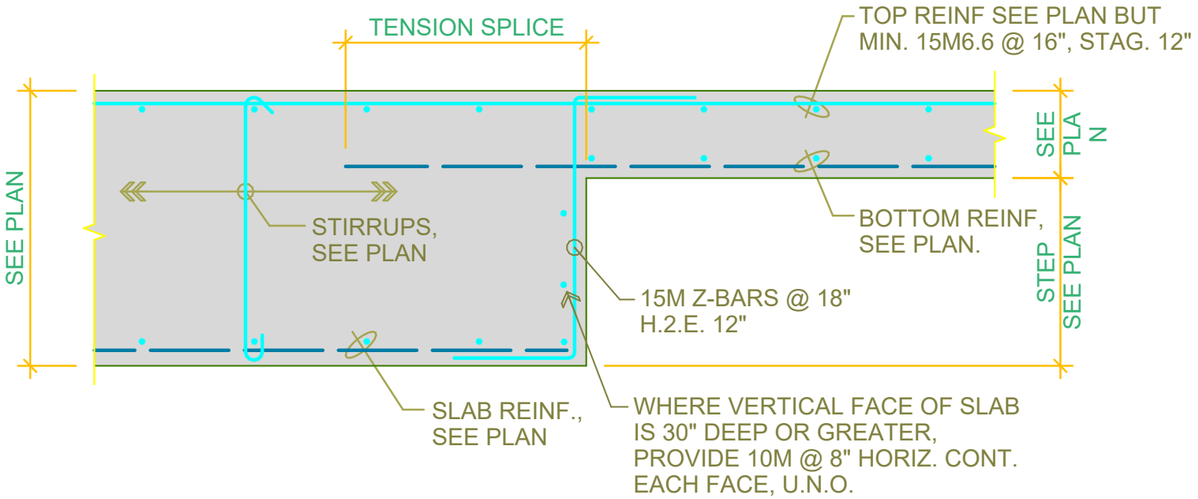


What differs: Drawing identical to D401-DET 10: soffit step plus top step; 'D4.01_9_SOFFIT STEP SECTION' shows the soffit step only.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D501-DET 05 - RAMP DETAIL

Revit: D5.01_4_RAMP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

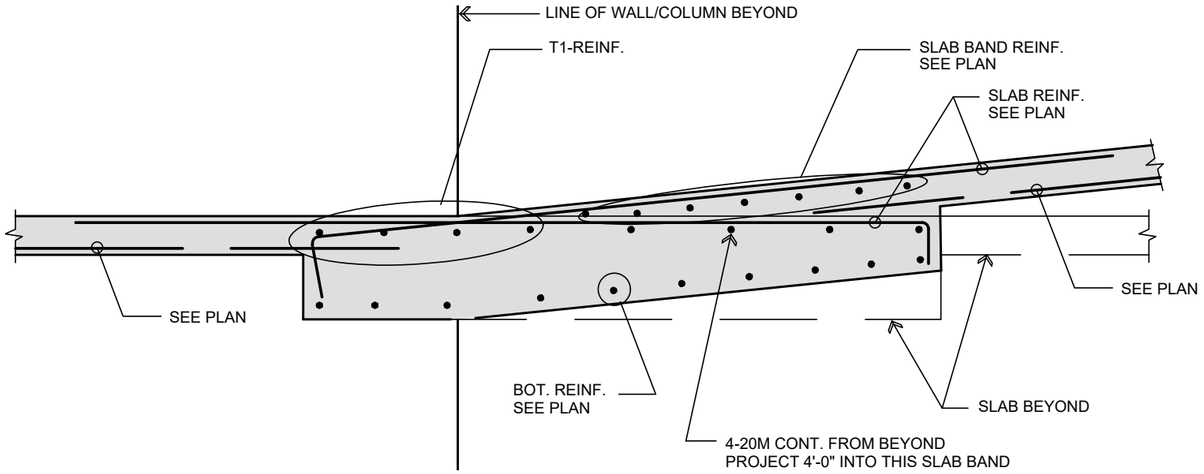

Revit template

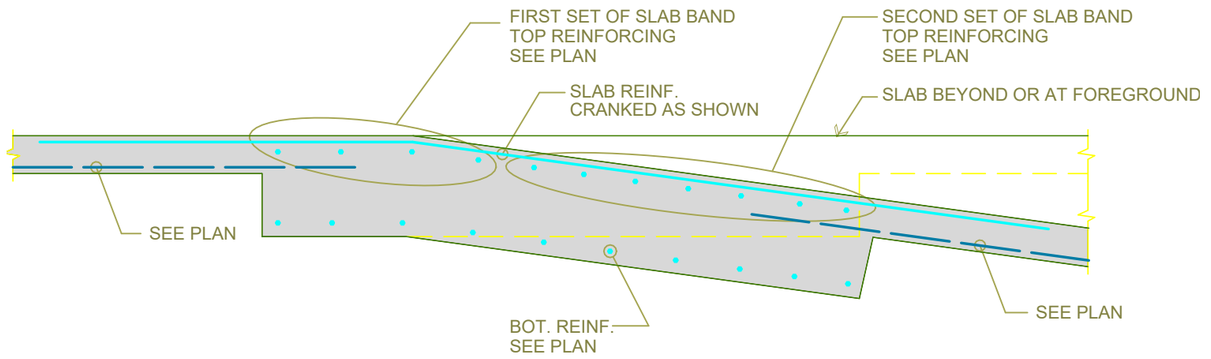


What differs: Ramp rising into slab band with 4-20M cont. bars and wall line beyond; 'D5.01_4_RAMP DETAIL' ramps down with a cranked second set of top bars.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D5.01_4_RAMP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

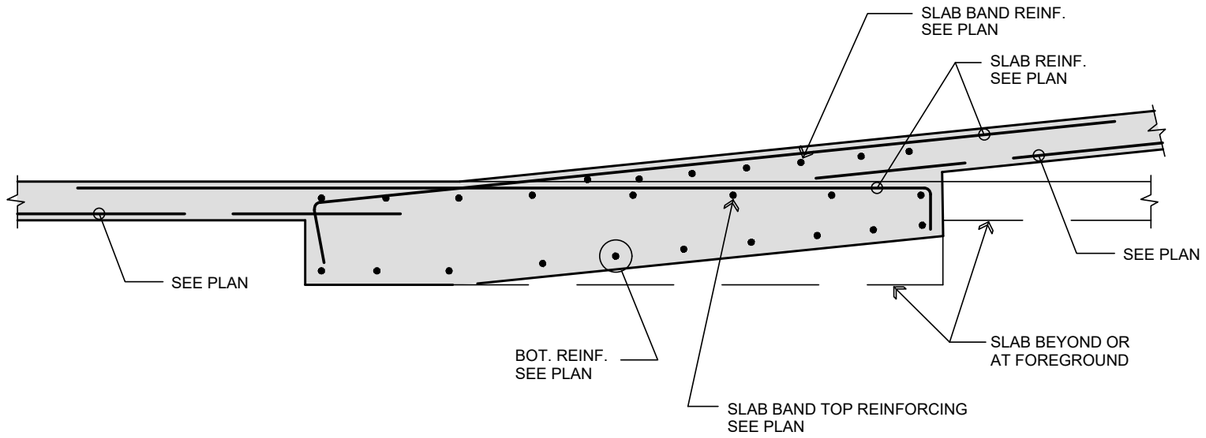

Revit template

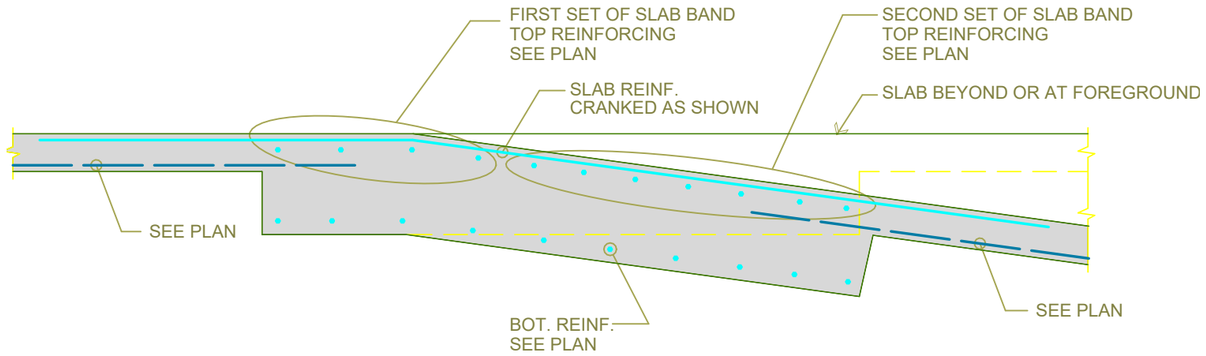


What differs: Ramp rising into slab band without 'D5.01_4_RAMP DETAIL"s cranked second set of top bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D501-DET 14 - LOAD BEARING STEEL GRATING SECTION

Revit: D5.01_13_LOAD BEARING STEEL GRATING SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

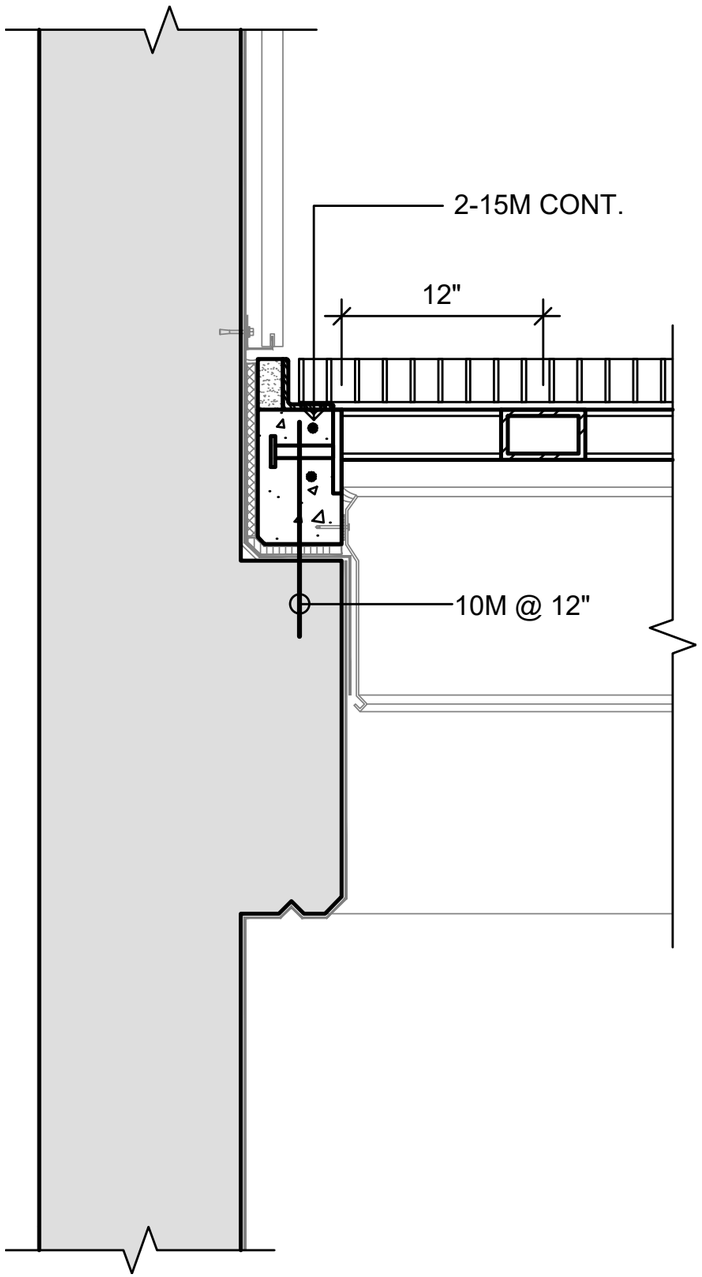

Revit template

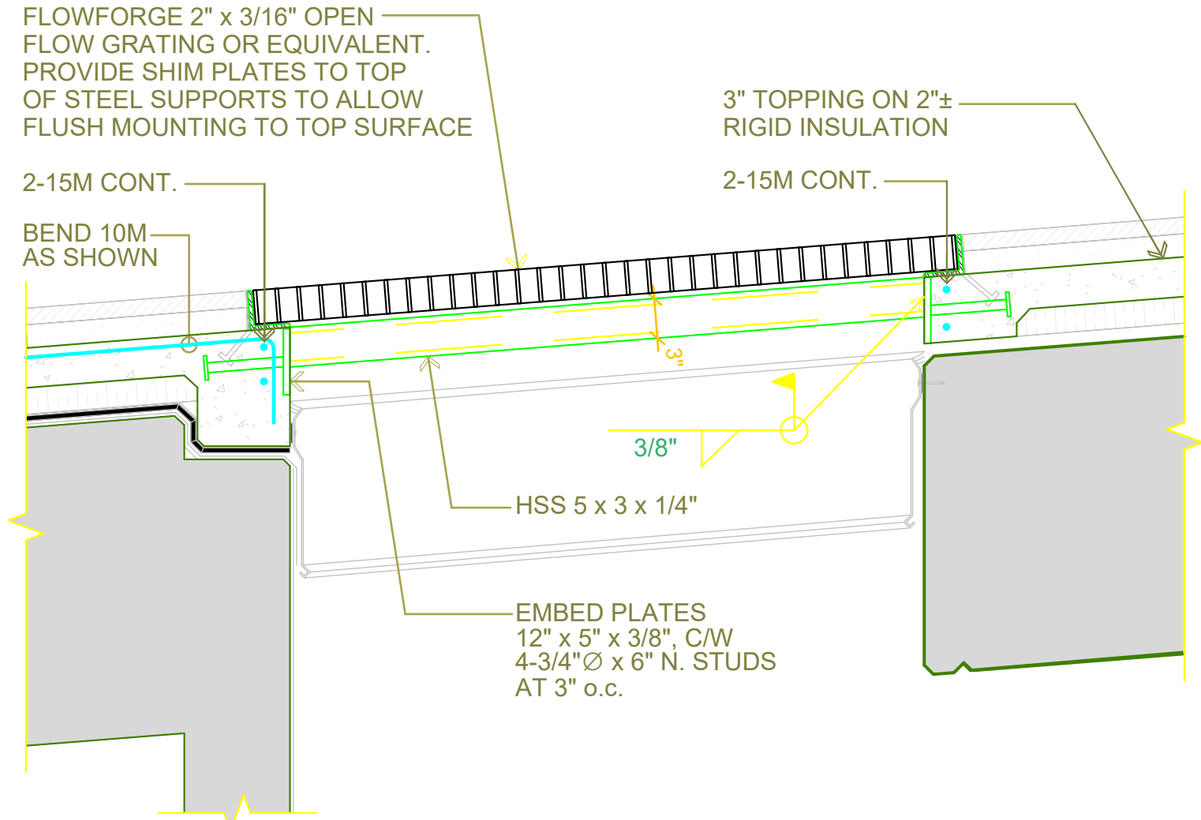


What differs: CAD is the grating support at a wall face with ledger and 10M dowels; 'D5.01_13_LOAD BEARING STEEL GRATING SECTION' is the grating spanning between slab edges.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D501-DET 18 - PENTHOUSE SPIRAL STEEL STAIR PLAN

Revit: D5.01_18_PENTHOUSE SPIRAL STEEL STAIR PLAN (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

CAD (master)

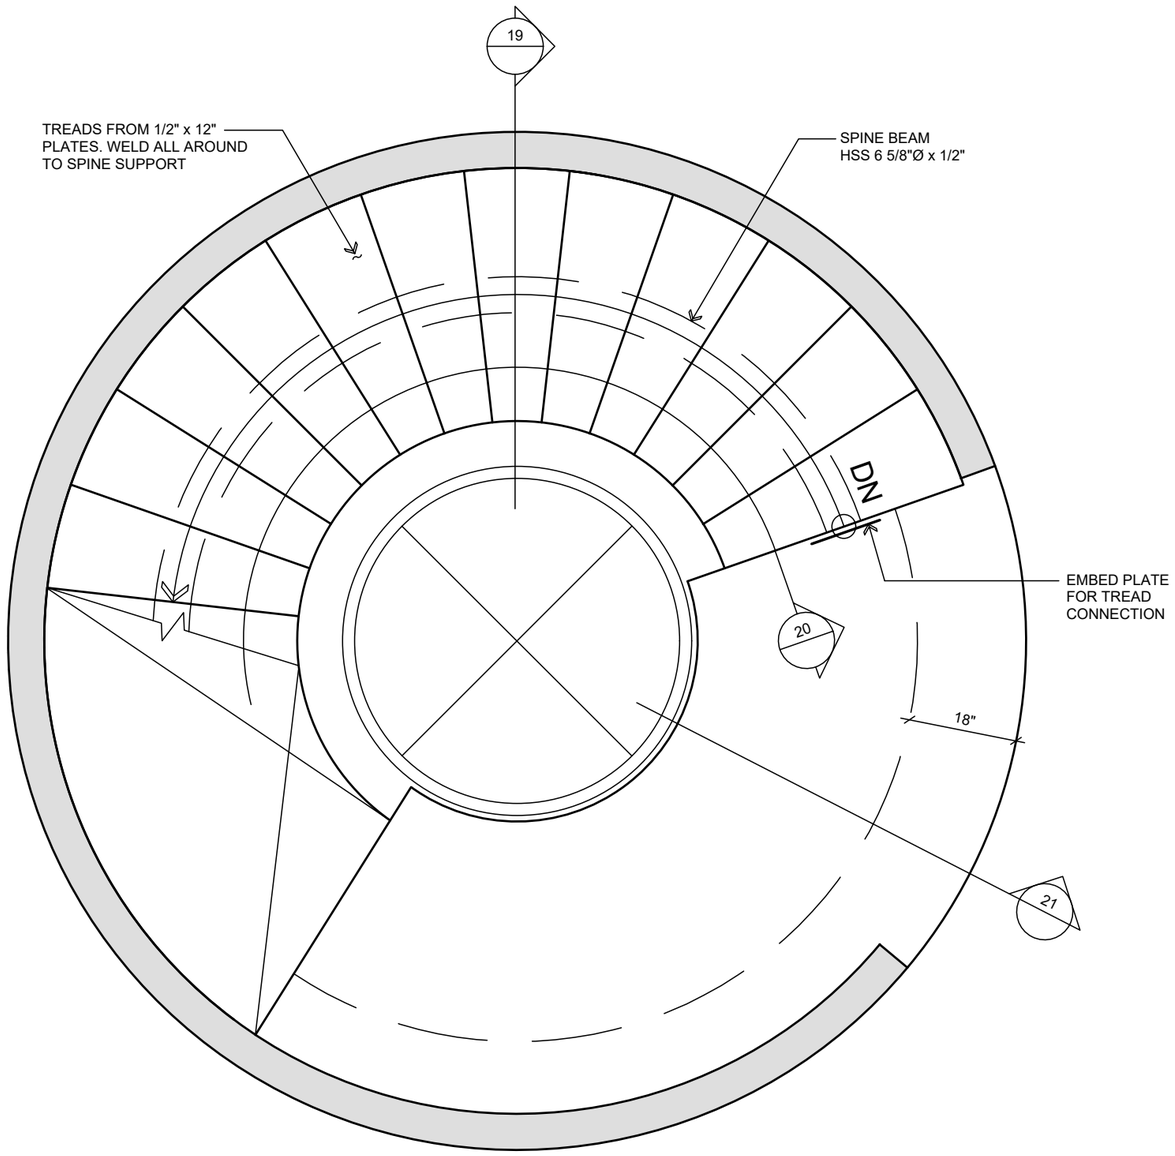

Revit template

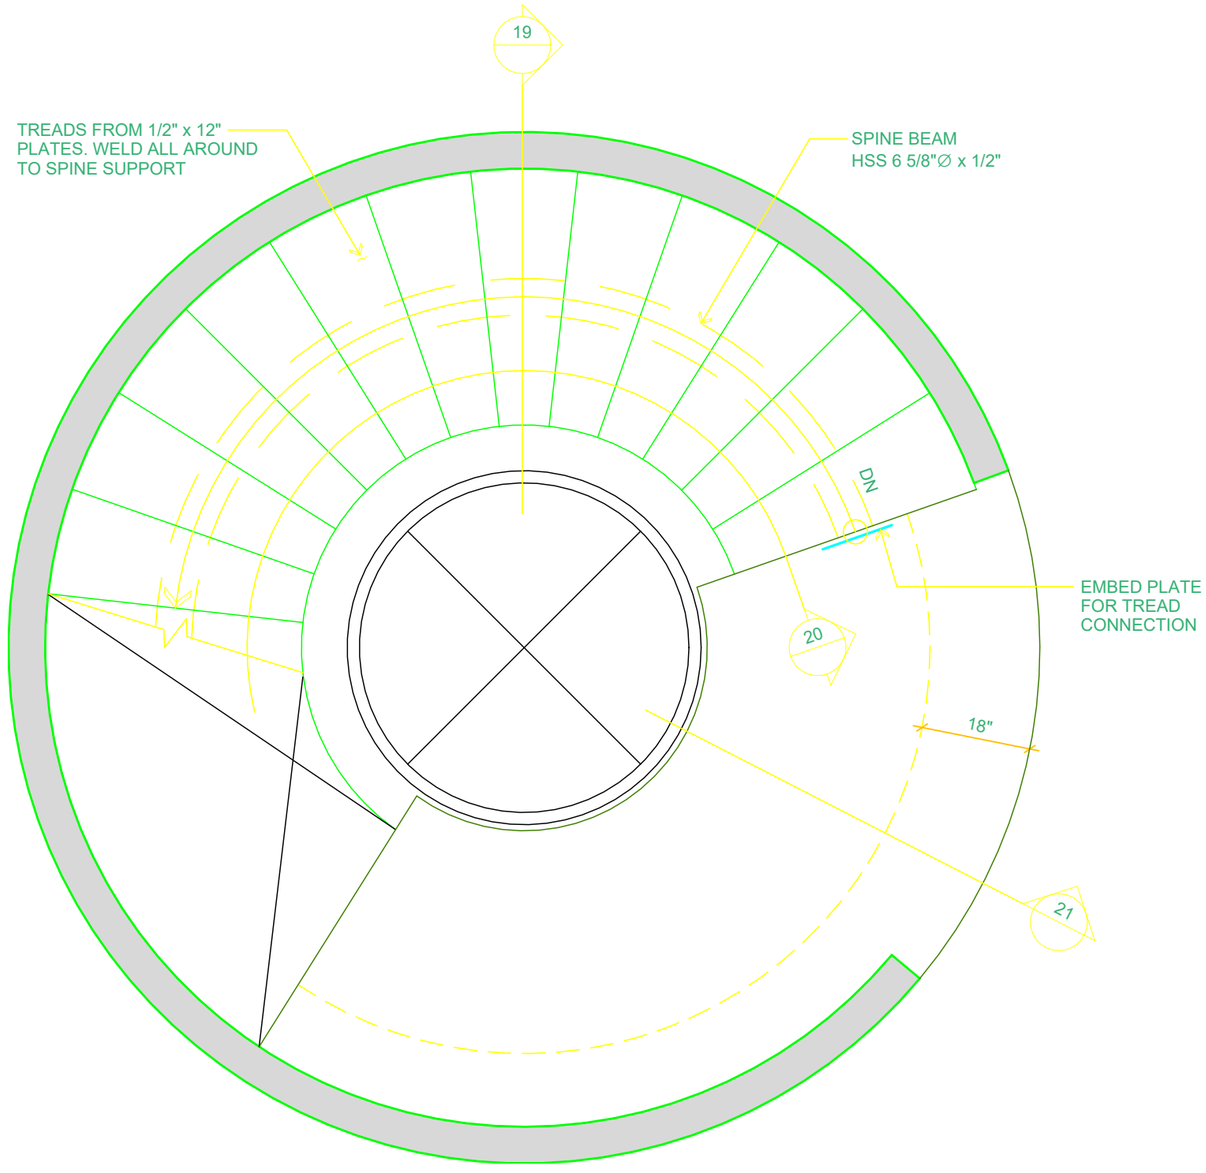


What differs: Same spiral stair plan content (treads, spine beam, embed plates) but CAD plan is drawn elliptical, Revit circular.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D5.02_10_TYPICAL ON GRADE SLAB THICKENING (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)

CAD (master)

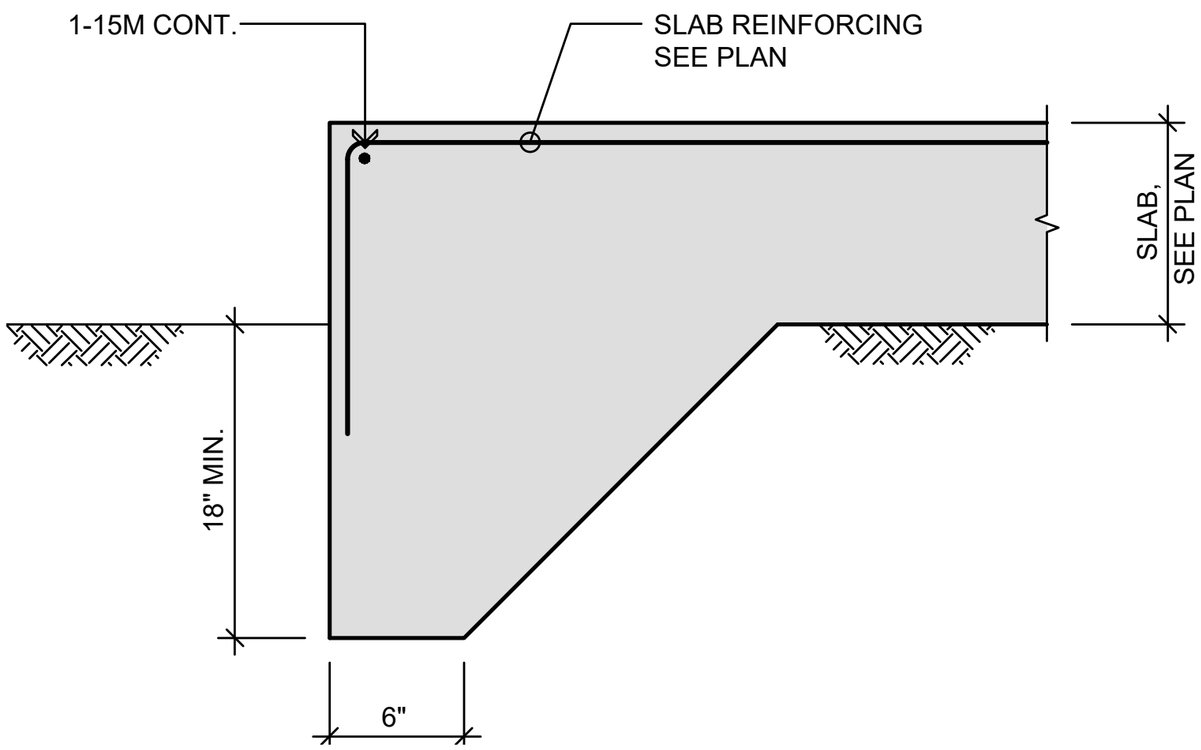

Revit template

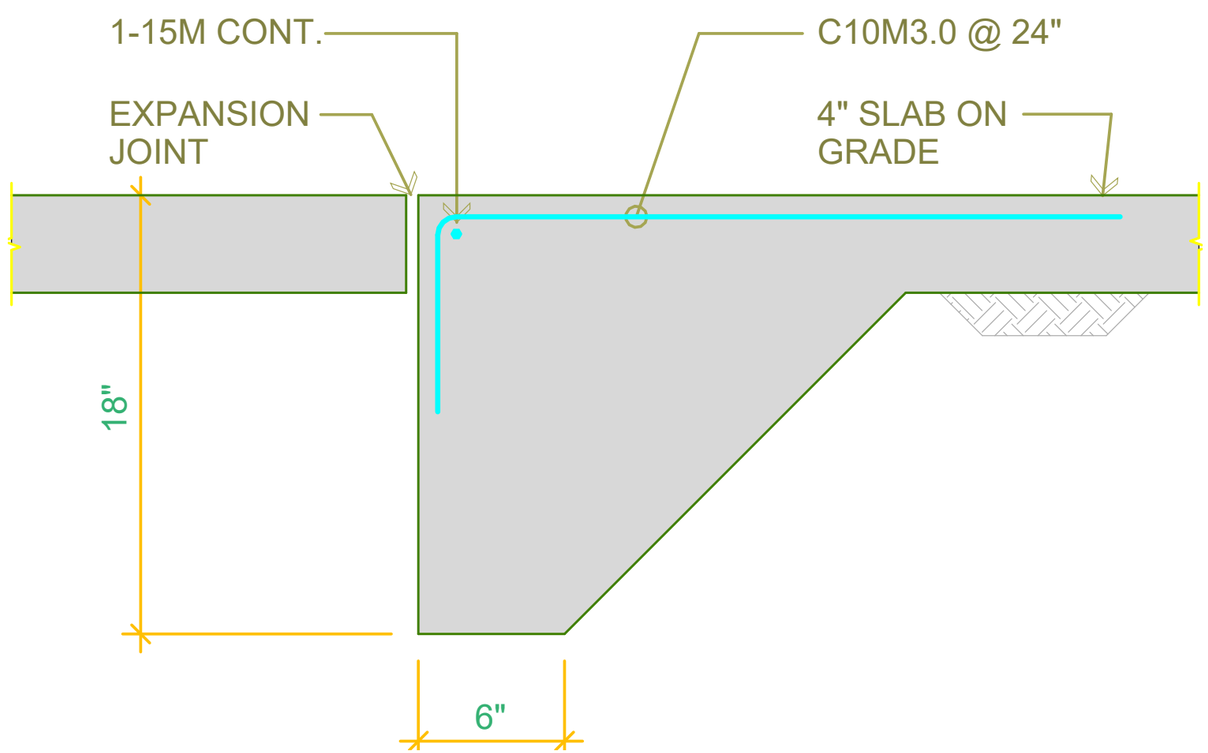


What differs: Thickened slab edge like 'D5.02_10_TYPICAL ON GRADE SLAB THICKENING' but no expansion joint/adjacent slab and different callouts.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D502-DET 12 - TYPICAL BUILT-UP SLAB UNO

Revit: 1E1.05_1_TYPICAL BUILT-UP SLAB (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

CAD (master)

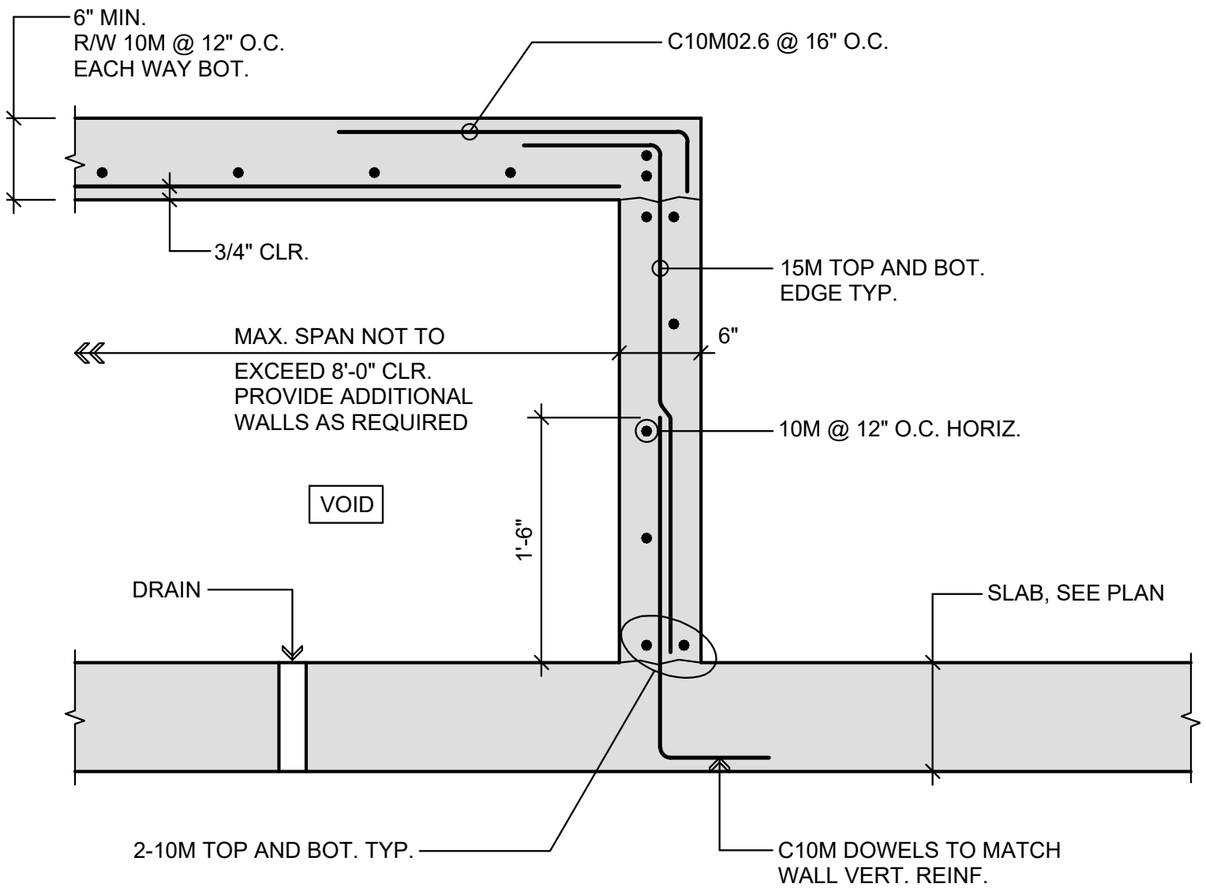

Revit template

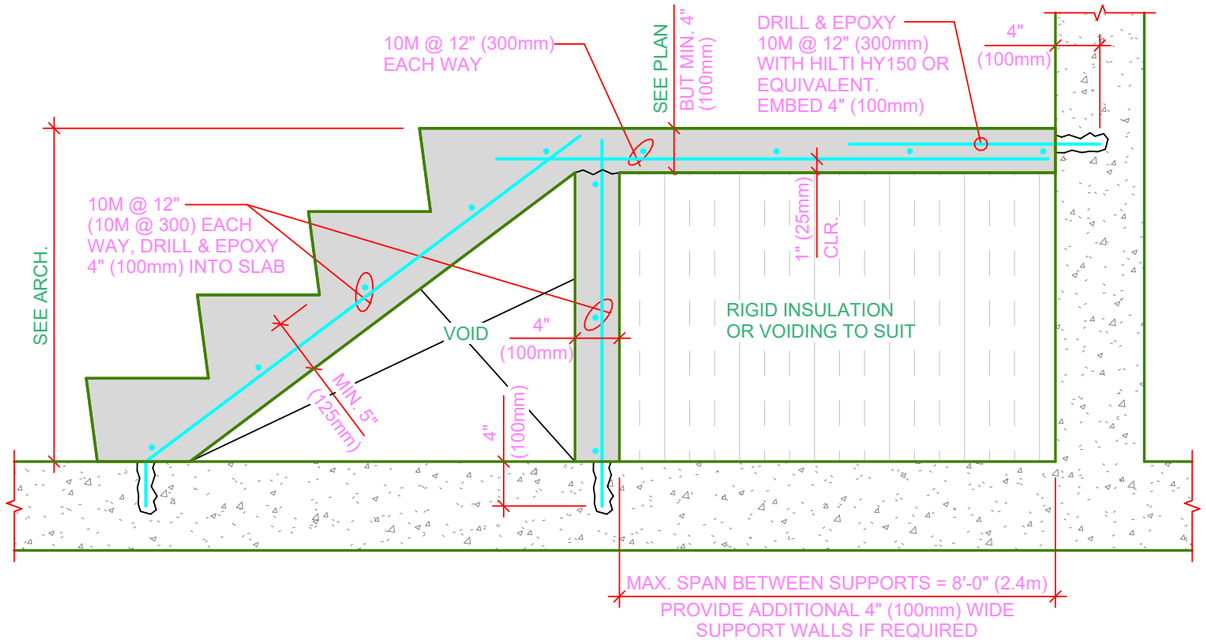


What differs: Both built-up slabs with void and max 8ft span support walls, but CAD is slab on walls with drain, Revit is stepped fill with insulation.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D502-DET 18 - POST-CAST CONCRETE BRICK LEDGER

Revit: D5.02_3_BRICK LEDGER DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)

CAD (master)

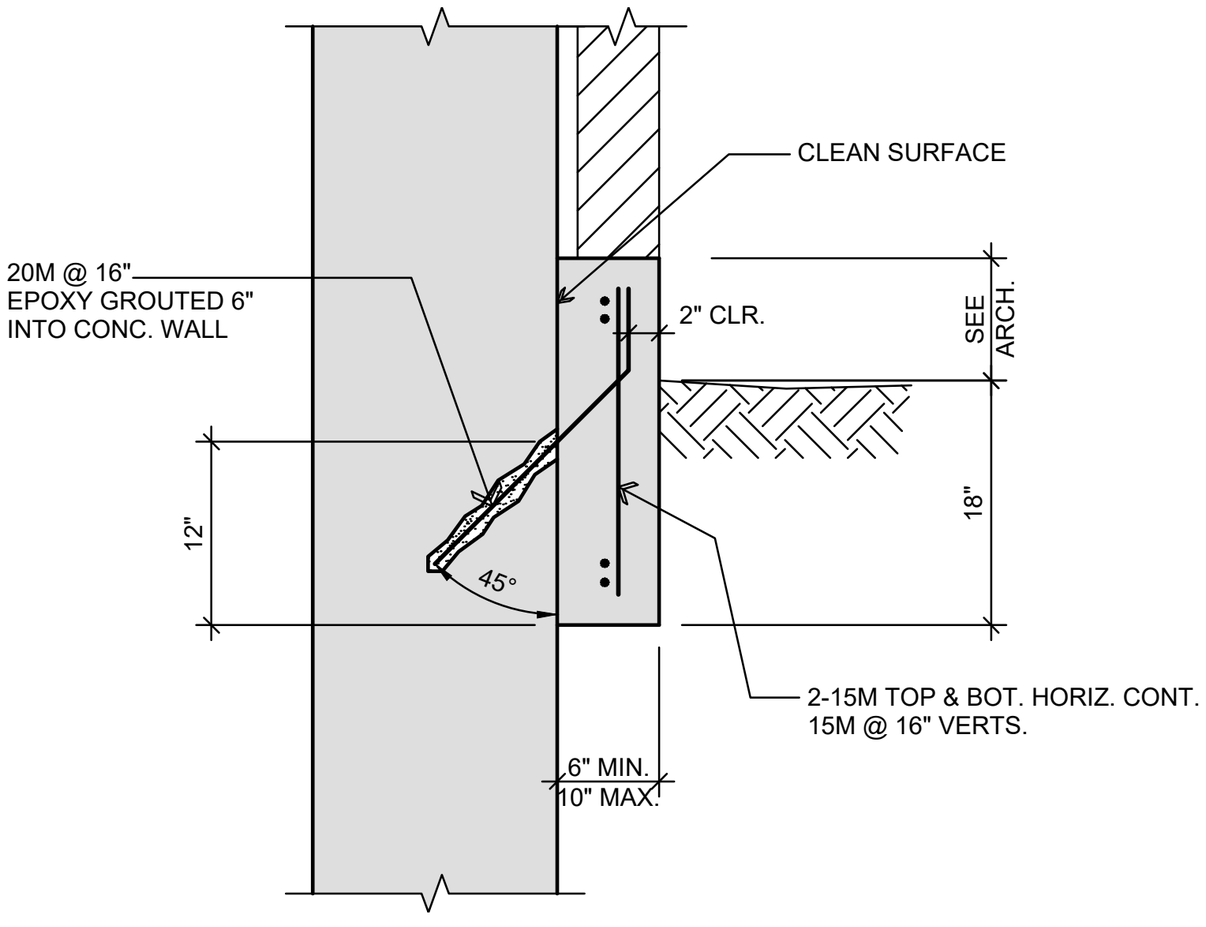

Revit template

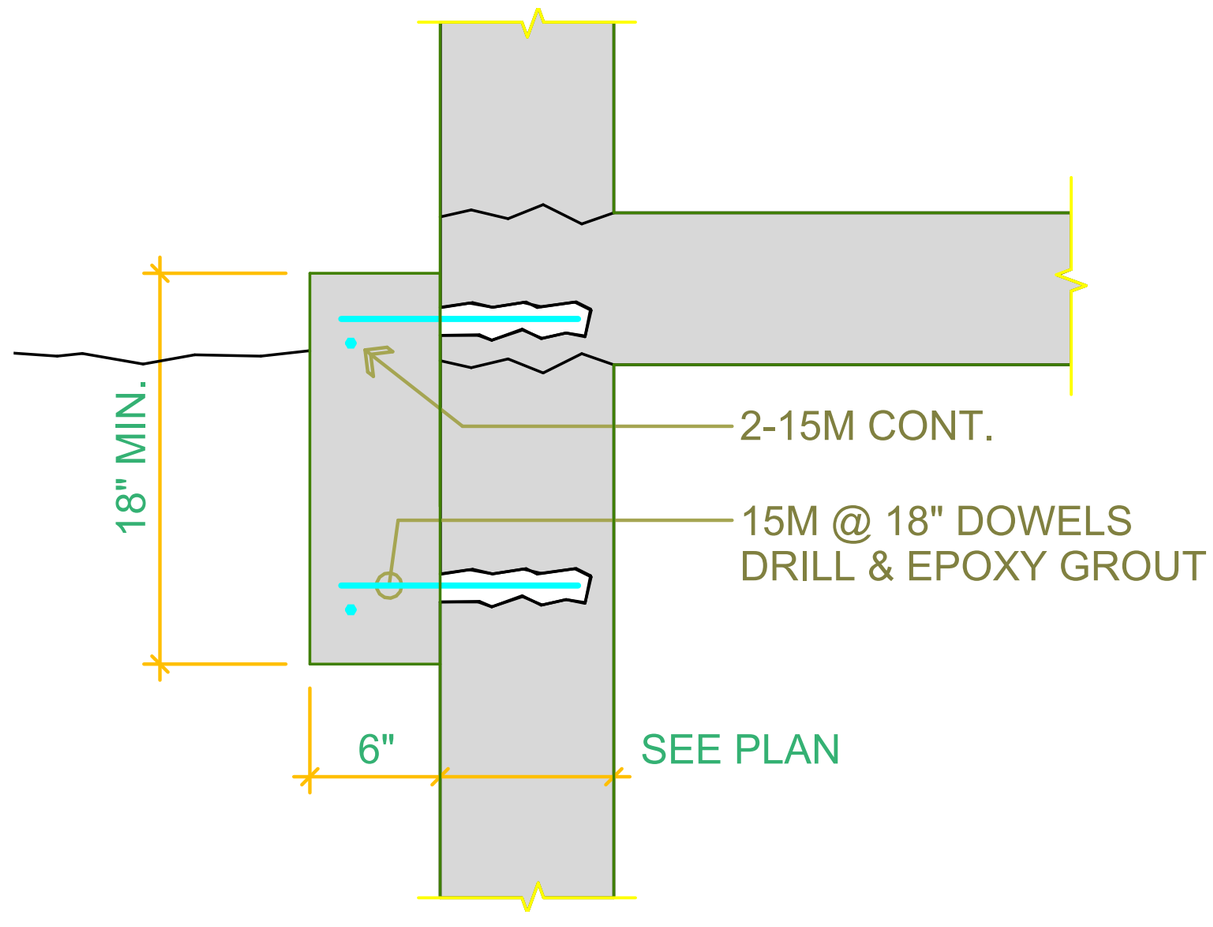


What differs: Both brick ledgers, but CAD is a post-cast ledger with 45 deg epoxied bars, Revit a cast ledger with horizontal dowels.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D502-DET 28 - TYPICAL COLUMN CAPITAL

Revit: S1.05_7_TYPICAL COLUMN CAPITAL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S1.05 TYPICAL DETAILS)

CAD (master)

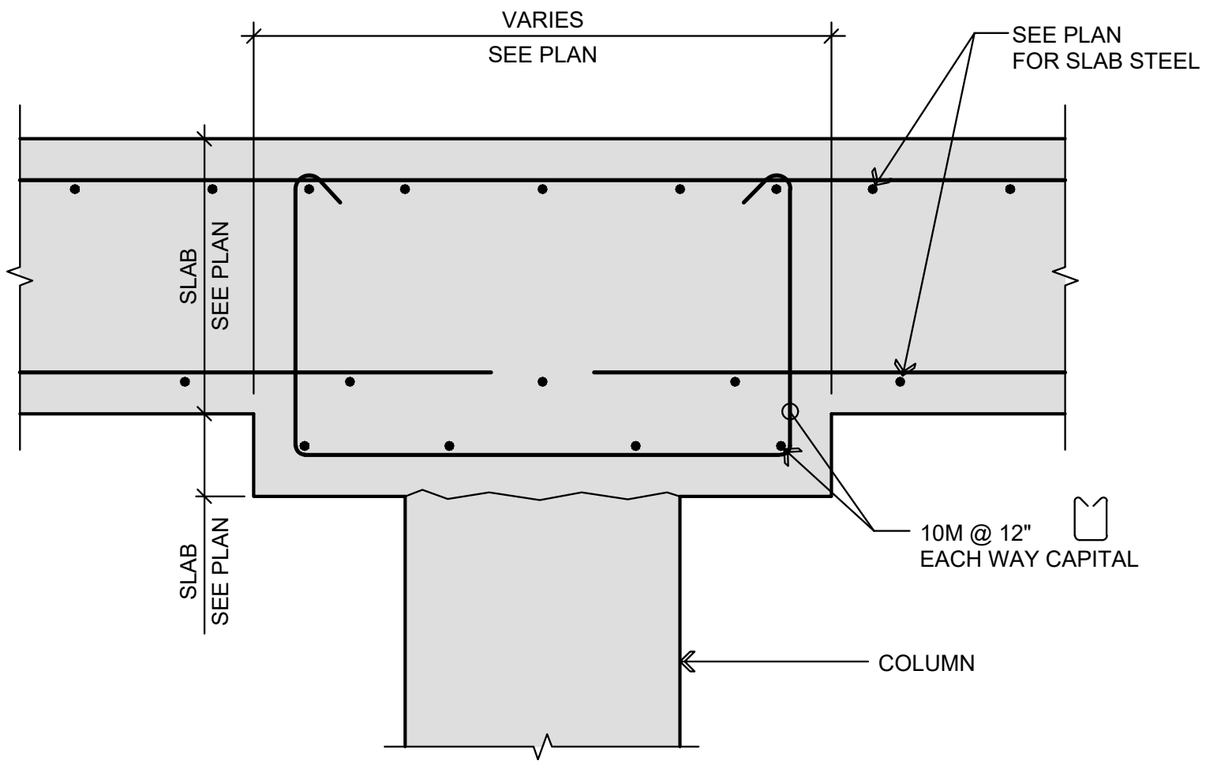

Revit template

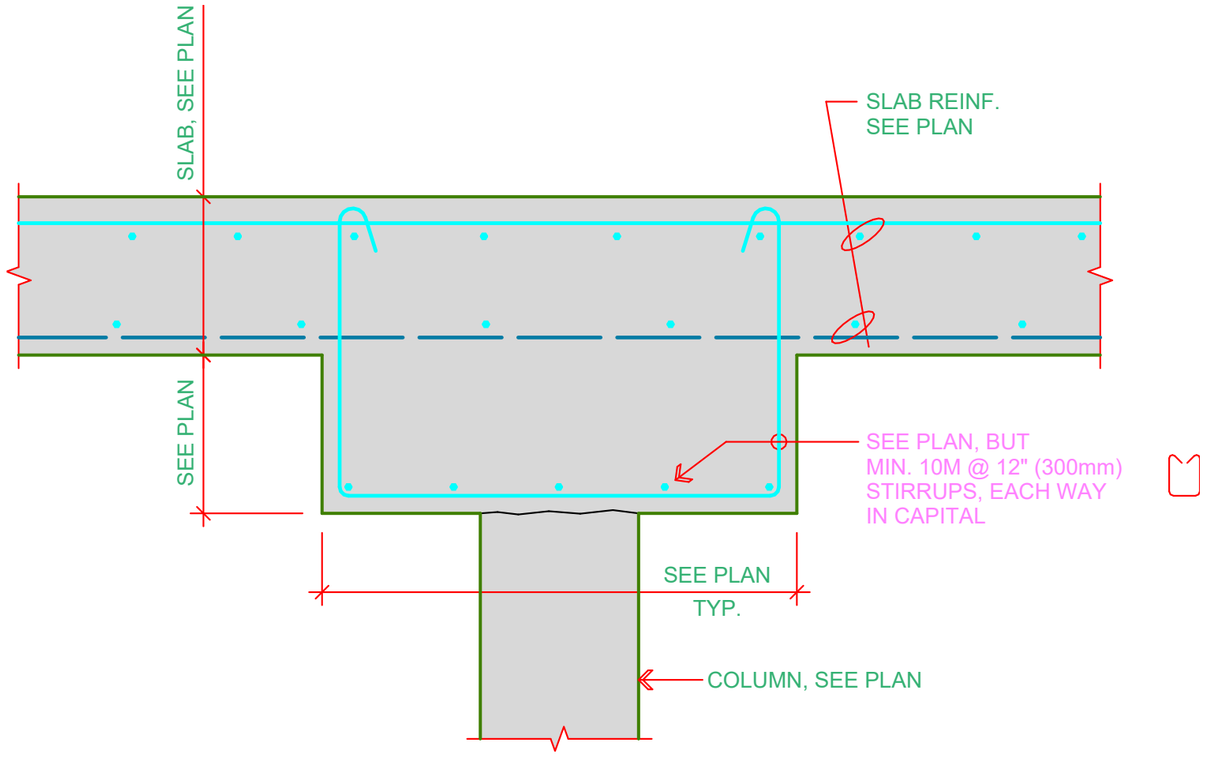


What differs: Column capital but CAD capital is wider with a different bar arrangement and no hooked top bars.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: 1E1.05_14_TYPICAL ARCHITECTURAL SITE WALL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

CAD (master)

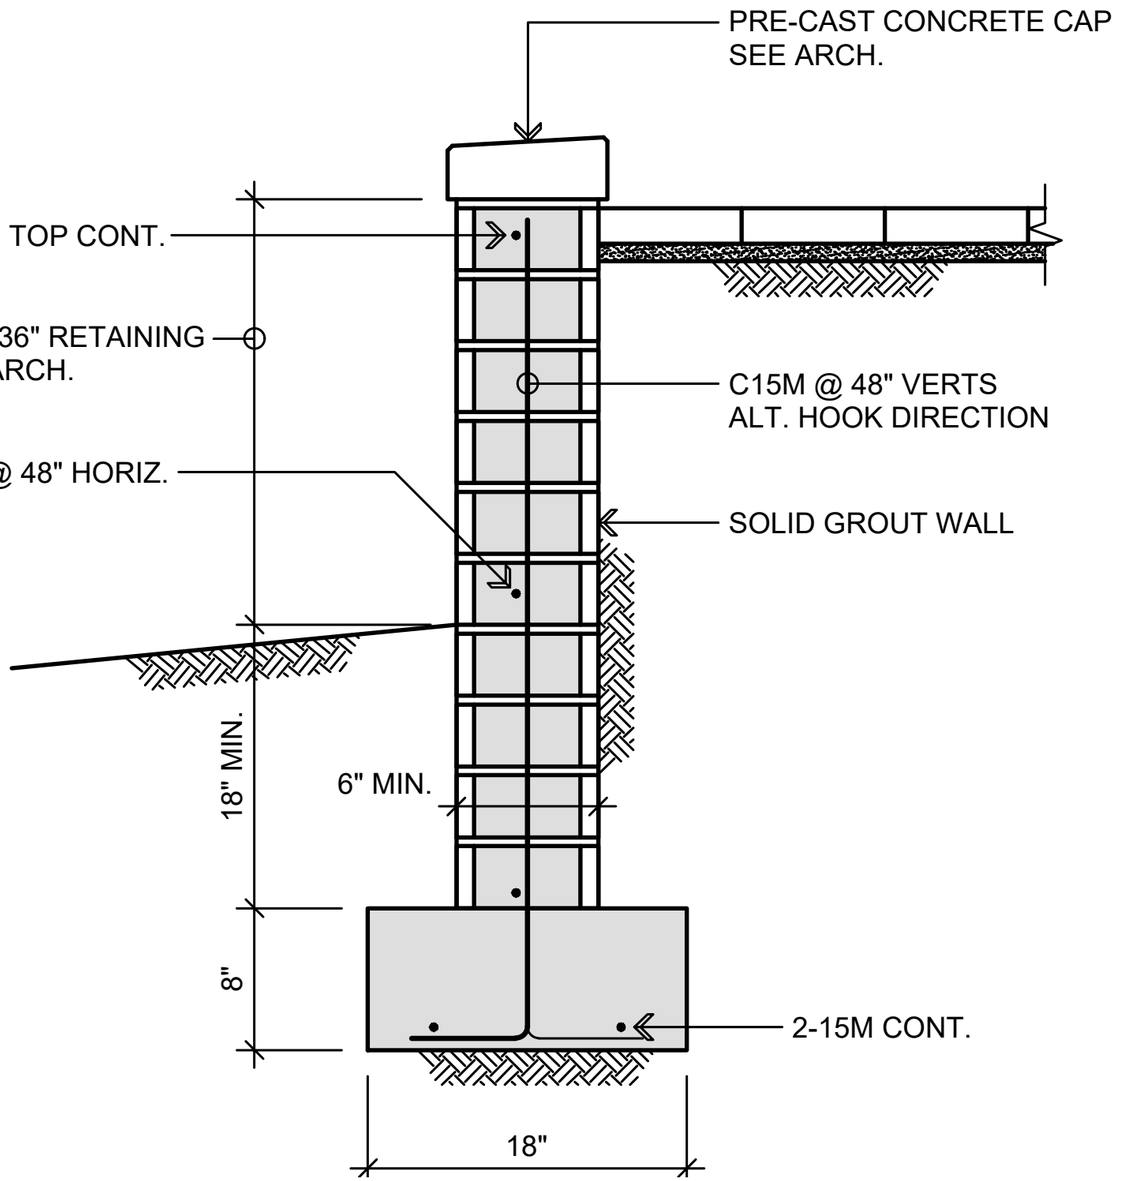

Revit template

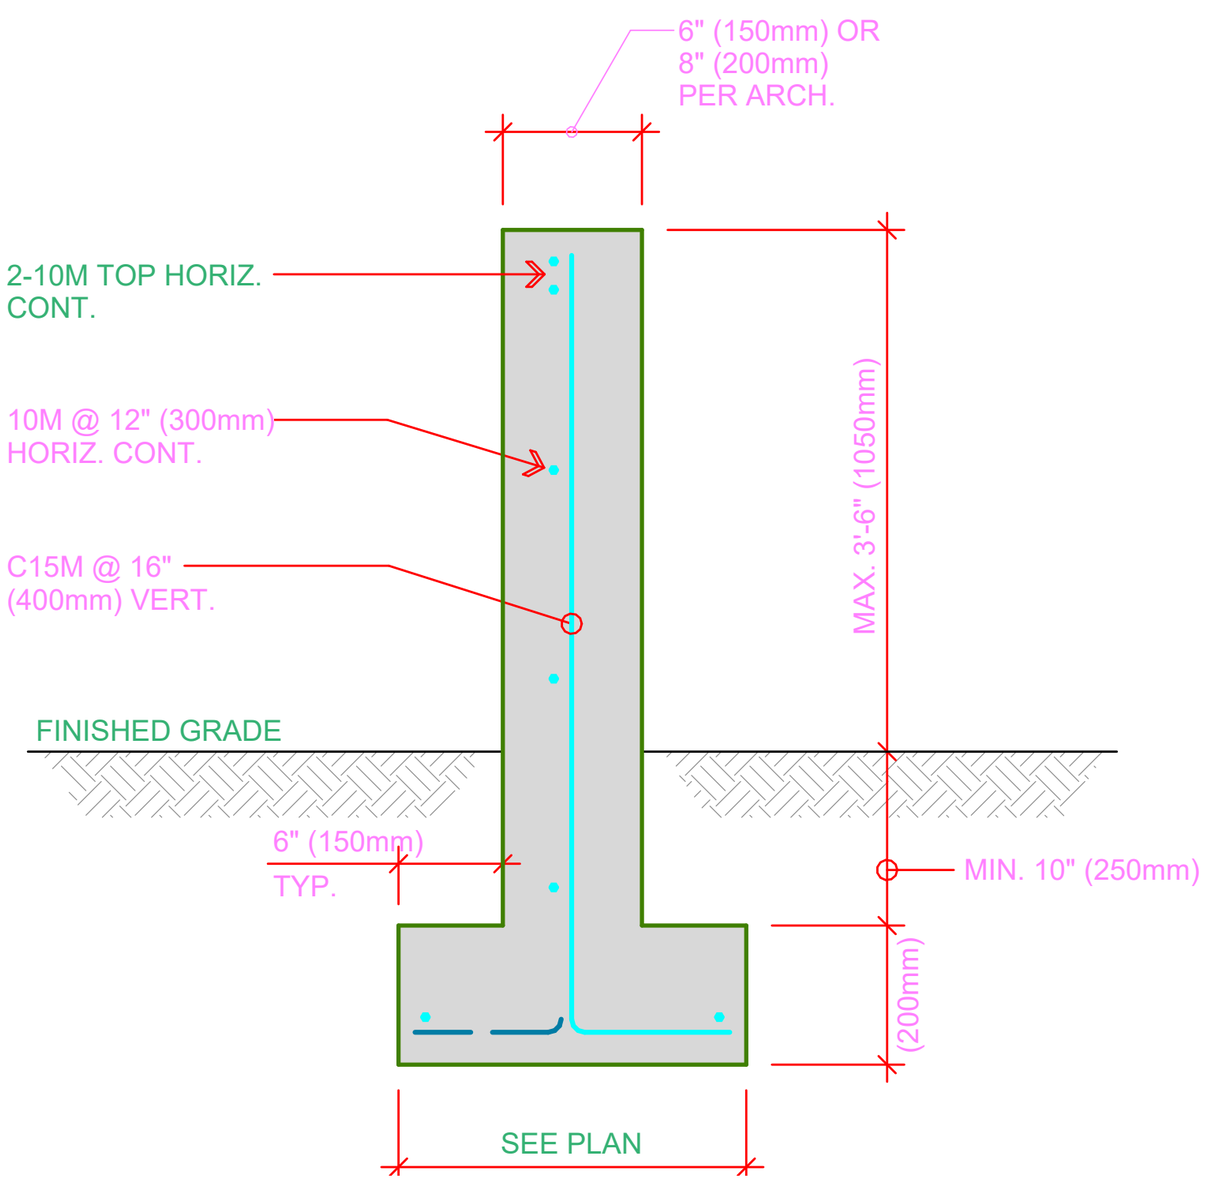


What differs: Both low site walls on footings, but CAD is a grouted masonry retaining wall with precast cap, Revit a concrete wall.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D502-DET 34 - BUILT-UP SLAB DETAIL

Revit: 1E1.05_1_TYPICAL BUILT-UP SLAB (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

CAD (master)

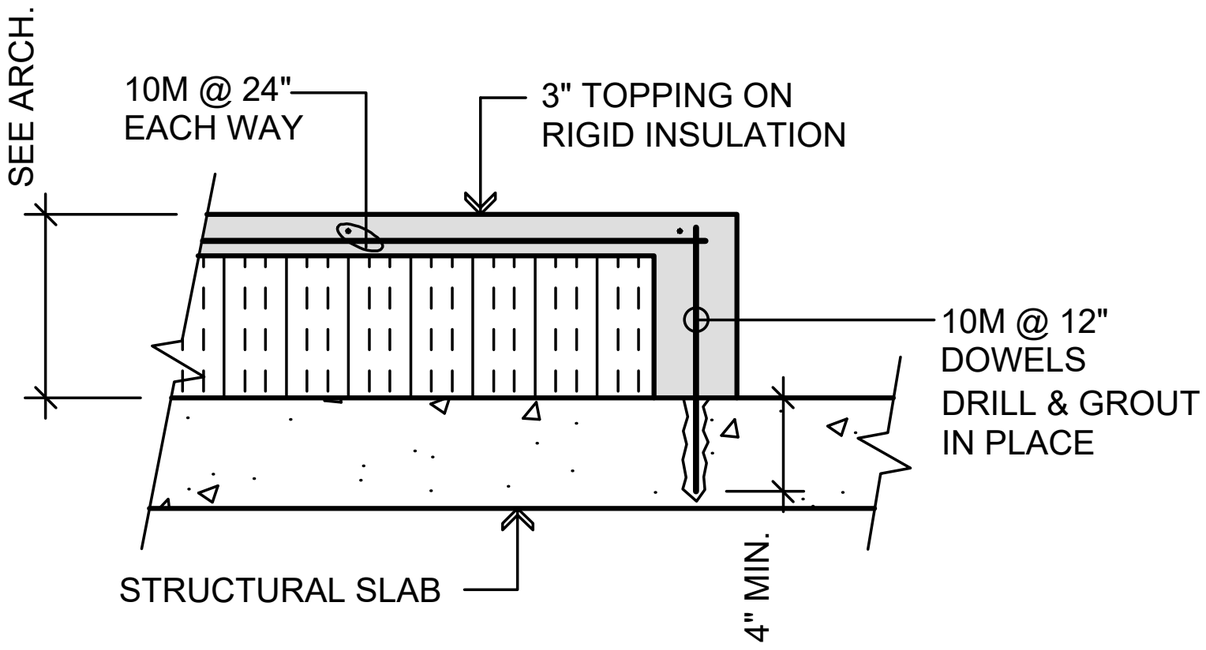

Revit template

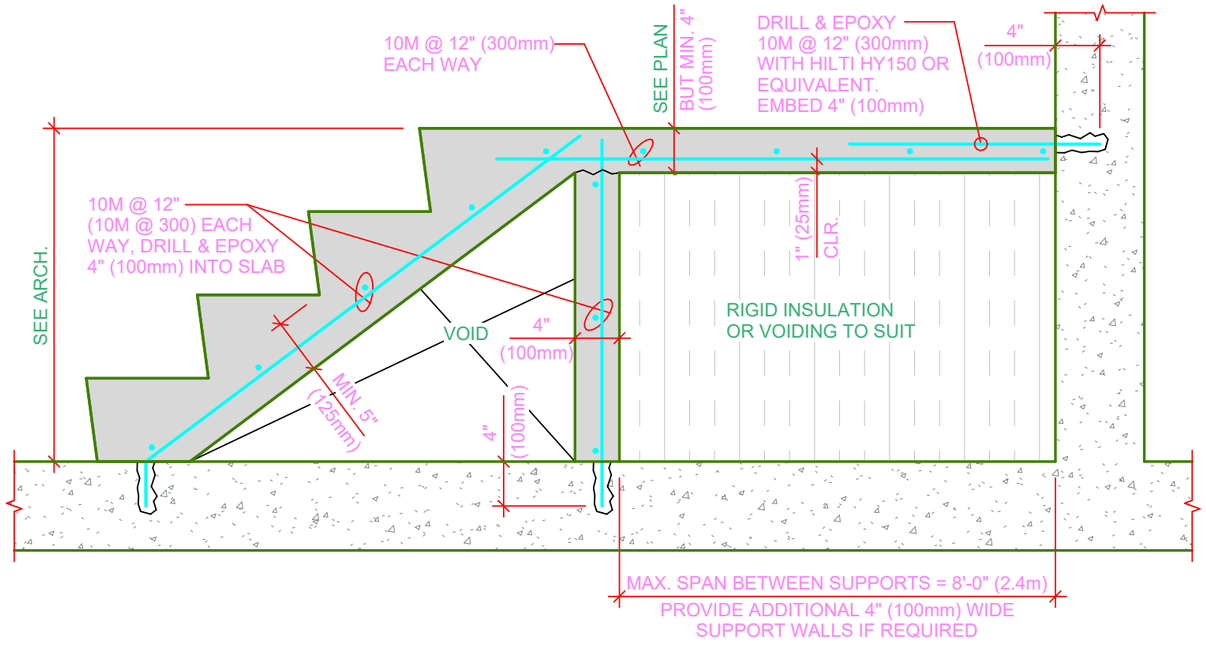


What differs: Both built-up slabs with rigid insulation, but CAD is topping on insulation with dowels, Revit a stepped fill with support walls.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D5.02_7_SANDWICH SLAB DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)

CAD (master)

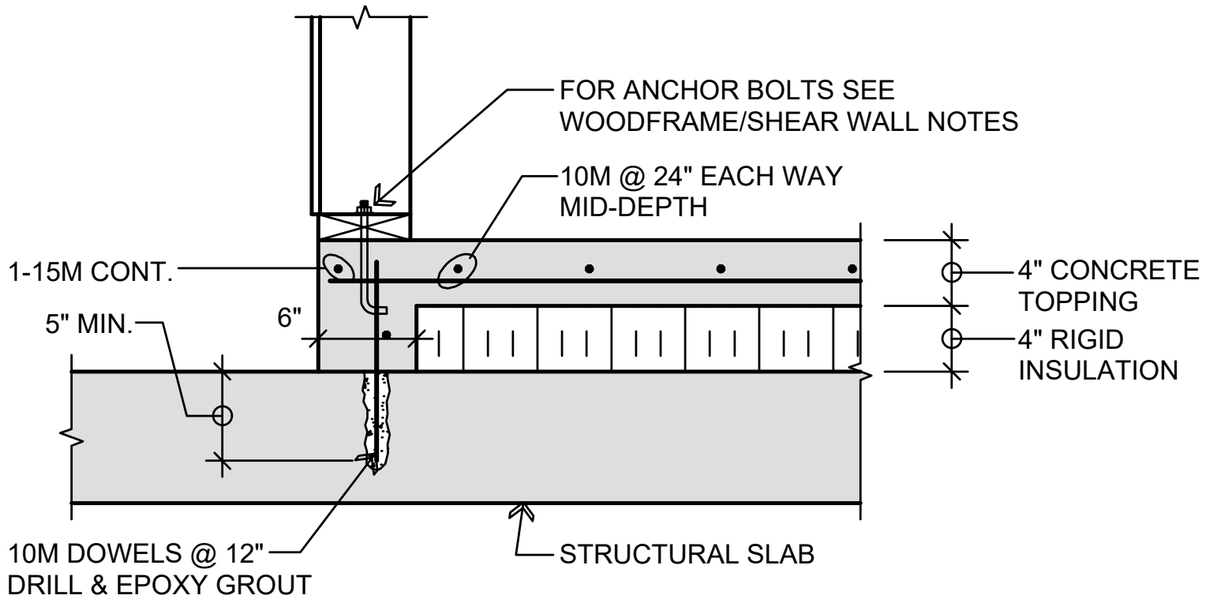

DOWELS REQUIRED AT PERIMETER
WALLS AND ALL INTERIOR
SHEAR WALL LOCATIONS

Revit template

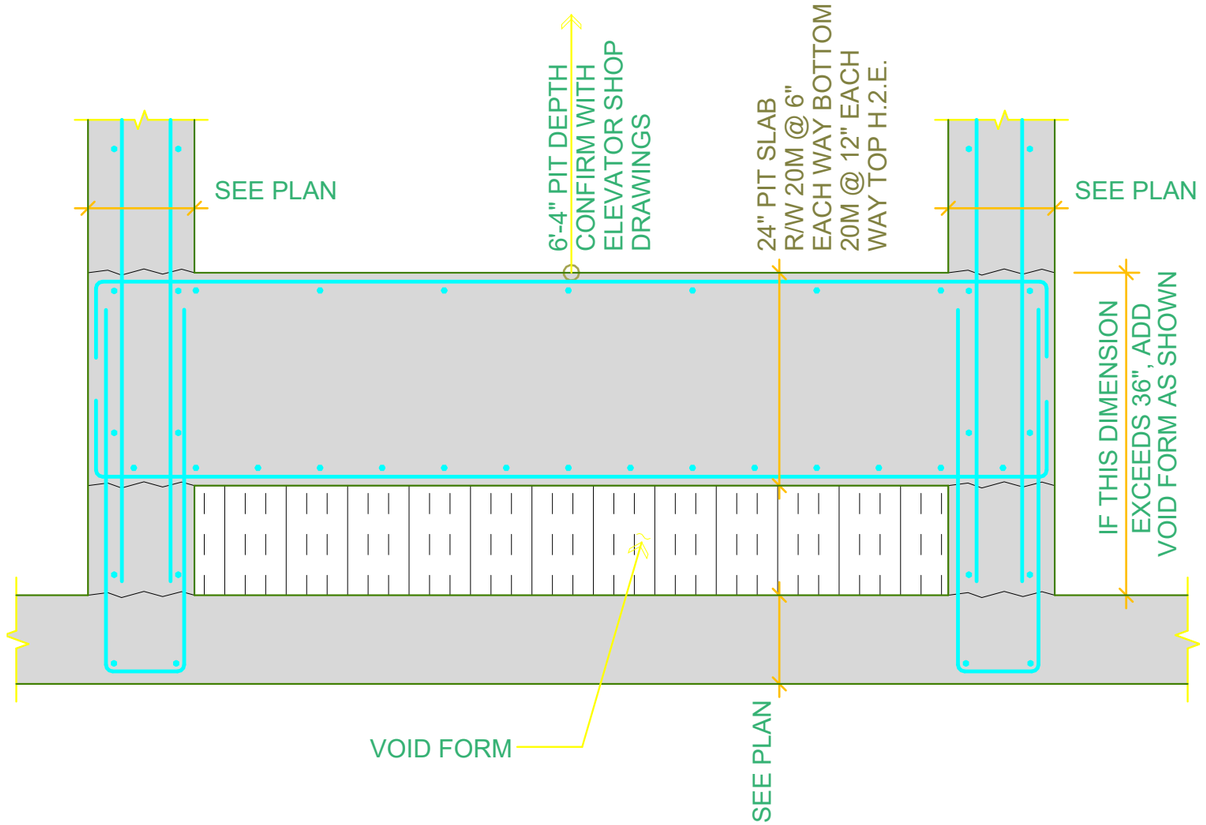


What differs: Same title, but CAD is topping on rigid insulation over structural slab, Revit a slab over void form at a pit.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D504-DET 06 - DOWNTURN DETAIL

Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

CAD (master)

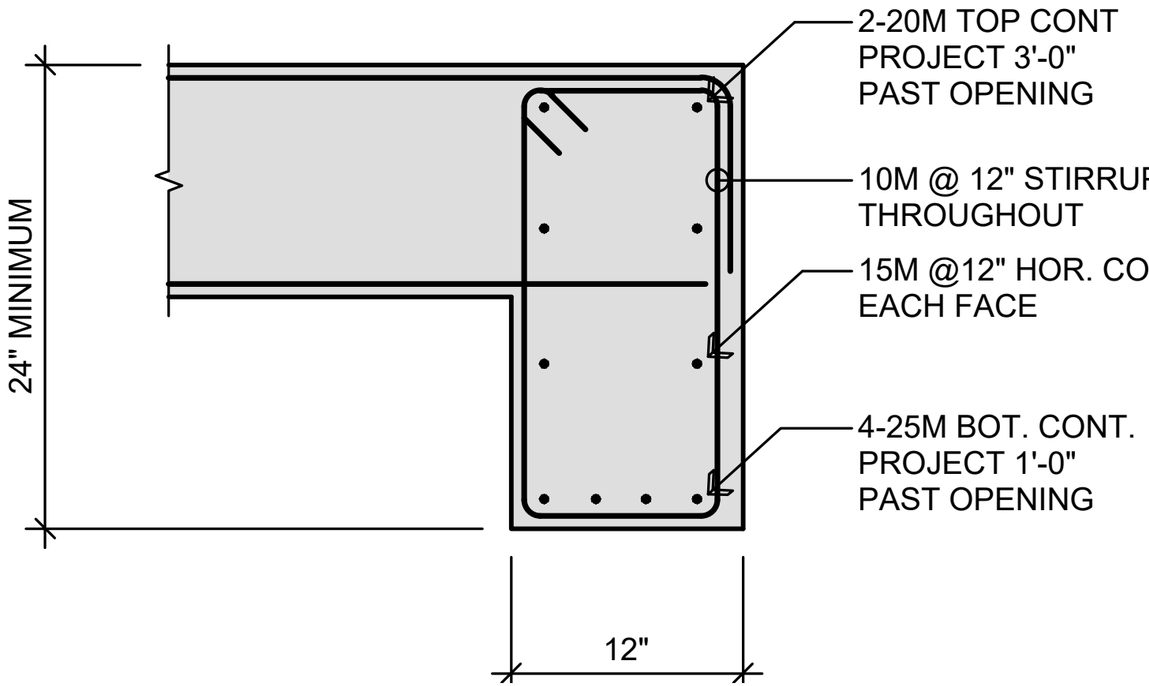

Revit template

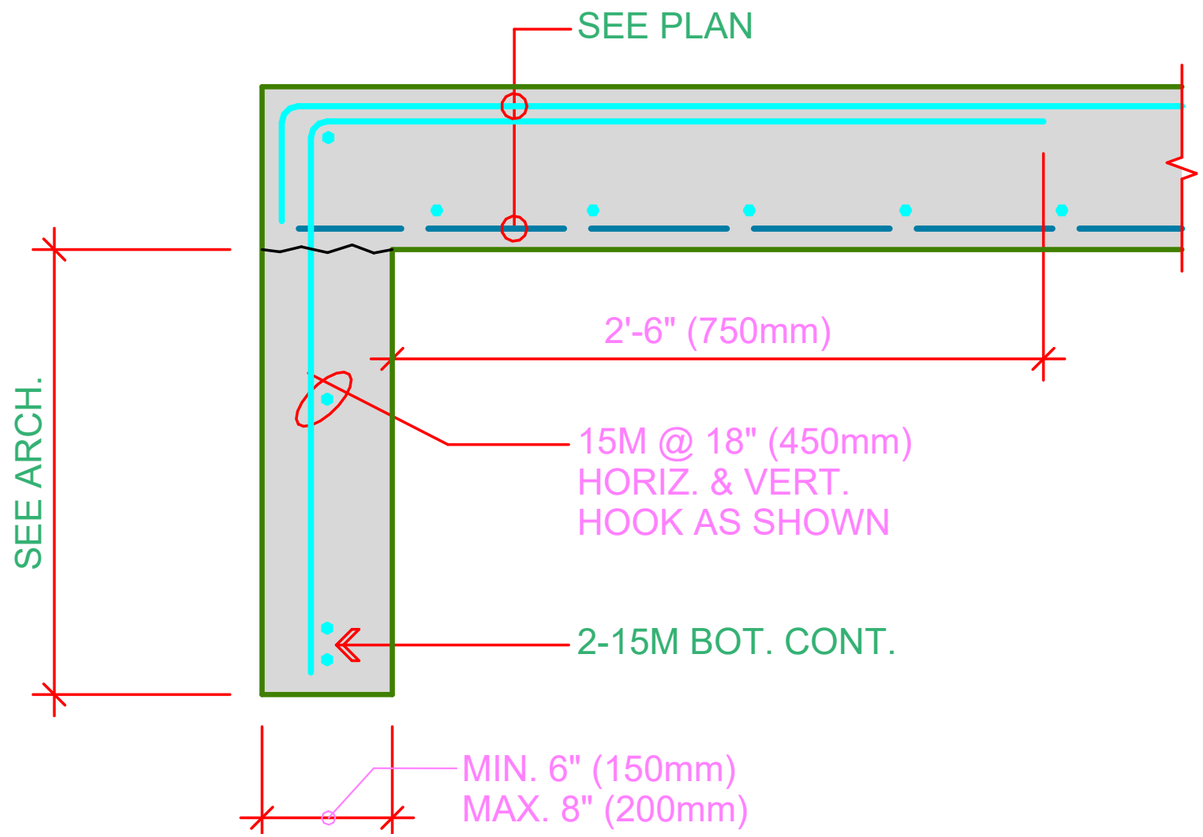


What differs: CAD is a 24in-min downturn beam with stirrups, 2-20M top and 4-25M bot projecting past an opening; '1E1.04_13_TYPICAL DOWNTURN' is a thin 6-8in downturn wall with 15M @ 18in.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-D504-DET 07 - DOWNTURN DETAIL

Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

CAD (master)

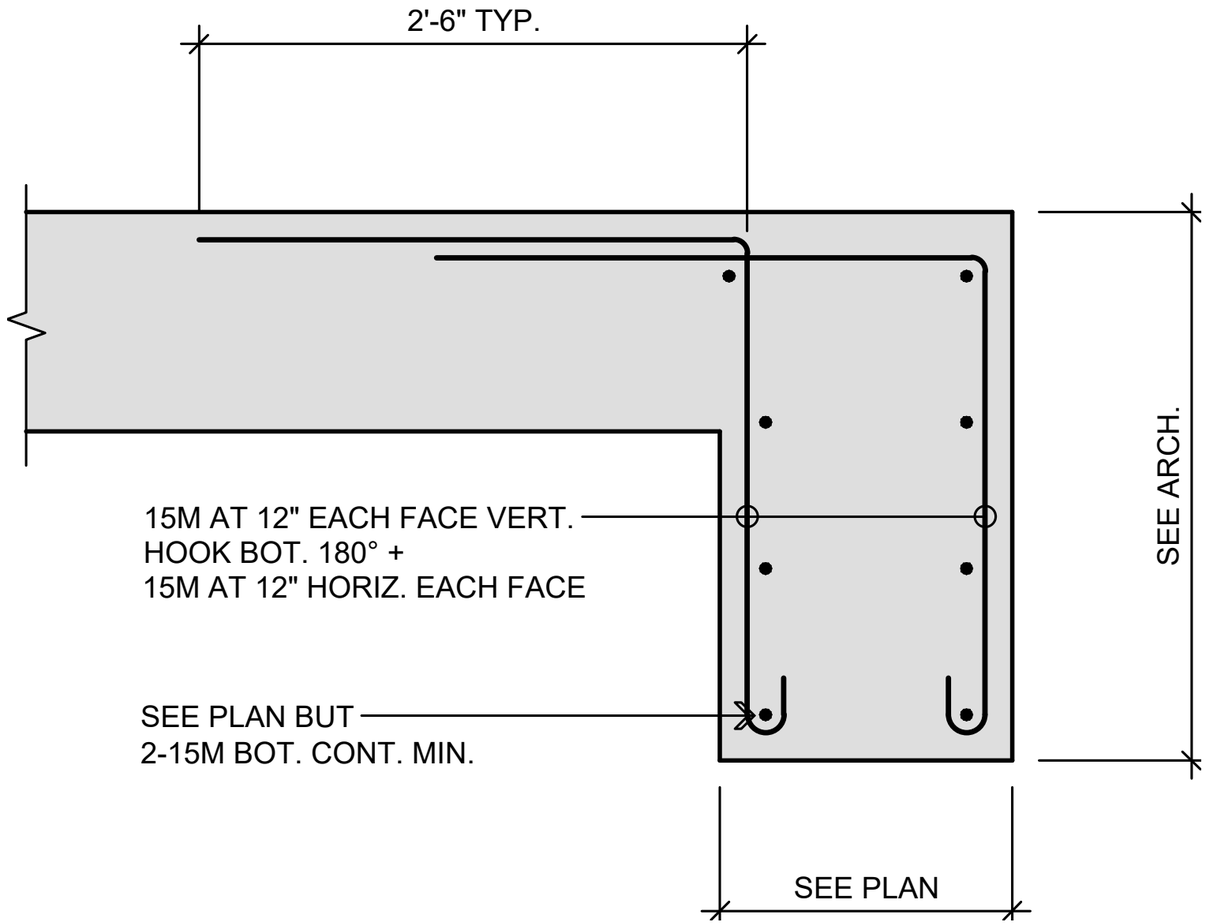

Revit template

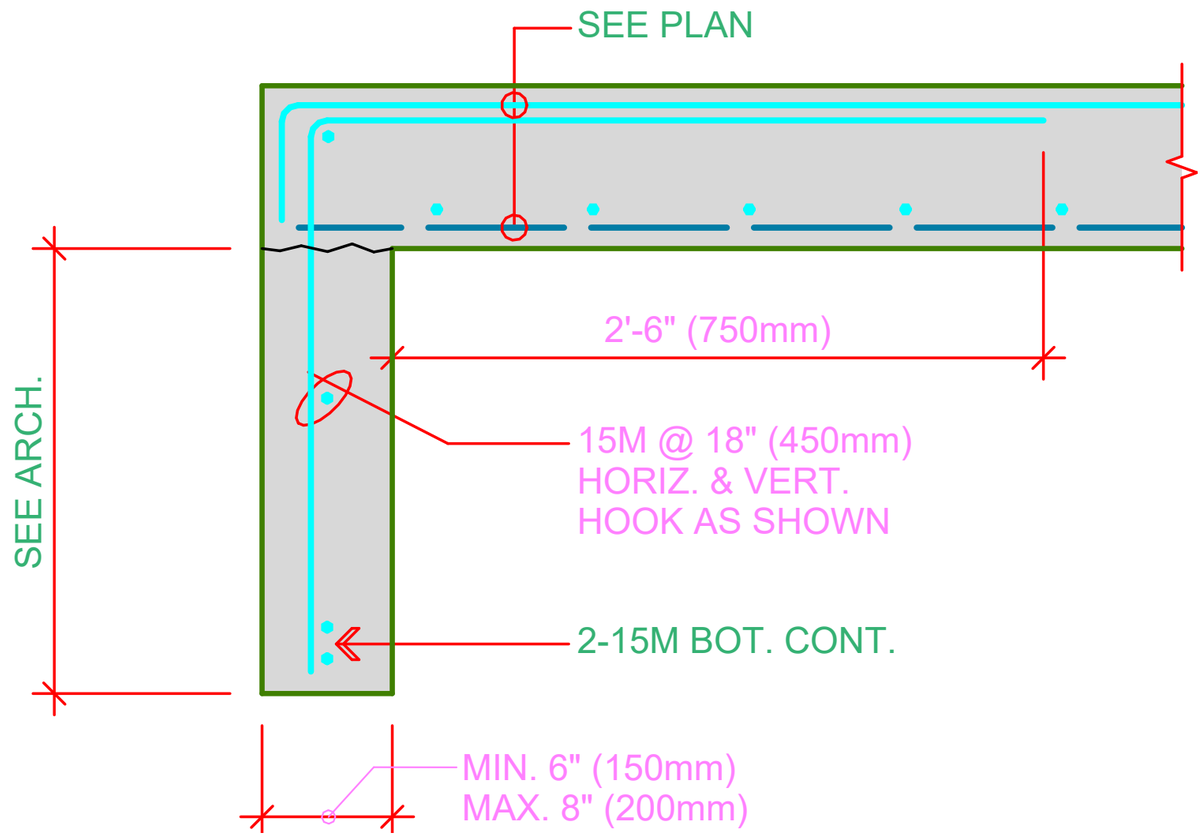


What differs: Same 2'-6in slab-edge downturn idea, but the CAD uses 15M @ 12in each face and a wider section; '1E1.04_13_TYPICAL DOWNTURN' uses 15M @ 18in.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

CAD (master)

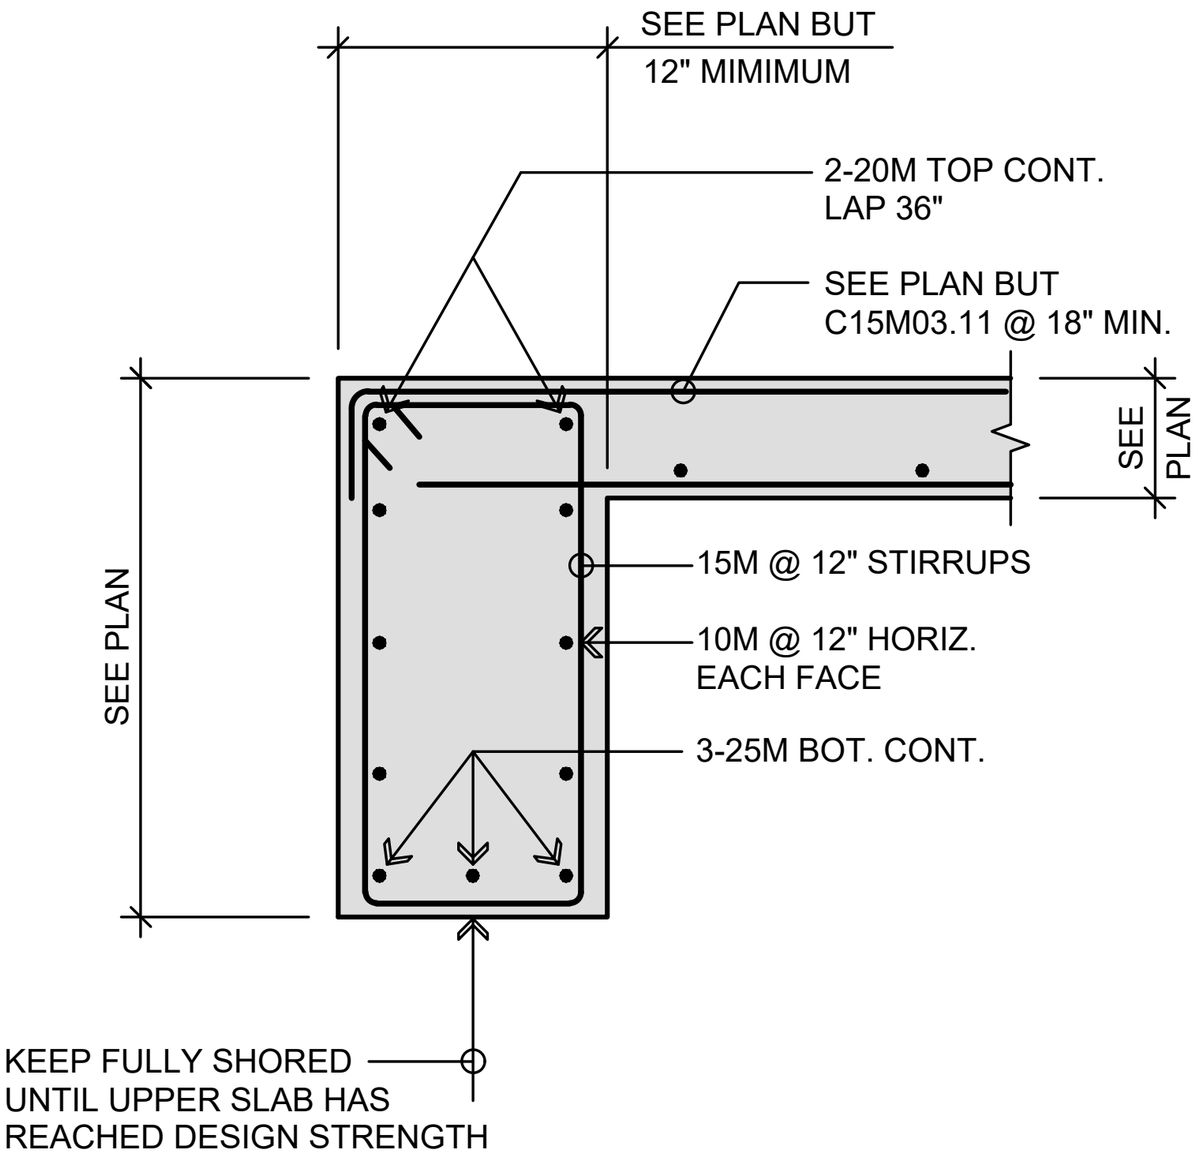

Revit template

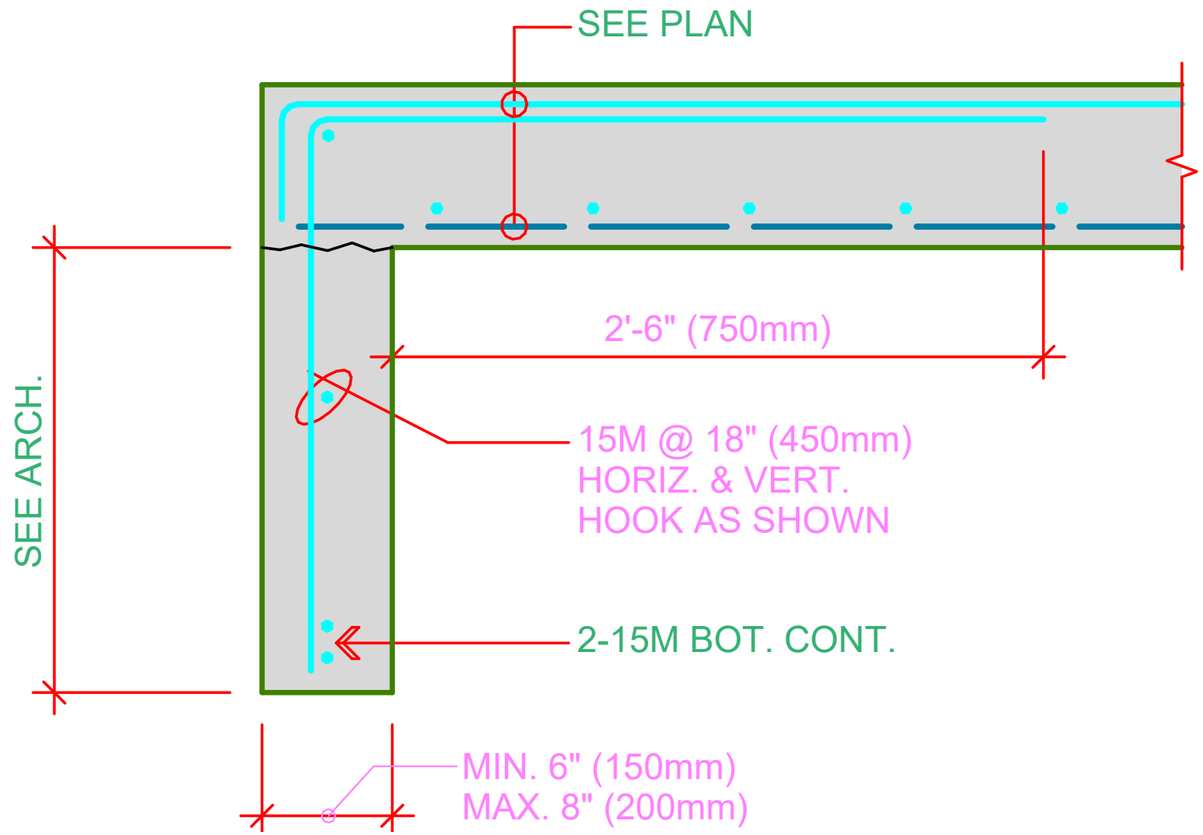


What differs: CAD is a stirruped downturn beam (3-25M bot, keep shored); '1E1.04_13_TYPICAL DOWNTURN' is a plain thin downturn wall.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

CAD (master)

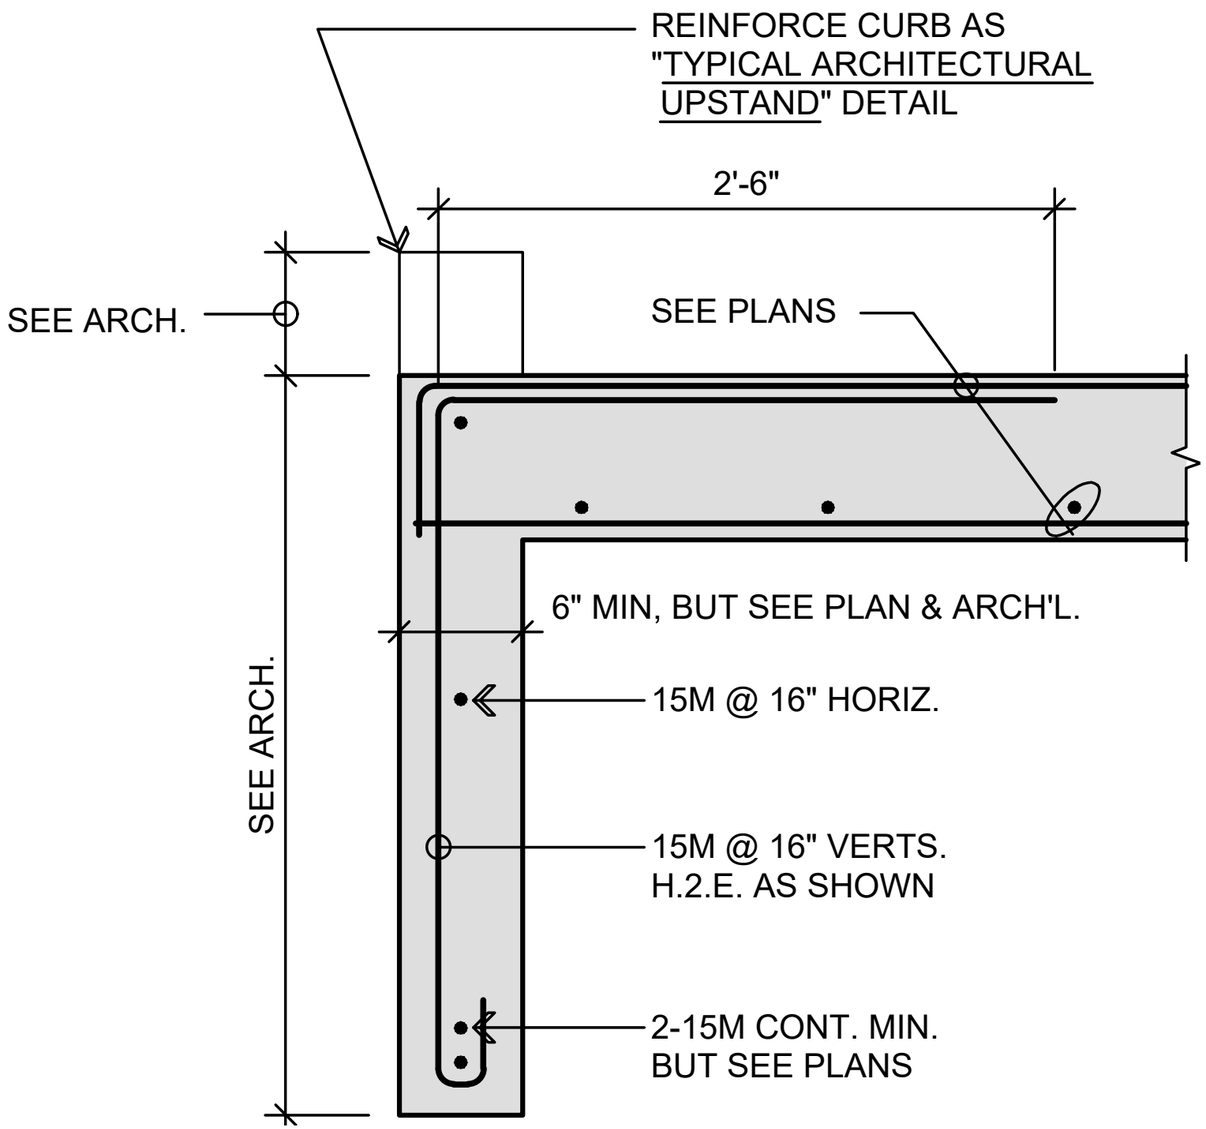

Revit template

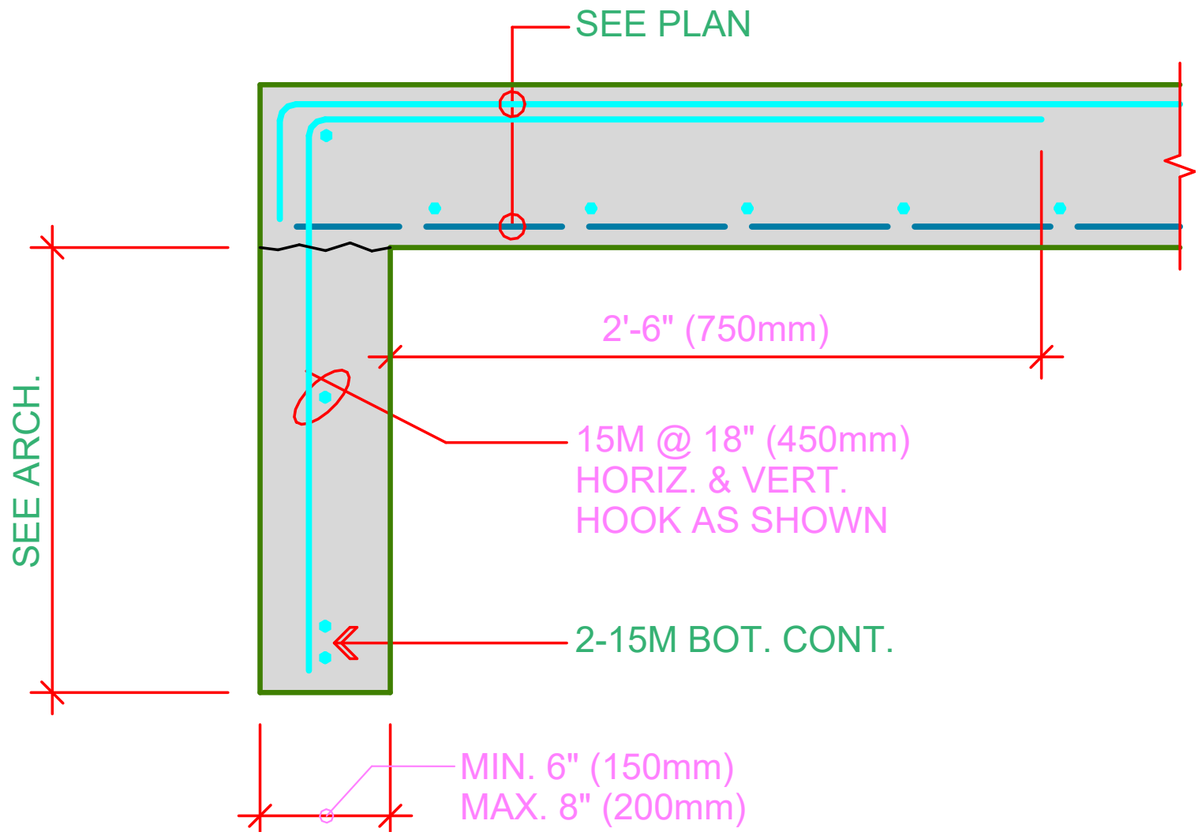


What differs: Closest match: same 2'-6in downturn with 2-15M bot cont, but the CAD has 15M @ 16in horiz/vert where '1E1.04_13_TYPICAL DOWNTURN' has 15M @ 18in, plus a curb/upstand callout.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


CAD: KOR-D504-DET 10 - BALCONY DETAIL

Revit: 1E1.04_7_TYPICAL BALCONY DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

CAD (master)

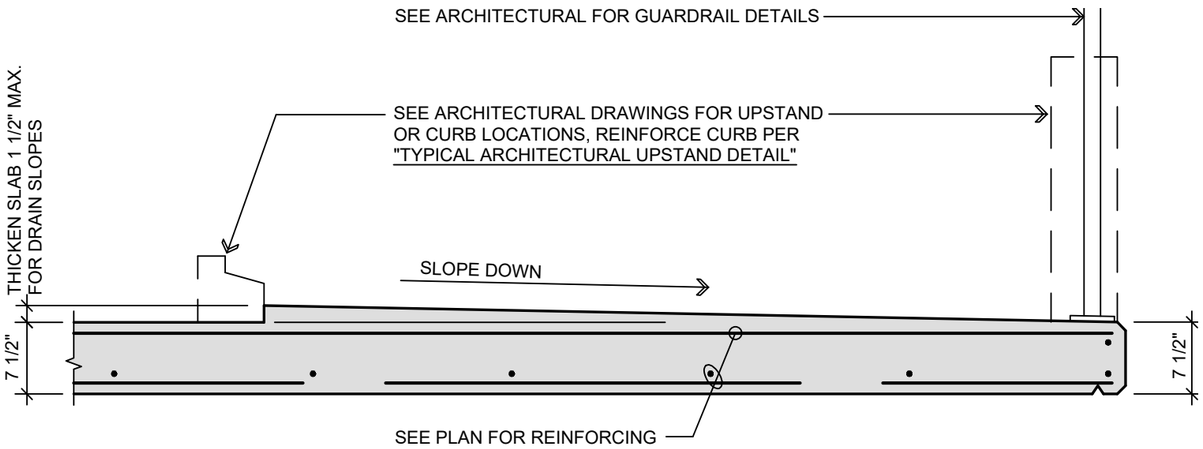

Revit template

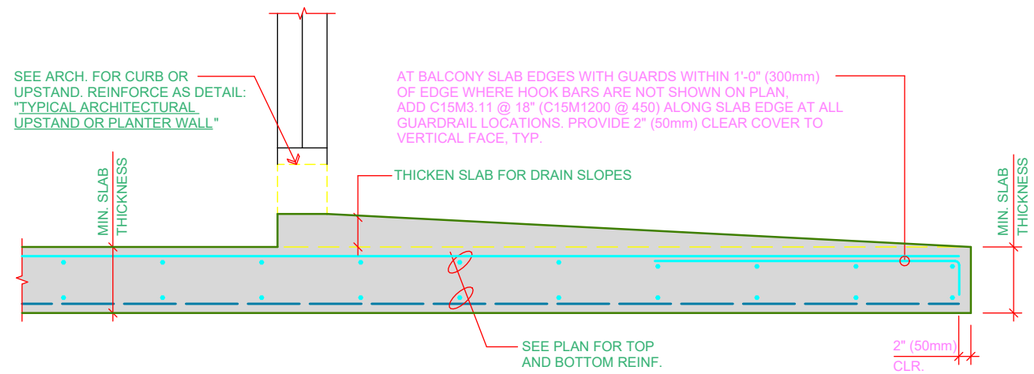


What differs: Both are balcony slabs thickened for drain slopes; the CAD has a 7 1/2in slab and 1 1/2in max thickening without the curb and guardrail hook-bar note '1E1.04_7_TYPICAL BALCONY DETAIL' shows.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D505-DET 03 - FOLDING PANEL HANGER DETAIL

Revit: D5.01_12_FOLDING PANEL HANGER DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)


CAD (master)

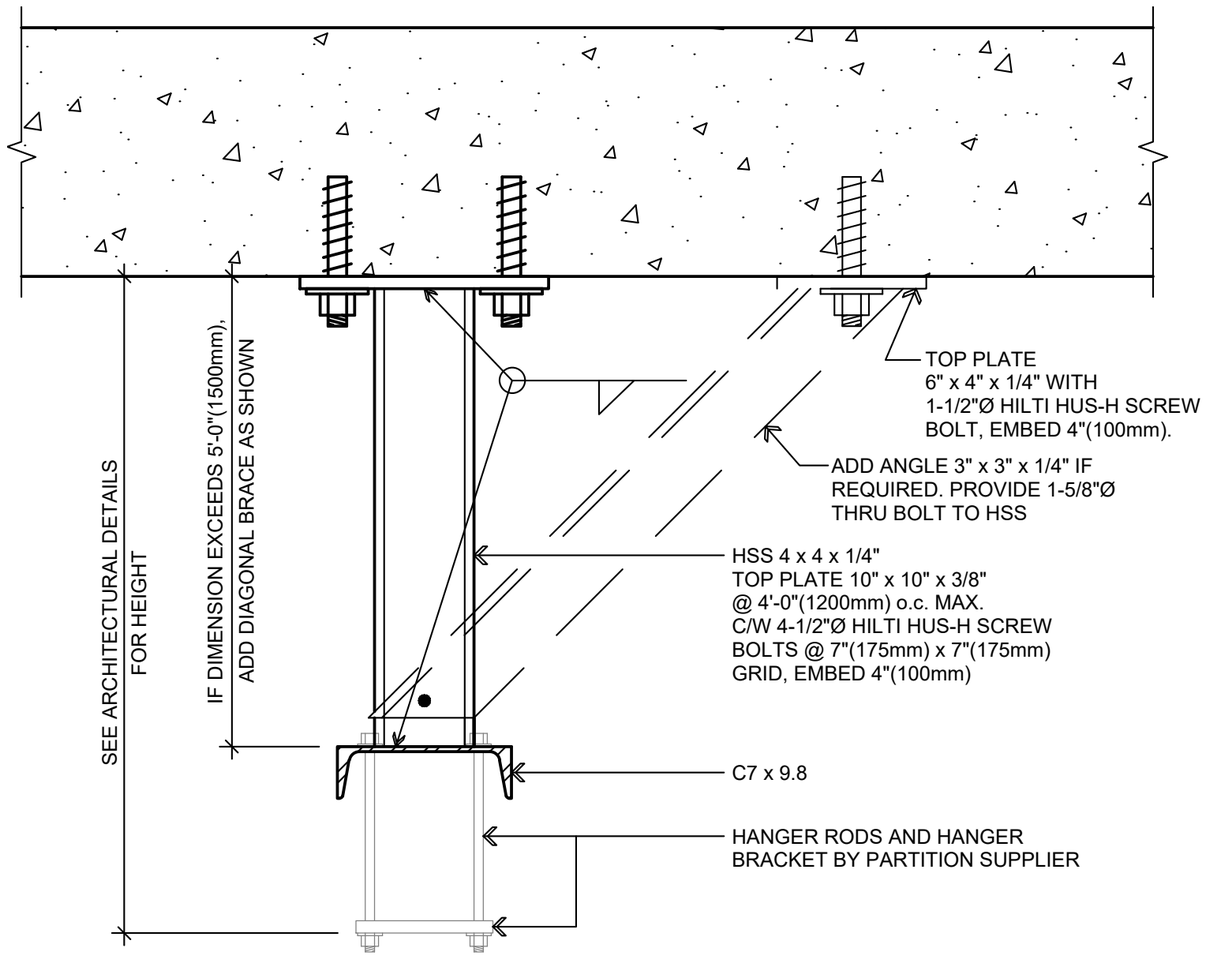

NOTE: MAXIMUM FOLDING PANEL DOOR WEIGHT IS 15 PSF

SEE INTERIOR DESIGN DRAWINGS FOR LOCATIONS

Revit template

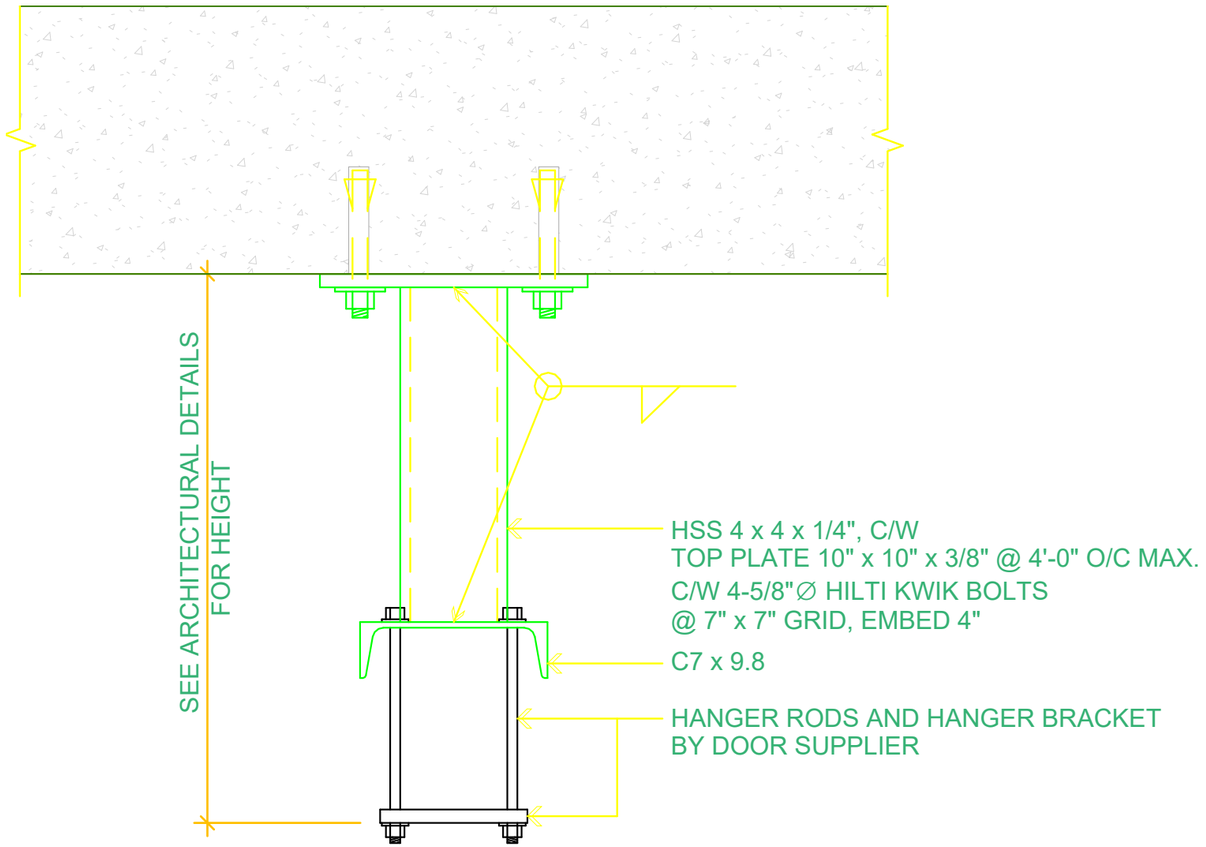

NOTE: MAXIMUM FOLDING PANEL WEIGHT IS 20 PSF


What differs: Same folding panel hanger, but the CAD adds a diagonal angle brace and uses Hilti HUS-H screws @ 6ft for a 15 psf door; 'D5.01_12_FOLDING PANEL HANGER DETAIL' has Kwik bolts @ 4ft for 20 psf and no brace.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


 CAD: KOR-S302-DET 07 - TYPICAL WALL AND ZONE VERT REINFORCING DETAIL THICKNESS CHANGES

Revit: 1E3.05_6_TYPICAL WALL AND ZONE VERT REINFORCING DETAIL WHERE WALL THICKNESS CHANGES (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E3.05 SHEAR WALL - TYPICAL DETAILS)

CAD (master)

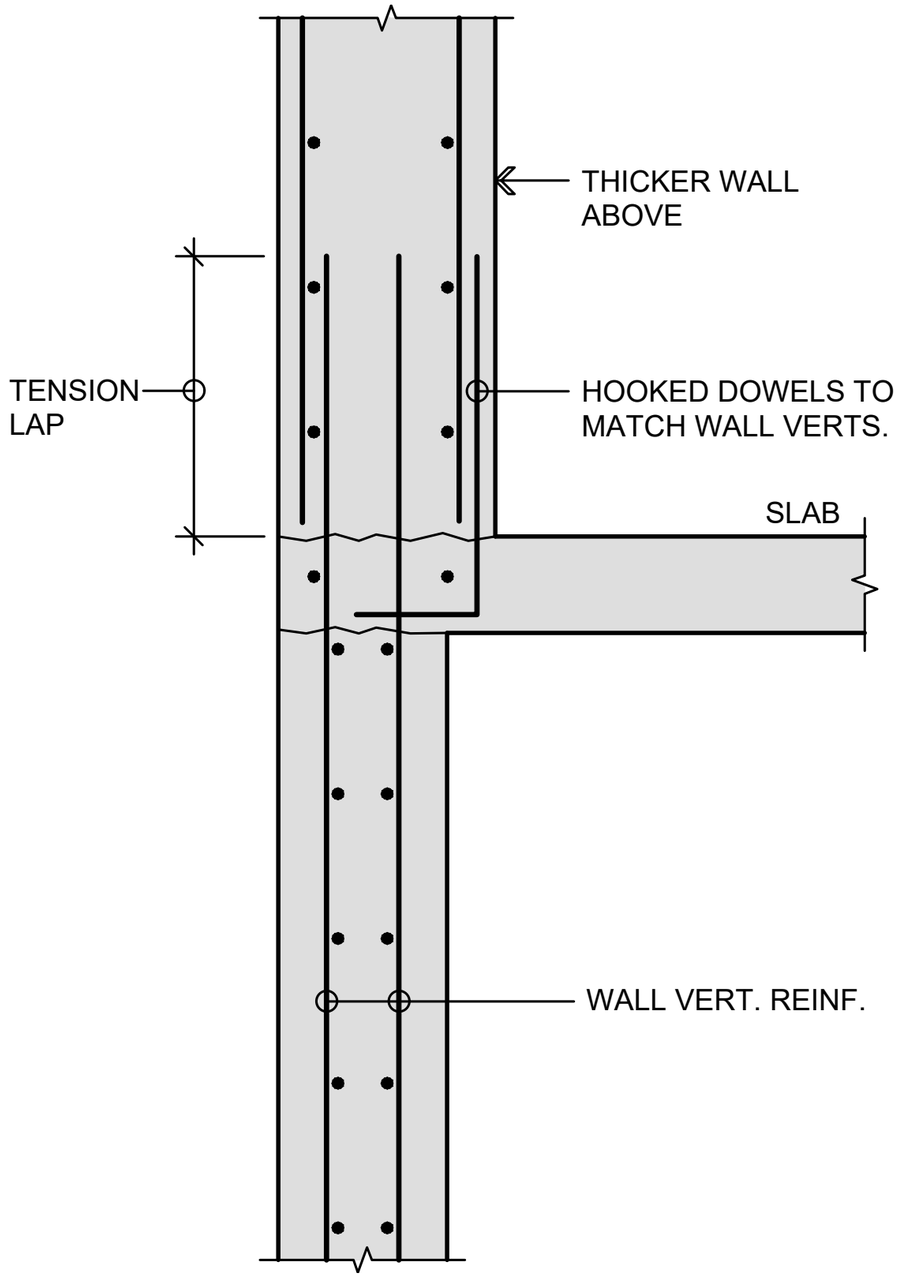

Revit template

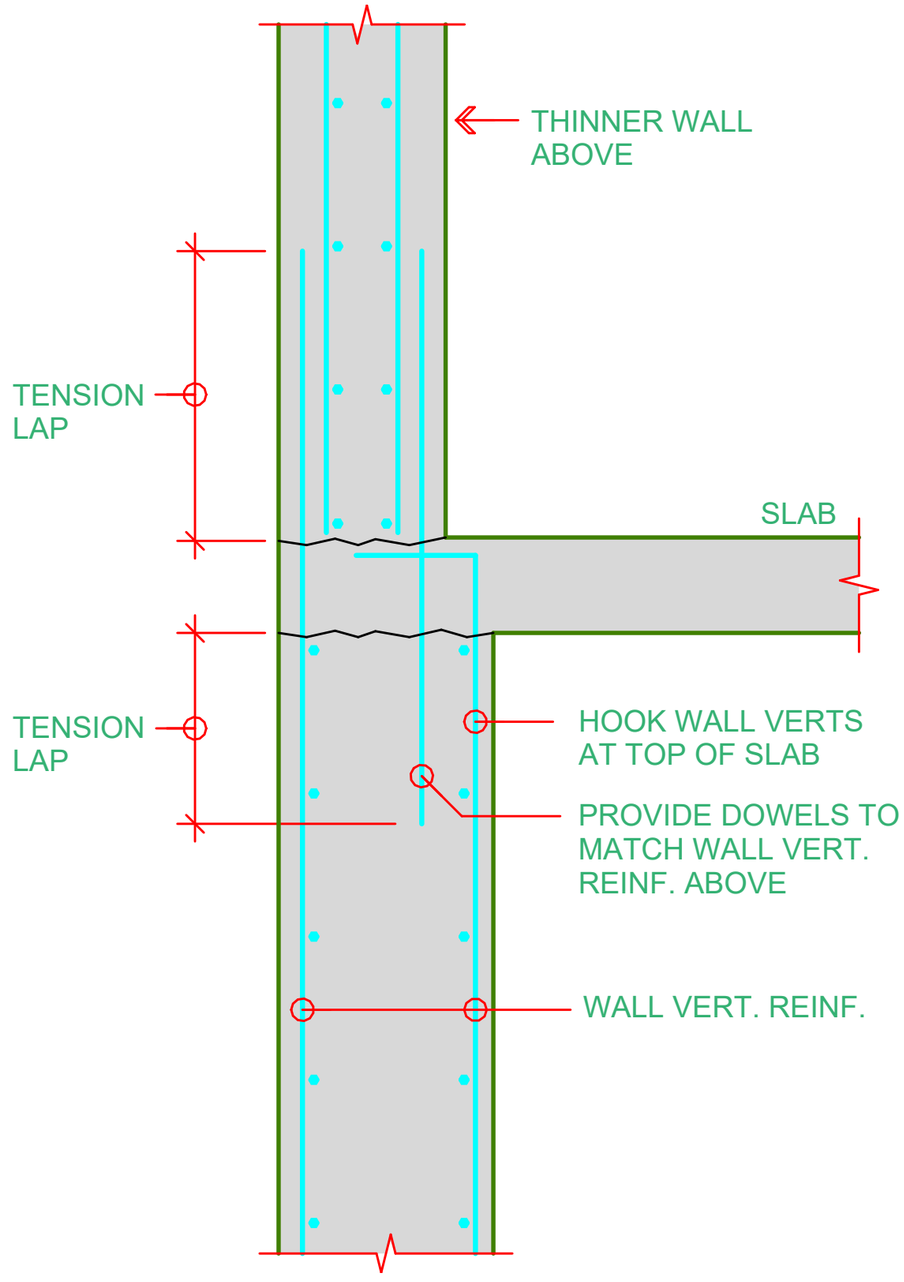


What differs: CAD is the THICKER-wall-above case with hooked dowels to match the wall verts and one tension lap; '1E3.05_6_TYPICAL WALL AND ZONE VERT REINFORCING DETAIL WHERE WALL THICKNESS CHANGES'/'D3.05_6_TYPICAL WALL AND ZONE VERT. REINFORCING DETAIL WHERE WALL THICKNESS CHANGES' are the thinner-wall-above case.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


53 of 55 CAD: KOR-S302-DET 12 - TYPICAL DIAGONALLY REINFORCED HEADER DETAIL

Revit: 1E3.05_1_TYPICAL DIAGONALLY REINFORCED HEADER DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E3.05 SHEAR WALL - TYPICAL DETAILS)

CAD (master)

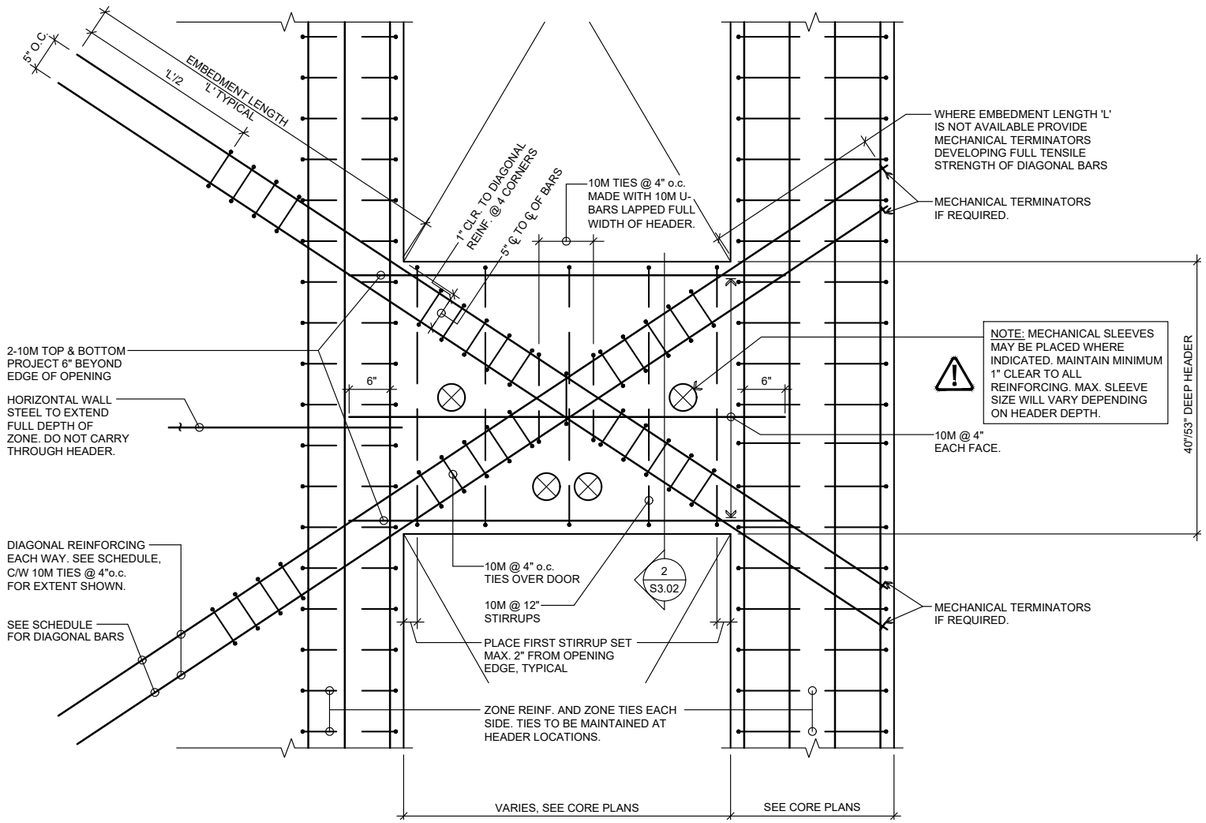

Revit template

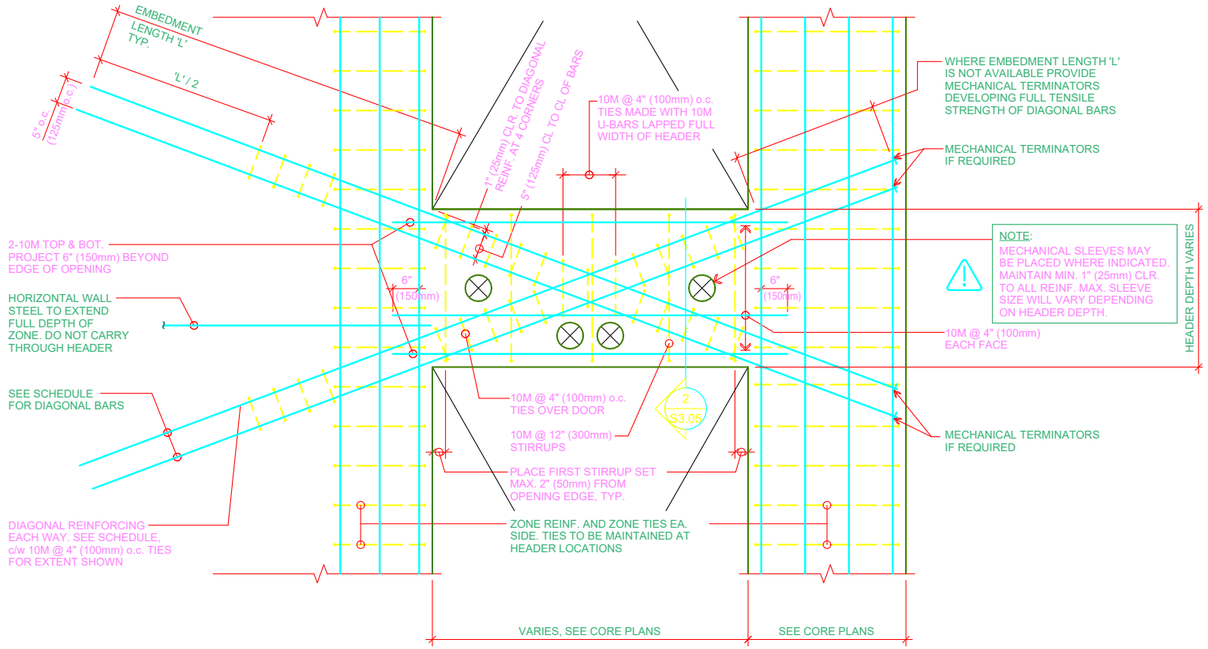

DIAGONAL REINFORCING EMBEDMENT TABLE (400W)

LENGTH 'L' : INCHES (BRACKETED VALUES ARE IN mm)

BAR \ CONC.	25 MPa	30 MPa	35 MPa	40 MPa	45 MPa	50 MPa	55 MPa	60 MPa	65 MPa & HIGHER
20M	34" (850)	31" (775)	29" (725)	27" (675)	25" (625)	24" (600)	23" (575)	22" (550)	21" (525)
25M	55" (1375)	50" (1250)	46" (1150)	43" (1075)	41" (1025)	39" (975)	37" (925)	35" (875)	34" (850)
30M	65" (1625)	59" (1475)	55" (1375)	51" (1275)	48" (1200)	46" (1150)	44" (1100)	42" (1050)	40" (1000)
35M	77" (1925)	71" (1775)	65" (1625)	61" (1525)	58" (1450)	55" (1375)	52" (1300)	50" (1250)	48" (1200)

DIAGONAL REINFORCING EMBEDMENT TABLE (500W)

LENGTH 'L' : INCHES (BRACKETED VALUES ARE IN mm)

BAR \ CONC.	25 MPa	30 MPa	35 MPa	40 MPa	45 MPa	50 MPa	55 MPa	60 MPa	65 MPa & HIGHER
20M	42" (1050)	38" (975)	36" (900)	33" (850)	31" (800)	30" (750)	29" (725)	27" (700)	26" (675)
25M	68" (1700)	62" (1550)	58" (1450)	54" (1350)	51" (1275)	48" (1200)	46" (1150)	44" (1100)	42" (1050)
30M	81" (2025)	74" (1850)	68" (1700)	64" (1600)	60" (1500)	57" (1425)	55" (1375)	52" (1300)	50" (1250)
35M	95" (2400)	87" (2200)	81" (2050)	76" (1900)	71" (1800)	68" (1700)	65" (1625)	62" (1550)	59" (1500)
45M	117" (2950)	107" (2700)	99" (2500)	92" (2350)	87" (2200)	83" (2100)	79" (2000)	76" (1900)	73" (1825)

What differs: CAD is a larger, project-specific 40in/53in deep header elevation with mechanical terminators and sleeve notes and no embedment tables; '1E3.05_1_TYPICAL DIAGONALLY REINFORCED HEADER DETAIL' is the generic version with tables.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: G002 - 31.0 SHEAR WALL AND ZONE REINF (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on DL1.03 GENERAL NOTES AND TYPICAL DETAILS | 1EL1.02 GENERAL N)

CAD (master)

ZONE AND SHEAR WALL NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR GRADE 400W REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa.
   FOR GRADE 500W REINFORCING ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 625 MPa.
   TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. HOOK WALL / ZONE VERTICAL REINFORCING AT TOP OF SLAB WHERE NOTED.
10. NO VERTICAL CONSTRUCTION JOINTS ARE PERMITTED IN SHEAR WALLS EXCEPT WITH WRITTEN PERMISSION FROM STRUCTURAL ENGINEER.
11. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

Revit template

31.0 TYPICAL CONCRETE SHEAR WALL AND ZONE REINFORCING NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR ZONE REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa. ALSO, TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

What differs: Same zone and shear wall notes text, but 'G002 - 31.0 SHEAR WALL AND ZONE REINF' has 9 items; CAD has 11 (adds grade 400W/500W yield limits, hooking verts at top of slab, no vertical construction joints).

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: G002 - 31.0 SHEAR WALL AND ZONE REINF (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on DL1.03 GENERAL NOTES AND TYPICAL DETAILS | 1EL1.02 GENERAL N)

CAD (master)

ZONE AND SHEAR WALL NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.

2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.

3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.

4. FOR GRADE 400W REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa.
   FOR GRADE 500W REINFORCING ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 625 MPa.
   TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.

5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.

6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.

7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.

8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).

9. HOOK WALL / ZONE VERTICAL REINFORCING AT TOP OF SLAB WHERE NOTED.

10. NO VERTICAL CONSTRUCTION JOINTS ARE PERMITTED IN SHEAR WALLS EXCEPT WITH WRITTEN PERMISSION FROM STRUCTURAL ENGINEER.

11. ZONES ARE TO HAVE 50% STAGGERED SPLICES FOR VERTICAL BARS (SPLICE HALF OF EACH ZONE VERTS. AT ALT. FLOORS). FROM LEVEL P1 TO U/S OF LEVEL 36. BARS MAY BE 100% SPLICED FROM LEVEL 36 AND UP, UNLESS NOTED OTHERWISE ON DETAILS.

Revit template

31.0 TYPICAL CONCRETE SHEAR WALL AND ZONE REINFORCING NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR ZONE REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa. ALSO, TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

What differs: Same notes as 'G002 - 31.0 SHEAR WALL AND ZONE REINF' but CAD has 11 items, including the clouded 50% staggered zone splice note that 'G002 - 31.0 SHEAR WALL AND ZONE REINF' lacks.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____