The 55 details drawn differently in CAD and Revit

Checked against the new drafters' file, 26 October.

55 of the 190 CAD typical details have a Revit version in your templates that is drawn differently. Each page: your CAD detail on the left, the Revit version on the right, what differs, and one answer: CAD is right, Revit is newer (we update CAD from it), or both wrong.

The new drafters' file is built from your Concrete Tower R24 template, with the detail from your CAD block put in where a sheet held a Revit copy. So the orange line under each title says where that Revit version stands now:

NO (32 pages): the Revit version is in your Container R23 file only. The new file carries the CAD version.

REPLACED (13 pages): it was your view on a sheet, and a detail from your CAD blocks now sits in its place - the line names which. If you answer Revit is newer, your view goes back on the sheet.

YES (10 pages): both versions are in the new file.

Until a page is answered, that detail stays out of the drafters' Details palette.

The pictures were made on 23 October; your CAD blocks and the template views they show have not changed since.


PLUS 6 MORE (56-61): details the old catalogue offered whose only match in your templates is a view on no sheet, drawn differently. Same question: which version is the standard?

 CAD: KOR-D201-DET 01 - TYPICAL DETAIL AT JUNCTION OF 60 TO 36 DEEP RAFT


Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

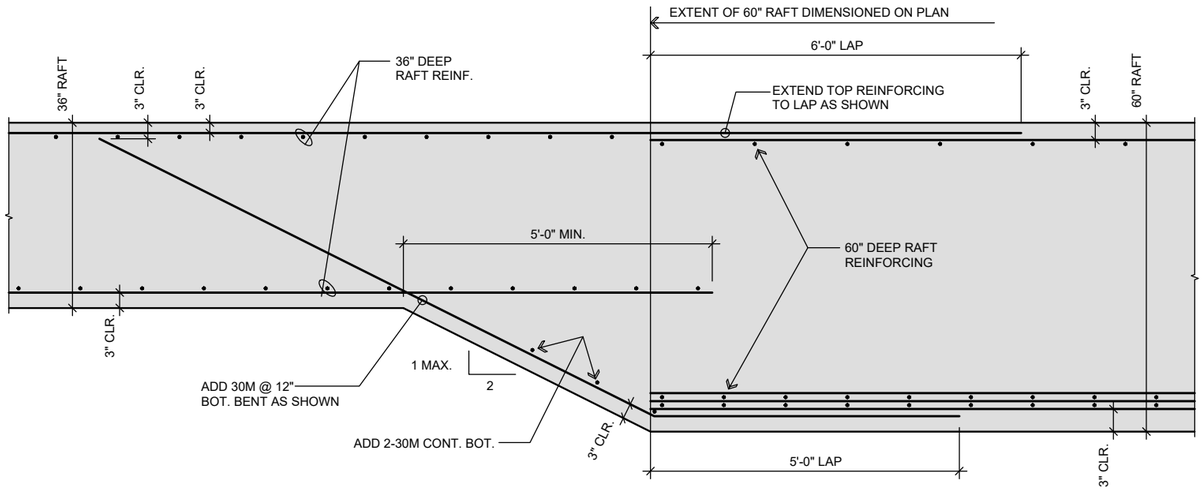

Revit template

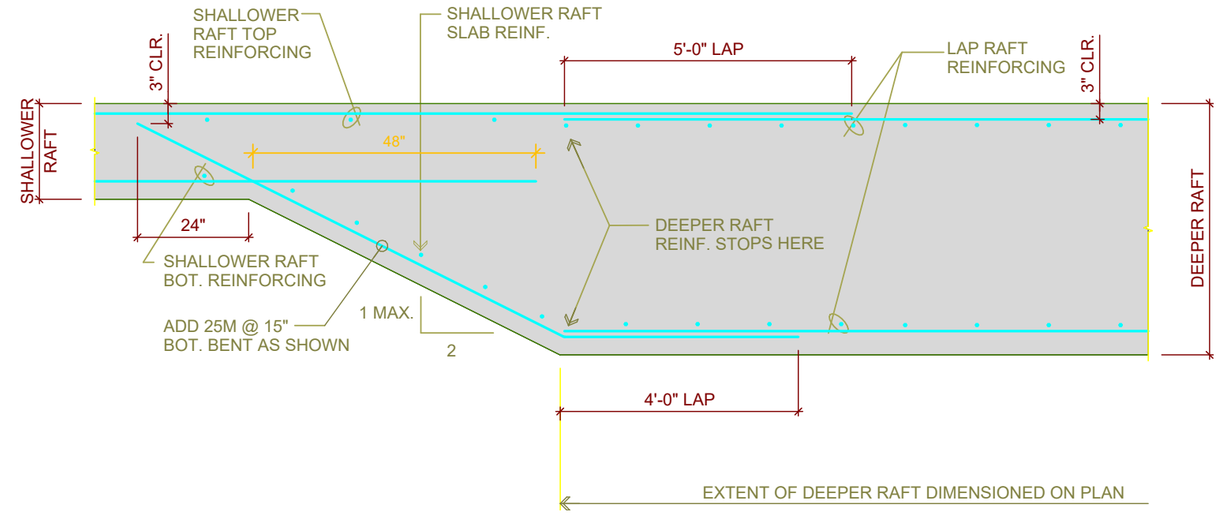

What differs: 60-to-36 junction version: same sloped transition but extra top-bar extension and 60-in raft reinforcing callouts; 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS' is the generic change in thickness.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D201-DET 02 - TYPICAL DETAIL AT JUNCTION OF 48 TO 36 DEEP RAFT


Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

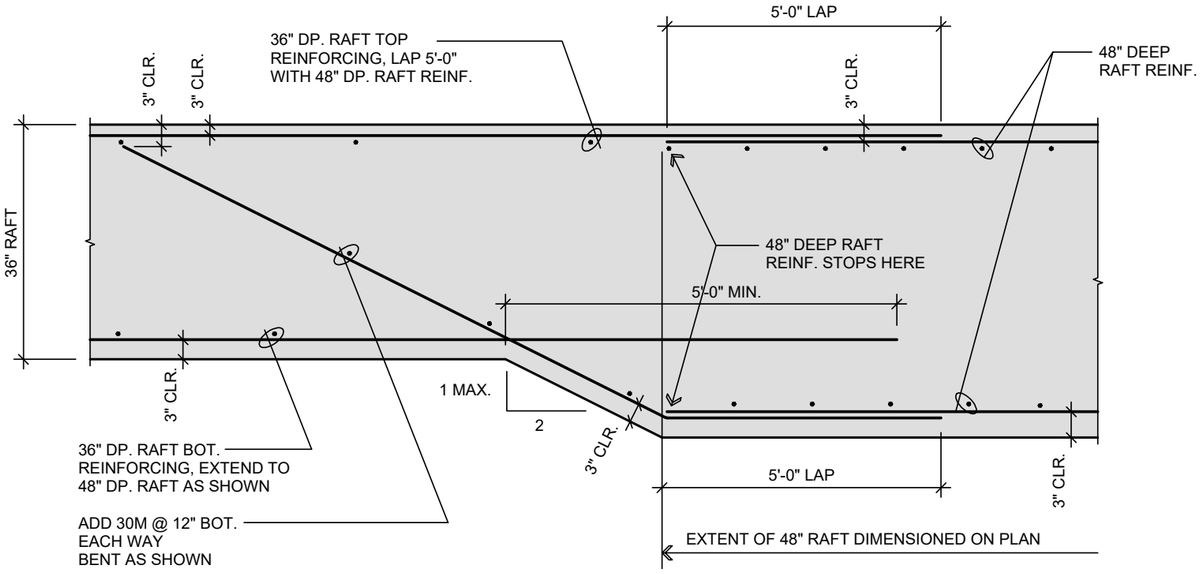

Revit template

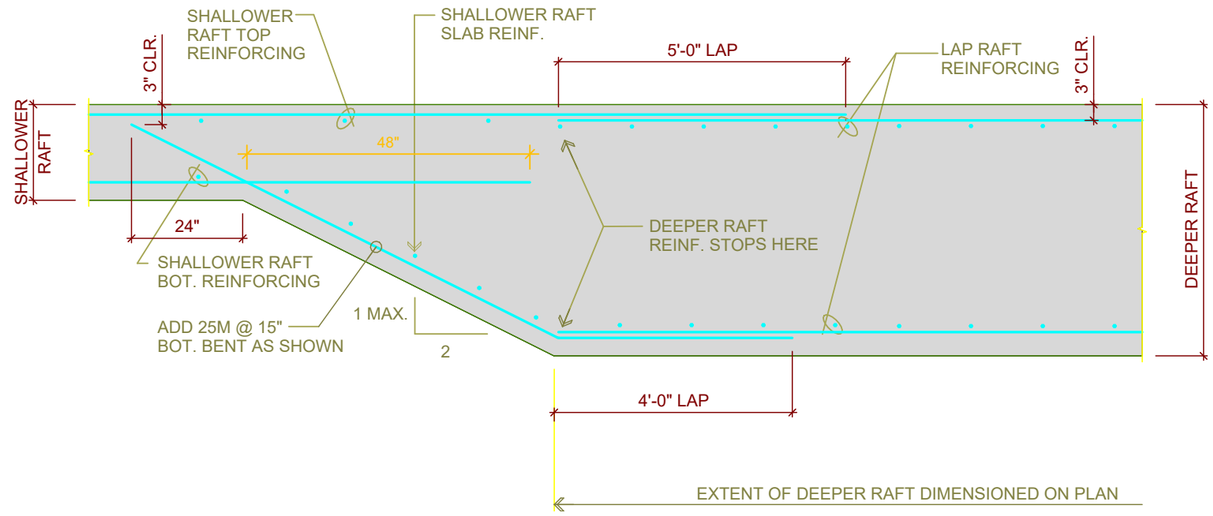

What differs: 48-to-36 junction version of the sloped raft transition; adds 48-in deep reinf callouts and a 30M bent bottom bar vs generic 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D201-DET 03 - TYPICAL BASEMENT WALL


Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

In the new file: REPLACED. This was your view on S5.05 position 1; KOR-D301-DET 07 now sits there. If Revit is newer, yours goes back.

CAD (master)

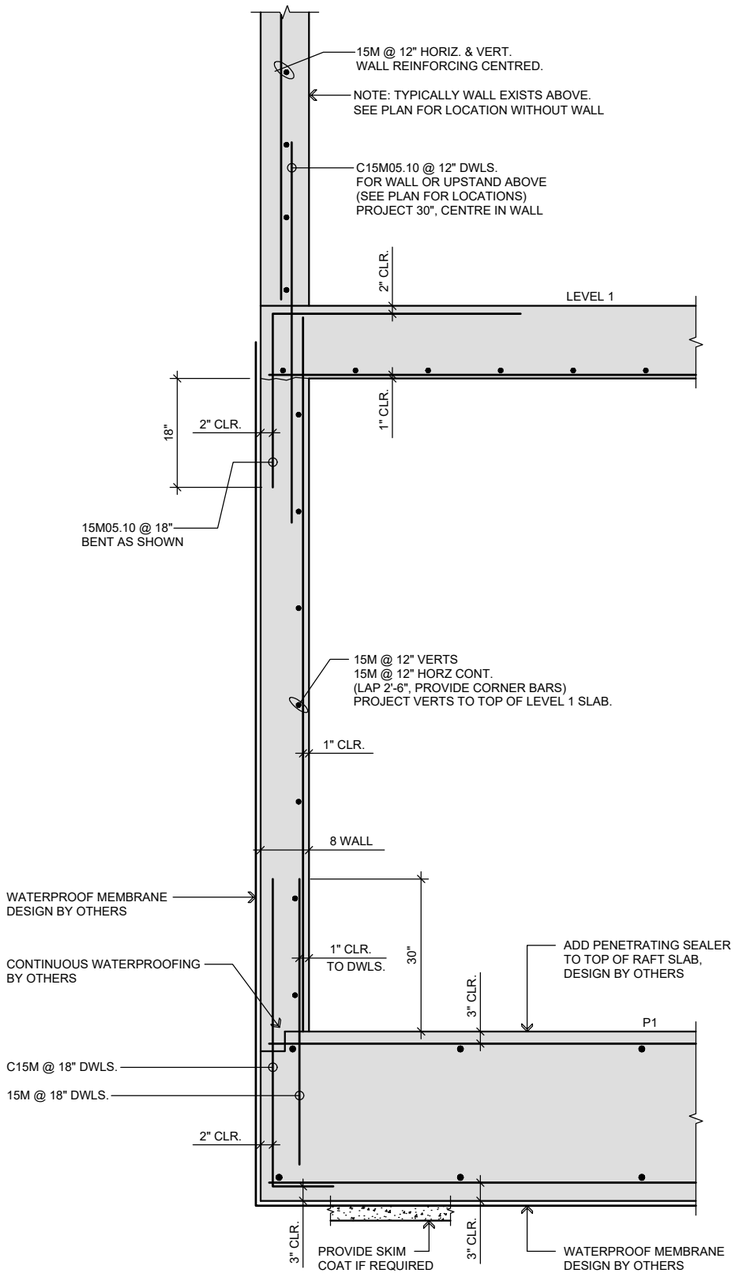

Revit template

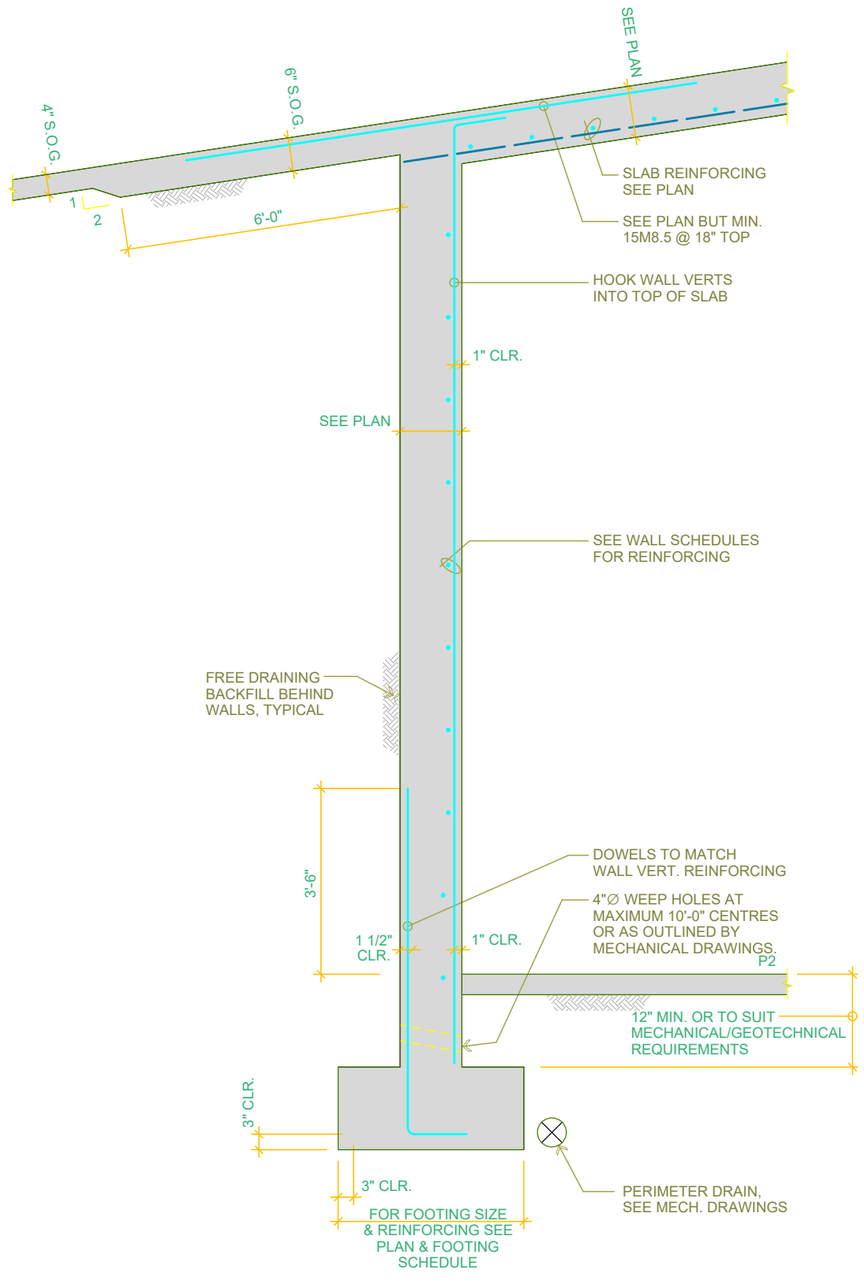


What differs: CAD is a basement wall running from suspended slab down into the raft with an intermediate slab; 'S5.05_1_BASEMENT WALL DETAIL' is a wall with sloped slab over and strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D5.01_1_TRENCH DRAIN ON GRADE DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

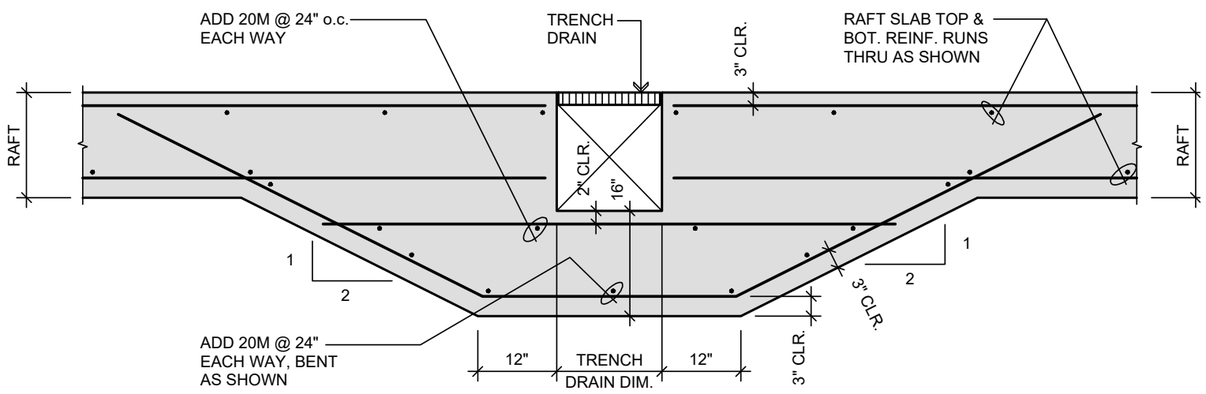

Revit template

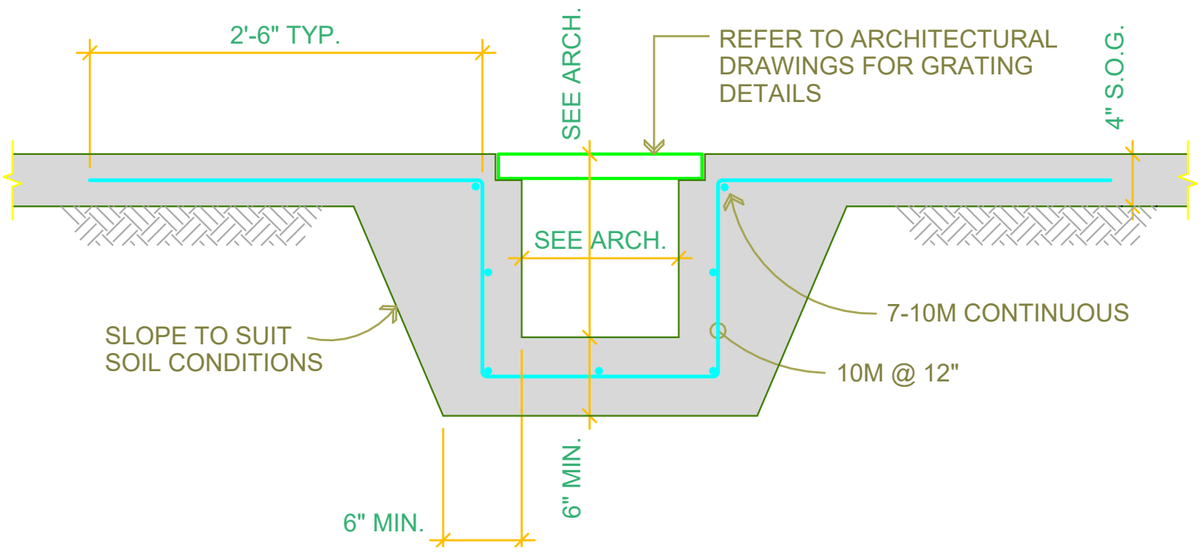

What differs: CAD is a trench drain in a thickened raft with 20M bars; 'D5.01_1_TRENCH DRAIN ON GRADE DETAIL' is the on-grade thickened trench of the same shape but different slab and bars ('D5.01_2_TRENCH DRAIN ON RAFT DETAIL' is a topping-on-raft trench).


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D201-DET 11 - TYPICAL PIT IN STRUCTURAL SLAB


Revit: D2.01_3_TYPICAL DETAIL AT CATCH BASIN OR SUMP IN RAFT SLAB (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

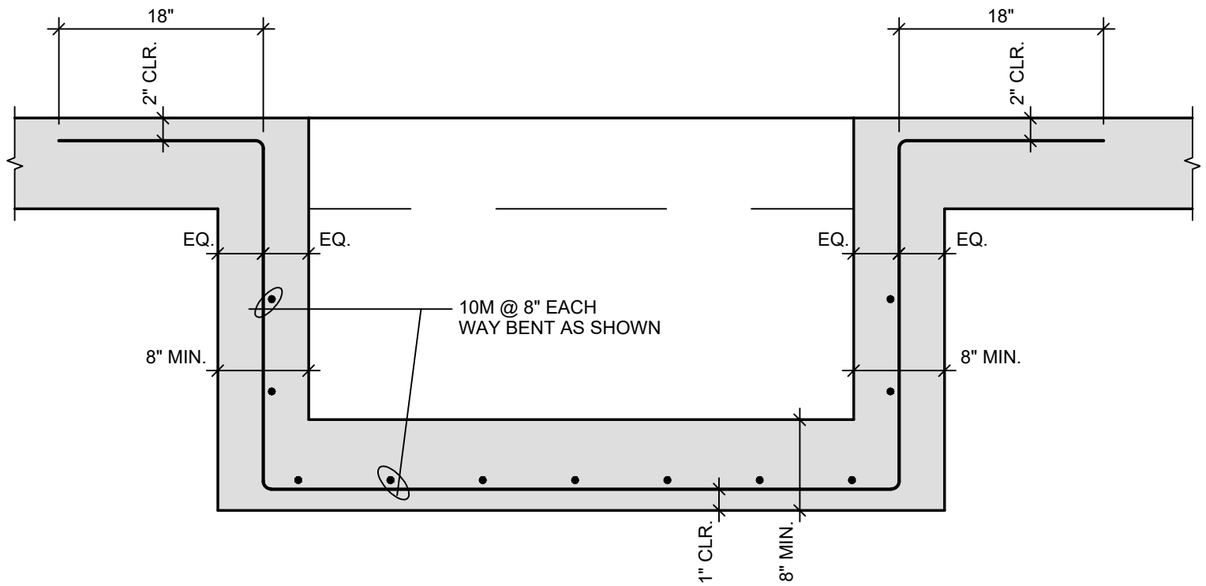

Revit template

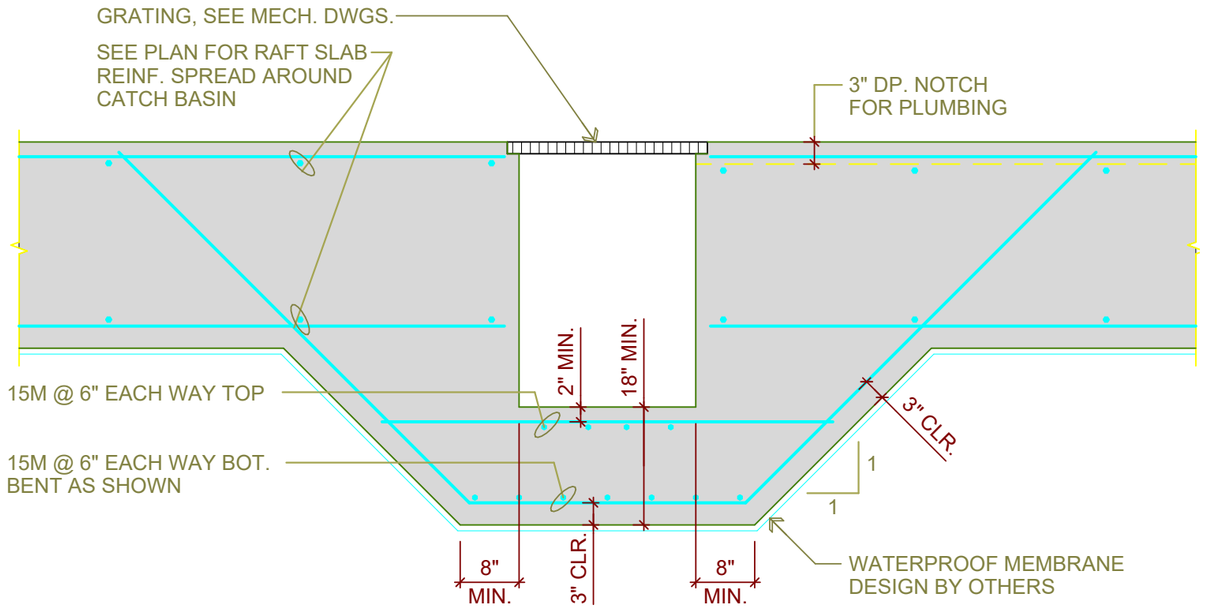

What differs: CAD is a square-sided pit dropped into a structural slab with 10M bent bars; 'D2.01_3_TYPICAL DETAIL AT CATCH BASIN OR SUMP IN RAFT SLAB' is a sloped-sided catch basin sump in raft - same purpose class, different shape and bars.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D201-DET 13 - SLOPE BETWEEN SLAB THICKNESS TYPICAL UNO


Revit: D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D2.01 FOUNDATION DETAILS)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

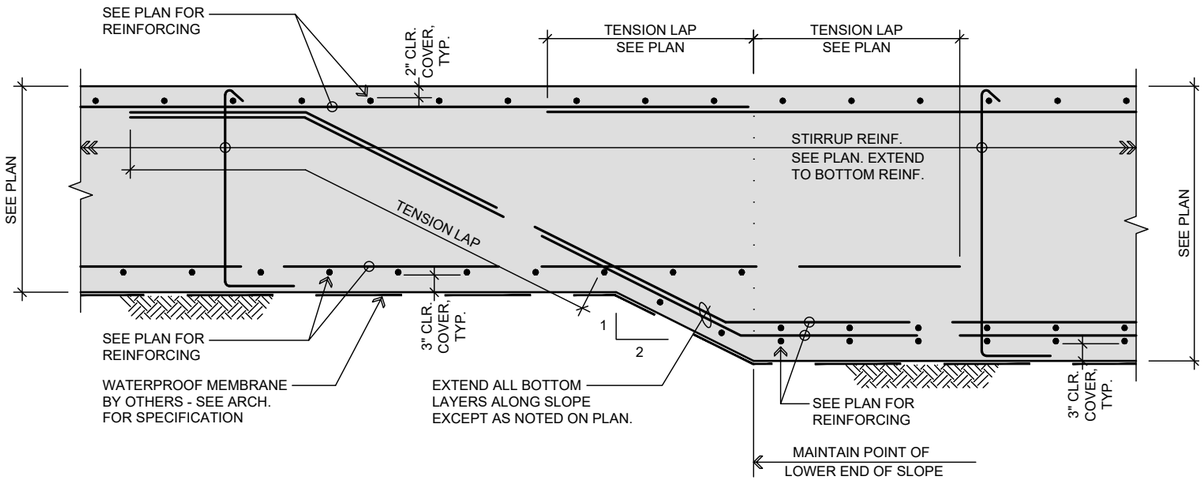

Revit template

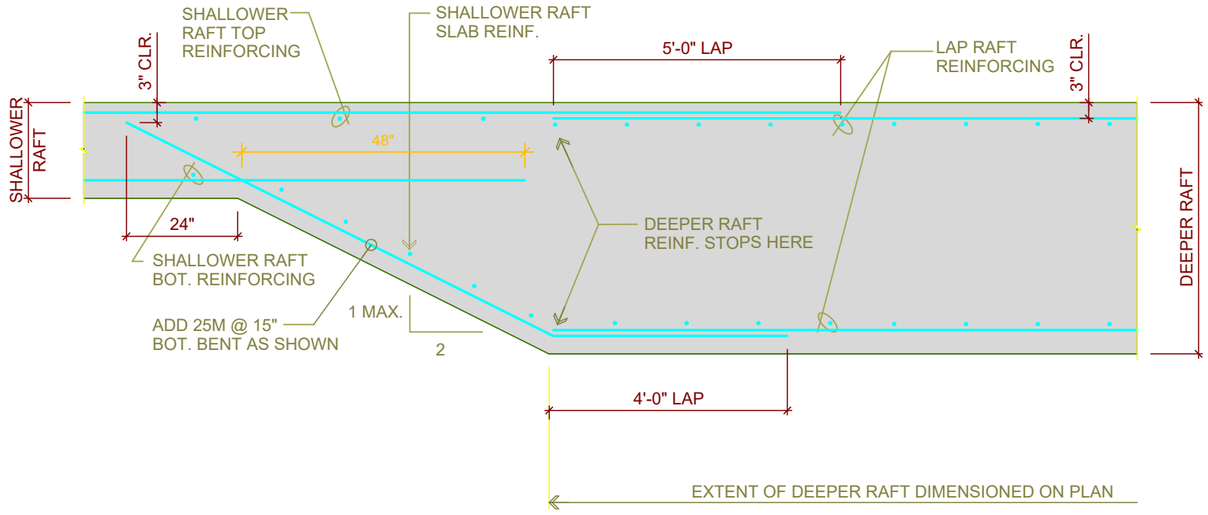

What differs: CAD slope between slab thicknesses has stirrups and tension laps on both layers; 'D2.01_1_TYPICAL CHANGE IN RAFT SLAB THICKNESS' shows a simpler bar arrangement.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

7 of 55 CAD: KOR-D202-DET 02 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

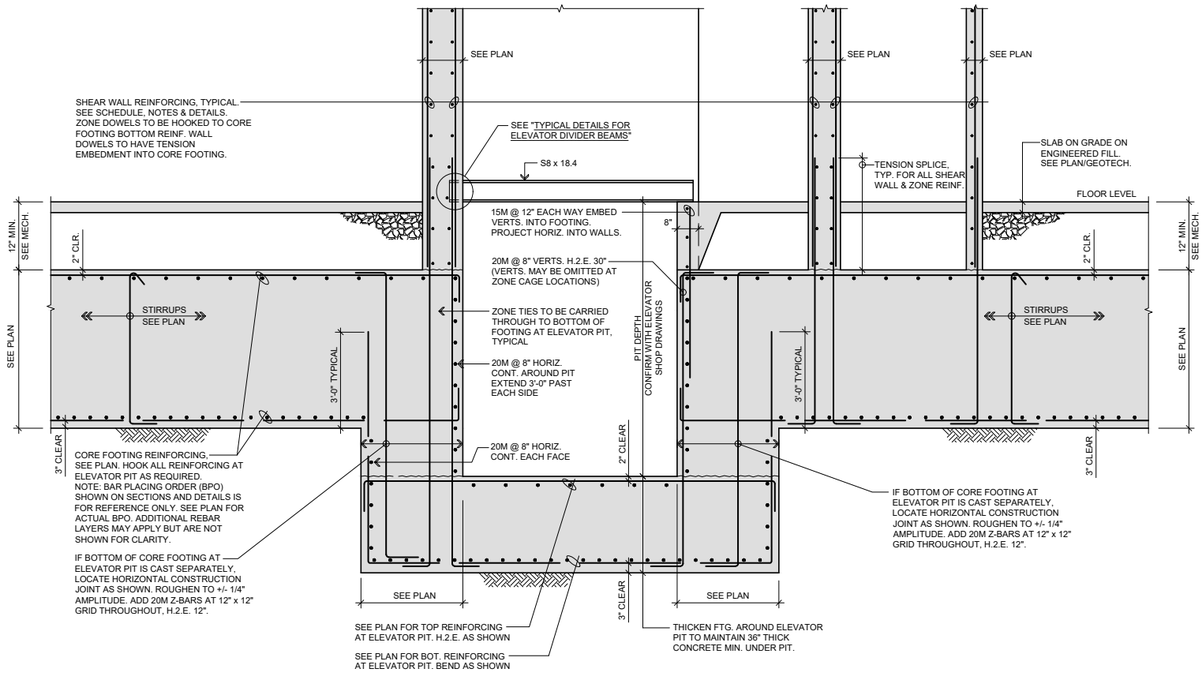

Revit template

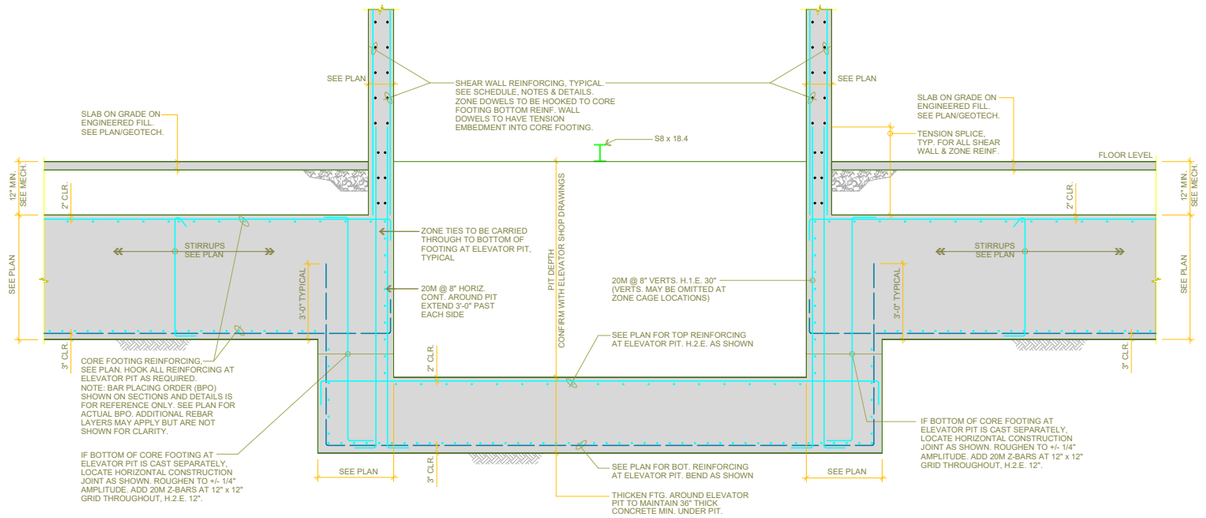

What differs: Core footing at elevator pit with a divider beam and extra horizontal bar callouts not in 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D202-DET 03 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

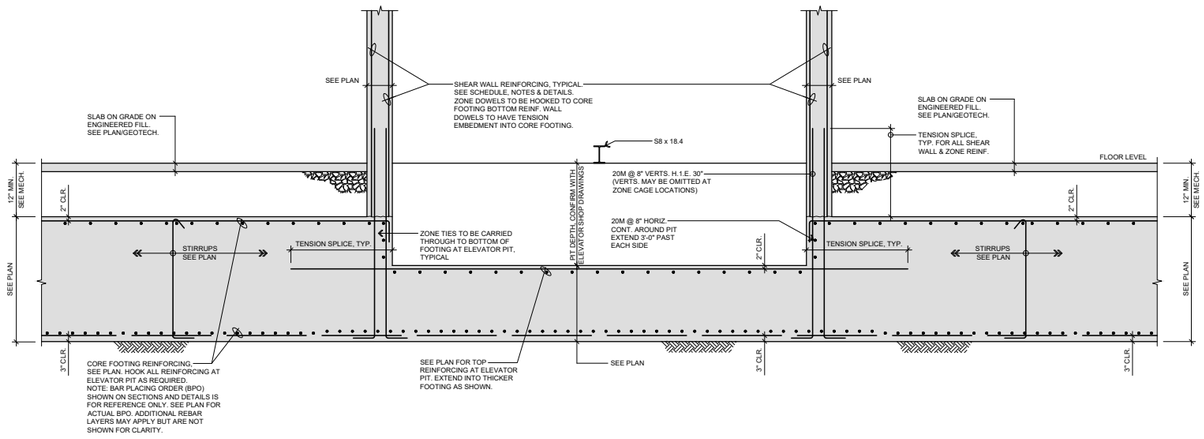

Revit template

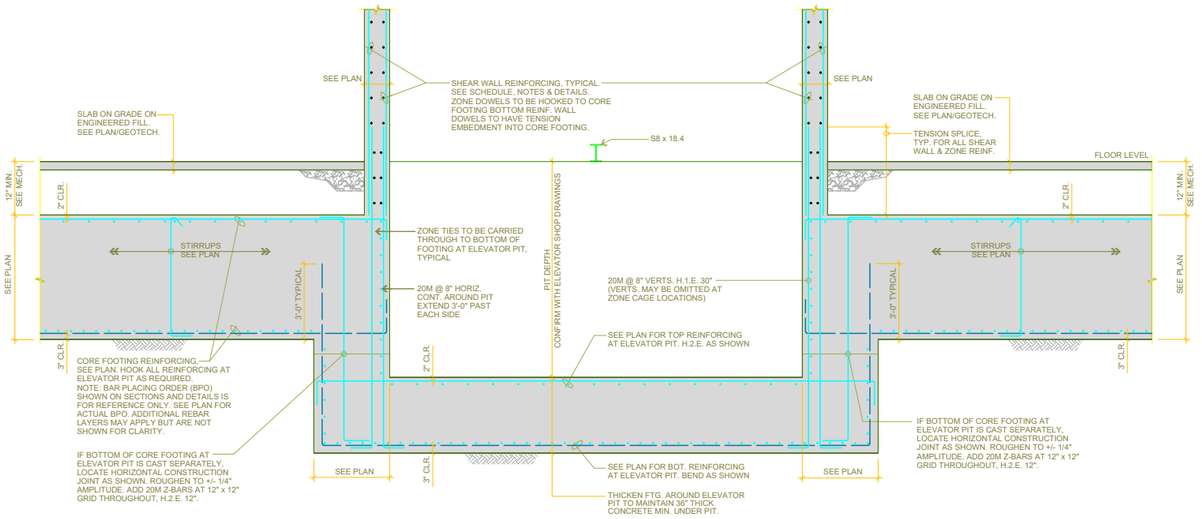

What differs: Core footing at elevator pit variant: flat footing with thicker pit slab, fewer callouts than 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D202-DET 04 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

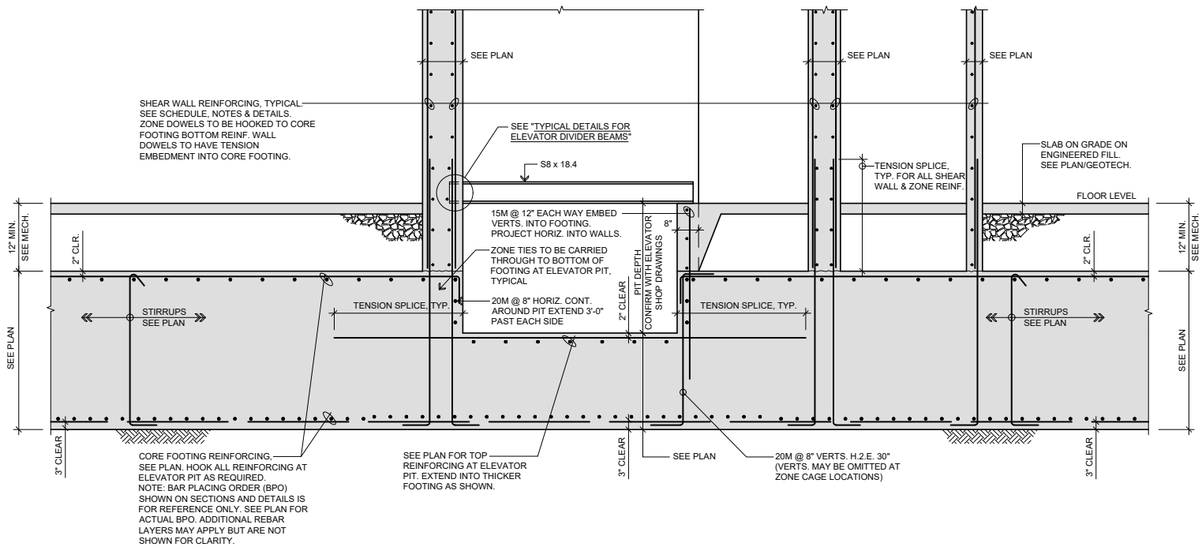

Revit template

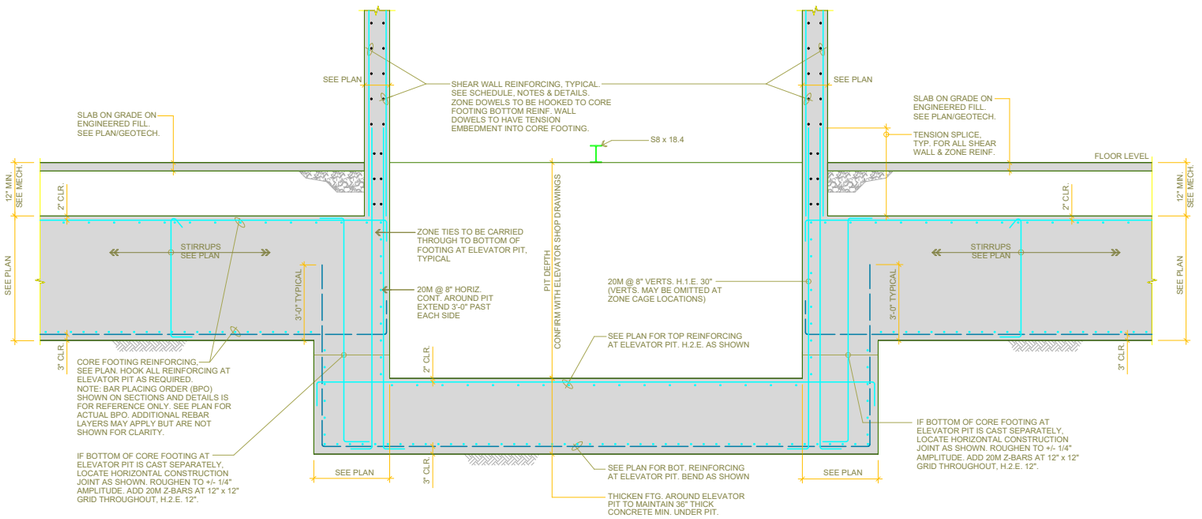

What differs: Core footing at elevator pit variant with an extra divider wall/beam and pit slab arrangement not in 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D202-DET 05 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

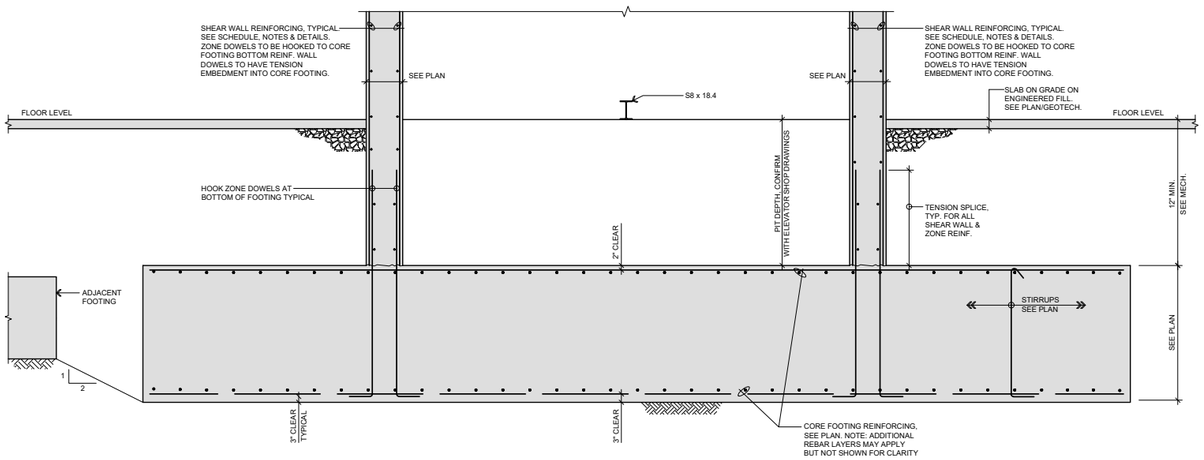

Revit template

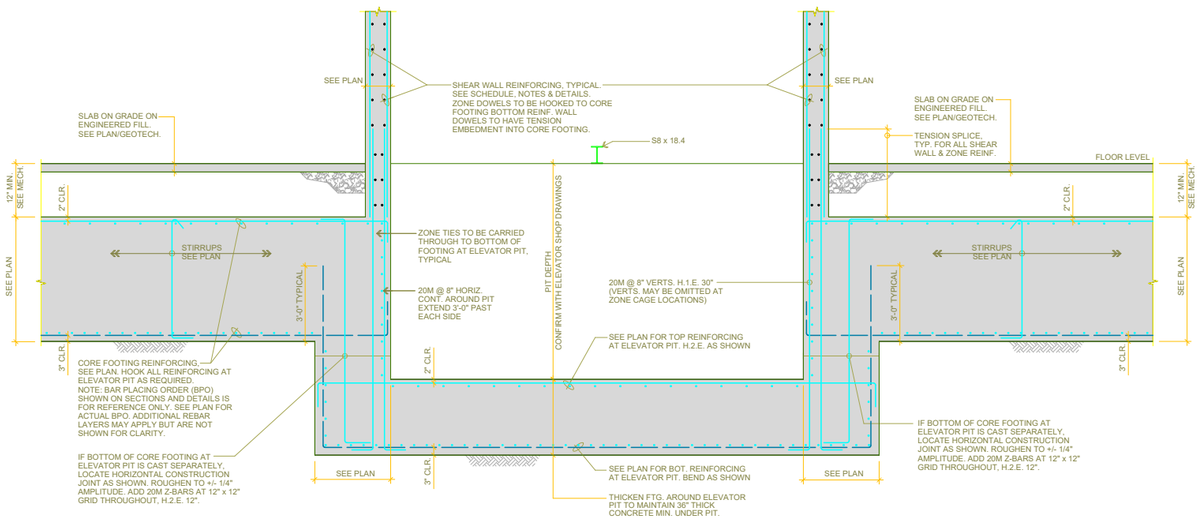

What differs: Flat core footing with adjacent footing and dowels, no stepped pit; same purpose as 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' drawn differently.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

11 of 55 CAD: KOR-D202-DET 06 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

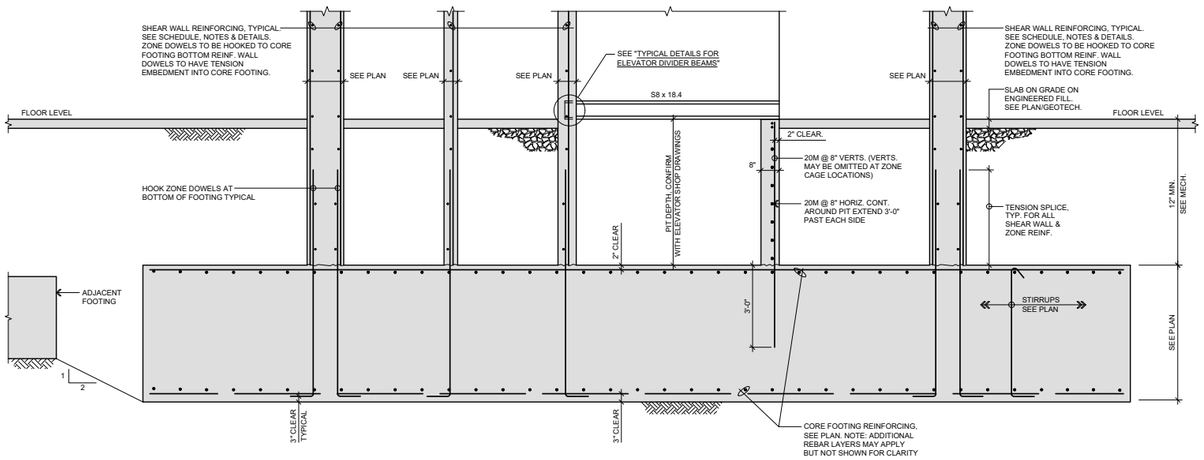

Revit template

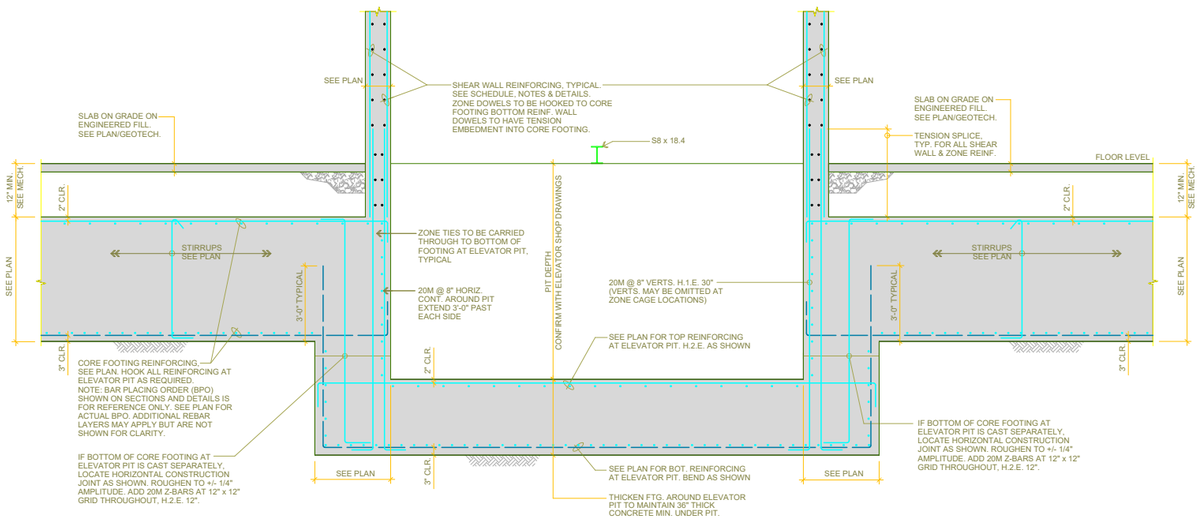

What differs: Flat core footing with divider wall and adjacent footing; differs in geometry from 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D202-DET 07 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

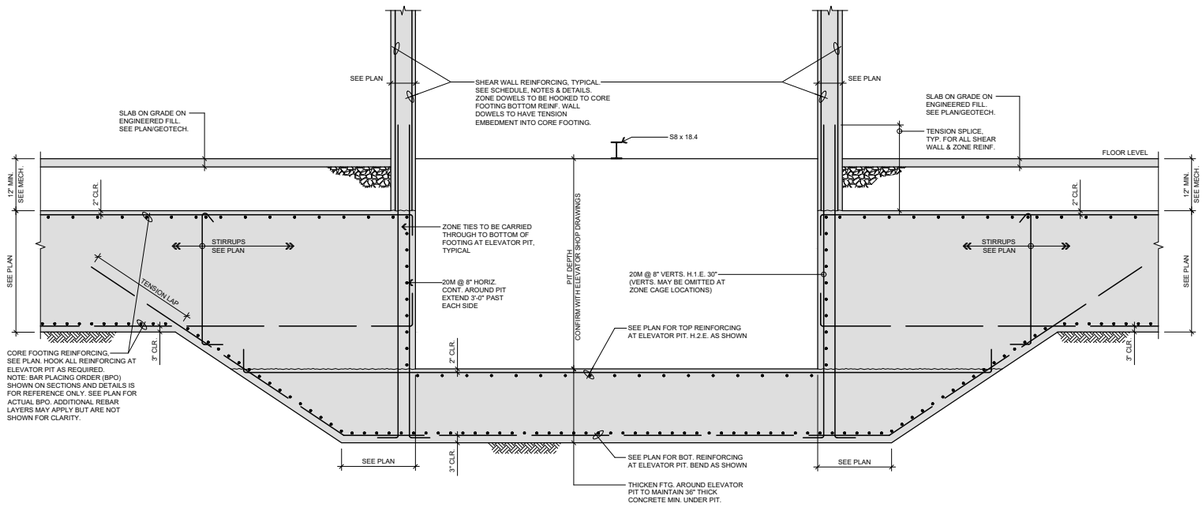

Revit template

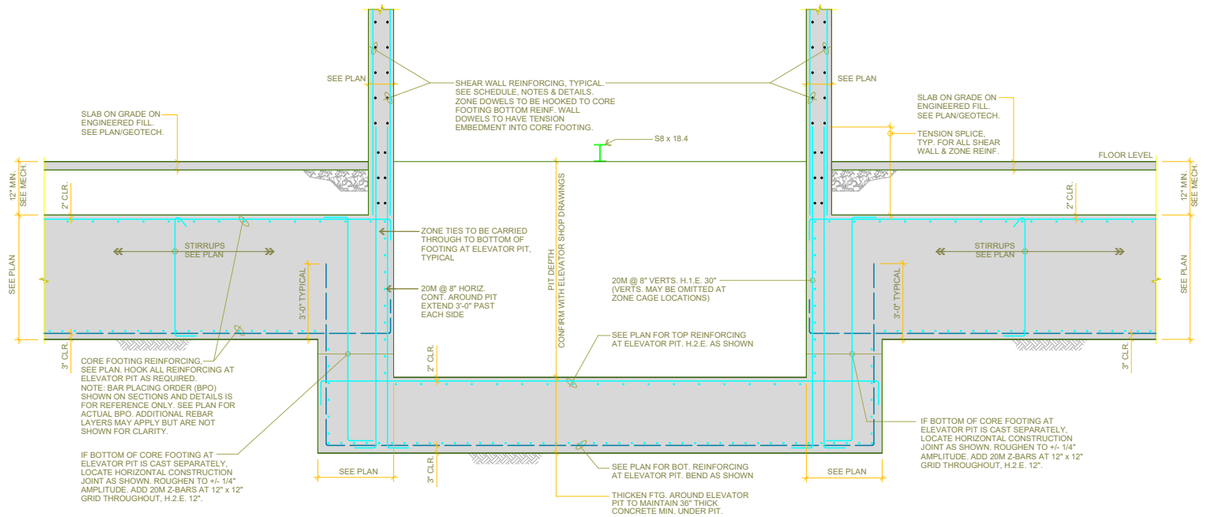

What differs: Core footing with sloped (haunched) sides to the deeper pit; 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' has vertical steps.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

13 of 55 CAD: KOR-D202-DET 08 - TYPICAL SECTION THRU CORE FOOTING AT ELEVATOR PIT


Revit: S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S6.01 CONCRETE DETAILS)

In the new file: REPLACED. This was your view on S6.01 position 2; KOR-D202-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

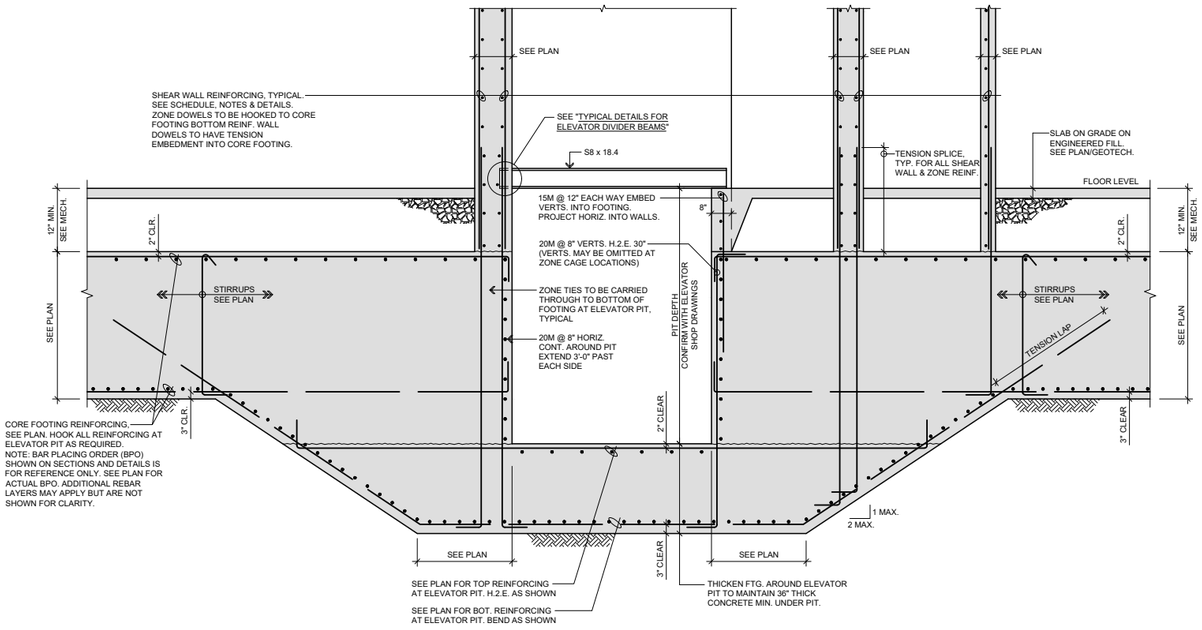

Revit template

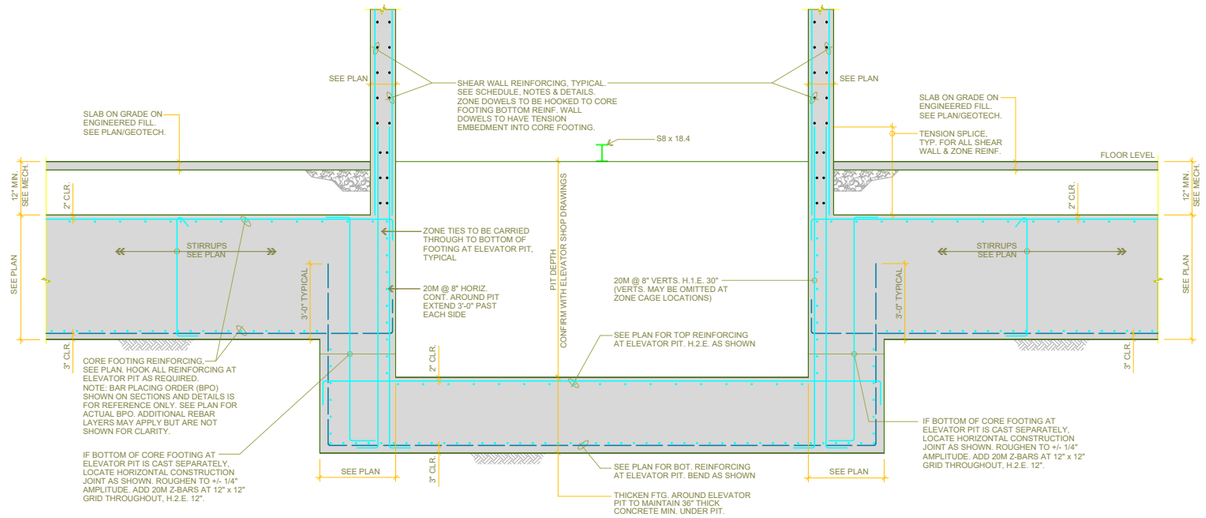

What differs: Core footing with sloped sides, divider beam and lap notes; 'S6.01_2_CORE FOOTING SECTION THRU ELEVATOR PIT' has vertical steps and no divider.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D301-DET 02 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

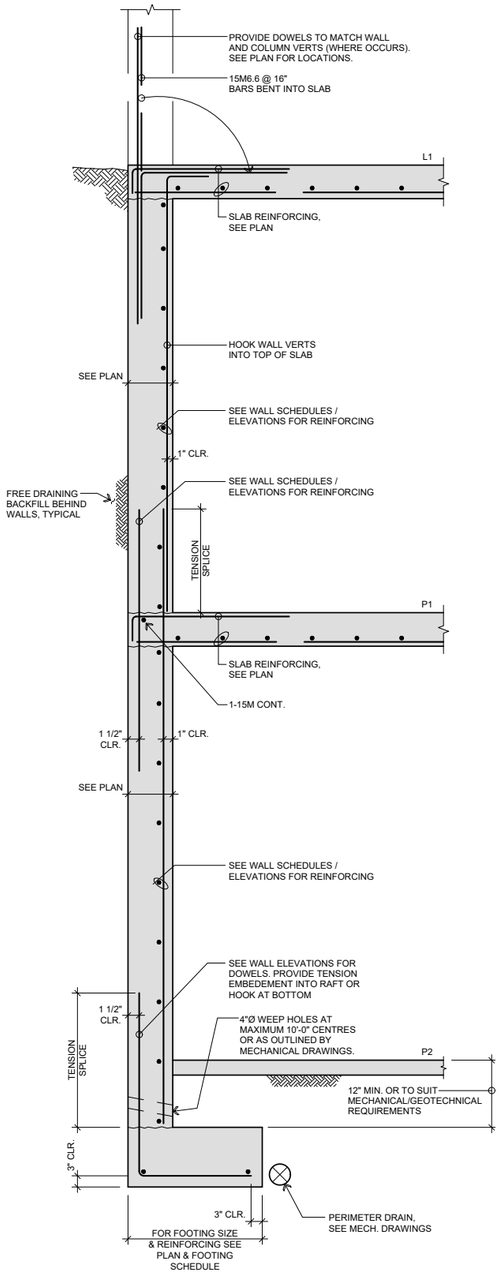

Revit template

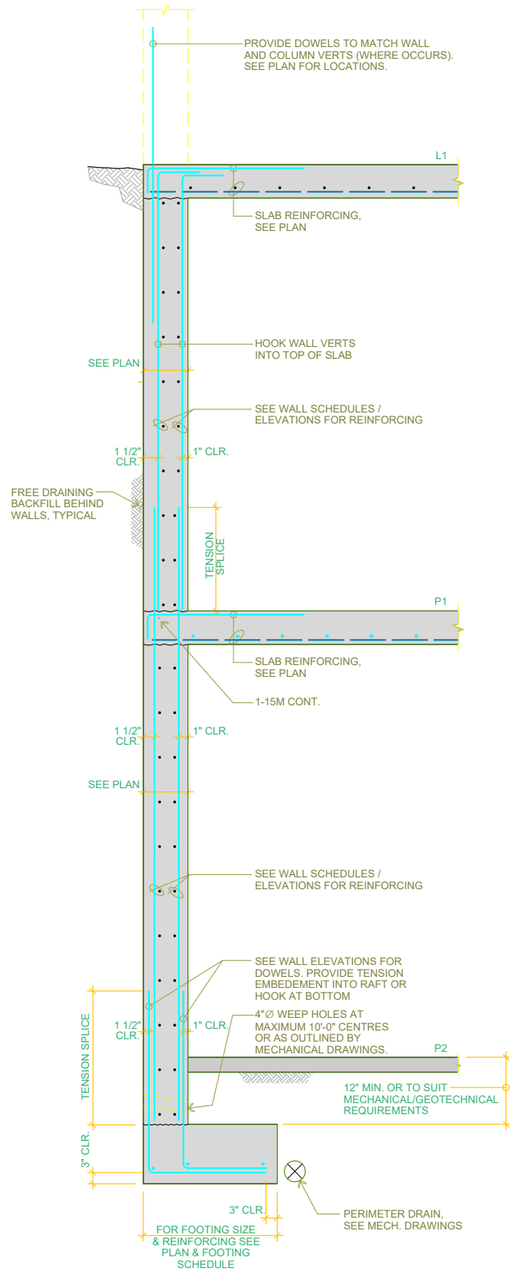

What differs: Same basement wall section but adds a wall-reinforcing-per-schedule callout and 15M bent bars that 'D3.01_1_BASEMENT WALL SECTION' lacks.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D301-DET 03 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

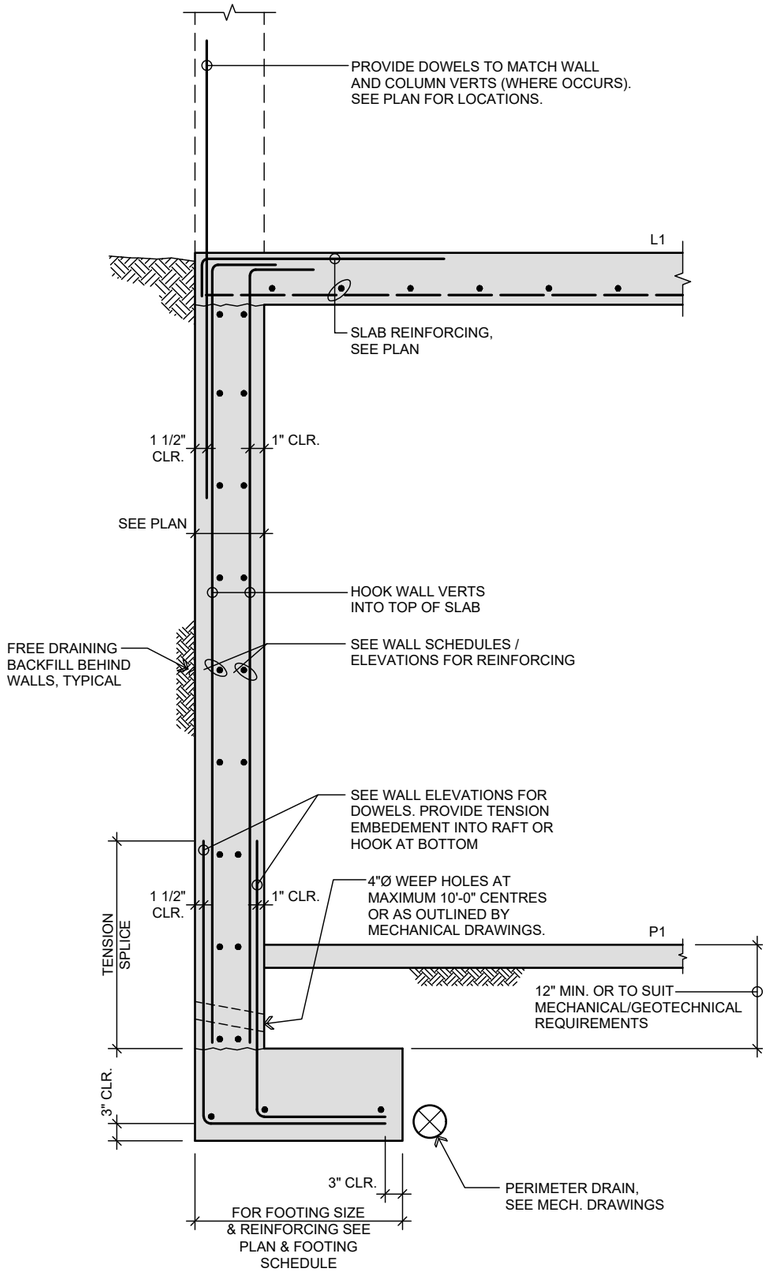

Revit template

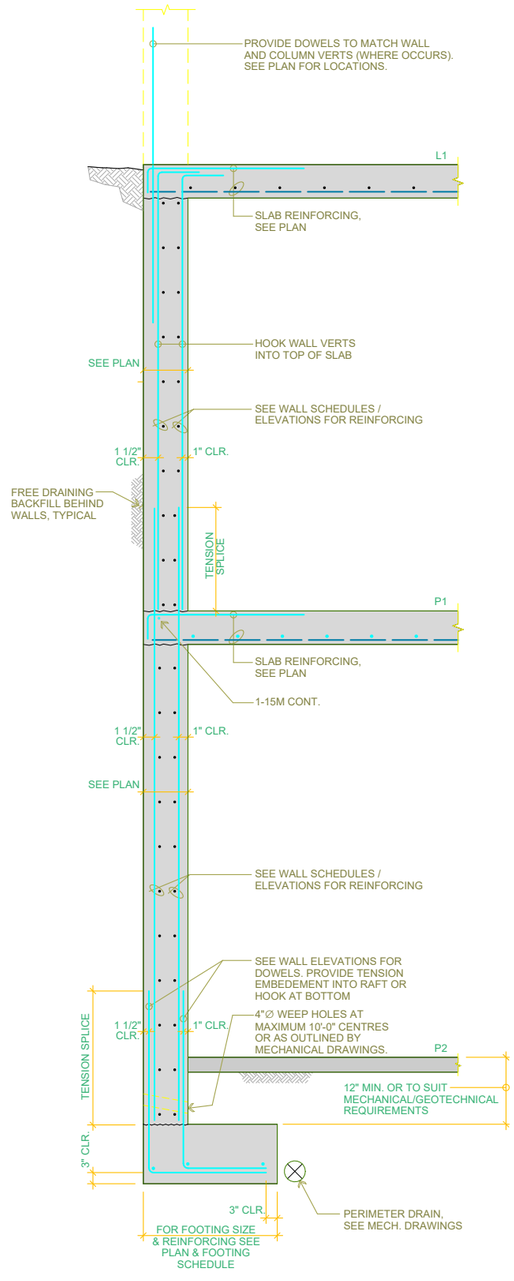

What differs: Single-storey basement wall with one slab and strip footing; 'D3.01_1_BASEMENT WALL SECTION' shows three suspended levels.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D301-DET 04 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

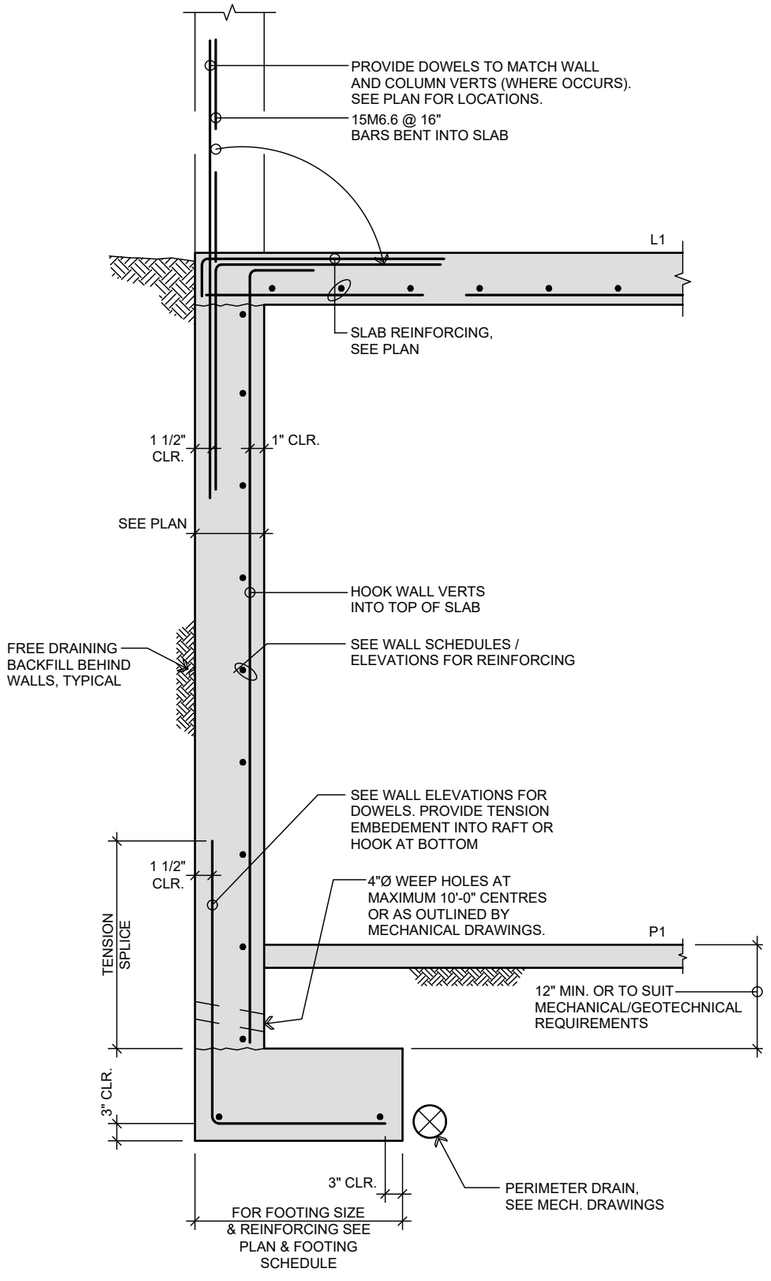

Revit template

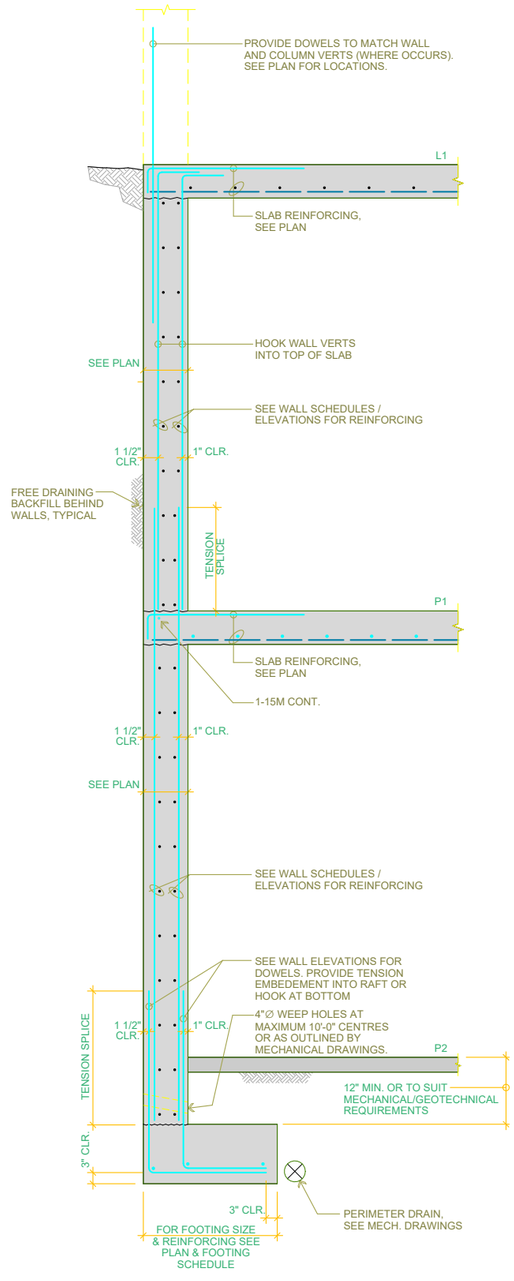


What differs: Single-storey basement wall with slab dowels and footing; 'D3.01_1_BASEMENT WALL SECTION' shows three levels.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

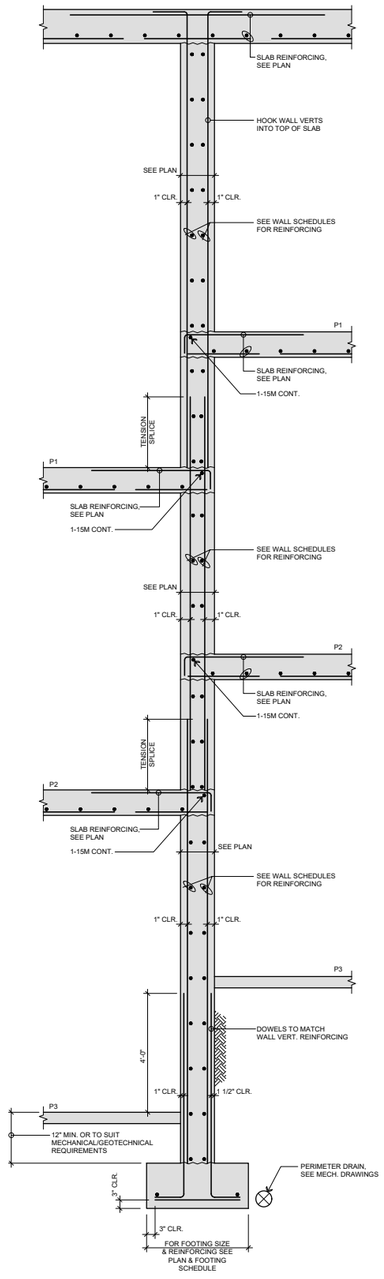

Revit template

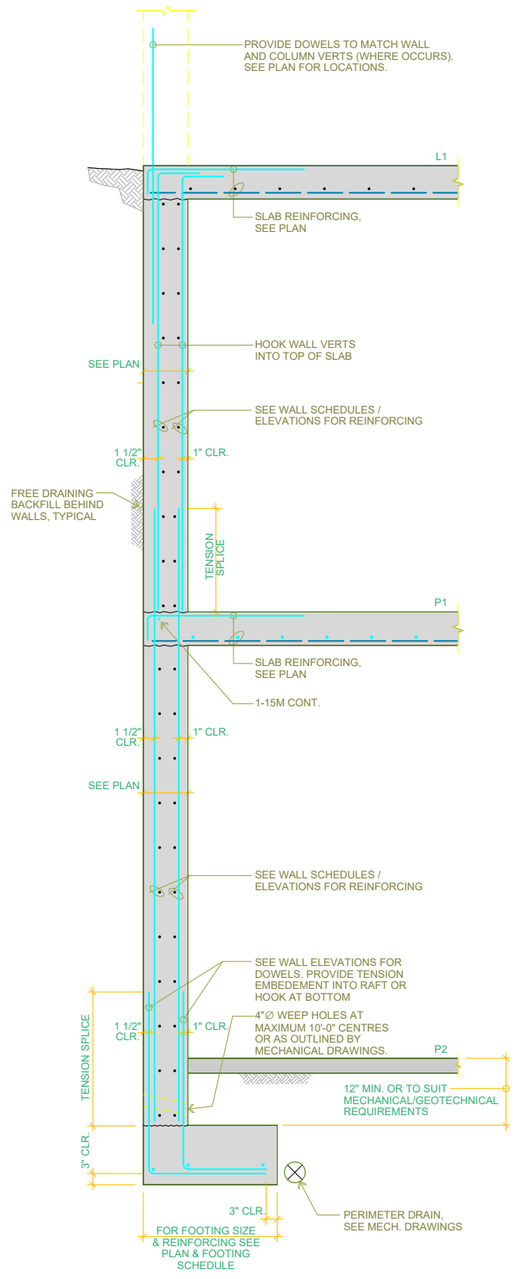


What differs: Tall multi-storey wall with five slabs; 'D3.01_1_BASEMENT WALL SECTION' shows three levels and different callouts.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

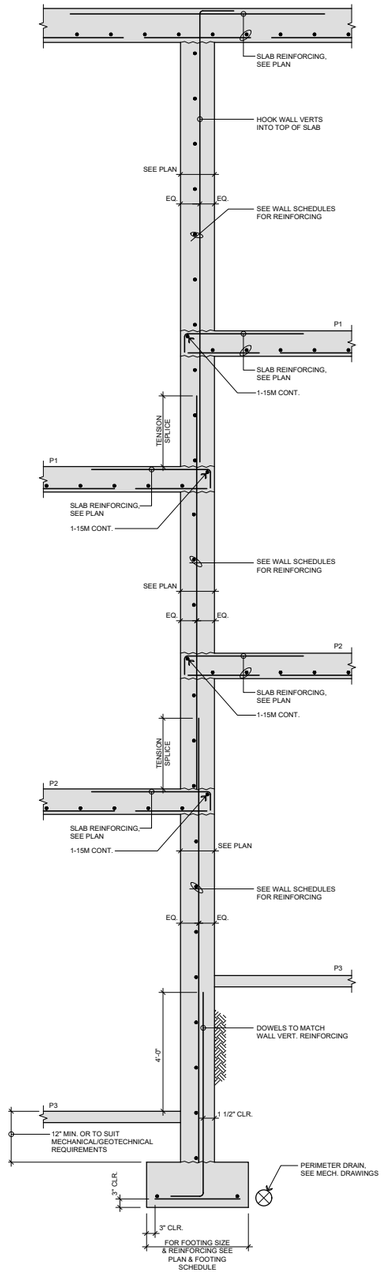

Revit template

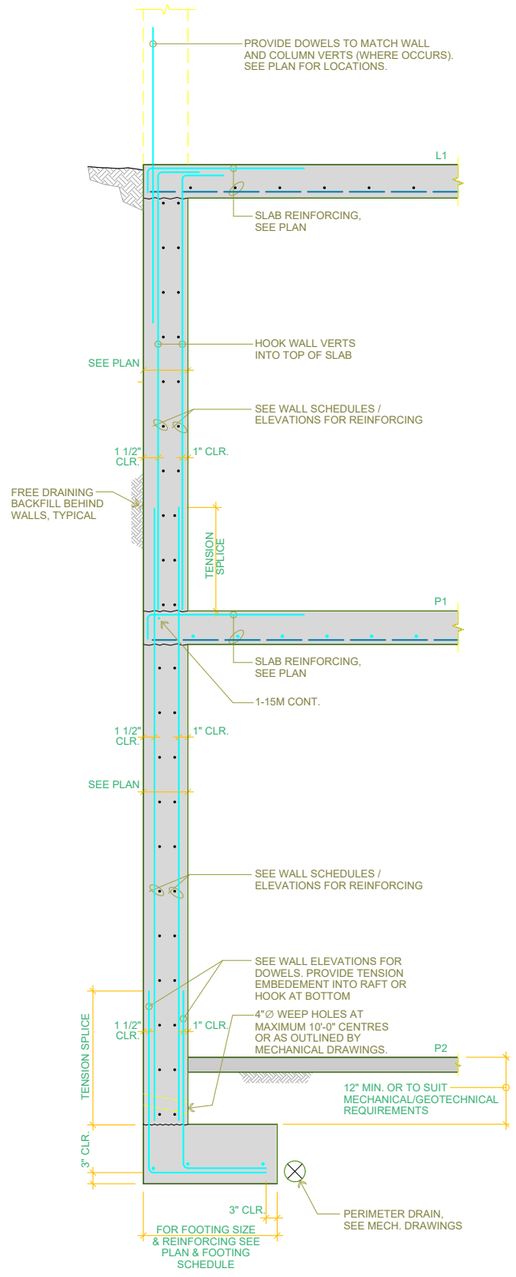

What differs: Tall multi-storey wall with five slabs; 'D3.01_1_BASEMENT WALL SECTION' shows three levels and different callouts.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 01 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

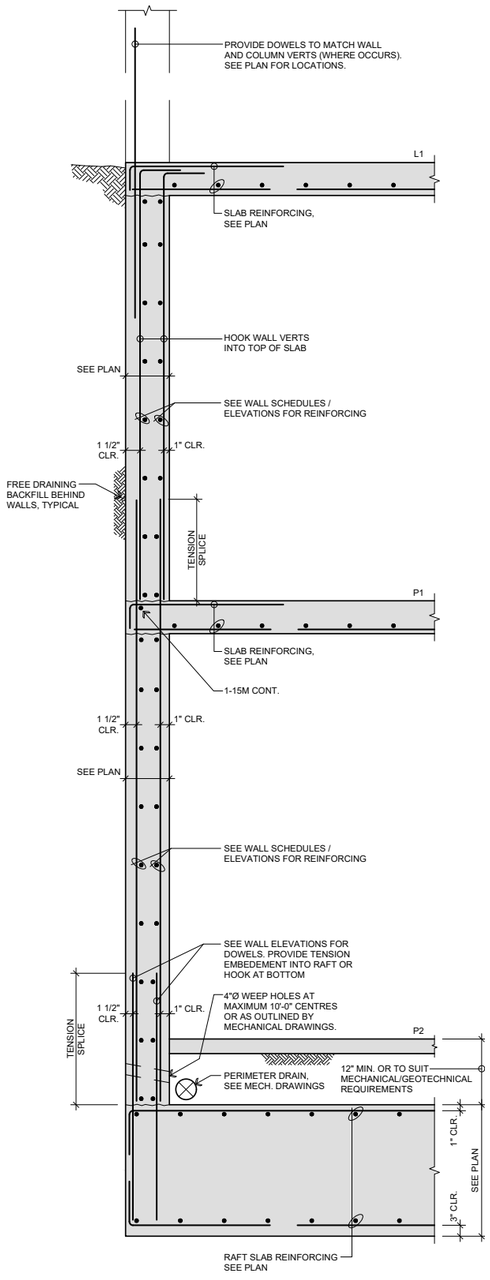

Revit template

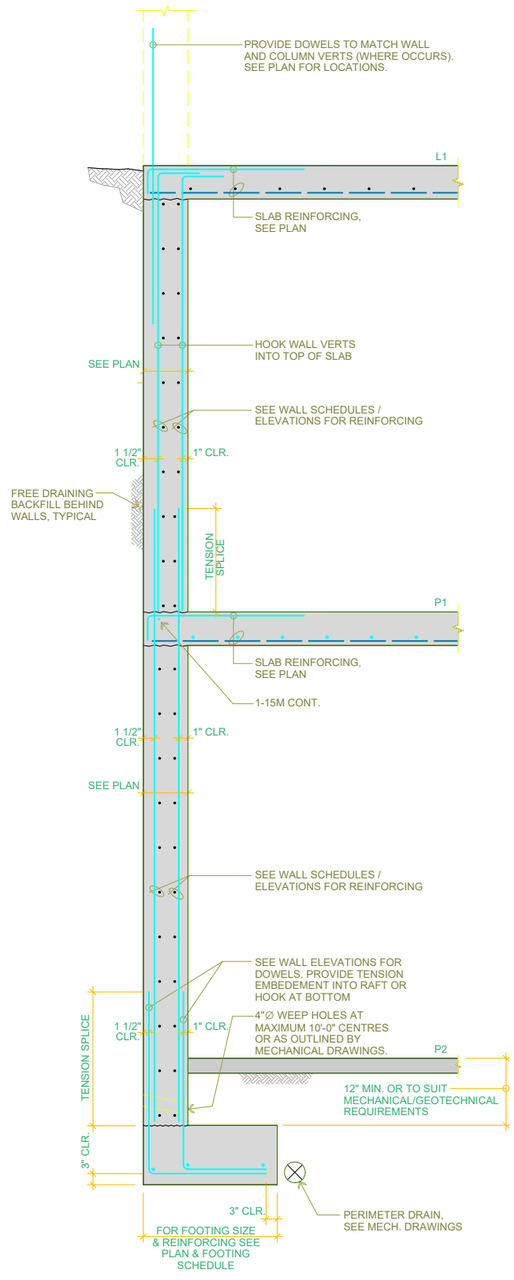

What differs: Basement wall section bearing on a raft instead of a strip footing; otherwise like 'D3.01_1_BASEMENT WALL SECTION'.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D302-DET 02 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

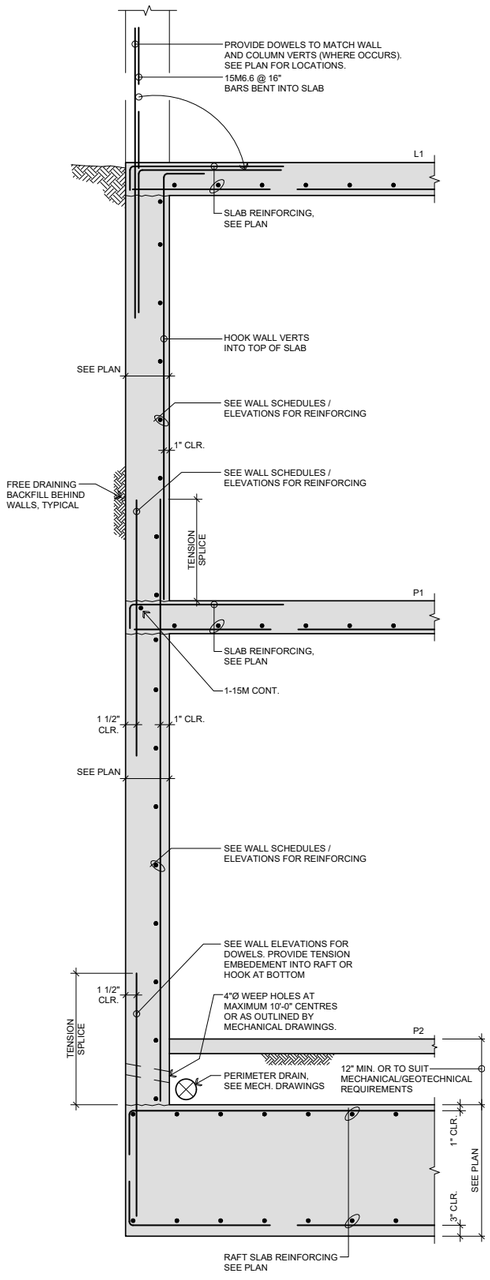

Revit template

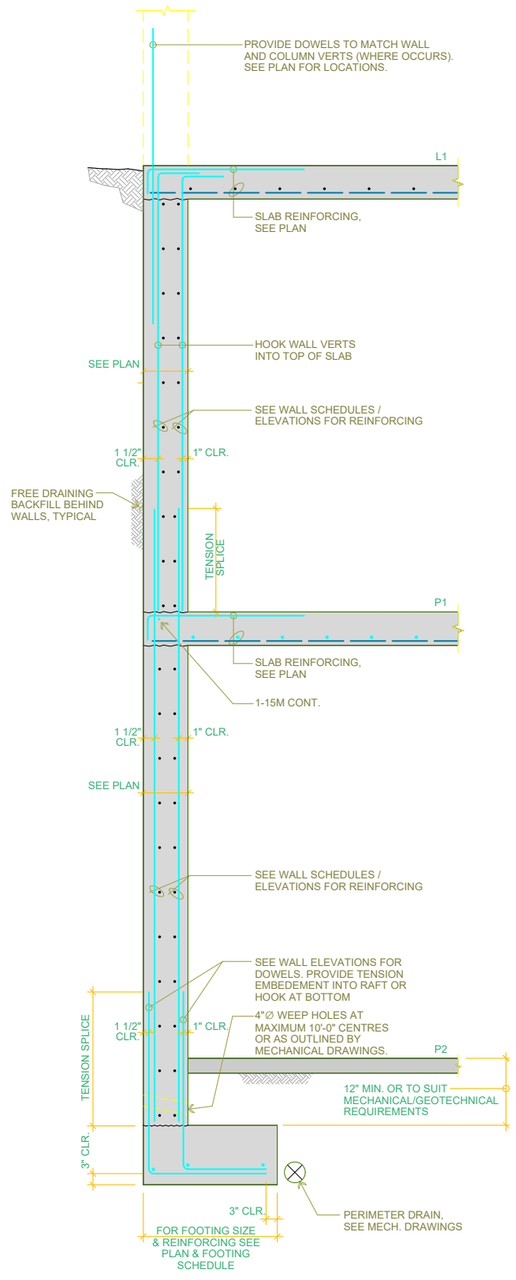

What differs: Basement wall on a raft with extra callouts vs 'D3.01_1_BASEMENT WALL SECTION''s strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D302-DET 03 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

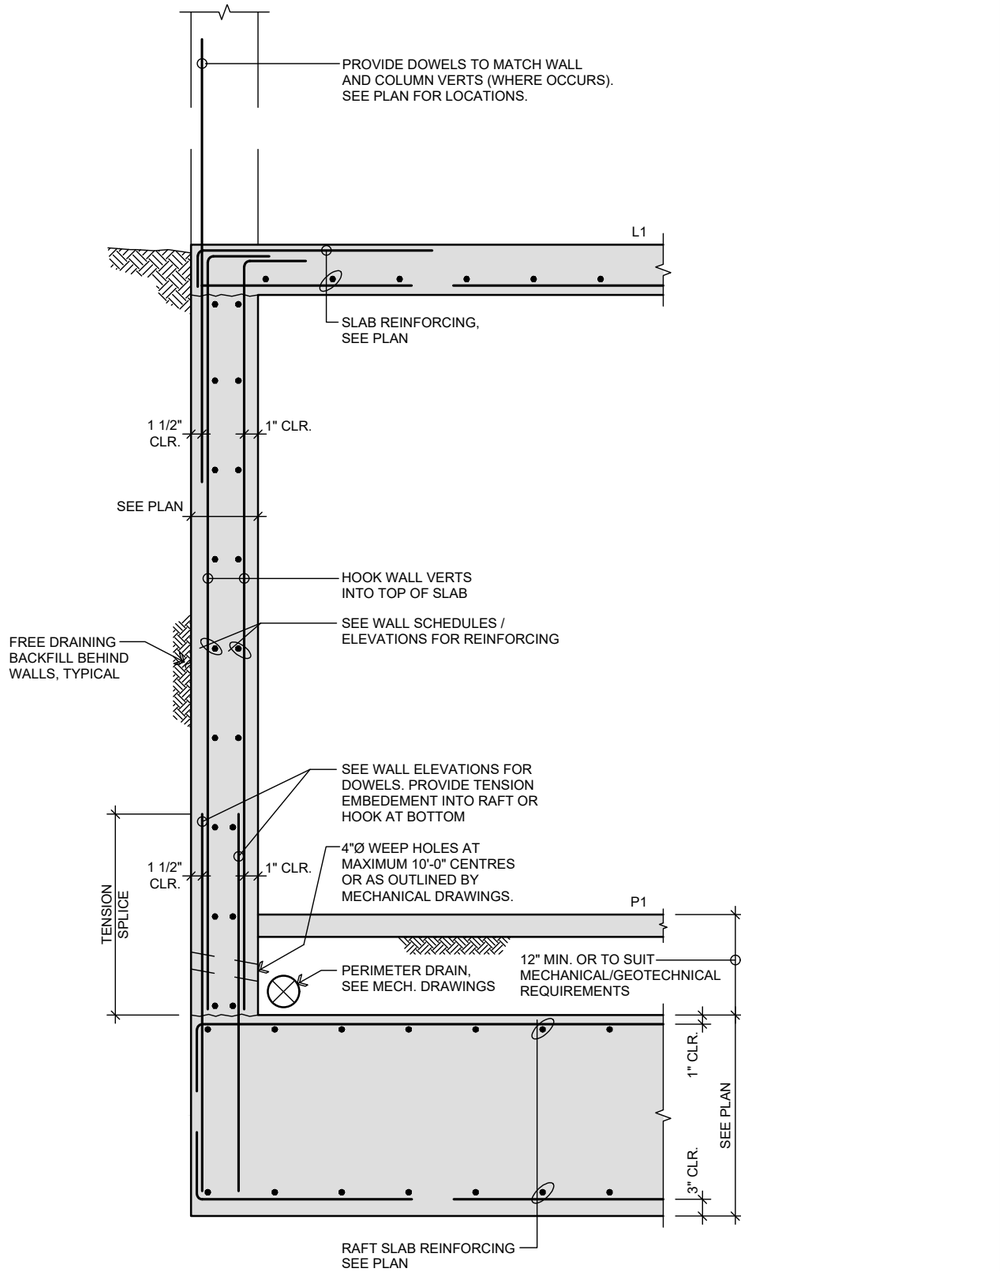

Revit template

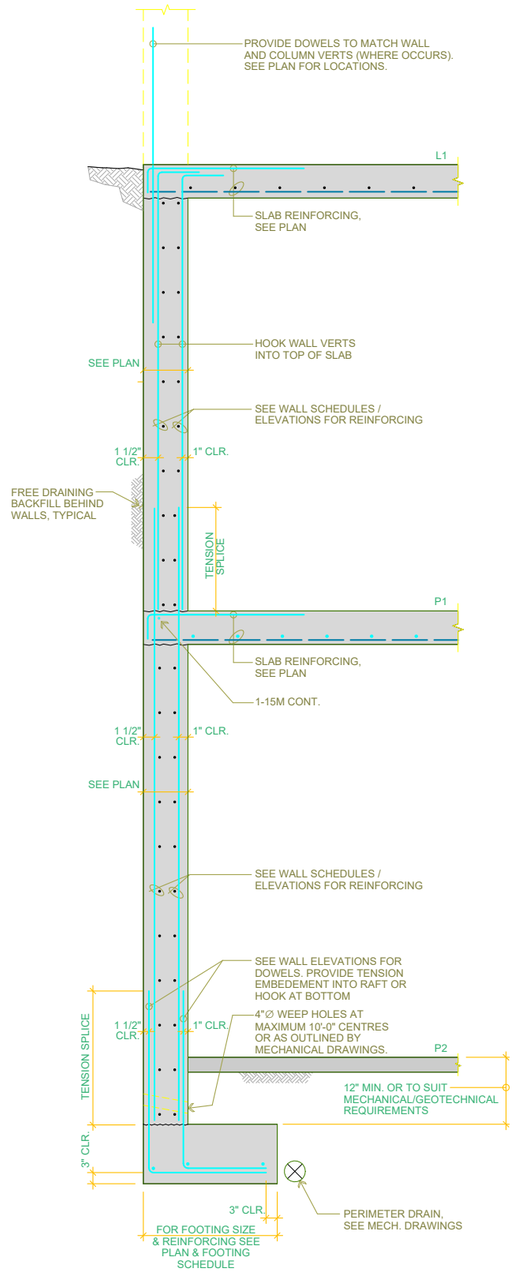

What differs: Single-storey basement wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 04 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

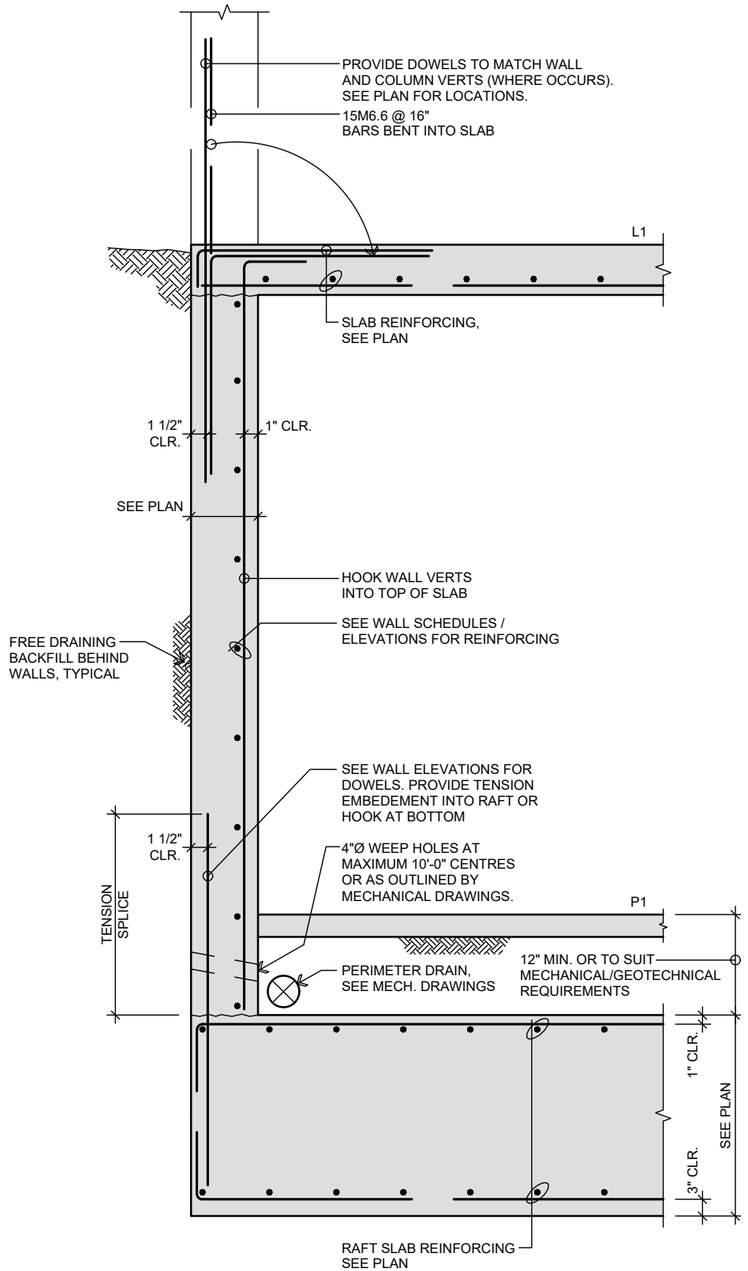

Revit template

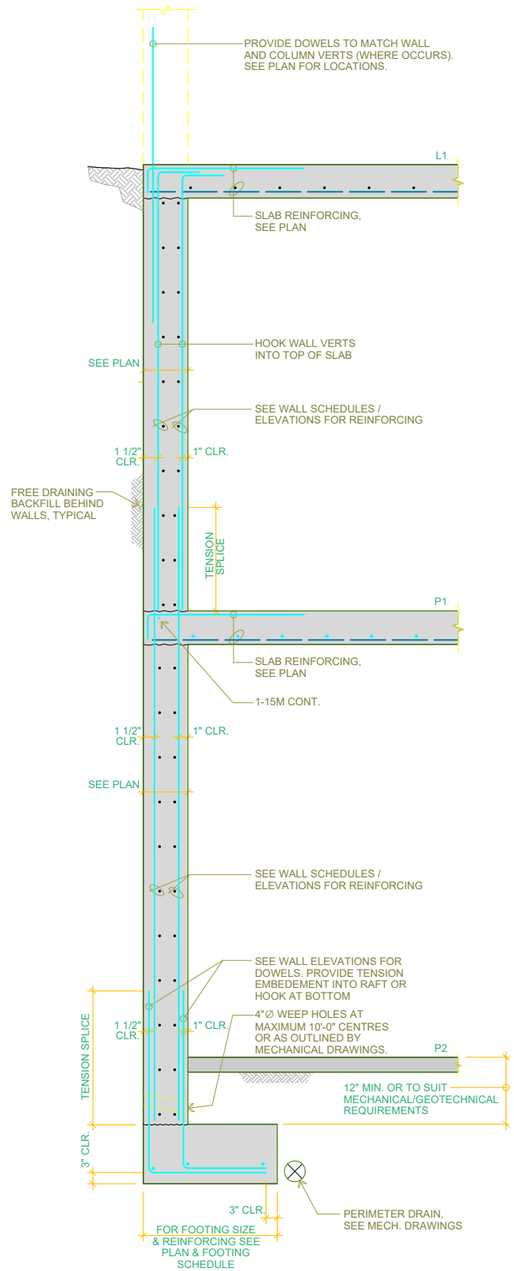

What differs: Single-storey basement wall on raft with slab dowel callout; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 05 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

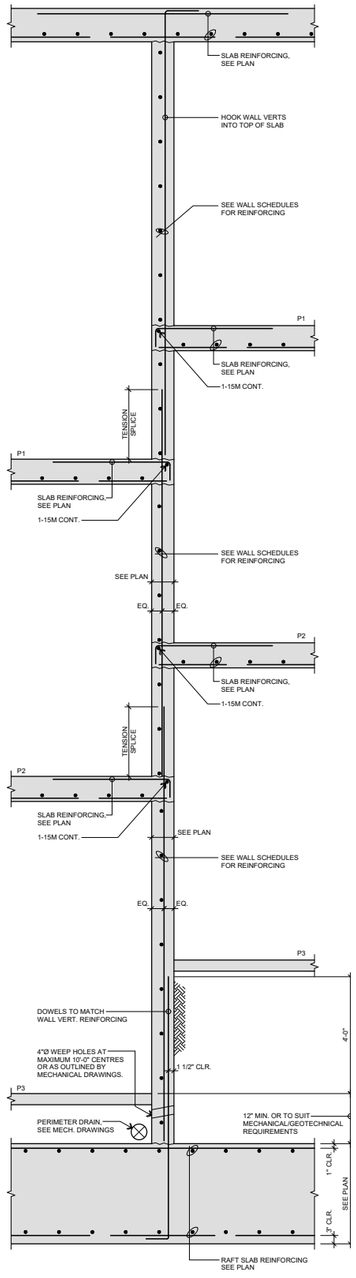

Revit template

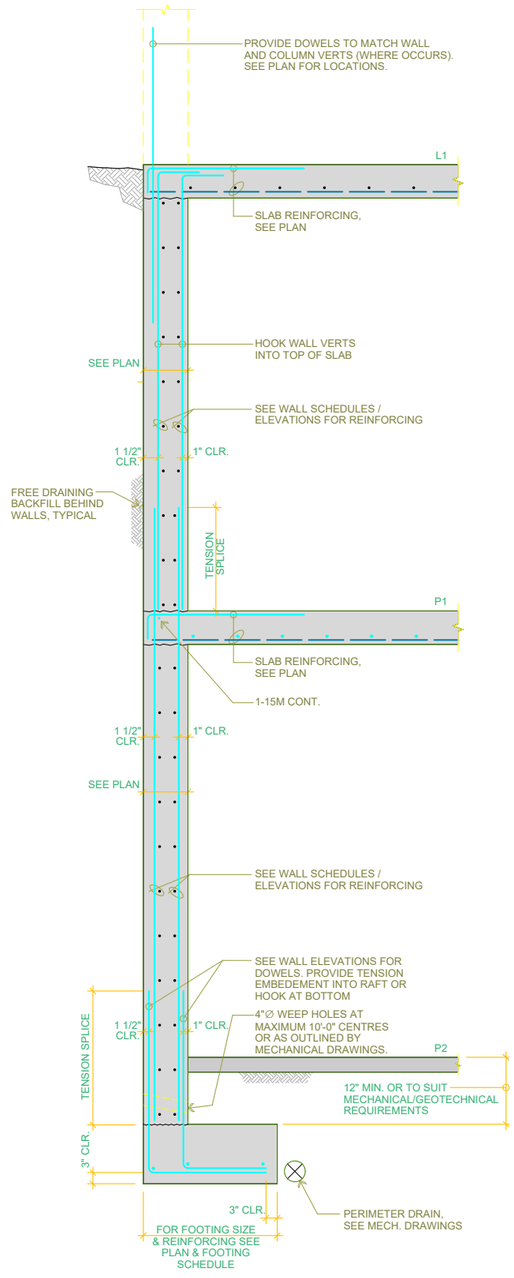

What differs: Tall multi-storey wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 06 - BASEMENT WALL SECTION


Revit: D3.01_1_BASEMENT WALL SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D3.01 Series 3 Basement)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

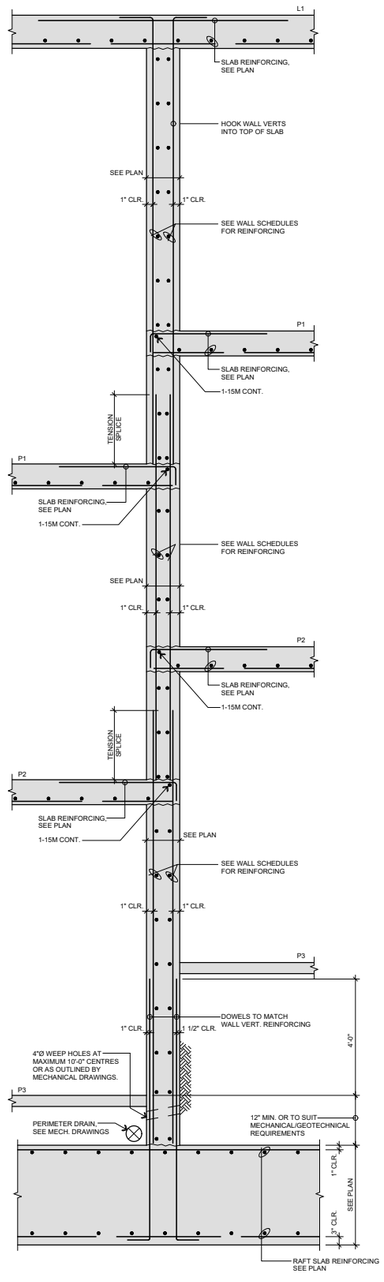

Revit template

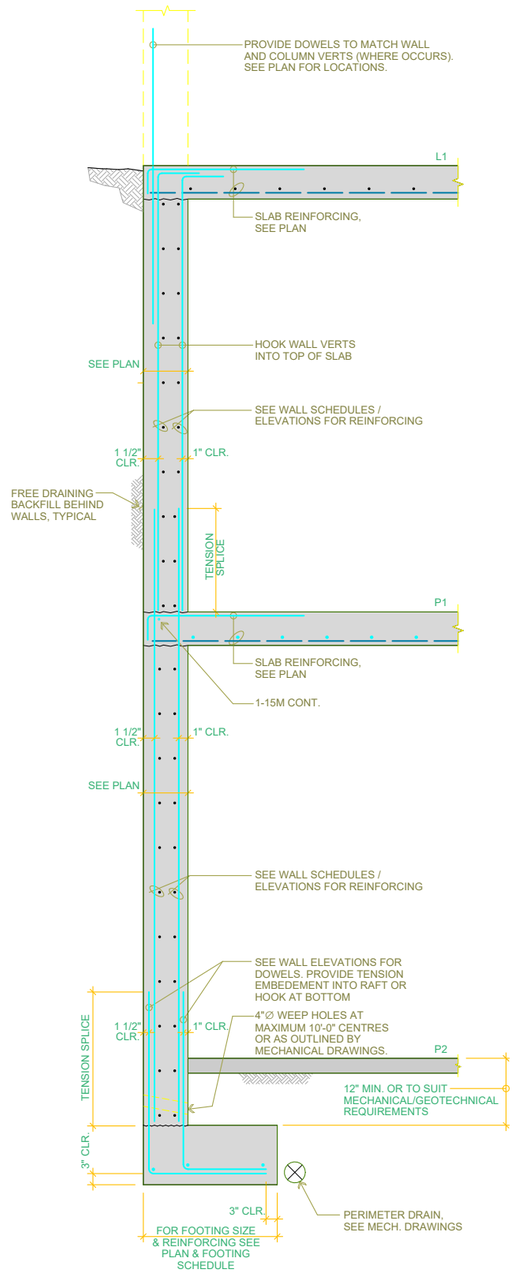

What differs: Tall multi-storey wall on raft; 'D3.01_1_BASEMENT WALL SECTION' is three levels on strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 07 - BASEMENT WALL SECTION


Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

In the new file: REPLACED. This was your view on S5.05 position 1; KOR-D301-DET 07 now sits there. If Revit is newer, yours goes back.

CAD (master)

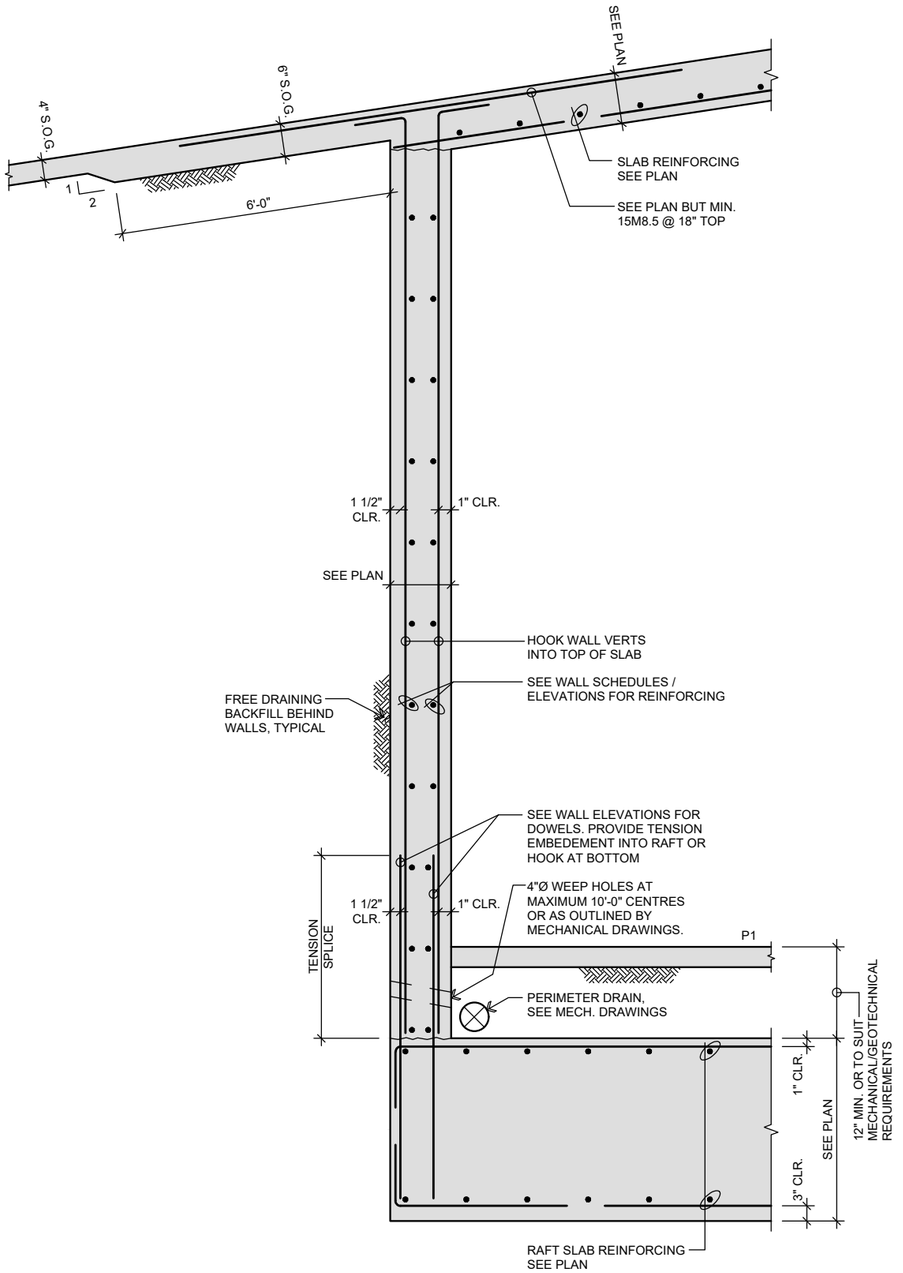

Revit template

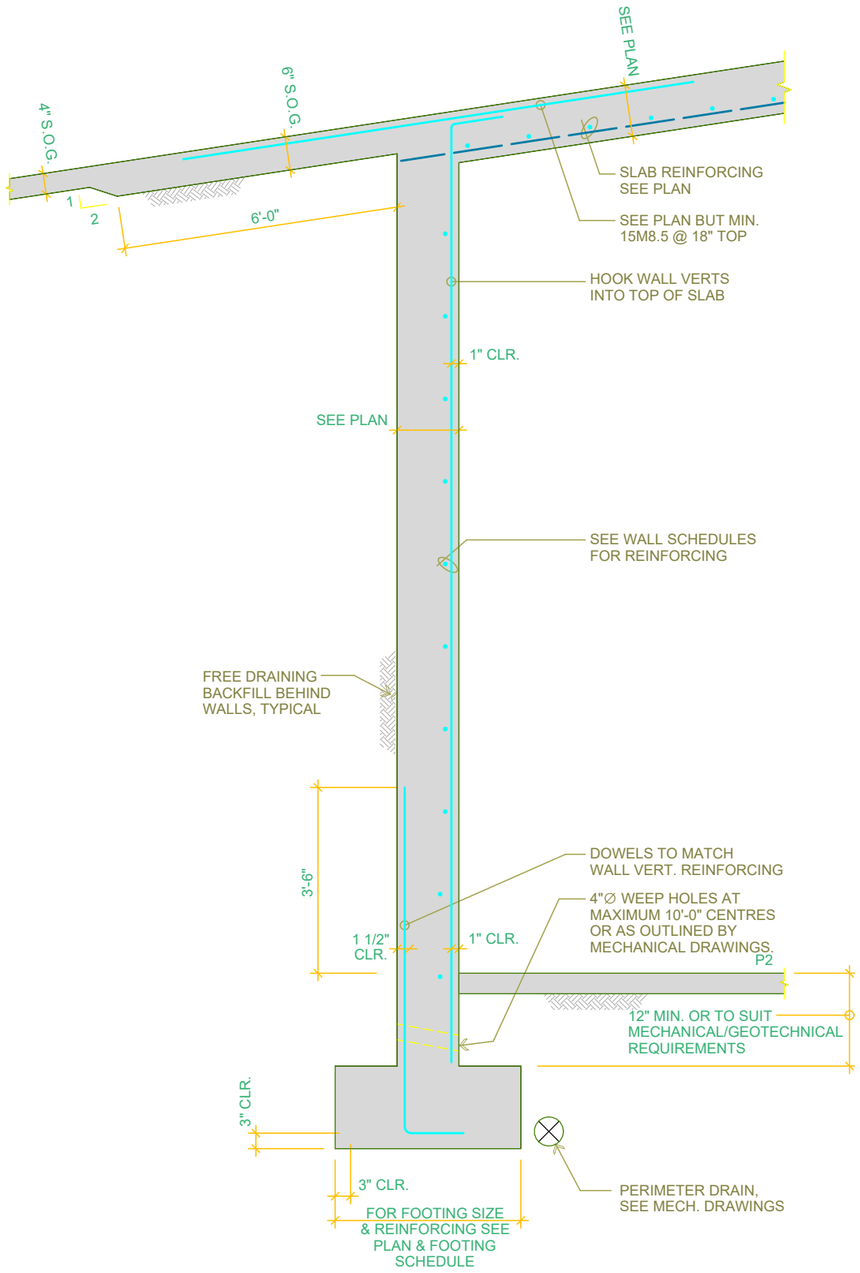

What differs: Wall with sloped slab over as 'S5.05_1_BASEMENT WALL DETAIL' but bearing on a raft rather than a strip footing.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D302-DET 08 - BASEMENT WALL SECTION


Revit: S5.05_1_BASEMENT WALL DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S5.05 BASEMENT WALL DETAILS)

In the new file: REPLACED. This was your view on S5.05 position 1; KOR-D301-DET 07 now sits there. If Revit is newer, yours goes back.

CAD (master)

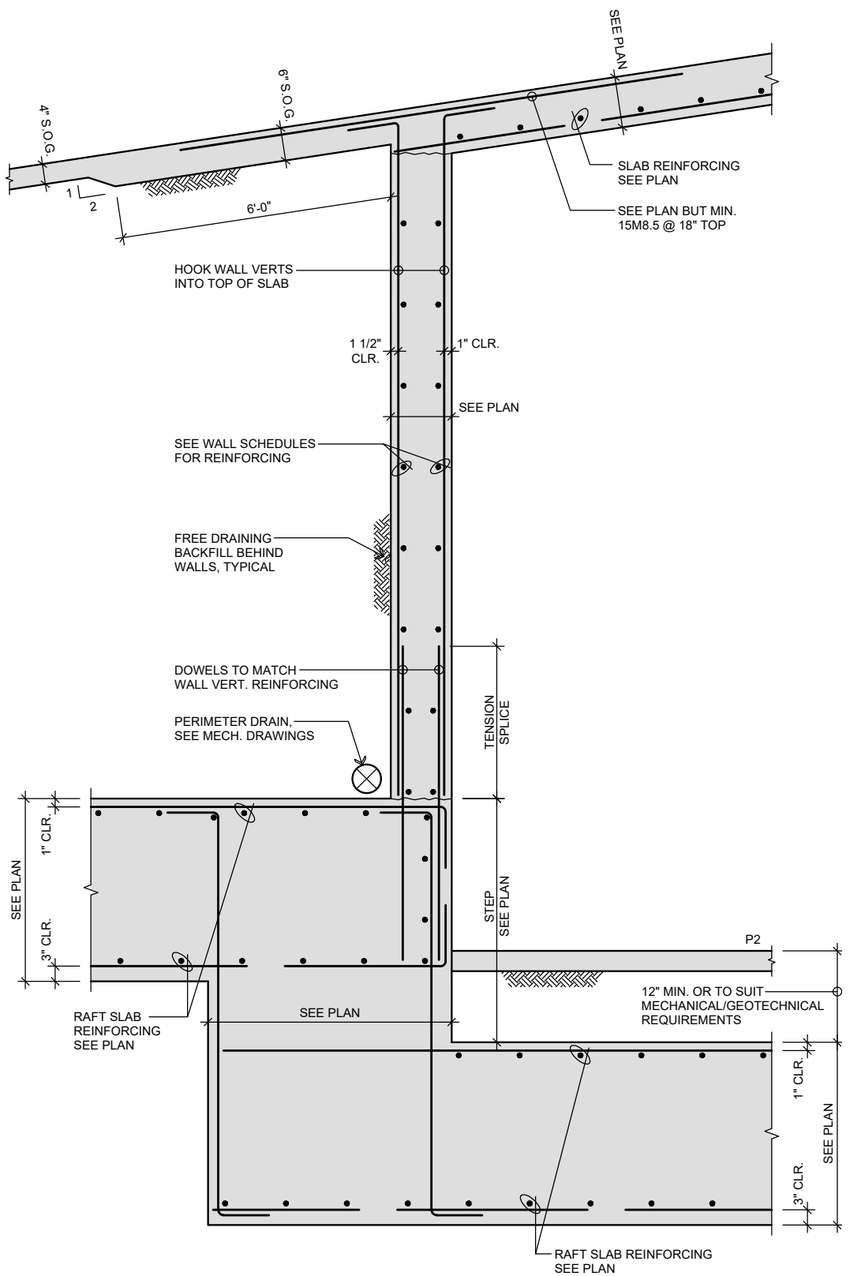

Revit template

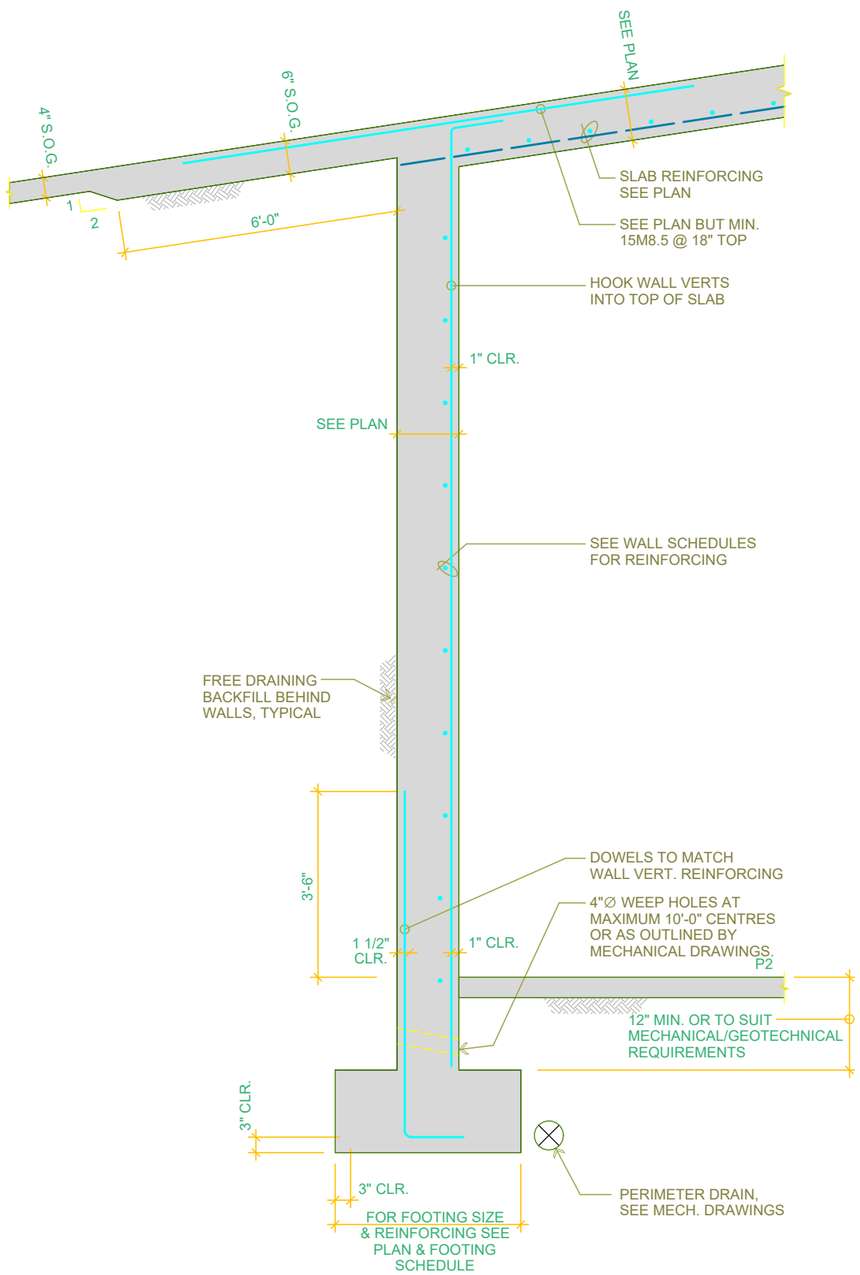


What differs: Wall with sloped slab over as 'S5.05_1_BASEMENT WALL DETAIL' but ending in a stepped raft rather than a strip footing.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

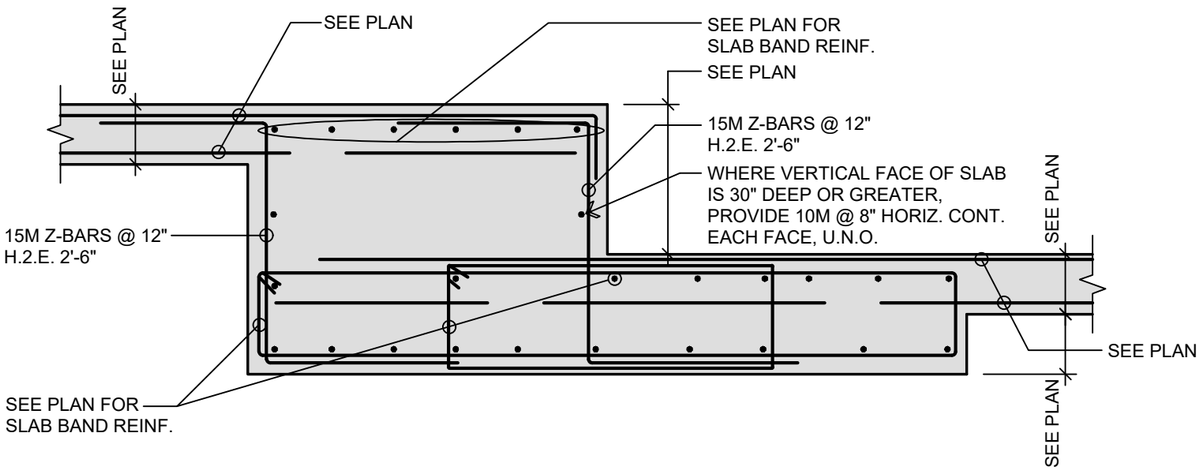

Revit template

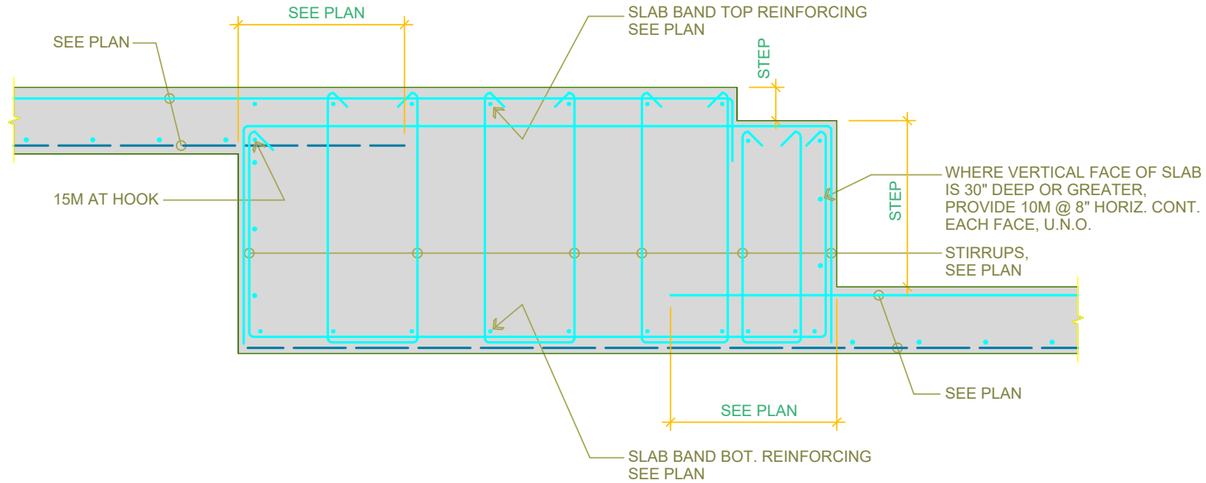

What differs: Slab band step reinforced with 15M Z-bars rather than 'D4.01_1_STEP SECTION''s stirrups and hooks.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D401-DET 04 - STEP SECTION


Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

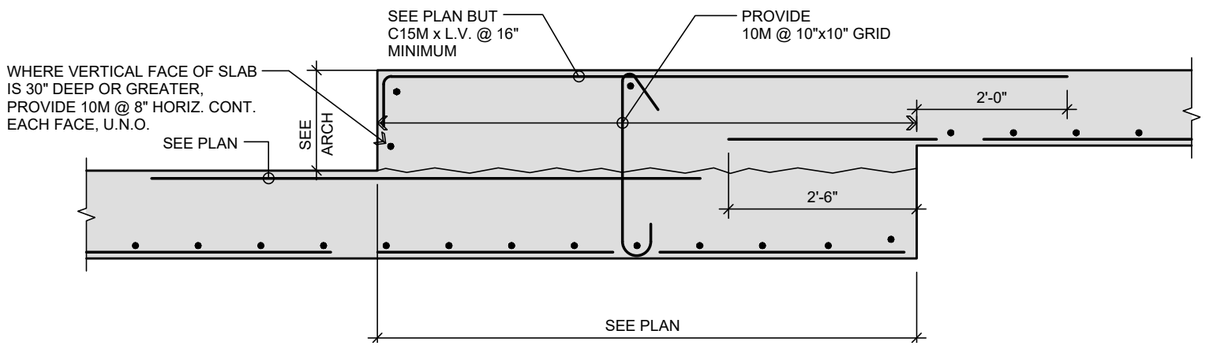

Revit template

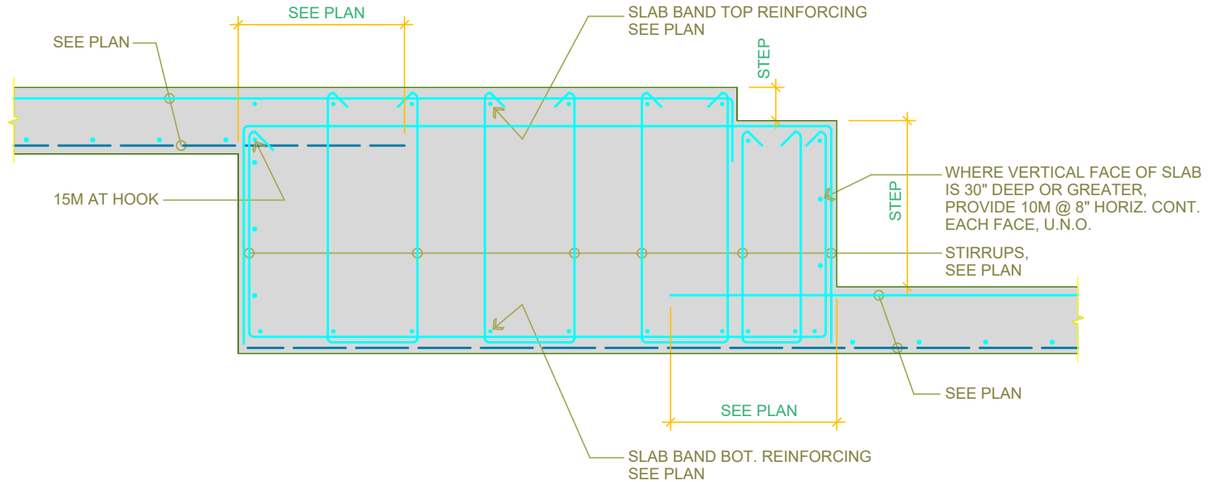

What differs: Top step built as a second pour with 10M grid dowel plus soffit step; 'D4.01_1_STEP SECTION' is a stirruped slab band step - closest only by purpose.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D401-DET 05 - STEP SECTION


Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

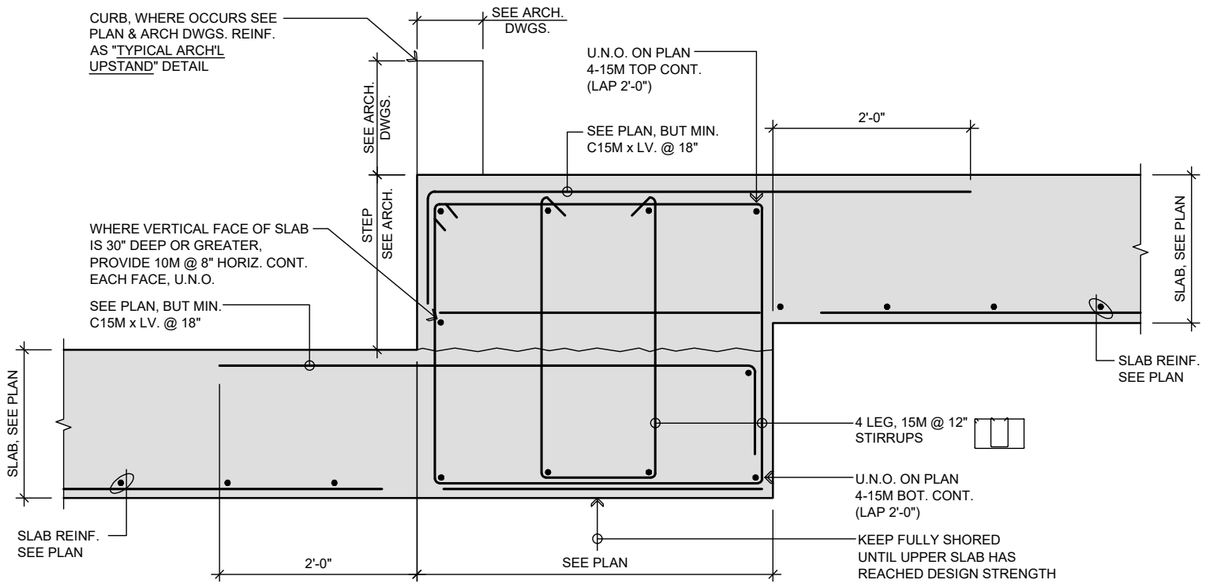

Revit template

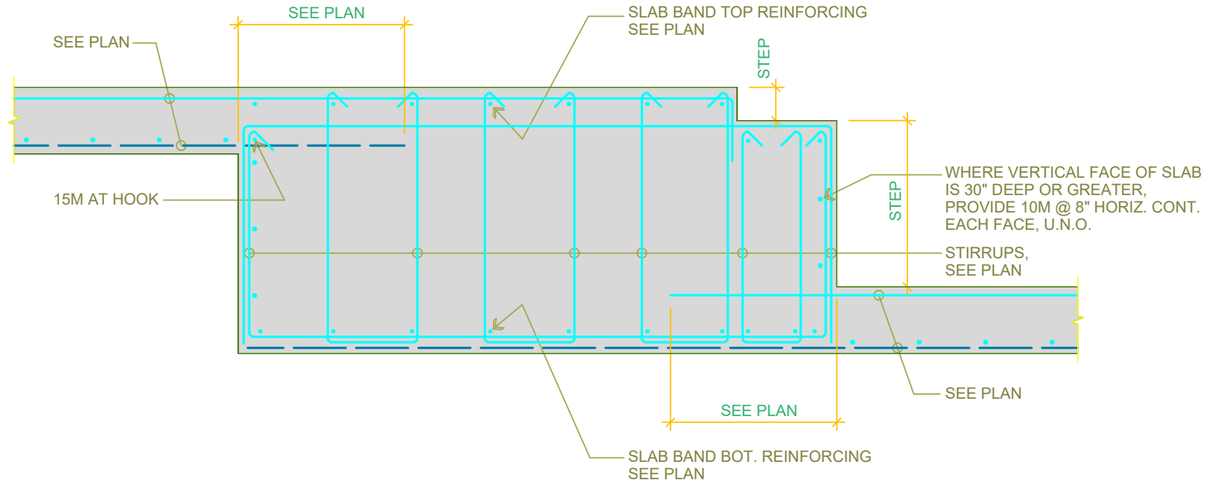

What differs: Step with curb and 4-leg stirruped beam at the step; 'D4.01_1_STEP SECTION' differs in geometry and bars.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D401-DET 06 - STEP SECTION


Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

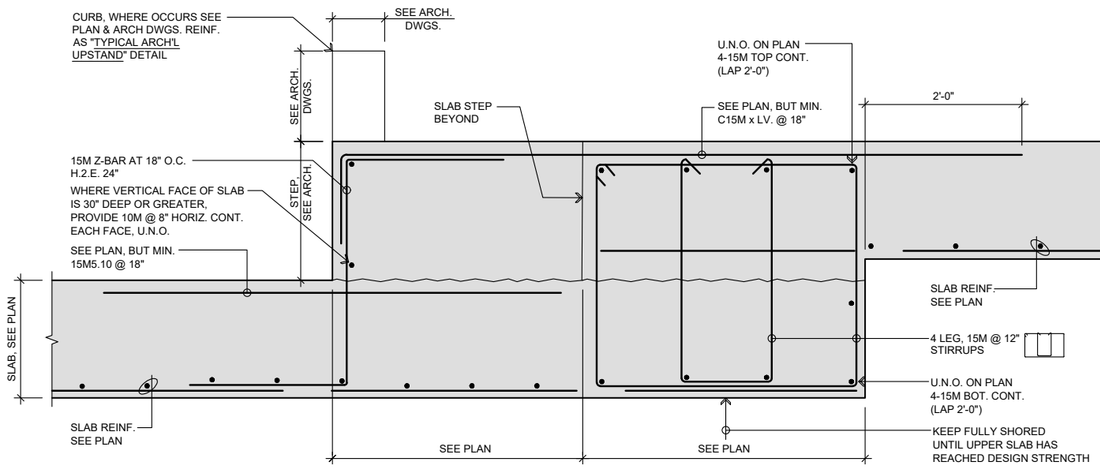

Revit template

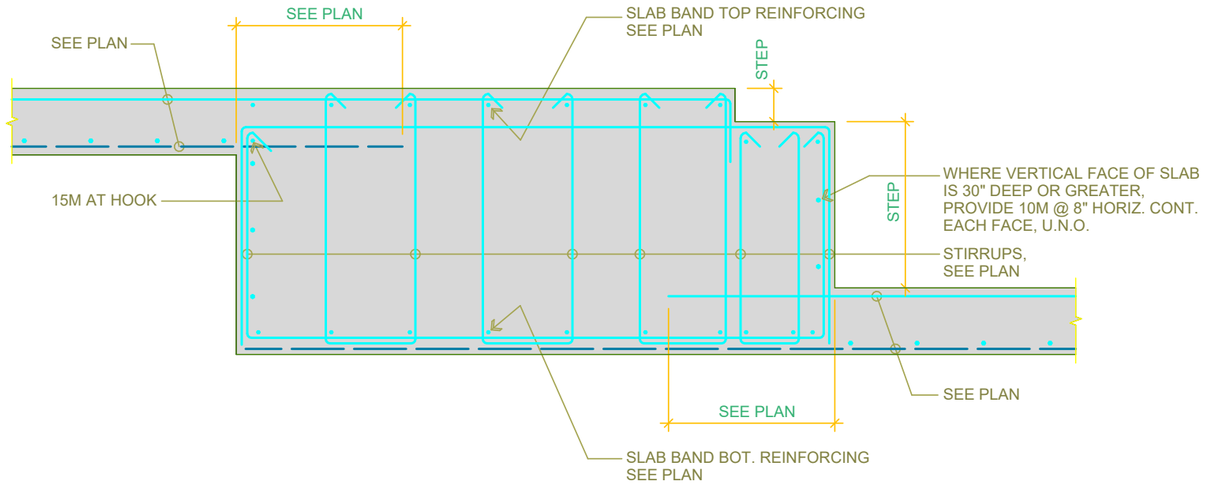


What differs: Step with curb, slab step beyond and stirruped beam; 'D4.01_1_STEP SECTION' differs in geometry and bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D5.01_8_SOFFIT STEP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

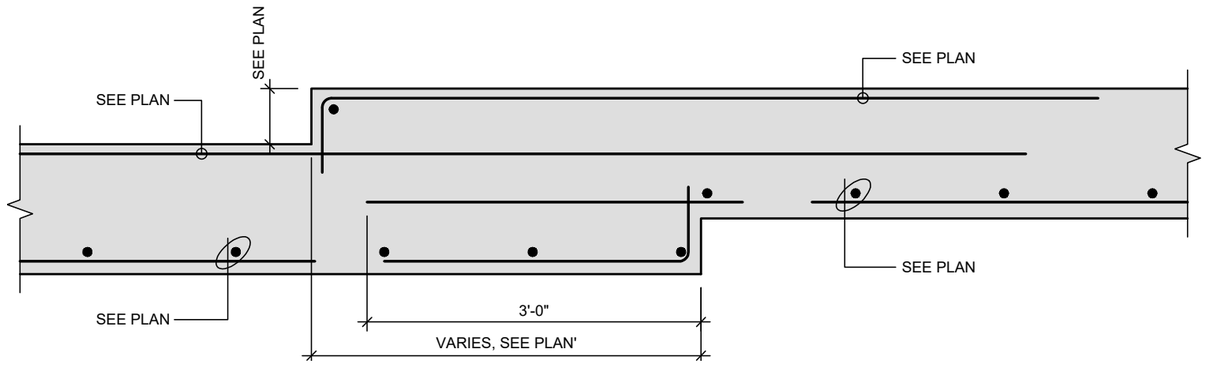

Revit template

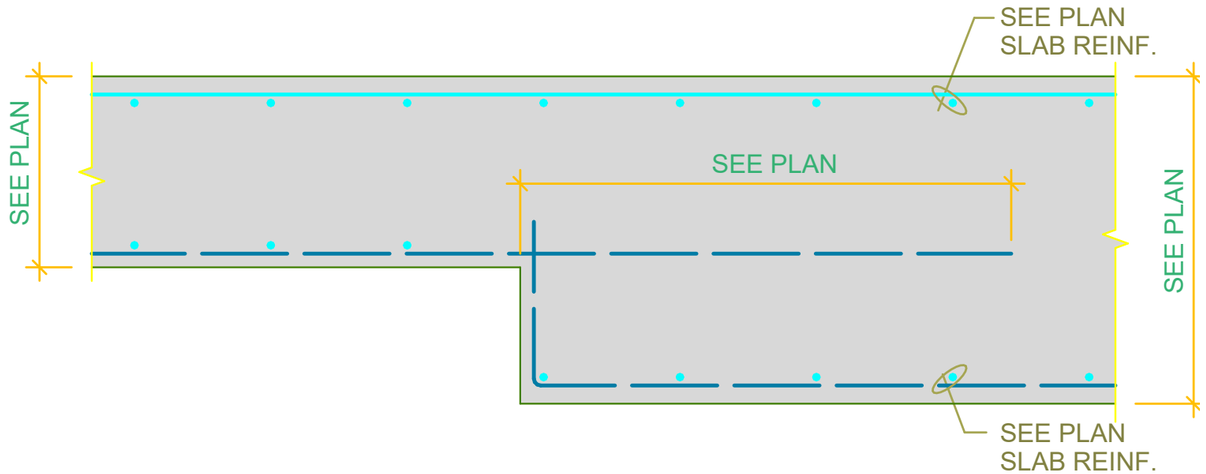

What differs: Combined top step and offset soffit step with hooked bottom bars; 'D5.01_8_SOFFIT STEP DETAIL' has the soffit step only.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D401-DET 08 - STEP SECTION


Revit: D4.01_1_STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

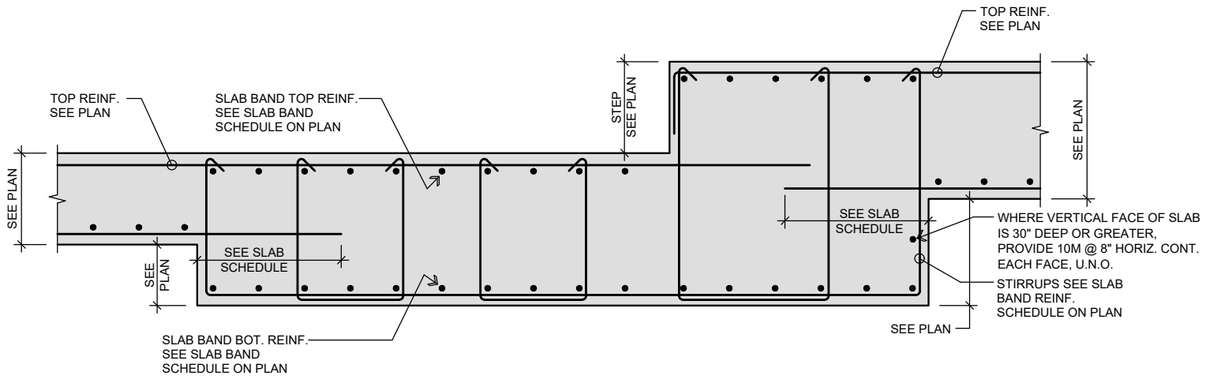

Revit template

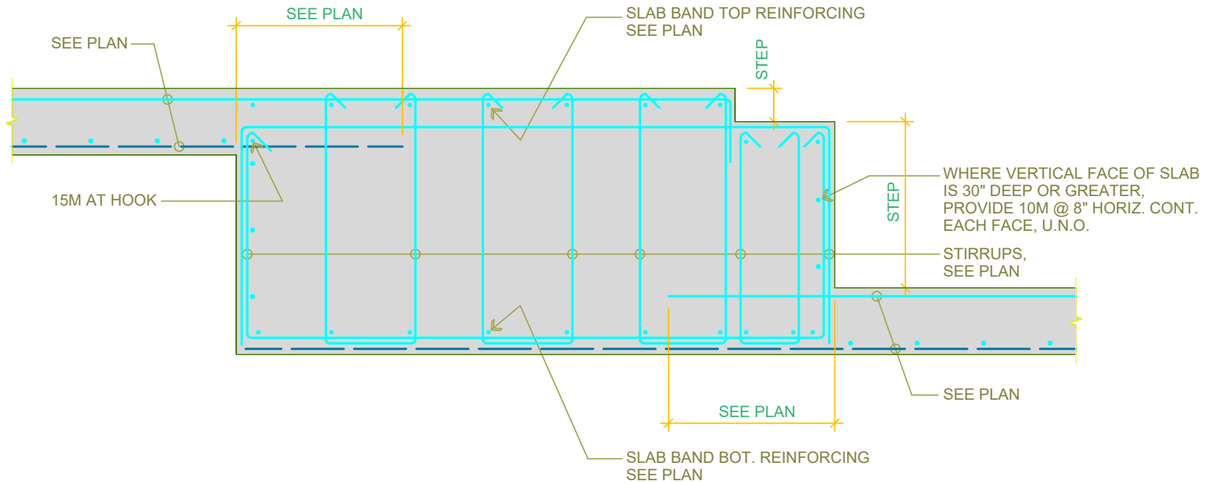

What differs: Slab band stepped on both sides with stirrups through; 'D4.01_1_STEP SECTION' is a single-side step.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D401-DET 10 - SOFFIT AND STEP SECTION


Revit: D4.01_9_SOFFIT STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

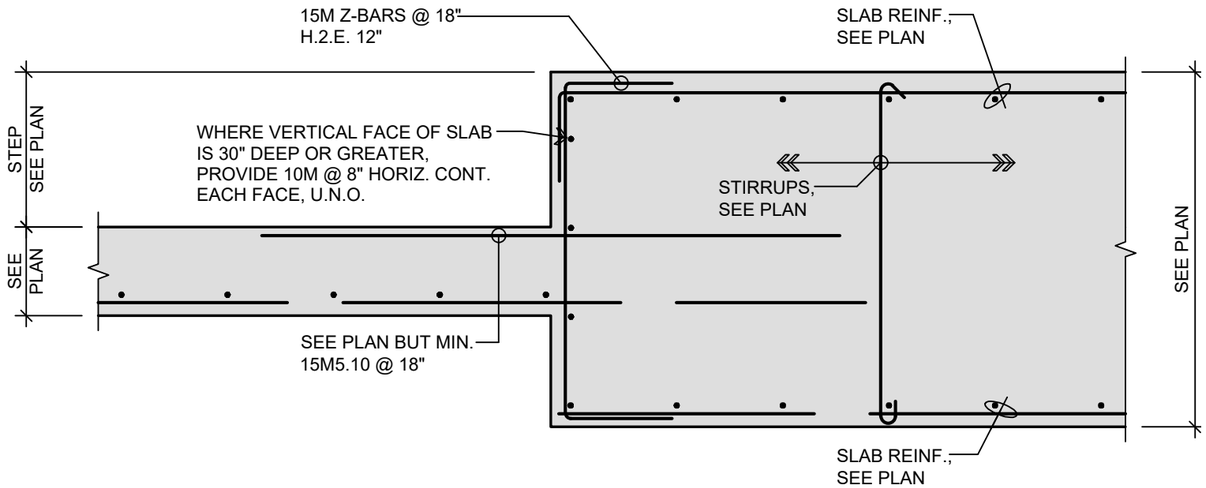

Revit template

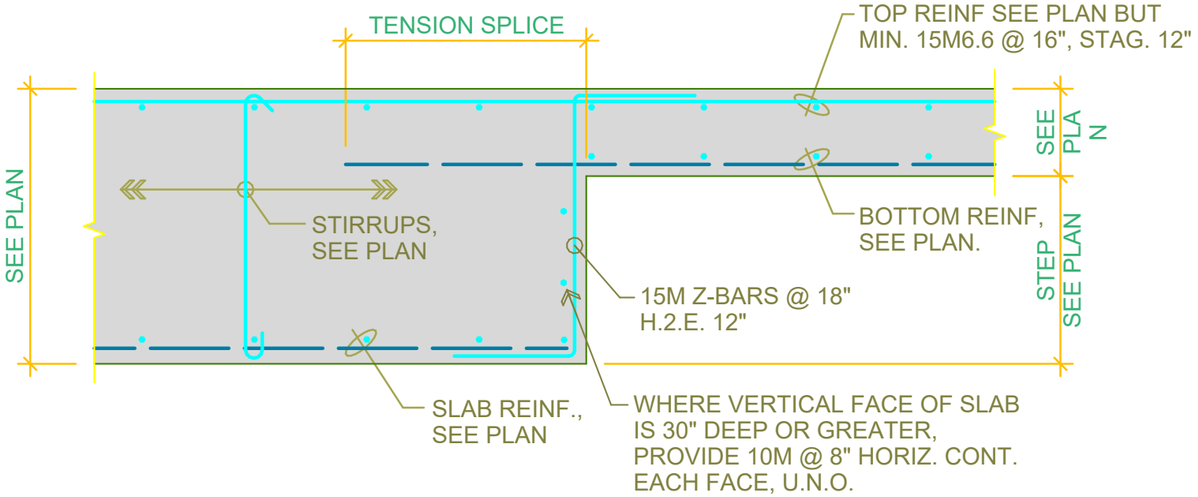


What differs: Soffit step combined with a top step (band higher than slab) using Z-bars; 'D4.01_9_SOFFIT STEP SECTION' has the soffit step only.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D4.01_9_SOFFIT STEP SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D4.01 Series 4 Step Deta)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

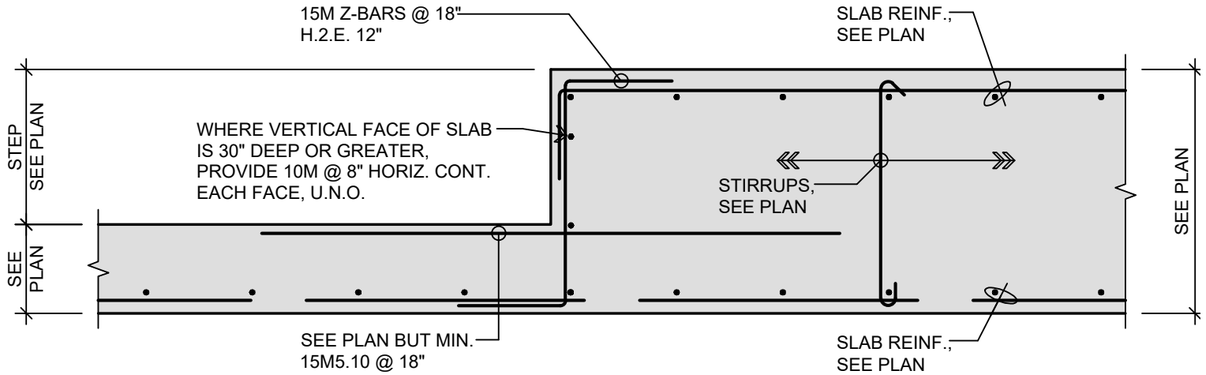

Revit template

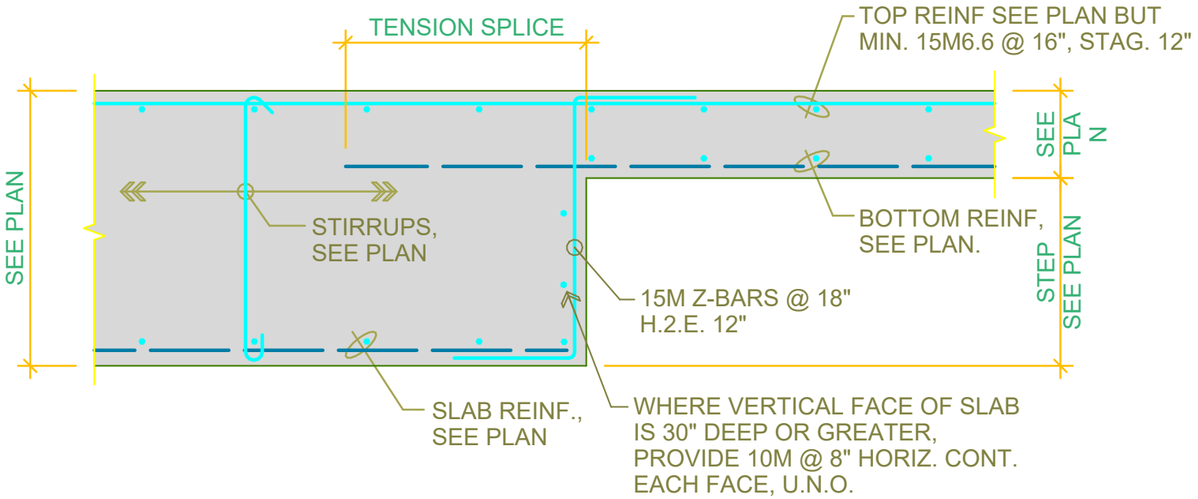

What differs: Drawing identical to D401-DET 10: soffit step plus top step; 'D4.01_9_SOFFIT STEP SECTION' shows the soffit step only.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D501-DET 05 - RAMP DETAIL


Revit: D5.01_4_RAMP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

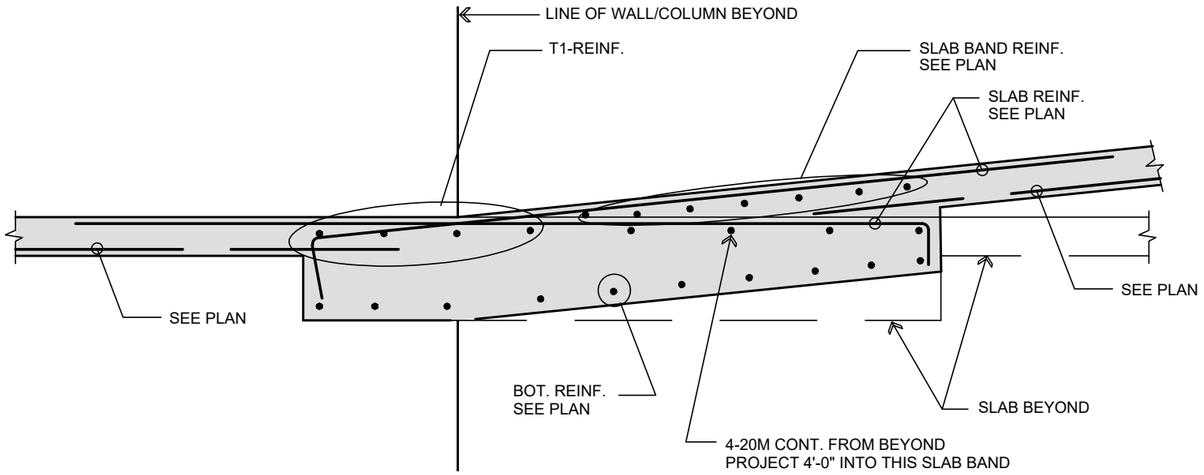

Revit template

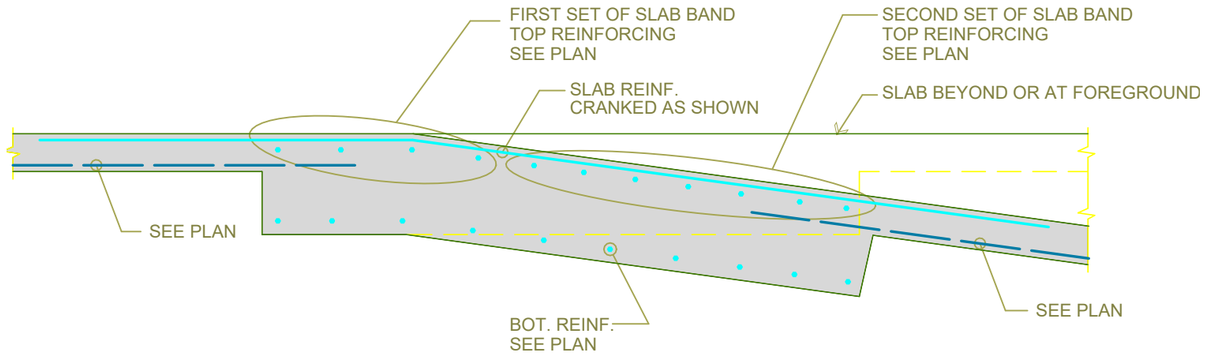


What differs: Ramp rising into slab band with 4-20M cont. bars and wall line beyond; 'D5.01_4_RAMP DETAIL' ramps down with a cranked second set of top bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D5.01_4_RAMP DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

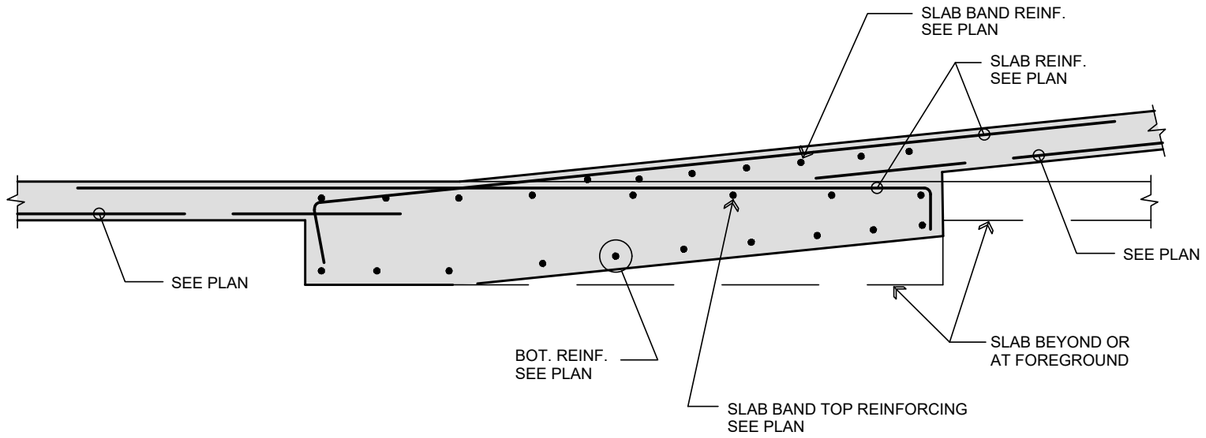

Revit template

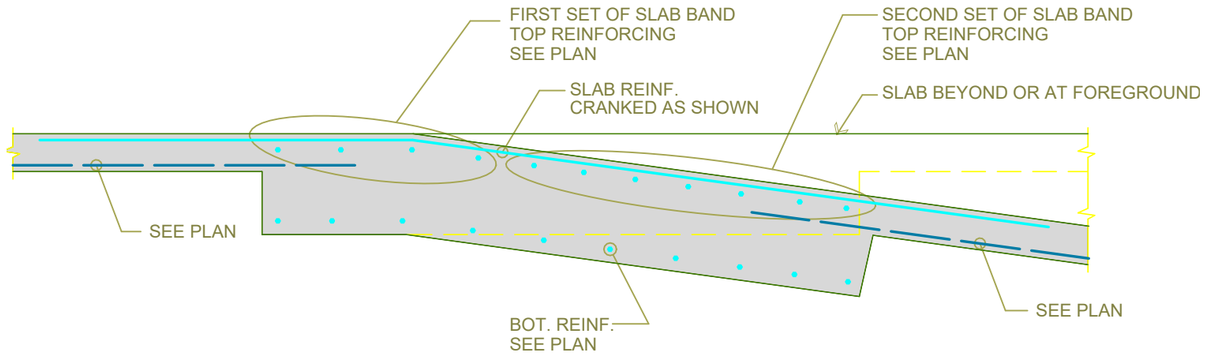

What differs: Ramp rising into slab band without 'D5.01_4_RAMP DETAIL"s cranked second set of top bars.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D501-DET 14 - LOAD BEARING STEEL GRATING SECTION


Revit: D5.01_13_LOAD BEARING STEEL GRATING SECTION (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

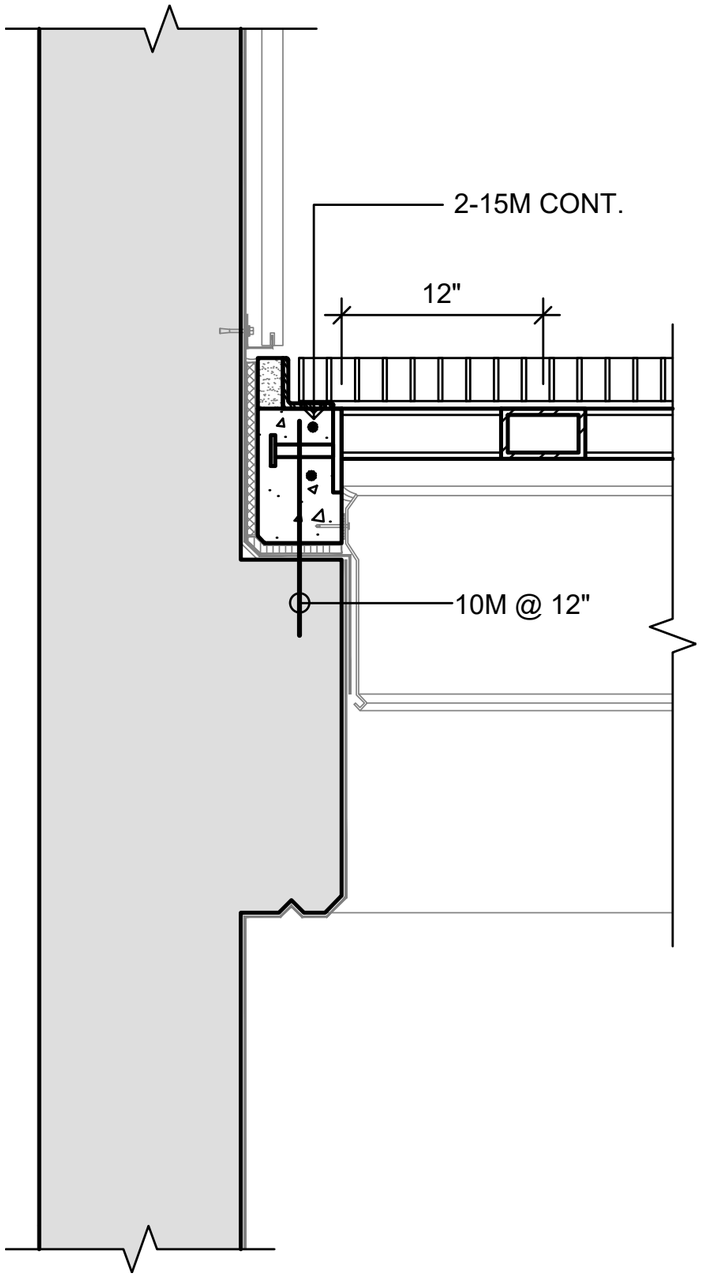

Revit template

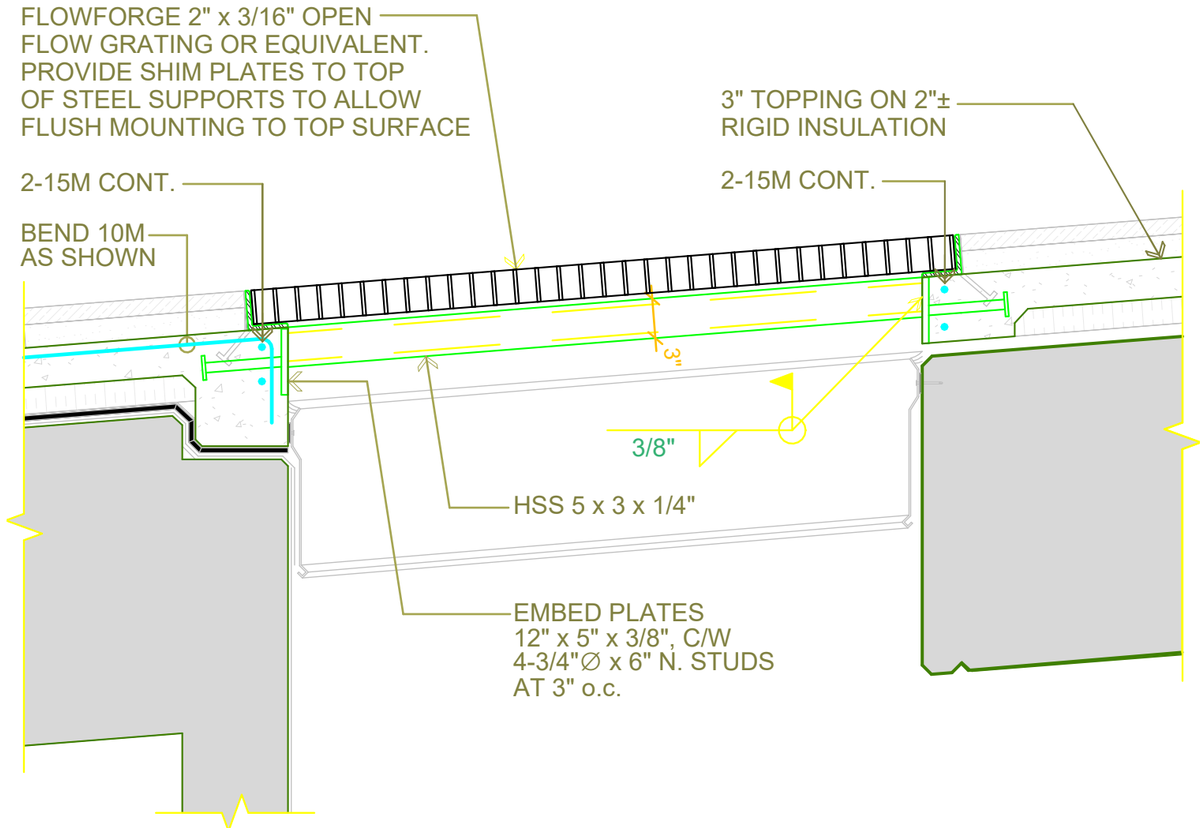

What differs: CAD is the grating support at a wall face with ledger and 10M dowels; 'D5.01_13_LOAD BEARING STEEL GRATING SECTION' is the grating spanning between slab edges.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D501-DET 18 - PENTHOUSE SPIRAL STEEL STAIR PLAN


Revit: D5.01_18_PENTHOUSE SPIRAL STEEL STAIR PLAN (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

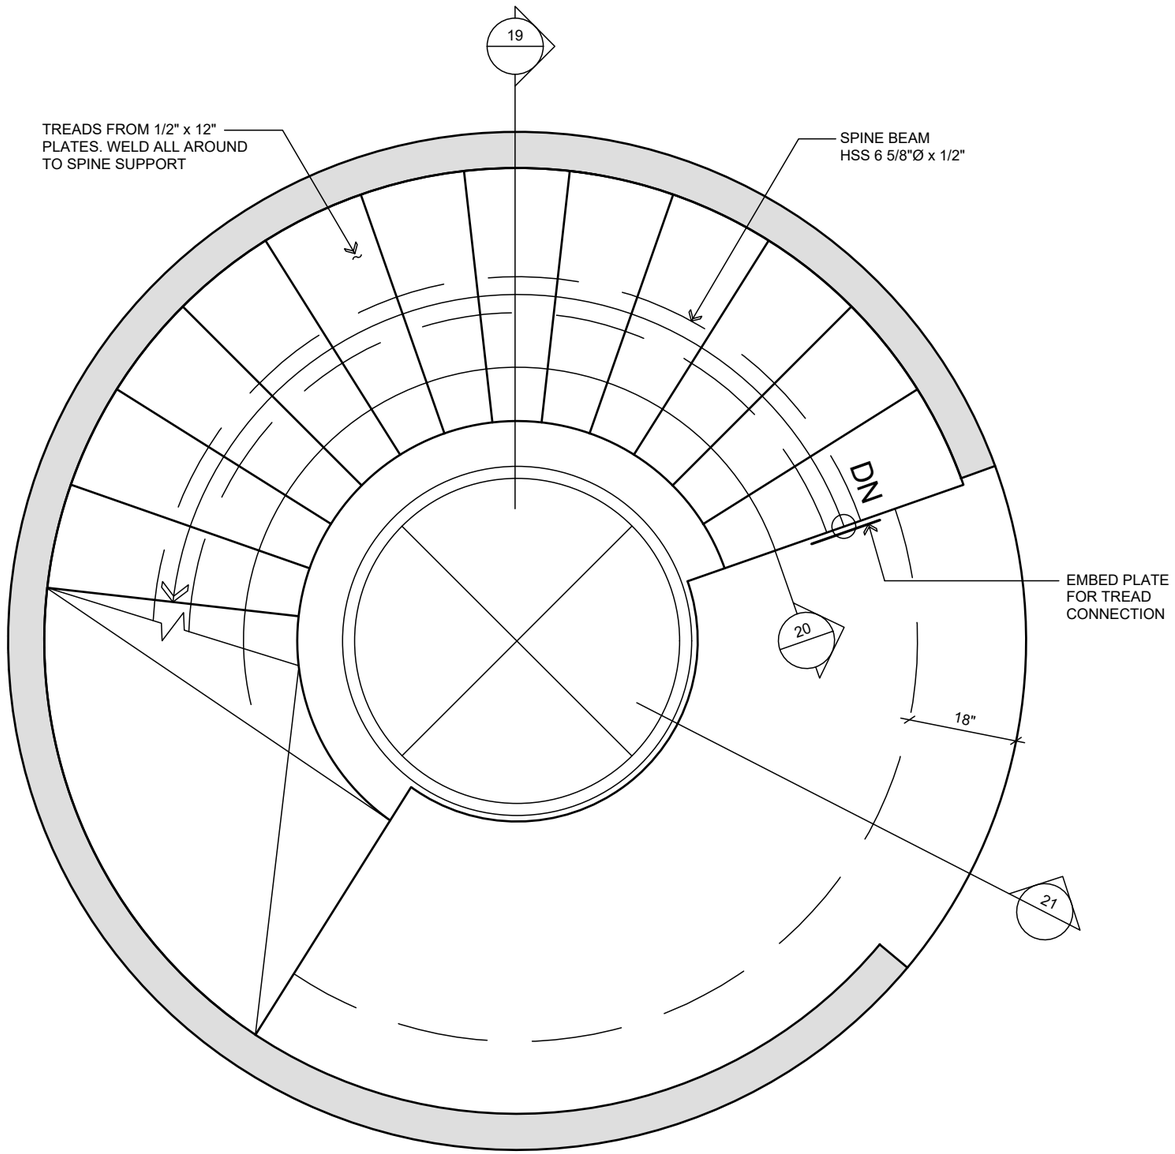

Revit template

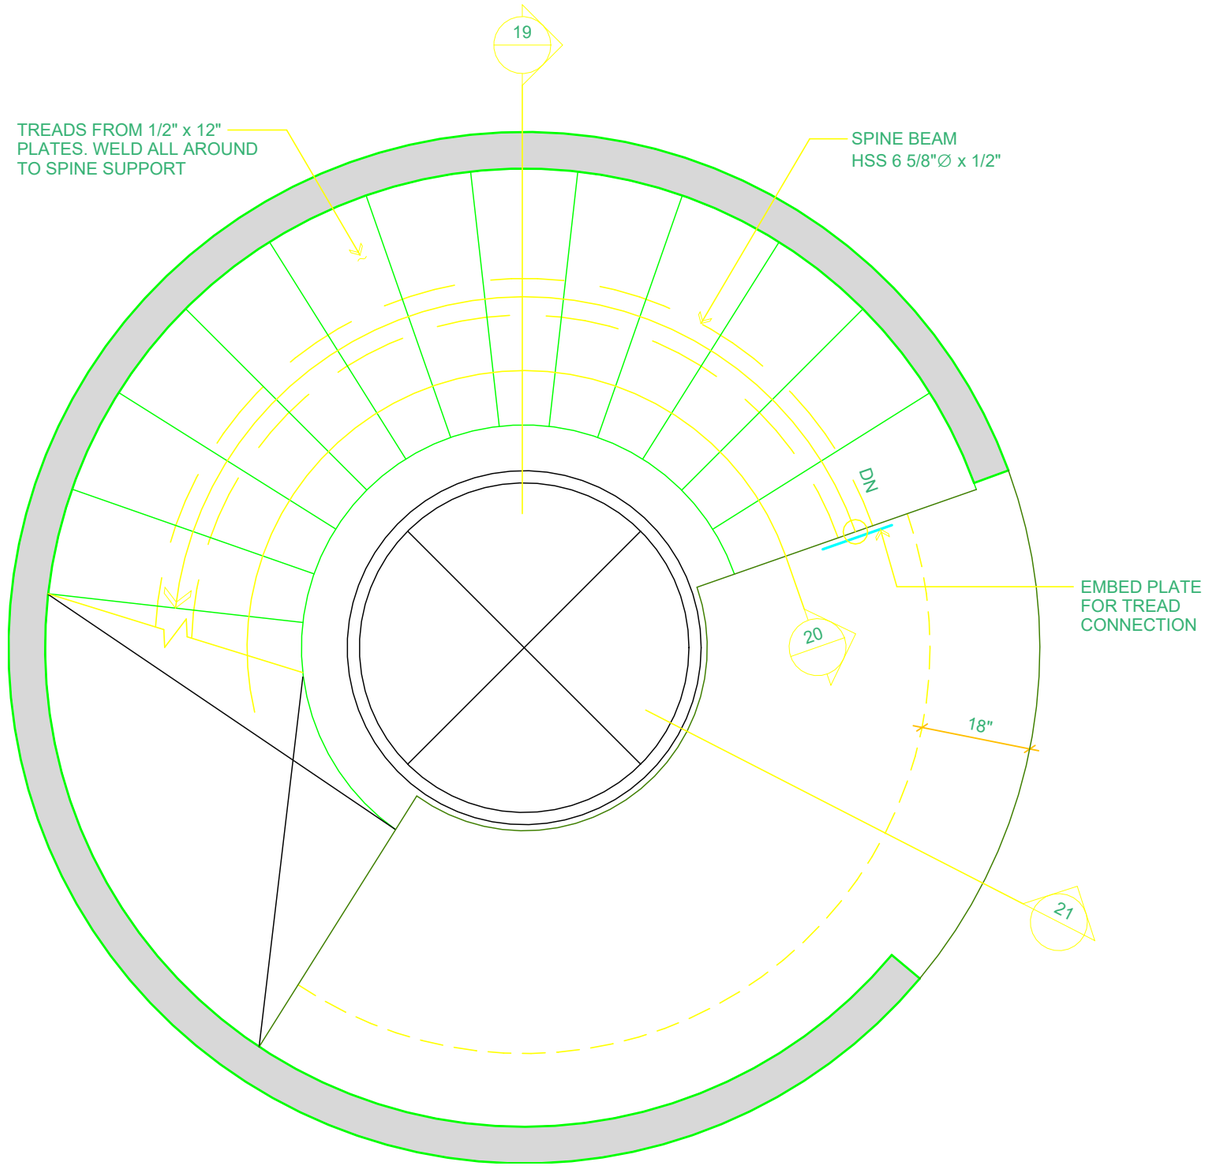


What differs: Same spiral stair plan content (treads, spine beam, embed plates) but CAD plan is drawn elliptical, Revit circular.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: D5.02_10_TYPICAL ON GRADE SLAB THICKENING (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

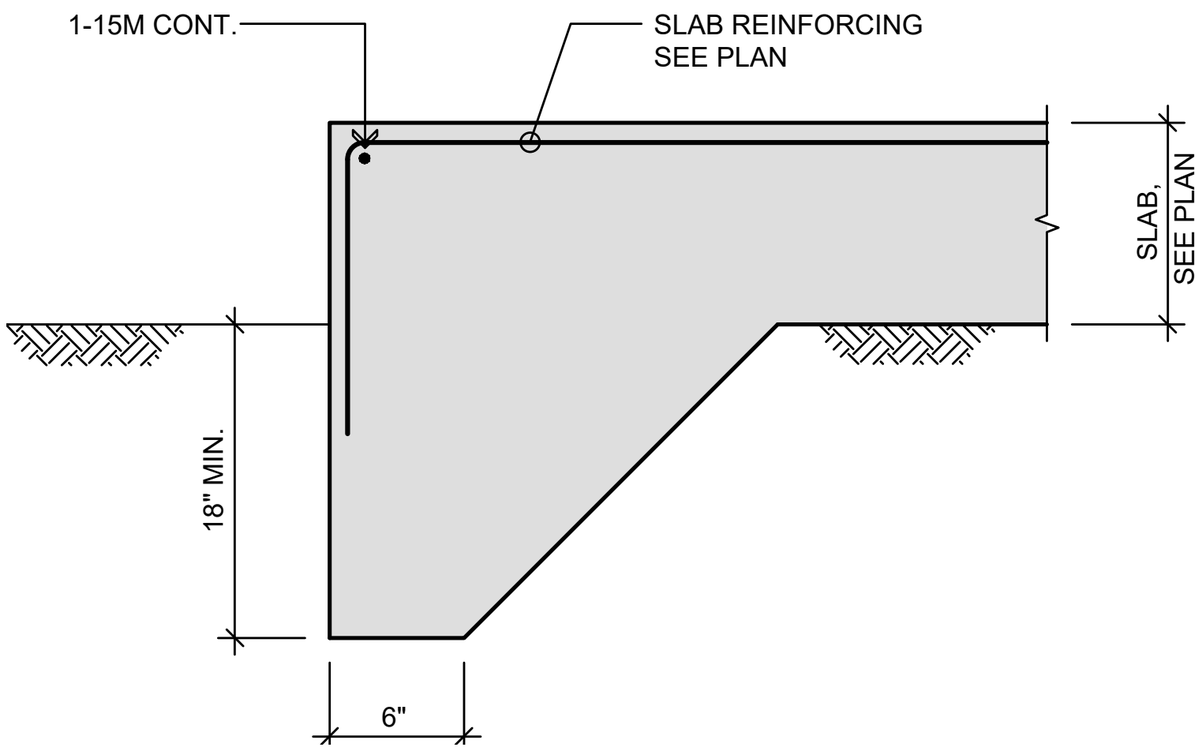

Revit template

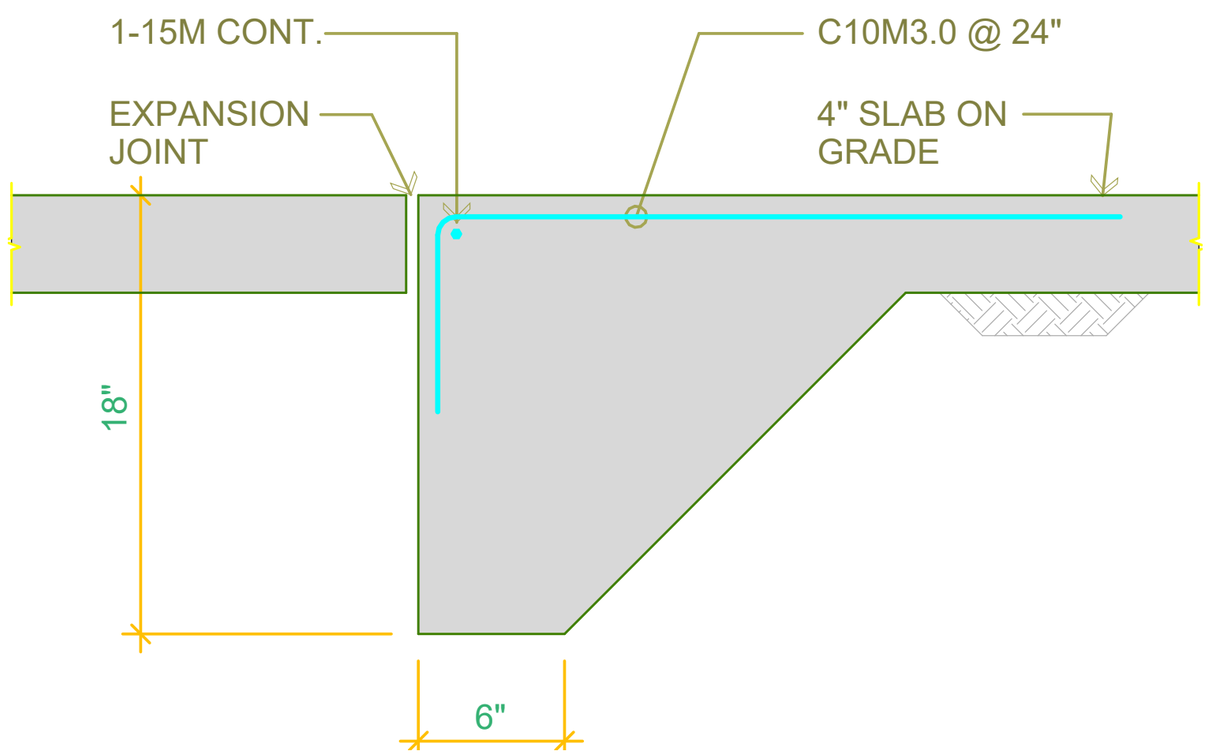

What differs: Thickened slab edge like 'D5.02_10_TYPICAL ON GRADE SLAB THICKENING' but no expansion joint/adjacent slab and different callouts.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D502-DET 12 - TYPICAL BUILT-UP SLAB UNO


Revit: 1E1.05_1_TYPICAL BUILT-UP SLAB (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

In the new file: YES, on 1E1.05. Both versions are in the file.

CAD (master)

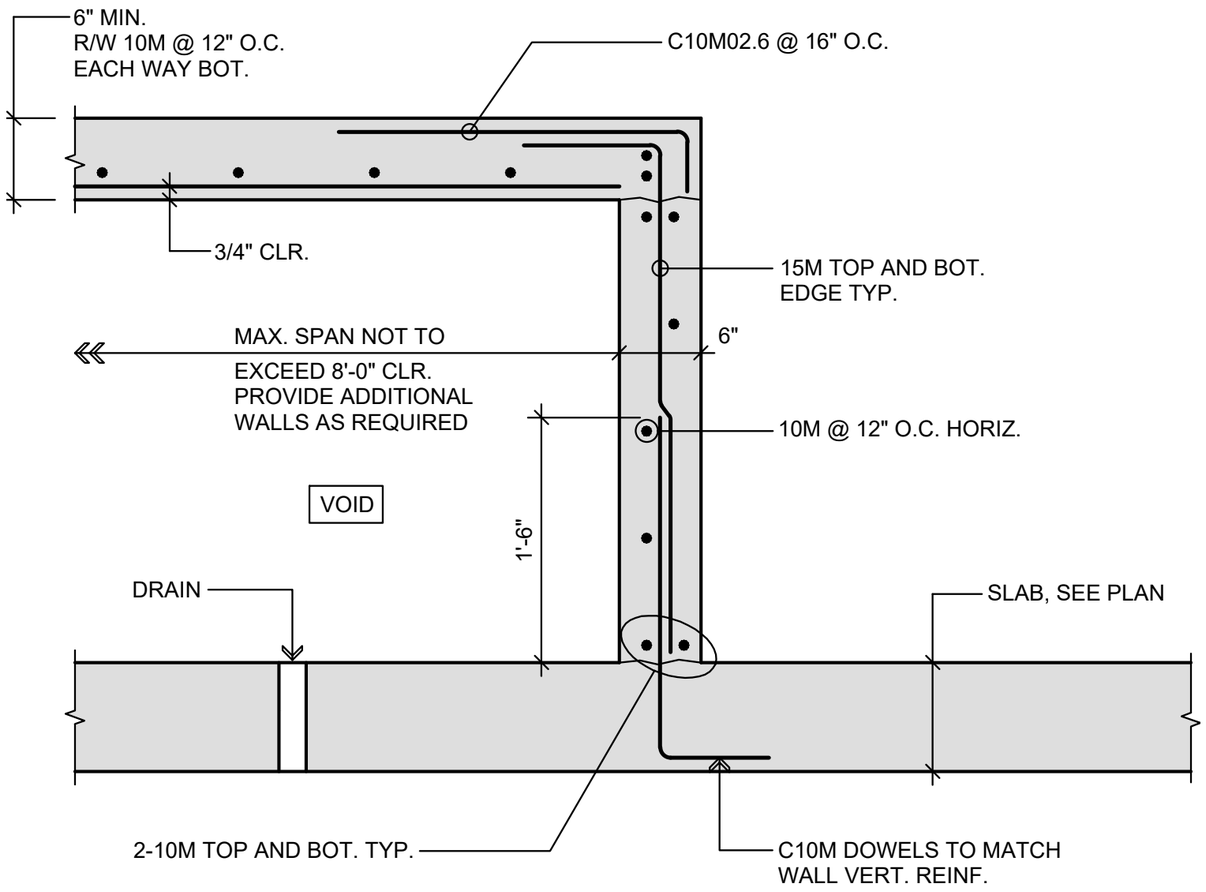

Revit template

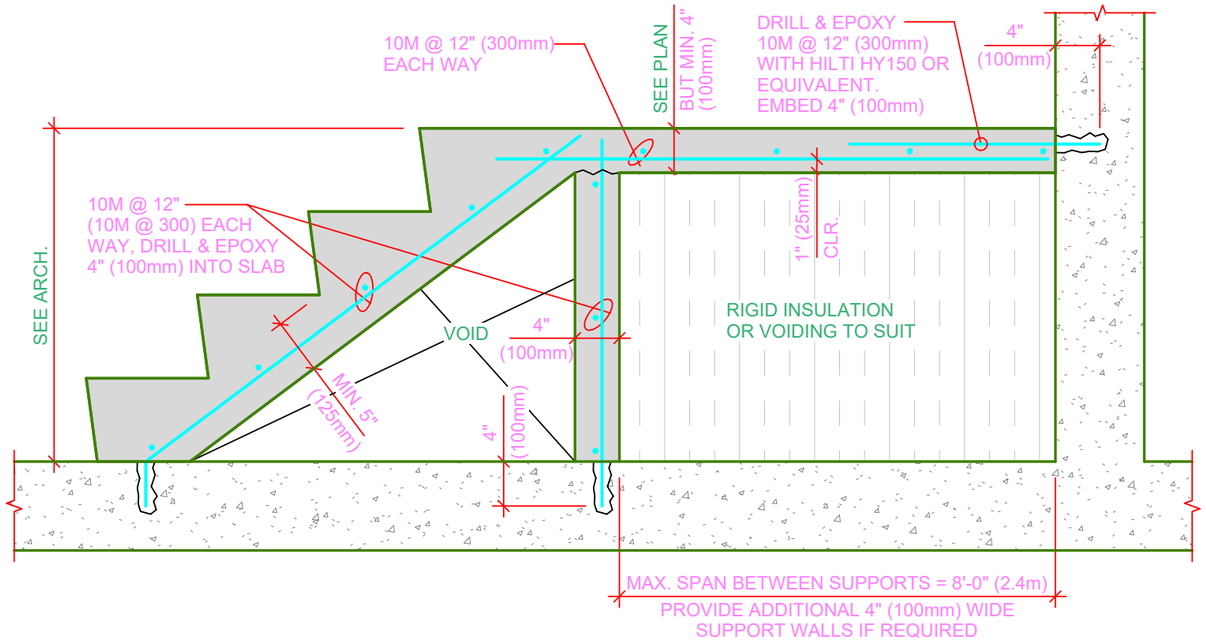

What differs: Both built-up slabs with void and max 8ft span support walls, but CAD is slab on walls with drain, Revit is stepped fill with insulation.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D502-DET 18 - POST-CAST CONCRETE BRICK LEDGER


Revit: D5.02_3_BRICK LEDGER DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

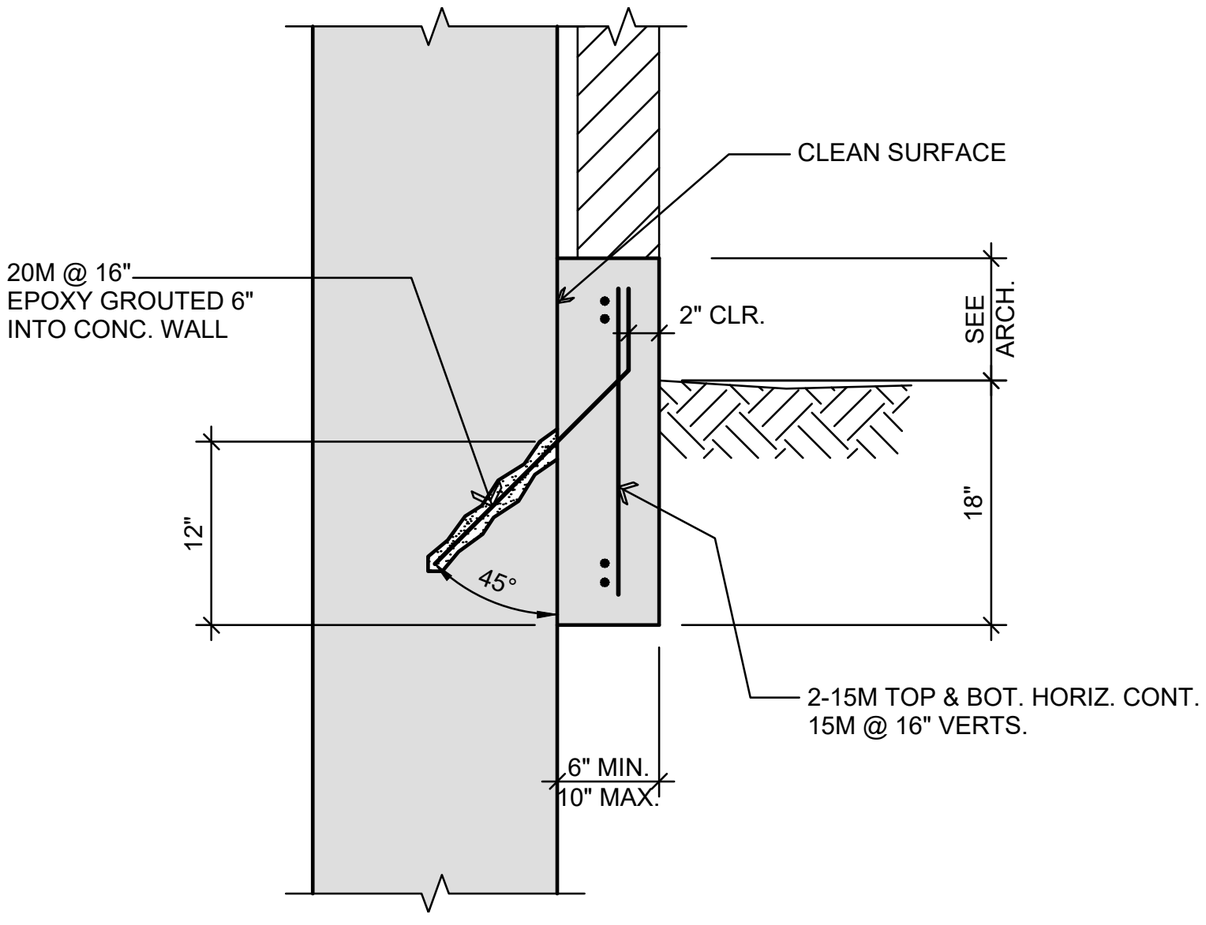

Revit template

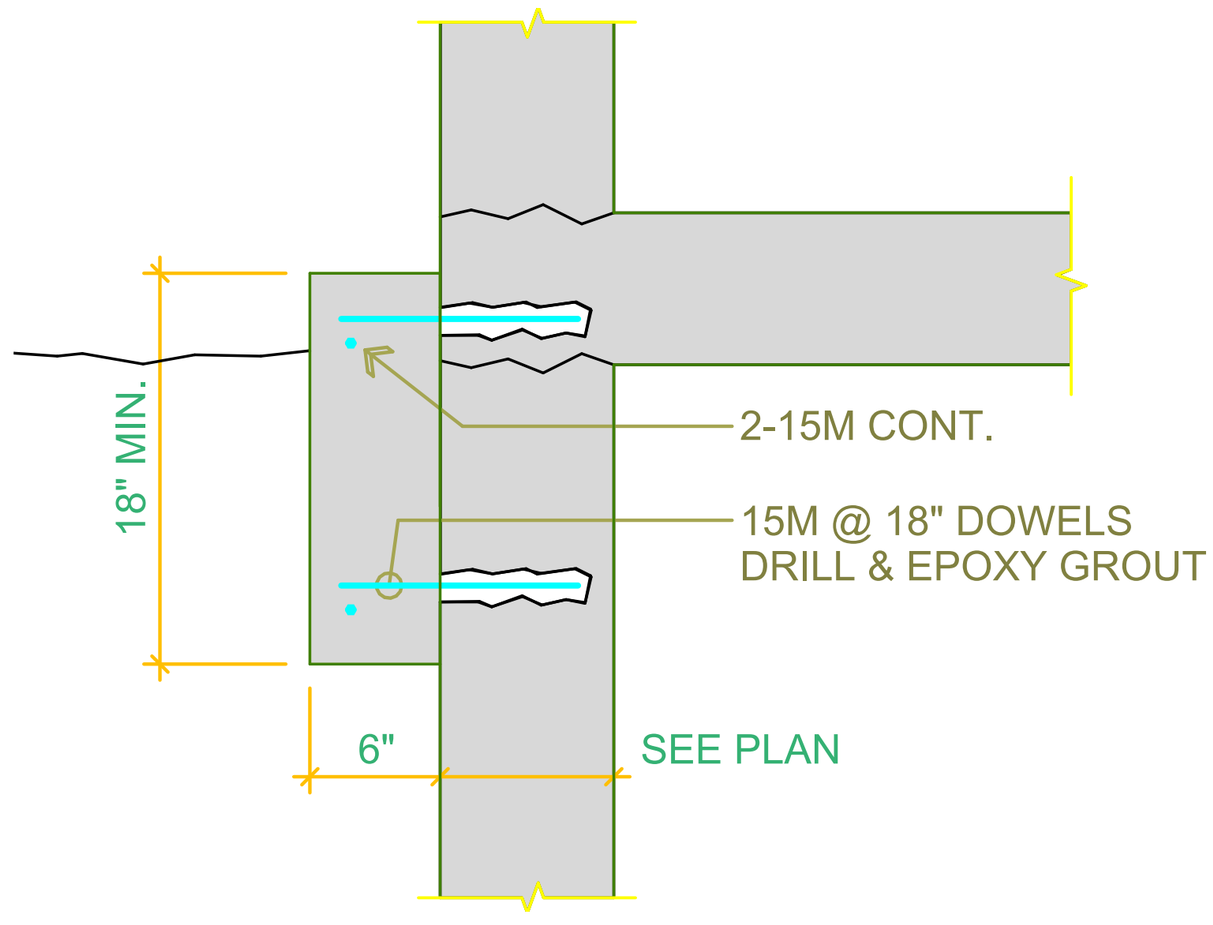

What differs: Both brick ledgers, but CAD is a post-cast ledger with 45 deg epoxied bars, Revit a cast ledger with horizontal dowels.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D502-DET 28 - TYPICAL COLUMN CAPITAL


Revit: S1.05_7_TYPICAL COLUMN CAPITAL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on S1.05 TYPICAL DETAILS)

In the new file: REPLACED. This was your view on S1.05 position 7; KOR-D502-DET 27 now sits there. If Revit is newer, yours goes back.

CAD (master)

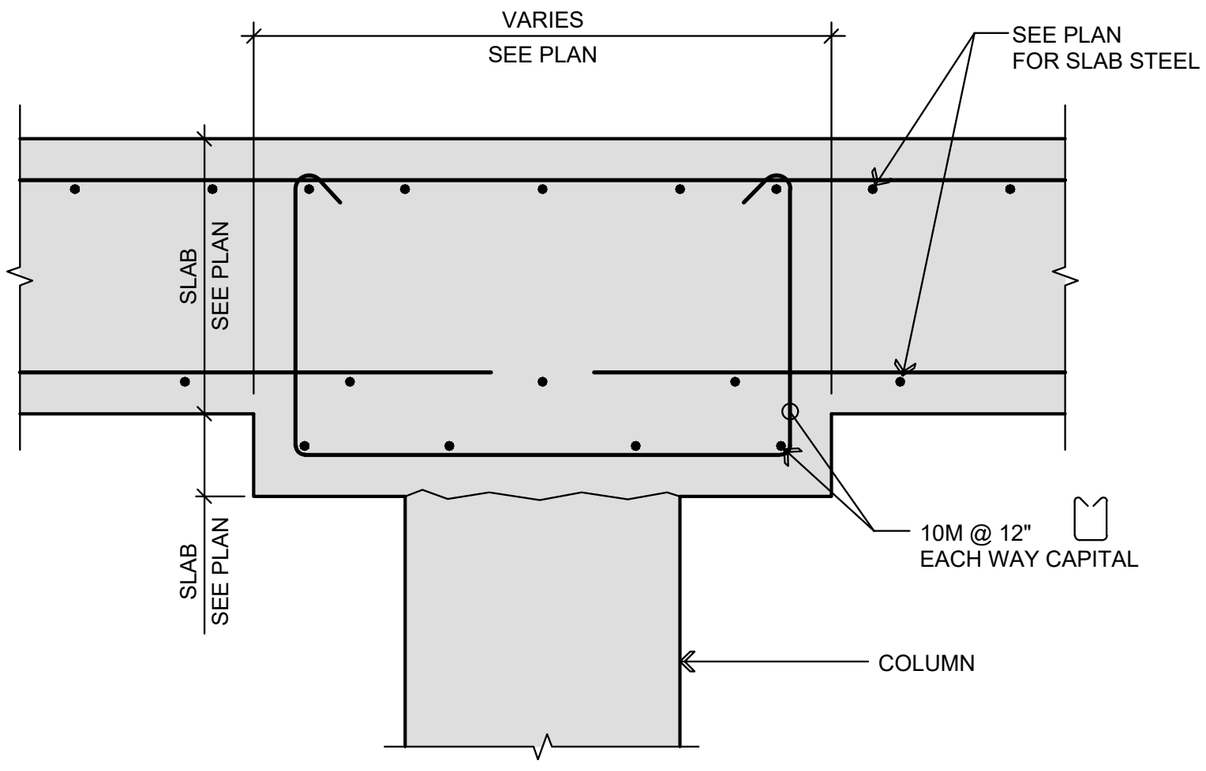

Revit template

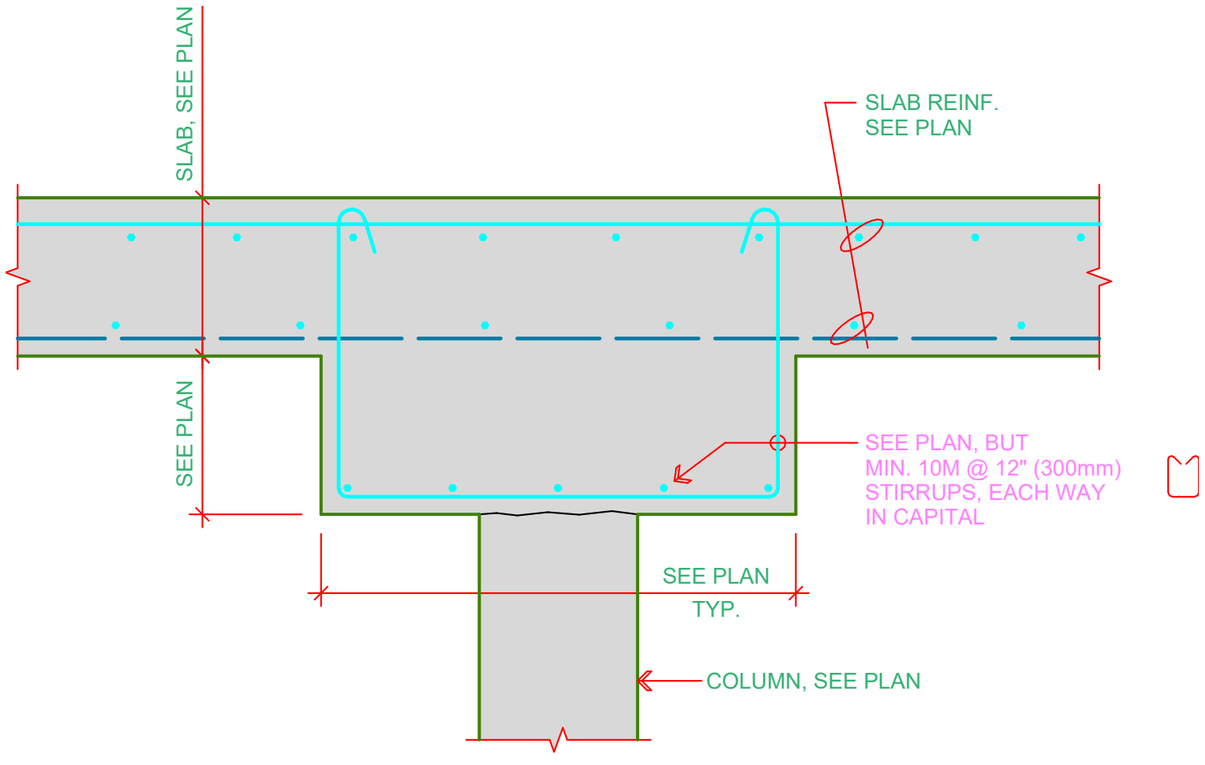


What differs: Column capital but CAD capital is wider with a different bar arrangement and no hooked top bars.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____


Revit: 1E1.05_14_TYPICAL ARCHITECTURAL SITE WALL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

In the new file: YES, on 1E1.05. Both versions are in the file.

CAD (master)

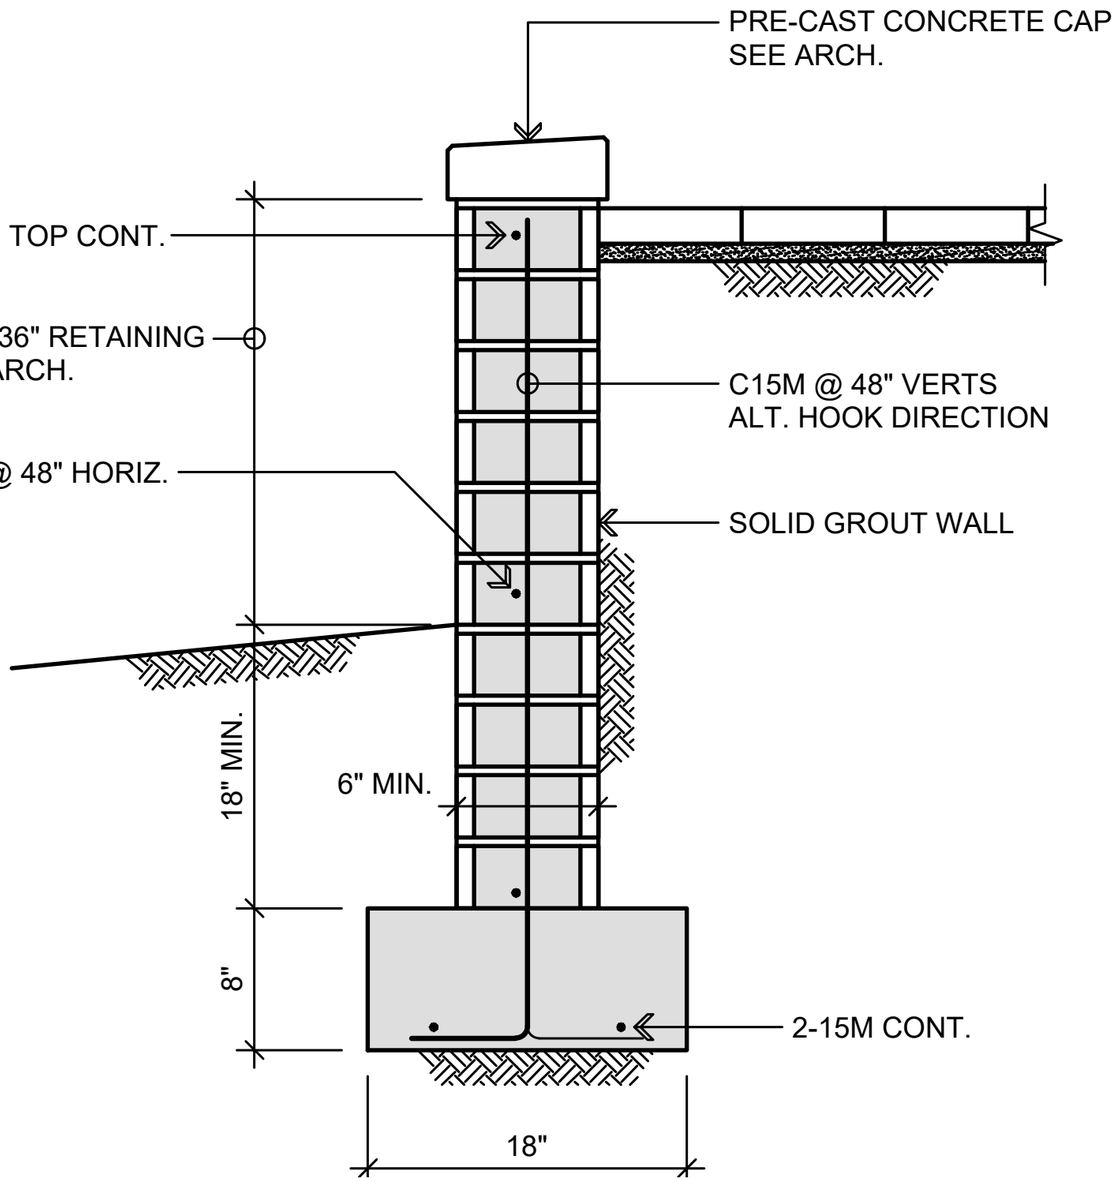

Revit template

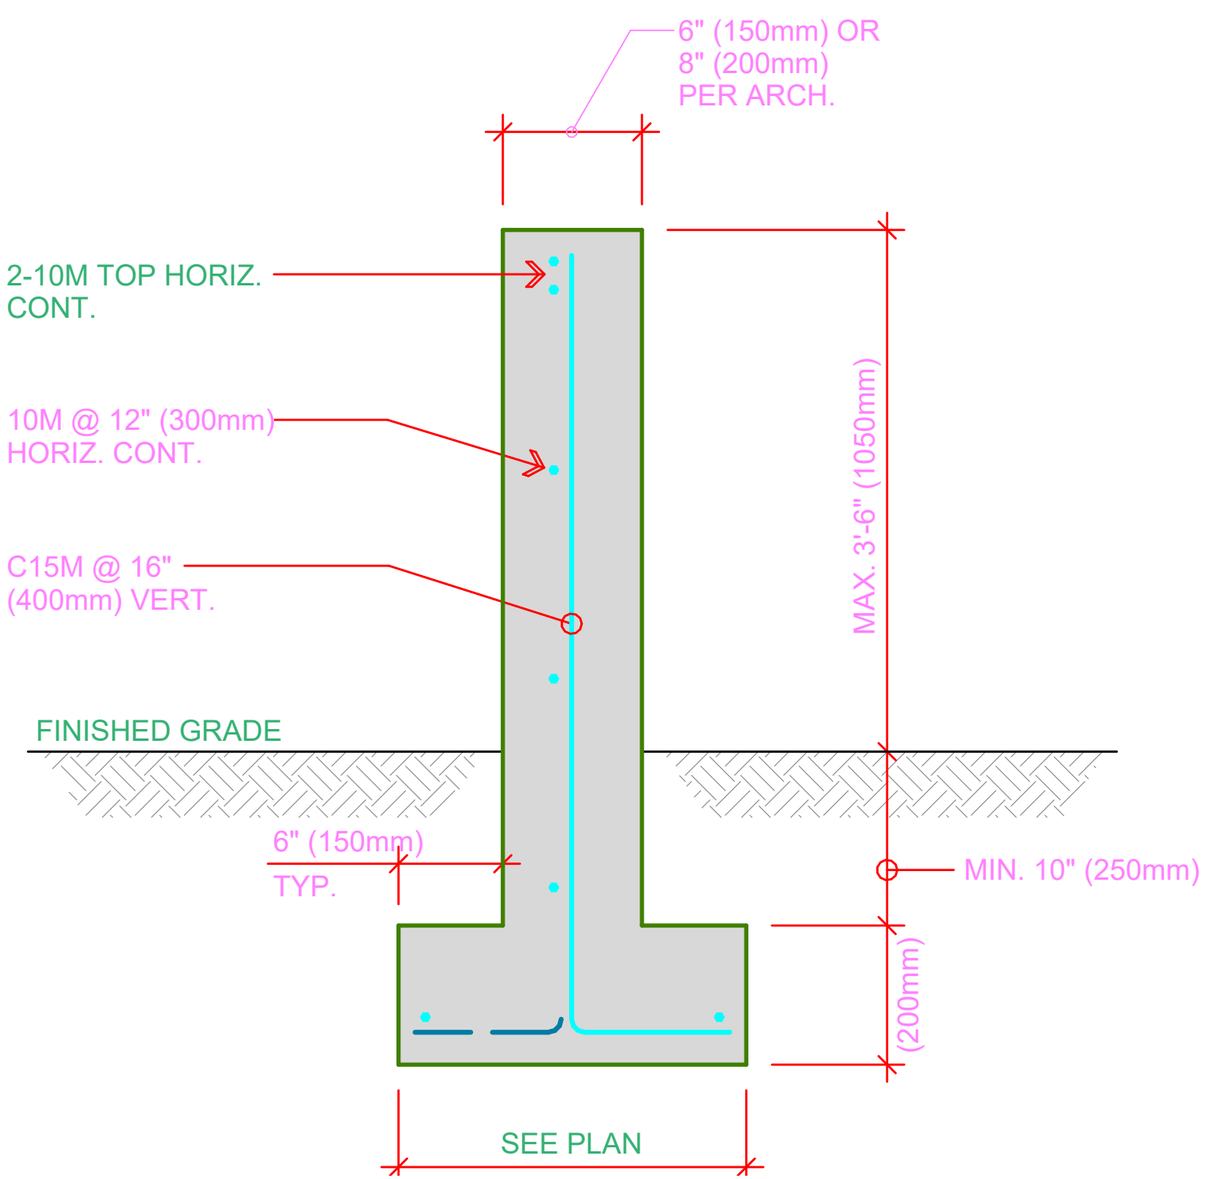

What differs: Both low site walls on footings, but CAD is a grouted masonry retaining wall with precast cap, Revit a concrete wall.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D502-DET 34 - BUILT-UP SLAB DETAIL


Revit: 1E1.05_1_TYPICAL BUILT-UP SLAB (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.05 TYPICAL DETAILS)

In the new file: YES, on 1E1.05. Both versions are in the file.

CAD (master)

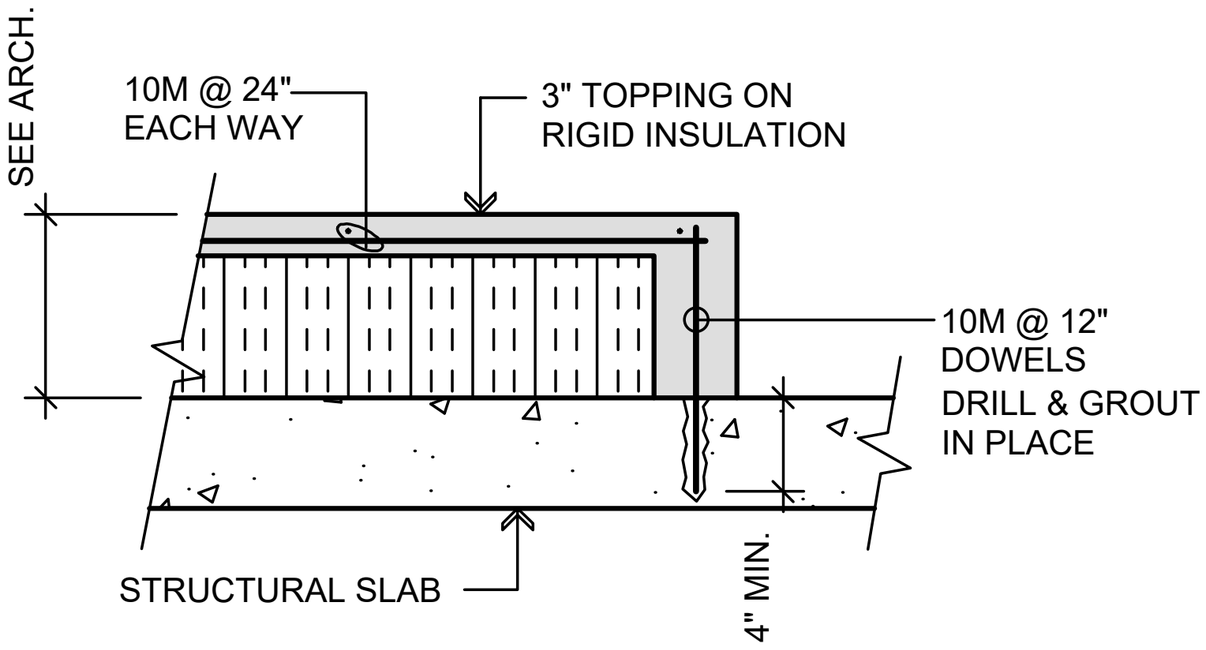

Revit template

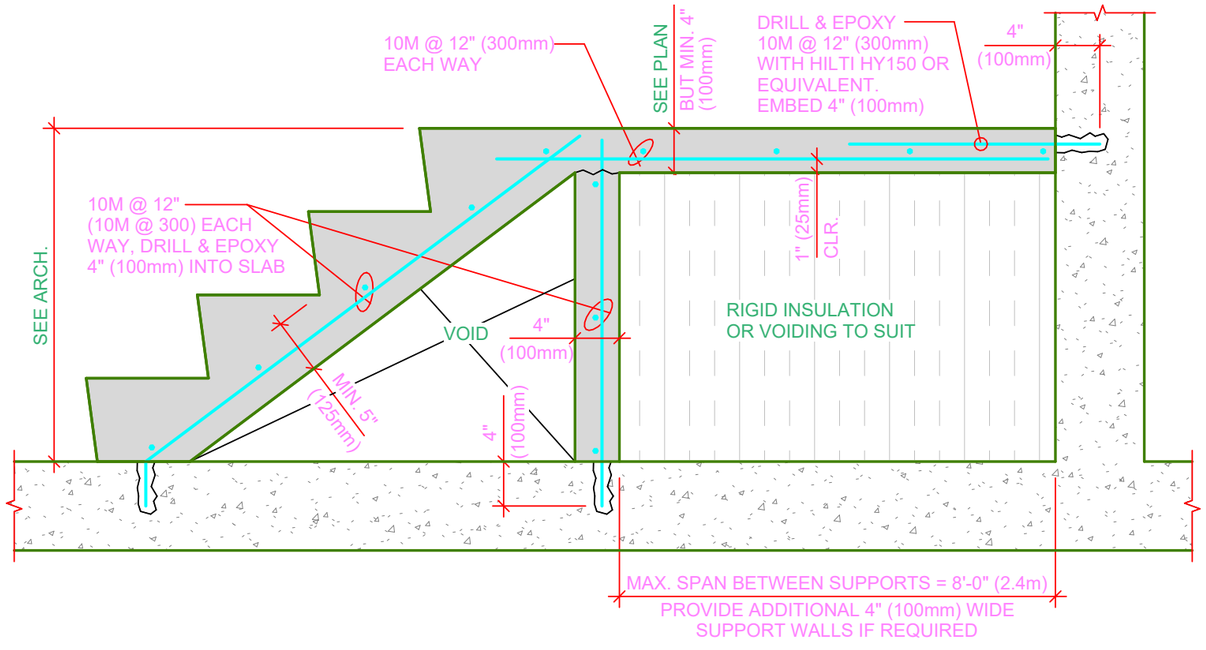


What differs: Both built-up slabs with rigid insulation, but CAD is topping on insulation with dowels, Revit a stepped fill with support walls.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: D5.02_7_SANDWICH SLAB DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.02 Series 5 Miscellan)


In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.

CAD (master)

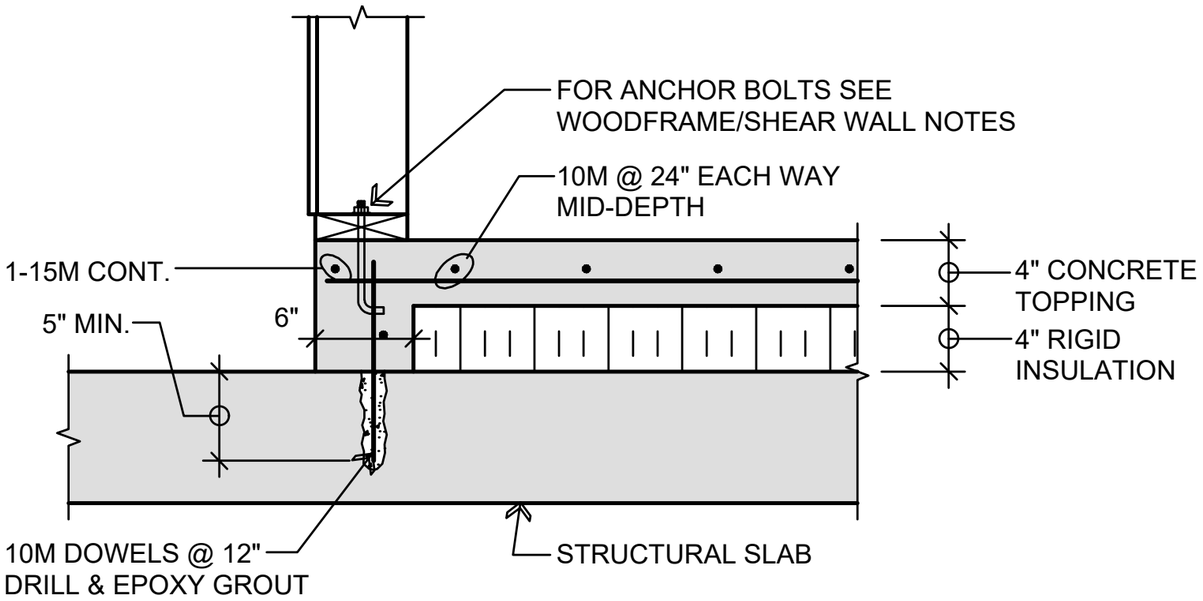

DOWELS REQUIRED AT PERIMETER
WALLS AND ALL INTERIOR
SHEAR WALL LOCATIONS

Revit template

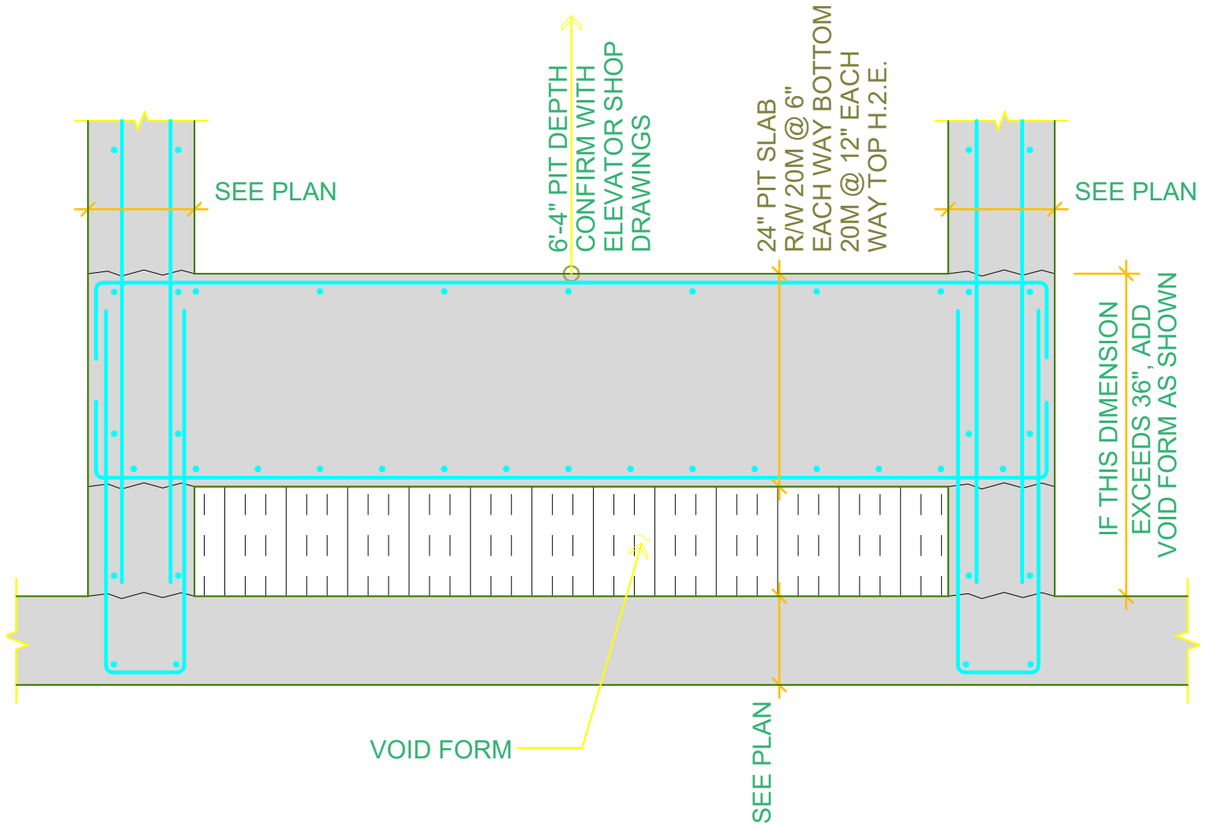

What differs: Same title, but CAD is topping on rigid insulation over structural slab, Revit a slab over void form at a pit.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D504-DET 06 - DOWNTURN DETAIL


Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

In the new file: YES, on 1E1.04. Both versions are in the file.

CAD (master)

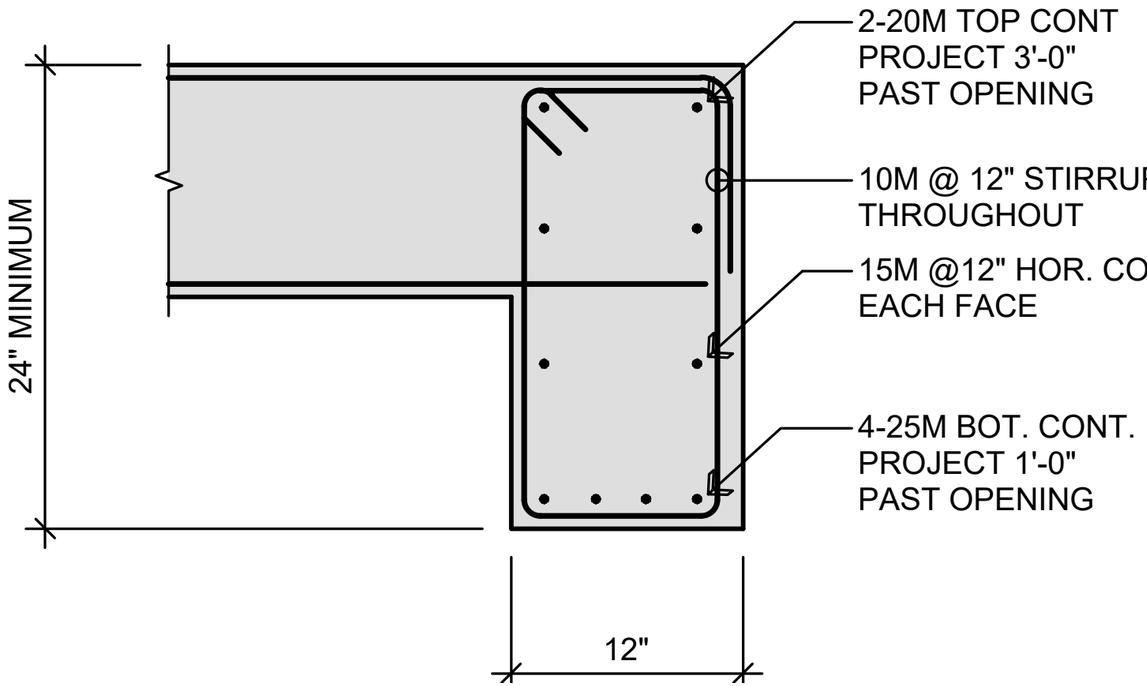

Revit template

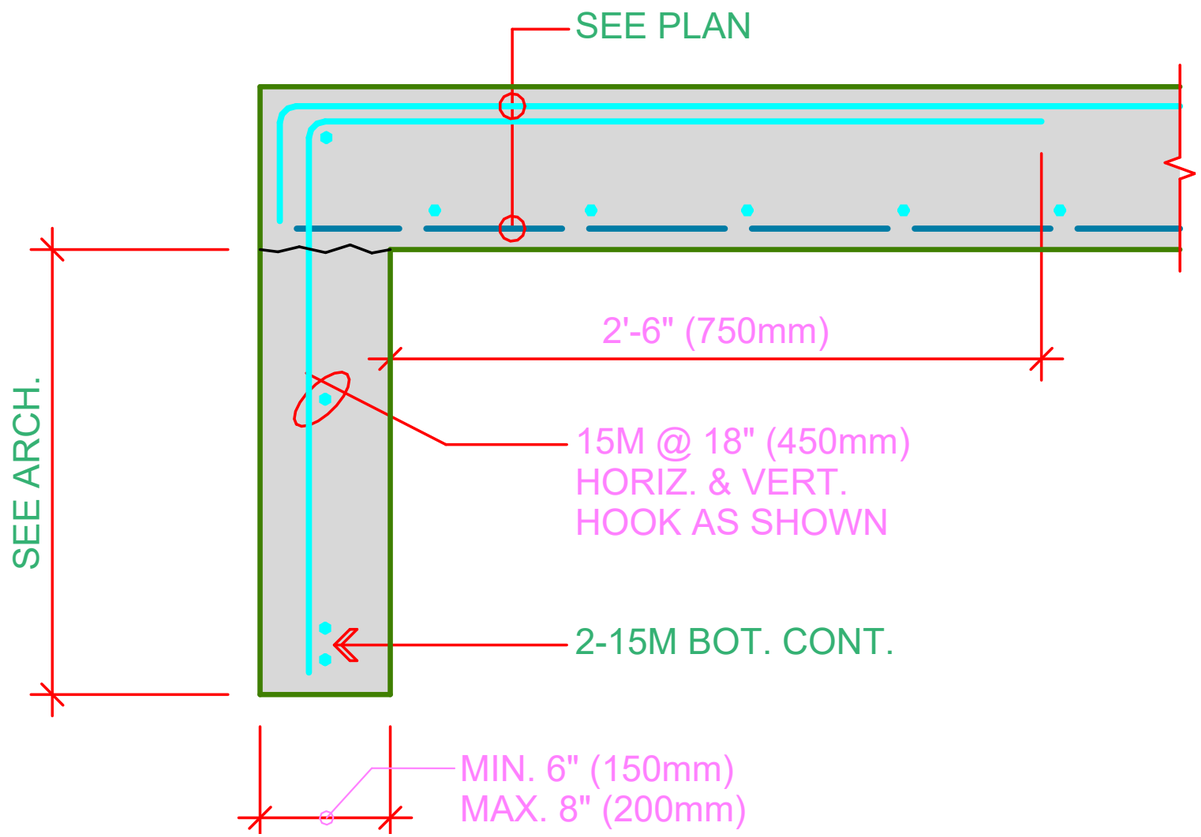

What differs: CAD is a 24in-min downturn beam with stirrups, 2-20M top and 4-25M bot projecting past an opening; '1E1.04_13_TYPICAL DOWNTURN' is a thin 6-8in downturn wall with 15M @ 18in.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D504-DET 07 - DOWNTURN DETAIL


Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

In the new file: YES, on 1E1.04. Both versions are in the file.

CAD (master)

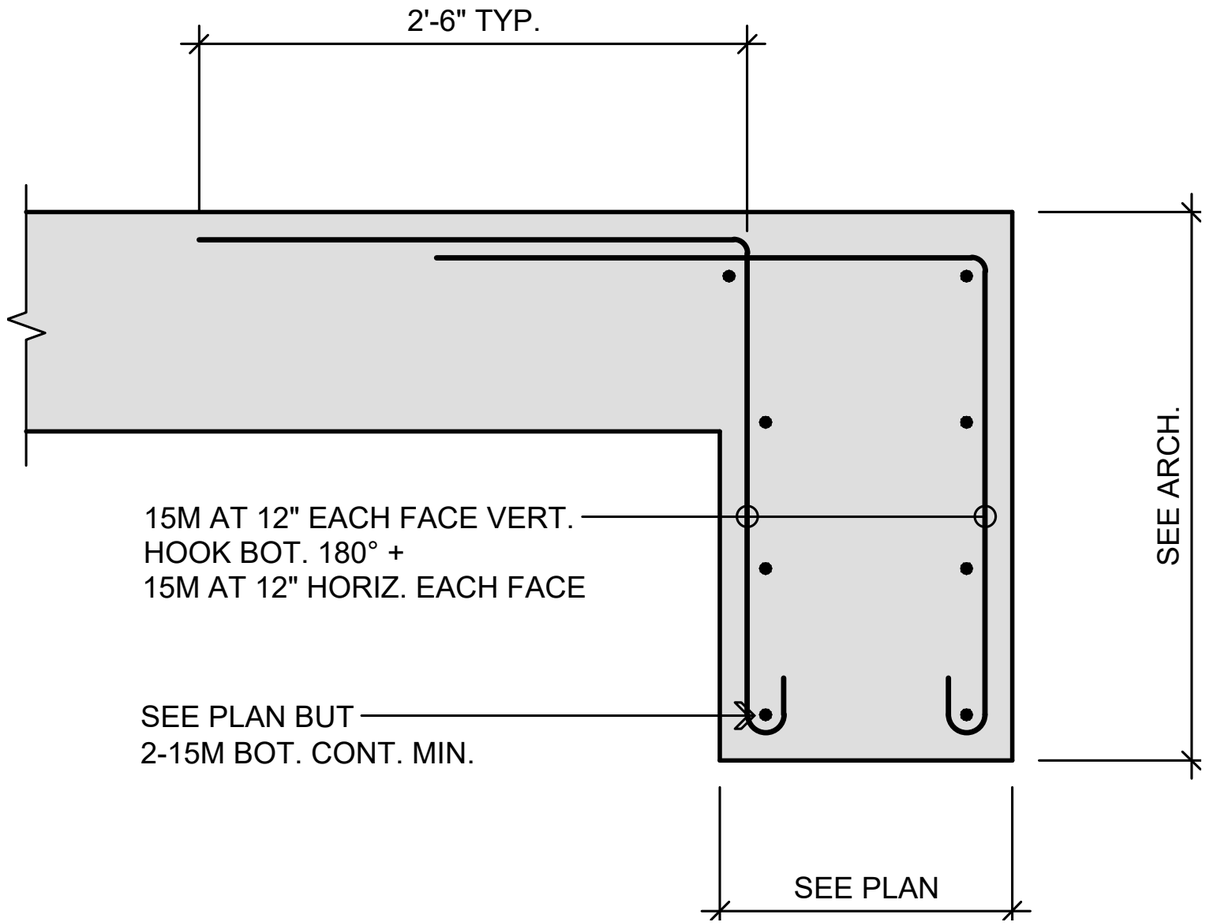

Revit template

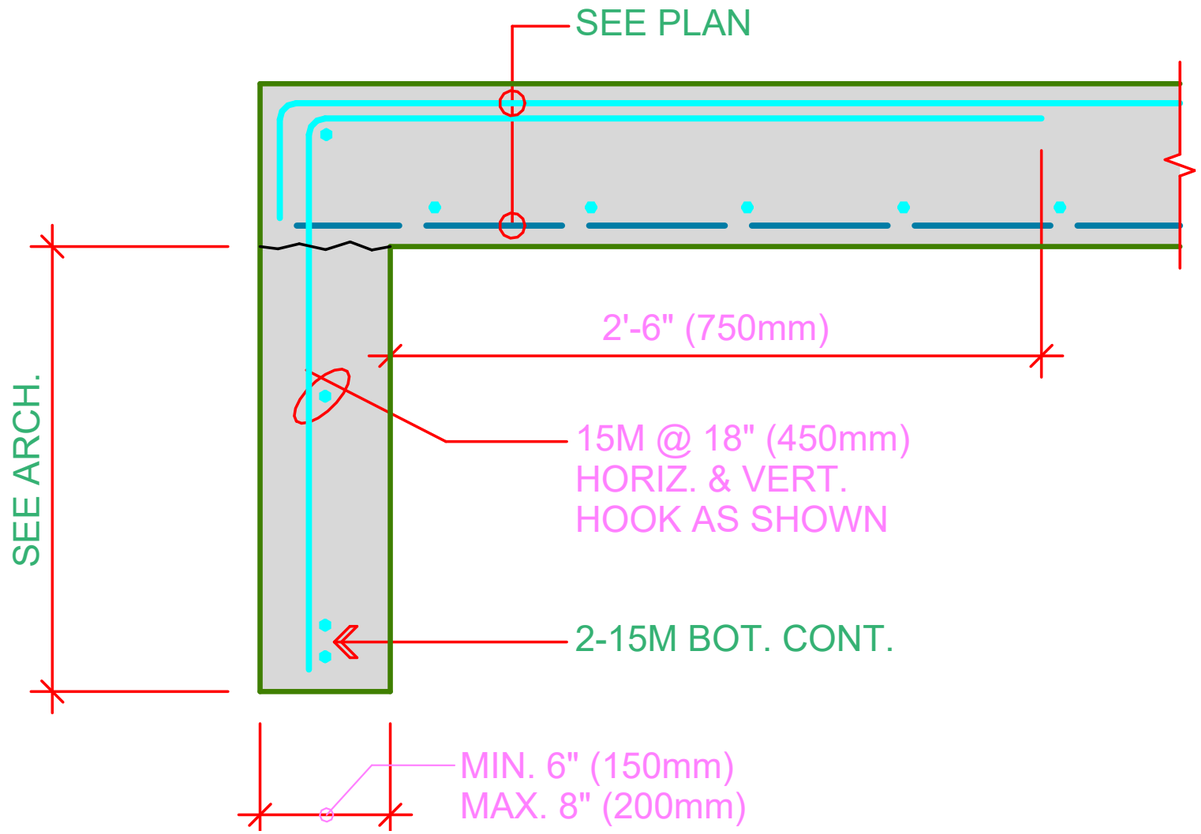

What differs: Same 2'-6in slab-edge downturn idea, but the CAD uses 15M @ 12in each face and a wider section; '1E1.04_13_TYPICAL DOWNTURN' uses 15M @ 18in.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D504-DET 08 - DOWNTURN DETAIL


Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

In the new file: YES, on 1E1.04. Both versions are in the file.

CAD (master)

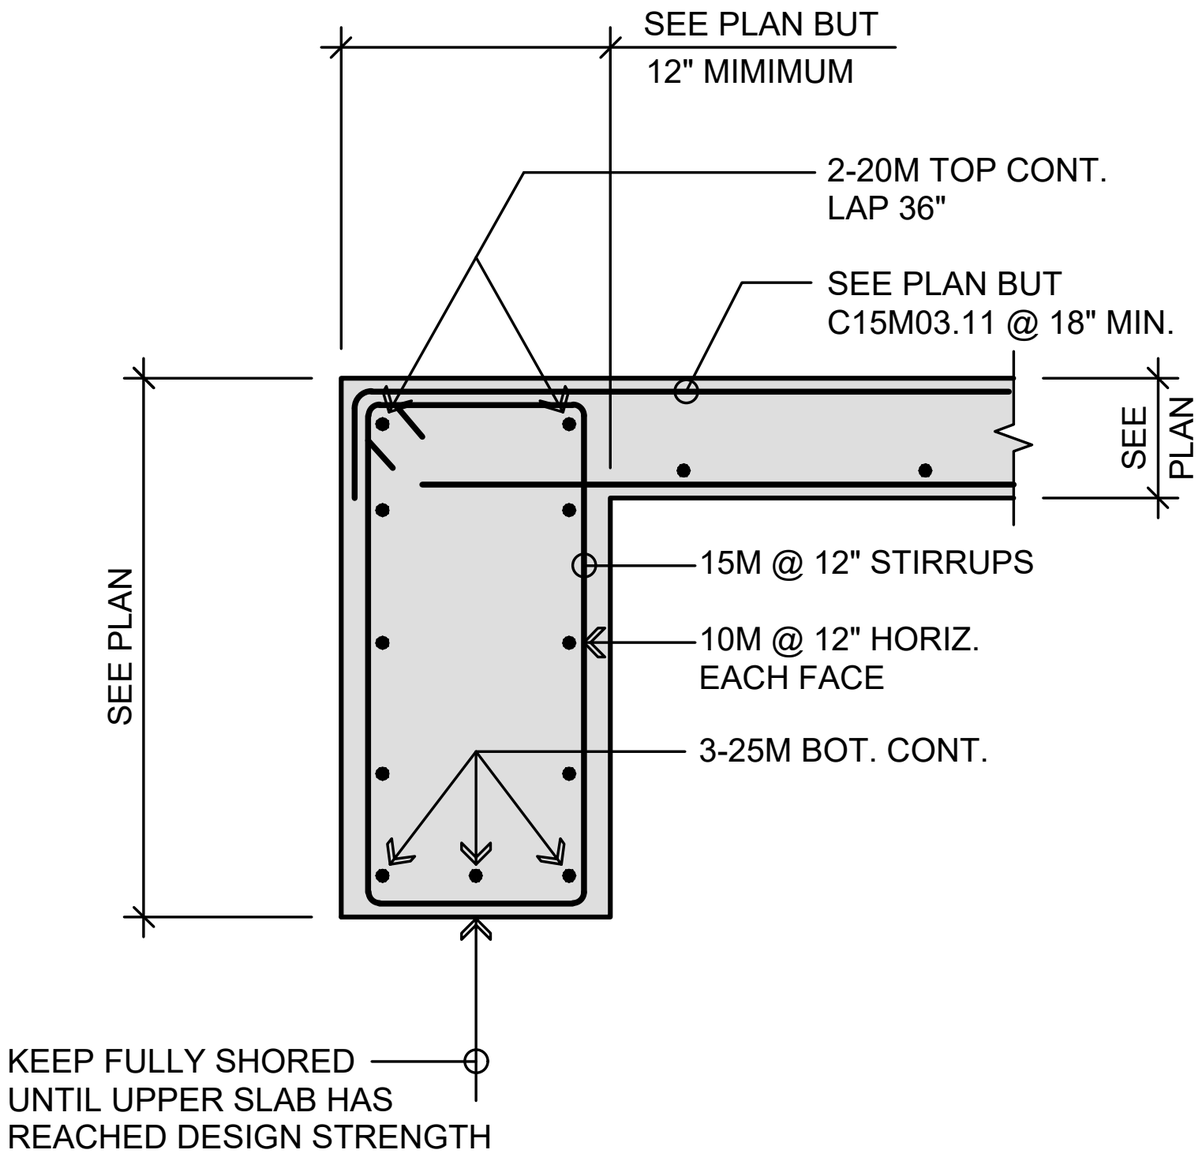

Revit template

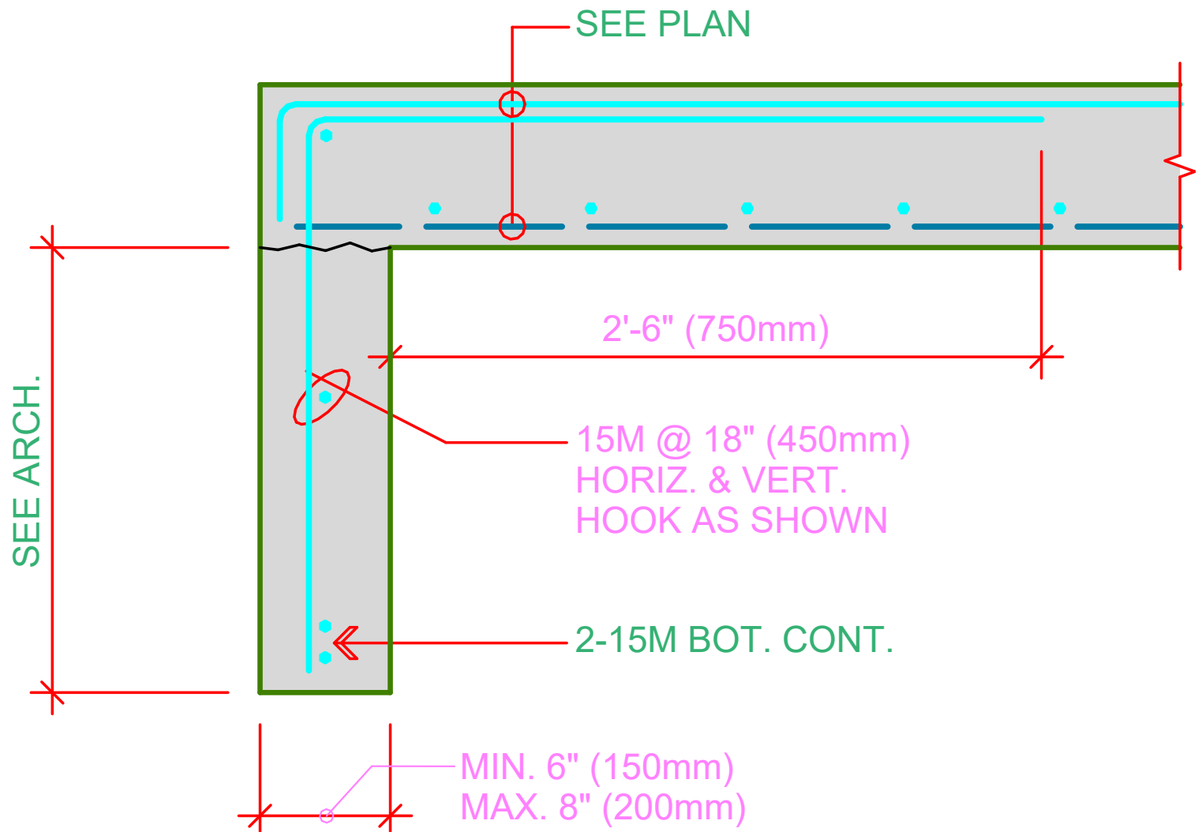

What differs: CAD is a stirruped downturn beam (3-25M bot, keep shored); '1E1.04_13_TYPICAL DOWNTURN' is a plain thin downturn wall.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D504-DET 09 - DOWNTURN DETAIL


Revit: 1E1.04_13_TYPICAL DOWNTURN (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

In the new file: YES, on 1E1.04. Both versions are in the file.

CAD (master)

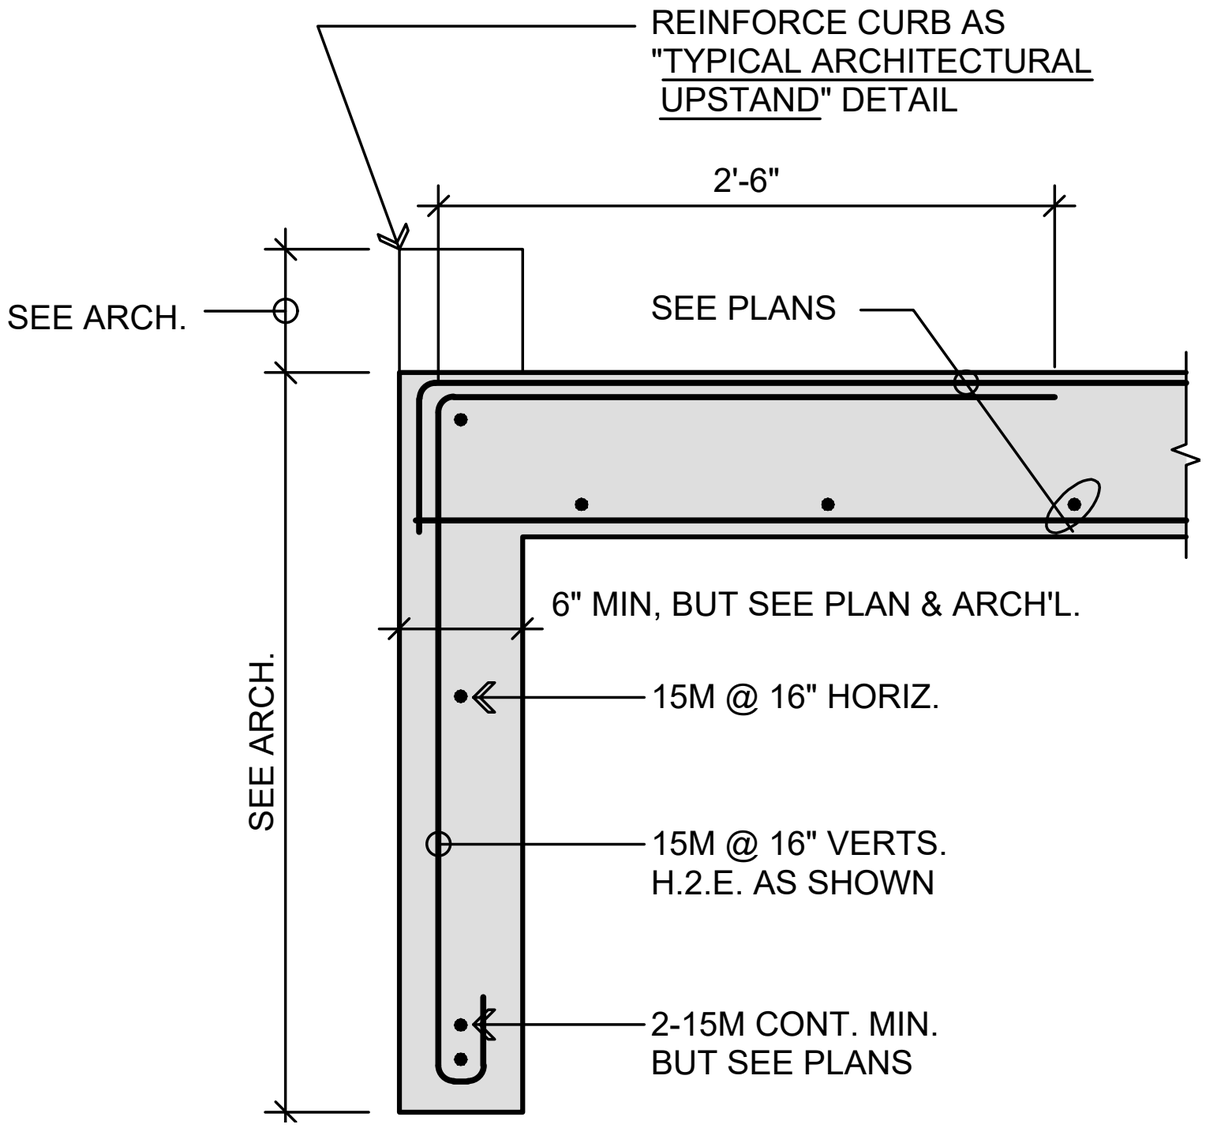

Revit template

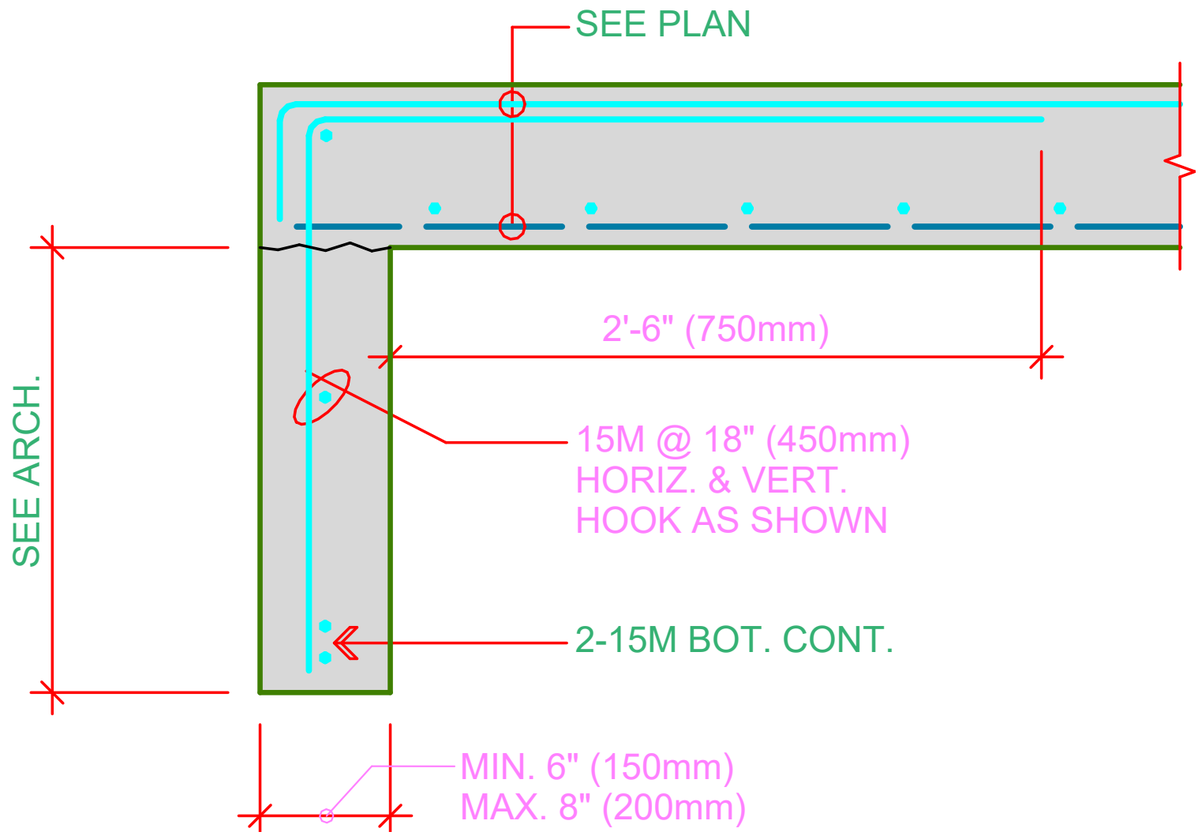

What differs: Closest match: same 2'-6in downturn with 2-15M bot cont, but the CAD has 15M @ 16in horiz/vert where '1E1.04_13_TYPICAL DOWNTURN' has 15M @ 18in, plus a curb/upstand callout.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

CAD: KOR-D504-DET 10 - BALCONY DETAIL


Revit: 1E1.04_7_TYPICAL BALCONY DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E1.04 TYPICAL DETAILS)

In the new file: YES, on 1E1.04. Both versions are in the file.

CAD (master)

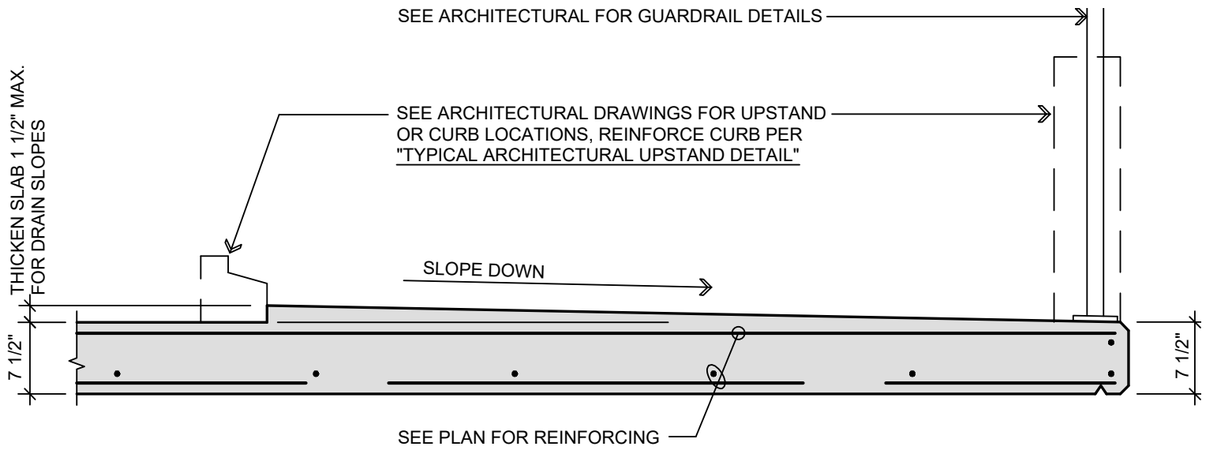

Revit template

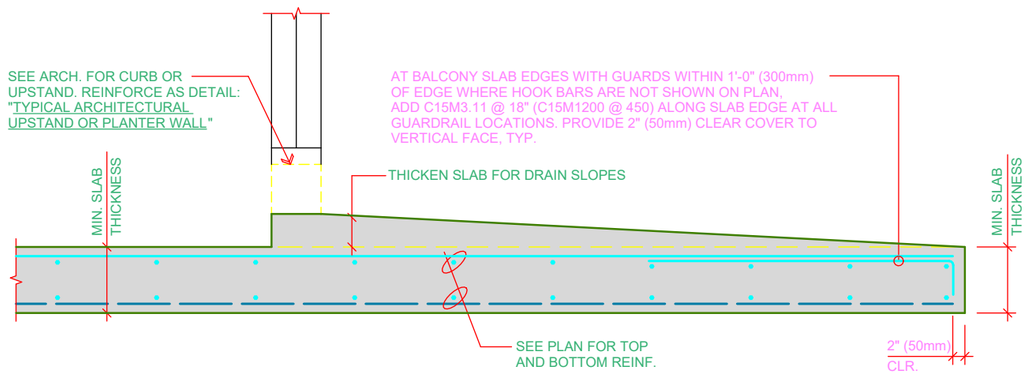

What differs: Both are balcony slabs thickened for drain slopes; the CAD has a 7 1/2in slab and 1 1/2in max thickening without the curb and guardrail hook-bar note '1E1.04_7_TYPICAL BALCONY DETAIL' shows.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-D505-DET 03 - FOLDING PANEL HANGER DETAIL

Revit: D5.01_12_FOLDING PANEL HANGER DETAIL (Typical Details - Container_R23 (Need_MET & IMP).rvt; on D5.01 Series 5 Miscellan)

In the new file: NO. This Revit version is in your Container R23 file only; the new file carries the CAD version.


CAD (master)

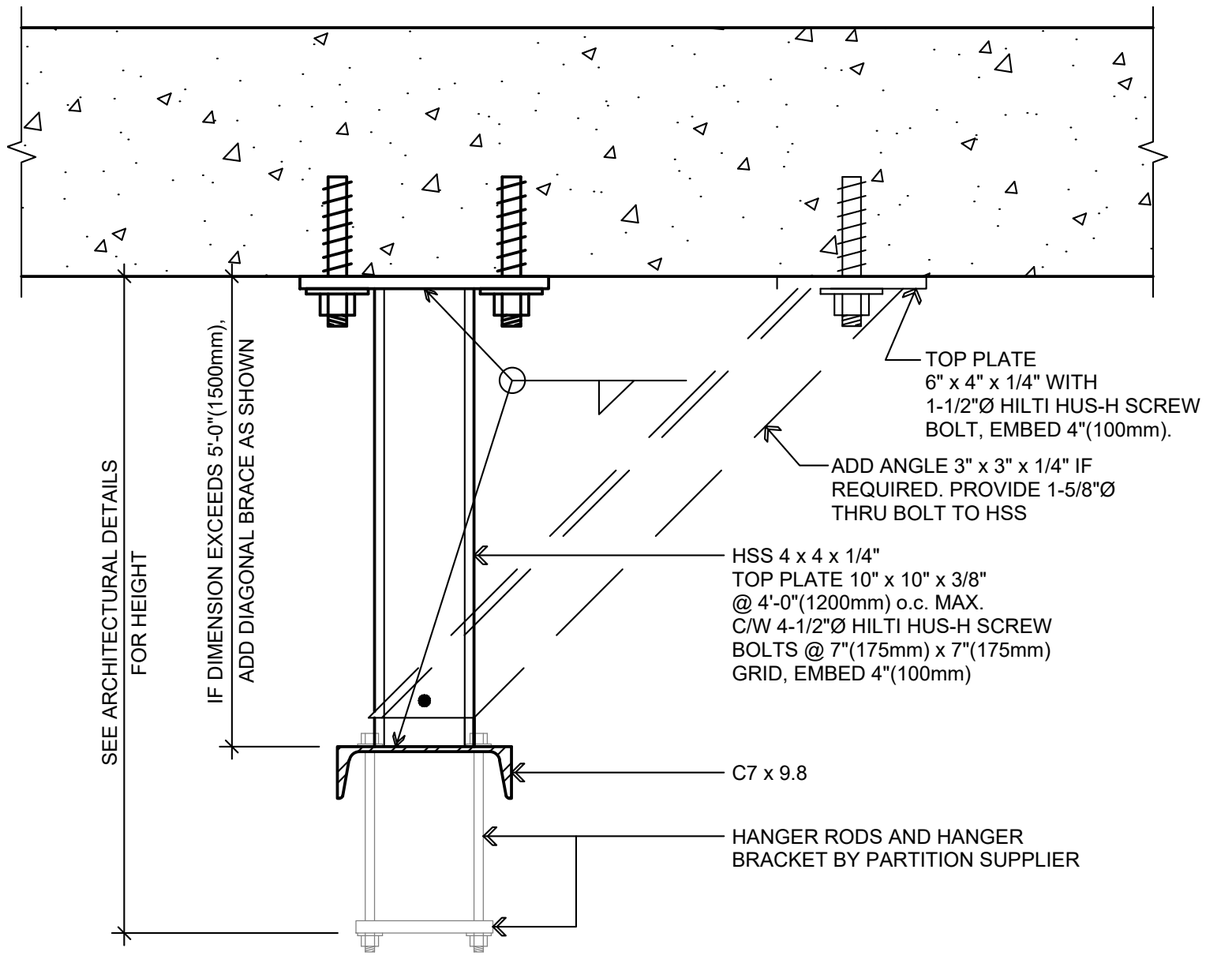

NOTE: MAXIMUM FOLDING PANEL DOOR WEIGHT IS 15 PSF

SEE INTERIOR DESIGN DRAWINGS FOR LOCATIONS

Revit template

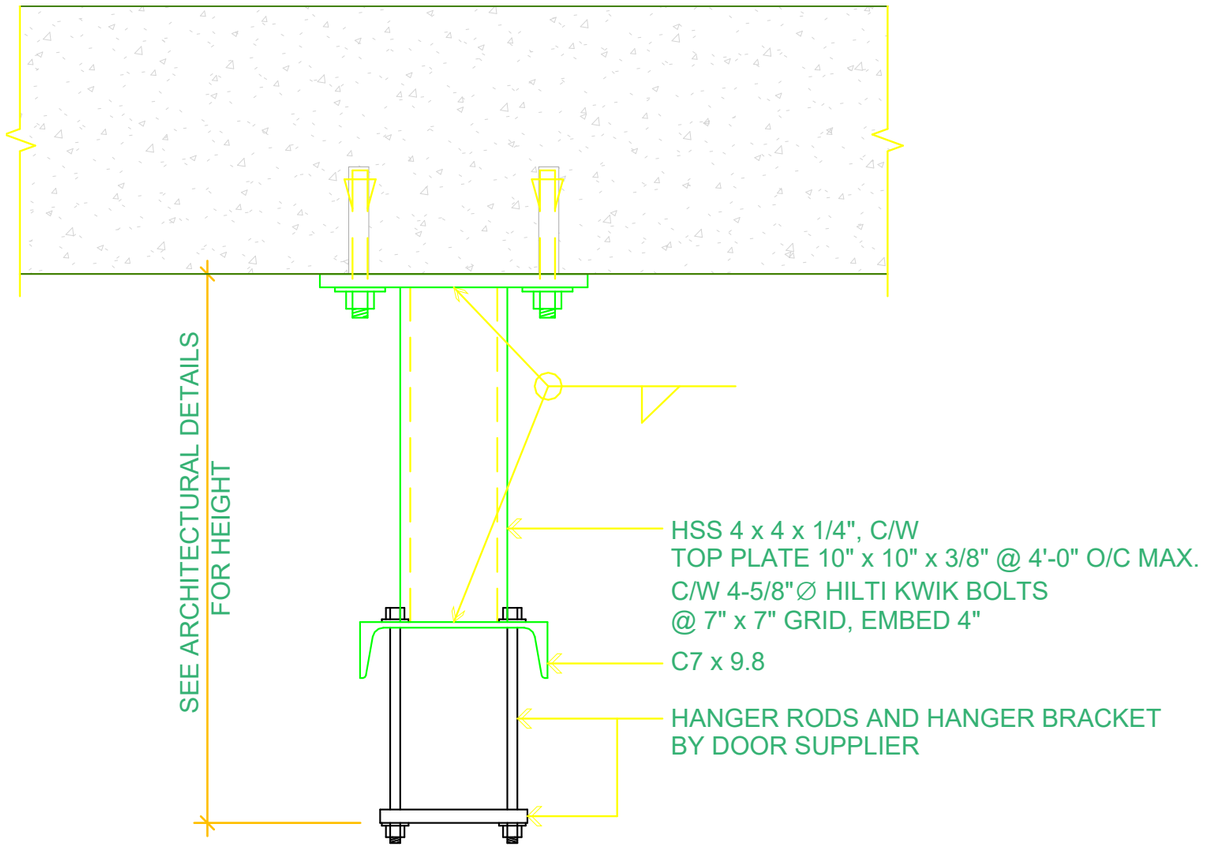

NOTE: MAXIMUM FOLDING PANEL WEIGHT IS 20 PSF

What differs: Same folding panel hanger, but the CAD adds a diagonal angle brace and uses Hilti HUS-H screws @ 6ft for a 15 psf door; 'D5.01_12_FOLDING PANEL HANGER DETAIL' has Kwik bolts @ 4ft for 20 psf and no brace.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-S302-DET 07 - TYPICAL WALL AND ZONE VERT REINFORCING DETAIL THICKNESS CHANGES


Revit: 1E3.05_6_TYPICAL WALL AND ZONE VERT REINFORCING DETAIL WHERE WALL THICKNESS CHANGES (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E3.05 SHEAR WALL - TYPICAL DETAILS)

In the new file: REPLACED. This was your view on 1E3.05 position 6; KOR-S302-DET 06 now sits there. If Revit is newer, yours goes back.

CAD (master)

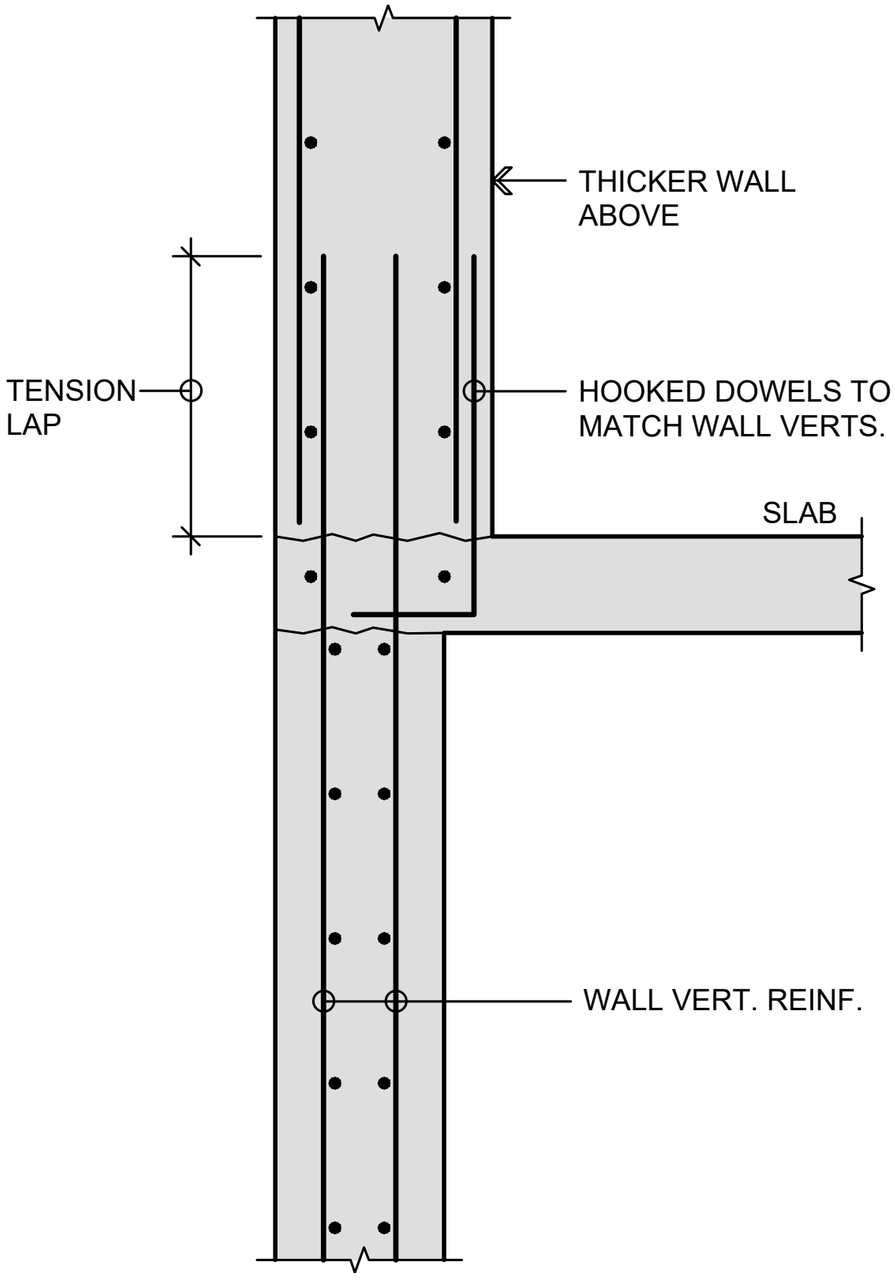

Revit template

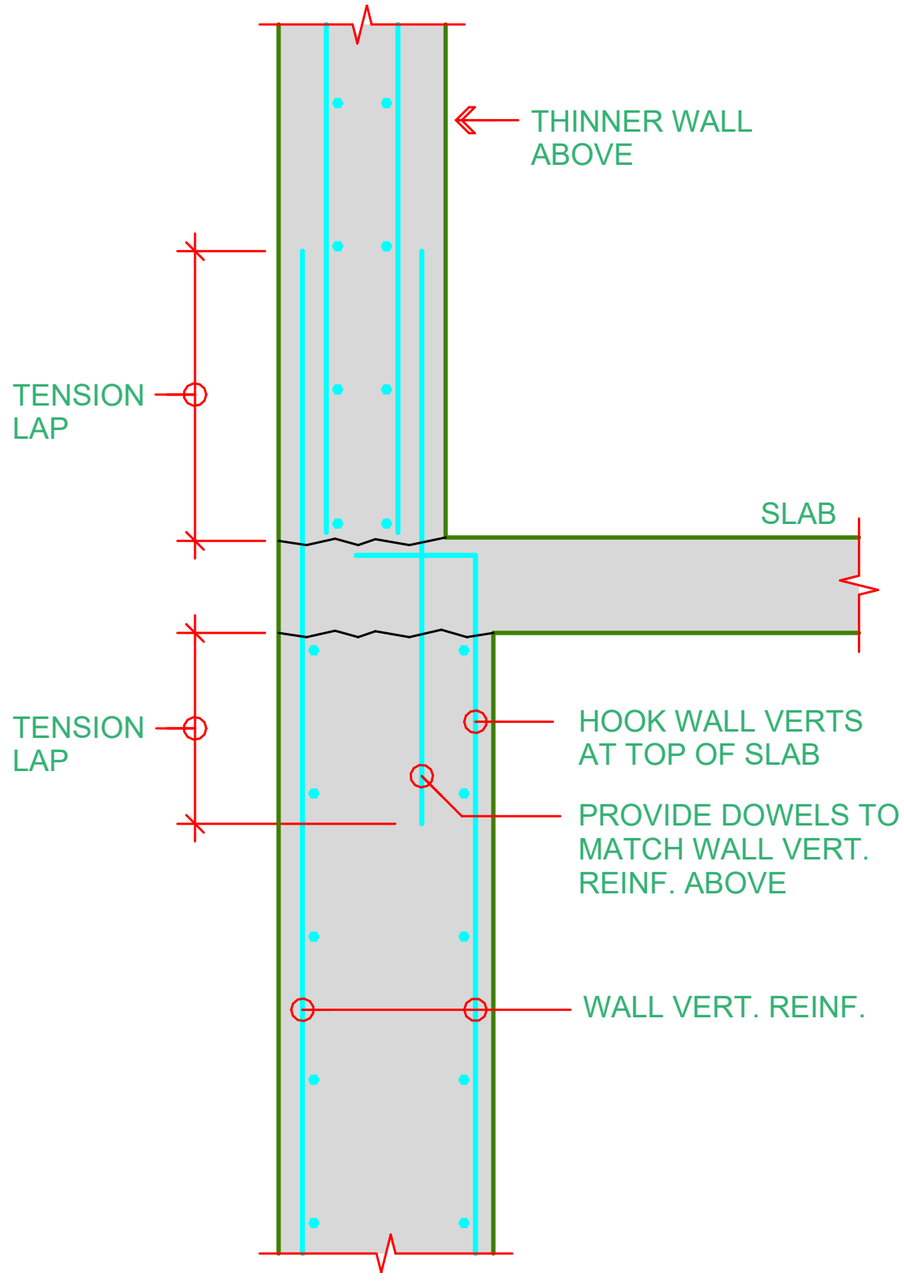

What differs: CAD is the THICKER-wall-above case with hooked dowels to match the wall verts and one tension lap; '1E3.05_6_TYPICAL WALL AND ZONE VERT REINFORCING DETAIL WHERE WALL THICKNESS CHANGES'/'D3.05_6_TYPICAL WALL AND ZONE VERT. REINFORCING DETAIL WHERE WALL THICKNESS CHANGES' are the thinner-wall-above case.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

53 of 55 CAD: KOR-S302-DET 12 - TYPICAL DIAGONALLY REINFORCED HEADER DETAIL


Revit: 1E3.05_1_TYPICAL DIAGONALLY REINFORCED HEADER DETAIL (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on 1E3.05 SHEAR WALL - TYPICAL DETAILS)

In the new file: REPLACED. This was your view on 1E3.05 position 1; KOR-S302-DET 01 now sits there. If Revit is newer, yours goes back.

CAD (master)

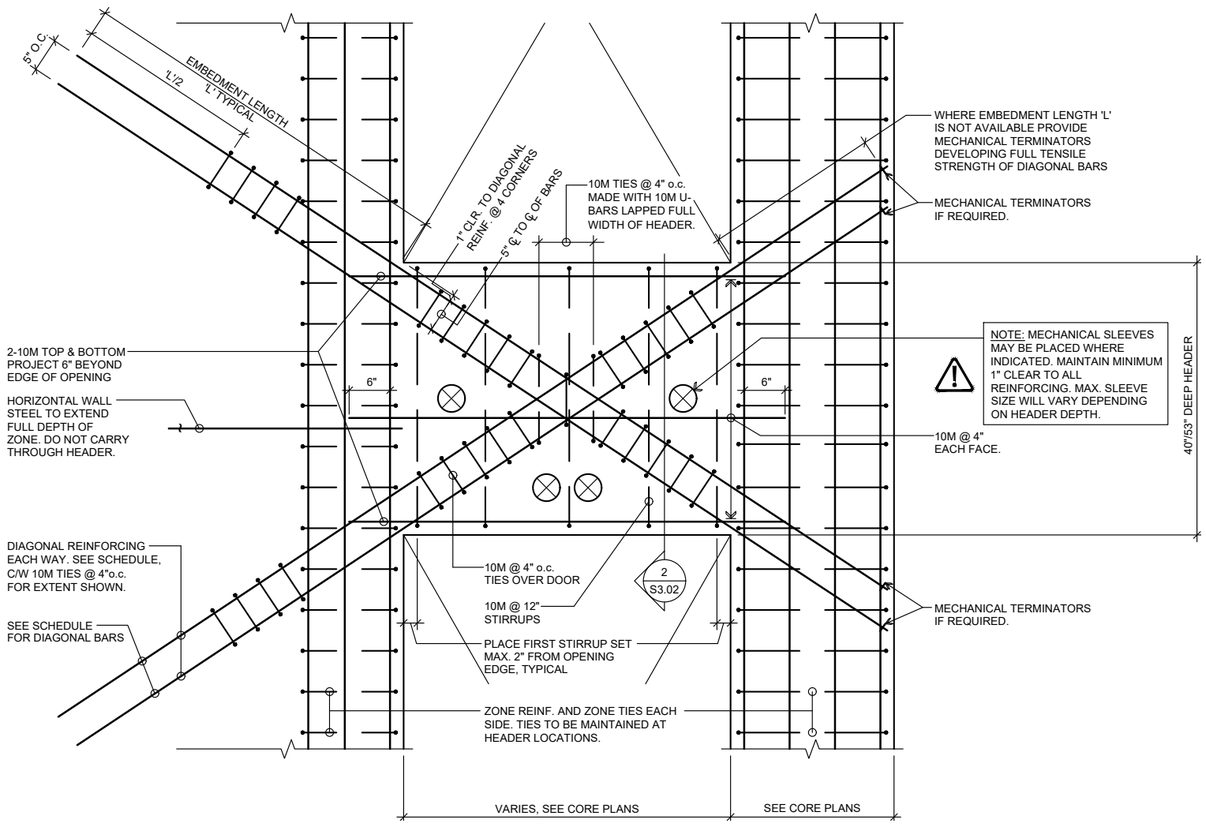

Revit template

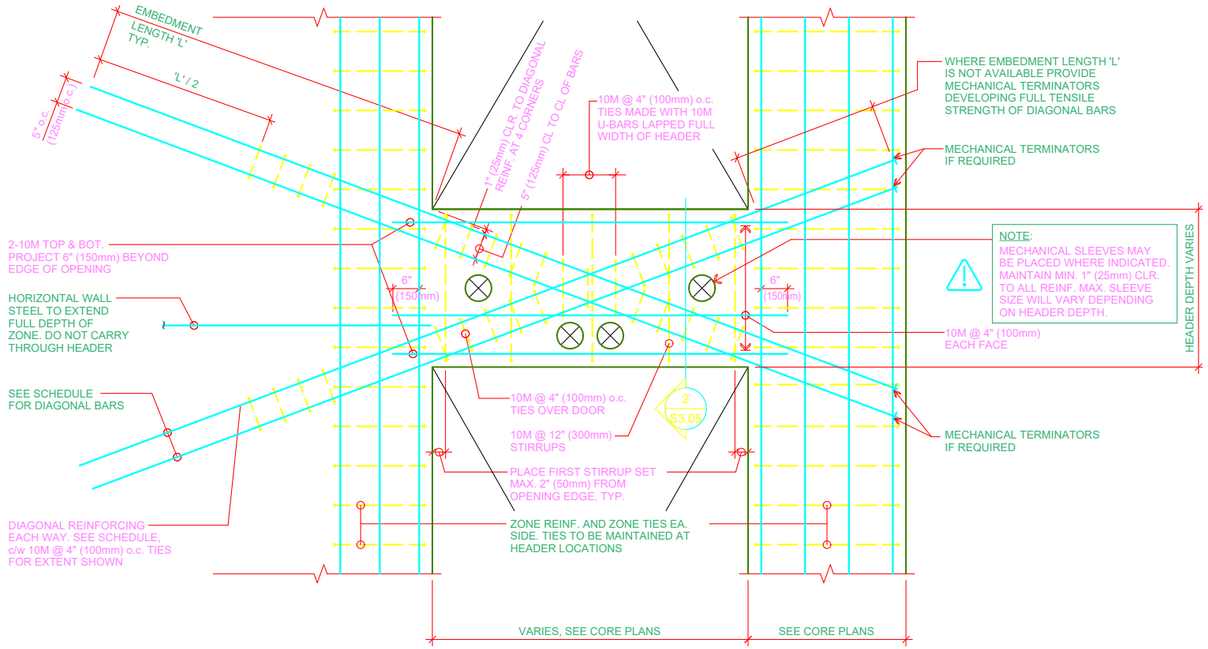

DIAGONAL REINFORCING EMBEDMENT TABLE (400W)

LENGTH 'L' : INCHES (BRACKETED VALUES ARE IN mm)

BAR \ CONC.	25 MPa	30 MPa	35 MPa	40 MPa	45 MPa	50 MPa	55 MPa	60 MPa	65 MPa & HIGHER
20M	34" (850)	31" (775)	29" (725)	27" (675)	25" (625)	24" (600)	23" (575)	22" (550)	21" (525)
25M	55" (1375)	50" (1250)	46" (1150)	43" (1075)	41" (1025)	39" (975)	37" (925)	35" (875)	34" (850)
30M	65" (1625)	59" (1475)	55" (1375)	51" (1275)	48" (1200)	46" (1150)	44" (1100)	42" (1050)	40" (1000)
35M	77" (1925)	71" (1775)	65" (1625)	61" (1525)	58" (1450)	55" (1375)	52" (1300)	50" (1250)	48" (1200)

DIAGONAL REINFORCING EMBEDMENT TABLE (500W)

LENGTH 'L' : INCHES (BRACKETED VALUES ARE IN mm)

BAR \ CONC.	25 MPa	30 MPa	35 MPa	40 MPa	45 MPa	50 MPa	55 MPa	60 MPa	65 MPa & HIGHER
20M	42" (1050)	38" (975)	36" (900)	33" (850)	31" (800)	30" (750)	29" (725)	27" (700)	26" (675)
25M	68" (1700)	62" (1550)	58" (1450)	54" (1350)	51" (1275)	48" (1200)	46" (1150)	44" (1100)	42" (1050)
30M	81" (2025)	74" (1850)	68" (1700)	64" (1600)	60" (1500)	57" (1425)	55" (1375)	52" (1300)	50" (1250)
35M	95" (2400)	87" (2200)	81" (2050)	76" (1900)	71" (1800)	68" (1700)	65" (1625)	62" (1550)	59" (1500)
45M	117" (2950)	107" (2700)	99" (2500)	92" (2350)	87" (2200)	83" (2100)	79" (2000)	76" (1900)	73" (1825)

What differs: CAD is a larger, project-specific 40in/53in deep header elevation with mechanical terminators and sleeve notes and no embedment tables; '1E3.05_1_TYPICAL DIAGONALLY REINFORCED HEADER DETAIL' is the generic version with tables.

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

Revit: G002 - 31.0 SHEAR WALL AND ZONE REINF (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on DL1.03 GENERAL NOTES AND TYPICAL DETAILS | 1EL1.02 GENERAL N)

In the new file: YES, on DL1.03, 1EL1.02. Both versions are in the file.

CAD (master)

ZONE AND SHEAR WALL NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR GRADE 400W REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa.
   FOR GRADE 500W REINFORCING ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 625 MPa.
   TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. HOOK WALL / ZONE VERTICAL REINFORCING AT TOP OF SLAB WHERE NOTED.
10. NO VERTICAL CONSTRUCTION JOINTS ARE PERMITTED IN SHEAR WALLS EXCEPT WITH WRITTEN PERMISSION FROM STRUCTURAL ENGINEER.
11. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

Revit template

31.0 TYPICAL CONCRETE SHEAR WALL AND ZONE REINFORCING NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR ZONE REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa. ALSO, TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

What differs: Same zone and shear wall notes text, but 'G002 - 31.0 SHEAR WALL AND ZONE REINF' has 9 items; CAD has 11 (adds grade 400W/500W yield limits, hooking verts at top of slab, no vertical construction joints).

Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

 CAD: KOR-S302-DET B - ZONE AND SHEAR WALL NOTES

Revit: G002 - 31.0 SHEAR WALL AND ZONE REINF (Kor_Concrete_Tower_Project_Template_Arch D E1 E_R24 (Do Not ; on DL1.03 GENERAL NOTES AND TYPICAL DETAILS | 1EL1.02 GENERAL N)

In the new file: YES, on DL1.03, 1EL1.02. Both versions are in the file.

CAD (master)

ZONE AND SHEAR WALL NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR GRADE 400W REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa.
   FOR GRADE 500W REINFORCING ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 625 MPa.
   TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. HOOK WALL / ZONE VERTICAL REINFORCING AT TOP OF SLAB WHERE NOTED.
10. NO VERTICAL CONSTRUCTION JOINTS ARE PERMITTED IN SHEAR WALLS EXCEPT WITH WRITTEN PERMISSION FROM STRUCTURAL ENGINEER.
11. ZONES ARE TO HAVE 50% STAGGERED SPLICES FOR VERTICAL BARS (SPLICE HALF OF EACH ZONE VERTS. AT ALT. FLOORS). FROM LEVEL P1 TO U/S OF LEVEL 36. BARS MAY BE 100% SPLICED FROM LEVEL 36 AND UP, UNLESS NOTED OTHERWISE ON DETAILS.

Revit template

31.0 TYPICAL CONCRETE SHEAR WALL AND ZONE REINFORCING NOTES

1. ALL ZONE VERTICALS ARE TO HAVE DOWELS HOOKED INTO THE BOTTOM OF FOOTINGS. ALL SHEAR WALL REINFORCING IS TO BE TENSION EMBEDDED INTO FOOTINGS, TYPICAL.
2. DO NOT CRANK OR BEND ZONE VERTICALS OR WALL VERTICALS, EVEN AT SPLICES. STEP TIE CAGES AT SPLICES.
3. ALL WALL HORIZONTAL AND VERTICAL REINFORCING IS TO HAVE FULL TENSION SPLICES. PROVIDE CORNER BARS AT ALL CORNERS AND AT ALL WALL INTERSECTIONS, U.N.O.
4. FOR ZONE REINFORCING, ACTUAL YIELD STRENGTH OF BARS IS NOT TO EXCEED 525 MPa. ALSO, TENSILE STRENGTH IS NOT TO EXCEED 1.25 x YIELD STRENGTH OF REINFORCING BARS.
5. AT CHANGES IN WALL THICKNESS, LOCATE THE VERTICAL REINFORCING IN THE LOWER LIFT TO FIT INTO UPPER LIFT. ALL ZONE VERTICALS AND ZONE DOWELS ARE TO BE TIED. PROVIDE EXTRA TIES AT ALL CHANGES IN WALL THICKNESSES.
6. ALL ZONE TIES ARE TO BE DETAILED AS HOOP TIES.
7. ZONE TIES TO BE CONTINUOUS AND TO CARRY THROUGH HEADER DEPTHS. TYPICAL.
8. ALL SHEAR WALL REINFORCING INCLUDING ZONES, TIES, HEADERS AND WALL REINFORCING TO COMPLY WITH CSA STANDARD G30.18 (WELDABLE GRADE).
9. ZONES BARS MAY BE 100% SPLICED AT ALL LEVELS.

What differs: Same notes as 'G002 - 31.0 SHEAR WALL AND ZONE REINF' but CAD has 11 items, including the clouded 50% staggered zone splice note that 'G002 - 31.0 SHEAR WALL AND ZONE REINF' lacks.


Answer: [ ] CAD is right [ ] Revit is newer - update CAD [ ] Both wrong / other: _____

56 of 61 OLD CATALOGUE: KOR-D-00165 - TYPICAL SHEARWALL DETAILS


Your template: TYPICAL SHEARWALL DETAILS (Concrete Tower R24; on no sheet)

In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.

Old catalogue (what drafters had)

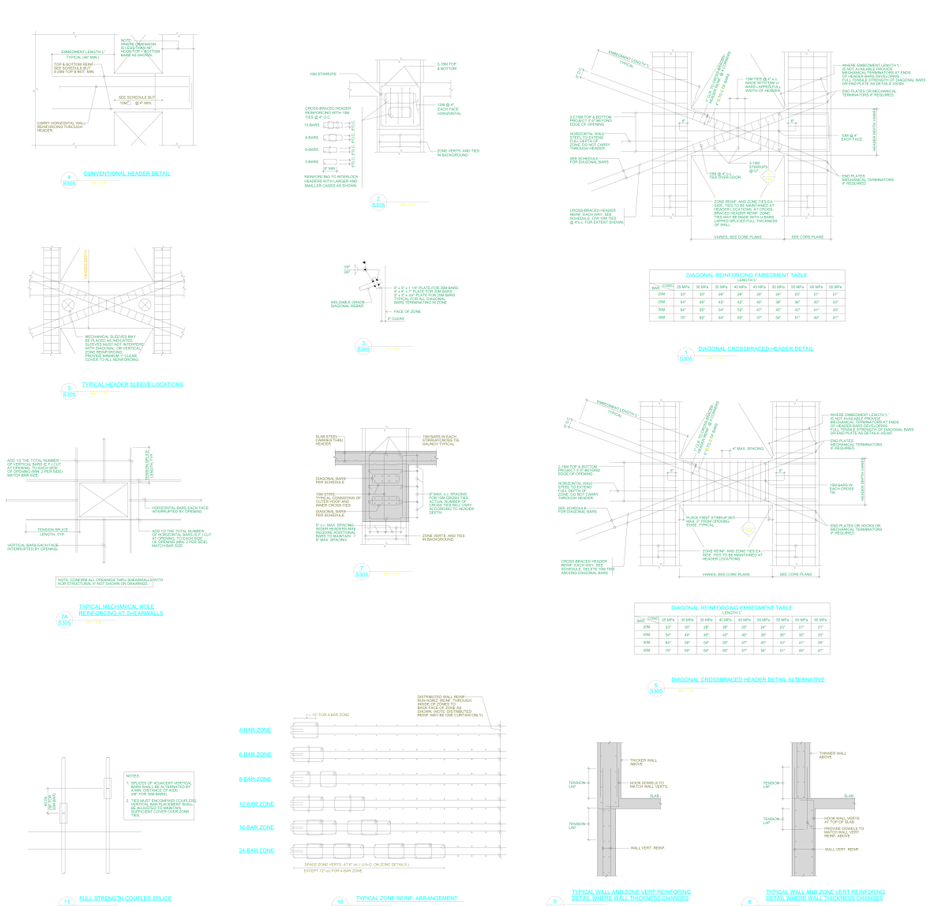

Your template view

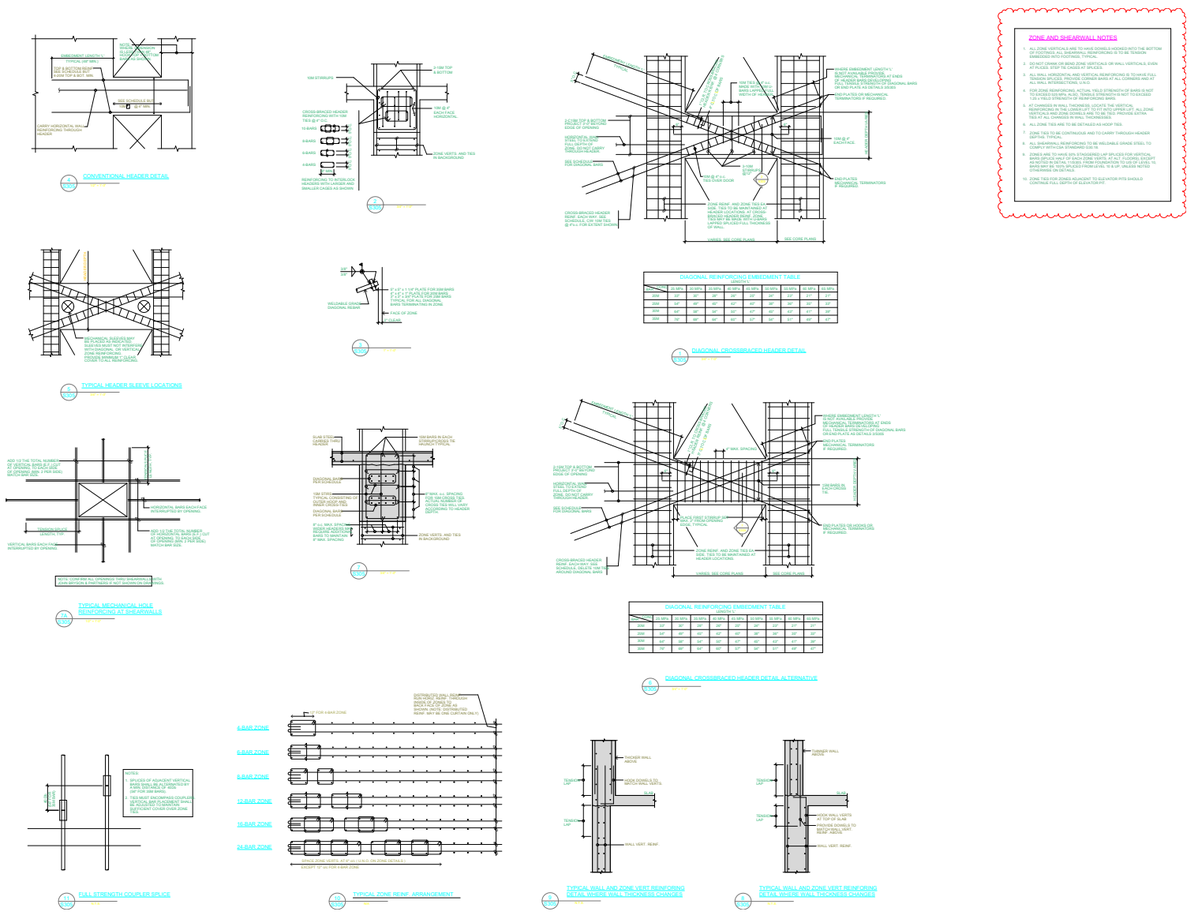

What differs: 9 of 9 grid pieces identical except note 7A: candidate says "JOHN BRYSON & PARTNERS", old says "KOR STRUCTURAL"


Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____

57 of 61 OLD CATALOGUE: KOR-D-00425 - EDGE ANGLE SPLICE DETAIL

Your template: STEEL DETAIL - EDGE ANGLE SPLICE DETAIL (Steel R24; on no sheet)


In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.

Old catalogue (what drafters had)

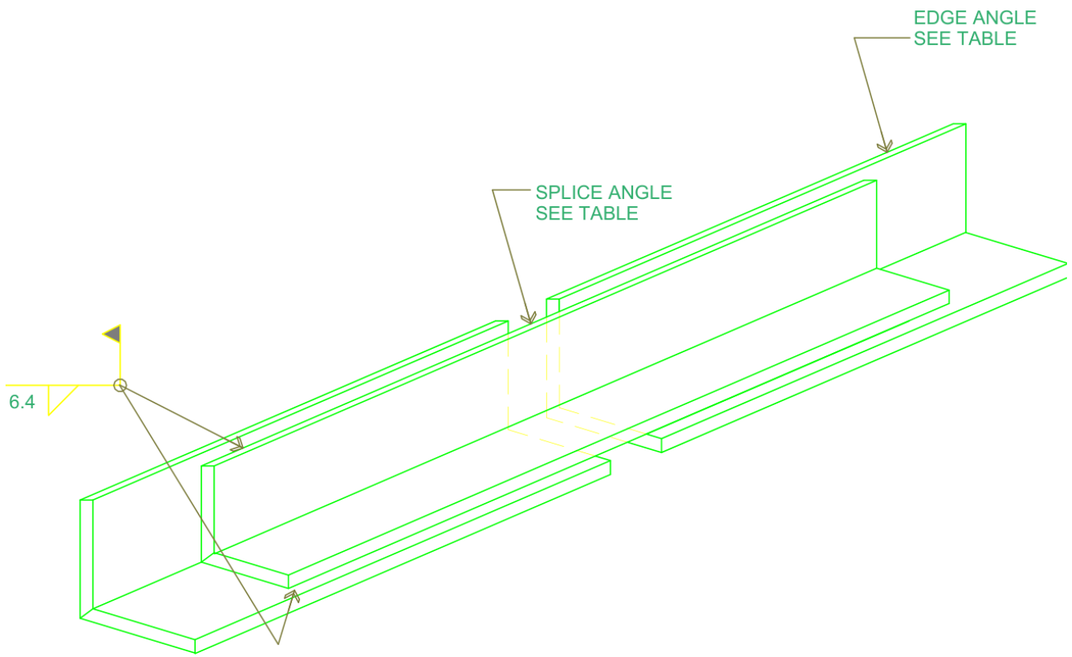

EDGE ANGLE	SPLICE ANGLE
L102 x 102 x 6.4	L76 x 76 x 9.5 x 300 LONG
L102 x 102 x 9.5	L76 x 76 x 13 x 450 LONG
L152 x 102 x 9.5 (OR L102 x 102 x 12.7)	L152 x 102 x 9.5 x 600 LONG (OR L102 x 102 x 12.7 x 600 LONG)
L152 x 102 x 13	L152 x 102 x 13 x 600 LONG

Your template view

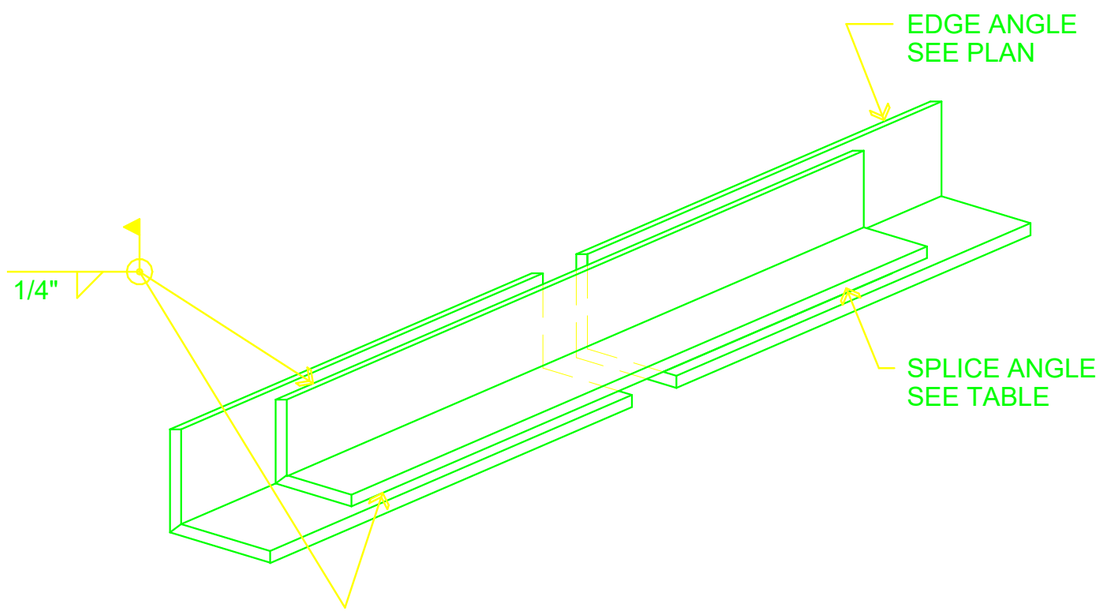

L 3 x 3 x 1/4"	L 2 x 2 x 3/8" x 18" LONG
L 3 x 3 x 3/8"	L 2 x 2 x 1/2" x 18" LONG
L 4 x 4 x 1/4"	L 3 x 3 x 3/8" x 18" LONG
L 4 x 4 x 3/8"	L 3 x 3 x 1/2" x 18" LONG
L 5 x 5 x 1/4"	L 4 x 4 x 3/8" x 18" LONG

What differs: same isometric; old metric 4-row table (L102x102x6.4..L152x102x13, 6.4 weld); candidate imperial 5-row (L3x3x1/4..L5x5x1/4, 1/4"), blank headers


Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____

58 of 61 OLD CATALOGUE: KOR-D-00436 - STEEL - TYPICAL MECH. UNIT SUPPRORT (ROOF OPENINGS)


Your template: TYP. MECH. UNIT SUPPORT (ROOF OPENINGS) (Steel R24; on no sheet)


In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.


Old catalogue (what drafters had)

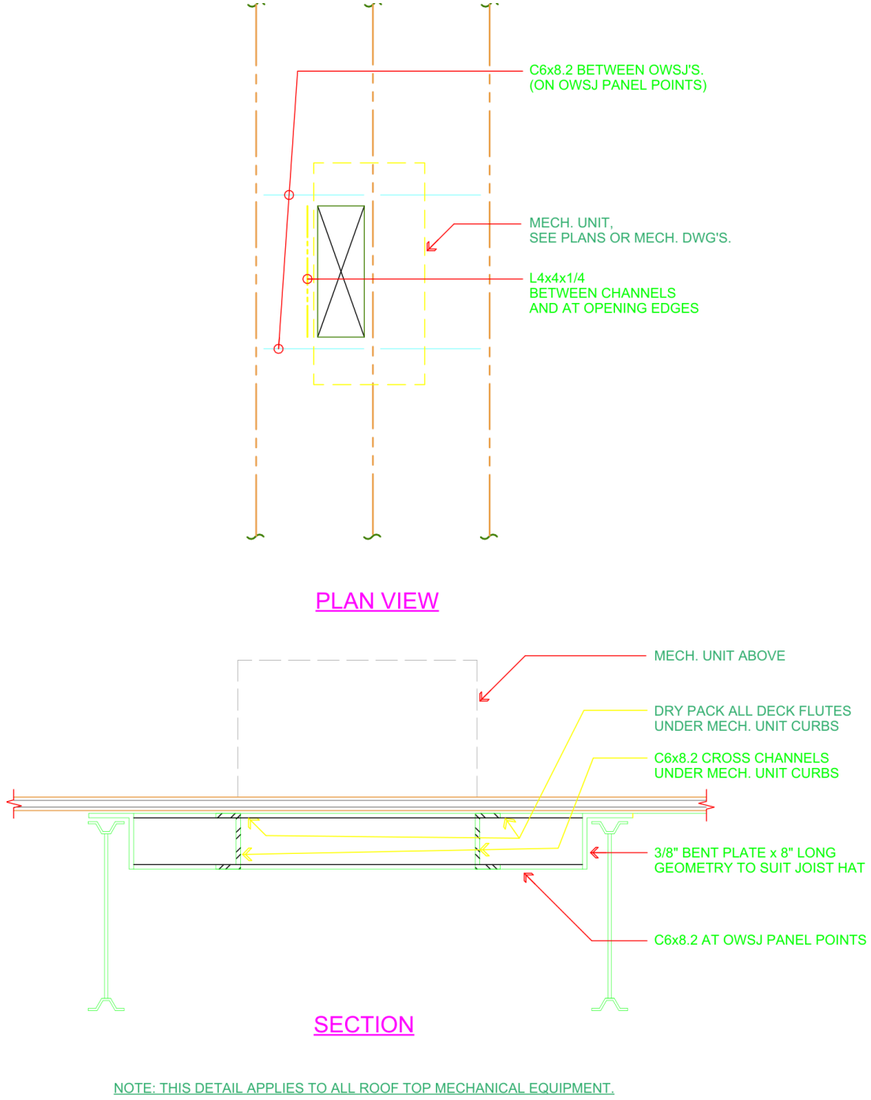

Your template view

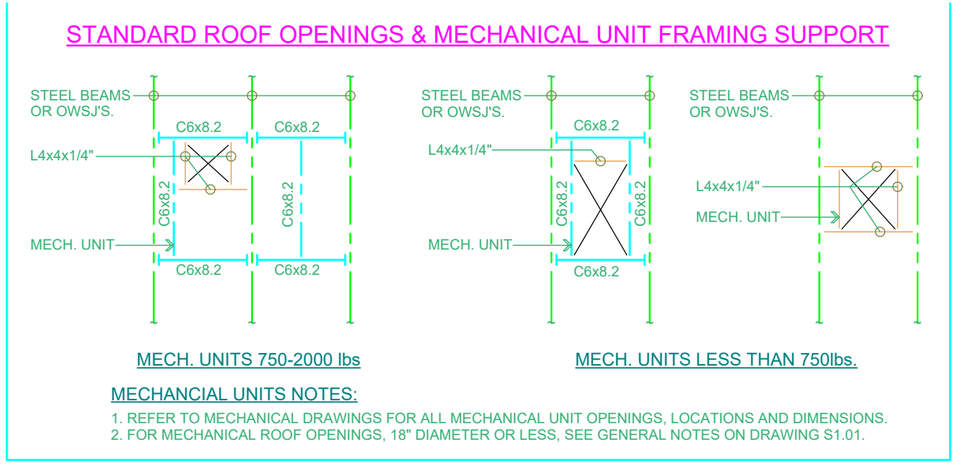

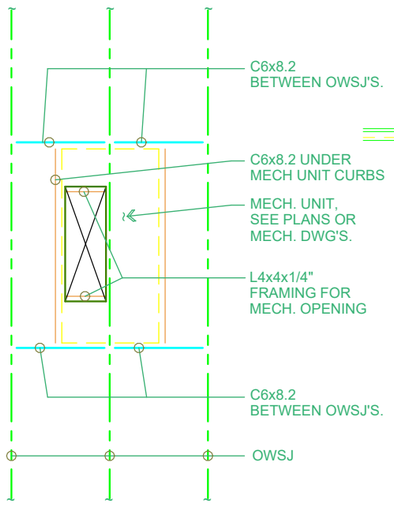

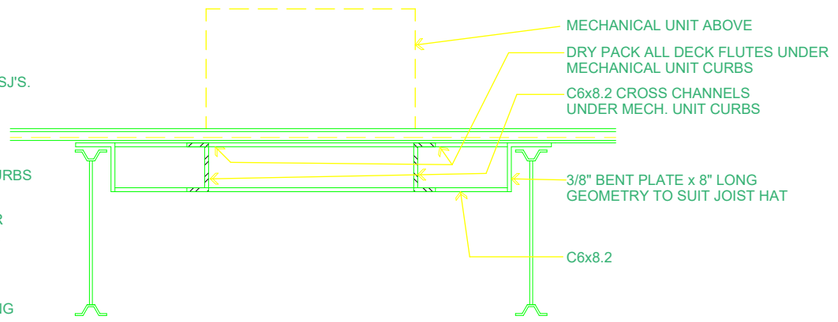

What differs: old plan+section appear inside; candidate adds 750-2000 lb / <750 lb framing cases box and notes; L4x4 label reworded


Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____

59 of 61 OLD CATALOGUE: KOR-D-00438 - STEEL DECK TO CONC. ROOF CONNECTION


Your template: TYP. CONNECTION FOR STEEL DECK TO CONC. WALL (Steel R24; on no sheet)

In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.

Old catalogue (what drafters had)

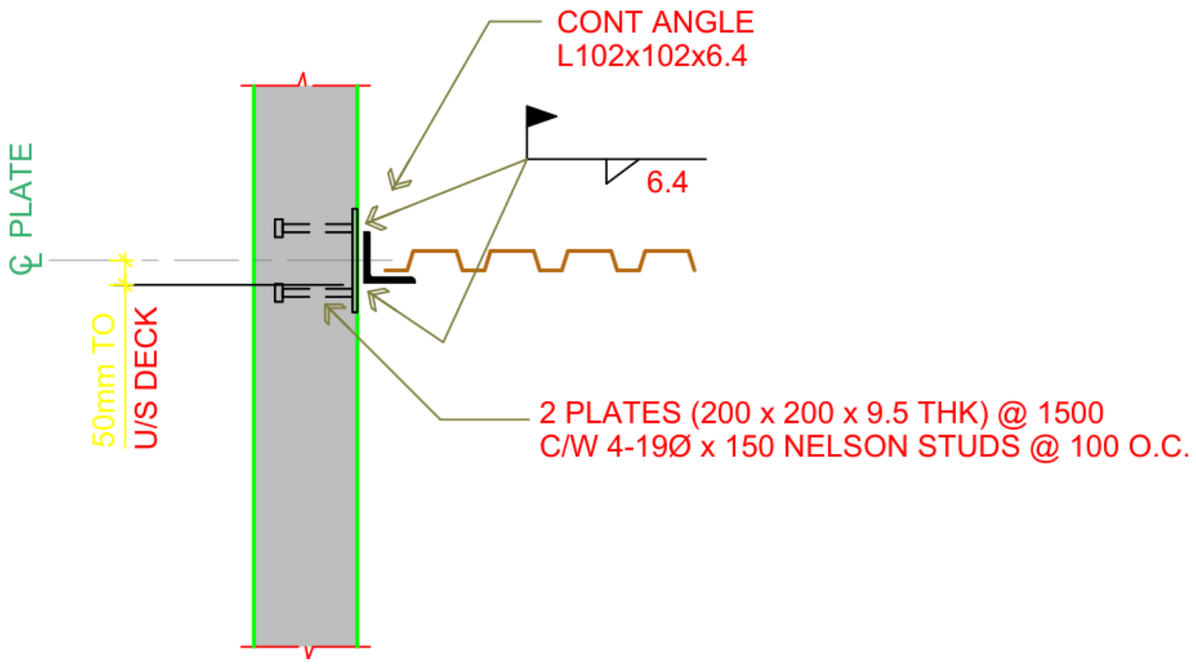

Your template view

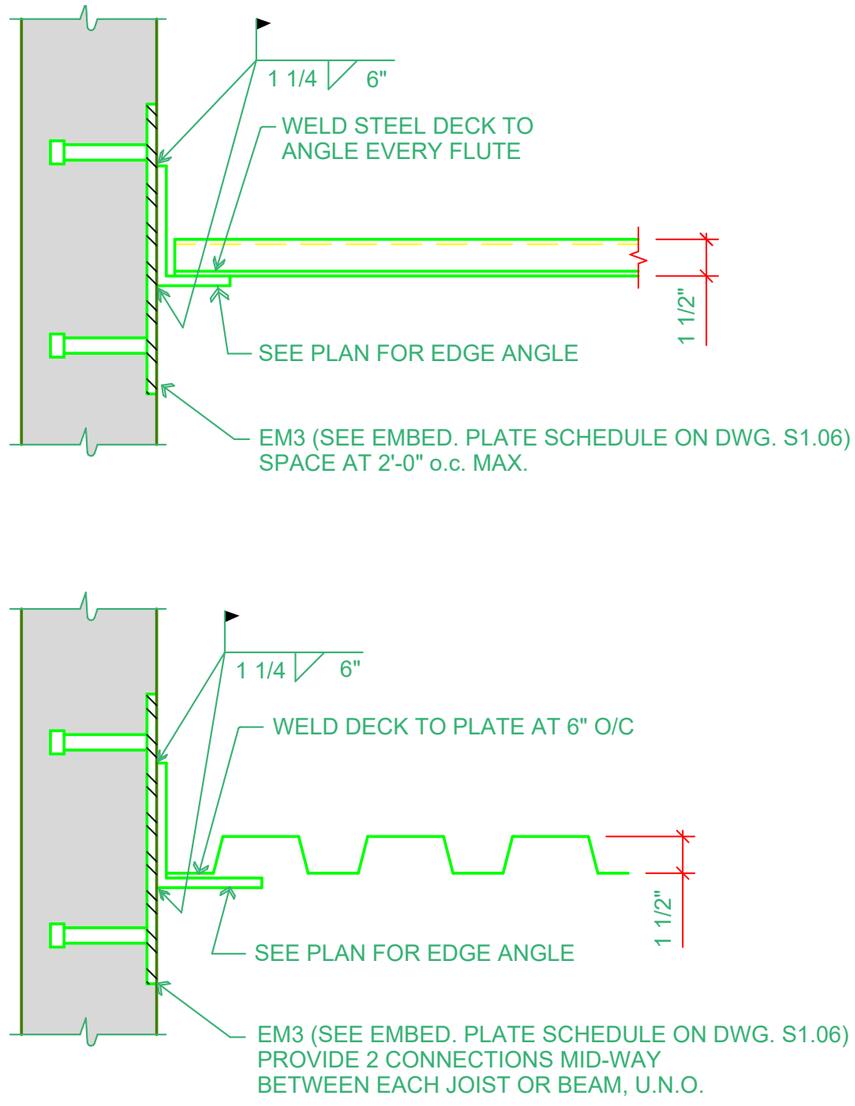

What differs: old: one case, L102x102x6.4 on 200x200x9.5 plates w/ 4-19 studs @1500, 6.4 weld; candidate: two deck cases, EM3 schedule plates, 1-1/4@6 stitch, imperial


Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____

60 of 61 OLD CATALOGUE: KOR-D-00450 - TYPICAL STEEL COLUMN BASE PLATE DETAILS


Your template: TYP. STEEL COLUMN BASE PLATE U.N.O. (Steel R24; on no sheet)

In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.

Old catalogue (what drafters had)

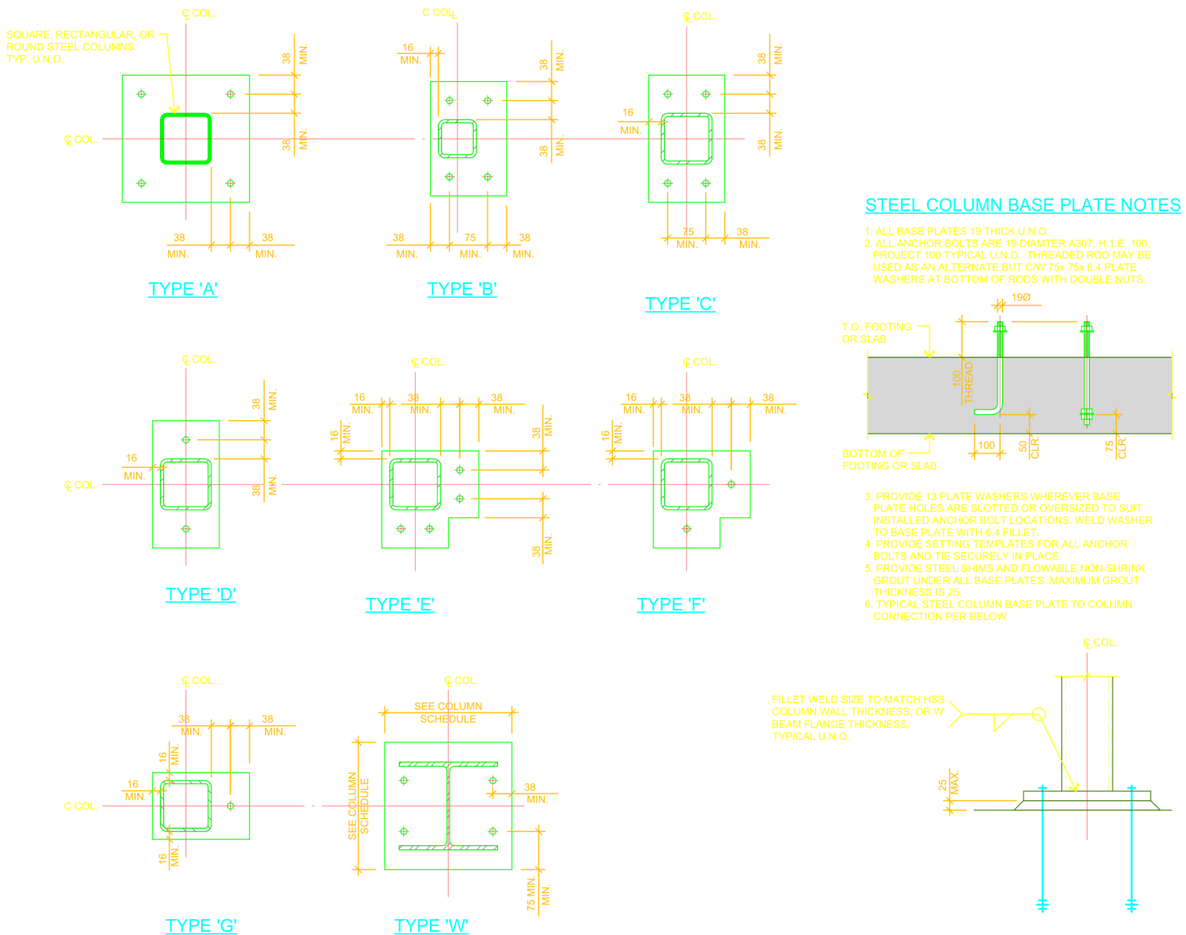

Your template view

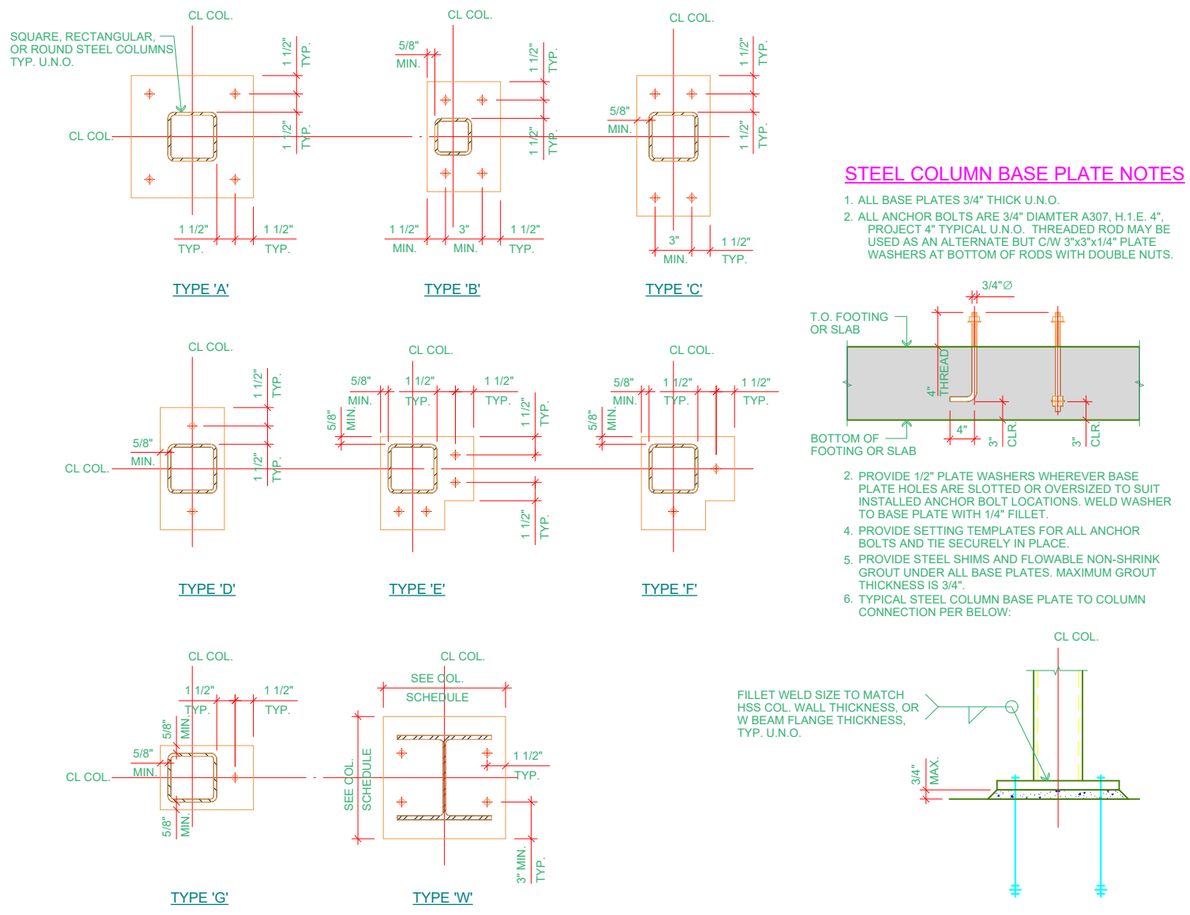

What differs: same 8 types A-G,W, same 6 notes and section, but metric (38/16/75, 19 dia, 25 grout) vs candidate imperial (1 1/2"/5/8"/3", 3/4", 3/4")


Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____

61 of 61 OLD CATALOGUE: KOR-D-00451 - TYPICAL STEEL COLUMN FOOTING


Your template: TYPICAL COLUMN BASE AT FOOTING (Steel R24; on no sheet)

In the new file: YES, brought in as a placeable detail? NO - this variant is in your template only; the old catalogue's version is what drafters had.

Old catalogue (what drafters had)

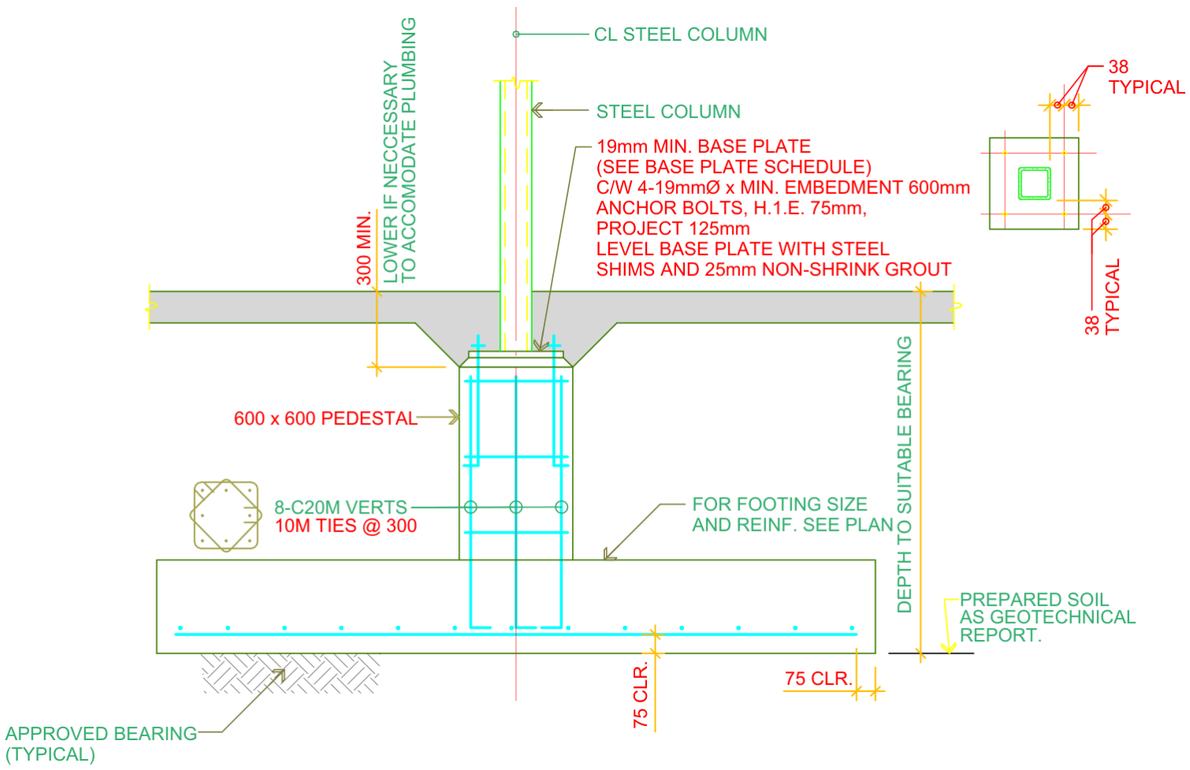

Your template view

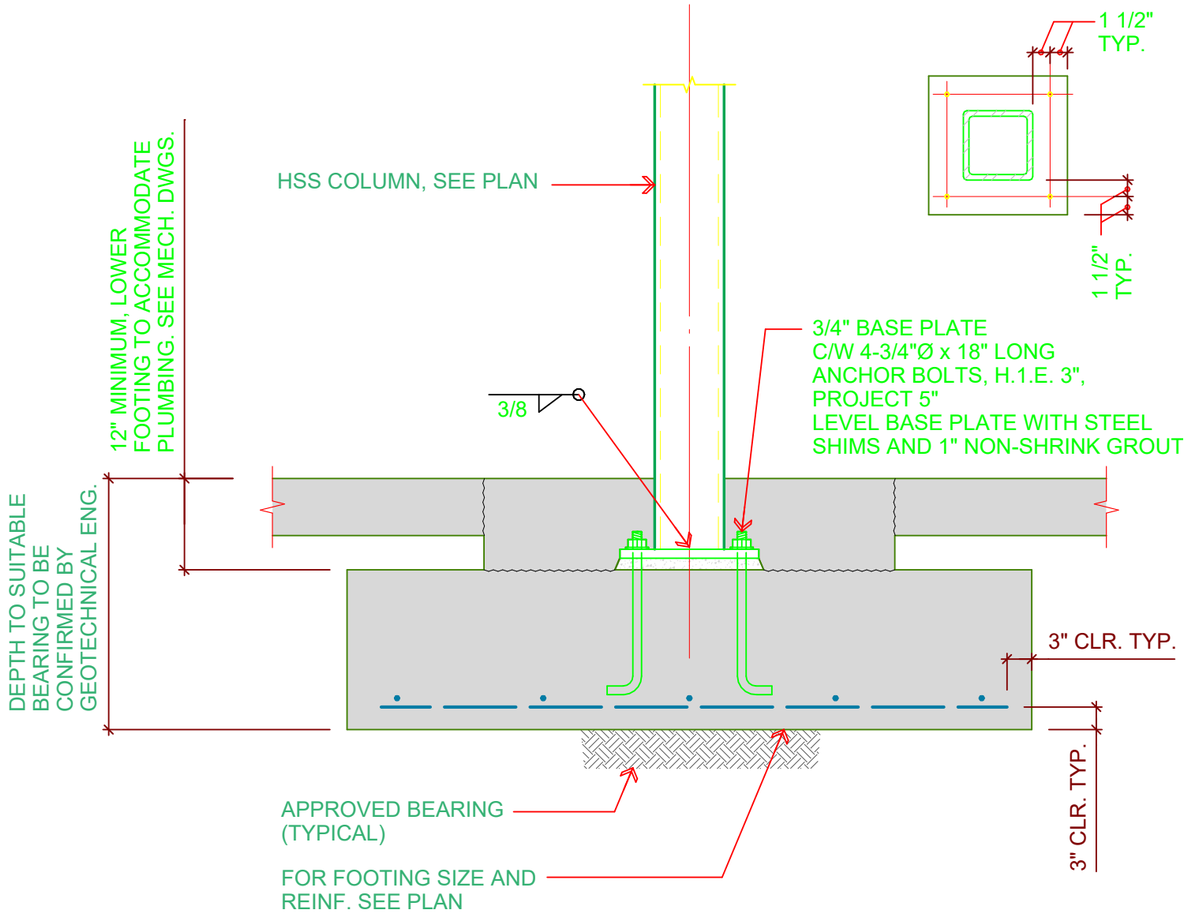

What differs: candidate omits 600x600 pedestal with 8-C20M verts/10M ties@300; imperial (3/4" plate, 4-3/4"x18" bolts, 3" clr); adds 3/8 weld

Answer: [ ] Keep the old catalogue's version [ ] Your template's version is right [ ] Both wrong / other: _____