Instruction Manual

for the

Aquaprobe® AP-7000 Multiparameter Water Quality Probe and associated

Aquameter[®], Utilities & Accessories

Aquameter® Software Version 6.00 and Above AP-7000 Software Version 4.00 and Above

Document No. 10401-00894

Revision: K

Date: February 19, 2015



P.O. Box 4, 6987 ZG Giesbeek Nijverheidsstraat 30, 6987 EM Giesbeek, The Netherlands

T +31 313 880200

F +31 313 880299

E info@eijkelkamp.com

I http://www.eijkelkamp.com

PROPRIETARY NOTICE

The information disclosed within this document or separately supplied in furtherance of this document includes proprietary rights of Aquaread[®] Ltd. Neither this document nor the information disclosed herein or of a supplementary nature shall be reproduced or transferred to other documents or used for any other purposes, except as specifically authorised in writing by Aquaread[®] Ltd. Copyright 2015 Aquaread[®] Ltd. All rights reserved.

SOFTWARE LICENCE AGREEMENT

By using the Aquameter[®], its associated probes and PC based software (AquaLink), you agree to be bound by the terms and conditions of the following software licence agreement. Please read this agreement carefully.

Aquaread® Ltd grants you a limited license to use the software embedded in the devices (the "Software") in binary executable form in the normal operation of the products. Title, ownership rights and intellectual property rights in and to the Software remain in Aquaread® Ltd.

You acknowledge that the Software is the property of Aquaread[®] Ltd and is protected under British copyright laws and international copyright treaties. You further acknowledge that the structure, organisation and code of the Software are valuable trade secrets of Aquaread[®] Ltd.

You agree not to decompile, dissemble, modify, reverse assemble, reverse engineer or reduce to human readable form the Software or any part thereof or create any derivative works based on the Software.

RECYCLING



Any product bearing this symbol must be handed over to an applicable collection point for the recycling of electrical and electronic equipment. By ensuring this product is disposed of properly, you will prevent possible adverse consequences for the environment which could be caused by inappropriate waste handling.

Note: For return for recycling, please contact Aquaread® Ltd for instructions on how to return end-of-life equipment, accessories, and all auxiliary items for proper disposal.

WARNING

Favourable indications made by this equipment **do not guarantee** water is safe for human or animal consumption. This equipment **can not** detect the presence of harmful bacteria or toxins. If in doubt, **ALWAYS TREAT SUSPECT WATER PRIOR TO CONSUMPTION**.

Limitations of Liability

Aquaread® Ltd and its affiliates specifically disclaim liability for any and all direct, indirect, special, general, incidental, consequential, punitive or exemplary damages including, but not limited to, loss of profits or revenue or anticipated profits or revenue or expenses incurred arising out of the use or inability to use any Aquaread® product, miscalibration, loss of data or product failure, even if Aquaread® Ltd and/or its affiliates has been advised of the possibility of such damages or they are foreseeable or for claims by any third party. Notwithstanding the foregoing, in no event shall Aquaread® Ltd and/or its affiliates aggregate liability arising under or in connection with Aquaread® products, regardless of the number of events, occurrences, or claims giving rise to liability, be in excess of the price paid by the purchaser for the Aquaread® product.

TRADEMARKS

Aquaread®, AquaPlus™, Aquameter®, Aquaprobe®, AquaLink™ and RapidCal™ are all trademarks of Aquaread® Ltd.

Microsoft®, Windows® and Excel® are trademarks of Microsoft Corporation

GOOGLE™ is a trademark of Google, Inc. StablCal® is a trademark of the HACH company

Aguaread[®] Ltd has no affiliation with Microsoft Corporation, Google, Inc. or HACH

Table of Contents

1. INTRODUCTION	8
2. WHAT'S IN THE BOX?	8
2.1. The Aquameter® and the Environment 2.2. The AP-7000 and the Environment 2.3. About the Probe Sleeve and Sleeve End Cap 2.4. Top Tips for successful measurements using optical electrodes 2.5. Important Notes Regarding Long-Term Deployment	8 8
3. BATTERY INSTALLATION AND CARE	12
3.1. Choice of Battery Type 3.2. Battery Life 3.3. Battery Condition Icon 3.4. Battery Saver Functions.	
4. OVERVIEW OF THE OPERATING SYSTEM	
4.1. INITIAL SWITCH ON, LANGUAGE AND CLOCK SETUP	
5. CONNECTING AN AP-7000	
5.1. AP-7000 DEPLOYMENT.	
6. TAKING MEASUREMENTS	
6.1. What Does It All Mean? 6.2. Trend Indication.	
6.3. Global Stability Indication	
6.4. Temperature Compensation	
7. DEPTH MEASUREMENT	
7.1. Taking Depth Measurements	19
7.2. Differential Depth Measurement	
8. MEMORY MODE	
8.1. Manually Saving Readings	
8.3. Recalling GLP Data	
8.4. Clearing the Memory	
8.5. Automatic Data Logging	
8.6. Battery and Memory Duration in Low Power Logging Mode	
9. SETUP & INSTALL	24
9.1. Setting Units of Measurement	24
9.2. AUX Socket Assignment	25
10. RAPIDCAL CALIBRATION METHOD	27
10.1. About Calibration	
10.2. Special Notes Concerning ISE Electrodes	
To Calibrate the 100% Saturation Point in Damp Air	
10.4. Calibration Error Messages	30
10.5. Resetting to Factory Calibration Defaults	
10.6. Calibration Data Storage	
11. AFTER USE	
12. THE AP-7000 AUTOMATIC CLEANING SYSTEM	
12.1. Wiper Removal and Replacement	33

12.2. Important Notes Regarding Long-Term Deployment	36
13. PH/ORP ELECTRODE CALIBRATION AND MAINTENANCE	37
13.1. Recognising the pH/ORP Electrode.	37
13.2. Electrode Removal and Replacement	
13.3. Keeping the Electrodes Moist	
13.4. Calibrating pH	
13.4.1. Special Notes Concerning ISE Electrodes during pH Calibration	
13.4.2. Calibrating the First Point (pH 7.00)	
13.4.3. Calibrating the Second Point	
13.4.4. Calibrating the Third Point	
13.5. Errors During Calibration	
13.6. PH ELECTRODE EFFICIENCY.	
13.7. Servicing the pH Electrode.	
13.8. CALIBRATING ORP	
14. DO/EC ELECTRODE CALIBRATION AND MAINTENANCE	
14.1. Recognising the DO/EC Electrode	
14.2. DO Measurement Technique	
14.3. Precautions During Use	
14.4. CALIBRATING THE DO/EC ELECTRODE	
14.5. CALIBRATING THE DO ZERO FOINT	
14.7. REPLACING THE OPTICAL DO CAP	
14.8. Calibrating EC	
14.9. Errors During Calibration.	
14.10. Cleaning the EC Contacts.	
15. OPTIONAL OPTICAL ELECTRODES CALIBRATION AND MAINTENANCE	
15.1. TOP TIPS FOR SUCCESSFUL MEASUREMENTS USING OPTICAL ELECTRODES.	
15.2. Optical Electrode Calibration Sequence	
15.3.1. About Turbidity	
15.3.2. Precautions During Use	
15.3.3. Negative Turbidity Readings	
15.3.4. Calibrating the Turbidity Electrode	
15.3.5. Calibration Points.	
15.3.6. Turbidity Zero Point Calibration	
15.3.7. Verifying the Zero Calibration	
15.3.8. Calibrating the Turbidity 20 NTU & 1000 NTU Points	
15.3.9. Errors During Calibration	
15.3.10. Lens and Sleeve Maintenance	57
15.3.11. References	
15.4. 7000-BGA-PC Freshwater Blue-Green Algae (phycocyanin) Electrode	
15.4.1. Principle of Operation	58
15.4.2. Limitations of Use	58
15.4.3. Calibrating the BGA-PC Electrode	58
15.4.4. Calibration Solution Preparation	59
15.4.5. Serial Dilution	59
15.4.6. Zero Point Calibration	
15.4.7. Calibrating Point 2	
15.4.8. Errors During Calibration	
15.4.9. Lens and Sleeve Maintenance	
15.5. 7000-BGA-PE SALTWATER BLUE-GREEN ALGAE (PHYCOERYTHRIN) ELECTRODE	
15.5.1. Principle of Operation	
15.5.2. Limitations of Use	
15.5.3. Calibrating the BGA-PE Electrode	
15.5.4. Calibration Solution Preparation	
15.5.5. Serial Dilution	
15.5.6. Zero Point Calibration	
15.5.7. Calibrating Point 2	66

15.5.8. Errors During Calibration	
15.5.9. Lens and Sleeve Maintenance	
15.6. 7000-CPHYLL Chlorophyll Electrode	
15.6.1. Principle of Operation	
15.6.2. Limitations of Use	
15.6.3. Calibrating the CPHYLL Electrode	
15.6.4. Calibration Solution Preparation	
15.6.5. Serial Dilution	
15.6.6. Zero Point Calibration	
15.6.7. Calibrating Point 2	
15.6.8. Errors During Calibration	
15.6.9. Lens and Sleeve Maintenance	
15.7. 7000-RHOD RHODAMINE ELECTRODE.	
15.7.1. Principle of Operation	
15.7.2. Limitations of Use	
15.7.3. Calibrating the RHOD Electrode	
15.7.4. Calibration Solution Preparation	
15.7.5. Serial Dilution	
15.7.6. Zero Point Calibration	
15.7.7. Calibrating Point 2	
15.7.8. Errors During Calibration	
15.7.9. Lens and Sleeve Maintenance	
15.8.1. Principle of Operation	
15.8.3. Calibrating the FSCEIN Electrode	
15.8.4. Calibration Solution Preparation	
15.8.5. Serial Dilution	
15.8.6. Zero Point Calibration	
15.8.7. Calibrating Point 2	
15.8.8. Errors During Calibration	
15.8.9. Lens and Sleeve Maintenance	
15.9. 7000-REFOIL Refined Oil Electrode.	
15.9.1. Principle of Operation	
15.9.2. Limitations of Use	
15.9.3. Special Precautions When Using the REFOIL Electrode	
15.9.4. Calibrating the REFOIL Electrode	82
15.9.5. Calibration Solution Preparation	82
15.9.6. Serial Dilution	82
15.9.7. Zero Point Calibration	83
15.9.8. Calibrating Point 2	84
15.9.9. Errors During Calibration	
15.9.10. Lens and Sleeve Maintenance	
15.10. 7000-CDOM/FDOM CHROMOPHORIC (FLUORESCENT) DISSOLVED ORGANIC MATTER	
15.10.1. Principle of Operation	
15.10.2. Limitations of Use	
15.10.3. Calibrating the CDOM Electrode	
15.10.4. Calibration Solutions	
15.10.5. Zero Point Calibration	
15.10.6. Calibrating Point 2	
15.10.7. Errors During Calibration	
15.10.8. Lens and Sleeve Maintenance	89
6. OPTIONAL ISE ELECTRODES CALIBRATION AND MAINTENANCE	90
16.1. ISE Electrode Limitations	Qſ
16.2. Calibration Points	
16.3. Special Notes Concerning ISE Electrodes.	
16.4. 7000-AMM Ammonium/Ammonia Electrode.	
16.4.1. Ammonium Calibration Solution Preparation.	
16.4.2. Three-point Calibration	
Point 2	
POINT 2	03

16.4.3. Two-point Calibration	
16.4.4. Single-point Calibration	94
16.4.5. Errors During Calibration	
16.5. 7000-NIT Nitrate Electrode	
16.5.1. Nitrate Calibration Solution Preparation	
16.5.2. Three-point Calibration	
Point 2	
Point 3	97
16.5.3. Two-point Calibration	98
16.5.4. Single-point Calibration	98
16.5.5. Errors During Calibration	
16.6. 7000-CHL Chloride Electrode.	
16.6.1. Chloride Calibration Solution Preparation	
16.6.2. Three-point Calibration	
Point 2	
Point 3	
16.6.3. Two-point Calibration	
16.6.4. Single-point Calibration	
16.6.5. Errors During Calibration	
16.7. 7000-CAL Calcium Electrode.	
16.7.1. Calcium Calibration Solution Preparation	
16.7.2. Three-point Calibration	
Pont 2.	
POINT 3	
16.7.3. Two-point Calibration	
16.7.4. Single-point Calibration	
16.7.5. Errors During Calibration	
16.8. 7000-FLU Fluoride Electrode	
16.8.1. Fluoride Calibration Solution Preparation	
Pont 2	
Point 3	
16.8.3. Two-point Calibration	
16.8.4. Single-point Calibration	
16.8.5. Errors During Calibration	
17. AQUALINK PC SOFTWARE	111
17.1. Downloading AquaLink TM PC Software from the Aquaread® website	111
17.2. Software Installation.	
17.3. Driver Installation.	
17.4. Running AquaLink.	
17.5. Uploading Data From Your Aquameter®	
17.6. Displaying GPS Co-ordinates.	
17.7. On Screen Help.	
17.8. Saving Logged Data	
17.9. Retrieving Logged Data	
17.10. Exporting Data.	
17.11. Exporting Text Reports.	
17.12. Typical Text Report Cover Page.	
17.13. Exporting Excel® Files.	
17.14. Exporting Google TM Files.	
17.15. Importing Files into Google TM Earth.	
17.16. Google TM Examples.	
18. LIMITED WARRANTY	
18.1. Cleaning Prior To Return.	118
18.2. Decontamination Certificate.	119
19. TROUBLESHOOTING	120
20. DECLARATION OF CONFORMITY	121
21. APPENDIX 1. THE TECH BEHIND AQUAREAD'S OPTICAL DO MEASUREMENT SYSTEM	122

Aquaprobe® AP-7000 Instruction Manual	10401-00894 Rev K
21.1. Principle of Operation.	122
21.2. Sensor Cap Life	123
22. APPENDIX 2. FITTING AUX ELECTRODES	124
22.1. Socket Assignment and Calibration	125
23. APPENDIX 3. STANDARD ELECTRODES DETAILED SPECIFICATION	126
24. APPENDIX 4. OPTICAL ELECTRODES DETAILED SPECIFICATION AND F	AQS127
24.1. What are the excitation and detection wavelengths?	
24.2. How does the Refined Oil sensor work?	127
24.3. I can see algae in the water but my sensor is giving low readings. Why?	128
24.4. What is the Range and Resolution of the Optical Electrodes?	
24.5. What is the Accuracy of the Optical Electrodes?	129
25. APPENDIX 4. ISE ELECTRODES DETAILED SPECIFICATION	130
25.1. Special Notes Concerning ISE Electrodes and pH Buffer Solutions	131

1. Introduction

This manual covers the setup, operation, calibration and maintenance of the Aquaprobe[®] AP-7000 V4.00+, Aquameter[®] V6.00+ Meter, AquaLink V4.00+ PC software and associated Aquaprobe[®] accessories. If your Aquaprobe[®] or Aquameter[®] are running earlier software, the functionality may differ from that shown in this manual. In this case, contact Aquaread for an earlier version of this manual or return your equipment for software upgrade.

2. What's in the Box?

The Aquameter® is supplied with the following:

- > The Aquameter® unit.
- Quick release lanyard.
- > Set of 5 AA Alkaline batteries.
- USB Cable for downloading logged data to a PC.
- Cross-head screwdriver for fitting the batteries and Probe maintenance.
- > Getting started card for quick reference.

The AP-7000 is supplied with the following:

- Protective Sleeve End Cap (pre fitted).
- > 600mL of RapidCal Solution.
- Two part calibration / rinse cup.
- One mounting nut (pre-fitted).
- Mounting Bracket

To complete your system, you will also need an AP-7000 Extension Cable, which should be purchased separately.

2.1. The Aquameter® and the Environment

The Aquameter® is designed to be used outdoors and is rated to IP67, that is to say it is waterproof but it is not designed for submersion. In order to prevent accidental dunking or loss, a lanyard is supplied. Please note that the socket on the Aquameter® is only waterproof when the associated plug is fitted. Without the plug fitted, water can enter the socket. Damage caused by water ingress through the socket is not covered by your warranty.

You may notice a small hole on the rear of the unit near the top. This is a waterproof vent for the internal barometric sensor. **Do not poke anything in this hole!** Doing so will cause major damage to the vent's waterproof membrane and invalidate your warranty.

2.2. The AP-7000 and the Environment

The AP-7000 is designed to be fully submerged in water and is rated to IP68, that is to say, it is rated for continual immersion to a depth of 30 meters, and short term immersion to 100 meters. During deployment, the AP-7000 can be suspended by the Extension Cable, but in order to provide a fail-safe for the plug and socket, always Ty-wrap the Extension Cable to the bracket just above the plug.

2.3. About the Probe Sleeve and Sleeve End Cap

The AP-7000 is constructed with an aluminium sleeve surrounding the delicate sensing electrodes. The Sleeve can be easily removed by unscrewing to allow cleaning of the individual electrodes, however, The Probe sleeve, end cap and wiper form an integral, working part of the Probe's optical and EC measurement system, and MUST be fitted during calibration and measurement for correct operation.

All Aquaread® Optical Electrodes are incredibly sensitive. For example, the Turbidity electrode is capable of measuring between 0 and 3000NTU with an internal resolution of greater than 0.1NTU. This means that the electrode is able to detect changes in turbidity that are less than 0.003% of the full range! The other optical electrodes have a similar level of sensitivity.

It follows, therefore, that in order to provide stable, repeatable readings, the environment in which the measurements are made must be completely stable and repeatable.

For this reason, the AP-7000 is constructed with a matt black aluminium sleeve and end cap that enclose the sensing electrodes and provide a closed, constant condition, non reflective measurement chamber.


In order to obtain consistent results, the measurement chamber created within the Aquaprobe® must remain physically constant during both calibration and measurement. It is therefore essential that both the sleeve and sleeve end cap are fitted during calibration and operation of all types of optical electrodes.

If an optical electrode is calibrated under one set of conditions then used to measure under another set of conditions, the readings will naturally be erroneous, especially at low concentrations.

A perfect example of this is calibrating with the end cap removed then measuring with the end cap fitted (or

vice-versa). By changing the physical characteristics of the measurement chamber, you also change the calibration and response of the electrode.

Another particular problem when trying to measure very low concentrations is air in the form of both visible and microscopic bubbles. These act like tiny prisms and can refract and reflect both the excitation light and the return signal being measured. The photograph to the right was taken in a calibration tube after fresh water was poured in. The bubbles are clearly visible in the light beam.

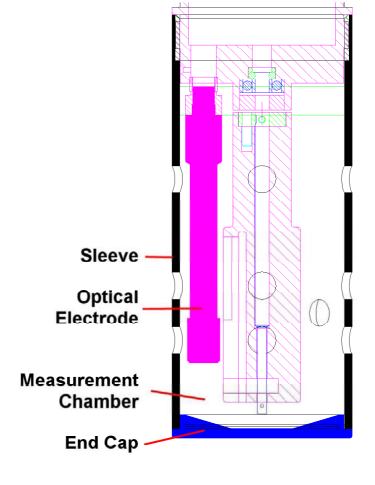



2.4. Top Tips for successful measurements using optical electrodes

- > Always keep the measurement chamber and electrode lenses clean.
- Always fit the sleeve and end cap during both calibration and measurement.
- Always allow the readings to settle completely during both calibration and measurement.
- > Always try to eliminate air bubbles by activate the self-cleaning mechanism.
- ➤ Always calibrate and zero the electrode as close to your sample temperature as possible. This is especially important with the Ref-Oil electrode.
- Always zero the optical electrodes just prior to use in clean water (bottled still mineral water is ideal) then deploy without disturbing the measurement chamber. This is especially important when using the Turbidity and Ref-Oil electrodes.

2.5. Important Notes Regarding Long-Term Deployment

Whilst the AP-7000 features an effective electrode cleaning system, the Probe should not be deployed and left for extended periods without regular checking, calibration and maintenance.

The time period between maintenance visits depends heavily upon the deployment conditions. For example, if the Probe is deployed in clean water, the only necessity should be regular single point calibration of the electrodes. This should be done every 4-6 weeks.

If the Probe is deployed in water that is polluted, silt-laden or heavily affected by algal growth, maintenance visits should be much more frequent.

It is very important to keep the cleaning brushes in good condition. The brushes should be replaced as soon as they show any signs of clogging or deterioration.

Likewise, it is very important to keep the inside of the Probe Sleeve and End Cap clean and free from any build up of algae or silt.

The Probe Sleeve and End Cap form an integral part of the optical measurement system. If they are allowed to become excessively dirty, the accuracy of your readings will be affected.

It is strongly recommended that after initial deployment, maintenance visits are made on a weekly basis in order to assess the rate of fouling. After several weeks, it should be possible to establish the optimum time interval for routine maintenance at any given site.

All ion selective electrodes (ISE) exhibit calibration drift over time. Drift should not be a major problem where the electrodes can be frequently calibrated. However, if the electrodes are to be used in long-term deployment studies, drift is almost certain to occur.

Also remember, in order to achieve accurate readings with ISE electrodes, the Probe needs to be placed in flowing water with a minimum flow rate of 0.3m/s over the electrode.

If there is no water flow across an ISE electrode, the ions in the immediate area of the electrode will be depleted and the readings will start to fall.

During long term deployment of ion selective electrodes, the user should obtain grab samples during the course of the deployment for analysis in the laboratory by chemical means and use the results to apply post calibration to the recorded results.

During long term deployment, the AP-7000 can be suspended by the Extension Cable, but in order to provide a fail-safe for the plug and socket, always Ty-wrap the Extension Cable to the bracket just above the plug.

3. Battery Installation and Care

The Aquameter® requires five AA size batteries. To install the batteries, loosen the two screws on the centreline of the rear of the meter and remove the battery compartment lid. Following the battery polarity markings inside the battery compartment, insert five AA cells then replace the compartment lid and tighten the screws.

3.1. Choice of Battery Type

Good quality alkaline batteries must be used. Never use rechargeable batteries as they do not provide enough voltage to power the AP-7000's cleaning mechanism.

If the Meter is to be out of use for a long period, remove the batteries to prevent damage due to possible leakage.

3.2. Battery Life

A set of fresh alkaline cells will give up to 12 hours use in the AM-200 GPS Aquameter® when used in conjunction with the AP-7000.

3.3. Battery Condition Icon

On all the main Aquameter® screens, a battery condition icon is displayed in the top left corner. The icon shows full when the batteries are fresh, and gradually empties as the batteries are used. When the batteries need replacing, the empty battery icon will flash on and off. If you ignore this, the Meter will automatically switch itself off when the battery voltage becomes too low for reliable operation.

3.4. Battery Saver Functions

The Aquameter® is designed to switch off automatically if you do not touch any of the keys for 30 minutes. The only exception to this is if you have activated the Automatic Data Logging feature. In this case, the Meter will continue to operate until either the memory is full or the batteries go flat.

The display on the Aquameter[®] incorporates a white backlight to improve visibility in low-light conditions. As on a mobile phone, the backlight switches on each time a key is pressed, and stays on at full brightness for 15 seconds. After 15 seconds, the backlight will fade to half brightness. After a further 15 seconds the backlight will switch off.

During normal operation, if you want to activate the backlight without changing the Meter function, simply press the **ESC** key.

4. Overview of the Operating System

The operating software in the Aquameter® has been designed for simple, intuitive use. Similarly, a great deal of development work has been put into simplifying and automating the calibration procedures in the Aquameter® in order to allow normal field operatives (as opposed to trained lab technicians) to achieve guick and accurate results.

If you are used to operating a mobile phone or programming audio/visual equipment using a remote control, you should feel at home with the familiar up/down left/right arrow shaped navigation keys and central **OK** key.

The tree structure behind the **MENU** key should also be very familiar. Each item on the menu leads to a sub menu and then either onto further menus or final choices. Each branch of the menu system is navigated using the arrow keys. At each point, selections can be made by either pressing the **OK** key or the right arrow key.

To reverse along a branch of the menu system, use the **ESC** (escape) key or left arrow key. After a short time, you should be able to navigate around the entire menu system at speed using just the four arrow keys. If, at any time, you leave the Meter in one of the submenu screens, it will automatically back out to the main operating screen after 15 seconds.

4.1. Initial Switch On, Language and Clock Setup

To switch the meter on or off, briefly press the red key. **Do not hold it down.** The meter contains a clock and is capable of operating in several different languages. When switching on for the first time, you must select an operating language and set the clock. The first screen you will see is the Language Selection Screen.

→ English Francais Deutsch Espanol

To select a language, move the cursor down the list using the down arrow key. To enter your selection, press the **OK** key or the right arrow key.

The next screen to be displayed is the Time & Date Setting Screen.

Time & Date

→ Time:15:46:37

Date:15/Jun/12

To set the time and date, use the arrow keys to move the cursor around the screen. Use the up and down arrow keys to adjust values. When the time and date are correct, press the **OK** key. Don't worry if you make a mistake first time round. You can easily get back to these screens later through the **MENU** key.

5. Connecting an AP-7000

The AP-7000 is designed to connect to the Aquameter® using an AP-7000 Extension Cable. The AP-7000 Extension Cable features high-pressure metal connectors, which incorporate several O-ring seals at the Probe end. Prior to first connection, the seals must be lubricated using the silicone grease supplied.



Apply a generous smear of grease to the O-rings where indicated above. Be careful not to get any grease inside the connector near the gold contacts. A small smear of grease should also be applied to the thread on the Probe to allow easy tightening of the collar.

To connect the Extension Cable to the AP-7000, align the coloured dot on the AP-7000 with the **◄AQUAREAD** logo on the plug body, then press the plug into the socket and tighten the retaining collar fully. Once the AP-7000 has been connected to the Extension Cable, the Aquameter® can be connected.

Always ensure the Aquameter[®] is switched off prior to connecting or disconnecting an AP-7000. Align the **◄AQUAREAD** logo on the plug body with the red on/off switch on the Aquameter[®], then press the plug into the socket and tighten the retaining collar.

Once the AP-7000 is connected to the Aquameter[®], switch the Meter on by pressing the red on/off switch. The Aquameter[®] should detect the Probe and start displaying readings.

5.1. AP-7000 Deployment

When you are ready to deploy the AP-7000, remove the mounting nut, fit the mounting bracket then replace and tighten the mounting nut. During deployment, the AP-7000 can be suspended by the Extension Cable, but in order to provide a fail-safe for the plug and socket, always Ty-wrap the Extension Cable to the bracket just above the plug.



6. Taking Measurements

The AP-7000 includes a pH/ORP electrode, which is kept moist by a storage cap. Remove the storage cap by pulling the red lanyard marked 'Remove Before Use / Replace After Use' straight down. **Do not use a twisting motion to remove or replace the cap as this can unscrew the electrode from the Probe body.** Rinse any salty deposits from the pH/ORP electrode with fresh water.

Fit the protective Sleeve End Cap into the end of the Probe sleeve. Switch the Aquameter® on and immerse the AP-7000 in the sample water, making sure that the water level covers the minimum immersion depth groove halfway up the Probe sleeve.

TIP: Occasional application of a smear of silicone grease or similar lubricant to the protective Sleeve End Cap thread will make fitting and removal of the Cap easier.

If the AP-7000 is connected correctly, the meter will read the Probe's serial number and model number, then will automatically configure itself to display only those readings the current AP-7000 is capable of taking. Initial Probe readings will be displayed on the meter's screen along with the current GPS status. The initial data screen for the GPS Aquameter® in conjunction with the AP-7000 is shown below.

Left/right arrows at the bottom corners of the screen indicate further data screens are available. To access these screens, simply press either the left or right arrow keys. Any value that is out of range or unavailable will be displayed as dashes. The other four screens available with the standard AM-200/AP-7000 combination are shown below.

```
DO:098.7% ↓
EC:6541μS/cm ↓
TDS:3271mg/L ↓
← GPS:3D Pos →
```

```
■ BARO:1013mb
DEPTH:01.75m
Hit [OK] to zero
← GPS:3D Pos →
```

Lat:N51 °21.498 Long:E001°24.323 Alt:00050M 1013mb ← Sats in use:09 →

6.1. What Does It All Mean?

The screens above show the full default range of readings for the AM-200/AP-7000 combination. If you are using a different Meter/Probe combination, you may have fewer screens to choose from and the readings may appear in a different order to facilitate logical screen layouts. If an asterisk (*) character is flashing just below the battery symbol, this indicates that Auto Data Logging is switched on. See Automatic Data Logging in section 8.

The table below explains the readings.

Prefix	Meaning	Units
TEMP	Probe Temperature	°C or °F*
рН	pH (Acidity/Alkalinity)	pH or pHmV*
ORP	Oxidation Reduction Potential	mV
GPS	GPS Status	See section 6.5
DO	Dissolved Oxygen	%Sat & mg/L
EC	Electrical Conductivity	μS/cm or mS/cm [†]
TDS	Total Dissolved Solids	mg/L or g/l [†]
SAL	Salinity	PSU or ppt*
SSG	Sea Water Specific Gravity	σt
BARO	Barometric Pressure	mb or mmHg*
DEPTH	Depth above / below zero datum	Meters / Feet*
Lat	Latitude	Degrees & Mins
Long	Longitude	Degrees & Mins
Alt	Altitude above Sea Level	Meters or Feet*

Items in the Units column marked with an asterisk (*) can be selected as alternative units of measurement in the Settings Menu (see section 9). Items in the Units column marked with a dagger (†) are auto-ranging, i.e. when the values become too large to display, the units of measurement automatically re-scale.

The EC field can be replaced by its reciprocal value, RES (Resistivity), if selected in the Settings Menu. If selected, readings will be displayed in either Ω -cm or K Ω -cm, depending on the value. See section 9 for more details.

6.2. Trend Indication

To the right of each reading, (except position, BARO and Depth), a trend indication is given. This consists of either an upwards facing arrow (which indicates the numeric value of the reading is rising), a downwards facing arrow (which indicates the numeric value of the reading is falling) or a two-headed arrow, which indicates a stable reading. Readings are judged to be stable when the variation over a ten second period drops below 1%.

6.3. Global Stability Indication

In addition to the individual trend indications, there is a global stability indication, which is displayed when **all** readings are stable. This takes the form of a flashing double headed arrow which is displayed at the start of the third line of the display.

When taking a set of readings, gently stir the Probe, or raise and lower it in the sample (if there is no natural water flow) until the global stability icon appears. The initial display of the global stability icon will be accompanied by a double beep. When this occurs, all values are stable and ready for reading or saving.

6.4. Temperature Compensation

The electrochemical properties of all solutions change with the solution's temperature. In addition, the response of electrochemical measuring electrodes change with temperature. It is a fundamental, practical requirement in the field of water quality monitoring that test measurements taken at different temperatures can be compared.

In order to facilitate this, the AP-7000 automatically applies corrections for temperature wherever required.

During three point calibration of the ISE electrodes, the variation in response of the electrodes due to temperature is automatically calculated. During measurement, the variation in response of the electrodes due to temperature is automatically compensated for.

During calibration of the EC electrode, the variation in the calibration buffer solution due to temperature is automatically corrected for. During measurement of EC, the readings can be displayed without any temperature correction, corrected to 20°C, or corrected to 25°C. See section 9 for more details.

During calibration of the DO electrode, variations due to temperature and air pressure are automatically compensated for. During the measurement of DO, temperature, air pressure and salinity are automatically compensated for.

During calibration of the ORP electrode, the variation in the calibration buffer solution due to temperature is automatically corrected for. During measurement of ORP however, temperature corrections are not applied as the correction factors are system and chemical dependent and are not easily determined.

ORP potential measurements are mostly made to follow reactions rather than for their own sake. The completion of an ORP reaction is normally accompanied by a sharp change in the ORP millivolts reading. This change is usually much larger than the errors induced by temperature side effects.

During calibration of the optical electrodes, variations in the calibration solutions due to temperature are automatically compensated for. During the measurement, temperature is automatically compensated for.

During calibration of the pH electrode, the small variation in the calibration buffer solutions due to temperature is not compensated for due to the differences in thermal coefficient between various buffer manufacturers. For this reason, the three pH points should be calibrated as close to the buffer manufacturer's specified temperature as possible (usually 20°C or 25°C) although a variation of up to +/-10°C makes very little difference in reality.

During pH measurement, temperature variation is automatically compensated for.

6.5. GPS Reception

The GPS version of the Aquameter® (AM-200) contains a built-in GPS receiver and antenna. The antenna is situated at the top of the case, just behind the AQUAREAD Logo. For optimum signal reception, the antenna must be able to 'see' a reasonably large amount of the sky. The GPS receiver will not work indoors or when shielded from the sky by any solid structure.

After switch-on, the GPS receiver will automatically start to search for satellites. During this phase, the message **GPS:Acquiring** will be shown on the bottom line of all the screens. As soon as three satellites are acquired, two dimensional position (no altitude) will be calculated and the message **GPS:2D POS** will be shown on the bottom line of the screens.

Once a fourth satellite is acquired, altitude will be calculated and **GPS:3D POS** will be shown on the bottom line of the screens. With a good view of the sky, position should be calculated within ninety seconds of switch-on. To see your geographic position and the number of satellites in use, use the left or right arrow keys to scroll to the Position page.

If you switch the meter on indoors, then carry it outside after several minutes, there may be a considerable delay in acquiring satellites. In this case, switch the meter off, then back on again to reset the acquisition process.

7. Depth Measurement

Depth is measured in the AP-7000 by a pressure sensor mounted inside the body of the probe. The datum on the probe for depth measurement is the top row of holes on the probe sleeve.

Depth is calculated by subtracting the barometric pressure being measured in the Aquameter® from the water pressure being measured in the AP-7000. The pressure differential, once corrected for temperature and salinity (water density), is directly proportional to depth.

The depth measurement system uses the EC sensor to detect when the probe has been placed in water. All the time the probe is measuring an EC of zero, the depth will read zero. As soon as an EC value is detected, the meter will start to calculate depth. For this reason, it is important to ensure the Probe is connected to the Meter and switched on prior to submerging the probe in water.

7.1. Taking Depth Measurements

Connect the Probe to the Meter and switch on prior to submerging the probe in water. Select the Baro/Depth screen as illustrated below. The depth should be reading zero.

BARO:1013mb

DEPTH:00.00m

Hit [OK] to zero

← GPS:3D Pos →

If the depth is not reading zero (this is possible if the probe is wet and a low EC reading is registering), press the OK key. You will be asked to confirm by pressing OK again.

Slowly lower the probe into the water. As soon as the depth value starts to register, you can lower the probe more quickly.

7.2. Differential Depth Measurement

If you want to measure changes in depth, it may be more convenient to zero the depth measurement once the probe has been submerged.

To do this, press the OK key whilst displaying depth, then confirm. The unit will now read positive or negative changes in depth from the current depth (zero datum).

If the values are positive, the water level has increased from the zero datum. If the values are negative, the water level has decreased.

Using the Automatic Data Logging feature detailed in the following section, it is possible to monitor water levels over a period of time for later recall.

8. Memory Mode

8.1. Manually Saving Readings

When you are happy that the readings are stable (see section 6.3: Global Stability Indication), press the **M+** key to snapshot the readings along with the time, date, GLP (calibration) data and position (GPS models only).

As each reading is saved, a numeric memory location 'Tag' will be briefly displayed which you can note down. This Tag can be used to identify readings at a later date, both on the Aquameter® and when using AquaLink software.

8.2. Recalling and Viewing Saved Readings

To recall your readings, press the **MR** key. On entering Memory Recall mode, the most recent Tag and set of readings are displayed first along with the date and time the readings were taken shown on the bottom line of the screen.

M TEMP:012.5°C M
ORP:0415.2mV
pH:08.21
02/Apr/12 15:04:01

During Memory Recall, an 'M' is flashed in the top left and right corners of the screen alternatively with an up/down arrow and a left/right arrow. This is to indicate that the Meter is in Memory Recall mode and that other screens can be accessed using the arrow keys.

To see earlier readings, press the up arrow key. Just before each set of readings is displayed, the Tag will be briefly displayed. To view all the parameters within one set of readings, use the left/right arrow keys as described earlier. To exit Memory Recall mode, press the **ESC** key. If no key is pressed for 30 seconds, Memory Recall mode will be automatically cancelled.

8.3. Recalling GLP Data

Each time a set of readings is added to memory, the date of the last successful calibration of each electrode is also appended. This is called GLP (Good Laboratory Practice) Data. In addition to the date of the last successful EC calibration, the Calibration Standard value at which the EC was calibrated is also displayed (see section 14: Calibrating EC for further details).

To view the last successful calibration date for each electrode for any particular stored reading, enter Memory Recall mode, scroll to the reading you are interested in using the up/down keys, then press the **MENU** key. The screen below will be displayed.

GLP DATA >pH/ORP DO/EC Aux Electrodes

Using the up/down keys, select the electrode you are interested in, then press either the OK key or the right arrow key. If, for instance, you selected pH/ORP, the screen below would be displayed.

pH7.00	[31/Jan/12]
рн4.01	[07/Feb/12]
PH10.0	[07/Feb/12]
ORP	[09/Feb/12]

This tells you that the last successful calibration, **prior to the recorded reading being taken**, was January 31st for the pH 7.00 point, February 7th for the pH 4.01 & pH 10.0 point and February 9th for ORP. If the date field is dashed (==/===), this means the electrode was either not fitted or had never been calibrated.

To exit this screen press the **ESC** key or the left arrow key.

8.4. Clearing the Memory

The memory within the Aquameter® is capable of storing over 1000 full sets of readings.

To clear the entire memory, switch the Meter off, hold down the **M+** key, then switch the Meter back on. A screen will be displayed asking you to confirm your request. Press OK to clear the memory or ESC to cancel and return to normal operation.

8.5. Automatic Data Logging

If you want to save readings on a regular basis, in order, say, to check water quality at a certain location over a period of time, you can set the Meter to record readings automatically.

Readings can be logged for short periods with the Meter permanently displaying readings, or for much longer periods in a Low Power Mode, where the Meter switches itself off between readings in order to extent the battery life.

Please note: Low Power Logging Mode is only available on Meters running version 4.54 software and above.

To activate Automatic Logging, press the **MENU** key. The Main Menu screen will be displayed. Please note, the first item on the menu, 'Clean Probe', will only be active if an Aquaprobe® AP-7000 (which has an automatic cleaning system) is connected.

→ Clean Probe
Auto Data Logging
Calibration
Setup & Install

Select **Auto Data Logging** by pressing the down arrow key then the right arrow key or the **OK** key. The Auto Data Logging screen will be displayed.

Auto Data Logging →Interval:10 Mins Status:OFF

Using the arrow keys to navigate, set the desired logging interval anywhere between 1 and 90 minutes.

To select permanent display logging mode, set the Status to **ON**. To select Low Power logging mode, set the Status to **LOW POWER**.

To activate the selected logging mode, press the **OK** key then revert back to the normal operation screen from the Main Menu by pressing the left arrow key.

To indicate that Auto Data Logging is switched on, an asterisk (*) character will flash on and off just below the battery symbol on all the main reading screens.

If permanent display logging mode was selected (Status set to **ON**), the Meter will record a full set of data automatically at the set rate until either the memory is full or the batteries go flat.

If Low Power Logging Mode was selected (Status set to **LOW POWER**), the Meter will switch itself off 30 seconds after your last key-press. Thereafter it will switch back on at the set rate, stay on for 30 seconds, log the data, then switch back off again. This will be repeated until either the memory is full or the batteries go flat.

If you press any key while the Meter is off between readings in low power mode, the Meter will switch back on. If no further key is pressed, the Meter will switch back off again after 30 seconds and resume Low Power Mode.

You can cancel Auto Data Logging at any time by going back into the screen above and setting the **Status** to **OFF**. Auto Data Logging will also be cancelled if you switch the Meter off manually.

8.6. Battery and Memory Duration in Low Power Logging Mode

Low Power Logging Mode is specifically designed for long term data logging. In order to estimate battery life and memory usage, the following table can be used.

The battery life figures quoted below are based on fresh, good quality alkaline batteries at a Meter temperature of 21°C or over. Colder Meter temperatures will drastically reduce the battery life. For example, at 5°C, the battery life will be approximately half that quoted.

Logging Rate	Battery Life (at 21°C)	Memory Duration
90 mins	36 Days	66 Days
60 mins	33 Days	44 Days
45 mins	30 Days	33 Days
30 mins	26 Days	22 Days
15 mins	18 Days	11 Days
5 mins	8 Days	3.6 Days
1 min	45 Hours	17 Hours

So, it can be seen that although the Meter has a maximum data capacity of 66 days, for logging rates above 45 minutes, fresh batteries would need to be fitted after approximately one month in order to make use of the Meter's full memory capacity.

Conversely, logging rates below 45 minutes will fill the Meter's memory on a single set of batteries (at 21°C or greater).

Useful Tip: If you want GPS data logged in association with your other data, ensure the Meter is positioned face up with a clear view of the sky.

8.7. Important Information About Memory Mode

When data is saved in the Meter, it is compressed in raw Probe format. In other words, the same way that it came up from the Probe. When you recall the data in Memory Recall mode, the data is decompressed, then processed for display.

The advantage of this is that the readings will always appear in the <u>current Meter configuration</u>. For example, if you spent a day taking readings with the Meter set to read Dissolved Oxygen in %Saturation, then when you got back you really want to see Dissolved Oxygen displayed in mg/L, you can do this by simply changing the Meter settings (see section 9).

The stored data can be displayed any way you want on recall. You are not limited to viewing the data in the same way it was logged. This is a major advantage and allows you to actually store and recall far more parameters than can be displayed at any one time.

The same rules apply when data is output to a PC running AquaLink Software via the USB cable. The data that is output is always as per the <u>Meter's current configuration</u>. You can output the data as many times as you like in various Meter configurations.

9. Setup & Install

To alter the way the Aquameter® displays readings, press the **MENU** key to get to the Main Menu, then choose **Setup & Install**. The Settings Menu will be displayed. Please note, the 'Socket Assignment' option on this screen is only accessible when an AP-7000 or AP-7000 Probe is connected.

→ Time & Date
Units
Language
Socket Assignment

9.1. Setting Units of Measurement

From this screen choose **Units**. The Units Menu will be displayed. Remember, you can use just the arrow keys to navigate through the branches of the menus. You don't need to press **OK** or **ESC** at each level.

Units Menu

→ DO/EC/TDS

TEMP/pH/ORP/SAL

BARO/Alt & Depth

At the Units Menu, you have a choice of which units you want to adjust. Choose the first line if you want to adjust Dissolved Oxygen, Electrical Conductivity or TDS. Choose line 2 if you want to adjust Temperature, pH, ORP or Salinity. Finally, line 3 will give access to Barometric Pressure, Altitude and Depth settings.

Moving the cursor right onto the first line will display the following screen.

Units
→ DO:%SAT
EC:Ref 25°C
TDS Fact:0.65

On this screen you can adjust the DO: setting between %Sat and mg/L. This will set the Dissolved Oxygen output to AquaLink to as either % Saturation or in milligrams/Litre (which is the same as parts per million). Both readings are automatically corrected for atmospheric pressure, sample temperature and sample salinity.

The second option on this screen allows you to choose how the Meter displays Electrical Conductivity. There are four options. EC can be displayed as 'Absolute EC' without any temperature correction [ABS EC], as 'Specific EC' referenced to 20°C [Ref 20°C], as 'Specific EC' referenced to 25°C [Ref 25°C] or as a reciprocal of Absolute EC, which is Absolute Resistivity [ABS RES].

Finally, this screen allows you to set the factor that the Meter uses to calculate Total Dissolved Solids from Specific EC. This is the TDS Fact: (TDS = EC x TDS Fact) and can be set anywhere between 0.00 and 1.00. Default value is 0.65.

Selecting the second line of the Units Menu will display the following screen.

Units

→ TEMP:°C

pH:pH

SAL:PSU

The first option on this screen allows you to change the temperature display between °C and °F.

The second option allows you to change the pH display between plain pH and pHmV. Plain pH displays normal, temperature compensated pH values in the range 0 - 14.

pHmV displays the actual voltage being generated by the pH electrode in +/- millivolts (mV) over a range of +/- 625mV. This is not temperature compensated.

The last option on this screen allows you to choose between displaying salinity in Practical Salinity Units (PSU), or parts per thousand (ppt), which is the same as grams per litre.

Selecting the third line of the Units Menu will display the following screen.

Units
→ BARO:mb
ALT:Metres

The first line allows you to choose between displaying Barometric pressure in millibars (mb) or in mm of mercury (mmHg).

The second line allows you to choose between displaying altitude <u>and depth</u> in metres (M) or feet (F). Whatever units ALT is set to, DEPTH will follow. Altitude is displayed with respect to mean sea level.

Depth is displayed with respect to the depth zero datum, which can be the water surface or any point at which the depth has been zeroed. See section 7: Differential Depth Measurement for further details.

9.2. AUX Socket Assignment

The AP-7000 features six AUX (axillary) sockets into which additional electrodes may be fitted. Any of the AUX sockets can be fitted with either AP-7000 Optical electrodes or AP-5000/7000 ISE (Ion Specific) electrodes.

When an electrode has been fitted to an AUX socket (see appendix 2 for fitting instructions), the socket must be assigned to the specific electrode type.

The Socket Assignment option is only available if the Aquameter® is connected to an AP-7000. This is because the assignment data is held in the Aquaprobe®, not in the Aquameter®.

When the Socket Assignment option has been selected, the following screen will be displayed.

The numbers 1 - 6 represent the AUX socket numbers.

SOCKET ASSIGNMENTS

→1:EMPTY | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

Using the up and down arrow keys, select the AUX socket you wish to assign then move the cursor to the right by pressing the right arrow key. When the cursor has moved to the right of the AUX socket number, use the up and down arrow keys to select the appropriate electrode type.

The tables below show the available electrode options and the selection that should be made on this screen:

AP-7000 Optical Electrodes

Electrode Part No.	Function	Aquameter® Selection
7000-TURB	Turbidity	TURB
7000-CPHYLL	Chlorophyll	Cphl
7000-BGA-PC	Phycocyanin (Blue-Green Algae PC)	BGA-PC
7000-BGA-PE	Phycoerythrin (Blue-Green Algae PE)	BGA-PE
7000-RHOD	Rhodamine WT Dye	Rhod
7000-FSCEIN	Fluorescein Dye	Fcein
7000-REFOIL	Refined Oil	OIL
7000-CDOM	CDOM/FDOM	CDOM

AP-5000/7000 ISE Electrodes

Electrode Part No.	Function	Aquameter® Selection
5000/7000-AMM	Ammonium/Ammonia	NH4
5000/7000-CHL	Chloride	CI
5000/7000-FLU	Fluoride	F
5000/7000-NIT	Nitrate	NO3
5000/7000-CAL	Calcium	Ca2

When the desired electrode type is showing, move the cursor back to the left of the socket number then press OK to send the selection to the AP-7000. The socket assignments are stored in the AP-7000.

If you press the ESC key whilst in this screen, any changes you have made will not be transferred to the AP-7000.

Please note: changing an AUX Socket assignment will clear all the calibration data for that socket.

If you subsequently remove an electrode, be sure to set the socket assignment back to EMPTY.

10. RapidCal Calibration Method

10.1. About Calibration

Calibration is a very important part of successful water quality measurement and should be carried out regularly as detailed in each separate section of this manual. A great deal of development work has been put into simplifying and automating the calibration procedures in the Aquameter® in order to allow normal field operatives (as opposed to trained lab technicians) to achieve quick and accurate results.

As a general rule, pH and EC should be calibrated as close to 25°C as possible. Optical electrodes should be calibrated as close to their deployment temperature as possible.

The AP-7000 is provided with a two part calibration cup. The probe is designed to be calibrated in these cups with the Probe Sleeve, Sleeve End Cap and Wiper fitted.

The Probe sleeve, end cap and wiper form an integral, working part of the Probe's optical and EC measurement system, and MUST be fitted during calibration and measurement for correct operation.

10.2. Special Notes Concerning ISE Electrodes

The high ionic concentration of pH calibration solutions (buffers), including RapidCal, can cause significant offsets in ISE electrodes.

These offsets are temporary, but best avoided because they can cause significant errors during both calibration and normal operation.

For this reason all ISE electrodes are supplied with a red rubber sealing cap.

The caps should be fitted to all ISE Electrodes during when using RapidCal in order to protect the ISE electrodes from the effects of the buffer solution.



At all other times, the ISE electrodes should be left uncovered.


AP-7000

400mL-

10.3. Using RapidCal

RapidCal is an easy way to calibrate the AP-7000 in the field using just one calibration solution. RapidCal calibrates EC at 2570µS/cm, the pH7.00 point and all the optional Optical Electrodes Zero points simultaneously. Ideally, this procedure should be carried out at the beginning of each day the Probe is to be used. To use RapidCal:


- Pour 400mL of RapidCal solution into one of the calibration cups provided as shown in the adjacent photograph.
- 2. Remove the storage cap from the pH electrode if fitted, wash the Probe in distilled water, then gently lower the Probe into the calibration cup.
- 3. If you do not have any ISE caps fitted, activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes. To do this, press the MENU key and select CLEAN PROBE. If you have ISE caps fitted, agitate the Probe to eliminate air. Do not activate the cleaning mechanism as the brush will jam against the ISE caps.
- 4. Wait until all readings are **completely** stable. The longer you can leave the probe to achieve thermal equilibrium before proceeding, the better. A minimum of two minutes is recommended.
- 5. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F). The closer to 25°C the better.
- 6. Press the **MENU** key then select **Calibration**. The following screen will be displayed.



7. Select **RapidCal**. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until all readings are stable, then it will send the RapidCal command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is



displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Calibrating 100% Press [OK]

When calibration is complete, press **OK** then **ESC** to return to normal reading mode.

Now the DO 100% saturation point should be calibrated in damp air.

To Calibrate the 100% Saturation Point in Damp Air

- 1. After calibrating with RapidCaL, remove the Probe from the cup, wash in fresh water, then shake off ensuring there are no droplets adhering to the DO membrane.
- 2. Moisten a clean cloth or piece of tissue paper with fresh water and wrap it around the end of the probe ensuring all the holes are covered. Place the probe on a flat surface. Do not hold the probe, the heat from your hands will warm the probe up and interfere with calibration.
- 3. Wait until the temperature measurement is completely stable. This is very important.
- 4. Referring back to the screen shown in item 5 above, select **DO 100%.**
- 5. Wait while the Aquameter® carries out the calibration procedure.
- 6. When the 'Calibrating 100%' screen (shown above) is displayed, press OK then ESC repeatedly to return to normal reading mode.



Important

If you have both Optical and ISE electrodes fitted to your Aquaprobe®, you must now remove the rubber sealing caps from all the ISE electrodes then re-calibrate the zero points (Pt-1) of all the optical electrodes in fresh, clean water (bottled <u>still</u> mineral water is ideal).

The ISE electrodes' sealing caps alter the optical characteristics of the measurement chamber and can therefore render the optical electrode's zero point calibration performed during RapidCal erroneous.

10.4. Calibration Error Messages

If the Aquameter[®] detects a problem with either the AP-7000 or the calibration solution during the calibration procedure, an error will be indicated. The chart below shows the possible errors and how to correct them.

Error Message	Problem	Action
REPLACE DO CAP	Full re-calibration required or Optical DO Cap needs replacing	See note below.
BATTERIES TOO LOW	Battery Voltage is too low for reliable calibration	Replace the batteries
NO PROBE RESPONSE	The Probe is not responding	Check connections / cycle power
READINGS UNSTABLE	Readings did not stabilise within the expected period	Top up / replace the RapidCal
OUT OF CAL RANGE	Readings are outside calibration limits (can be caused by low level / incorrect calibration solution). Or the Probe Sleeve is not fitted	Top up / check calibration solution is correct type. Ensure the Probe Sleeve is fitted
OUT OF TEMP RANGE	Temperature is outside 5°C – 40°C limit ISE differential calibration rules not met.	Warm / cool the RapidCal
CAL ZERO FIRST	You are trying to calibrate an upper calibration point on an optical electrode without first calibrating the zero point.	Calibrate the zero point first, then without switching the Aquameter off, calibrate the upper point.

If the 'REPLACE DO CAP' error occurs during Optical DO Zero calibration, this usually indicates that the DO Cap needs replacing. Perform a full DO calibration first at DO Zero then at 100% DO. If that does not cure the problem, replace the DO Cap (see Replacing the Optical DO Cap in section 14).

If the corrective actions shown above for 'READINGS UNSTABLE' or 'OUT OF CAL RANGE' errors do not work, thoroughly clean the Probe and try again. If the 'OUT OF CAL RANGE' error persists, reset the calibration values to Factory Defaults then try again.

If the 'OUT OF CAL RANGE' error persists when calibrating EC, check you are using the correct EC Calibration Standard and that the wiper is fitted.

If the 'OUT OF CAL RANGE' error persists when calibrating pH, check you are using the correct pH Calibration Standard for the calibration point selected.

If the 'OUT OF TEMP RANGE' error persists when carrying out a three point ISE calibration, check your solution temperatures are within the specified limits with respect to each other.

Remember: The Probe sleeve, end cap and wiper form an integral, working part of the Probe's optical and EC measurement system, and MUST be fitted during calibration and measurement of these functions for correct operation. If you try to calibrate any of the optical electrodes or the EC without the sleeve, end cap and wiper fitted, you may get an error message.

10.5. Resetting to Factory Calibration Defaults

In some cases, if there has been a serious calibration error, the easiest way to rectify the situation is to reset the Probe to its factory defaults. To do this, first bring up the Calibration screen:

Calibration → RapidCal DO 100% Full Cal

Select Full Cal. This will give you a choice of electrodes:

Calibration → pH/ORP DO/EC Aux Electrodes

Move the cursor arrow to the electrode you want to reset, then press the **MR** key. If you select Aux Electrodes, you must press OK first to enter the Aux Electrode selection screen. Once in that screen, select the Aux electrode you want to reset then press **MR**.

A confirmation screen will be displayed.

Are you sure you want to restore the factory calibration values? [ESC]=NO

If you are sure, press the **OK** key. If you want to change your mind, press the **ESC** key. If you press OK, you will see a message that says CAL RESTORED.

Once factory calibration defaults have been restored, you **must** carry out a **full calibration** of the electrode in question.

10.6. Calibration Data Storage

The AP-7000 contains its own microprocessor and memory. All calibration data, including the GLP data, is stored within the Probe's memory. When a Probe is connected to a Meter, this data is transferred for display and logging.

This is a major advantage and allows you to use a variety of different Probes with a single Meter, without the need for re-calibration.

10.7. Calibration Reports

At the conclusion of each successful individual electrode calibration, a single line Calibration Report is displayed. This report contains the raw output of the electrode under calibration, uncorrected for temperature.

These values can be recorded and used to track the performance and ageing of the individual electrodes. Please note however, in order to maximise the value of this feature, all calibrations must be performed at the same temperature otherwise the recorded values will not be comparable over time. No calibration report is generated when using RapidCal.

11. After Use

The AP-7000 should always be cleaned after every use.

It is advisable to clean the Probe after use with the cable attached. This will prevent any water entering the Probe's socket and will allow any deposits to be removed from the connector collar and shell.

The Sleeve on the AP-7000 can be removed by unscrewing to allow cleaning of the individual electrodes. After every use, remove the protective Sleeve End Cap then unscrew the sleeve.

With the Sleeve removed, the individual electrodes are very vulnerable, so please handle the Probe with extreme care. If you drop it, it's going to break!

Rinse the exposed electrodes, the inside of the Sleeve and the Sleeve End Cap with fresh, clean water. Shake the water from inside the Sleeve, then reattach. Dry the outside of the Probe using a soft cloth.

Remember to replace the pH/ORP storage cap after use. Failure to do so will damage the electrode. For more details, see Keeping the Electrodes Moist in section 13.

Never clean the Probe with solvents, alcohol or concentrated acid/alkaline based cleaning products such as Decon 90. These products can strip the anodised finish from the Probe and damage the plastic and rubber components. Damage caused by the use of aggressive cleaning agents or solvents is not covered by your warranty.

TIP: Occasional application of a smear of silicone grease (provided) to the connector Orings and thread, Sleeve thread, the protective Sleeve End Cap thread will make fitting and removal of these parts easier.

12. The AP-7000 Automatic Cleaning System

The AP-7000 features a motorised cleaning mechanism. This cleaning mechanism is designed for use during long term deployment when the AP-7000 is connected to an AquaLogger or a third party telemetry device capable of supplying the required voltage and current.

The cleaning cycle can be activated from the Aquameter[®], which is useful during calibration for removing air bubbles from the electrodes.

To activate the cleaning mechanism from the Aquameter[®], press the **MENU** key. The Main Menu screen will be displayed. Select the first item on the menu, 'Clean Probe'.

→ Clean Probe Auto Data Logging Calibration Setup & Install

When activated, the centrally mounted wiper will rotate to each occupied electrode position and carry out a brief scrubbing action before returning the its park position.

If there is not enough power available from the meter or if the meter-probe cable is excessively long (which causes a voltage drop), a 'Wiper Jammed' message will be displayed.

This message will also be displayed if the wiper hits an obstacle which prevents it completing it's cleaning cycle. If an obstacle is hit and the wiper jams, it will reverse direction and return to its park position.

12.1. Wiper Removal and Replacement

Occasional cleaning or replacement of the wiper brushes may be required due to fouling. This is a simple job and requires no tools.

First remove the sleeve then pull the stainless-steel spring pin out of the central shaft.



Next, slide the wiper off the central shaft.



Next, slide the top brush carrier out of the wiper.



Next, slide the top brush out of the top brush carrier.



Finally, slide the side brush from the wiper.



Re-assembly is simply the reverse of this process.

Tips:

- Ensure the brushes are re-fitted the right way round. Refer to the photographs above if in doubt.
- Before sliding the wiper back onto the central shaft, rub a small amount of silicone grease onto the shaft.
- When sliding the wiper back onto the shaft, ensure the hole in the top brush carrier is in alignment with the central hole in the wiper.
- Ensure that the torque arm (see below) is aligned with the corresponding receiving hole in the end of the wiper.



Finally, ensure the spring clip is correctly and securely fitted.



12.2. Important Notes Regarding Long-Term Deployment

Whilst the AP-7000 features an effective electrode cleaning system, the Probe should not be deployed and left for extended periods without regular checking, calibration and maintenance.

The time period between maintenance visits depends heavily upon the deployment conditions. For example, if the Probe is deployed in clean water, the only necessity should be regular single point calibration of the electrodes. This should be done every 4-6 weeks.

If the Probe is deployed in water that is polluted, silt-laden or heavily affected by algal growth, maintenance visits should be much more frequent.

It is very important to keep the cleaning brushes in good condition. The brushes should be replaced as soon as they show any signs of clogging or deterioration.

Likewise, it is very important to keep the inside of the Probe Sleeve and End Cap clean and free from any build up of algae or silt. The Probe Sleeve and End Cap form an integral part of the optical measurement system. If they are allowed to become excessively dirty, the accuracy of your readings will be affected.

It is strongly recommended that after initial deployment, maintenance visits are made on a weekly basis in order to assess the rate of fouling. After several weeks, it should be possible to establish the optimum time interval for routine maintenance at any given site.

13. pH/ORP Electrode Calibration and Maintenance

13.1. Recognising the pH/ORP Electrode

The combined pH/ORP electrode is easy to recognise because it is the only electrode that is not black. This electrode has a clear, gel filled body.

13.2. Electrode Removal and Replacement

The pH/ORP electrode can be unscrewed from the Probe body by rotating it anti-clockwise. When replacing an electrode, apply a little silicone grease or similar lubricant to the thread and O ring, then screw fully in.

Gripping the knurled collar at the top of the electrode, tighten until the O ring is fully compressed.

Useful Tip: The red lanyard that is attached to the pH/ORP storage cap makes a very useful belt wrench for tightening and loosening the pH/ORP and AUX electrodes.



Slide the lanyard over the electrode and use it to grip the knurled body.

Never immerse an AP-7000 with the pH/ORP electrode removed. This will cause serious damage to the electrode socket. **This is not covered by your warranty.**

13.3. Keeping the Electrodes Moist

It is very important that the pH/ORP electrode is kept moist when not in use. This is achieved by always fitting the storage cap, which incorporates a sponge that should be soaked in a special storage solution.

The sponge within the storage cap should be moistened with a few drops of pH Electrode Storage Solution each time it is removed and replaced. If a pH/ORP electrode is inadvertently allowed to dry out, it must be re-hydrated by soaking in storage solution for at least one hour prior to use.

13.4. Calibrating pH

pH electrodes should be calibrated fully at least once a week to ensure optimum accuracy. Full calibration involves calibrating at pH 7.00 first, then at pH 4.01 and/or pH 10.00. The AP-7000 allows for both two and three point pH calibration. Should you decide to carry out just a two point calibration, the probe will automatically calculate and save a calibration value for the uncalibrated third point in order to maintain the electrode's linearity over the full range of 0-14.

For best results, calibrate all three points as close to 25°C as possible.

13.4.1. Special Notes Concerning ISE Electrodes during pH Calibration

The high ionic concentration of pH calibration solutions (buffers), including RapidCal, can cause significant offsets in ISE electrodes.

These offsets are temporary, but best avoided because they can cause significant errors during both calibration and normal operation.

For this reason all ISE electrodes are supplied with a red rubber sealing cap.

The caps should be fitted to all ISE Electrodes during pH calibration in order to protect the ISE electrodes from the effects of the buffer solution.



At all other times, the ISE electrodes should be left uncovered.

13.4.2. Calibrating the First Point (pH 7.00)

Due to the way in which pH calibration works, the Probe must be calibrated at pH7.00 before calibrating at pH 4.01 or pH 10.00. Never calibrate at pH 4.01 or pH 10.00 before first calibrating at pH7.00.

To calibrate the pH electrode follow these steps:

- 1. Pour 200mL of fresh pH 7.00 solution or RapidCal in a calibration cup, remove the storage cap from the pH electrode, wash the Probe in distilled water, then gently lower the Probe in all the way.
- 2. If you do not have any ISE caps fitted, activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes. To do this, press the MENU key and select CLEAN PROBE. If you have ISE caps fitted, agitate the Probe to eliminate air. Do not activate the cleaning mechanism as the brush will jam against the ISE caps.
- 3. Wait until the temperature and pH measurements are completely stable.
- 4. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 5. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration

→ RapidCal

DO 100%

Full Cal

6. Select **Full Cal**. The screen will change to:

Calibration
→ pH/ORP
DO/EC
Aux Electrodes

7. Select **pH/ORP**. The screen will change to:

→ pH7.00?[01/Jan/12]
 pH4.01?[01/Jan/12]
 pH10.0?[01/Jan/12]
 ORP? [01/Jan/12]

The dates shown to the right of the screen are the dates of the last successful calibration.

8. Select pH7.00. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Offset: -1.2mV Calibrating 100% Press [OK]

The top line displays the voltage offset from zero for the pH electrode in +/-millivolts (mV). If this offset goes beyond +/-25mV at 25°C, the pH electrode should be serviced.

This value is not stored in memory so should be noted down in a calibration record book for the Probe. When the offset voltage details have been noted down, press **OK** then **ESC** repeatedly to return to normal reading mode.

Remove the Probe from the calibration cup, rinse thoroughly in de-ionised water, shake off any excess and dry the outer sleeve with a soft cloth.

13.4.3. Calibrating the Second Point

The pH electrode can now be calibrated at either pH 4.01 or pH 10.00. If you intend to calibrate at both pH 4.01 and pH 10.00, both points must be calibrated in the same session, i.e. without turning the power off.

If the power is removed after calibrating just one additional point (pH 4.00 for example), the probe will automatically calculate and save a calibration value for the uncalibrated third point in order to maintain the electrode's linearity.

To calibrate the second point, pour 200mL of fresh pH 4.01 or pH 10.00 solution into a clean calibration cup and drop the Probe in all the way. Follow the procedure detailed above, but at step 8, select either pH4.01 or pH10.0, dependent upon the solution you are using. Wait while the Meter stabilises and calibrates. When the 'Calibrating 100%' screen is displayed, the calibration report will display the slope for the pH electrode in millivolts (mV) per pH unit. If this slope goes below 45mV/pH at 25°C, the pH electrode should be serviced. Press **OK** then press the **ESC** key repeatedly to get back to the main display.

Remove the Probe from the calibration cup, rinse thoroughly in fresh water, shake off any excess and dry the outer sleeve with a soft cloth.

13.4.4. Calibrating the Third Point

Without switching the Aquameter® off or disconnecting the Probe, pour 200mL of fresh pH 4.01 or pH 10.00 solution into a clean calibration cup drop the Probe in all the way. Follow the procedure detailed above, but at step 8, select either pH4.01 or pH10.0 dependent upon the solution you are using. Wait while the Meter stabilises and calibrates. When the 'Calibrating 100%' screen is displayed, the calibration report will display the slope for the pH electrode in millivolts (mV) per pH unit. If this slope goes below 45mV/pH at 25°C, the pH electrode should be serviced. Press **OK** then press the **ESC** key repeatedly to get back to the main display.

Remove the Probe from the calibration cup, rinse thoroughly in fresh water, shake off any excess and dry the outer sleeve with a soft cloth. Dampen the sponge in the storage cap with storage solution and fit it to the pH/ORP electrode. pH calibration is now complete.

13.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

13.6. pH Electrode Efficiency

If the pH electrode becomes worn or clogged, its efficiency and response time can be reduced. The efficiency of the pH electrode is constantly monitored and in the event of the efficiency dropping below 85%, 'ERROR 01' will be flashed on the bottom line of the display. If this occurs, or if the pH reading response becomes slow, recondition the electrode as described below.

13.7. Servicing the pH Electrode

- 1. Remove the pH or combined pH/ORP electrode from the Probe body (see Electrode Removal and Replacement).
- 2. Rinse with methyl alcohol.
- 3. Replace the electrode.
- 4. Re-calibrate.

Never place the entire AP-7000 in methyl alcohol, as this will cause irreparable damage to the DO/EC electrode. Damaged caused in this way is not covered by the warranty.

If the methyl alcohol rinse does not restore the electrode, perform the following actions:

- 1. Remove the electrode from the body again.
- 2. Soak in 0.1M HCl for 5 minutes.
- 3. Rinse in de-ionised water.
- 4. Soak in 0.1M NaOH for 5 minutes.
- 5. Rinse in de-ionised water.
- 6. Soak in pH4.01 buffer for 10 minutes.

If the above procedure still does not restore performance, replace the electrode.

13.8. Calibrating ORP

ORP electrodes should be calibrated at least once a month to ensure optimum accuracy. Full calibration involves calibrating at a single point, (250mV at 25°C) using a 250mV ORP calibration standard such as **Reagecon RS250 Redox Standard**, or similar.

For best results, calibrate as close to 25°C as possible. The probe will automatically compensate for temperature variation in the calibration solution during calibration.

To calibrate the ORP electrode follow these steps:

- 1. Pour 200mL of fresh calibration solution into a calibration cup, remove the storage cap from the pH/ORP electrode, wash the Probe in distilled water, then gently lower the Probe in all the way.
- 2. Activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes. Wait until the temperature and ORP measurements are completely stable.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration
→ RapidCal
DO 100%
Full Cal

5. Select **Full Cal**. The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **pH/ORP**. The screen will change to:

Calibration

→ pH7.00?[01/Jan/12]

pH4.01?[01/Jan/12]

ORP? [01/Jan/12]

7. Select ORP. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Offset: 5.5mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage offset between the ORP electrode output and the value of the calibration solution at the calibration temperature in +/-millivolts (mV). During normal operation this offset will be subtracted from the ORP electrode output to give a corrected ORP display.

This value is not stored in memory so should be noted down in a calibration record book for the probe. When calibration is complete, press the **OK** key then the **ESC** key repeatedly to return to normal operating mode.

Remove the Probe from the calibration cup, rinse thoroughly in fresh water, shake off any excess and dry the outer sleeve with a soft cloth. Dampen the sponge in the storage cap with storage solution and fit it to the pH/ORP electrode. ORP calibration is now complete.

13.9. Converting ORP Readings to the Hydrogen Scale

Electrochemical measurements are ultimately referred to the so-called hydrogen scale, the convention for which is that the electrochemical potential of a hydrogen electrode in contact with hydrogen gas at one atmosphere partial pressure and a solution containing hydrogen ions at unit activity is zero at all temperatures.

The ORP reference electrode used in Aquaread® combination electrodes is a 3MPK1 silver chloride type, and exhibits potentials on the hydrogen scale of:

Temperature	Potential
5°C	221 mV
10°C	217 mV
15°C	214 mV
20°C	210 mV
25°C	207 mV
30°C	203 mV
35°C	200 mV
40°C	196 mV

Thus, to refer an ORP potential value measured with the AP-7000 to the hydrogen scale, the appropriate value above should be added to the measured value.

14. DO/EC Electrode Calibration and Maintenance

14.1. Recognising the DO/EC Electrode

The DO/EC electrode is easy to recognise because it has a screw-on cap and four stainless-steel EC sensor contacts on the inside facing the wiper. Dissolved Oxygen (DO) is measured at the end of the electrode by the components behind the removable cap. Electrical Conductivity (EC) is measured on the inside edge of the electrode by the four stainless steel contacts. The flat on the wiper forms part of the EC cell.

14.2. DO Measurement Technique

The AP-7000 features an optical DO sensor. This sensor does not use a liquid electrolyte and has a black rubber gas-permeable membrane. See Appendix 1. The Tech Behind Aquaread's Optical DO Measurement System for further details.

14.3. Precautions During Use

EC measurement is not possible with the Probe central wiper removed as the central wiper forms an integral part of the measurement system.

Never immerse the Probe without the DO Cap fitted. If the components at the end of the DO/EC electrode come into contact with the liquid being tested, serious damage can occur to the DO/EC electrode circuitry.

14.4. Calibrating the DO/EC Electrode

Calibration of the EC section of the electrode is normally carried out during RapidCal (see RapidCal Calibration Method). EC can be calibrated separately using different EC Calibration Standards, this is covered after the DO calibration section (Calibrating EC).

The DO section of the electrode should be calibrated at the Zero saturation point at least once a month. Before each day's use, the 100% saturation point should be checked in moist air and re-calibrated if necessary. For optimum accuracy, calibrate the DO100% point as near to your sample temperature as possible (within the calibration temperature limits of 5°C - 40°C).

If you are going to calibrate both the Zero and 100% points at the same time, **ALWAYS** calibrate the Zero point first, then the 100% point.

14.5. Calibrating the DO Zero Point

- 1. Pour 200mL of DO Zero calibration solution into a calibration up, remove the storage cap from the pH electrode if fitted, wash the Probe in distilled water, then gently lower the Probe in all the way.
- 2. Activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes. Wait until the temperature and DO measurements are completely stable.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration → RapidCal DO 100% Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration
→ pH/ORP
DO/EC
Aux Electrodes

6. Select **DO/EC**. The screen will change to:

Calibration

→ DOZero?[01/Jan/12]

DO100%?[01/Jan/12]

EC2570?[01/Jan/12]

The dates shown to the right of the screen are the dates of the last successful calibration.

7. Select DOZero. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:4.4 Calibrating 100% Press [OK]

The top line will display a value which represents the health of the luminophore. This value should be between 3.5 and 4.5 (at 25°C). If the value returned is less than 3.5, the Optical DO Cap should be replaced.

This value is not stored in memory so should be noted down in a calibration record book for the probe. When the Cell offset voltage details have been noted down, press **OK** then **ESC** repeatedly to return to normal reading mode.

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

Remove the Probe from the calibration cup, rinse thoroughly in fresh water, shake off any excess and dry the outer sleeve with a soft cloth.

14.6. Calibrating the DO 100% Saturation Point in Moist Air

- 1. Wash the probe thoroughly in fresh water, then shake off ensuring there are no droplets adhering to the DO membrane.
- 2. Moisten a clean cloth or piece of tissue paper with fresh water and wrap it around the open end of the probe ensuring all the holes are covered. Place the probe on a flat surface. Do not hold the probe, the heat from your hands will warm the probe up and interfere with calibration.
- 3. Switch the Aquameter® on and wait until the temperature measurement is completely stable. This is very important.
- 4. Referring back to the screens shown in items 4 or 6 above (dependent on software version), select **DO100**%
- 5. Wait while the Aquameter® carries out the calibration procedure.
- 6. When calibration is complete, the Calibration Report will be displayed.

The top line will display a value which represents the health of the luminophore. This value should be between 0.8 and 1.5 (at 25°C). If the value returned is less than 0.8, the Optical DO Cap should be replaced. These values are not stored in memory so should be noted down in a calibration record book for the probe.

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

14.7. Replacing the Optical DO Cap

The Optical DO Cap contains a lens, which is coated with an oxygen sensitive luminophore, which is in turn coated with a black rubber compound that provides optical isolation but is permeable to oxygen. Oxygen molecules pass through the rubber into the luminophore. Never touch the black rubber end of the DO electrode as the oils in your skin can block the pores in the rubber coating and stop it from working correctly.

The luminophore within the DO Cap will need replacing every few years, as it is a consumable item. Since the luminophore is an integral part of the DO Cap, the entire DO Cap is replaced. An Optical DO Cap can last up to ten years dependent upon the amount of use it gets. See Sensor Cap Life in Appendix 1 for further details.

Caution: The inside of the Optical DO Cap is very sensitive to light and can be ruined (bleached) if it is exposed to bright light for any length of time. Never remove the Optical DO Cap from the Probe unless you intend to replace it with a new one. When replacing an Optical DO Cap, do so under subdued light.

To replace the Optical DO Cap, follow these simple steps.

- 1. Remove the Probe sleeve.
- 2. Unscrew the Optical DO Cap from the end of the DO/EC electrode by rotating it anticlockwise. Do not touch the exposed optical components.
- 3. Apply a light smear of silicone grease to the thread and O ring.

- 4. Remove the new Optical DO Cap from its light-proof bag and quickly screw it onto the end of the DO/EC electrode. Ensure that the cap is screwed fully onto the electrode and that it is done up tight.
- 5. Carry out both Zero point and 100% point DO calibration as described earlier.

Please Note: It is essential when replacing the Optical DO Cap to calibrate the Zero point BEFORE calibrating the 100% point.

14.8. Calibrating EC

EC calibration is always carried out at a single point. There is a choice of three single points. These are: $1413\mu S/cm$, $2570\mu S/cm$ (using Aquaread® RapidCal solution) and $12,880\mu S/cm$. These values have been chosen to allow accurate readings to be taken in a variety of water types.

For taking measurements in fresh surface or ground water, use Aquaread® RapidCal solution. If this is not available, use a third party 1413µS/cm EC Calibration Standard. For taking readings in brackish or salt water, use a third party 12,880µS/cm (12.88mS/cm) EC Calibration Standard.

The Probe's central wiper forms an integral, working part of the Probe's EC measurement system, and MUST be fitted during calibration and measurement for correct operation. If you try to calibrate the Probe without the wiper fitted, you will get erroneous results.

For best results, calibrate as close to 25°C as possible. The probe will compensate for temperature variation in the Calibration Standard during calibration.

- 1. Pour 400mL of calibration solution into one of the calibration cups provided. Remove the storage cap from the pH electrode if fitted, wash the Probe in distilled water, then gently lower the Probe into the calibration cup.
- 2. Ensure the liquid level is at least two thirds of the way up the calibration cup. Low liquid level will result in erroneous EC calibration. Refer to the photograph in section 10 Using RapidCal.
- 3. Activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes. Wait until the temperature and EC measurements are completely stable.
- 4. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 5. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration
→ RapidCal
DO 100%
Full Cal

6. Select **Full Cal.** The screen will change to:

Calibration

→ pH/ORP

DO/EC

Aux Electrodes

7. Select **DO/EC**. The screen will change to:

Calibration

→ DOZero?[01/Jan/12]

DO100%?[01/Jan/12]

EC2570?[01/Jan/12]

The dates shown to the right of the screen are the dates of the last successful calibration. The value shown on the bottom line next to 'EC' is the value the EC electrode was last calibrated to.

8. Move the pointer down to the bottom line using the down arrow key.

Calibration
DOZero?[01/Jan/12]
DO100%?[01/Jan/12]
→ EC2570?[01/Jan/12]

If the Calibration Standard value you are using is already displayed, press the **OK** key to start calibrating. Remember, if you are using RapidCal solution, the EC value on this line should be 2570.

If the value of the EC Calibration Standard you are using is not displayed, press the right arrow key. The bottom line will change to:

Calibration DOZero?[01/Jan/12] DO100%?[01/Jan/12] EC→2570?[01/Jan/12]

You can now use the up and down arrow keys to select one of three EC Calibration Standard values (1413, 2570 or 12880).

9. Once the correct Calibration Standard value is being displayed, press the **OK** key. The screen will change to:

PLEASE WAIT Stabilising 000%

10. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Cell constant:0.98 Calibrating 100% Press [OK]

The Calibration Report on the top line displays the EC Cell Constant. This value is not stored in memory so should be noted down in a calibration record book for the probe.

When the cell constant details have been noted down, press **OK** then **ESC** repeatedly to return to normal reading mode.

Special Notes:

- If you have selected a Calibration Standard value other than 2570 (RapidCal), then you subsequently use the RapidCal calibration technique described in section 10, the Calibration Standard value will automatically be reset to 2570.
- The Calibration Standard value is stored in the Probe, **not** the Meter. If you use one Meter with several different Probes, you will have to set the Calibration Standard value for each probe individually during calibration.
- If you select a Calibration Standard value but do not press **OK**, the information will not be sent to the Probe and the change will not be registered.

14.9. Errors During Calibration

At the beginning of the calibration routine, a sanity check is done. If the probe detects that the Calibration Standard value set and the Calibration Standard being used differ, the 'OUT OF CAL RANGE' error will be reported. If any other problems occur during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

14.10. Cleaning the EC Contacts

On a regular basis, thoroughly clean the four stainless steel EC contacts situated on the side of the DO/EC electrode with a soft cloth or toothbrush and non-abrasive detergent. **Never use solvent or alcohol based products to clean the DO/EC electrode**. After cleaning, replace the Probe sleeve and re-calibrate.

15. Optional Optical Electrodes Calibration and Maintenance

The AP-7000 is constructed with an aluminium sleeve surrounding the delicate sensing electrodes. The Sleeve can be easily removed by unscrewing to allow cleaning of the individual electrodes, however, The Probe sleeve, end cap and wiper form an integral, working part of the Probe's optical measurement system, and MUST be fitted during calibration and measurement for correct operation.

All Aquaread® Optical Electrodes are incredibly sensitive. For example, the Turbidity electrode is capable of measuring between 0 and 3000NTU with an internal resolution of greater than 0.1NTU. This means that the electrode is able to detect changes in turbidity that are less than 0.003% of the full range! The other optical electrodes have a similar level of sensitivity.


It follows, therefore, that in order to provide stable, repeatable readings, the environment in which the measurements are made must be completely stable and repeatable.

For this reason, the AP-7000 is constructed with a matt black aluminium sleeve and end cap that enclose the sensing electrodes and provide a closed, constant condition, non reflective measurement chamber.

In order to obtain consistent results, the measurement chamber created within the Aquaprobe® must remain physically constant during both calibration and measurement. It is therefore essential that both the sleeve and sleeve end cap are fitted during calibration and operation of all types of optical electrodes.

If an optical electrode is calibrated under one set of conditions then used to measure under another set of conditions, the readings will naturally be erroneous, especially at low concentrations.

A perfect example of this is calibrating with the end cap removed then measuring with the end cap fitted (or vice-versa).

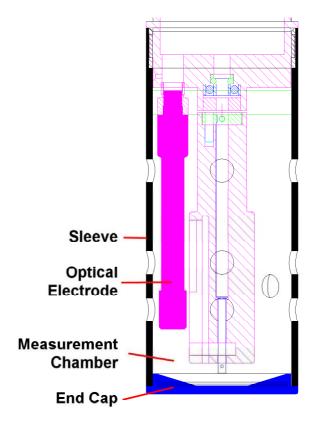

By changing the physical characteristics of the measurement chamber, you also change the calibration and response of the electrode.

Another particular problem when trying to measure very low concentrations is air in the form of both visible and microscopic bubbles. These act like tiny prisms and can refract and reflect both the excitation light and the return signal being measured.

15.1. Top Tips for successful measurements using optical electrodes

- Always keep the measurement chamber and electrode lenses clean.
- > Always fit the sleeve and end cap during both calibration and measurement.
- Always allow the readings to settle completely during both calibration and measurement.
- > Always try to eliminate air bubbles by activate the self-cleaning mechanism.
- Always calibrate and zero the electrode as close to your sample temperature as possible. This is especially important with the Ref-Oil electrode.
- Always zero the optical electrodes just prior to use in clean water (bottled still mineral water is ideal) then deploy without disturbing the measurement chamber. This is especially important when using the Turbidity and Ref-Oil electrodes.

15.2. Optical Electrode Calibration Sequence

Optical electrodes feature either two or three point calibration, dependent upon the type. In all cases however, the lower calibration points is ZERO.

When calibrating any optical electrode, the Zero point must be calibrated first.

If you are performing a two or three point calibration, all calibration points must be calibrated within the same calibration session (i.e. without turning the Aquameter® off or disconnecting the Aquaprobe).

If you attempt to calibrate an upper calibration point without first calibrating the ZERO point, a calibration error will occur.

15.3. 7000-TURB Turbidity Electrode

Turbidity can be measured by the AP-7000 using the optional 7000-TURB optical electrode.

This electrode employs a Nephelometric technique in accordance with ISO 7027, which uses Formazin as a reference standard. The Aquameter® displays turbidity in Nephelometric Turbidity Units (NTU) which are nominally equivalent to Formazin Turbidity Units (FTU).

Turbidity can be calibrated with either Formazin Turbidity Standards or Suspended Polymer Turbidity Standards, depending upon your preferred turbidity reference. **Be aware, these two standards will give very different results**. Factory calibration is carried out with a 1000 NTU Stabilised Formazin Turbidity Standard in accordance with ISO 7027.

15.3.1. About Turbidity

Turbidity is a measurement of the light scattering properties of solids suspended within a liquid and is therefore an **indirect** measurement of clarity. Turbidity is not a direct measurement of suspended solids, clarity or colour.

Particle size relative to the wavelength of the transmitted light, particle shape and refractive index modify the distribution of scattered light. Sample colour, (particularly dark colours) can also reduce a certain portion of the scattered light by varying degrees.

Combined, these effects result in wide variability in the distribution and intensity of light scattering from a turbid water sample. As a result, different combinations of particle shape, size, colour and refractive index can produce similar turbidity effects.

By contrast, changing only the incident light wavelength and detector distance can dramatically change the measured turbidity of a given sample. As a result, different model sensors from different manufacturers can measure different turbidity values for the same sample. This highlights the qualitative nature of turbidity measurements.

Integrated monitoring programs, where turbidity measurements from different locations are to be compared, **must** use a single model of sensor and maintain a strict QA and calibration program to accurately characterise, compare, and interpret observed turbidity values.

15.3.2. Precautions During Use

In common with all other submersion type Turbidity Probes, air bubbles and stray reflections can be a problem when trying to measure low turbidity values. In order to avoid air bubbles, keep the Turbidity electrode clean, and agitate the Probe after submersion to dislodge any air bubbles which may be clinging to the lenses. In order to maintain a common reflective pattern between calibration and use, always calibrate and measure turbidity with the protective Sleeve End Cap fitted.

15.3.3. Negative Turbidity Readings

When a Probe is deployed in clean/clear water and negative turbidity readings occur, the cause is usually an erroneous zero point calibration, caused either by contaminated calibration solution, aeration or changes in the measurement chamber between zeroing and deployment.

It follows that if the Probe has been zeroed in a solution that has a turbidity greater than true zero, subsequent measurements taken in a less turbid sample will be displayed as negative. If you experience negative turbidity readings, thoroughly clean the Probe then rezero in completely clean water. Still, bottled mineral water is recommended for zeroing the electrode as it is cheap and readily available. **Never use sparkling or carbonated water.**

If you still experience negative turbidity readings and you are certain that your zero calibration solution is completely clear water, the problem is almost certainly aeration, i.e. air in the form of both visible and microscopic bubbles. These act like tiny prisms and can refract and reflect both the excitation light and the return signal being measured.

The photograph to the right was taken in a calibration bottle after fresh water was poured in. The bubbles are clearly visible in the light beam. This level of aeration will



register the equivalent of around 5NTU as each bubble is seen as a solid particle.

If your zero calibration water is aerated, allow it to stand for a while until the air has all dispersed, then re-insert the Probe and re-calibrate. Do not leave the Probe sitting in aerated water, the bubbles will simply cling to the inside surface of the Probe and make the problem worse.

15.3.4. Calibrating the Turbidity Electrode

The Probe Sleeve and Sleeve End Cap form an integral, working part of the Probe's turbidity measurement system, and MUST be fitted during calibration and measurement for correct operation.

15.3.5. Calibration Points

Turbidity electrodes have three calibration points. Careful calibration is essential in order to ensure consistent and reliable results across the full measurement range.

When a turbidity electrode is first installed, it MUST be calibrated at three points in order to establish the individual electrode's slope. The Zero NTU point must always be calibrated first, followed by the other two points, all within the same calibration session (i.e. without turning the Aquameter® off).

The Turbidity electrode should subsequently be Zeroed (calibrated at the Zero NTU point) before each day's use. A three point calibration should be carried out once a month to ensure optimum accuracy.

Zeroing of the Turbidity electrode is normally carried out automatically during RapidCal (see RapidCal Calibration Method).

15.3.6. Turbidity Zero Point Calibration

To calibrate the Turbidity zero point (zero the electrode), follow these steps:

 Three-quarters fill a calibration bottle with clean water (bottled still mineral water is recommended), remove the storage cap from the pH electrode if fitted, wash the Probe in clean water, then drop the Probe in all the way. The Sleeve End Cap must be fitted.

- 2. Switch the Aquameter® on and wait until the temperature and turbidity readings are stable. Activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration → RapidCal DO 100% Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:TURB | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

Select the TURB electrode. The screen will change to:

CALIBRATE TURB

→ ZERO? [01/Jan/14]

1000? [01/Jan/14]

20? [01/Jan/14]

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place.

During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:1318mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the Turbidity Receiver Electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe if required. Press [OK] then [ESC] repeatedly to return to the screen displaying the turbidity reading.

15.3.7. Verifying the Zero Calibration

An accurate zero point calibration is essential to the correct operation of the turbidity electrode. The zero point calibration can sometimes be erroneous due to small air bubbles or microscopic suspended solids in the calibration solution. For this reason, it is important to verify the zero point calibration before proceeding to calibrate the other points.

After calibrating the zero point, remove the Probe from the calibration bottle then reinsert, activate the probe cleaning feature then allow the reading to settle. Check the turbidity reading is within +/- 1NTU of zero. If not, re-calibrate the zero point.

15.3.8. Calibrating the Turbidity 20 NTU & 1000 NTU Points

When calibrating the 20 NTU and 1000 NTU points, the Zero point must be calibrated first within the same calibration session (i.e. without turning the Aquameter® off).

Remove the Probe from the zero calibration bottle, rinse thoroughly in fresh water (if using RapidCal solution), shake off any excess and dry the outer sleeve with a soft cloth.

Gently invert, do not shake, a bottle of 20 NTU or 1000 NTU Stabilised Formazin Turbidity Standard solution (available from most lab supply companies) several times to thoroughly mix.

Formazin Turbidity Standard is hazardous to your health. Be sure to handle with care and to read and comply with all health and safety advice.

Three-quarters fill a calibration bottle with the solution and drop the Probe in all the way. Activate the probe cleaning feature in order to remove any air bubbles that may be clinging to the electrodes.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select either 20 or 1000, dependant upon the solution the probe is in. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the Turbidity Receiver Electrode in millivolts (mV). Press the **OK** key to continue.

Rinse the probe thoroughly then repeat this procedure for the third point.

15.3.9. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.3.10. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray reflections.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.3.11. References

The summary on turbidity at the beginning of this section is based on information from the following sources.

- ➤ National Field Manual For the Collection of Water-Quality Data, Turbidity section 6.7, Revised by Chauncey w. Anderson, USGS, 2004.
- ➤ Environmental Instrumentation and Analysis Handbook, Randy D. Down and Jay H. Lehr, Chapter 24 Turbidity Monitoring, John Downing, John Wiley & Sons, Inc. 2005
- ➤ Turbidity Science, Michael J. Sadar, Hach Company 1998.
- ➤ Guidelines and Standard Procedures for continuous Water-Quality Monitors: Site Selection, Field Operation, Calibration, Record Computation and Reporting, Richard J. Wagner et al., USGS Reston VA Meeting, 2000.

15.4. 7000-BGA-PC Freshwater Blue-Green Algae (phycocyanin) Electrode

Freshwater Blue-Green Algae (BGA-PC) can be measured by the AP-7000 using the optional 7000-BGA-PC optical electrode.

15.4.1. Principle of Operation

The 7000-BGA-PC optical electrode is a submersible, fixed response fluorometer, which provides excitation at 590nm and detects any resultant fluorescence above 655nm.

The electrode induces the phycocyanin to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.

15.4.2. Limitations of Use

Determination of BGA-PC in the field using fluorescence measurement techniques will never be as accurate as measurements made in a lab using either cell counting or analysis of molecular phycocyanin after its extraction from cells.

Factors adversely affecting accuracy include:

- Interference from other microbiological species and compounds, which fluoresce at similar wavelengths.
- Differences in the fluorescent response between various species of BGA.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

Fluorescence measurement techniques are ideal for researchers who are interested in detecting the presence or absence of a specific substance and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are not ideal for quantitative measurement. In order to obtain more accurate results, data obtained with the fluorometer in the field should be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

15.4.3. Calibrating the BGA-PC Electrode

The BGA-PC electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results.

When a BGA-PC electrode is first installed, **it MUST be calibrated at both points** in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, a single point (Zero) calibration should be carried out daily. Calibration of the BGA-PC electrode Zero point is normally carried out during RapidCal (see RapidCal Calibration Method).

Full two-point calibration should be carried out every few months.

15.4.4. Calibration Solution Preparation

In order to 'calibrate' (actually, set the relative sensitivity) of the BGA-PC electrode, a $100\mu g/L$ calibration solution of fluorescent dye known as Rhodamine WT should be used. This is exactly the same calibration solution that is recommended for calibration of the RHOD electrode.

Please note: there is no direct correlation between Rhodamine concentration and the number of BGA-PC cells/mL. Rhodamine is used as a convenient dye for setting the sensitivity of the sensor. The subsequent display of BGA-PC in terms of cells/mL is a generalisation based on research and experience. The only way to obtain a true value in terms of cells/mL is to correlate the values from the Probe to quantitative data that has been obtained by laboratory analysis of grab samples. See previous 'Limitations of Use' section.

The 100µg/L calibration solution should be freshly prepared by serial dilution from 200g/L standard using deionised water. The following Rhodamine WT standard is recommended:

Part number: 70301027

Description: Rhodamine WT Liquid Supplier: Keystone Europe Ltd. Contact: http://www.dyes.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.4.5. Serial Dilution

The recommended Rhodamine solution is supplied as a 20% or 200g/L solution, dilution of the stock solution should be carried out as follows.

200g/L stock \rightarrow 100µg/L is recommended to be done as a two step dilution procedure.

Step 1: weigh out 0.5g of 200g/L stock solution in a weigh boat and add this to 1L of deionized water in a volumetric flask, use some of the water from the 1L flask to rinse the weigh boat so no stock Rhodamine remains on the boat. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 2000 dilution of the stock. At this point the 1L flask will contain a 100mg/L solution.

Step 2: Transfer 1ml of the 100mg/L solution to a 1L volumetric flask and top up to 1L with deionized water. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 1000 dilution of the solution from step 1. The concentration of this solution is $100\mu g/L$. This solution can now be used as Pt-2 calibration of the BGA-PC sensor.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

15.4.6. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrodes.
- 2. Wait until the temperature and BGA-PC readings are stable. If the BGA-PC reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration → RapidCal DO 100% Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:BGA-PC | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The BGA-PC electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select BGA-PC. The screen will change to:

CALIBRATE BGA-PC

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.4.7. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed Rhodamine calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue. The reading on the Aquameter® directly after calibration should be approximately 70,000 cells/mL at 20°C (this value will vary with temperature).

Calibration is now complete.

15.4.8. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.4.9. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.5. 7000-BGA-PE Saltwater Blue-Green Algae (phycoerythrin) Electrode

Salt-water Blue-Green Algae (BGA-PE) can be measured by the AP-7000 using the optional 7000-BGA-PE optical electrode.

15.5.1. Principle of Operation

The 7000-BGA-PE optical electrode is a submersible, fixed response fluorometer, which provides excitation at 520nm and detects any resultant fluorescence above 575nm.

The electrode induces the phycoerythrin to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.

15.5.2. Limitations of Use

Determination of BGA-PE in the field using fluorescence measurement techniques will never be as accurate as measurements made in a lab using either cell counting or analysis of molecular phycoerythrin after its extraction from cells.

Factors adversely affecting accuracy include:

- Interference from other microbiological species and compounds, which fluoresce at similar wavelengths.
- Differences in the fluorescent response between various species of BGA.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

Fluorescence measurement techniques are ideal for researchers who are interested in detecting the presence or absence of a specific substance and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are not ideal for quantitative measurement. In order to obtain more accurate results, data obtained with the fluorometer in the field should be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

15.5.3. Calibrating the BGA-PE Electrode

The BGA-PE electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results.

When a BGA-PE electrode is first installed, **it MUST be calibrated at both points** in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, a single point (Zero) calibration should be carried out daily. Calibration of the BGA-PE electrode Zero point is normally carried out during RapidCal (see RapidCal Calibration Method).

Full two-point calibration should be carried out every few months.

15.5.4. Calibration Solution Preparation

In order to 'calibrate' (actually, set the relative sensitivity) of the BGA-PE electrode, an 8µg/L calibration solution of fluorescent dye known as Rhodamine WT should be used.

Please note: there is no direct correlation between Rhodamine concentration and the number of BGA-PE cells/mL. Rhodamine is used as a convenient dye for setting the sensitivity of the sensor. The subsequent display of BGA-PE in terms of cells/mL is a generalisation based on research and experience. The only way to obtain a true value in terms of cells/mL is to correlate the values from the Probe to quantitative data that has been obtained by laboratory analysis of grab samples. See previous 'Limitations of Use' section.

The 8µg/L calibration solution should be freshly prepared by serial dilution from 200g/L standard using deionised water. The following Rhodamine WT standard is recommended:

Part number: 70301027

Description: Rhodamine WT Liquid Supplier: Keystone Europe Ltd. Contact: http://www.dyes.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.5.5. Serial Dilution

The recommended Rhodamine solution is supplied as a 20% or 200g/L solution, dilution of the stock solution should be carried out as follows.

200g/L stock \rightarrow 8µg/L is recommended to be done as a two step dilution procedure.

Step 1: weigh out 0.5g of 200g/L stock solution in a weigh boat and add this to 1L of deionized water in a volumetric flask, use some of the water from the 1L flask to rinse the weigh boat so no stock Rhodamine remains on the boat. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 2000 dilution of the stock, at this point the 1L flask will contain a 100mg/L solution.

Step 2: Transfer 80µl of the 100mg/L solution to a 1L volumetric flask and top up to 1L with deionized water. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 12500 dilution of the solution from step 1. The concentration of this solution is $8\mu g/L$. This solution can now be used as Pt-2 calibration of the BGA-PE sensor.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

15.5.6. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrodes.
- 2. Wait until the temperature and BGA-PE readings are stable. If the BGA-PE reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration
→ RapidCal
DO 100%
Full Cal

5. Select **Full Cal**. The screen will change to:

Calibration
→ pH/ORP
DO/EC
Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:BGA-PE | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The BGA-PE electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select BGA-PE. The screen will change to:

CALIBRATE BGA-PE

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.5.7. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed Rhodamine calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue. The reading on the Aquameter® directly after calibration should be approximately 200,000 cells/mL at 20°C (this value will vary with temperature).

Calibration is now complete.

15.5.8. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.5.9. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.6. 7000-CPHYLL Chlorophyll Electrode

Chlorophyll can be measured by the AP-7000 using the optional 7000-CPHYLL optical electrode.

15.6.1. Principle of Operation

The 7000-CPHYLL optical electrode is a submersible, fixed response fluorometer, which provides excitation at 470nm and detects any resultant fluorescence above 630nm.

The electrode induces the chlorophyll to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.

15.6.2. Limitations of Use

Determination of chlorophyll in the field using fluorescence measurement techniques will never be as accurate as measurements made in a lab using either cell counting or analysis of molecular chlorophyll after its extraction from cells.

Factors adversely affecting accuracy include:

- Interference from other microbiological species and compounds, which fluoresce at similar wavelengths.
- Differences in the fluorescent response between various species of phytoplankton.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

Fluorescence measurement techniques are ideal for researchers who are interested in detecting the presence or absence of a specific substance and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are not ideal for quantitative measurement. In order to obtain more accurate results, data obtained with the fluorometer in the field should be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

15.6.3. Calibrating the CPHYLL Electrode

The CPHYLL electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results.

When a CPHYLL electrode is first installed, it MUST be calibrated at both points in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, a single point (Zero) calibration should be carried out daily. Calibration of the CPHYLL electrode Zero point is normally carried out during RapidCal (see RapidCal Calibration Method).

Full two-point calibration should be carried out every few months.

15.6.4. Calibration Solution Preparation

In order to 'calibrate' (actually, set the relative sensitivity) of the CPHYLL electrode, a 500µg/L calibration solution of fluorescent dye known as Rhodamine WT should be used.

Please note: there is no direct correlation between Rhodamine concentration and the concentration of chlorophyll. Rhodamine is used as a convenient dye for setting the sensitivity of the sensor. The subsequent display of chlorophyll in terms of mg/L is a generalisation based on research and experience. The only way to obtain a true value in terms of cells/mL is to correlate the values from the Probe to quantitative data that has been obtained by laboratory analysis of grab samples. See previous 'Limitations of Use' section.

The 500µg/L calibration solution should be freshly prepared by serial dilution from 200g/L standard using deionised water. The following Rhodamine WT standard is recommended:

Part number: 70301027

Description: Rhodamine WT Liquid Supplier: Keystone Europe Ltd. Contact: http://www.dyes.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.6.5. Serial Dilution

The recommended Rhodamine solution is supplied as a 20% or 200g/L solution, dilution of the stock solution should be carried out as follows.

200g/L stock \rightarrow 500µg/L is recommended to be done as a two step dilution procedure.

Step 1: weigh out 0.5g of 200g/L stock solution in a weigh boat and add this to 1L of deionized water in a volumetric flask, use some of the water from the 1L flask to rinse the weigh boat so no stock Rhodamine remains on the boat. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 2000 dilution of the stock, at this point the 1L flask will contain a 100mg/L solution.

Step 2: Transfer 5ml of the 100mg/L solution to a 1L volumetric flask and top up to 1L with deionized water. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 200 dilution of the solution from step 1. The concentration of this solution is $500\mu g/L$. This solution can now be used as Pt-2 calibration of the CPHYLL sensor.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

15.6.6. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrodes.
- 2. Wait until the temperature and Cphl readings are stable. If the Cphl reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration → RapidCal DO 100% Full Cal

5. Select **Full Cal**. The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:Cphl | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The CphI electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select CphI. The screen will change to:

CALIBRATE Cph1

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.6.7. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed Rhodamine calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue. The reading on the Aquameter® directly after calibration should be approximately 118 µg/L at 20°C (this value will vary with temperature).

Calibration is now complete.

15.6.8. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.6.9. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.7. 7000-RHOD Rhodamine Electrode

Rhodamine WT is a fluorescent red dye that is commonly used in water flow studies and can be measured by the AP-7000 using the optional 7000-RHOD optical electrode.

15.7.1. Principle of Operation

The 7000-RHOD optical electrode is a submersible, fixed response fluorometer, which provides excitation at 520nm and detects any resultant fluorescence above 575nm.

The electrode induces the Rhodamine to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.

15.7.2. Limitations of Use

Measurement of Rhodamine in the field using fluorescence measurement techniques can be adversely affected by:

- Interference from microbiological species and compounds, which fluoresce at similar wavelengths.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

The normal affects of temperature on the fluorescent response of Rhodamine is automatically compensated for by the electrode.

15.7.3. Calibrating the RHOD Electrode

The RHOD electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results

When a RHOD electrode is first installed, it **MUST** be calibrated at both points in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, a single point (Zero) calibration should be carried out daily. Calibration of the RHOD electrode Zero point is normally carried out during RapidCal (see RapidCal Calibration Method).

Full two-point calibration should be carried out every few months.

15.7.4. Calibration Solution Preparation

In order to 'calibrate' the RHOD electrode, a 100µg/L calibration solution of Rhodamine WT should be used. This is exactly the same calibration solution that is recommended for calibration of the BGA-PC electrode.

The 100µg/L calibration solution should be freshly prepared by serial dilution from 200g/L standard using deionised water. The following Rhodamine WT standard is recommended:

Part number: 70301027

Description: Rhodamine WT Liquid Supplier: Keystone Europe Ltd. Contact: http://www.dyes.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.7.5. Serial Dilution

The recommended Rhodamine solution is supplied as a 20% or 200g/L solution, dilution of the stock solution should be carried out as follows.

200g/L stock $\rightarrow 100\mu g/L$ is recommended to be done as a two step dilution procedure.

Step 1; weigh out 0.5g of 200g/L stock solution in a weigh boat and add this to 1L of deionized water in a volumetric flask, use some of the water from the 1L flask to rinse the weigh boat so no stock Rhodamine remains on the boat. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 2000 dilution of the stock, at this point the 1L flask will contain a 100mg/L solution.

Step 2; Transfer 1ml of the 100mg/L solution to a 1L volumetric flask and top up to 1L with deionized water. Put a lid on the 1L flask and invert 10 times.

This step results in a 1 in 1000 dilution of the solution from step 1. The concentration of this solution is $100\mu g/L$. This solution can now be used as Pt-2 calibration of the RHOD sensor.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

15.7.6. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrodes.
- 2. Wait until the temperature and Rhod readings are stable. If the Rhod reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration
→ RapidCal
DO 100%
Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:Rhod | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The Rhod electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select Rhod. The screen will change to:

CALIBRATE Rhod

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.7.7. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed Rhodamine calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue.

Calibration is now complete.

15.7.8. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.7.9. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.8. 7000-FSCEIN Fluorescein Electrode

Fluorescein is a fluorescent dye that is commonly used in water flow studies and can be measured by the AP-7000 using the optional 7000-FSCEIN optical electrode.

15.8.1. Principle of Operation

The 7000-FSCEIN optical electrode is a submersible, fixed response fluorometer, which provides excitation at 470nm and detects any resultant fluorescence above 550nm.

The electrode induces the Fluorescein to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.

15.8.2. Limitations of Use

Measurement of Fluorescein in the field using fluorescence measurement techniques can be adversely affected by:

- Interference from microbiological species and compounds, which fluoresce at similar wavelengths.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

The normal affects of temperature on the fluorescent response of Fluorescein is automatically compensated for by the electrode.

15.8.3. Calibrating the FSCEIN Electrode

The FSCEIN electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results

When a FSCEIN electrode is first installed, it MUST be calibrated at both points in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, a single point (Zero) calibration should be carried out daily. Calibration of the FSCEIN electrode Zero point is normally carried out during RapidCal (see RapidCal Calibration Method).

Full two-point calibration should be carried out every few months.

15.8.4. Calibration Solution Preparation

In order to 'calibrate' the FSCEIN electrode, a $100\mu g/L$ calibration solution of Fluorescein Dye should be used.

The 100µg/L calibration solution should be freshly prepared by serial dilution from 200g/L standard using deionised water. The following Fluorescein Dye is recommended:

Part number: 801 073 81

Description: Keyacid Fluorescein 019187

Supplier: Keystone Europe Ltd. Contact: http://www.dyes.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.8.5. Serial Dilution

A three step dilution process should be used as outlined below.

Step 1; Weigh out 0.5g Fluorescein dye powder and add to 1L deionized water in a volumetric flask. Invert 10 times or until all powder is dissolved. This gives a stock solution of 500mg/L.

Step 2; Transfer 10ml of the 500mg/L stock solution into a 1L volumetric flask and top the flask up to 1L with deionized water. Invert to mix.

This step results in a 1 in 100 dilution of the 500mg/L stock resulting in a 5mg/L stock.

Step 3; Transfer 20ml of the 5mg/L stock from step 2 into a 1L volumetric flask. Top up to 1L with deionized water. Invert to mix.

This step results in a 1 in 50 dilution and gives you the 100µg/L FSCEIN calibration standard required for Pt-2.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

15.8.6. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrodes.
- 2. Switch the Aquameter® on and wait until the temperature and Fcein readings are stable. If the Fcein reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration

→ RapidCal

DO 100%

Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:Fcein | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The Fcein electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select Fcein. The screen will change to:

CALIBRATE Fcein

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.8.7. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed Fluorescein calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue.

Fluorescein calibration is now complete.

15.8.8. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.8.9. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.9. 7000-REFOIL Refined Oil Electrode

Refined fuels such as benzene, toluene, ethylbenzene, and xylenes (BTEX) can be measured by the AP-7000 using the optional 7000-REFOIL optical electrode.

15.9.1. Principle of Operation

The 7000-REFOIL optical electrode is a submersible, fixed response fluorometer, which provides excitation at 285nm (deep UV) and detects any resultant fluorescence between 330nm and 370nm.

The electrode induces the aromatic hydrocarbons within the refined oil to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.



- → During operation, the Refined Oil Electrode emits high intensity ultraviolet (UV) light, which is harmful to skin and eyes and may cause cancer. Avoid exposure to UV light when the Electrode is in operational.
- → Precautions must be taken to avoid looking directly at the Electrode without the use of UV light protective glasses.
- → Do not look directly at the lenses on the front face of the Electrode when it is operational.
- → Ensure the warning label supplied with the Electrode is attached to the Aquaprobe®.

15.9.2. Limitations of Use

Determination of refined oil in the field using fluorescence measurement techniques will never be as accurate as measurements made in a lab using either Gas or Liquid Chromatography.

Factors adversely affecting accuracy include:

- Interference from other compounds (such as flour and some bacterial spores which fluoresce at similar wavelengths.
- Differences in the fluorescent response between various types of oil.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

Fluorescence measurement techniques are ideal for researchers who are interested in detecting the presence or absence of a specific substance and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are not ideal for quantitative measurement. In order to obtain more accurate results, data obtained with the fluorometer in the field should be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

15.9.3. Special Precautions When Using the REFOIL Electrode

- Always observe the safety advice printed above.
- Do not deploy the REFOIL electrode in water temperatures above 30°C.

15.9.4. Calibrating the REFOIL Electrode

The REFOIL electrode has two calibration points. Careful calibration is essential in order to ensure consistent and reliable results. It is important to calibrate this electrode as close to operational temperature as possible.

When a REFOIL electrode is first installed, it **MUST** be calibrated at both points in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, zero point calibration should be carried out before each use and full two-point calibration should be carried out every few months.

15.9.5. Calibration Solution Preparation

In order to 'calibrate' the REFOIL electrode, a 10ppm calibration solution of 1-5, naphthalenedisulfonic acid disodium salt should be used. This solution contains naphthalene, an aromatic hydrocarbon, which has **similar** fluorescence characteristics to many Refined Oils.

The 10ppm calibration solution should be freshly prepared by serial dilution from pure 1-5, naphthalenedisulfonic acid disodium salt. The following Naphthalene salt is recommended:

Part number: 250899

Description: 1,5-Naphthalenedisulfonic acid disodium salt hydrate (95% pure)

Supplier: Sigma Aldrich

Contact: www.sigma-aldrich.com

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

15.9.6. Serial Dilution

10ppm Napthalene salt can be prepared either as a one or two step process dependent upon the accuracy of the scales used.

One step process:

Weigh out 10.5mg of the recommended salt and add to 1L of deionized water in a volumetric flask. Invert or mix until all salt has dissolved. This gives the Pt-2 10ppm stock solution required for calibration.

Two step process:

Step 1: Weigh out 1.05g of the recommended salt and add to 1L deionized water in a volumetric flask. Invert or mix until all salt has dissolved. This gives a 1000ppm stock solution.

Step 2: Transfer 10ml of the 1000ppm stock solution to a 1L volumetric flask and top up with 1L of deionized water. Invert 10 times. This step results in a 1 in 100 dilution of the 1000ppm stock giving the 10ppm standard required for Pt-2 calibration.

The dilute solution can be stored in a dark bottle in a refrigerator for up to five days. After that time it must be discarded.

Important note: When calibrating the Refined Oil sensor with naphthalenedisulfonic acid disodium salt, the readings given will be in $\mu g/L$ (ppb) naphthalene. In order to display readings with respect to a specific type of refined oil, it is necessary to prepare a 10ppm solution of the target oil type and use that to calibrate the electrode in place of the naphthalene solution.

15.9.7. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrode.
- 2. Switch the Aquameter® on and wait until the temperature and Oil readings are stable. If the Oil reading is very high, there are probably air bubbles adhering to the lenses
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration
→ RapidCal
DO 100%
Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration

→ pH/ORP

DO/EC

Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:Oil | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

The Oil electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select Oil. The screen will change to:

CALIBRATE Oil

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.9.8. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of freshly mixed 1-5, naphthalenedisulfonic acid disodium salt calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue.

Refined oil calibration is now complete.

15.9.9. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.9.10. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

15.10. 7000-CDOM/FDOM Chromophoric (Fluorescent) Dissolved Organic Matter

Fluorescent) Dissolved Organic Matter can be measured by the AP-7000 using the optional 7000-CDOM optical electrode.

15.10.1. Principle of Operation

The 7000-CDOM optical electrode is a submersible, fixed response fluorometer, which provides excitation at 365nm (UV) and detects any resultant fluorescence between 450nm and 520nm.

The electrode induces the dissolved organic matter to fluoresce, then measures the longer wavelength light which is emitted as a result of the fluorescence process.



- → During operation, the CDOM Electrode emits high intensity ultraviolet (UV) light, which is harmful to skin and eyes and may cause cancer. Avoid exposure to UV light when the Electrode is in operational.
- → Precautions must be taken to avoid looking directly at the Electrode without the use of UV light protective glasses.
- → Do not look directly at the lenses on the front face of the Electrode when it is operational.
- → Ensure the warning label supplied with the Electrode is attached to the Aquaprobe®.

15.10.2. Limitations of Use

Determination of CDOM in the field using fluorescence measurement techniques will never be as accurate as measurements made in a lab using traditional techniques.

Factors adversely affecting accuracy include:

- Interference from compounds which fluoresce at similar wavelengths.
- Differences in the fluorescent response caused by temperature.
- Differences in the fluorescent response caused by ambient light.
- Interference caused by turbidity.

Fluorescence measurement techniques are ideal for researchers who are interested in detecting the presence or absence of a specific substance and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are not ideal for quantitative measurement. In order to obtain more accurate results, data obtained with the fluorometer in the field should be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

15.10.3. Calibrating the CDOM Electrode

The CDOM electrode has two calibration points, zero and 100ppb ($100\mu g/L$). Careful calibration is essential in order to ensure consistent and reliable results. It is important to calibrate this electrode as close to operational temperature as possible.

When a CDOM electrode is first installed, **it MUST be calibrated at both points** in order to set the electrode's relative sensitivity and establish its slope.

Subsequently, zero point calibration should be carried out before each use and full two-point calibration should be carried out every few months.

15.10.4. Calibration Solutions

Scientists have not developed a standard way to report CDOM values. Results are therefore expressed in relative units based on calibration to a standard fluorescing compound, usually quinine.

In order to 'calibrate' the CDOM electrode, a 100ppb solution of Quinine Sulphate in sulphuric acid can be used. However, since Quinine Sulphate is extremely expensive and sulphuric acid is dangerous to handle, Aquaread Ltd has formulated an equivalent, non toxic standard for use during CDOM electrode calibration. This is available in 600mL bottles.

Part number: CDOM-CAL-600

Supplier: Aquaread Ltd

Contact: http://www.aquaread.co.uk

15.10.5. Zero Point Calibration

To calibrate the zero point, follow these steps:

- Pour 300mL of de-ionised water into a clean calibration cup, remove the storage cap
 from the pH electrode if fitted, wash the Probe in distilled water, then gently lower
 the Probe in all the way. The Sleeve End Cap must be fitted. Activate the probe
 cleaning feature in order to remove any air bubbles that may be clinging to the
 electrode.
- 2. Switch the Aquameter® on and wait until the temperature and CDOM readings are stable. If the CDOM reading is very high, there are probably air bubbles adhering to the lenses.
- 3. Ensure the temperature of the solution is between 5°C and 40°C (41°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration

→ RapidCal

DO 100%

Full Cal

5. Select **Full Cal.** The screen will change to:

Calibration

→ pH/ORP

DO/EC

Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE →1:CDOM | 4:EMPTY 2:EMPTY | 5:EMPTY 3:EMPTY | 6:EMPTY

The CDOM electrode should have been assigned to an AUX socket when it was fitted. Choose that socket. Press the OK or right arrow key to select CDOM. The screen will change to:

CALIBRATE CDOM

→ ZERO? [01/Jan/12]

Pt-2? [01/Jan/12]

Calibration point 2 (Pt-2) is the upper calibration point.

The dates shown to the right of each point are the dates of the last successful calibration.

7. Select ZERO. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:2500mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the electrode in

millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe.

15.10.6. Calibrating Point 2

Remove the Probe from the calibration cup, shake off any excess water then dry the outer sleeve with a soft cloth.

Pour 300mL of fresh CDOM-CAL calibration solution into a clean calibration cup then gently lower the Probe in all the way.

Follow the procedure detailed above for Zero point calibration as far as step 6, then select Pt-2. Wait while the Meter stabilises and calibrates.

After successful calibration, the 'Calibrating 100%' screen will be displayed along with the Calibration Report, which will show the voltage output from the electrode in millivolts (mV). Press the **OK** key to continue.

CDOM calibration is now complete.

15.10.7. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

15.10.8. Lens and Sleeve Maintenance

On a daily basis, the lenses on the electrode should be wiped over with a soft damp cloth.

Similarly, the inside of the Probe Sleeve and Sleeve Cap should be kept clean and free from any deposits that may cause stray fluorescence.

Never use an abrasive cleaner on the inside of the Probe sleeve or cap as they have been treated with a non-reflective coating which can be easily damaged. The inside of the sleeve should be wiped over with a soft damp cloth and non-abrasive detergent.

Always re-calibrate the zero point after cleaning the sleeve or lenses.

16. Optional ISE Electrodes Calibration and Maintenance

During calibration of the ISE electrodes, very special care must be taken to achieve the specified temperatures. In order to help reduce the Probe's thermal mass and thereby speed up temperature stabilisation, it is advisable to carry out ISE calibration with the sleeve and wiper removed. In this condition, however, the individual electrodes are very vulnerable so care should be taken in order to avoid damage.

16.1. ISE Electrode Limitations

All ion selective electrodes suffer from interference from ions which are similar in nature to the target ion. For this reason, ISE Electrodes are not recommended for use in brackish or salt water due to the high level of interfering ions.

In order to achieve accurate readings with ISE electrodes, the Probe needs to be either placed in flowing water, or needs to be stirred or raised and lowered continuously to ensure a minimum flow rate of 0.3m/s over the electrode. If there is no water flow across the ISE electrode, the ions in the immediate area of the electrode will be depleted and the reading will start to fall. This also applies to calibration, where the probe should be stirred at all times.

16.2. Calibration Points

All ISE electrodes have three calibration points. Careful calibration is essential in order to ensure consistent and reliable results. Prior to initial calibration, all ISE Electrodes should be soaked in their relevant Point 1 calibration solution for 20 – 30 minutes.

When an ISE electrode is first installed, **it MUST be calibrated at three points** in order to establish the electrode's slope and thermal characteristics. Two of the calibration points must be at the same temperature whilst the third must be at least 10°C cooler.

Subsequently, a two-point calibration should be carried out weekly and a single point calibration should be carried out daily. The ISE electrode should be replaced every 6-12 months.

16.3. Special Notes Concerning ISE Electrodes

The high ionic concentration of pH calibration solutions (buffers), including RapidCal, can cause significant offsets in ISE electrodes.

These offsets are temporary, but best avoided because they can cause significant errors during both calibration and normal operation.

For this reason all ISE electrodes are supplied with a red rubber sealing cap.

The caps should be fitted to all ISE Electrodes during pH calibration or when using RapidCal in order to protect the ISE electrodes from the effects of the buffer solution.



At all other times, the ISE electrodes should be left uncovered.

16.4. 7000-AMM Ammonium/Ammonia Electrode

Ammonium (NH4) and Ammonia (NH3) can be measured by the AP-7000 using the optional 7000-AMM ISE electrode within a pH range of 5-8.

The Ammonium ISE electrode will suffer interference from Potassium, Sodium and Magnesium ions, which are similar in nature.

16.4.1. Ammonium Calibration Solution Preparation

When an Ammonium ISE electrode is first installed, it must be calibrated at three points. In order to achieve this, three batches of Ammonium calibration solution must be prepared.

The solutions required are two 200mL batches of Ammonium (as NH4) at a concentration of 10ppm and one 250mL batch of Ammonium (as NH4) at a concentration of 10ppm.

The three calibration solutions should be freshly prepared by serial dilution from 1000ppm calibration standard. The following Ammonium standard is recommended:

Part number: SS-702-1610

Description: 500mL Ammonium 1000ppm as NH4 ISE

Supplier: T E Laboratories Ltd, Ireland.

Contact: http://www.tellab.ie

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

Preparing the 100ppm solution

250mL of 100ppm solution is required. To prepare this, mix 25mL of 1000ppm calibration standard with 225mL of deionised water.

Dispense 200mL of the 100ppm solution into a calibration cup and retain 50mL for preparation of the 10ppm solution.

Preparing the 10ppm solution

A total of 400mL of 10ppm solution is required. To prepare this, mix 40mL of the 100ppm solution you have just prepared with 360mL of deionised water. Dispense the 10ppm solution into two calibration cups (200mL each).

Achieving the correct temperature

During three point calibration, the 100ppm solution and one batch of the 10ppm solution must be at exactly the same temperature. The second batch of 10ppm solution must be at least 10°C cooler.

In order to achieve this, one batch of the 10ppm solution should be put into a refrigerator and the other two solutions should be put into a water bath at 25°C. Once all three solutions are at a stable temperature, calibration can begin.

16.4.2. Three-point Calibration

During three-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1. The AP-7000's sleeve and wiper should also be removed in order to reduce the Probe's thermal mass. To calibrate the ISE electrode follow these steps:

Point 1.

- 1. Remove the Probe Sleeve and the Wiper (see section 12.1.). Remove the storage cap from the pH electrode, wash the Probe in distilled water, dry the probe thoroughly then gently lower the Probe in to the warm 10ppm solution.
- 2. Switch the Aquameter® on and stir the probe until the temperature and NH4 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is between 20°C and 40°C (68°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.

Calibration → RapidCal DO 100% Full Cal

5. Select Full Cal. The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select **Aux Electrodes**. The screen will change to:

SELECT ELECTRODE

→1:TURB | 4:EMPTY

2:NH4 | 5:EMPTY

3:EMPTY | 6:EMPTY

The Ammonium (NH4) electrode should have been assigned to an AUX socket when it was fitted. Move the pointer to NH4 then press the OK or right arrow key to select.

7. The screen will change to:

CALIBRATE NH4

→ Pt-1? [01/Jan/12]

Pt-2? [01/Jan/12]

Pt-3? [01/Jan/12]

Calibration point 1 (Pt-1) is the warm 10ppm point. Calibration point 2 (Pt-2) is the warm 100ppm point. Calibration point 3 (Pt-3) is the cool 10ppm point.

The dates shown to the right of each point are the dates of the last successful calibration.

8. Select Pt-1. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:348mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the ISE electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe along with the temperature.

Point 2

- 1. Remove the probe from the 10ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the warm **100ppm** solution.
- 2. Stir the probe until the temperature and NH4 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is within 1°C of the previous 10ppm calibration point. If the solution is warmer or cooler than this, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-2 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the 100ppm solution is more than 1°C different from the Pt-1 calibration temperature, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

Point 3

- 1. Remove the probe from the 100ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the **cool 10ppm** solution.
- 2. Stir the probe until the temperature and NH4 readings are completely stable. A minimum of fifteen minutes is recommended.
- 3. Ensure the temperature of the solution is at least 10°CThree-point calibration cooler than the previous 100ppm calibration point. If the solution is too warm, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-3 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is

successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the cool 10ppm solution is less than 10°C cooler than the Pt-1 and Pt-2 calibration temperatures, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

At the end of the three-point calibration sequence, replace the wiper (see section 12.1.) Sleeve and sleeve cap.

16.4.3. Two-point Calibration

Two-point calibration should be carried out weekly. For this, 10ppm and 100ppm solutions are required. The two solutions can be at any temperature between 5°C and 30°C but they both must be the same temperature (within 1°C).

If the temperature of the two solutions differ by more than 1°C, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

During two-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 and 2 only.

16.4.4. Single-point Calibration

Single-point calibration should be carried out daily. For this, just 10ppm solution is required. The solution can be at any temperature between 5°C and 30°C.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 only.

16.4.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

16.5. 7000-NIT Nitrate Electrode

Nitrate (NO3) can be measured by the AP-7000 using the optional 7000-CHL ISE electrode within a pH range of 3 - 10.

The Nitrate ISE electrode will suffer interference from Chloride, Bromide, Fluoride, Sulphate, Chlorate and Perchlorate ions, which are similar in nature.

16.5.1. Nitrate Calibration Solution Preparation

When an Nitrate ISE electrode is first installed, it must be calibrated at three points. In order to achieve this, three batches of Nitrate calibration solution must be prepared.

The solutions required are two 200mL batches of Nitrate at a concentration of 10ppm and one 250mL batch of Nitrate at a concentration of 100ppm.

The three calibration solutions should be freshly prepared by serial dilution from 1000ppm calibration standard. The following Nitrate standard is recommended:

Part number: SS-712-1610

Description: 500mL Nitrate 1000ppm ISE Supplier: T E Laboratories Ltd, Ireland.

Contact: http://www.tellab.ie

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

Preparing the 100ppm solution

250mL of 100ppm solution is required. To prepare this, mix 25mL of 1000ppm calibration standard with 225mL of deionised water.

Dispense 200mL of the 100ppm solution into a calibration cup and retain 50mL for preparation of the 10ppm solution.

Preparing the 10ppm solution

A total of 400mL of 10ppm solution is required. To prepare this, mix 40mL of the 100ppm solution you have just prepared with 360mL of deionised water. Dispense the 10ppm solution into two calibration cups (200mL each).

Achieving the correct temperature

During three point calibration, the 100ppm solution and one batch of the 10ppm solution must be at exactly the same temperature. The second batch of 10ppm solution must be at least 10°C cooler.

In order to achieve this, one batch of the 10ppm solution should be put into a refrigerator and the other two solutions should be put into a water bath at 25°C.

Once all three solutions are at a stable temperature, calibration can begin.


16.5.2. Three-point Calibration

During three-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

The AP-7000's sleeve and wiper should also be removed in order to reduce the Probe's thermal mass. To calibrate the ISE electrode follow these steps:

Point 1.

- 1. Remove the Probe Sleeve and the Wiper (see section 12.1.). Remove the storage cap from the pH electrode, wash the Probe in distilled water, dry the probe thoroughly then gently lower the Probe in to the warm 10ppm solution.
- 2. Switch the Aquameter® on and stir the probe until the temperature and NO3 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is between 20°C and 40°C (68°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.



5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select Aux Electrodes. The screen will change to:

SELECT ELECTRODE


>1:TURB | 4:EMPTY

2:NO3 | 5:EMPTY

3:EMPTY | 6:EMPTY

The Nitrate (NO3) electrode should have been assigned to an AUX socket when it was fitted. Move the pointer to NO3 then press the OK or right arrow key to select.

7. The screen will change to:



Calibration point 1 (Pt-1) is the warm 10ppm point. Calibration point 2 (Pt-2) is the warm 100ppm point. Calibration point 3 (Pt-3) is the cool 10ppm point.

The dates shown to the right of each point are the dates of the last successful calibration.

8. Select Pt-1. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:348mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the ISE electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe along with the temperature.

Point 2

- 1. Remove the probe from the 10ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the warm **100ppm** solution.
- 2. Stir the probe until the temperature and NO3 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is within 1°C of the previous 10ppm calibration point. If the solution is warmer or cooler than this, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-2 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the 100ppm solution is more than 1°C different from the Pt-1 calibration temperature, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

Point 3

- 1. Remove the probe from the 100ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the **cool 10ppm** solution.
- 2. Stir the probe until the temperature and NO3 readings are completely stable. A minimum of fifteen minutes is recommended.
- 3. Ensure the temperature of the solution is at least 10°C cooler than the previous 100ppm calibration point. If the solution is too warm, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-3 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place.

During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the cool 10ppm solution is less than 10°C cooler than the Pt-1 and Pt-2 calibration temperatures, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

At the end of the three-point calibration sequence, replace the wiper (see section 12.1.) Sleeve and sleeve cap.

16.5.3. Two-point Calibration

Two-point calibration should be carried out weekly. For this, 10ppm and 100ppm solutions are required. The two solutions can be at any temperature between 5°C and 30°C but they both must be the same temperature (within 1°C).

If the temperature of the two solutions differ by more than 1°C, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

During two-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 and 2 only.

16.5.4. Single-point Calibration

Single-point calibration should be carried out daily. For this, just 10ppm solution is required. The solution can be at any temperature between 5°C and 30°C.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 only.

16.5.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

16.6. 7000-CHL Chloride Electrode

Chloride (CI) can be measured by the AP-7000 using the optional 7000-CHL ISE electrode within a pH range of 2-11.

The Chloride ISE electrode will suffer nterference from Bromide, Iodide, Cyanide and Sulphide ions, which are similar in nature.

16.6.1. Chloride Calibration Solution Preparation

When an Chloride ISE electrode is first installed, it must be calibrated at three points. In order to achieve this, three batches of Chloride calibration solution must be prepared.

The solutions required are two 200mL batches of Chloride at a concentration of 10ppm and one 250mL batch of Chloride at a concentration of 100ppm.

The three calibration solutions should be freshly prepared by serial dilution from 1000ppm calibration standard. The following Chloride standard is recommended:

Part number: SS-706-1610

Description: 500mL Chloride 1000ppm ISE Supplier: T E Laboratories Ltd, Ireland.

Contact: http://www.tellab.ie

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

Preparing the 100ppm solution

250mL of 100ppm solution is required. To prepare this, mix 25mL of 1000ppm calibration standard with 225mL of deionised water.

Dispense 200mL of the 100ppm solution into a calibration cup and retain 50mL for preparation of the 10ppm solution.

Preparing the 10ppm solution

A total of 400mL of 10ppm solution is required. To prepare this, mix 40mL of the 100ppm solution you have just prepared with 360mL of deionised water. Dispense the 10ppm solution into two calibration cups (200mL each).

Achieving the correct temperature

During three point calibration, the 100ppm solution and one batch of the 10ppm solution must be at exactly the same temperature. The second batch of 10ppm solution must be at least 10°C cooler.

In order to achieve this, one batch of the 10ppm solution should be put into a refrigerator and the other two solutions should be put into a water bath at 25°C.

Once all three solutions are at a stable temperature, calibration can begin.


16.6.2. Three-point Calibration

During three-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

The AP-7000's sleeve and wiper should also be removed in order to reduce the Probe's thermal mass. To calibrate the ISE electrode follow these steps:

Point 1.

- 1. Remove the Probe Sleeve and the Wiper (see section 12.1.). Remove the storage cap from the pH electrode, wash the Probe in distilled water, dry the probe thoroughly then gently lower the Probe in to the warm 10ppm solution.
- 2. Switch the Aquameter® on and stir the probe until the temperature and CI readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is between 20°C and 40°C (68°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.



5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select Aux Electrodes. The screen will change to:

SELECT ELECTRODE

→1:TURB | 4:EMPTY

2:Cl | 5:EMPTY

3:EMPTY | 6:EMPTY

The Chloride (CI) electrode should have been assigned to an AUX socket when it was fitted. Move the pointer to CI then press the OK or right arrow key to select.

7. The screen will change to:

CALIBRATE C1

→ Pt-1? [01/Jan/12]

Pt-2? [01/Jan/12]

Pt-3? [01/Jan/12]

Calibration point 1 (Pt-1) is the warm 10ppm point. Calibration point 2 (Pt-2) is the warm 100ppm point. Calibration point 3 (Pt-3) is the cool 10ppm point.

The dates shown to the right of each point are the dates of the last successful calibration.

8. Select Pt-1. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:348mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the ISE electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe along with the temperature.

Point 2

- 1. Remove the probe from the 10ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the warm **100ppm** solution.
- 2. Stir the probe until the temperature and CI readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is within 1°C of the previous 10ppm calibration point. If the solution is warmer or cooler than this, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-2 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the 100ppm solution is more than 1°C different from the Pt-1 calibration temperature, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

Point 3

- 1. Remove the probe from the 100ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the **cool 10ppm** solution.
- 2. Stir the probe until the temperature and CI readings are completely stable. A minimum of fifteen minutes is recommended.
- 3. Ensure the temperature of the solution is at least 10°C cooler than the previous 100ppm calibration point. If the solution is too warm, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-3 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the cool 10ppm solution is less than 10°C cooler than the Pt-1 and Pt-2 calibration temperatures, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

At the end of the three-point calibration sequence, replace the wiper (see section 12.1.) Sleeve and sleeve cap.

16.6.3. Two-point Calibration

Two-point calibration should be carried out weekly. For this, 10ppm and 100ppm solutions are required. The two solutions can be at any temperature between 5°C and 30°C but they both must be the same temperature (within 1°C).

If the temperature of the two solutions differ by more than 1°C, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

During two-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 and 2 only.

16.6.4. Single-point Calibration

Single-point calibration should be carried out daily. For this, just 10ppm solution is required. The solution can be at any temperature between 5°C and 30°C.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 only.

16.6.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

16.7. 7000-CAL Calcium Electrode

Calcium (Ca2) can be measured by the AP-7000 using the optional 7000-CHL ISE electrode within a pH range of 4-9.

The Calcium ISE electrode will suffer interference from Magnesium, Barium, Lead, Zinc and Sodium ions, which are similar in nature.

16.7.1. Calcium Calibration Solution Preparation

When an Calcium ISE electrode is first installed, it must be calibrated at three points. In order to achieve this, three batches of Calcium calibration solution must be prepared.

The solutions required are two 200mL batches of Calcium at a concentration of 10ppm and one 250mL batch of Calcium at a concentration of 100ppm.

The three calibration solutions should be freshly prepared by serial dilution from 1000ppm calibration standard. The following Calcium standard is recommended:

Part number: SS-705-1610

Description: 500mL Calcium 1000ppm ISE Supplier: T E Laboratories Ltd, Ireland.

Contact: http://www.tellab.ie

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

Preparing the 100ppm solution

250mL of 100ppm solution is required. To prepare this, mix 25mL of 1000ppm calibration standard with 225mL of deionised water.

Dispense 200mL of the 100ppm solution into a calibration cup and retain 50mL for preparation of the 10ppm solution.

Preparing the 10ppm solution

A total of 400mL of 10ppm solution is required. To prepare this, mix 40mL of the 100ppm solution you have just prepared with 360mL of deionised water. Dispense the 10ppm solution into two calibration cups (200mL each).

Achieving the correct temperature

During three point calibration, the 100ppm solution and one batch of the 10ppm solution must be at exactly the same temperature. The second batch of 10ppm solution must be at least 10°C cooler.

In order to achieve this, one batch of the 10ppm solution should be put into a refrigerator and the other two solutions should be put into a water bath at 25°C.

Once all three solutions are at a stable temperature, calibration can begin.


16.7.2. Three-point Calibration

During three-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

The AP-7000's sleeve and wiper should also be removed in order to reduce the Probe's thermal mass. To calibrate the ISE electrode follow these steps:

Point 1.

- 1. Remove the Probe Sleeve and the Wiper (see section 12.1.). Remove the storage cap from the pH electrode, wash the Probe in distilled water, dry the probe thoroughly then gently lower the Probe in to the warm 10ppm solution.
- 2. Switch the Aquameter® on and stir the probe until the temperature and Ca2 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is between 20°C and 40°C (68°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.



5. Select **Full Cal.** The screen will change to:

Calibration → pH/ORP DO/EC Aux Electrodes

6. Select Aux Electrodes. The screen will change to:

SELECT ELECTRODE


→1:TURB | 4:EMPTY

2:Ca2 | 5:EMPTY

3:EMPTY | 6:EMPTY

The Calcium (Ca2) electrode should have been assigned to an AUX socket when it was fitted. Move the pointer to Ca2 then press the OK or right arrow key to select.

7. The screen will change to:



Calibration point 1 (Pt-1) is the warm 10ppm point. Calibration point 2 (Pt-2) is the warm 100ppm point. Calibration point 3 (Pt-3) is the cool 10ppm point.

The dates shown to the right of each point are the dates of the last successful calibration.

8. Select Pt-1. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:348mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the ISE electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe along with the temperature.

Point 2

- 1. Remove the probe from the 10ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the warm **100ppm** solution.
- 2. Stir the probe until the temperature and Ca2 readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is within 1°C of the previous 10ppm calibration point. If the solution is warmer or cooler than this, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-2 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the 100ppm solution is more than 1°C different from the Pt-1 calibration temperature, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

Point 3

- 1. Remove the probe from the 100ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the **cool 10ppm** solution.
- 2. Stir the probe until the temperature and Ca2 readings are completely stable. A minimum of fifteen minutes is recommended.
- 3. Ensure the temperature of the solution is at least 10°C cooler than the previous 100ppm calibration point. If the solution is too warm, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-3 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the cool 10ppm solution is less than 10°C cooler than the Pt-1 and Pt-2 calibration temperatures, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

At the end of the three-point calibration sequence, replace the wiper (see section 12.1.) Sleeve and sleeve cap.

16.7.3. Two-point Calibration

Two-point calibration should be carried out weekly. For this, 10ppm and 100ppm solutions are required. The two solutions can be at any temperature between 5°C and 30°C but they both must be the same temperature (within 1°C).

If the temperature of the two solutions differ by more than 1°C, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

During two-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 and 2 only.

16.7.4. Single-point Calibration

Single-point calibration should be carried out daily. For this, just 10ppm solution is required. The solution can be at any temperature between 5°C and 30°C.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 only.

16.7.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

16.8. 7000-FLU Fluoride Electrode

Fluoride (F) can be measured by the AP-7000 using the optional 7000-CHL ISE electrode within a pH range of 4 - 8.

The Fluoride ISE electrode will suffer interference from hydroxide (OH-) ions, which are similar in nature.

16.8.1. Fluoride Calibration Solution Preparation

When an Fluoride ISE electrode is first installed, it must be calibrated at three points. In order to achieve this, three batches of Fluoride calibration solution must be prepared.

The solutions required are two 200mL batches of Fluoride at a concentration of 0.5ppm and one 250mL batch of Fluoride at a concentration of 5ppm.

The three calibration solutions should be freshly prepared by serial dilution from 1000ppm calibration standard. The following Fluoride standard is recommended:

Part number: SS-709-1610

Description: 500mL Fluoride 1000ppm ISE Supplier: T E Laboratories Ltd, Ireland.

Contact: http://www.tellab.ie

Be sure to handle chemicals with care and to read and comply with all health and safety advice.

Preparing the 5ppm solution

250mL of 5ppm solution is required.

To prepare this, first make an intermediate dilution of 50ppm. To do this, mix 6mL of 1000ppm calibration standard with 114mL of deionised water. This will produce 120mL of 50ppm solution.

Next mix 25mL of the 50ppm solution with 225mL of deionised water. This will produce 250mL of 5ppm solution.

Dispense 200mL of the 5ppm solution into a calibration cup and retain the rest for preparation of the 0.5ppm solution.

Preparing the 0.5ppm solution

A total of 400mL of 0.5ppm solution is required. To prepare this, mix 40mL of the 5ppm solution you have just prepared with 360mL of deionised water. Dispense the 0.5ppm solution into two calibration cups (200mL each).

Achieving the correct temperature

During three point calibration, the 5ppm solution and one batch of the 0.5ppm solution must be at exactly the same temperature. The second batch of 0.5ppm solution must be at least 10°C cooler.

In order to achieve this, one batch of the 0.5ppm solution should be put into a refrigerator and the other two solutions should be put into a water bath at 25°C.


Once all three solutions are at a stable temperature, calibration can begin.

16.8.2. Three-point Calibration

During three-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1. The AP-7000's sleeve and wiper should also be removed in order to reduce the Probe's thermal mass. To calibrate the ISE electrode follow these steps:

Point 1.

- 1. Remove the Probe Sleeve and the Wiper (see section 12.1.). Remove the storage cap from the pH electrode, wash the Probe in distilled water, dry the probe thoroughly then gently lower the Probe in to the warm **0.5ppm** solution.
- 2. Switch the Aquameter® on and stir the probe until the temperature and F readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is between 20°C and 40°C (68°F 104°F).
- 4. Press the **MENU** key then select **Calibration**. The following screen will be displayed.



5. Select Full Cal. The screen will change to:

```
Calibration

→ pH/ORP

DO/EC

Aux Electrodes
```

6. Select Aux Electrodes. The screen will change to:

```
SELECT ELECTRODE

→1:TURB | 4:EMPTY

2:F | 5:EMPTY

3:EMPTY | 6:EMPTY
```

The Fluoride (F) electrode should have been assigned to an AUX socket when it was fitted. Move the pointer to F then press the OK or right arrow key to select.

7. The screen will change to:

```
CALIBRATE F

→ Pt-1? [01/Jan/12]

Pt-2? [01/Jan/12]

Pt-3? [01/Jan/12]
```

Calibration point 1 (Pt-1) is the warm 0.5ppm point. Calibration point 2 (Pt-2) is the warm 5ppm point. Calibration point 3 (Pt-3) is the cool 0.5ppm point.

The dates shown to the right of each point are the dates of the last successful calibration.

8. Select Pt-1. The screen will change to:

PLEASE WAIT Stabilising 000%

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up. If the calibration is successful, the counter will reach 100% and the following screen will be displayed.

Output:348mV Calibrating 100% Press [OK]

The Calibration Report on the top line displays the voltage output from the ISE electrode in millivolts (mV). This value is not stored in memory so should be noted down in a calibration record book for the probe along with the temperature.

Point 2

- 1. Remove the probe from the 0.5ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the warm **5ppm** solution.
- 2. Stir the probe until the temperature and F readings are completely stable. A minimum of five minutes is recommended.
- 3. Ensure the temperature of the solution is within 1°C of the previous 0.5ppm calibration point. If the solution is warmer or cooler than this, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-2 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the 5ppm solution is more than 1°C different from the Pt-1 calibration temperature, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

Point 3

- 1. Remove the probe from the 5ppm solution and wash thoroughly in deionised water. Dry the probe then gently lower it into to the **cool 0.5ppm** solution.
- 2. Stir the probe until the temperature and F readings are completely stable. A minimum of fifteen minutes is recommended.
- 3. Ensure the temperature of the solution is at least 10°C cooler than the previous 5ppm calibration point. If the solution is too warm, calibration will fail.
- 4. Referring to steps 4-7 above, select Pt-3 and press OK.

The Meter will wait until the readings are stable, then it will send the calibration command to the Probe, where the calibration takes place. During calibration, the Calibrating screen is displayed and the progress counter counts up as shown above. If the calibration is successful, the counter will reach 100% and the calibration report screen will be displayed.

If the temperature of the cool 0.5ppm solution is less than 10°C cooler than the Pt-1 and Pt-2 calibration temperatures, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

At the end of the three-point calibration sequence, replace the wiper (see section 12.1.) Sleeve and sleeve cap.

16.8.3. Two-point Calibration

Two-point calibration should be carried out weekly. For this, 0.5ppm and 5ppm solutions are required. The two solutions can be at any temperature between 5°C and 30°C but they both must be the same temperature (within 1°C).

If the temperature of the two solutions differ by more than 1°C, an OUT OF TEMP RANGE calibration error will be reported. If this happens, adjust the temperature and try again.

During two-point calibration, the AP-7000 and Aquameter® must remain switched on. If the Aquameter® is switched off between points, the calibration process will be aborted and must be re-started from point 1.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 and 2 only.

16.8.4. Single-point Calibration

Single-point calibration should be carried out daily. For this, just 0.5ppm solution is required. The solution can be at any temperature between 5°C and 30°C.

To calibrate the ISE electrode follow the steps outlined above under three-point calibration for points 1 only.

16.8.5. Errors During Calibration

If a problem occurs during calibration, an error message will be displayed. Refer to Calibration Error Messages in section 10 for error message handling.

17. AquaLink PC Software

AquaLink is a utility program designed to run under Microsoft® Windows® XP®, Vista® or 7 on a stand-alone PC with a minimum screen resolution of 1024 x 768, a CD drive and an available USB 2.0 socket.

17.1. Downloading AquaLink™ PC Software from the Aquaread® website

The AquaLink™ PC Software is available for download using the following link: http://www.aquaread.co.uk/downloads.php

From the Aquaread® Downloads page, select 'AquaLink-Aquameter Utility'. The software will be downloaded as a .ZIP file.

17.2. Software Installation

Unzip the downloaded .ZIP file into a temporary directory . Browse the temporary directory and click on '**setup.exe**'. You will be given the usual Windows® security warnings. Allow the software to install. Once installed, AquaLink™ will run automatically.

To communicate with the Aquameter, two further software 'drivers' need to be installed. These are the 'Aquameter' driver and a 'USB Serial Port' driver.

17.3. Driver Installation

Connect the Aquameter to your PC using the USB cable provided. The 'Found New Hardware' wizard on your PC should activate automatically.

Different versions of Windows® react to plugging USB devices in differently. Earlier versions will give you the option to 'locate and install driver software'. If this happens, direct Windows® to your temporary directory containing the unzipped download.

If your version of Windows® tries to search the Internet or 'Windows Update' for the drivers, stop the search and direct Windows® to your temporary directory.

If Windows® reports a problem installing the drivers, go to your Windows® Device Manager, locate the 'Aquameter' device and update the driver forcing Windows® to search your temporary directory for the driver. Repeat this process for the USB Serial Port.

17.4. Running AquaLink

Select AquaLink from your Programs menu. After an introductory splash-screen has been displayed, the following screen will appear:




Select your preferred operating language by clicking on one of the national flags.

17.5. Uploading Data From Your Aquameter®

Ensure your Aquameter® has batteries installed but is switched off. Connect the Aquameter® to your PC using the USB cable supplied. The Aquameter® should switch itself on automatically and display 'USB CONNECTED' on its screen.

Click the 'Upload Data From Aquameter®' button. AquaLink will search for the Aquameter® then upload all the available logged data from the Meter to your PC. A progress bar and file counter will be displayed during this process. Once upload is complete, the memory Tag, date and time for all the logged data that has been uploaded will be displayed in the Uploaded Data column on the left of the screen.

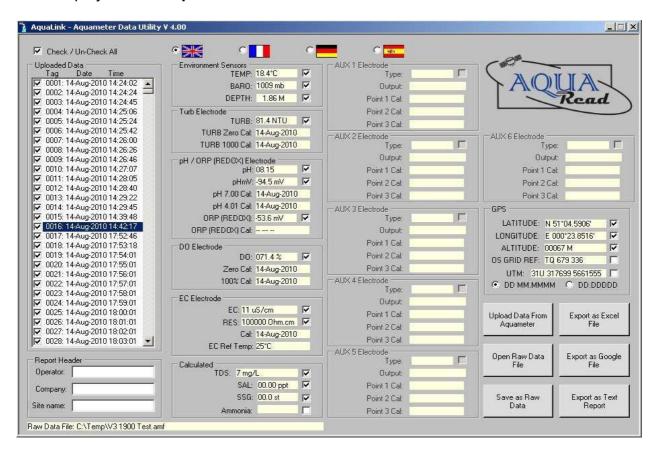

To view any of the logged data records, simply click on the desired Tag, date and time label as shown above. The data for the highlighted label will be displayed in the individual data boxes, which are grouped by electrode function. Any data that is unavailable or out of range will be displayed as dashes. To move up and down the Tag/date/time column, use either your mouse or the cursor up/down keys.

Remember, the Aquameter® stores all logged data in a raw Probe format, so can be made to output logged data in several different forms, dependent upon the Meter's current settings. See Important Information About Memory Mode in section 8 for more information.

17.6. Displaying GPS Co-ordinates

On the right of the screen, the position at which the data was logged is displayed in the GPS boxes (when logged using an AM-200 GPS Aquameter® only). Latitude and longitude can be displayed as Degrees and decimal Minutes (DD MM.MMMM) or as decimal Degrees (DD.DDDDD). Select one format or the other by clicking one of the two options at the bottom of the GPS box. Positional accuracy of lat/lon co-ordinates is +/- 10 meters with a 3D Position fix.

GPS position is also displayed as an Ordnance Survey Great Britain (OSGB) grid reference, (if the position falls within the United Kingdom) and UTM (Universal Transverse Mercator) co-ordinates. Positional accuracy of OSGB co-ordinates is +/- 1 digit (i.e. +/- 100 metres). Positional accuracy of UTM co-ordinates is +/- 10 metres with a 3D Position fix.

17.7. On Screen Help

Help has been provided in this software in the form of 'Tool Tips'. If you want to know what a control button does or what a data box displays, simply move your mouse pointer over the item in question. A multi-lingual Tool Tip will appear after a few seconds to give you more information.

17.8. Saving Logged Data

Once a set of logged data has been uploaded from the Aquameter[®], it can be saved on your PC as a Raw Data file. These files use a proprietary Aquaread[®] format and are saved with a .amf (aquameter file) extension.

To save the uploaded data, click the 'Save as Raw Data' button. You will be asked for a file name in the normal Windows® format. The file name you choose will automatically be given the .amf extension.

Useful Tip: Once you have saved the logged data, it is a good idea to clear the Aquameter®'s memory so next time you log data, you don't get both your old data and new data uploaded to your PC. See Clearing the Memory in section 8.

17.9. Retrieving Logged Data

Once a Raw Data file has been saved using the above technique, it can be easily retrieved by clicking on the '**Open Raw Data**' button. When a raw data file is opened, it will appear exactly as uploaded data and the file name will be displayed in the box below the Report Header box.

17.10. Exporting Data

AquaLink can export data in three different formats. Before exporting data, the actual data to be exported must be selected.

First, select which data records you want to export by checking the relevant check-boxes in the Uploaded Data column. You can check or un-check all data records simultaneously by checking or un-checking the 'Check / Un-Check All' box above the Uploaded Data column.

Next, select which individual data classes you want to export by checking or un-checking the check-boxes next to each individual data box. You are now ready to export your data.

17.11. Exporting Text Reports

To export a text report, first fill in the boxes in the group marked **Report Header** on the left of the screen. This information will be used at the beginning of your report. Next, click on the '**Export as Text Report**' button. You will be asked to specify a file name. A .txt extension will automatically be added.

A report will be generated that consists of a cover page giving the start and end date, time and position, the total number of readings, an analysis of the highest and lowest readings, the variance between the highest and lowest readings, the average readings and the GLP data. Each block of individual readings, laid out in chronological order, follows this page.

This report can be imported into any text editor or word processor package.

Useful Tip: Of the two text editors supplied with Windows®, Microsoft® WordPad is the preferred text editor for viewing AquaLink Text Reports as this handles text file formatting better than Microsoft® Notepad.

A typical report cover page follows.

17.12. Typical Text Report Cover Page

AquaLink	REPORT						
File name: Operator name: Company name: Site name:		C:\Test\3 day to G.E.M. Aquaread® Ltd Test Site 4	Aquaread® Ltd				
Start date Start pos	e and time: ition:		24-Jul-2009 10:09:33 Lat: N 51°21.4989' Lon: E 001°24.3232' OSGB: TR 370 677				
End date End posi	and time: tion:	27-Jul-2009 13 Lat: N 51°21.49		E 001°24.3233'	OSGB: TR 370 677		
Total nur	mber of readings:	877					
Highest r	eadings						
Temp: Baro: Turb: pH: pHmV: ORP: DO: EC: RES: TDS: SAL: SSG:	19.8C 1020mb 05.8 NTU 7.63 -36.3mV 365.7mV 79.4% Sat 810uS/cm 1,445 \Omega^cm 526mg/L 0.40ppt 0.0st	Tag: 0648 Tag: 0315 Tag: 0560 Tag: 0565 Tag: 0009 Tag: 0320 Tag: 0742 Tag: 0588 Tag: 0285 Tag: 0588 Tag: 0001 Tag: 0001	Date Date Date Date Date Date Date Date	: 26-Jul-2009 : 25-Jul-2009 : 26-Jul-2009 : 26-Jul-2009 : 24-Jul-2009 : 25-Jul-2009 : 27-Jul-2009 : 25-Jul-2009 : 25-Jul-2009 : 26-Jul-2009 : 24-Jul-2009 : 24-Jul-2009	Time: 15:51:00 Time: 12:19:00 Time: 08:46:00 Time: 09:09:00 Time: 10:49:01 Time: 12:44:00 Time: 01:46:00 Time: 10:51:00 Time: 10:51:00 Time: 10:09:33 Time: 10:09:33		
Lowest re	eadings						
Temp: Baro: Turb: pH: pHmV: ORP: DO: EC: RES: TDS: SAL: SSG:	17.9C 1005mb 04.1 NTU 7.55 -40.8mV 354.4mV 30.1% Sat 782uS/cm 1,358 Ω•cm 508mg/L 0.39ppt 0.0st	Tag: 0254 Tag: 0838 Tag: 0830 Tag: 0003 Tag: 0556 Tag: 0820 Tag: 0427 Tag: 0149 Tag: 0651 Tag: 0145 Tag: 0017 Tag: 0001	Date Date Date Date Date Date Date Date	: 25-Jul-2009 : 27-Jul-2009 : 27-Jul-2009 : 24-Jul-2009 : 26-Jul-2009 : 27-Jul-2009 : 25-Jul-2009 : 24-Jul-2009 : 24-Jul-2009 : 24-Jul-2009 : 24-Jul-2009 : 24-Jul-2009	Time: 07:14:01 Time: 09:46:00 Time: 09:06:00 Time: 10:19:01 Time: 08:24:00 Time: 08:16:00 Time: 21:39:00 Time: 22:29:01 Time: 18:11:13 Time: 22:09:01 Time: 11:29:01 Time: 10:09:33		
	Variand	ce Aver	age values	3			
Temp: Baro: Turb: pH: pHmV: ORP: DO: EC: Res: TDS: SAL: SSG:	1.9C 15mb 1.7 NT 0.08 4.5mV 11.3m\ 49.3% 28uS/c 87 Ω•c 18mg/l 0.01pp 0.0st	7.60 -39.0 / 358.4 Sat 59.10 m 792.2 m 1,415 514.4	emb NTU 19mV 45mV 0% Sat 2uS/cm 5.4 Ω•cm 4mg/l 1ppt				
Turb Zero pH 7.00: DO Zero EC:	o: 24-Jul- 24-Jul-	2009 pH 4 2009 DO 1	100%:	23-Jul-200 23-Jul-200 24-Jul-200 23-Jul-200	9 9		

Blocks of individual readings, laid out in chronological order, follow this cover page. The readings picked out on the cover page can be cross-referenced to the blocks of individual readings using the Tag numbers.

17.13. Exporting Excel[®] Files

To export an Excel® file, click on the 'Export as Excel File' button. You will be asked to specify a file name. A .xls extension will automatically be added. Excel® files are exported in a Tab delimited text format. This means that each data field is separated by a Tab, and each data record appears on a new line.

Excel® files are saved with a .xls extension and can be opened directly in Microsoft® Excel®. When opening a .xls file created by AquaLink for the first time, Excel® may automatically run a 'Text Import Wizard'. Follow the three simple steps to import the file. Save the file afterwards as a 'Microsoft Excel Workbook'.

17.14. Exporting Google™ Files

To export a Google[™] file, click on the 'Export as Google File' button. You will be asked to specify a file name. A .kml extension will automatically be added. Please note: only data logged with a valid GPS position can be exported to Google[™] files.

Google[™] files are exported in Google's proprietary Keyhole Markup Language with a .kml extension, and can be directly imported into Google[™] Earth, where the data is overlaid on satellite images.

17.15. Importing Files into Google™ Earth

To view your files in Google™ Earth, you will need to log on to the Google™ website and install the Google™ Earth application on your computer. This is free of charge at present.

Once you have downloaded Google™ Earth and have it running, either double click on your .KML file or follow these steps:

- 1. Click on 'File'.
- 2. Select 'Open' from the list.
- 3. Browse for the .KML file you exported from AquaLink, and select it.

You will now be able to view your data overlaid on Google™ Earth Satellite images. Each data point is represented by a yellow pushpin, and all the data points are listed in a column on the left of the screen. To view the data associated with each pin, either click on the pin or click on the data point in the list.

Please note: Although you have downloaded the Google™ Earth application and are running it from your PC, you still need to be connected to the Internet in order for the application to access satellite images.

A typical Google™ Earth image follows.

17.16. Google™ Examples



Zooming in on the satellite photos in Google™ Earth is a great way to spot potential sources of pollution. If one of the readings you have taken shows an abnormality, the chances are that you will be able to spot the possible source of the problem (a riverside factory for example) directly on the satellite photo.

18. Limited Warranty

All Aquaread® Meters are guaranteed for three years, Probes, Flow-Through Cells and individual electrodes are guaranteed for one year from date of purchase against defects in workmanship and materials when used for their intended purpose and maintained according to instructions.

This warranty is limited to repair or replacement free of charge. Accidental damage, misuse, tampering, lack of prescribed maintenance, water ingress through unprotected Meter and Probe sockets, and damage caused by leaking batteries are not covered.

If service is required, contact our Service Department directly by email in the first instance (service@aquaread.com). Report the model number, date of purchase, serial number and problem. You will be given a Returns Authorisation number by our Service Department. You should then return the equipment, thoroughly cleaned, properly packaged, carriage paid, to the address you are given. If the equipment is within warranty, any necessary repairs will be carried out and your equipment will be returned free of charge.

If the repair is not covered by the warranty, you will be given an estimate for the costs of repair and return carriage. Upon receipt of payment, your equipment will be repaired and returned.

Please note: The majority of perceived problems can be rectified by careful study of this instruction manual, use of the TROUBLESHOOTING section below, or with a little help from our engineers over the phone. Always contact our Service Department prior to returning any equipment.

18.1. Cleaning Prior To Return

In order to protect the health and safety of our employees, any equipment returned for service must be thoroughly cleaned and decontaminated prior to despatch, and must be accompanied by a completed copy of the Decontamination Certificate printed below. Any equipment returned for service without a satisfactory Decontamination Certificate, or any equipment deemed by our engineers to be contaminated, will be quarantined pending receipt of a properly completed Decontamination Certificate.

Never clean the Probe with concentrated acid or alkaline based cleaning products such as Decon 90. These products can strip the anodised finish from the Probe and damage some of the plastic components.

18.2. Decontamination Certificate

Please print this certificate, complete all sections, and enclose it with any returned equipment.

Decontamin	ation Certificate
Company Name:	
Address:	
Postal code:	
Country:	
Phone:	email:
Product:	Serial No.:
Contaminant (if known):	
Decontamination Procedure:	
Certified by (print name) :	Title:
Date:	
Signature:	

19. TROUBLESHOOTING

This section details some of the common difficulties you may encounter when using the Aquameter®, Aquaprobe® and AquaLink software. Try all the suggested remedies. If your problem is still unresolved, contact our Service Department (service@aquaread.com).

Problem		Cause / Remedy
The Aquameter® will not turn on when the on/off key is pressed.	✓	Batteries are probably dead or incorrectly fitted. Check you have fresh batteries fitted and that they are inserted the correct way round.
The Aquameter® turns on but turns off again almost immediately.	✓	Batteries are probably nearly dead or incorrectly fitted. Check you have fresh batteries fitted and that they are inserted the correct way round.
The Aquameter® can not find the Aquaprobe®.	√	Probably a poor connection. Switch the Aquameter® off, disconnect the Aquaprobe®, ensure there is no debris or moisture in the plugs and sockets, then re-connect ensuring they are fully inserted and that the screw collars are fully tightened.
The Aquameter® displays a 'Wiper Jammed' message during the cleaning cycle.	✓	Something (possibly the pH storage cap if it has been left on) is jamming the wiper. Clear the obstruction. Batteries are possibly too low to supply the voltage and current required by the cleaning mechanism. Insert fresh, good quality alkaline batteries and try again.
The GPS Aquameter® will not show a position fix.	√	The Aquameter® probably does not have a good enough view of the available satellites. Ensure there are no obstructions between the Aquameter® and the open sky. Remember, GPS does not work indoors.
The AquaLink software can not find the Aquameter [®] .	✓✓	The USB drivers may not be properly installed. Reinstall the USB drivers carefully following the instructions. There may be a problem with the USB socket on the PC, try an alternative socket.
The 'USB CONNECTED' message does not appear on the Aquameter® when it is connected to a PC.	\[\lambda \]	Check you have fresh batteries fitted and that they are inserted the correct way round. The USB cable does not power the Aquameter [®] .
ERROR 01 appears on the Aquameter® screen.	√	This indicates that the pH electrode has dropped below 85% efficiency. Try cleaning the pH electrode and re-calibrating as described in the relevant section of this manual. If that does not cure the problem, replace the electrode.
ERROR 02 appears on the Aquameter® screen.	√	This indicates that the Optical DO electrode needs calibrating or the cap needs replacing. Perform a full DO calibration, first at DO Zero then at 100% DO. If that does not cure the problem, replace the Optical DO Cap
COMMS ERROR appears on the Aquameter® screen.	✓	This indicates that the Aquaprobe® has stopped responding to requests for data from the Aquameter®. Check the Aquaprobe® plug is fully inserted. Cycle the power to reset the Aquaprobe®.
Battery electrolyte leakage detected in the battery compartment.	✓	Remove and discard the batteries immediately. Thoroughly clean the battery compartment and terminals. If the battery terminals are corroded, contact our Service Department for return instructions.
Dissolved Oxygen readings are inaccurate or unstable.	✓ ✓ ✓	The DO electrode may need calibrating. Recalibrate. The DO membrane may be dirty. Clean the DO membrane. Calibration may have been carried out at an extreme temperature. Recalibrate at a temperature as close to the sample temperature as possible.

Troubleshooting Continued ...

Problem	Cause / Remedy
pH and/or ORP readings are slow, inaccurate or unstable or calibration is impossible.	 ✓ The electrodes may need re-calibrating. Recalibrate. ✓ The electrodes may need cleaning. Clean as described in the relevant section of this manual. ✓ The electrodes may have been allowed to dry out. Re-hydrate as described in the relevant section of this manual. ✓ The electrodes may be damaged. Replace the electrodes. ✓ The electrode may be loose allowing water to enter the electrode socket. Remove the electrode, blow out the socket with compressed air then leave the probe and electrode in a warm
EC readings are inaccurate or unstable. OUT OF CAL RANGE error shows during calibration of EC.	 place for at least 48 hours to dry out. ✓ Have you got the Probe Sleeve fitted? EC will not work without the Probe Sleeve fitted. ✓ The Aquaprobe® may not be inserted deep enough into the sample being measured. Ensure the sample level reaches the minimum depth line on the outside of the Aquaprobe®. ✓ Trapped air bubbles may be causing problems. Tap and swish the Aquaprobe® to dislodge them. ✓ The Probe Sleeve may be loose. The Probe Sleeve must be absolutely rigid with respect to the Probe Body for correct EC operation. If you can move the Probe Sleeve to and fro whilst holding the Probe Body, tighten then recalibrate. ✓ The EC electrode may need recalibrating. Recalibrate. ✓ The EC electrode may be dirty. Clean the EC electrode then recalibrate.
Turbidity readings are inaccurate or unstable.	 ✓ Have you got the Probe Sleeve and end cap fitted? Turbidity will not work without the Probe Sleeve and end cap fitted. ✓ Trapped air bubbles may be causing interference. Tap and swish the Aquaprobe® to dislodge them. ✓ The sample being measured may contain air bubbles. Under these conditions, optical turbidity measurements can not be taken. ✓ The Aquaprobe® may not be inserted deep enough into the sample being measured. Ensure the sample level reaches the minimum depth line on the outside of the Aquaprobe®. ✓ The Probe Sleeve may be loose. The Probe Sleeve must be absolutely rigid with respect to the Probe Body for correct turbidity operation. If you can move the Probe Sleeve to and fro whilst holding the Probe Body, tighten then recalibrate. ✓ The Turbidity electrodes may need recalibrating. Recalibrate. ✓ The lenses on the turbidity electrodes may be dirty. Clean the lenses then recalibrate.
Turbidity readings are negative in clear water.	✓ Erroneous zero point calibration caused either by contaminated calibration solution or changes in the measurement chamber between zeroing and deployment. Thoroughly clean the Probe then re-zero in completely clean/clear water.

20. DECLARATION OF CONFORMITY

Aquaread® Ltd declares that the equipment described herein is in compliance with the essential requirements and other relevant provisions of Directives 2004/108/EC and 1999/5/EC.


21. Appendix 1. The Tech Behind Aquaread's Optical DO Measurement System

21.1. Principle of Operation

The Aquaread® AquaPlus™ Optical DO measurement system works on the principle of Dynamic Luminescence Quenching. A gas-permeable chemical known as a luminophore is excited with short bursts of blue light, which causes molecules in the luminophore to emit red photons. The presence of oxygen in contact with the luminophore causes the emission of the red photons to be quenched or delayed. By measuring the delay of the returned red photons with respect to the blue excitation, it is possible to determine the level of dissolved oxygen present.

Whilst this sounds very simple in principle, the optical system and the high-speed electronics required to obtain good accuracy are extremely complex. Calling on many years' experience designing military Night Vision Goggle (NVG) compatible optics, Aquaread® engineers have produced an amazingly small and elegant solution.

Housed in a resin filled, marine grade aluminium body that measures just 8mm (0.3") diameter by 13mm (0.5") long, the fully waterproof AquaPlus Sensor Module contains blue excitation and red reference LEDs, optical filters, a photon detector, temperature sensor, driver circuitry and high gain amplification circuitry.

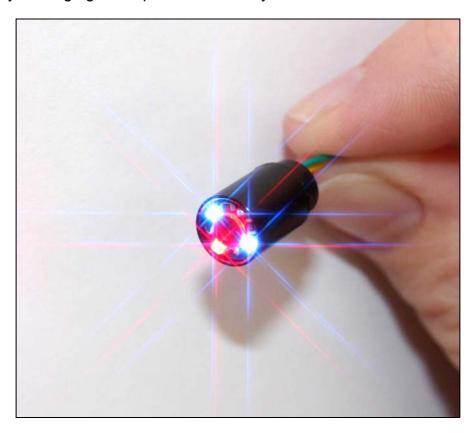

The nano-engineered AquaPlus™ Sensor Module

The incredibly small size of the Sensor Module allows it to fit comfortably into the end of a standard 12mm diameter DO electrode in place of a traditional Clark Cell. The addition of a replaceable cap containing a lens coated with the luminophore material completes the DO section of the electrode.

21.2. Sensor Cap Life

All optical dissolved oxygen sensors work on the same principle, and all must have the sensor cap containing the luminophore replaced periodically due to a phenomenon known as photo bleaching.

When a sensor cap is new, the luminophore will return a large number of red photons when excited. As time goes on, a bleaching effect takes place and the number of red photons returned reduces to a point where they are no longer detectable.

The amount of photo bleaching that the luminophore suffers is in direct proportion to the amount of time it is excited by the sensor's blue light source. It therefore follows that the faster a reading can be taken, the less time the luminophore needs to be excited and the longer it will last.

The high-speed circuitry within the AquaPlus[™] module requires just eleven milliseconds to take a reading! This incredibly fast reading time increases the useful life of the luminophore considerably.

Another technique used to prolong the life of the luminophore in the AquaPlus™ module is variable excitation brightness. When the luminophore is new, the brightness of the excitation is reduced to a minimum in order to prevent unnecessary photo bleaching. As the output from the luminophore gradually reduces, the brightness of the excitation is increased in order to squeeze the maximum possible life from the sensor cap.


The combination of low duty cycle and variable excitation brightness can stretch the useful life of a sensor cap as far as several years.

22. Appendix 2. Fitting AUX Electrodes

There are two types of AUX Electrodes designed for use with the AP-7000: Optical Electrodes and ISE Electrodes. These and can be fitted to any of the AUX sockets. The six AUX sockets on the AP-7000 should be populated in numeric order starting with AUX1. If you are fitting a mix of Optical and ISE Electrodes, fit the Optical Electrodes first.

Installing AUX Electrodes

First, remove the blanking plug from the AUX socket that you want to use on the AP-7000. To remove the blanking plug and subsequently tighten the AUX Electrode, use the red lanyard that is attached to the pH/ORP storage cap as a belt wrench as shown below.

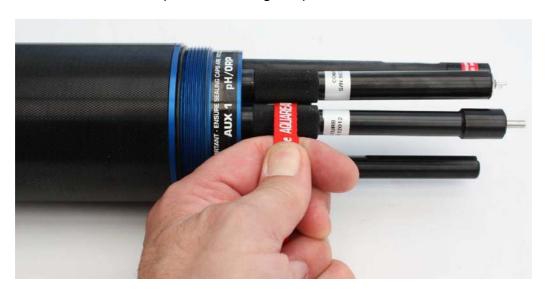

Apply a small amount of silicone grease (supplied with the AP-7000) to the threaded section and the O-ring of the AUX Electrode (see photograph).



ENSURE NO GREASE IS APPLIED TO THE GOLD CONTACTS. Using a clean cloth or tissue paper, polish the gold contacts ensuring they are completely clean. Carefully insert the electrode into the AUX socket and tighten firmly until the O-ring is completely compressed.

Apply a small amount of silicone grease (supplied with the AP-7000) to the threaded section and the O-ring of the AUX Electrode (see photograph).

ENSURE NO GREASE IS APPLIED TO THE GOLD CONTACTS. Using a clean cloth or tissue paper, polish the gold contacts ensuring they are completely clean. Carefully insert the electrode into the AUX socket and tighten firmly until the O-ring is completely compressed.

22.1. Socket Assignment and Calibration

After installation, it is essential to connect the AP-7000 to an Aquameter® and assign the new electrode types to the relevant AUX Sockets. On the Aquameter®, press the MENU key, then select Setup & Install followed by Socket Assignment. When the Socket Assignment option has been selected, the following screen will be displayed.

SOCKET ASSIGNMENTS

→1:EMPTY | 4:EMPTY

2:EMPTY | 5:EMPTY

3:EMPTY | 6:EMPTY

Using the up and down arrow keys, select the AUX socket you wish to assign then move the cursor to the right by pressing the right arrow key. When the cursor has moved to the right of the AUX socket number, use the up and down arrow keys to select the appropriate electrode type. The tables below show the available electrode options and the selection that should be made on this screen:

AP-7000 Optical Electrodes

Electrode Part No.	Function	Aquameter® Selection
7000-TURB	Turbidity	TURB
7000-CPHYLL	Chlorophyll	Cphl
7000-BGA-PC	Phycocyanin (Blue-Green Algae PC)	BGA-PC
7000-BGA-PE	Phycoerythrin (Blue-Green Algae PE)	BGA-PE
7000-RHOD	Rhodamine WT Dye	Rhod
7000-FSCEIN	Fluorescein Dye	Fcein
7000-REFOIL	Refined Oil	R-OIL
7000-CDOM	CDOM/FDOM	CDOM

AP-5000/7000 ISE Electrodes

Electrode Part No.	Function	Aquameter® Selection
5000/7000-AMM	Ammonium/Ammonia	NH4
5000/7000-CHL	Chloride	CI
5000/7000-FLU	Fluoride	F
5000/7000-NIT	Nitrate	NO3
5000/7000-CAL	Calcium	Ca2

When the desired electrode type is showing, move the cursor back to the left of the socket number then press OK to send the selection to the AP-7000. The socket assignments are stored in the AP-7000. If you press the ESC key whilst in this screen, any changes you have made will not be transferred to the AP-7000.

Finally, refer to the relevant section of this manual and carry out a full two-point (optical) or three-point (ISE) calibration of the new electrode.

YOUR NEW ELECTRODE WILL NOT GIVE SENSIBLE READINGS UNTIL IT HAS BEEN FULLY CALIBRATED.

Please note: changing an AUX Socket assignment will clear all the calibration data for that socket.

Keep the blanking plug in a safe place. If you subsequently remove an electrode, be sure to replace the blanking plug and set the socket assignment back to EMPTY.

23. Appendix 3. Standard Electrodes Detailed Specification

Dissolved Oxygen Resolution 0.1% / 0.01mg/L Conductivity (EC) Range 0 - 200 mS/cm (0 - 200,000 μS/cm) Range (EC) Resolution (3 Auto-range scales: 0 - 9999 μS/cm, 10.00 - 99.99 mS/cm, 10.00 - 200,00mS/cm TDS* Range (EC) Accuracy (EC) ± 1% of reading or ± 1μS/cm if greater (see note 2) Resolution (EC) Range (EC) 2 Auto-range scales: 0 - 9999 mg/cm, 10.00 - 100.00g/L Accuracy (EC) ± 1% of reading or ± 1 mg/L if greater (see note 2) Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 2 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Resistivity* Resolution (EC) 3 Auto-range scales: 5 - 9999 Ω·cm, 10.0 - 1000.00 κΩ·cm Seawater (Specific) Resolution (EC) 3 Auto-range scales: 5	Optical	Range	0 – 500.0% / 0 – 50.00 mg/L		
Range	Dissolved	Resolution	0.1% / 0.01mg/L		
Conductivity (EC) Resolution 3 Auto-range scales: 0 – 9999 μS/cm, 10.00 – 99.99 mS/cm, 100.0 – 200.0mS/cm TDS* Range 0 – 100,000 mg/L (ppm) Resolution 2 Auto-range scales: 0 – 9999mg/L, 10.00 – 100.00g/L Accuracy ± 1% of reading or ± 1mg/L if greater (see note 2) Resistivity* Resolution 2 Auto-range scales: 5 – 9999 Ω·cm, 10.0 – 1000.0 KΩ·cm Resistivity* Resolution 2 Auto-range scales: 5 – 9999 Ω·cm, 10.0 – 1000.0 KΩ·cm Accuracy ± 1% of reading or ± 1 Ω·cm if greater (see note 2) Range 0 – 70 PSU / 0 – 70.00 ppt (g/Kg) Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Reading 0 – 50 σ₁ Resolution 0.1 σ₁ Accuracy ± 1.0 σ₁ Range 0 – 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 – 99.99 m Resolution 1 cm <th>Oxygen</th> <td>Accuracy</td> <td colspan="3">0 - 200%: ± 1% of reading. 200% - 500%: ± 10%</td>	Oxygen	Accuracy	0 - 200%: ± 1% of reading. 200% - 500%: ± 10%		
Range D - 100,000 mg/L (ppm)		Range			
Range	Conductivity	Resolution	3 Auto-range scales: 0 – 9999 μS/cm, 10.00 – 99.99 mS/cm, 100.0 – 200.0mS/cm		
Resolution	(EC)	Accuracy	± 1% of reading or ± 1μS/cm if greater (see note 2)		
Resistivity* Accuracy ± 1% of reading or ± 1mg/L if greater (see note 2) Resistivity* Range 5 Ω*cm − 1 MΩ*cm Resolution 2 Auto-range scales: 5 − 9999 Ω*cm, 10.0 − 1000.0 KΩ*cm Accuracy ± 1% of reading or ± 1 Ω*cm if greater (see note 2) Range 0 − 70 PSU / 0 − 70.00 ppt (g/Kg) Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Seawater Specific Range Resolution 0.1 σ _ξ Resolution 0.1 σ _ξ Range 0 − 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 − 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C − +50°C (23°F − 122°F) Resolution 0.1° C/F		Range			
Resistivity* Range 5 Ω*cm − 1 MΩ*cm Resolution 2 Auto-range scales: 5 − 9999 Ω*cm, 10.0 − 1000.0 KΩ*cm Accuracy ± 1% of reading or ± 1 Ω*cm if greater (see note 2) Range 0 − 70 PSU / 0 − 70.00 ppt (g/Kg) Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Seawater Specific Range 0 − 50 σ₁ Resolution 0.1 σ₁ Range 0 − 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 − 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C − +50°C (23°F − 122°F) Resolution 0.1° C/F	TDS*	Resolution	2 Auto-range scales: 0 – 9999mg/L, 10.00 – 100.00g/L		
Resistivity* Resolution 2 Auto-range scales: 5 − 9999 Ω•cm, 10.0 − 1000.0 KΩ•cm Accuracy ± 1% of reading or ± 1 Ω•cm if greater (see note 2) Range 0 − 70 PSU / 0 − 70.00 ppt (g/Kg) Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Seawater Specific Resolution Gravity* Accuracy Resolution 0.1 σ₁ Resolution 0.01 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Resolution 0.1mV Accuracy ± 5mV Resolution 0.1mV Accuracy ± 5mV Range ± 0 − 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C + +50°C (23°F - 122°F) Temperature Resolution 0.1° C/F		Accuracy			
Accuracy		Range			
Salinity* Range 0 − 70 PSU / 0 − 70.00 ppt (g/Kg) Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Seawater Specific Range 0 − 50 σ₁ Gravity* Accuracy ± 1.0 σ₁ Range 0 − 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) ORP Resolution 0.1mV Accuracy ± 5mV Range ± 0 − 99.99 m Pepth Resolution 1cm Accuracy ± 0.2% FS Range -5°C − +50°C (23°F − 122°F) Resolution 0.1° C/F	Resistivity*	Resolution	<u> </u>		
Salinity* Resolution 0.01 PSU / 0.01 ppt Accuracy ± 1% of reading or ± 0.1 unit if greater (see note 2) Seawater Specific Range 0 - 50 σ _t Gravity* Accuracy ± 1.0 σ _t Range 0 - 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 - 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Temperature Resolution 0.1° C/F		Accuracy			
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		Range	11 (6 6)		
Seawater Specific Range 0 - 50 σ _t Gravity* Accuracy ± 1.0 σ _t PH Range 0 - 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 - 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Temperature Resolution 0.1° C/F	Salinity*				
Specific Gravity* Resolution 0.1 σ _t μ Range 0 – 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1 mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) ORP Resolution Accuracy ± 5mV Range ± 0 – 99.99 m Depth Resolution Accuracy ± 0.2% FS Range -5°C – +50°C (23°F – 122°F) Temperature Resolution 0.1° C/F		Accuracy	± 1% of reading or ± 0.1 unit if greater (see note 2)		
Gravity* Accuracy ± 1.0 σ _t PH Range 0 – 14 pH / ± 625mV (see note 3) Resolution 0.01 pH / ± 0.1mV Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 – 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C – +50°C (23°F – 122°F) Resolution 0.1° C/F	Seawater	Range			
Range 0 - 14 pH / ± 625mV (see note 3)	Specific	Resolution	0.1 σ _t		
pH Resolution 0.01 pH / ± 0.1 mV Accuracy ± 0.1 pH / ± 5 mV Range ± 2000mV (see note 3) Resolution 0.1 mV Accuracy ± 5 mV Range ± 0 - 99.99 m Resolution 1 cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Resolution 0.1° C/F	Gravity*	Accuracy	± 1.0 σ _t		
Accuracy ± 0.1 pH / ± 5mV Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 - 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Resolution 0.1° C/F		Range	0 - 14 pH / ± 625mV (see note 3)		
ORP Range ± 2000mV (see note 3) Resolution 0.1mV Accuracy ± 5mV Range ± 0 - 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Resolution 0.1° C/F	pН	Resolution	0.01 pH / ± 0.1mV		
ORP Resolution 0.1mV Accuracy ± 5mV Pange ± 0 – 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C – +50°C (23°F – 122°F) Resolution 0.1° C/F	<u> </u>	Accuracy	± 0.1 pH / ± 5mV		
ORP Resolution 0.1mV Accuracy ± 5mV Pange ± 0 – 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C – +50°C (23°F – 122°F) Resolution 0.1° C/F		Range	± 2000mV (see note 3)		
Depth Range ± 0 – 99.99 m Resolution 1cm Accuracy ± 0.2% FS Range -5°C – +50°C (23°F – 122°F) Resolution 0.1° C/F	ORP		· · · ·		
Depth Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Resolution 0.1° C/F		Accuracy	± 5mV		
Depth Resolution 1cm Accuracy ± 0.2% FS Range -5°C - +50°C (23°F - 122°F) Resolution 0.1° C/F		Range	± 0 – 99.99 m		
Range -5°C - +50°C (23°F - 122°F) Temperature Resolution 0.1° C/F	Depth		1cm		
Temperature Resolution 0.1° C/F		Accuracy	± 0.2% FS		
· ·		Range	-5°C – +50°C (23°F – 122°F)		
Accuracy ± 0.5° C	Temperature	Resolution	0.1° C/F		
		Accuracy	± 0.5° C		

^{*} Readings calculated from EC and temperature electrode values Aquaread® Ltd reserves the right to change specifications without notice

Notes:

- 1. The accuracy figures quoted throughout this document represent the equipment's capability at the calibration points at 25°C. These figures do not take into account errors introduced by variations in the accuracy of calibration solutions and errors beyond the control of the manufacturer that may be introduced by environmental conditions in the field. Accuracy in the field is also dependent upon **full calibration** and minimal time between calibration and use
- 2. The EC electrode can be calibrated at various points for use in fresh, brackish or salt water. The quoted accuracy of the electrode, and therefore all derived readings, relies upon the readings being within a reasonable range of the calibration point. For taking measurements in fresh surface or ground water, use Aquaread® RapidCal solution. If this is not available, use a third party 1413μS/cm EC Calibration Standard. For taking readings in brackish or salt water, use a third party 12,880μS/cm (12.88mS/cm) EC Calibration Standard.
- 3. The measurement of pH and ORP relies upon the ability of the electrode to pass a minute electrical current through the water under test. For this reason, when using the standard pH/ORP electrode, the water under test must have a minimum EC (electrical conductivity) of 100µS/cm. Special low EC pH electrodes are available to special order.

24. Appendix 4. Optical Electrodes Detailed Specification and FAQs

24.1. What are the excitation and detection wavelengths?

Each Aquaread® Optical Electrode (with the exception of Turbidity) is effectively a standalone, fixed frequency fluorometer, specially tuned to excite and detect fluorescence of selected substances in water.

The Turbidity electrode is not a fluorometer. This electrode employs a Nephelometric measurement technique in accordance with ISO 7027.

The following table shows the excitation peak wavelengths and detection ranges for each electrode.

Electrode	Excitation Peak Wavelength	Detection Range
Chlorophyll	470nm	>630nm
Blue-Green Algae Phycocyanin (BGA-PC)	590nm	>655nm
Blue-Green Algae Phycoerythrin (BGA-PE)	520nm	>575nm
Fluorescein Dye	470nm	>550nm
Rhodamine WT	520nm	>575nm
Refined Oil	285nm	330nm – 370nm
CDOM	365nm	450nm - 520nm
Turbidity	850nm	850nm

Each fluorometer electrode (with the exception of the Refined Oil Electrode) emits short pulses of high energy light at the excitation wavelength and responds to fluorescence in the detection range. The deep UV excitation of the Refined Oil Electrode operates on a 15 second on / 15 second off duty cycle.

24.2. How does the Refined Oil sensor work?

The Refined Oil sensor detects volatile organic compounds (VOCs) that are found in petroleum derivatives. These include benzene, toluene, ethylbenzene, and xylenes (BTEX).

The sensor is a fixed frequency *in situ* fluorometer that uses deep UV wavelengths (285nm) to excite the VOCs. An emission filter is then used to detect any fluorescence generated by the VOCs between 330 and 370nm.

The electrode measures the VOCs immediately in front of the sensor face so will measure at whatever depth the probe is lowered to. Naturally, the probe will only detect compounds that are actually mixed/dissolved in the water, not those floating on the surface.

The Refined Oil electrode is ideal for customers who are interested in detecting the presence or absence of VOC's and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

The electrode is not intended for absolute, quantitative measurements. This can only really be done using Gas or Liquid Chromatography in a laboratory.

24.3. I can see algae in the water but my sensor is giving low readings. Why?

Aquaread[®] Chlorophyll and Blue-Green Algae sensors are not designed to measure floating macroscopic (visible to the naked eye) algae or plant material.

The sensors measure the fluorescence from the microscopic phytoplankton suspended within the body of the water below the surface. Carpets of floating algae are often seen on environmental water that has low subsurface phytoplankton concentrations. In these circumstances, the fluorescent algae sensors will return low readings.

24.4. What is the Range and Resolution of the Optical Electrodes?

Turbidity	Range	0 – 3000 NTU	
	Resolution	2 Auto-range scales: 0.0 - 99.9 NTU, 100 - 3000 NTU	
	Accuracy	± 5% of auto-ranged scale	
	MLD ⁽¹⁾	0.0 NTU	
	MLR ⁽²⁾	5.0 NTU	
	Range	0 – 500.0 μg/L (ppb)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 μg/L, 100.0 - 500.0 μg/L	
Chlorophyll	Repeatability	± 5% of reading	
	MLD ⁽¹⁾	0.1µg/L	
	MLR ⁽²⁾	5 μg/L	
Phycocyanin	Range	0 – 300,000 cells/mL	
(BGA-PC)	Resolution	1 cell/mL	
(Freshwater Blue	Repeatability	± 10% of reading	
-Green Algae)	MLD ⁽¹⁾	200 cells/mL	
Phycoerythrin	Range	0 – 200,000 cells/mL	
(BGA-PE)	Resolution	1 cell/mL	
(Marine Blue-	Repeatability	± 10% of reading	
Green Algae)	MLD ⁽¹⁾	400 cells/mL	
	Range	0 – 500 μg/L (ppb)	
Rhodamine	Resolution	2 Auto-range scales: 0.00 - 99.99 μg/L, 100.0 - 500.0 μg/L	
WT Dye	Repeatability	± 5% of reading	
	MLD ⁽¹⁾	0.1 μg/L	
	MLR ⁽²⁾	5 μg/L	
	Range	0 – 500 μg/L (ppb)	
Fluorescein	Resolution	2 Auto-range scales: 0.00 - 99.99 μg/L, 100.0 - 500.0 μg/L	
Dye	Repeatability	± 5% of reading	
	MLD ⁽¹⁾	0.1 μg/L	
	MLR ⁽²⁾	5 μg/L	
	Range	0 – 10,000 μg/L (ppb) (Napthalene)	
Refined Oil	Resolution	0.1 μg/L	
Reillieu Oli	Repeatability	± 10% of reading	
	MLD ⁽¹⁾	10 μg/L (Napthalene)	
	Range	0 – 20,000 μg/L (ppb) (Quinine Sulphate)	
CDOM/FDOM	Resolution	2 Auto-range scales: 0.0 – 9,999.9 μg/L, 10,000 – 20,000 μg/L	
	Repeatability	± 10% of reading	
	MLD ⁽¹⁾	10 μg/L (Quinine Sulphate)	
Aguaread® I to reserves the right to change specifications without notice			

Aquaread® Ltd reserves the right to change specifications without notice

Notes:

- 1. MLD (Minimmum Level of Detection) is the minimum value the electrode is physically capable of measuring.
- 2. MLR (Minimum Level of Repeatability) is the value below which optical electrode readings become generally unreliable and unrepeatable (unless taken under ideal conditions) due to interfering factors such as refraction from visible air bubbles and microscopic aeration.

24.5. What is the Accuracy of the Optical Electrodes?

All Optical Electrodes, with the exception of the Turbidity Electrode, employ fluorescent measurement techniques. Interference from microbiological species and compounds which fluoresce at similar wavelengths and differences in fluorescence caused by temperature, ambient light and turbidity can all cause inaccuracies.

Fluorescence measurement is ideal for researchers who are interested in detecting the presence or absence of a specific substance in reasonable concentrations and measuring relative fluorescence changes that can be used as an indication of increasing or decreasing concentrations.

Fluorescence measurement techniques are <u>not ideal for quantitative measurement</u> and it is therefore impossible to specify an absolute accuracy.

In order to obtain accurate results, data obtained with a fluorescent electrode in the field must be post-calibrated with data from standard laboratory analysis of grab samples acquired during the study.

25. Appendix 4. ISE Electrodes Detailed Specification

	Range	0 – 9,000mg/L (ppm)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 mg/L, 100.0 - 8,999.9 mg/L	
Ammonium / Accuracy ± 10% of reading or 2ppm (whichever is greated MLD(1) 1.0 ppm		± 10% of reading or 2ppm (whichever is greater)	
		1.0 ppm	
	Interfering Ions(2)	Potassium, Sodium and Magnesium	
	pH Range ⁽³⁾	5 - 8	
	Range	0 – 20,000mg/L (ppm)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 mg/L, 100.0 – 19,999.9 mg/L	
Chloride	Accuracy	± 10% of reading or 2ppm (whichever is greater)	
	MLD ⁽¹⁾	2.0 ppm	
	Interfering Ions(2)	Bromide, Iodide, Cyanide and Sulphide	
	pH Range ⁽³⁾	2 - 11	
	Range	0 – 1,000mg/L (ppm)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 mg/L, 100.0 – 999.9 mg/L	
Fluoride	Accuracy	± 10% of reading or 2ppm (whichever is greater)	
	MLD ⁽¹⁾	0.05 ppm	
	Interfering Ions ⁽²⁾	Hydroxide (OH-)	
	pH Range ⁽³⁾	4 - 8	
	Range	0 – 30,000mg/L (ppm)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 mg/L, 100.0 – 29,999.9 mg/L	
Nitrate	Accuracy	± 10% of reading or 2ppm (whichever is greater)	
MLD ⁽¹⁾		0.5 ppm	
	Interfering Ions ⁽²⁾	Chloride, Bromide, Fluoride, Sulphate, Chlorate and Perchlorate	
	pH Range ⁽³⁾	3 - 10	
	Range	0 – 2,000mg/L (ppm)	
	Resolution	2 Auto-range scales: 0.00 - 99.99 mg/L, 100.0 – 1,999.9 mg/L	
Calcium	Accuracy	± 10% of reading or 2ppm (whichever is greater)	
	MLD ⁽¹⁾	0.05 ppm	
	Interfering lons(2)	Magnesium, Barium, Lead, Zinc and Sodium	
	pH Range ⁽³⁾	4 - 9	

[†] Ammonia readings are calculated from Ammonium, pH and temperature electrode values. Aquaread[®] Ltd reserves the right to change specifications without notice

Notes:

- 1. MLD (Minimmum Level of Detection) is the minimum value the electrode is physically capable of measuring.
- 2. Each ion selective electrode is prone to interference from ions that are similar in nature to the target ion. The main interfering ions for each electrode type are listed here. If the water under test contains interfering ions, the electrode will produce erroneous readings. Ion Selective Electrodes are not recommended for use in brackish or salt water due to the high level of interfering ions.
- 3. Each ion selective electrode will only operate within a specific pH and EC range. The pH limits vary and are listed against each electrode. All ion selective electrodes work in conjunction with the pH electrode during measurement. For this reason, the selected Aquaprobe® must have a working pH or pH/ORP electrode fitted and the conductivity (EC) of the water under test must be greater than 50µS/cm.
- 4. All ion selective electrodes exhibit calibration drift over time. Drift should not be a major problem where the electrodes can be frequently calibrated. However, if the electrodes are to be used in long-term deployment studies, drift is almost certain to occur.

During long term deployment of ion selective electrodes, the user should obtain grab samples during the course of the deployment for analysis in the laboratory by chemical means and use the results to apply post calibration to the recorded results.

- 5. Accuracy in the field is dependent upon <u>full three-point calibration</u> and minimal time between calibration and use.
- 6. In order to achieve accurate readings with ISE electrodes, the Probe needs to be either placed in flowing water, or needs to be stirred or raised and lowered continuously to ensure a minimum flow rate of 0.3m/s over the electrode. If there is no water flow across the ISE electrode, the ions in the immediate area of the electrode will be depleted and the reading will start to fall. This also applies during calibration, where the probe should be stirred at all times.

25.1. Special Notes Concerning ISE Electrodes and pH Buffer Solutions

The high ionic concentration of pH calibration solutions (buffers), including RapidCal, can cause significant offsets in ISE electrodes.

These offsets are temporary, but best avoided because they can cause significant errors during both calibration and normal operation.

For this reason all ISE electrodes are supplied with a red rubber sealing cap.

The caps should be fitted to all ISE Electrodes during pH calibration or when using RapidCal in order to protect the ISE electrodes from the effects of the buffer solution.



At all other times, the ISE electrodes should be left uncovered.