



GREY BANNER ALERT



mainroads
WESTERN AUSTRALIA

SHW Serious Incident (SI) – Final Notice

Date of Incident:	10 June 2023	Time of Incident:	10.00am
Region / Directorate:	RMO – MWG	Main Roads or Contractor:	Contractor
EQSafe Event Type:	SHW Procedure Breach	EQSafe Incident Number:	31898
Actual Consequence:	Insignificant	Potential Consequence:	Major

Incident Short Description:	Worker on foot within 1.2m of a live trafficable lane
------------------------------------	---


Executive Summary:

Whilst travelling through the northern worksite at approximately 10.00am on Saturday 10 June, a Main Roads worker has witnessed a works supervisor talking to the driver of a 6-wheeler work truck that was stopped in the working lane.

The supervisor was standing on the centre line whilst the live lane was open to traffic with a set speed of 60km/hr and had no escape route from live traffic.

The Main Roads worker has then pulled over onto the road shoulder to make contact with the supervisor and has remained well clear of the work site. The supervisor was then informed that they needed to remove themselves from the centre line and remain clear of the 1.2m exclusion zone.

STATIC WORKSITE
SINGLE LANE SHUTTLE UNDER PORTABLE TRAFFIC SIGNALS
110km/h ROADS - WORKERS BETWEEN 1.2m - 3.0m OF TRAFFIC
TRAFFIC SIGNALS SHALL ONLY BE USED UNDER MANUAL OPERATION.
IMPLEMENTATION: 0600 - 1800

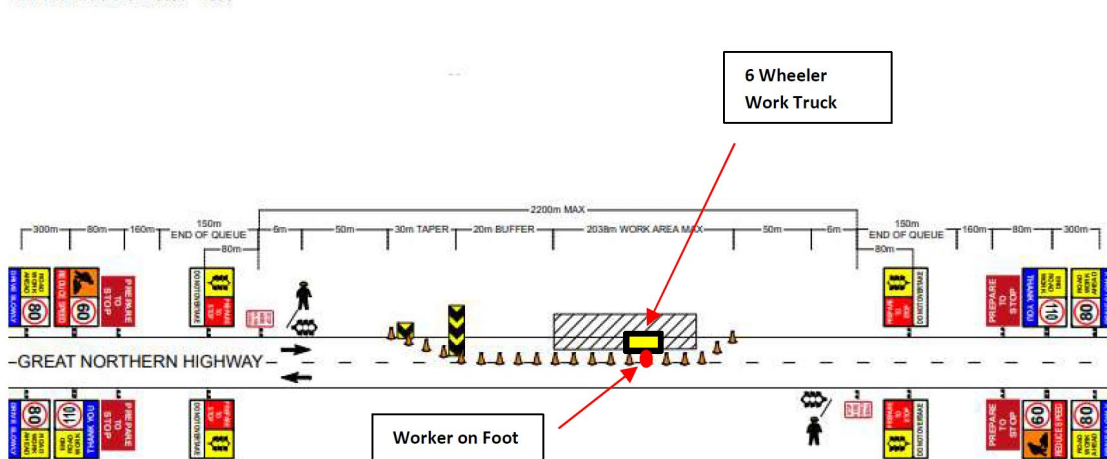

Position of worker on foot and 6-wheeler within traffic management set up.

Contributing Factors:	
• Failure to include exclusion zones from live traffic lanes within the site-specific induction for all sub-contractors. • Complacency of individual. • Supervisor did not assess the risk of approaching water cart driver from the driver's side of vehicle. • Lack of information around traffic management requirements for those that do not hold or have not held traffic management accreditations. • SWMS does not contain information regarding exclusion zones from traffic at 40 or 60km/h restrictions. • Traffic Management personnel and truck driver did not warn Supervisor of oncoming traffic.	
Corrective Actions:	
• Pre-start to discuss statistics, exclusion zones, and escape routes, and the importance of following traffic management procedures. • Review site-specific inductions and include information regarding exclusion zones and speed restrictions. • Update SWMS to include information regarding exclusion zones and speed restrictions.	
Additional Issues/Learnings:	
The project induction lacked information regarding the exclusion zones for working next to live traffic. The induction paid more attention to the types of live traffic present within the work site and there was no information on how close the workers on foot are to be working next to live traffic. Making this information part of the induction process gives confidence that all road workers working on the project will have an awareness and understanding of the exclusion zone requirements prior to working on site.	
 Critical Risk: This serious potential incident aligns with the Main Roads Critical Risk Profile relating to Interaction With Live Traffic.	
Distribution of Notice:	Main Roads Personnel and Contracting Organisations