Waterjet quote - X carriage and Z plates, material supplied by the shop

Two drawings, both **1/2in 6061**: the **X carriage plate** and the **Z plate**. 🔴 **Please supply the material for these two** - unlike our other requests, nothing is being handed over, so **the outline on each drawing is a CUT line**: profile and holes both. **Neither part has been made before**, so there is no existing piece to match. 🔴 **THE TWO PLATES WANT DIFFERENT HOLE SIZES AND BOTH ARE DELIBERATE.** Every hole that gets counterbored is drawn at its pilot size and **must be cut at that size, not opened out**: the X carriage plate's sixteen at **ø5.2** and the Z plate's twenty at **ø6.2**. We counterbore them here with piloted bits, and a hole cut any larger than its pilot leaves the pilot nothing to steer on - the counterbore then cannot be made at all. The holes that are NOT counterbored are drawn at their finished size. Origin is the lower-left corner on both, which is also each plate's installed bottom-left. **Every drawing is a separate DXF** and the file name is printed on its page.

What is in it

File	Part	Material	Overall	Holes
`8-x-carriage-plate.dxf`	X CARRIAGE PLATE - QTY 1		430 × 170 mm	24 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 1 × ø35 mm (1.378 in)
`9-z-plate.dxf`	Z PLATE - QTY 1		180 × 170 mm	2 × ø6 mm (0.236 in) · 20 × ø6.2 mm (0.244 in) · 8 × ø6.8 mm (0.268 in)

How to read the drawings

- **Units are millimetres** and the origin is the lower-left corner of every drawing, marked with a **red dot**. Inch equivalents are printed alongside for reference only — work to the millimetre figures.
- **Hole offsets from that origin are printed on each page** — the **X** values across the top, the **Y** values down the left side, each on a leader from its own tick. They are there to read the drawing by; the **DXF is the authority** and the offsets are taken from it.
- **R12 DXF, lines, circles and arcs only.** No polylines, no splines, no blocks. Outlines are closed.
- **Layers:** OUTLINE is the cut profile, HOLES are the holes, NOTES and PARTS are text and are not to be cut.
- **Where a drawing says STOCK, the material is supplied** and the outline drawn IS that piece — the job is the holes, and any excess falls outside them. Where it says MATERIAL, the shop supplies the plate and the outline is the part to cut.
- **Holes called out as edge-bored are not drawn.** They run into a part's end face rather than through it, and are drilled here.
- **Where two parts share one piece**, both are drawn in position on it with the kerf allowed between them.

What would help on the quote

- Price **per drawing**, and separately the material where you are supplying it.
- Say if any hole is **below your minimum for the thickness** — a pilot that gets opened out here is fine, and so is a scribed mark, so tell us which you would rather cut.
- Note any outline you would rather nest differently. Nesting is yours to choose; the drawings do not assume one.

X CARRIAGE PLATE - QTY 1


PART 430 mm (16.929 in) x 170 mm (6.693 in) x 12.7 mm (0.500 in) 6061 - SHOP TO SUPPLY THE MATERIAL

THE OUTLINE IS A CUT LINE ON THIS DRAWING - profile and holes both

UNITS mm - ORIGIN LOWER LEFT

Holes 24 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 8-x-carriage-plate.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

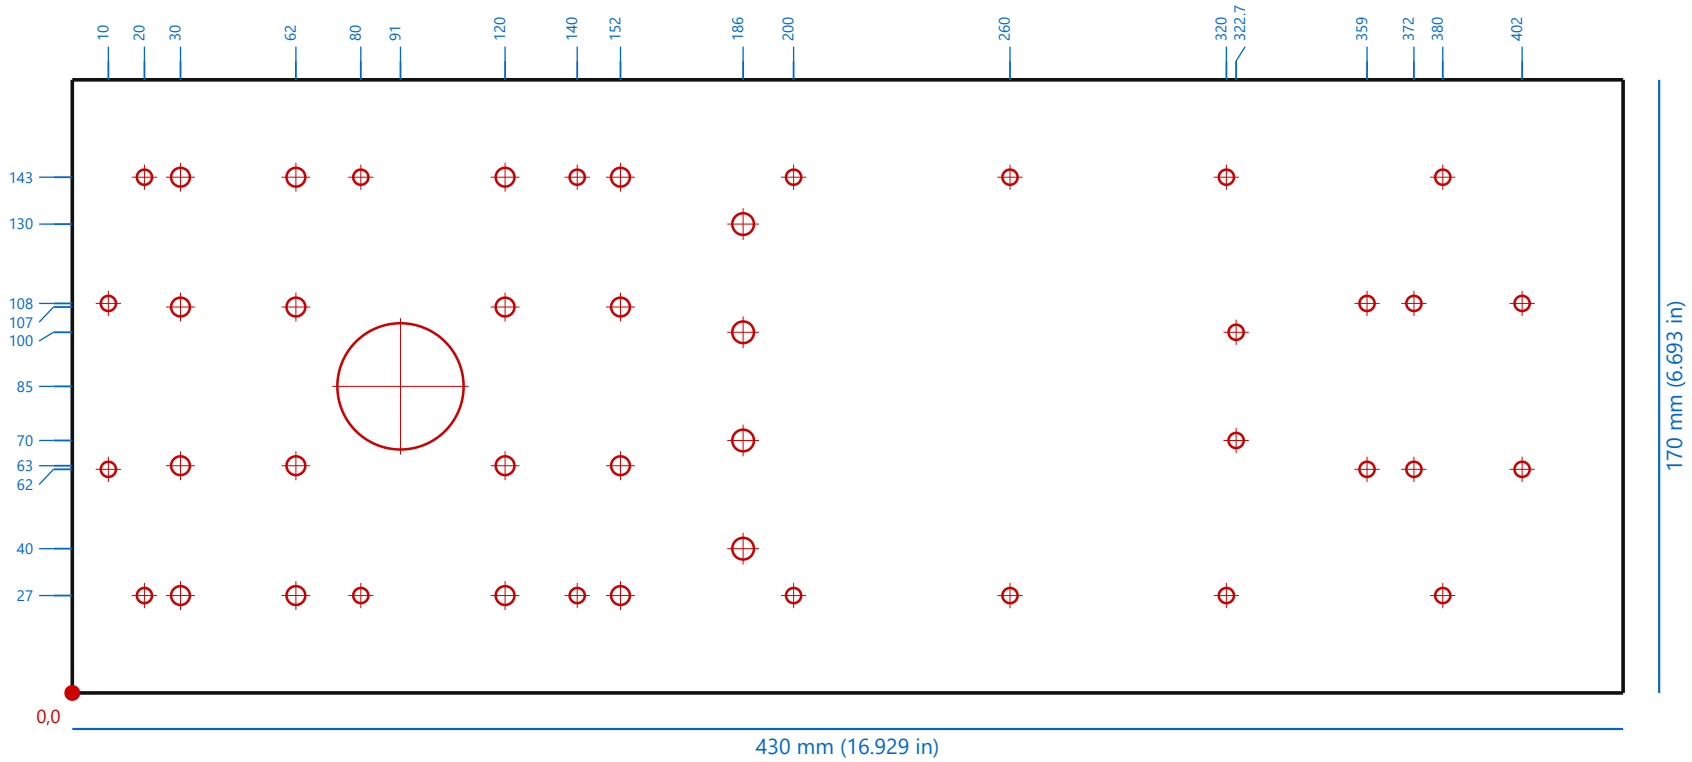

Z PLATE - QTY 1

PART 180 mm (7.087 in) x 170 mm (6.693 in) x 12.7 mm (0.500 in) 6061 - SHOP TO SUPPLY THE MATERIAL

THE OUTLINE IS A CUT LINE ON THIS DRAWING - profile and holes both

UNITS mm - ORIGIN LOWER LEFT

Holes 2 × ø6 mm (0.236 in) · 20 × ø6.2 mm (0.244 in) · 8 × ø6.8 mm (0.268 in)

Drawn at 1:1.5 from the DXF itself · 9-z-plate.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

