Waterjet quote - X gantry end plates

Two drawings in **6061**: the two **X gantry end plates**, each with its doubler nested in the strip beside it. **All material is supplied** and the outline drawn is the piece handed over, so the job is the holes and the profiles cut out of each piece. **Every drawing is a separate DXF** and the file name is printed on its page.

What is in it

File	Part	Material	Overall	Holes
`5-x-end-plate-left.dxf`	X GANTRY END PLATE, LEFT-HAND - QTY 1 + 2 DOUBLERS	STOCK 300 mm (11.811 in) x 200 mm (7.874 in) x 12.19 mm (0.480 in) 6061	300 × 200 mm	8 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)
`6-x-end-plate-right.dxf`	X GANTRY END PLATE, RIGHT-HAND WITH THE TONGUE - QTY 1 + 1 DOUBLER	STOCK 300 mm (11.811 in) x 200 mm (7.874 in) x 12.19 mm (0.480 in) 6061	300 × 200 mm	8 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)

How to read the drawings

- **Units are millimetres** and the origin is the lower-left corner of every drawing, marked with a **red dot**. Inch equivalents are printed alongside for reference only — work to the millimetre figures.
- **Hole offsets from that origin are printed on each page** — the **X** values across the top, the **Y** values down the left side, each on a leader from its own tick. They are there to read the drawing by; the **DXF is the authority** and the offsets are taken from it.
- **R12 DXF, lines, circles and arcs only.** No polylines, no splines, no blocks. Outlines are closed.
- **Layers:** OUTLINE is the cut profile, HOLES are the holes, NOTES and PARTS are text and are not to be cut.
- **Where a drawing says STOCK, the material is supplied** and the outline drawn IS that piece — the job is the holes, and any excess falls outside them. Where it says MATERIAL, the shop supplies the plate and the outline is the part to cut.
- **Holes called out as edge-bored are not drawn.** They run into a part's end face rather than through it, and are drilled here.
- **Where two parts share one piece**, both are drawn in position on it with the kerf allowed between them.

What would help on the quote

- Price **per drawing**, and separately the material where you are supplying it.
- Say if any hole is **below your minimum for the thickness** — a pilot that gets opened out here is fine, and so is a scribed mark, so tell us which you would rather cut.
- Note any outline you would rather nest differently. Nesting is yours to choose; the drawings do not assume one.

X GANTRY END PLATE, LEFT-HAND - QTY 1 + 2 DOUBLERS


STOCK 300 mm (11.811 in) x 200 mm (7.874 in) x 12.19 mm (0.480 in) 6061

UNITS mm - ORIGIN LOWER LEFT - BOTH PARTS OFF ONE PIECE

8 EDGE-BORED HOLE(S) ARE NOT DRAWN - they run into an end face and are drilled here

Holes 8 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 5-x-end-plate-left.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

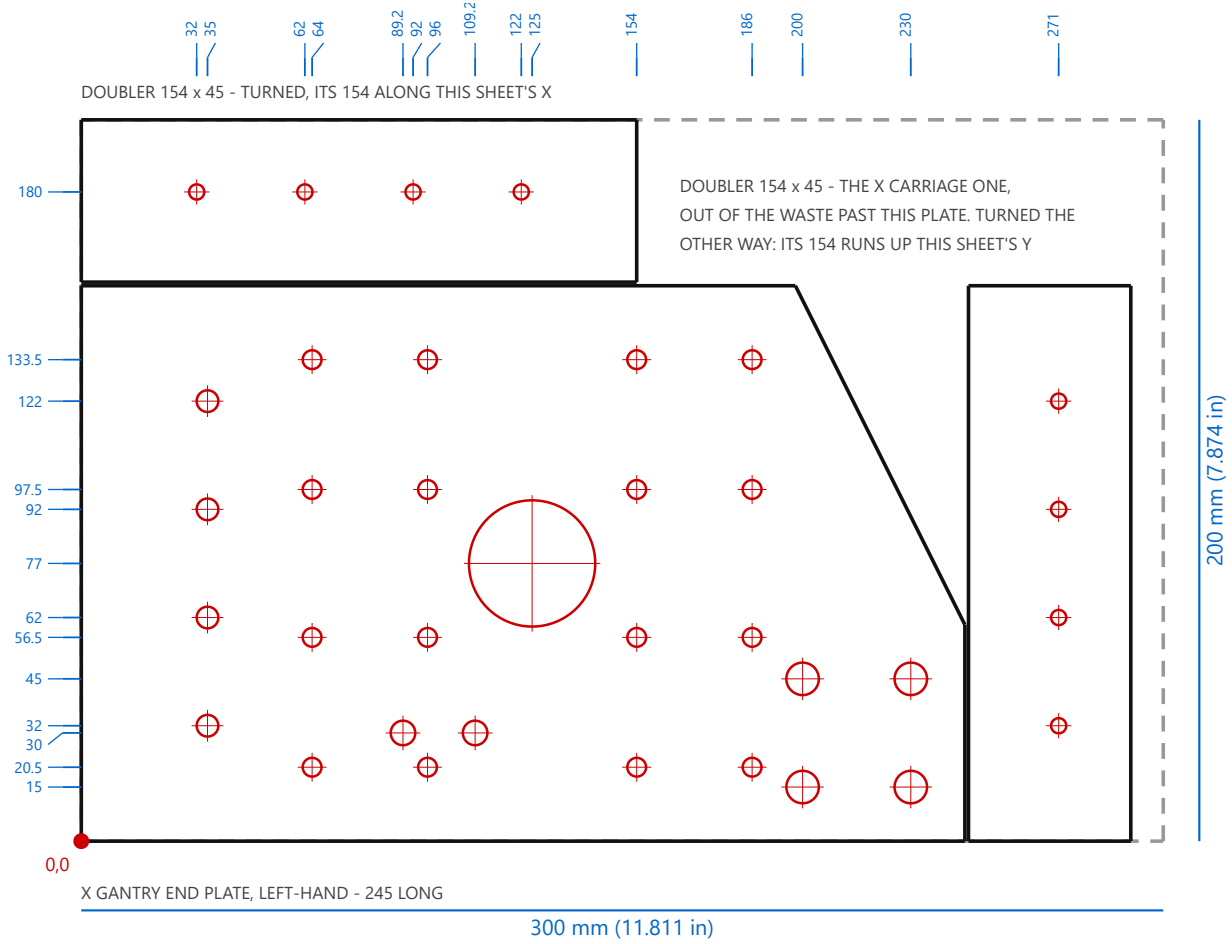

X GANTRY END PLATE, RIGHT-HAND WITH THE TONGUE - QTY 1 + 1 DOUBLER

STOCK 300 mm (11.811 in) x 200 mm (7.874 in) x 12.19 mm (0.480 in) 6061

UNITS mm - ORIGIN LOWER LEFT - BOTH PARTS OFF ONE PIECE

8 EDGE-BORED HOLE(S) ARE NOT DRAWN - they run into an end face and are drilled here

Holes 8 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 6-x-end-plate-right.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

