Waterjet quote - X gantry end plates and doublers

Three drawings in **6061**: the two **X gantry end plates** and the three **doubler blocks**. **Every part is already cut to finished size and the job is the holes only** - each outline is drawn to register against and is **not** a cut line. On the end plates the origin is on the part's factory long edge, not the sawn one. **Every drawing is a separate DXF** and the file name is printed on its page.

What is in it

File	Part	Material	Overall	Holes
`5-x-end-plate-left.dxf`	X GANTRY END PLATE, LEFT-HAND - QTY 1		245 × 154 mm	16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)
`6-x-end-plate-right.dxf`	X GANTRY END PLATE, RIGHT-HAND WITH THE TONGUE - QTY 1		300 × 154 mm	4 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)
`7-doublers.dxf`	DOUBLER BLOCKS - QTY 3		154 × 163 mm	12 × ø4.2 mm (0.165 in)

How to read the drawings

- **Units are millimetres** and the origin is the lower-left corner of every drawing, marked with a **red dot**. Inch equivalents are printed alongside for reference only — work to the millimetre figures.
- **Hole offsets from that origin are printed on each page** — the **X** values across the top, the **Y** values down the left side, each on a leader from its own tick. They are there to read the drawing by; the **DXF is the authority** and the offsets are taken from it.
- **R12 DXF, lines, circles and arcs only.** No polylines, no splines, no blocks. Outlines are closed.
- **Layers:** OUTLINE is the cut profile, HOLES are the holes, NOTES and PARTS are text and are not to be cut.
- **Where a drawing says STOCK, the material is supplied** and the outline drawn IS that piece — the job is the holes, and any excess falls outside them. Where it says MATERIAL, the shop supplies the plate and the outline is the part to cut.
- **Holes called out as edge-bored are not drawn.** They run into a part's end face rather than through it, and are drilled here.
- **Where two parts share one piece**, both are drawn in position on it with the kerf allowed between them.

What would help on the quote

- Price **per drawing**, and separately the material where you are supplying it.
- Say if any hole is **below your minimum for the thickness** — a pilot that gets opened out here is fine, and so is a scribed mark, so tell us which you would rather cut.
- Note any outline you would rather nest differently. Nesting is yours to choose; the drawings do not assume one.

X GANTRY END PLATE, LEFT-HAND - QTY 1

PART 245 mm (9.646 in) x 154 mm (6.063 in) x 12.19 mm (0.480 in) 6061 - ALREADY CUT TO SIZE


UNITS mm - ORIGIN LOWER LEFT - THE OUTLINE IS REFERENCE, NOT A CUT LINE

ORIGIN IS ON THE FACTORY LONG EDGE - the UNCUT one, NOT the sawn edge the doubler came off

4 EDGE-BORED HOLE(S) ARE NOT DRAWN - they run into an end face and are drilled here

Holes 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 5-x-end-plate-left.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

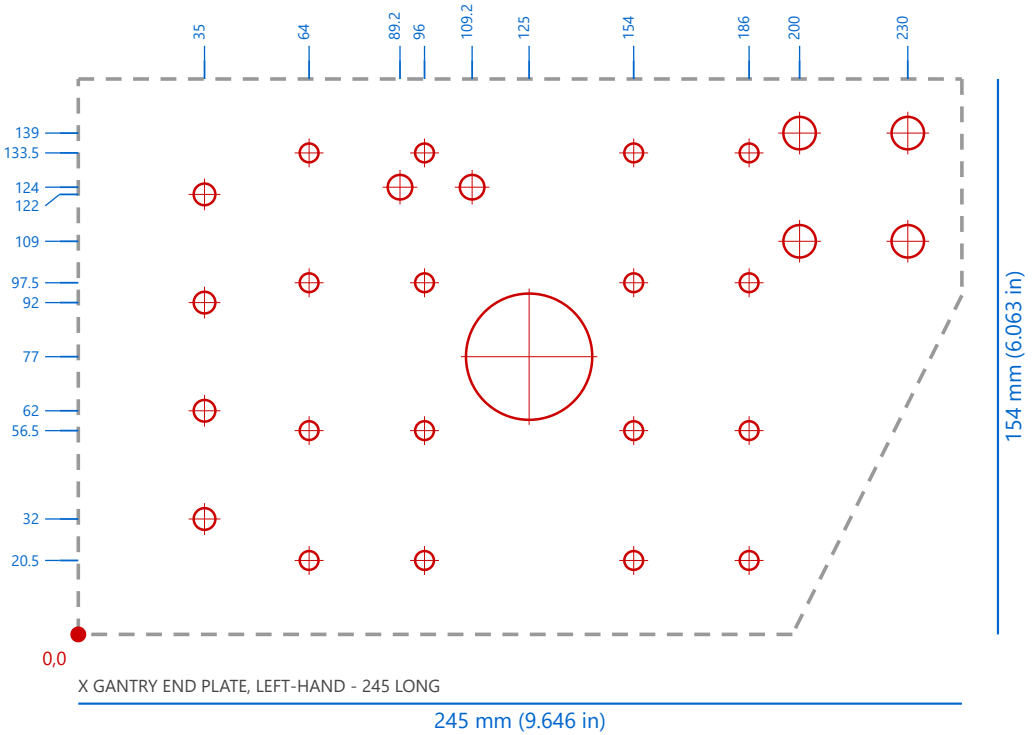

X GANTRY END PLATE, RIGHT-HAND WITH THE TONGUE - QTY 1

PART 300 mm (11.811 in) x 154 mm (6.063 in) x 12.19 mm (0.480 in) 6061 - ALREADY CUT TO SIZE


UNITS mm - ORIGIN LOWER LEFT - THE OUTLINE IS REFERENCE, NOT A CUT LINE

ORIGIN IS ON THE FACTORY LONG EDGE - the UNCUT one, NOT the sawn edge the doubler came off

4 EDGE-BORED HOLE(S) ARE NOT DRAWN - they run into an end face and are drilled here

Holes 4 × ø4.2 mm (0.165 in) · 16 × ø5.2 mm (0.205 in) · 4 × ø6 mm (0.236 in) · 2 × ø6.8 mm (0.268 in) · 4 × ø9 mm (0.354 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 6-x-end-plate-right.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

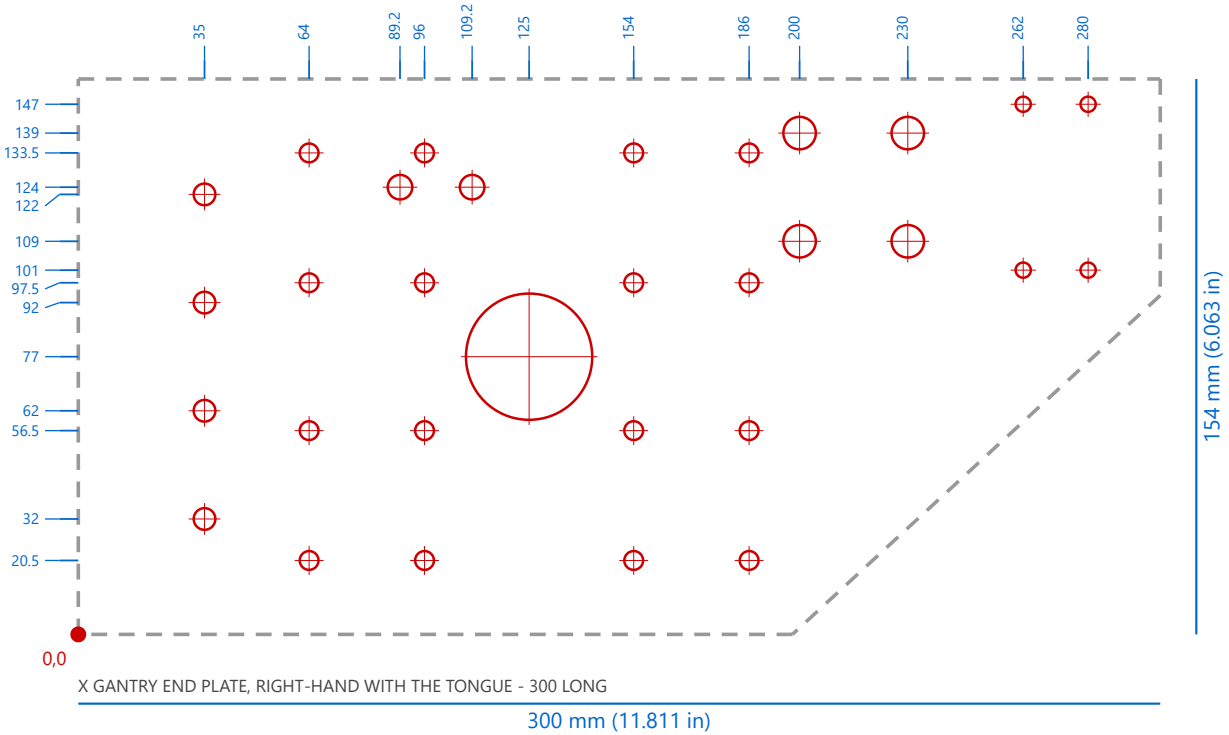

DOUBLER BLOCKS - QTY 3

PART 154 mm (6.063 in) x 45 mm (1.772 in) x 12.19 mm (0.480 in) 6061 - ALREADY SAWN TO SIZE

UNITS mm - ORIGIN LOWER LEFT OF EACH BLOCK - THE OUTLINE IS REFERENCE, NOT A CUT LINE

4 EDGE-BORED HOLE(S) PER BLOCK ARE NOT DRAWN - they run into an end face and are drilled there

Holes 12 × ø4.2 mm (0.165 in)

Drawn at 1:1.5 from the DXF itself · 7-doublers.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

