Waterjet quote - X carriage and Z plates, material supplied by the shop

Two drawings, both **1/2in 6061**: the **X carriage plate** and the **Z plate**. 🔴 **Please supply the material for these two** - unlike our other requests, nothing is being handed over, so **the outline on each drawing is a CUT line**: profile and holes both. **Neither part has been made before**, so there is no existing piece to match. 🔴 **EVERY HOLE IS DRAWN AT THE SIZE WE WANT YOU TO CUT, which is not always its finished size.** You told us you cannot hold better than about an eighth of an inch on anything under 6.8, so the drawings are laid out around that rather than against it, and **please cut exactly what is drawn**: **ø2 is a pilot** - we open those out and tap them here, so a small hole's size does not matter to us at all, only its position; **ø6 we want at 6** - our counterbore's pilot fits the ø6 holes you cut on the last plate, so please do not open these out; **ø6.8 and ø35 are finished sizes** - the 6.8 is an M8 tap drill and your 6.8 and 9 both came back accurate on the last job, which is why those are the ones we are asking you to hold. Origin is the lower-left corner on both, which is also each plate's installed bottom-left. **Every drawing is a separate DXF** and the file name is printed on its page.

What is in it

File	Part	Material	Overall	Holes
`8-x-carriage-plate.dxf`	X CARRIAGE PLATE - QTY 1		430 × 170 mm	40 × ø2 mm (0.079 in) · 4 × ø6 mm (0.236 in) · 1 × ø35 mm (1.378 in)
`9-z-plate.dxf`	Z PLATE - QTY 1		180 × 170 mm	22 × ø6 mm (0.236 in) · 8 × ø6.8 mm (0.268 in)

How to read the drawings

- **Units are millimetres** and the origin is the lower-left corner of every drawing, marked with a **red dot**. Inch equivalents are printed alongside for reference only — work to the millimetre figures.
- **Hole offsets from that origin are printed on each page** — the **X** values across the top, the **Y** values down the left side, each on a leader from its own tick. They are there to read the drawing by; the **DXF is the authority** and the offsets are taken from it.
- **R12 DXF, lines, circles and arcs only.** No polylines, no splines, no blocks. Outlines are closed.
- **Layers:** OUTLINE is the cut profile, HOLES are the holes, NOTES and PARTS are text and are not to be cut.
- **Where a drawing says STOCK, the material is supplied** and the outline drawn IS that piece — the job is the holes, and any excess falls outside them. Where it says MATERIAL, the shop supplies the plate and the outline is the part to cut.
- **Holes called out as edge-bored are not drawn.** They run into a part's end face rather than through it, and are drilled here.
- **Where two parts share one piece**, both are drawn in position on it with the kerf allowed between them.

What would help on the quote

- Price **per drawing**, and separately the material where you are supplying it.
- Say if any hole is **below your minimum for the thickness** — a pilot that gets opened out here is fine, and so is a scribed mark, so tell us which you would rather cut.
- Note any outline you would rather nest differently. Nesting is yours to choose; the drawings do not assume one.

X CARRIAGE PLATE - QTY 1


PART 430 mm (16.929 in) x 170 mm (6.693 in) x 12.7 mm (0.500 in) 6061 - SHOP TO SUPPLY THE MATERIAL

THE OUTLINE IS A CUT LINE ON THIS DRAWING - profile and holes both

UNITS mm - ORIGIN LOWER LEFT

Holes 40 × ø2 mm (0.079 in) · 4 × ø6 mm (0.236 in) · 1 × ø35 mm (1.378 in)

Drawn at 1:2 from the DXF itself · 8-x-carriage-plate.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

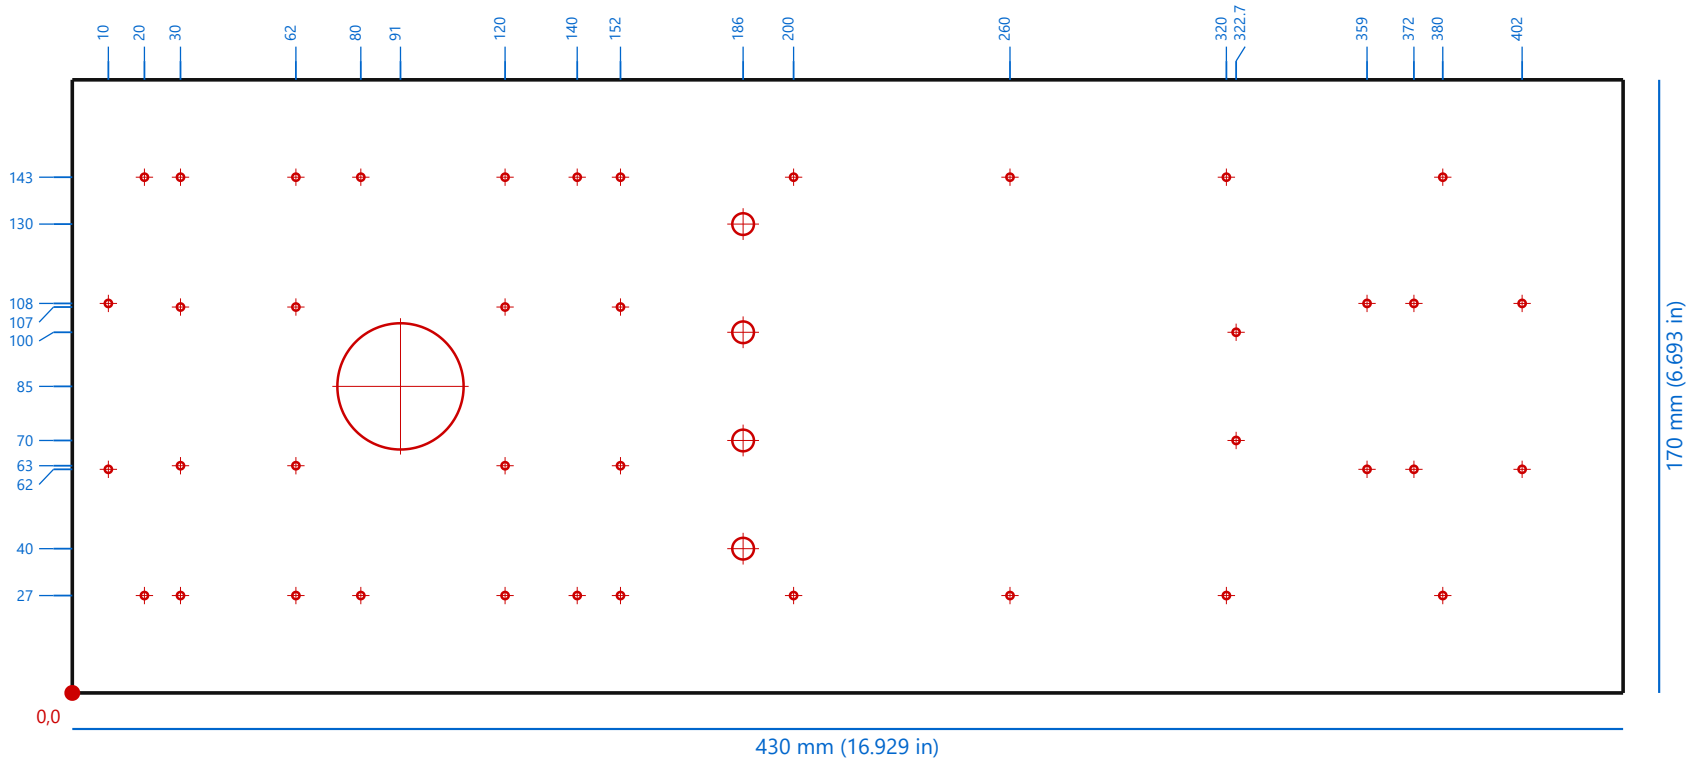

Z PLATE - QTY 1

PART 180 mm (7.087 in) x 170 mm (6.693 in) x 12.7 mm (0.500 in) 6061 - SHOP TO SUPPLY THE MATERIAL

THE OUTLINE IS A CUT LINE ON THIS DRAWING - profile and holes both

UNITS mm - ORIGIN LOWER LEFT

Holes 22 × ø6 mm (0.236 in) · 8 × ø6.8 mm (0.268 in)

Drawn at 1:1.5 from the DXF itself · 9-z-plate.dxf · offsets are HOLE CENTRES from the red 0,0 dot - X across the top, Y down the left side

