TMS320C28x Floating Point Unit and Instruction Set

Reference Guide



Literature Number: SPRUEO2A June 2007—Revised August 2008



Contents

Prefa	ace 5
1	Introduction 7
1.1	Introduction to the Central Processing Unit (CPU)
1.2	Compatibility with the C28x Fixed-Point CPU
	1.2.1 Floating-Point Code Development9
1.3	Components of the C28x plus Floating-Point CPU9
	1.3.1 Emulation Logic
	1.3.2 Memory Map
	1.3.3 On-Chip Program and Data
	1.3.4 CPU Interrupt Vectors
1.4	Memory Interface
	1.4.1 Address and Data Buses
	1.4.2 Alignment of 32-Bit Accesses to Even Addresses
2	CPU Register Set 13
2.1	CPU Registers
	2.1.1 Floating-Point Status Register (STF)
	2.1.2 Repeat Block Register (RB)
3	Pipeline
3.1	Pipeline Overview
3.2	General Guidelines for Floating-Point Pipeline Alignment
3.3	Moves from FPU Registers to C28x Registers
3.4	Moves from C28x Registers to FPU Registers
3.5	Parallel Instructions
3.6	Invalid Delay Instructions
3.7	Optimizing the Pipeline
4	Instruction Set
4.1	Instruction Descriptions
4.2	Instructions
Α	Revision History
A.1	Changes





List of Figures

1-1	FPU Functional Block Diagram	8
2-1	C28x With Floating-Point Registers	14
2-2	Floating-point Unit Status Register (STF)	
2-3	Repeat Block Register (RB)	18
3-1	FPU Pipeline	22
2-1	List of Tables 28x Plus Floating-Point CPU Register Summary	
2-1	28x Plus Floating-Point CPU Register Summary	
2-2	Floating-point Unit Status (STF) Register Field Descriptions	
2-3	Repeat Block (RB) Register Field Descriptions	18
4-1	Operand Nomenclature	30
4-2	Summary of Instructions	32
Λ_1	Technical Changes Made in This Pavision	137



Read This First

This document describes the CPU architecture, pipeline, instruction set, and interrupts of the C28x floating-point DSP.

About This Manual

The TMS320C2000™ digital signal processor (DSP) platform is part of the TMS320™ DSP family.

Notational Conventions

This document uses the following conventions.

- Hexadecimal numbers are shown with the suffix h or with a leading 0x. For example, the following number is 40 hexadecimal (decimal 64): 40h or 0x40.
- Registers in this document are shown in figures and described in tables.
 - Each register figure shows a rectangle divided into fields that represent the fields of the register.
 Each field is labeled with its bit name, its beginning and ending bit numbers above, and its read/write properties below. A legend explains the notation used for the properties.
 - Reserved bits in a register figure designate a bit that is used for future device expansion.

Related Documentation

The following books describe the TMS320x28x and related support tools that are available on the TI website:

Data Manual and Errata—

SPRS439— TMS320F28335, TMS320F28334, TMS320F28332, TMS320F28235, TMS320F28234, TMS320F28232 Digital Signal Controllers (DSCs) Data Manual contains the pinout, signal descriptions, as well as electrical and timing specifications for the F2833x/2823x devices.

SPRZ272— TMS320F28335, F28334, F28332, TMS320F28235, F28234, F28232 Digital Signal Controllers (DSCs) Silicon Errata describes the advisories and usage notes for different versions of silicon.

CPU User's Guides-

SPRU430— TMS320C28x DSP CPU and Instruction Set Reference Guide describes the central processing unit (CPU) and the assembly language instructions of the TMS320C28x fixed-point digital signal processors (DSPs). It also describes emulation features available on these DSPs.

SPRUEO2— TMS320C28x Floating Point Unit and Instruction Set Reference Guide describes the floating-point unit and includes the instructions for the FPU.

Peripheral Guides—

SPRU566— TMS320x28xx, 28xxx Peripheral Reference Guide describes the peripheral reference guides of the 28x digital signal processors (DSPs).

SPRUFB0— TMS320x2833x, 2823x System Control and Interrupts Reference Guide describes the various interrupts and system control features of the 2833x digital signal controllers (DSCs).

SPRU812— TMS320x2833x, 2823x Analog-to-Digital Converter (ADC) Reference Guide describes how to configure and use the on-chip ADC module, which is a 12-bit pipelined ADC.




Related Documentation www.ti.com

- SPRU949— TMS320x2833x, 2823x External Interface (XINTF) User's Guide describes the XINTF, which is a nonmultiplexed asynchronous bus, as it is used on the 2833x devices.
- **SPRU963** TMS320x2833x, TMS320x2823x Boot ROM User's Guide describes the purpose and features of the bootloader (factory-programmed boot-loading software) and provides examples of code. It also describes other contents of the device on-chip boot ROM and identifies where all of the information is located within that memory.
- **SPRUFB7—** TMS320x2833x, 2823x Multichannel Buffered Serial Port (McBSP) User's Guide describes the McBSP available on the F2833x devices. The McBSPs allow direct interface between a DSP and other devices in a system.
- SPRUFB8— TMS320x2833x, 2823x Direct Memory Access (DMA) Reference Guide describes the DMA on the 2833x devices.
- SPRUG04— TMS320x2833x, 2823x Enhanced Pulse Width Modulator (ePWM) Module Reference Guide describes the main areas of the enhanced pulse width modulator that include digital motor control, switch mode power supply control, UPS (uninterruptible power supplies), and other forms of power conversion.
- **SPRUG02** TMS320x2833x, 2823x High-Resolution Pulse Width Modulator (HRPWM) describes the operation of the high-resolution extension to the pulse width modulator (HRPWM).
- **SPRUFG4—** TMS320x2833x, 2823x Enhanced Capture (eCAP) Module Reference Guide describes the enhanced capture module. It includes the module description and registers.
- SPRUG05— TMS320x2833x, 2823x Enhanced Quadrature Encoder Pulse (eQEP) Reference Guide describes the eQEP module, which is used for interfacing with a linear or rotary incremental encoder to get position, direction, and speed information from a rotating machine in high performance motion and position control systems. It includes the module description and registers.
- **SPRUEU1—** TMS320x2833x, 2823x Enhanced Controller Area Network (eCAN) Reference Guide describes the eCAN that uses established protocol to communicate serially with other controllers in electrically noisy environments.
- SPRUFZ5— TMS320F2833x, 2823x Serial Communication Interface (SCI) Reference Guide describes the SCI, which is a two-wire asynchronous serial port, commonly known as a UART. The SCI modules support digital communications between the CPU and other asynchronous peripherals that use the standard non-return-to-zero (NRZ) format.
- SPRUEU3— TMS320x2833x, 2823x Serial Peripheral Interface (SPI) Reference Guide describes the SPI a high-speed synchronous serial input/output (I/O) port that allows a serial bit stream of programmed length (one to sixteen bits) to be shifted into and out of the device at a programmed bit-transfer rate.
- **SPRUG03** TMS320x2833x, 2823x Inter-Integrated Circuit (I2C) Reference Guide describes the features and operation of the inter-integrated circuit (I2C) module.

Tools Guides—

- **SPRU513—** TMS320C28x Assembly Language Tools User's Guide describes the assembly language tools (assembler and other tools used to develop assembly language code), assembler directives, macros, common object file format, and symbolic debugging directives for the TMS320C28x device.
- SPRU514— TMS320C28x Optimizing C Compiler User's Guide describes the TMS320C28x™ C/C++ compiler. This compiler accepts ANSI standard C/C++ source code and produces TMS320 DSP assembly language source code for the TMS320C28x device.
- SPRU608— The TMS320C28x Instruction Set Simulator Technical Overview describes the simulator, available within the Code Composer Studio for TMS320C2000 IDE, that simulates the instruction set of the C28x™ core.
- **SPRU625** TMS320C28x DSP/BIOS Application Programming Interface (API) Reference Guide describes development using DSP/BIOS.





Introduction

The TMS320C2000™ DSP family consists of fixed-point and floating-point digital signal controllers (DSCs). TMS320C2000™ Digital Signal Controllers combine control peripheral integration and ease of use of a microcontroller (MCU) with the processing power and C efficiency of Tl's leading DSP technology. This chapter provides an overview of the architectural structure and components of the C28x plus floating-point unit CPU.

Topic		Page
1.1	Introduction to the Central Processing Unit (CPU)	8
1.2	Compatibility with the C28x Fixed-Point CPU	
1.3	Components of the C28x plus Floating-Point CPU	9
1.4	Memory Interface	10



1.1 Introduction to the Central Processing Unit (CPU)

The C28x plus floating-point (C28x+FPU) processor extends the capabilities of the C28x fixed-point CPU by adding registers and instructions to support IEEE single-precision floating point operations. This device draws from the best features of digital signal processing; reduced instruction set computing (RISC); and microcontroller architectures, firmware, and tool sets. The DSC features include a modified Harvard architecture and circular addressing. The RISC features are single-cycle instruction execution, register-to-register operations, and modified Harvard architecture (usable in Von Neumann mode). The microcontroller features include ease of use through an intuitive instruction set, byte packing and unpacking, and bit manipulation. The modified Harvard architecture of the CPU enables instruction and data fetches to be performed in parallel. The CPU can read instructions and data while it writes data simultaneously to maintain the single-cycle instruction operation across the pipeline. The CPU does this over six separate address/data buses.

Throughout this document the following notations are used:

- C28x refers to the C28x fixed-point CPU.
- C28x plus Floating-Point and C28x+FPU both refer to the C28x CPU with enhancements to support IEEE single-precision floating-point operations.

1.2 Compatibility with the C28x Fixed-Point CPU

No changes have been made to the C28x base set of instructions, pipeline, or memory bus architecture. Therefore, programs written for the C28x CPU are completely compatible with the C28x+FPU and all of the features of the C28x documented in *TMS320C28x DSP CPU and Instruction Set Reference Guide* (literature number SPRU430) apply to the C28x+FPU.

Figure 1-1 shows basic functions of the FPU.

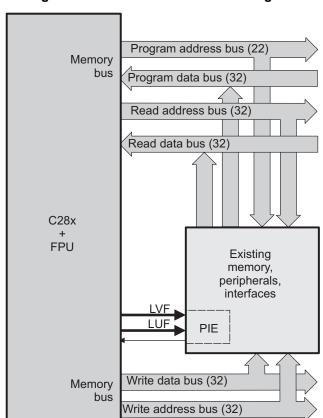


Figure 1-1. FPU Functional Block Diagram



1.2.1 Floating-Point Code Development

When developing C28x floating-point code use Code Composer Studio 3.3, or later, with at least service release 8. The C28x compiler V5.0, or later, is also required to generate C28x native floating-point opcodes. This compiler is available via Code Composer Studio update advisor as a seperate download. V5.0 can generate both fixed-point as well as floating-point code. To build floating-point code use the compiler switches:-v28 and - -float_support = fpu32. In Code Composer Studio 3.3 the float_support option is in the build options under compiler-> advanced: floating point support. Without the float_support flag, or with float_support = none, the compiler will generate fixed-point code.

When building for C28x floating-point make sure all associated libraries have also been built for floating-point. The standard run-time support (RTS) libraries built for floating-point included with the compiler have fpu32 in their name. For example rts2800_fpu32.lib and rts2800_fpu_eh.lib have been built for the floating-point unit. The "eh" version has exception handling for C++ code. Using the fixed-point RTS libraries in a floating-point project will result in the linker issuing an error for incompatible object files.

To improve performance of native floating-point projects, consider using the *C28x FPU Fast RTS Library* (SPRC664). This library contains hand-coded optimized math routines such as division, square root, atan2, sin and cos. This library can be linked into your project before the standard runtime support library to give your application a performance boost. As an example, the standard RTS library uses a polynomial expansion to calculate the sin function. The Fast RTS library, however, uses a math look-up table in the boot ROM of the device. Using this look-up table method results in approximately a 20 cycle savings over the standard RTS calculation.

1.3 Components of the C28x plus Floating-Point CPU

The C28x+FPU contains:

- A central processing unit for generating data and program-memory addresses; decoding and executing instructions; performing arithmetic, logical, and shift operations; and controlling data transfers among CPU registers, data memory, and program memory
- A floating-point unit for IEEE single-precision floating point operations.
- Emulation logic for monitoring and controlling various parts and functions of the device and for testing device operation. This logic is identical to that on the C28x fixed-point CPU.
- Signals for interfacing with memory and peripherals, clocking and controlling the CPU and the
 emulation logic, showing the status of the CPU and the emulation logic, and using interrupts. This logic
 is identical to the C28x fixed-point CPU.

Some features of the C28x+FPU central processing unit are:

- Fixed-Point instructions are pipeline protected. This pipeline for fixed-point instructions is identical to that on the C28x fixed-point CPU. The CPU implements an 8-phase pipeline that prevents a write to and a read from the same location from occurring out of order. See Figure 3-1
- Some floating-point instructions require pipeline alignment. This alignment is done through software to allow the user to improve performance by taking advantage of required delay slots.
- Independent register space. These registers function as system-control registers, math registers, and data pointers. The system-control registers are accessed by special instructions.
- Arithmetic logic unit (ALU). The 32-bit ALU performs 2s-complement arithmetic and Boolean logic operations.
- Floating point unit (FPU). The 32-bit FPU performs IEEE single-precision floating-point operations.
- Address register arithmetic unit (ARAU). The ARAU generates data memory addresses and increments or decrements pointers in parallel with ALU operations.
- Barrel shifter. This shifter performs all left and right shifts of fixed-point data. It can shift data to the left by up to 16 bits and to the right by up to 16 bits.
- Fixed-Point Multiplier. The multiplier performs 32-bit × 32-bit 2s-complement multiplication with a 64-bit result. The multiplication can be performed with two signed numbers, two unsigned numbers, or one signed number and one unsigned number.



Memory Interface www.ti.com

1.3.1 Emulation Logic

The emulation logic is identical to that on the C28x fixed-point CPU. This logic includes the following features. For more details about these features, refer to the *TMS320C28x DSP CPU and Instruction Set Reference Guide* (literature number SPRU430:

- Debug-and-test direct memory access (DT-DMA). A debug host can gain direct access to the content
 of registers and memory by taking control of the memory interface during unused cycles of the
 instruction pipeline.
- A counter for performance benchmarking.
- Multiple debug events. Any of the following debug events can cause a break in program execution:
 - A breakpoint initiated by the ESTOP0 or ESTOP1 instruction.
 - An access to a specified program-space or data-space location.

When a debug event causes the C28x to enter the debug-halt state, the event is called a break event.

Real-time mode of operation.

1.3.2 Memory Map

Like the C28x, the C28x+FPU uses 32-bit data addresses and 22-bit program addresses. This allows for a total address reach of 4G words (1 word = 16 bits) in data space and 4M words in program space. Memory blocks on all C28x+FPU designs are uniformly mapped to both program and data space. For specific details about each of the map segments, see the data sheet for your device.

1.3.3 On-Chip Program and Data

All C28x+FPU based devices contain at least two blocks of single access on-chip memory referred to as M0 and M1. Each of these blocks is 1K words in size. M0 is mapped at addresses 0x0000 – 0x03FF and M1 is mapped at addresses 0x0400 – 0x07FF. Like all other memory blocks on the C28x+FPU devices, M0 and M1 are mapped to both program and data space. Therefore, you can use M0 and M1 to execute code or for data variables. At reset, the stack pointer is set to the top of block M1. Depending on the device, it may also have additional random-access memory (RAM), read-only memory (ROM), external interface zones, or flash memory.

1.3.4 CPU Interrupt Vectors

The C28x+FPU interrupt vectors are identical to those on the C28x CPU. Sixty-four addresses in program space are set aside for a table of 32 CPU interrupt vectors. The CPU vectors can be mapped to the top or bottom of program space by way of the VMAP bit. For more information about the CPU vectors, see *TMS320C28x DSP CPU and Instruction Set Reference Guide* (literature number <u>SPRU430</u>). For devices with a peripheral interrupt expansion (PIE) block, the interrupt vectors will reside in the PIE vector table and this memory can be used as program memory.

1.4 Memory Interface

The C28x+FPU memory interface is identical to that on the C28x. The C28x+FPU memory map is accessible outside the CPU by the memory interface, which connects the CPU logic to memories, peripherals, or other interfaces. The memory interface includes separate buses for program space and data space. This means an instruction can be fetched from program memory while data memory is being accessed. The interface also includes signals that indicate the type of read or write being requested by the CPU. These signals can select a specified memory block or peripheral for a given bus transaction. In addition to 16-bit and 32-bit accesses, the C28x+FPU supports special byte-access instructions that can access the least significant byte (LSByte) or most significant byte (MSByte) of an addressed word. Strobe signals indicate when such an access is occurring on a data bus.



www.ti.com Memory Interface

1.4.1 Address and Data Buses

Like the C28x, the memory interface has three address buses:

PAB: Program address bus

The PAB carries addresses for reads and writes from program space. PAB is a 22-bit bus.

· DRAB: Data-read address bus

The 32-bit DRAB carries addresses for reads from data space.

DWAB: Data-write address bus

The 32-bit DWAB carries addresses for writes to data space.

The memory interface also has three data buses:

PRDB: Program-read data bus

The PRDB carries instructions during reads from program space. PRDB is a 32-bit bus.

· DRDB: Data-read data bus

The DRDB carries data during reads from data space. DRDB is a 32-bit bus.

· DWDB: Data-/Program-write data bus

The 32-bit DWDB carries data during writes to data space or program space.


A program-space read and a program-space write cannot happen simultaneously because both use the PAB. Similarly, a program-space write and a data-space write cannot happen simultaneously because both use the DWDB. Transactions that use different buses can happen simultaneously. For example, the CPU can read from program space (using PAB and PRDB), read from data space (using DRAB and DRDB), and write to data space (using DWAB and DWDB) at the same time. This behavior is identical to the C28x CPU.

1.4.2 Alignment of 32-Bit Accesses to Even Addresses

The C28x+FPU CPU expects memory wrappers or peripheral-interface logic to align any 32-bit read or write to an even address. If the address-generation logic generates an odd address, the CPU will begin reading or writing at the previous even address. This alignment does not affect the address values generated by the address-generation logic.

Most instruction fetches from program space are performed as 32-bit read operations and are aligned accordingly. However, alignment of instruction fetches are effectively invisible to a programmer. When instructions are stored to program space, they do not have to be aligned to even addresses. Instruction boundaries are decoded within the CPU.

You need to be concerned with alignment when using instructions that perform 32-bit reads from or writes to data space.





CPU Register Set

The C28x+FPU architecture is the same as the C28x CPU with an extended register and instruction set to support IEEE single-precision floating point operations. This section describes the extensions to the C28x architecture.

Topic				
2.1	CPU Registers	14		



CPU Registers www.ti.com

2.1 CPU Registers

Devices with the C28x+FPU include the standard C28x register set plus an additional set of floating-point unit registers. The additional floating-point unit registers are the following:

- Eight floating-point result registers, RnH (where n = 0 7)
- Floating-point Status Register (STF)
- Repeat Block Register (RB)

All of the floating-point registers except the repeat block register are shadowed. This shadowing can be used in high priority interrupts for fast context save and restore of the floating-point registers.

Figure 2-1 shows a diagram of both register sets and Table 2-1 shows a register summary. For information on the standard C28x register set, see the *TMS320C28x DSP CPU and Instruction Set Reference Guide* (literature number SPRU430).

Figure 2-1. C28x With Floating-Point Registers

Standard C28x Register Set	Additional 32-bit FPU Registers
ACC (32-bit)	R0H (32-bit)
P (32-bit)	
XT (32-bit)	R1H (32-bit)
XAR0 (32-bit)	R2H (32-bit)
` ′	
XAR1 (32-bit)	R3H (32-bit)
XAR2 (32-bit)	
XAR3 (32-bit)	R4H (32-bit)
XAR4 (32-bit)	R5H (32-bit)
XAR5 (32-bit)	. (* * * *)
XAR6 (32-bit)	R6H (32-bit)
XAR7 (32-bit)	R7H (32-bit)
PC (22-bit)	
RPC (22-bit)	FPU Status Register (STF)
DP (16-bit)	Repeat Block Register (RB)
SP (16-bit)	FPU registers R0H - R7H and STF
	are shadowed for fast context
ST0 (16-bit)	save and restore
ST1 (16-bit)	
IER (16-bit)	
IFR (16-bit)	

DBGIER (16-bit)



www.ti.com CPU Registers

Table 2-1. 28x Plus Floating-Point CPU Register Summary

Register	C28x CPU	C28x+FPU	Size	Description	Value After Reset
ACC	Yes	Yes	32 bits	Accumulator	0x0000000
AH	Yes	Yes	16 bits	High half of ACC	0x0000
AL	Yes	Yes	16 bits	Low half of ACC	0x0000
XAR0	Yes	Yes	16 bits	Auxiliary register 0	0x00000000
XAR1	Yes	Yes	32 bits	Auxiliary register 1	0x00000000
XAR2	Yes	Yes	32 bits	Auxiliary register 2	0x00000000
XAR3	Yes	Yes	32 bits	Auxiliary register 3	0x00000000
XAR4	Yes	Yes	32 bits	Auxiliary register 4	0x00000000
XAR5	Yes	Yes	32 bits	Auxiliary register 5	0x00000000
XAR6	Yes	Yes	32 bits	Auxiliary register 6	0x00000000
XAR7	Yes	Yes	32 bits	Auxiliary register 7	0x00000000
AR0	Yes	Yes	16 bits	Low half of XAR0	0x0000
AR1	Yes	Yes	16 bits	Low half of XAR1	0x0000
AR2	Yes	Yes	16 bits	Low half of XAR2	0x0000
AR3	Yes	Yes	16 bits	Low half of XAR3	0x0000
AR4	Yes	Yes	16 bits	Low half of XAR4	0x0000
AR5	Yes	Yes	16 bits	Low half of XAR5	0x0000
AR6	Yes	Yes	16 bits	Low half of XAR6	0x0000
AR7	Yes	Yes	16 bits	Low half of XAR7	0x0000
DP	Yes	Yes	16 bits	Data-page pointer	0x0000
IFR	Yes	Yes	16 bits	Interrupt flag register	0x0000
IER	Yes	Yes	16 bits	Interrupt enable register	0x0000
DBGIER	Yes	Yes	16 bits	Debug interrupt enable register	0x0000
P	Yes	Yes	32 bits	Product register	0x0000000
PH	Yes	Yes	16 bits	High half of P	0x0000
PL	Yes	Yes	16 bits	Low half of P	0x0000
PC	Yes	Yes	22 bits	Program counter	0x3FFFC0
RPC	Yes	Yes	22 bits	Return program counter	0x0000000
SP	Yes	Yes	16 bits	Stack pointer	0x0400
ST0	Yes	Yes	16 bits	Status register 0	0x0000
ST1	Yes	Yes	16 bits	Status register 1	0x080B ⁽¹⁾
XT	Yes	Yes	32 bits	Multiplicand register	0x0000000
Т	Yes	Yes	16 bits	High half of XT	0x0000
TL	Yes	Yes	16 bits	Low half of XT	0x0000
ROH	No	Yes	32 bits	Floating-point result register 0	0.0
R1H	No	Yes	32 bits	Floating-point result register 1	0.0
R2H	No	Yes	32 bits	Floating-point result register 2	0.0
R3H	No	Yes	32 bits	Floating-point result register 3	0.0
R4H	No	Yes	32 bits	Floating-point result register 4	0.0
R5H	No	Yes	32 bits	Floating-point result register 5	0.0
R6H	No	Yes	32 bits	Floating-point result register 6	0.0
R7H	No	Yes	32 bits	Floating-point result register 7	0.0
STF	No	Yes	32 bits	Floating-point status register	0x0000000
RB	No	Yes	32 bits	Repeat block register	0x0000000
4	1	1	1	,	

⁽¹⁾ Reset value shown is for devices without the VMAP signal and MOM1MAP signal pinned out. On these devices both of these signals are tied high internal to the device.



CPU Registers www.ti.com

2.1.1 Floating-Point Status Register (STF)

The floating-point status register (STF) reflects the results of floating-point operations. There are three basic rules for floating point operation flags:

- 1. Zero and negative flags are set based on moves to registers.
- 2. Zero and negative flags are set based on the result of compare, minimum, maximum, negative and absolute value operations.
- 3. Overflow and underflow flags are set by math instructions such as multiply, add, subtract and 1/x. These flags may also be connected to the peripheral interrupt expansion (PIE) block on your device. This can be useful for debugging underflow and overflow conditions within an application.

As on the C28x, program flow is controlled by C28x instructions that read status flags in the status register 0 (ST0). If a decision needs to be made based on a floating-point operation, the information in the STF register needs to be loaded into ST0 flags (Z,N,OV,TC,C) so that the appropriate branch conditional instruction can be executed. The MOVST0 FLAG instruction is used to load the current value of specified STF flags into the respective bits of ST0. When this instruction executes, it will also clear the latched overflow and underflow flags if those flags are specified.

Example 2-1. Moving STF Flags to the ST0 Register

```
Loop:

MOV32 R0H,*XAR4++


MOV32 R1H,*XAR3++

CMPF32 R1H, R0H

MOVST0 ZF, NF ; Move ZF and NF to ST0

BF Loop, GT ; Loop if (R1H > R0H)
```

Figure 2-2. Floating-point Unit Status Register (STF)

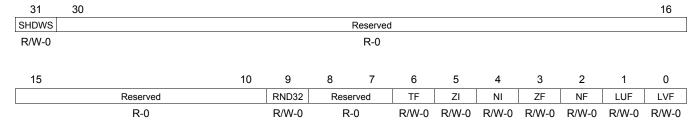

LEGEND: R/W = Read/Write; R = Read only; -n = value after reset

Table 2-2. Floating-point Unit Status (STF) Register Field Descriptions

Bits	Field	Value	Description	
31	SHDWS		Shadow Mode Status Bit	
		0	This bit is forced to 0 by the RESTORE instruction.	
		1	This bit is set to 1 by the SAVE instruction.	
			This bit is not affected by loading the status register either from memory or from the shadow values.	
30 - 10	Reserved	0	Reserved for future use	
9	RND32		Round 32-bit Floating-Point Mode	
		0	If this bit is zero, the MPYF32, ADDF32 and SUBF32 instructions will round to zero (truncate).	
		1	If this bit is one, the MPYF32, ADDF32 and SUBF32 instructions will round to the nearest even value.	
8 - 7	Reserved	0	Reserved for future use	



CPU Registers www.ti.com

Table 2-2. Floating-point Unit Status (STF) Register Field Descriptions (continued)

Bits	Field	Value	Description Description
6	TF		Test Flag
			The TESTTF instruction can modify this flag based on the condition tested. The SETFLG and SAVE instructions can also be used to modify this flag.
		0	The condition tested with the TESTTF instruction is false.
		1	The condition tested with the TESTTF instruction is true.
5	ZI		Zero Integer Flag
			The following instructions modify this flag based on the integer value stored in the destination register: MOV32, MOVD32, MOVDD32 The SETFLG and SAVE instructions can also be used to modify this flag.
		0	The integer value is not zero.
		1	The integer value is zero.
4	NI		Negative Integer Flag
			The following instructions modify this flag based on the integer value stored in the destination register: MOV32, MOVD32, MOVDD32 The SETFLG and SAVE instructions can also be used to modify this flag.
		0	The integer value is not negative.
		1	The integer value is negative.
3	ZF		Zero Floating-Point Flag (1)(2)
			The following instructions modify this flag based on the floating-point value stored in the destination register: MOV32, MOVD32, MOVDD32, ABSF32, NEGF32 The CMPF32, MAXF32, and MINF32 instructions modify this flag based on the result of the operation. The SETFLG and SAVE instructions can also be used to modify this flag
		0	The floating-point value is not zero.
		1	The floating-point value is zero.
2	NF		Negative Floating-Point Flag (1)(2)
			The following instructions modify this flag based on the floating-point value stored in the destination register: MOV32, MOVD32, MOVDD32, ABSF32, NEGF32 The CMPF32, MAXF32, and MINF32 instructions modify this flag based on the result of the operation. The SETFLG and SAVE instructions can also be used to modify this flag.
		0	The floating-point value is not negative.
		1	The floating-point value is negative.
1	LUF		Latched Underflow Floating-Point Flag
			The following instructions will set this flag to 1 if an underflow occurs: MPYF32, ADDF32, SUBF32, MACF32, EINVF32, EISQRTF32
		0	An underflow condition has not been latched. If the MOVST0 instruction is used to copy this bit to ST0, then LUF will be cleared.
		1	An underflow condition has been latched.
0	LVF		Latched Overflow Floating-Point Flag
			The following instructions will set this flag to 1 if an overflow occurs: MPYF32, ADDF32, SUBF32, MACF32, EINVF32, EISQRTF32
		0	An overflow condition has not been latched. If the MOVST0 instruction is used to copy this bit to ST0, then LVF will be cleared.
		1	An overflow condition has been latched.

A negative zero floating-point value is treated as a positive zero value when configuring the ZF and NF flags. A DeNorm floating-point value is treated as a positive zero value when configuring the ZF and NF flags.



CPU Registers www.ti.com

2.1.2 Repeat Block Register (RB)

The repeat block instruction (RPTB) is a new instruction for C28x+FPU. This instruction allows you to repeat a block of code as shown in Example 2-2.

Example 2-2. The Repeat Block (RPTB) Instruction uses the RB Register

```
; find the largest element and put its address in XAR6
  MOV32
         ROH, *XARO++;
                                 ; Aligns the next instruction to an even address
  .align 2
                                 ; Makes RPTB odd aligned - required for a block size of 8
  NOP
  RPTB
           VECTOR_MAX_END, AR7
                                 ; RA is set to 1
  MOVL
           ACC, XAR0
  MOV32
          R1H, *XAR0++
                                 ; RSIZE reflects the size of the RPTB block
  MAXF32
          ROH, R1H
                                 ; in this case the block size is 8
  MOVST0
          NF,ZF
  MOVL
           XAR6, ACC, LT
VECTOR_MAX_END:
                                 ; RE indicates the end address. RA is cleared
```

The C28x_FPU hardware automatically populates the RB register based on the execution of a RPTB instruction. This register is not normally read by the application and does not accept debugger writes.

Figure 2-3. Repeat Block Register (RB)



LEGEND: R = Read only; -n = value after reset

Table 2-3. Repeat Block (RB) Register Field Descriptions


Bits	Field	Value	Description
31	RAS		Repeat Block Active Shadow Bit
			When an interrupt occurs the repeat active, RA, bit is copied to the RAS bit and the RA bit is cleared. When an interrupt return instruction occurs, the RAS bit is copied to the RA bit and RAS is cleared.
		0	A repeat block was not active when the interrupt was taken.
		1	A repeat block was active when the interrupt was taken.
30	RA		Repeat Block Active Bit
		0	This bit is cleared when the repeat counter, RC, reaches zero.
			When an interrupt occurs the RA bit is copied to the repeat active shadow, RAS, bit and RA is cleared. When an interrupt return, IRET, instruction is executed, the RAS bit is copied to the RA bit and RAS is cleared.
		1	This bit is set when the RPTB instruction is executed to indicate that a RPTB is currently active.
29-23	RSIZE		Repeat Block Size
			This 7-bit value specifies the number of 16-bit words within the repeat block. This field is initialized when the RPTB instruction is executed. The value is calculated by the assembler and inserted into the RPTB instruction's RSIZE opcode field.
		0-7	Illegal block size.
		8/9-0x7F	A RPTB block that starts at an even address must include at least 9 16-bit words and a block that starts at an odd address must include at least 8 16-bit words. The maximum block size is 127 16-bit words. The codegen assembler will check for proper block size and alignment.



www.ti.com CPU Registers

Table 2-3. Repeat Block (RB) Register Field Descriptions (continued)

Bits	Field	Value	Description
22-16	RE		Repeat Block End Address
			This 7-bit value specifies the end address location of the repeat block. The RE value is calculated by hardware based on the RSIZE field and the PC value when the RPTB instruction is executed.
			RE = lower 7 bits of (PC + 1 + RSIZE)
15-0	RC		Repeat Count
		0	The block will not be repeated; it will be executed only once. In this case the repeat active, RA, bit will not be set.
		1- 0xFFFF	This 16-bit value determines how many times the block will repeat. The counter is initialized when the RPTB instruction is executed and is decremented when the PC reaches the end of the block. When the counter reaches zero, the repeat active bit is cleared and the block will be executed one more time. Therefore the total number of times the block is executed is RC+1.





Pipeline

The pipeline flow for C28x instructions is identical to that of the C28x CPU described in *TMS320C28x DSP CPU and Instruction Set Reference Guide* (SPRU430). Some floating-point instructions, however, use additional execution phases and thus require a delay to allow the operation to complete. This pipeline alignment is achieved by inserting NOPs or non-conflicting instructions when required. Software control of delay slots allows you to improve performance of an application by taking advantage of the delay slots and filling them with non-conflicting instructions. This section describes the key characteristics of the pipeline with regards to floating-point instructions. The rules for avoiding pipeline conflicts are small in number and simple to follow and the C28x+FPU assembler will help you by issuing errors for conflicts.

Topic		Page
3.1	Pipeline Overview	22
3.2	General Guidelines for Floating-Point Pipeline Alignment	22
3.3	Moves from FPU Registers to C28x Registers	23
3.4	Moves from C28x Registers to FPU Registers	23
3.5	Parallel Instructions	24
3.6	Invalid Delay Instructions	24
3.7	Optimizing the Pipeline	27



Pipeline Overview www.ti.com

3.1 Pipeline Overview

The C28x FPU pipeline is identical to the C28x pipeline for all standard C28x instructions. In the decode2 stage (D2), it is determined if an instruction is a C28x instruction or a floating-point unit instruction. The pipeline flow is shown in Figure 3-1. Notice that stalls due to normal C28x pipeline stalls (D2) and memory waitstates (R2 and W) will also stall any C28x FPU instruction. Most C28x FPU instructions are single cycle and will complete in the FPU E1 or W stage which aligns to the C28x pipeline. Some instructions will take an additional execute cycle (E2). For these instructions you must wait a cycle for the result from the instruction to be available. The rest of this section will describe when delay cycles are required. Keep in mind that the assembly tools for the C28x+FPU will issue an error if a delay slot has not been handled correctly.

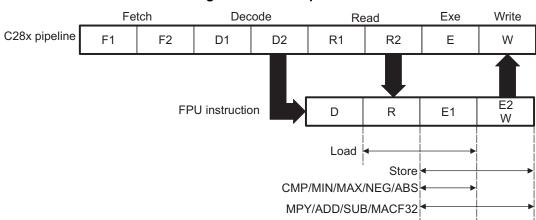


Figure 3-1. FPU Pipeline

3.2 General Guidelines for Floating-Point Pipeline Alignment

While the C28x+FPU assembler will issue errors for pipeline conflicts, you may still find it useful to understand when software delays are required. This section describes three guidelines you can follow when writing C28x+FPU assembly code.

Floating-point instructions that require delay slots have a 'p' after their cycle count. For example '2p' stands for 2 pipelined cycles. This means that an instruction can be started every cycle, but the result of the instruction will only be valid one instruction later.

There are three general guidelines to determine if an instruction needs a delay slot:

- 1. Floating-point math operations (multiply, addition, subtraction, 1/x and MAC) require 1 delay slot.
- 2. Conversion instructions between integer and floating-point formats require 1 delay slot.
- 3. Everything else does not require a delay slot. This includes minimum, maximum, compare, load, store, negative and absolute value instructions.

There are two exceptions to these rules. First, moves between the CPU and FPU registers require special pipeline alignment that is described later in this section. These operations are typically infrequent. Second, the MACF32 R7H, R3H, mem32, *XAR7 instruction has special requirements that make it easier to use. Refer to the MACF32 instruction description for details.

An example of the 32-bit ADDF32 instruction is shown in Example 3-1. ADDF32 is a 2p instruction and therefore requires one delay slot. The destination register for the operation, R0H, will be updated one cycle after the instruction for a total of 2 cycles. Therefore, a NOP or instruction that does not use R0H must follow this instruction.

Any memory stall or pipeline stall will also stall the floating-point unit. This keeps the floating-point unit aligned with the C28x pipeline and there is no need to change the code based on the waitstates of a memory block.



Example 3-1. 2p Instruction Pipeline Alignment

```
ADDF32 R0H, #1.5, R1H ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction
; <-- ADDF32 completes, R0H updated

NOP ; Any instruction
```

3.3 Moves from FPU Registers to C28x Registers

When transferring from the floating-point unit registers to the C28x CPU registers, additional pipeline alignment is required as shown in Example 3-2 and Example 3-3.

Example 3-2. Floating-Point to C28x Register Software Pipeline Alignment

```
; MINF32: 32-bit floating-point minimum: single-cycle operation
; An alignment cycle is required before copying ROH to ACC
MINF32 ROH, R1H ; Single-cycle instruction
; <-- ROH is valid
NOP ; Alignment cycle
MOV32 @ACC, ROH ; Copy ROH to ACC
```

For 1-cycle FPU instructions, one delay slot is required between a write to the floating-point register and the transfer instruction as shown in Example 3-2. For 2p FPU instructions, two delay slots are required between a write to the floating-point register and the transfer instruction as shown in Example 3-3.

Example 3-3. Floating-Point to C28x Register Software Pipeline Alignment

```
; ADDF32: 32-bit floating-point addition: 2p operation
; An alignment cycle is required before copying R0H to ACC
ADDF32 R0H, R1H, #2 ; R0H = R1H + 2, 2 pipeline cycle instruction
NOP ; 1 delay cycle or non-conflicting instruction
; <-- R0H is valid
NOP ; Alignment cycle
MOV32 @ACC, R0H ; Copy R0H to ACC
```

3.4 Moves from C28x Registers to FPU Registers

Transfers from the standard C28x CPU registers to the floating-point registers require four alignment cycles. In this case the four alignment cycles can be filled with NOPs or any non-conflicting instruction except for FRACF32, UI16TOF32, I16TOF32, F32TOUI32, and F32TOI32. These instructions cannot replace any of the four alignment NOPs.

Example 3-4. C28x Register to Floating-Point Register Software Pipeline Alignment

```
; Four alignment cycles are required after copying a standard 28x CPU
; register to a floating-point register.
;

MOV32 ROH,@ACC ; Copy ACC to ROH
NOP
NOP
NOP
NOP
NOP
NOP
NOP
; Wait 4 cycles
ADDF32 R2H,R1H,R0H ; ROH is valid
```



Parallel Instructions www.ti.com

3.5 Parallel Instructions

Parallel instructions are single opcodes that perform two operations in parallel. This can be a math operation in parallel with a move operation, or two math operations in parallel. Math operations with a parallel move are referred to as 2p/1 instructions. The math portion of the operation takes 2 pipelined cycles while the move portion of the operation is single cycle. This means that NOPs or other non conflicting instructions must be inserted to align the math portion of the operation. An example of an add with parallel move instruction is shown in Example 3-5.

Example 3-5. 2p/1 Parallel Instruction Software Pipeline Alignment

```
; ADDF32 || MOV32 instruction: 32-bit floating-point add with parallel move
; ADDF32 is a 2p operation
; MOV32 is a 1 cycle operation
;
ADDF32 ROH, R1H, #2 ; ROH = R1H + 2, 2 pipeline cycle operation
|| MOV32 R1H, @Val ; R1H gets the contents of Val, single cycle operation
; <-- MOV32 completes here (R1H is valid)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- ADDF32 completes here (R0H is valid)
NOP ; Any instruction
```

Parallel math instructions are referred to as 2p/2p instructions. Both math operations take 2 cycles to complete. This means that NOPs or other non conflicting instructions must be inserted to align the both math operations. An example of a multiply with parallel add instruction is shown in Example 3-5

Example 3-6. 2p/2p Parallel Instruction Software Pipeline Alignment

3.6 Invalid Delay Instructions

Most instructions can be used in delay slots as long as source and destination register conflicts are avoided. The C28x+FPU assembler will issue an error anytime you use an conflicting instruction within a delay slot. The following guidelines can be used to avoid these conflicts.

Note: Destination register conflicts in delay slots:

Any operation used for pipeline alignment delay must not use the same destination register as the instruction requiring the delay. See Example 3-7.

In Example 3-7 the MPYF32 instruction uses R2H as its destination register. The next instruction should not use R2H as its destination. Since the MOV32 instruction uses the R2H register a pipeline conflict will be issued by the assembler. This conflict can be resolved by using a register other than R2H for the MOV32 instruction as shown in Example 3-8.



Example 3-7. Destination Register Conflict

```
; Invalid delay instruction. Both instructions use the same destination register
MPYF32 R2H, R1H, R0H ; 2p instruction
MOV32 R2H, mem32 ; Invalid delay instruction
```

Example 3-8. Destination Register Conflict Resolved

```
; Valid delay instruction

MPYF32 R2H, R1H, R0H ; 2p instruction

MOV32 R1H, mem32 ; Valid delay

; <-- MPYF32 completes, R2H valid
```

Note: Instructions in delay slots cannot use the instruction's destination register as a source register.

Any operation used for pipeline alignment delay must not use the destination register of the instruction requiring the delay as a source register as shown in Example 3-9. For parallel instructions, the current value of a register can be used in the parallel operation before it is overwritten as shown in Example 3-11.

In Example 3-9 the MPYF32 instruction again uses R2H as its destination register. The next instruction should not use R2H as its source since the MPYF32 will take an additional cycle to complete. Since the ADDF32 instruction uses the R2H register a pipeline conflict will be issued by the assembler. This conflict can be resolved by using a register other than R2H or by inserting a non-conflicting instruction between the MPYF32 and ADDF32 instructions. Since the SUBF32 does not use R2H this instruction can be moved before the ADDF32 as shown in Example 3-10.

Example 3-9. Destination/Source Register Conflict

```
; Invalid delay instruction. ADDF32 should not use R2H as a source operand
MPYF32 R2H, R1H, R0H ; 2p instruction
ADDF32 R3H, R3H, R2H ; Invalid delay instruction
SUBF32 R4H, R1H, R0H
```

Example 3-10. Destination/Source Register Conflict Resolved

```
; Valid delay instruction.

MPYF32 R2H, R1H, R0H ; 2p instruction

SUBF32 R4H, R1H, R0H ; Valid delay for MPYF32

ADDF32 R3H, R3H, R2H ; <-- MPYF32 completes, R2H valid

NOP ; <-- SUBF32 completes, R4H valid
```

It should be noted that a source register for the 2nd operation within a parallel instruction can be the same as the destination register of the first operation. This is because the two operations are started at the same time. The 2nd operation is not in the delay slot of the first operation. Consider Example 3-11 where the MPYF32 uses R2H as its destination register. The MOV32 is the 2nd operation in the instruction and can freely use R2H as a source register. The contents of R2H before the multiply will be used by MOV32.



www.ti.com

Example 3-11. Parallel Instruction Destination/Source Exception

```
; Valid parallel operation.

MPYF32 R2H, R1H, R0H

| MOV32 mem32, R2H

; <-- Uses R2H before the MPYF32

; <-- mem32 updated

NOP

; <-- Delay for MPYF32

; <-- R2H updated
```

Likewise, the source register for the 2nd operation within a parallel instruction can be the same as one of the source registers of the first operation. The MPYF32 operation in Example 3-12 uses the R1H register as one of its sources. This register is also updated by the MOV32 register. The multiplication operation will use the value in R1H before the MOV32 updates it.

Example 3-12. Parallel Instruction Destination/Source Exception

```
; Valid parallel instruction

MPYF32 R2H, R1H, R0H ; 2p/1 instruction

|| MOV32 R1H, mem32 ; Valid

NOP ; <-- MOV32 completes, R1H valid

; <-- MPYF32, R2H valid
```

Note: Operations within parallel instructions cannot use the same destination register.

When two parallel operations have the same destination register, the result is invalid.

For example, see Example 3-13.

If both operations within a parallel instruction try to update the same destination register as shown in Example 3-13 the assembler will issue an error.

Example 3-13. Invalid Destination Within a Parallel Instruction

```
; Invalid parallel instruction. Both operations use the same destination register MPYF32 R2H, R1H, R0H ; 2p/1 instruction || MOV32 R2H, mem32 ; Invalid
```

Some instructions access or modify the STF flags. Because the instruction requiring a delay slot will also be accessing the STF flags, these instructions should not be used in delay slots. These instructions are SAVE, SETFLG, RESTORE and MOVSTO.

Note: Do not use SAVE, SETFLG, RESTORE, or the MOVST0 instruction in a delay slot.

www.ti.com Optimizing the Pipeline

3.7 Optimizing the Pipeline

The following example shows how delay slots can be used to improve the performance of an algorithm. The example performs two Y = MX+B operations. In Example 3-14, no optimization has been done. The Y = MX+B calculations are sequential and each takes 7 cycles to complete. Notice there are NOPs in the delay slots that could be filled with non-conflicting instructions. The only requirement is these instructions must not cause a register conflict or access the STF register flags.

Example 3-14. Floating-Point Code Without Pipeline Optimization

```
Using NOPs for alignment cycles, calculate the following:
 V1 = M1 * X1 + B1
 Y2 = M2*X2 + B2
;
 Calculate Y1
   MOV32
           ROH, @M1
                              ; Load ROH with M1 - single cycle
  MOV32
          R1H,@X1
                             ; Load R1H with X1 - single cycle
                              ; R1H = M1 * X1 - 2p operation
   MPYF32
          R1H,R1H,R0H
                              ; Load ROH with B1 - single cycle
|| MOV32
          ROH,@B1
   NOP
                              ; Wait for MPYF32 to complete
                              ; <-- MPYF32 completes, R1H is valid
                              ; R1H = R1H + R0H - 2p operation
   ADDF32 R1H,R1H,R0H
                              ; Wait for ADDF32 to complete
   NOP
                              ; <-- ADDF32 completes, R1H is valid
   MOV32
           @Y1,R1H
                              ; Save R1H in Y1
                                                 - single cycle
; Calculate Y2
   MOV32
           ROH,@M2
                              ; Load ROH with M2 - single cycle
   MOV32
           R1H,@X2
                              ; Load R1H with X2 - single cycle
                              ; R1H = M2 * X2 - 2p operation
; Load R0H with B2 - single cycle
          R1H,R1H,R0H
                              ; R1H = M2 * X2
   MPYF32
| MOV32
           ROH,@B2
   NOP
                              ; Wait for MPYF32 to complete
                              ; <-- MPYF32 completes, R1H is valid
   ADDF32 R1H,R1H,R0H
                              ; R1H = R1H + R0H
   NOP
                              ; Wait for ADDF32 to complete
                              ; <-- ADDF32 completes, R1H is valid
   MOV32
           @Y2,R1H
                              ; Save R1H in Y2
; 14 cycles
; 48 bytes
```

The code shown in Example 3-15 was generated by the C28x+FPU compiler with optimization enabled. Notice that the NOPs in the first example have now been filled with other instructions. The code for the two Y = MX+B calculations are now interleaved and both calculations complete in only 9 cycles.




Optimizing the Pipeline www.ti.com

Example 3-15. Floating-Point Code With Pipeline Optimization

```
; Using non-conflicting instructions for alignment cycles,
; calculate the following:
; Y1 = M1*X1 + B1
; Y2 = M2*X2 + B2
                                ; Load R2H with X1 - single cycle
   MOV32
             R2H, @X1
   MOV32
             R1H,@M1
                               ; Load R1H with M1 - single cycle
                              ; R3H = M1 * X1 - 2p operation
; Load R0H with M2 - single cycle
   MPYF32
             R3H,R2H,R1H
|| MOV32
             ROH,@M2
   MOV32
             R1H,@X2
                               ; Load R1H with X2 - single cycle
                               ; <-- MPYF32 completes, R3H is valid
   MPYF32
             ROH, R1H, ROH
                               ; R0H = M2 * X2

    2p operation

|| MOV32
             R4H,@B1
                                ; Load R4H with B1 - single cycle
                               ; <-- MOV32 completes, R4H is valid
                               ; R1H = B1 + M1*X1 - 2p operation
; Load R2H with B2 - single cycle
   ADDF32
             R1H,R4H,R3H
|| MOV32
             R2H,@B2
                                ; <-- MPYF32 completes, ROH is valid
                               ; ROH = B2 + M2*X2 - 2p operation
   ADDF32
             ROH, R2H, ROH
                                ; <-- ADDF32 completes, R1H is valid
   MOV32
              @Y1,R1H
                                ; Store Y1
                                ; <-- ADDF32 completes, R0H is valid
   MOV32
              @Y2,R0H
                                ; Store Y2
  9 cycles
; 36 bytes
```





Instruction Set

This chapter describes the assembly language instructions of the TMS320C28x plus floating-point processor. Also described are parallel operations, conditional operations, resource constraints, and addressing modes. The instructions listed here are an extension to the standard C28x instruction set. For information on standard C28x instructions, see the TMS320C28x DSP CPU and Instruction Set Reference Guide (literature number SPRU430).

Topic					
	Instruction Descriptions				
4.2	Instructions	32			



Instruction Descriptions www.ti.com

4.1 Instruction Descriptions

This section gives detailed information on the instruction set. Each instruction may present the following information:

- Operands
- Opcode
- Description
- Exceptions
- Pipeline
- Examples
- · See also

The example INSTRUCTION is shown to familiarize you with the way each instruction is described. The example describes the kind of information you will find in each part of the individual instruction description and where to obtain more information. On the C28x+FPU instructions, follow the same format as the C28x. The source operand(s) are always on the right and the destination operand(s) are on the left.

The explanations for the syntax of the operands used in the instruction descriptions for the TMS320C28x plus floating-point processor are given in Table 4-1. For information on the operands of standard C28x instructions, see the TMS320C28x DSP CPU and Instruction Set Reference Guide (SPRU430).

Table 4-1. Opera	nd Nomenclature
------------------	-----------------

Symbol	Description						
#16FHi	16-bit immediate (hex or float) value that represents the upper 16-bits of an IEEE 32-bit floating-point value Lower 16-bits of the mantissa are assumed to be zero.						
#16FHiHex	16-bit immediate hex value that represents the upper 16-bits of an IEEE 32-bit floating-point value. Lower 16-bits of the mantissa are assumed to be zero.						
#16FLoHex	A 16-bit immediate hex value that represents the lower 16-bits of an IEEE 32-bit floating-point value						
#32Fhex	32-bit immediate value that represents an IEEE 32-bit floating-point value						
#32F	Immediate float value represented in floating-point representation						
#0.0	Immediate zero						
#RC	16-bit immediate value for the repeat count						
*(0:16bitAddr)	16-bit immediate address, zero extended						
CNDF	Condition to test the flags in the STF register						
FLAG	Selected flags from STF register (OR) 11 bit mask indicating which floating-point status flags to change						
label	Label representing the end of the repeat block						
mem16	Pointer (using any of the direct or indirect addressing modes) to a 16-bit memory location						
mem32	Pointer (using any of the direct or indirect addressing modes) to a 32-bit memory location						
RaH	R0H to R7H registers						
RbH	R0H to R7H registers						
RcH	R0H to R7H registers						
RdH	R0H to R7H registers						
ReH	R0H to R7H registers						
RfH	R0H to R7H registers						
RB	Repeat Block Register						
STF	FPU Status Register						
VALUE	Flag value of 0 or 1 for selected flag (OR) 11 bit mask indicating the flag value; 0 or 1						





INSTRUCTION dest1, source1, source2 Short Description

Operands

dest1	description for the 1st operand for the instruction	
source1	description for the 2nd operand for the instruction	
source2	description for the 3rd operand for the instruction	

Each instruction has a table that gives a list of the operands and a short description. Instructions always have their destination operand(s) first followed by the source operand(s).

Opcode This section shows the opcode for the instruction.

Description Detailed description of the instruction execution is described. Any constraints on the

operands imposed by the processor or the assembler are discussed.

Restrictions Any constraints on the operands or use of the instruction imposed by the processor are

discussed.

Pipeline This section describes the instruction in terms of pipeline cycles as described in

Chapter 3.

Example Examples of instruction execution. If applicable, register and memory values are given

before and after instruction execution. All examples assume the device is running with the OBJMODE set to 1. Normally the boot ROM or the c-code initialization will set this

bit.

See Also Lists related instructions.



Instructions www.ti.com

4.2 Instructions

The instructions are listed alphabetically, preceded by a summary.

Table 4-2. Summary of Instructions

Title	Page
ABSF32 RaH, RbH 32-bit Floating-Point Absolute Value	34
ADDF32 RaH, #16FHi, RbH 32-bit Floating-Point Addition	35
ADDF32 RaH, RbH, #16FHi 32-bit Floating-Point Addition	
ADDF32 RaH, RbH, RcH 32-bit Floating-Point Addition	
ADDF32 RdH, ReH, RfH MOV32 mem32, RaH 32-bit Floating-Point Addition with Parallel Move	
ADDF32 RdH, ReH, RfH MOV32 RaH, mem32 32-bit Floating-Point Addition with Parallel Move	42
CMPF32 RaH, RbH 32-bit Floating-Point Compare for Equal, Less Than or Greater Than	44
CMPF32 RaH, #16FHi 32-bit Floating-Point Compare for Equal, Less Than or Greater Than	45
CMPF32 RaH, #0.0 32-bit Floating-Point Compare for Equal, Less Than or Greater Than	46
EINVF32 RaH, RbH 32-bit Floating-Point Reciprocal Approximation	47
EISQRTF32 RaH, RbH 32-bit Floating-Point Square-Root Reciprocal Approximation	49
F32TOI16 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Integer	. 51
F32TOI16R RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Integer and Round	. 52
F32TOI32 RaH, RbH Convert 32-bit Floating-Point Value to 32-bit Integer	53
F32TOUI16 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer	54
F32TOUI16R RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer and Round	55
F32TOUI32 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer	
FRACF32 RaH, RbH Fractional Portion of a 32-bit Floating-Point Value	57
I16TOF32 RaH, RbH Convert 16-bit Integer to 32-bit Floating-Point Value	
I16TOF32 RaH, mem16 Convert 16-bit Integer to 32-bit Floating-Point Value	
I32TOF32 RaH, mem32 Convert 32-bit Integer to 32-bit Floating-Point Value	
I32TOF32 RaH, RbH Convert 32-bit Integer to 32-bit Floating-Point Value	
MACF32 R3H, R2H, RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Add	
MACF32 R3H, R2H, RdH, ReH, RfH MOV32 RaH, mem32 32-bit Floating-Point Multiply and Accumulate with Parallel	
MACC22 DZU D2U mam22 *VADZU 22 bit Floating Boint Multiply and Assumulate	
MACF32 R7H, R3H, mem32, *XAR7++ 32-bit Floating-Point Multiply and Accumulate	
MACF32 R7H, R6H, RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Add	
Move	
MAXF32 RaH, RbH 32-bit Floating-Point Maximum	
MAXF32 RaH, #16FHi 32-bit Floating-Point Maximum	
MAXF32 RaH, RbH MOV32 RcH, RdH 32-bit Floating-Point Maximum with Parallel Move	. 74
MINF32 RaH, RbH 32-bit Floating-Point Minimum	. 75
MINF32 RaH, #16FHi 32-bit Floating-Point Minimum	. 76
MINF32 RaH, RbH MOV32 RcH, RdH 32-bit Floating-Point Minimum with Parallel Move	. 77
MOV16 mem16, RaH Move 16-bit Floating-Point Register Contents to Memory	. 78
MOV32 *(0:16bitAddr), loc32 Move the Contents of loc32 to Memory	. 7 9
MOV32 ACC, RaH Move 32-bit Floating-Point Register Contents to ACC	. 80
MOV32 loc32, *(0:16bitAddr) Move 32-bit Value from Memory to loc32	. 81
MOV32 mem32, RaH Move 32-bit Floating-Point Register Contents to Memory	. 82
MOV32 mem32, STF Move 32-bit STF Register to Memory	. 83
MOV32 P, RaH Move 32-bit Floating-Point Register Contents to P	84
MOV32 RaH, ACC Move the Contents of ACC to a 32-bit Floating-Point Register	
MOV32 RaH, mem32 {, CNDF} Conditional 32-bit Move	
MOV32 RaH, P Move the Contents of P to a 32-bit Floating-Point Register	. 88

www.ti.com Instructions

Table 4-2. Summary of Instructions (continued)

MOV32 RaH, RbH {, CNDF} Conditional 32-bit Move	. 89
MOV32 RaH, XARn Move the Contents of XARn to a 32-bit Floating-Point Register	. 90
MOV32 RaH, XT Move the Contents of XT to a 32-bit Floating-Point Register	. 91
MOV32 STF, mem32 Move 32-bit Value from Memory to the STF Register	. 92
MOV32 XARn, RaH Move 32-bit Floating-Point Register Contents to XARn	. 93
MOV32 XT, RaH Move 32-bit Floating-Point Register Contents to XT	. 94
MOVD32 RaH, mem32 Move 32-bit Value from Memory with Data Copy	. 95
MOVF32 RaH, #32F Load the 32-bits of a 32-bit Floating-Point Register	. 96
MOVI32 RaH, #32FHex Load the 32-bits of a 32-bit Floating-Point Register with the immediate	. 97
MOVIZ RaH, #16FHiHex Load the Upper 16-bits of a 32-bit Floating-Point Register	. 98
MOVIZF32 RaH, #16FHi Load the Upper 16-bits of a 32-bit Floating-Point Register	. 99
MOVST0 FLAG Load Selected STF Flags into ST0	100
MOVXI RaH, #16FLoHex Move Immediate to the Low 16-bits of a Floating-Point Register	101
MPYF32 RaH, RbH, RcH 32-bit Floating-Point Multiply	102
MPYF32 RaH, #16FHi, RbH 32-bit Floating-Point Multiply	103
MPYF32 RaH, RbH, #16FHi 32-bit Floating-Point Multiply	104
MPYF32 RaH, RbH, RcH ADDF32 RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Add	105
MPYF32 RdH, ReH, RfH MOV32 RaH, mem32 32-bit Floating-Point Multiply with Parallel Move	
MPYF32 RdH, ReH, RfH MOV32 mem32, RaH 32-bit Floating-Point Multiply with Parallel Move	
MPYF32 RaH, RbH, RcH SUBF32 RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Subtract	110
NEGF32 RaH, RbH{, CNDF} Conditional Negation	111
POP RB Pop the RB Register from the Stack	
PUSH RB Push the RB Register onto the Stack	
RESTORE Restore the Floating-Point Registers	
RPTB label, loc16 Repeat A Block of Code	
RPTB label, #RC Repeat a Block of Code	
SAVE FLAG, VALUE Save Register Set to Shadow Registers and Execute SETFLG	120
SETFLG FLAG, VALUE Set or clear selected floating-point status flags	
SUBF32 RaH, RbH, RcH 32-bit Floating-Point Subtraction	
SUBF32 RaH, #16FHi, RbH 32-bit Floating Point Subtraction	
SUBF32 RdH, ReH, RfH MOV32 RaH, mem32 32-bit Floating-Point Subtraction with Parallel Move	
SUBF32 RdH, ReH, RfH MOV32 mem32, RaH 32-bit Floating-Point Subtraction with Parallel Move	
SWAPF RaH, RbH{, CNDF} Conditional Swap	
TESTTF CNDF Test STF Register Flag Condition	
UI16TOF32 RaH, mem16 Convert unsigned 16-bit integer to 32-bit floating-point value	
UI16TOF32 RaH, RbH Convert unsigned 16-bit integer to 32-bit floating-point value	
UI32TOF32 RaH, mem32 Convert Unsigned 32-bit Integer to 32-bit Floating-Point Value	
UI32TOF32 RaH, RbH Convert Unsigned 32-bit Integer to 32-bit Floating-Point Value	
ZERO RaH Zero the Floating-Point Register RaH	
ZEROA Zero All Floating-Point Registers	
ZENOA ZOO AII I IOQUINY-I OINI NEGISIEIS	100



Instructions www.ti.com

ABSF32 RaH, RbH 32-bit Floating-Point Absolute Value

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 0110 1001 0101 MSW: 0000 0000 00bb baaa
```

Description

The absolute value of RbH is loaded into RaH. Only the sign bit of the operand is modified by the ABSF32 instruction.

```
if (RbH < 0) {RaH = -RbH} else {RaH = RbH}
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The STF register flags are modified as follows:

```
NF = 0;
ZF = 0;
if ( RaH[30:23] == 0) ZF = 1;
```

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32 R1H, #-2.0 ; R1H = -2.0 (0xC0000000)
ABSF32 R1H, R1H ; R1H = 2.0 (0x40000000), ZF = NF = 0

MOVIZF32 R0H, #5.0 ; R0H = 5.0 (0x40A00000)
ABSF32 R0H, R0H ; R0H = 5.0 (0x40A00000), ZF = NF = 0

MOVIZF32 R0H, #0.0 ; R0H = 0.0
ABSF32 R1H, R0H ; R1H = 0.0 ZF = 1, NF = 0
```

See also

NEGF32 RaH, RbH{, CNDF}



www.ti.com Instructions

ADDF32 RaH, #16FHi, RbH 32-bit Floating-Point Addition

Operands

RaH	floating-point destination register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 1000 10II IIII MSW: IIII IIII IIbb baaa
```

Description

Add RbH to the floating-point value represented by the immediate operand. Store the result of the addition in RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. #16FHi is most useful for representing constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, the value -1.5 can be represented as #-1.5 or #0xBFC0.

```
RaH = RbH + #16FHi:0
```

This instruction can also be written as ADDF32 RaH, RbH, #16FHi.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if ADDF32 generates an underflow condition.
- LVF = 1 if ADDF32 generates an overflow condition.

Pipeline

This is a 2 pipeline-cycle instruction (2p). That is:

```
ADDF32 RaH, #16FHi, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- ADDF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
; Add to R1H the value 2.0 in 32-bit floating-point format
                            ; ROH = 2.0 + R1H
  ADDF32 ROH, #2.0, R1H
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, ROH updated
  NOP
; Add to R3H the value -2.5 in 32-bit floating-point format
                            ; R2H = -2.5 + R3H
  ADDF32 R2H, #-2.5, R3H
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, R2H updated
; Add to R5H the value 0x3FC00000 (1.5)
  ADDF32 R5H, \#0x3FC0, R5H ; R5H = 1.5 + R5H
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, R5H updated
  NOP
```



Instructions www.ti.com

ADDF32 RaH, RbH, #16FHi See also

ADDF32 RaH, RbH, RcH

ADDF32 RdH, ReH, RfH || MOV32 RaH, mem32 ADDF32 RdH, ReH, RfH || MOV32 mem32, RaH

MACF32 R3H, R2H, RdH, ReH, RfH MPYF32 RaH, RbH, RcH || ADDF32 RdH, ReH, RfH



ADDF32 RaH, RbH, #16FHi 32-bit Floating-Point Addition

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

```
LSW: 1110 1000 10II IIII MSW: IIII IIII IIbb baaa
```

Description

Add RbH to the floating-point value represented by the immediate operand. Store the result of the addition in RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. #16FHi is most useful for representing constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, the value -1.5 can be represented as #-1.5 or #0xBFC0.

```
RaH = RbH + #16FHi:0
```

This instruction can also be written as ADDF32 RaH, #16FHi, RbH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if ADDF32 generates an underflow condition.
- LVF = 1 if ADDF32 generates an overflow condition.

Pipeline

This is a 2 pipeline-cycle instruction (2p). That is:

```
ADDF32 RaH, #16FHi, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- ADDF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
; Add to R1H the value 2.0 in 32-bit floating-point format
                            ; ROH = R1H + 2.0
  ADDF32 ROH, R1H, #2.0
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, ROH updated
  NOP
; Add to R3H the value -2.5 in 32-bit floating-point format
  ADDF32 R2H, R3H, #-2.5
                            ; R2H = R3H + (-2.5)
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, R2H updated
  NOP
; Add to R5H the value 0x3FC00000 (1.5)
  ADDF32 R5H, R5H, \#0x3FC0; R5H = R5H + 1.5
                             ; Delay for ADDF32 to complete
  NOP
                             ; <-- ADDF32 completes, R5H updated
  NOP
```



ADDF32 RaH, #16FHi, RbH See also

ADDF32 RaH, RbH, RcH

ADDF32 RdH, ReH, RfH || MOV32 RaH, mem32 ADDF32 RdH, ReH, RfH || MOV32 mem32, RaH

MACF32 R3H, R2H, RdH, ReH, RfH MPYF32 RaH, RbH, RcH || ADDF32 RdH, ReH, RfH



ADDF32 RaH, RbH, RcH 32-bit Floating-Point Addition

Operands

RaH	floating-point destination register (R0H to R7H)	
RbH	floating-point source register (R0H to R7H)	
RcH	floating-point source register (R0H to R7H)	

Opcode

LSW: 1110 0111 0001 0000 MSW: 0000 000c ccbb baaa

Description

Add the contents of RcH to the contents of RbH and load the result into RaH.

RaH = RbH + RcH

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if ADDF32 generates an underflow condition.
- LVF = 1 if ADDF32 generates an overflow condition.

Pipeline

This is a 2 pipeline-cycle instruction (2p). That is:

```
ADDF32 RaH, RbH, RcH
                          ; 2 pipeline cycles (2p)
NOP
                          ; 1 cycle delay or non-conflicting instruction
                          ; <-- ADDF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

Calculate Y = M1*X1 + B1. This example assumes that M1, X1, B1 and Y are all on the same data page.

```
DP, #M1
   MVOM
                         ; Load the data page
   MOV32
          ROH,@M1
                         ; Load ROH with M1
                         ; Load R1H with X1
   MOV32
          R1H,@X1
   MPYF32 R1H,R1H,R0H
                         ; Multiply M1*X1
| MOV32
          ROH, @B1
                               and in parallel load ROH with B1
   NOP
                         ; <-- MOV32 complete
                         ; <-- MPYF32 complete
   ADDF32 R1H,R1H,R0H
                        ; Add M*X1 to B1 and store in R1H
   NOP
                         ; <-- ADDF32 complete
   MOV32
           @Y1,R1H
                         ; Store the result
Calculate Y = A + B.
   MOVL
          XAR4, #A
```

```
; Load ROH with A
MOV32
      ROH, *XAR4
MOVL
       XAR4, #B
MOV32
     R1H, *XAR4
                     ; Load R1H with B
ADDF32 ROH,R1H,R0H
                     ; Add A + B R0H=R0H+R1H
MOVL
       XAR4, #Y
                     ; <-- ADDF32 complete
MOV32 *XAR4,R0H
                     ; Store the result
```

See also

```
ADDF32 RaH, #16FHi, RbH
ADDF32 RaH, RbH, #16FHi
ADDF32 RdH, ReH, RfH | MOV32 RaH, mem32
ADDF32 RdH, ReH, RfH | MOV32 mem32, RaH
```

MACF32 R3H, R2H, RdH, ReH, RfH MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH



ADDF32 RdH, ReH, RfH | | MOV32 mem32, RaH | 32-bit Floating-Point Addition with Parallel Move

Operands

RdH	floating-point destination register for the ADDF32 (R0H to R7H)
ReH	floating-point source register for the ADDF32 (R0H to R7H)
RfH	floating-point source register for the ADDF32 (R0H to R7H)
mem32	pointer to a 32-bit memory location. This will be the destination of the MOV32.
RaH	floating-point source register for the MOV32 (R0H to R7H)

Opcode

LSW: 1110 0000 0001 fffe MSW: eedd daaa mem32

Description

Perform an ADDF32 and a MOV32 in parallel. Add RfH to the contents of ReH and store the result in RdH. In parallel move the contents of RaH to the 32-bit location pointed to by mem32. mem32 addresses memory using any of the direct or indirect addressing modes supported by the C28x CPU.

```
RdH = ReH + RfH,
[mem32] = RaH
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if ADDF32 generates an underflow condition.
- LVF = 1 if ADDF32 generates an overflow condition.

Pipeline

ADDF32 is a 2 pipeline-cycle instruction (2p) and MOV32 takes a single cycle. That is:

```
ADDF32 RdH, ReH, RfH ; 2 pipeline cycles (2p)

|| MOV32 mem32, RaH ; 1 cycle
; <-- MOV32 completes, mem32 updated
NOP ; 1 cycle delay or non-conflicting instruction
; <-- ADDF32 completes, RdH updated
```

Any instruction in the delay slot must not use RdH as a destination register or use RdH as a source operand.

Example

```
ADDF32
               R3H, R6H, R4H
                                       ; (A) R3H = R6H + R4H and R7H = I3
| MOV32
              R7H, *-SP[2]
                                       ; <-- R7H valid
  SUBF32
              R6H, R6H, R4H
                                       ; (B) R6H = R6H - R4H
                                         <-- ADDF32 (A) completes, R3H valid
  SUBF32
               R3H, R1H, R7H
                                       ; (C) R3H = R1H - R7H and store R3H (A)
               *+XAR5[2], R3H
| MOV32
                                       ; <-- SUBF32 (B) completes, R6H valid
                                       ; <-- MOV32 completes, (A) stored
              R4H, R7H, R1H
                                       ; R4H = D = R7H + R1H and store R6H (B)
  ADDF32
| MOV32
               *+XAR5[6], R6H
                                       ; <-- SUBF32 (C) completes, R3H valid
                                       ; <-- MOV32 completes, (B) stored
  MOV32
               *+XAR5[0], R3H
                                       ; store R3H (C)
                                       ; <-- MOV32 completes, (C) stored
                                       ; <-- ADDF32 (D) completes, R4H valid
  MOV32
               *+XAR5[4], R4H
                                       ; store R4H (D)
                                       ; <-- MOV32 completes, (D) stored
```



See also ADDF32 RaH, #16FHi, RbH

ADDF32 RaH, RbH, #16FHi ADDF32 RaH, RbH, RcH

MACF32 R3H, R2H, RdH, ReH, RfH

MPYF32 RaH, RbH, RcH || ADDF32 RdH, ReH, RfH ADDF32 RdH, ReH, RfH || MOV32 RaH, mem32



ADDF32 RdH, ReH, RfH ||MOV32 RaH, mem32 32-bit Floating-Point Addition with Parallel Move

Operands

RdH	floating-point destination register for the ADDF32 (R0H to R7H). RdH cannot be the same register as RaH.
ReH	floating-point source register for the ADDF32 (R0H to R7H)
RfH	floating-point source register for the ADDF32 (R0H to R7H)
RaH	floating-point destination register for the MOV32 (R0H to R7H). RaH cannot be the same register as RdH.
mem32	pointer to a 32-bit memory location. This is the source for the MOV32.

Opcode

```
LSW: 1110 0011 0001 fffe MSW: eedd daaa mem32
```

Description

Perform an ADDF32 and a MOV32 operation in parallel. Add RfH to the contents of ReH and store the result in RdH. In parallel move the contents of the 32-bit location pointed to by mem32 to RaH. mem32 addresses memory using any of the direct or indirect addressing modes supported by the C28x CPU.

```
RdH = ReH + RfH,
RaH = [mem32]
```

Restrictions

The destination register for the ADDF32 and the MOV32 must be unique. That is, RaH and RdH cannot be the same register.

Any instruction in the delay slot must not use RdH as a destination register or use RdH as a source operand.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	Yes	Yes	Yes	Yes	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if ADDF32 generates an underflow condition.
- LVF = 1 if ADDF32 generates an overflow condition.

The MOV32 Instruction will set the NF, ZF, NI and ZI flags as follows:

```
NF = RaH(31);
ZF = 0;
if(RaH(30:23) == 0) { ZF = 1; NF = 0; }
NI = RaH(31);
ZI = 0;
if(RaH(31:0) == 0) ZI = 1;
```

Pipeline

The ADDF32 takes 2 pipeline cycles (2p) and the MOV32 takes a single cycle. That is:



Calculate Y = A + B - C: Example MOVL XAR4, #A ROH, *XAR4 ; Load ROH with A MOV32 MOVL XAR4, #B R1H, *XAR4 ; Load R1H with B MOV32 MOVL XAR4, #C ADDF32 ROH,R1H,R0H ; Add A + B and in parallel | MOV32 R2H, *XAR4 ; Load R2H with C ; <-- MOV32 complete MOVL XAR4,#Y ; ADDF32 complete SUBF32 R0H,R0H,R2H ; Subtract C from (A + B) NOP ; <-- SUBF32 completes MOV32 *XAR4,R0H ; Store the result ADDF32 RaH, #16FHi, RbH See also ADDF32 RaH, RbH, #16FHi ADDF32 RaH, RbH, RcH ADDF32 RdH, ReH, RfH || MOV32 mem32, RaH MACF32 R3H, R2H, RdH, ReH, RfH MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH



CMPF32 RaH, RbH 32-bit Floating-Point Compare for Equal, Less Than or Greater Than

Operands

RaH	floating-point source register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 0110 1001 0100 MSW: 0000 0000 00bb baaa
```

Description

Set ZF and NF flags on the result of RaH - RbH. The CMPF32 instruction is performed as a logical compare operation. This is possible because of the IEEE format offsetting the exponent. Basically the bigger the binary number, the bigger the floating-point value.

Special cases for inputs:

- Negative zero will be treated as positive zero.
- A denormalized value will be treated as positive zero.
- Not-a-Number (NaN) will be treated as infinity.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The STF register flags are modified as follows:

```
If(RaH == RbH) {ZF=1, NF=0}
If(RaH > RbH) {ZF=0, NF=0}
If(RaH < RbH) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
; Behavior of ZF and NF flags for different comparisons
```

```
MOVIZF32 R1H, #-2.0 ; R1H = -2.0 (0xC0000000)
MOVIZF32 R0H, #5.0 ; R0H = 5.0 (0x40A00000)
CMPF32 R1H, R0H ; ZF = 0, NF = 1
CMPF32 R0H, R1H ; ZF = 0, NF = 0
CMPF32 R0H, R0H ; ZF = 1, NF = 0
```

; Using the result of a compare for loop control

```
Loop:
                         ; Load ROH
  MOV32
           R0H, *XAR4++
           R1H,*XAR3++
  MOV32
                         ; Load R1H
                         ; Set/clear ZF and NF
  CMPF32
           R1H, R0H
                         ; Copy ZF and NF to STO Z and N bits
  MOVST0
           ZF, NF
  BF
           Loop, GT
                         ; Loop if R1H > R0H
```

See also

CMPF32 RaH, #16FHi CMPF32 RaH, #0.0 MAXF32 RaH, #16FHi MAXF32 RaH, RbH MINF32 RaH, #16FHi MINF32 RaH, RbH



CMPF32 RaH, #16FHi 32-bit Floating-Point Compare for Equal, Less Than or Greater Than

Operands

RaH	floating-point source register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

```
LSW: 1110 1000 0001 0III MSW: IIII IIII IIII IIII Iaaa
```

Description

Compare the value in RaH with the floating-point value represented by the immediate operand. Set the ZF and NF flags on (RaH - #16FHi:0).

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. This addressing mode is most useful for constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, -1.5 can be represented as #-1.5 or #0xBFC0.

The CMPF32 instruction is performed as a logical compare operation. This is possible because of the IEEE floating-point format offsets the exponent. Basically the bigger the binary number, the bigger the floating-point value.

Special cases for inputs:

- · Negative zero will be treated as positive zero.
- Denormalized value will be treated as positive zero.
- Not-a-Number (NaN) will be treated as infinity.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	Yes	Yes	No	No	

The STF register flags are modified as follows:

```
If(RaH == #16FHi:0) {ZF=1, NF=0}
If(RaH > #16FHi:0) {ZF=0, NF=0}
If(RaH < #16FHi:0) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction

Example

```
; Behavior of ZF and NF flags for different comparisons

MOVIZF32 R1H, #-2.0 ; R1H = -2.0 (0xC0000000)
MOVIZF32 R0H, #5.0 ; R0H = 5.0 (0x40A00000)
CMPF32 R1H, #-2.2 ; ZF = 0, NF = 0
```

CMPF32 R0H, #6.5 ; ZF = 0, NF = 1CMPF32 R0H, #5.0 ; ZF = 1, NF = 0

; Using the result of a compare for loop control

```
Loop:

MOV32 R1H,*XAR3++ ; Load R1H

CMPF32 R1H, #2.0 ; Set/clear ZF and NF

MOVST0 ZF, NF ; Copy ZF and NF to ST0 Z and N bits

BF Loop, GT ; Loop if R1H > #2.0
```

See also

CMPF32 RaH, #0.0 CMPF32 RaH, RbH MAXF32 RaH, #16FHi MAXF32 RaH, RbH MINF32 RaH, #16FHi MINF32 RaH, RbH



CMPF32 RaH, #0.0 32-bit Floating-Point Compare for Equal, Less Than or Greater Than

Operands

RaH	floating-point source register (R0H to R7H)
#0.0	zero

Opcode

LSW: 1110 0101 1010 0aaa

Description

Set the ZF and NF flags on (RaH - #0.0). The CMPF32 instruction is performed as a logical compare operation. This is possible because of the IEEE floating-point format offsets the exponent. Basically the bigger the binary number, the bigger the floating-point value.

Special cases for inputs:

- Negative zero will be treated as positive zero.
- Denormalized value will be treated as positive zero.
- Not-a-Number (NaN) will be treated as infinity.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	Yes	Yes	No	No	

The STF register flags are modified as follows:

```
If(RaH == #0.0) {ZF=1, NF=0}
If(RaH > #0.0) {ZF=0, NF=0}
If(RaH < #0.0) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

; Behavior of ZF and NF flags for different comparisons

```
MOVIZF32 ROH, #5.0
                       ; ROH = 5.0 (0x40A00000)
                       ; R1H = -2.0 (0xC0000000)
MOVIZF32 R1H, #-2.0
                       ; R2H = 0.0 (0x00000000)
MOVIZF32
         R2H, #0.0
         ROH, #0.0
                       ; ZF = 0, NF = 0
CMPF32
                       ; ZF = 0, NF = 1
CMPF32
         R1H, #0.0
         R2H, #0.0
                       ; ZF = 1, NF = 0
CMPF32
```

; Using the result of a compare for loop control

Loop:

MOV32 R1H, *XAR3++ ; Load R1H

CMPF32 R1H, #0.0 ; Set/clear ZF and NF

MOVSTO ZF, NF ; Copy ZF and NF to STO Z and N bits

BF Loop, GT; Loop if R1H > #0.0

See also

CMPF32 RaH, #0.0 CMPF32 RaH, #16FHi MAXF32 RaH, #16FHi MAXF32 RaH, RbH MINF32 RaH, #16FHi MINF32 RaH, RbH



EINVF32 RaH, RbH 32-bit Floating-Point Reciprocal Approximation

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 0110 1001 0011 MSW: 0000 0000 00bb baaa
```

Description

This operation generates an estimate of 1/X in 32-bit floating-point format accurate to approximately 8 bits. This value can be used in a Newton-Raphson algorithm to get a more accurate answer. That is:

```
Ye = Estimate(1/X);
Ye = Ye*(2.0 - Ye*X)
Ye = Ye*(2.0 - Ye*X)
```

After 2 iterations of the Newton-Raphson algorithm, you will get an exact answer accurate to the 32-bit floating-point format. On each iteration the mantissa bit accuracy approximately doubles. The EINVF32 operation will not generate a negative zero, DeNorm or NaN value.

RaH = Estimate of 1/RbH

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if EINVF32 generates an underflow condition.
- LVF = 1 if EINVF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
EINVF32 RaH, RbH ; 2p

NOP ; 1 cycle delay or non-conflicting instruction ; <-- EINVF32 completes, RaH updated

NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.



Example

Calculate Y = A/B. A fast division routine similar to that shown below can be found in the C28x FPU Fast RTS Library (SPRC664).

```
MOVL XAR4, #A
                         ; Load ROH with A
   MOV32 ROH, *XAR4
   MOVL XAR4, #B
   MOV32 R1H,
                          ; Load R1H with B
               *XAR4
                          ; Calculate ROH = ROH / R1H
   LCR DIV
   MOV32 *XAR4, R0H
DIV:
                                    ; R2H = Ye = Estimate(1/B)
    EINVF32
               R2H, R1H
               ROH, #0.0
                                   ; Check if A == 0
   CMPF32
   MPYF32
               R3H, R2H, R1H
                                   ; R3H = Ye*B
   NOP
               R3H, #2.0, R3H
   SUBF32
                                    ; R3H = 2.0 - Ye*B
   NOP
               R2H, R2H, R3H
   MPYF32
                                    ; R2H = Ye = Ye*(2.0 - Ye*B)
   NOP
                                   ; R3H = Ye*B
   MPYF32
               R3H, R2H, R1H
                R1H, #0.0
    CMPF32
                                   ; Check if B == 0.0
               R3H, #2.0, R3H
R0H, R0H, EQ
                                   ; R3H = 2.0 - Ye*B
    SUBF32
   NEGF32
                                    ; Fixes sign for A/0.0
   MPYF32
               R2H, R2H, R3H
                                    ; R2H = Ye = Ye*(2.0 - Ye*B)
   NOP
   MPYF32
                ROH, ROH, R2H
                                    ; ROH = Y = A*Ye = A/B
   LRETR
```

See also

EISQRTF32 RaH, RbH

EISQRTF32 RaH, RbH 32-bit Floating-Point Square-Root Reciprocal Approximation

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 0110 1001 0010 MSW: 0000 0000 00bb baaa
```

Description

This operation generates an estimate of 1/sqrt(X) in 32-bit floating-point format accurate to approximately 8 bits. This value can be used in a Newton-Raphson algorithm to get a more accurate answer. That is:

```
Ye = Estimate(1/sqrt(X));
Ye = Ye*(1.5 - Ye*Ye*X/2.0)
Ye = Ye*(1.5 - Ye*Ye*X/2.0)
```

After 2 iterations of the Newton-Raphson algorithm, you will get an exact answer accurate to the 32-bit floating-point format. On each iteration the mantissa bit accuracy approximately doubles. The EISQRTF32 operation will not generate a negative zero, DeNorm or NaN value.

RaH = Estimate of 1/sqrt (RbH)

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if EISQRTF32 generates an underflow condition.
- LVF = 1 if EISQRTF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
EINVF32 RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- EISQRTF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.



Example

Calculate the square root of X. A square-root routine similar to that shown below can be found in the *C28x FPU Fast RTS Library* (SPRC664).

```
; Y = sqrt(X)
; Ye = Estimate(1/sqrt(X));
; Ye = Ye*(1.5 - Ye*Ye*X*0.5)
; Ye = Ye*(1.5 - Ye*Ye*X*0.5)
; Y = X*Ye
_sqrt:
                                    ; ROH = X on entry
                                    ; R1H = Ye = Estimate(1/sqrt(X))
    EISQRTF32
                R1H, R0H
                R2H, R0H, #0.5
                                    ; R2H = X*0.5
    MPYF32
    MPYF32
                R3H, R1H, R1H
                                    ; R3H = Ye*Ye
    NOP
    MPYF32
                R3H, R3H, R2H
                                    ; R3H = Ye*Ye*X*0.5
    NOP
                R3H, #1.5, R3H
                                    ; R3H = 1.5 - Ye*Ye*X*0.5
    SUBF32
    NOP
    MPYF32
                R1H, R1H, R3H
                                    ; R2H = Ye = Ye*(1.5 - Ye*Ye*X*0.5)
    NOP
                                    ; R3H = Ye*X*0.5
    MPYF32
                R3H, R1H, R2H
    NOP
                R3H, R1H, R3H
    MPYF32
                                    ; R3H = Ye*Ye*X*0.5
    NOP
    SUBF32
                R3H, #1.5, R3H
                                    ; R3H = 1.5 - Ye*Ye*X*0.5
                                    ; Check if X == 0
                ROH, #0.0
    CMPF32
                R1H, R1H, R3H
    MPYF32
                                    ; R2H = Ye = Ye*(1.5 - Ye*Ye*X*0.5)
    NOP
    MOV32
                R1H, R0H, EQ
                                    ; If X is zero, change the Ye estimate to {\tt 0}
    MPYF32
                ROH, ROH, R1H
                                    ; ROH = Y = X*Ye = sqrt(X)
    LRETR
```

See also

EINVF32 RaH, RbH



F32TOI16 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Integer

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1100 MSW: 0000 0000 00bb baaa

Description

Convert a 32-bit floating point value in RbH to a 16-bit integer and truncate. The result

will be stored in RaH.

RaH(15:0) = F32TOI16(RbH)

RaH(31:16) = sign extension of RaH(15)

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32TOI16 RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- F32TOI16 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZF32
           ROH, #5.0 ; ROH = 5.0 (0x40A00000)
F32T0I16
           R1H, R0H
                      ; R1H(15:0) = F32TOI16(R0H)
                      ; R1H(31:16) = Sign extension of R1H(15)
           R2H, \#-5.0; R2H = -5.0 (0xC0A00000)
MOVIZE32
                      ; <-- F32TOI16 complete, R1H(15:0) = 5 (0x0005)
                                               R1H(31:16) = 0 (0x0000)
                    ; R3H(15:0) = F32TOI16(R2H)
F32T0I16
          R3H, R2H
                      ; R3H(31:16) = Sign extension of R3H(15)
                      ; 1 Cycle delay for F32TOI16 to complete
NOP
                      ; <-- F32TOI16 complete, R3H(15:0) = -5 (0xFFFB)
                                               R3H(31:16) = (0xFFFF)
```

See also

F32TOI16R RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



F32TOI16R RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Integer and Round

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1100 MSW: 1000 0000 00bb baaa

Description

Convert the 32-bit floating point value in RbH to a 16-bit integer and round to the nearest

even value. The result is stored in RaH.

RaH(15:0) = F32ToI16round(RbH)RaH(31:16) = sign extension of RaH(15)

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32TOI16R RaH, RbH
                         ; 2 pipeline cycles (2p)
```

1 cycle delay or non-conflicting instruction NOP

; <-- F32TOI16R completes, RaH updated

NOP

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZ
           ROH, \#0x3FD9; ROH [31:16] = 0x3FD9
MOVXT
           ROH, \#0x999A; ROH [15:0] = 0x999A
                         ; ROH = 1.7 (0x3FD9999A)
F32TOI16R R1H, R0H
                         ; R1H(15:0) = F32TOI16round (R0H)
                         ; R1H(31:16) = Sign extension of R1H(15)
                         ; R2H = -1.7 (0xBFD9999A)
MOVF32
           R2H, #-1.7
                         ; <-- F32TOI16R complete, R1H(15:0) = 2 (0x0002)
                                                   R1H(31:16) = 0 (0x0000)
                         ; R3H(15:0) = F32TOI16round (R2H)
F32TOI16R R3H, R2H
                         ; R3H(31:16) = Sign extension of R2H(15)
                         ; 1 Cycle delay for F32TOI16R to complete
NOP
                           <-- F32TOI16R complete, R1H(15:0) = -2 (0xFFFE)
                                                   R1H(31:16) = (0xFFFF)
```

See also

F32TOI16 RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



F32TOI32 RaH, RbH Convert 32-bit Floating-Point Value to 32-bit Integer

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1000 MSW: 0000 0000 00bb baaa

Description

Convert the 32-bit floating-point value in RbH to a 32-bit integer value and truncate. Store the result in RaH.

RaH = F32TOI32(RbH)

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32T0I32 RaH, RbH ; 2 pipeline cycles (2p)
```

NOP ; 1 cycle delay or non-conflicting instruction

; <-- F32T0I32 completes, RaH updated

NOF

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVF32 R2H, #11204005.0; R2H = 11204005.0 (0x4B2AF5A5)
F32TOI32 R3H, R2H; R3H = F32TOI32 (R2H)
MOVF32 R4H, #-11204005.0; R4H = -11204005.0 (0xCB2AF5A5)
; <-- F32TOI32 complete,
; R3H = 11204005 (0x00AAF5A5);
F32TOI32 R5H, R4H; R4H;
NOP; 1 Cycle delay for F32TOI32 to complete
; <-- F32TOI32 complete,
; R5H = -11204005 (0xFF550A5B)
```

See also

F32TOUI32 RaH, RbH I32TOF32 RaH, RbH I32TOF32 RaH, mem32 UI32TOF32 RaH, RbH UI32TOF32 RaH, mem32



F32TOUI16 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1110 MSW: 0000 0000 00bb baaa

Description

Convert the 32-bit floating point value in RbH to an unsigned 16-bit integer value and truncate to zero. The result will be stored in RaH. To instead round the integer to the nearest even value use the F32TOUI16R instruction.

```
RaH(15:0) = F32ToUI16(RbH)
RaH(31:16) = 0x0000
```

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32TOUI16 RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- F32TOUI16 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
R4H, #9.0 ; R4H = 9.0 (0x41100000)
MOVIZF32
                     ; R5H (15:0) = F32TOUI16 (R4H)
F32TOUI16
          R5H, R4H
                      ; R5H (31:16) = 0x0000
MOVIZF32
           R6H, #-9.0; R6H = -9.0 (0xC1100000)
                      ; <-- F32TOUI16 complete, R5H (15:0) = 9.0 (0x0009)
                                                R5H (31:16) = 0.0 (0x0000)
F32TOUI16 R7H, R6H
                    ; R7H (15:0) = F32TOUI16 (R6H)
                      ; R7H (31:16) = 0 \times 0000
                       1 Cycle delay for F32TOUI16 to complete
NOP
                      ; <-- F32TOUI16 complete, R7H (15:0) = 0.0 (0x0000)
                                                R7H (31:16) = 0.0 (0x0000)
```

See also

F32TOI16 RaH, RbH F32TOUI16R RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



F32TOUI16R RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer and Round

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1110 MSW: 1000 0000 00bb baaa

Description

Convert the 32-bit floating-point value in RbH to an unsigned 16-bit integer and round to the closest even value. The result will be stored in RaH. To instead truncate the converted value, use the F32TOUI16 instruction.

RaH(15:0) = F32ToUI16round(RbH) RaH(31:16) = 0x0000

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32TOUI16R RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- F32TOUI16R completes, RaH updated
```

NOF

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZ
            R5H, \#0x412C; R5H = 0x412C
                          ; R5H = 0xCCCD
MOVXI
            R5H, #0xCCCD
                          ; R5H = 10.8 (0x412CCCCD)
F32TOUI16R R6H, R5H
                          ; R6H (15:0) = F32TOUI16round (R5H)
                          ; R6H (31:16) = 0x0000
                          ; R7H = -10.8 (0x0xC12CCCCD)
MOVF32
            R7H, #-10.8
                            <-- F32TOUI16R complete,
                            R6H (15:0) = 11.0 (0x000B)
                            R6H (31:16) = 0.0 (0x0000)
F32TOUI16R R0H, R7H
                          ; R0H (15:0) = F32TOUI16round (R7H)
                           ; R0H (31:16) = 0x0000
NOP
                          ; 1 Cycle delay for F32TOUI16R to complete
                          ; <-- F32TOUI16R complete,
                          ; R0H (15:0) = 0.0 (0 \times 0000)
                           ; R0H (31:16) = 0.0 (0x0000)
```

See also

F32TOI16 RaH, RbH F32TOI16R RaH, RbH F32TOUI16 RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



F32TOUI32 RaH, RbH Convert 32-bit Floating-Point Value to 16-bit Unsigned Integer

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1010 MSW: 0000 0000 00bb baaa

Description

Convert the 32-bit floating-point value in RbH to an unsigned 32-bit integer and store the

result in RaH.

RaH = F32ToUI32(RbH)

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
F32TOUI32 RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- F32TOUI32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZF32 R6H, #12.5 ; R6H = 12.5 (0x41480000)
F32TOUI32 R7H, R6H ; R7H = F32TOUI32 (R6H)
MOVIZF32 R1H, #-6.5 ; R1H = -6.5 (0xC0D000000)
; <-- F32TOUI32 complete, R7H = 12.0 (0x0000000C)
F32TOUI32 R2H, R1H ; R2H = F32TOUI32 (R1H)
NOP ; 1 Cycle delay for F32TOUI32 to complete
; <-- F32TOUI32 complete, R2H = 0.0 (0x00000000)
```

See also

F32TOI32 RaH, RbH I32TOF32 RaH, RbH I32TOF32 RaH, mem32 UI32TOF32 RaH, RbH UI32TOF32 RaH, mem32



FRACF32 RaH, RbH Fractional Portion of a 32-bit Floating-Point Value

Operands

RaH floating-point destination register (R0H to R7H) RbH floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1111 0001 MSW: 0000 0000 00bb baaa

Description

Returns in RaH the fractional portion of the 32-bit floating-point value in RbH

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

FRACF32 RaH, RbH ; 2 pipeline cycles (2p)

; 1 cycle delay or non-conflicting instruction

; <-- FRACF32 completes, RaH updated

NOP

Any instruction in the delay slot must not use RaH as a destination register or use RaH

as a source operand.

Example MOVIZF32 R2H, #19.625; R2H = 19.625 (0x419D0000)

FRACF32 R3H, R2H ; R3H = FRACF32 (R2H)

; 1 Cycle delay for FRACF32 to complete NOP

; <-- FRACF32 complete, R3H = 0.625 (0x3F200000)

See also



I16TOF32 RaH, RbH Convert 16-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 0110 1000 1101 MSW: 0000 0000 00bb baaa
```

Description

Convert the 16-bit signed integer in RbH to a 32-bit floating point value and store the result in RaH.

RaH = I16ToF32 RbH

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
I16TOF32 RaH, RbH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- I16TOF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZ
          ROH, \#0x0000; ROH[31:16] = 0.0 (0x0000)
MOVXI
          ROH, \#0x0004; ROH[15:0] = 4.0 (0x0004)
I16TOF32
         R1H, R0H
                        ; R1H = I16TOF32 (R0H)
          R2H, \#0x0000; R2H[31:16] = 0.0 (0x0000)
MOVIZ
                        ; <--\text{I16TOF32} complete, R1H = 4.0 (0x40800000)
MOVXI
          R2H, \#0xFFFC; R2H[15:0] = -4.0 (0xFFFC)
I16TOF32 R3H, R2H
                        ; R3H = I16TOF32 (R2H)
NOP
                        ; 1 Cycle delay for I16TOF32 to complete
                        ; <-- I16TOF32 complete, R3H = -4.0 (0xC0800000)
```

See also

F32TOI16 RaH, RbH F32TOI16R RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



I16TOF32 RaH, mem16 Convert 16-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
mem316	16-bit source memory location to be converted

Opcode

```
LSW: 1110 0110 1100 1000 MSW: 0000 0aaa mem16
```

Description

Convert the 16-bit signed integer indicated by the mem16 pointer to a 32-bit floating-point value and store the result in RaH.

```
RaH = I16ToF32[mem16]
```

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
I16TOF32 RaH, mem16 ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- I16TOF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVW
           DP, \#0x0280 ; DP = 0x0280
MOV
           @0, #0x0004 ; [0x00A000] = 4.0 (0x0004)
I16TOF32
           ROH, @0
                         ; R0H = I16TOF32 [0x00A000]
           01, #0xFFFC
                        ; [0x00A001] = -4.0 (0xFFFC)
                         ; <--\text{I16TOF32} complete, R0H = 4.0 (0x40800000)
I16TOF32
           R1H, @1
                         ; R1H = I16TOF32 [0x00A001]
                         ; 1 Cycle delay for I16TOF32 to complete
NOP
                         ; \leftarrow-- I16TOF32 complete, R1H = -4.0 (0xC0800000)
```

See also

F32TOI16 RaH, RbH F32TOI16R RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH UI16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



132TOF32 RaH, mem32 Convert 32-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
mem32	32-bit source for the MOV32 operation. mem32 means that the operation can only address memory using any of the direct or indirect addressing modes supported by the C28x CPU

Opcode

LSW: 1110 0010 1000 1000 MSW: 0000 0aaa mem32

Description

Convert the 32-bit signed integer indicated by the mem32 pointer to a 32-bit floating point value and store the result in RaH.

RaH = I32ToF32[mem32]

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
I32TOF32 RaH, mem32 ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- I32TOF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

See also

F32TOI32 RaH, RbH F32TOUI32 RaH, RbH I32TOF32 RaH, RbH UI32TOF32 RaH, RbH UI32TOF32 RaH, mem32



132TOF32 RaH, RbH Convert 32-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1000 1001 MSW: 0000 0000 00bb baaa

Description

Convert the signed 32-bit integer in RbH to a 32-bit floating-point value and store the result in RaH.

RaH = I32ToF32(RbH)

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
I32TOF32 RaH, RbH ; 2 pipeline cycles (2p)
```

NOP ; 1 cycle delay or non-conflicting instruction

; <-- I32TOF32 completes, RaH updated

NOF

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

```
MOVIZ R2H, #0x1111 ; R2H[31:16] = 4369 (0x1111)

MOVXI R2H, #0x1111 ; R2H[15:0] = 4369 (0x1111)

; Value of the 32 bit signed integer present
; in R2H is +286331153 (0x11111111)

I32TOF32 R3H, R2H ; R3H = I32TOF32 (R2H)

NOP ; 1 Cycle delay for I32TOF32 to complete
; <-- I32TOF32 complete, R3H = 286331153 (0x4D888888)
```

See also

F32TOI32 RaH, RbH F32TOUI32 RaH, RbH I32TOF32 RaH, mem32 UI32TOF32 RaH, RbH UI32TOF32 RaH, mem32



MACF32 R3H, R2H, RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Add

Operands

This instruction is an alias for the parallel multiply and add instruction. The operands are translated by the assembler such that the instruction becomes:

MPYF32	RdH,	RaH, RbH
ADDF32	R3H,	R3H, R2H
R3H		floating-point destination and source register for the ADDF32
R2H		floating-point source register for the ADDF32 operation (R0H to R7H)
RdH		floating-point destination register for MPYF32 operation (R0H to R7H) RdH cannot be R3H
ReH		floating-point source register for MPYF32 operation (R0H to R7H)
RfH		floating-point source register for MPYF32 operation (R0H to R7H)

Opcode

```
LSW: 1110 0111 0100 00ff MSW: feee dddc ccbb baaa
```

Description

This instruction is an alias for the parallel multiply and add, MACF32 || ADDF32, instruction.

```
RdH = ReH * RfH

R3H = R3H + R2H
```

Restrictions

The destination register for the MPYF32 and the ADDF32 must be unique. That is, RdH cannot be R3H.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 or ADDF32 generates an underflow condition.
- LVF = 1 if MPYF32 or ADDF32 generates an overflow condition.

Pipeline

Both MPYF32 and ADDF32 take 2 pipeline cycles (2p) That is:

```
MPYF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)

| ADDF32 RdH, ReH, RfH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction
; <-- MPYF32, ADDF32 complete, RaH, RdH updated
NOP
```

Any instruction in the delay slot must not use RaH or RdH as a destination register or as a source operand.



```
Example
                          Perform 5 multiply and accumulate operations:
                          1st multiply: A = X0 * Y0
                          2nd multiply: B = X1 * Y1
                          3rd multiply: C = X2 * Y2
                          4th multiply: D = X3 * Y3
                          5th multiply: E = X3 * Y3
                          Result = A + B + C + D + E
                          MOV32 ROH, *XAR4++
                                                        ; ROH = XO
                          MOV32 R1H, *XAR5++
                                                         ; R1H = Y0
                                                         ; R2H = A = X0 * Y0
                          MPYF32 R2H, R0H, R1H
                                                         ; In parallel ROH = X1
                       || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                         ; R1H = Y1
                                                         ; R3H = B = X1 * Y1
                          MPYF32 R3H, R0H, R1H
                                                         ; In parallel ROH = X2
                       || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                         ; R1H = Y2
                                                         ; R3H = A + B
                                                         ; R2H = C = X2 * Y2
                          MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X3
                       | MOV32 ROH, *XAR4++
                          MOV32 R1H, *XAR5++
                                                         ; R1H = Y3
                                                         ; R3H = (A + B) + C
                                                         ; R2H = D = X3 * Y3
                          MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X4
                       | MOV32 R0H, *XAR4
                          MOV32 R1H, *XAR5
                                                        ; R1H = Y4
                      ; The next MACF32 is an alias for
                      ; MPYF32 || ADDF32
                                                         ; R2H = E = X4 * Y4
                          MACF32 R3H, R2H, R2H, R0H, R1H; in parallel R3H = (A + B + C) + D
                                                         ; Wait for MPYF32 | ADDF32 to complete
                                                         ; R3H = (A + B + C + D) + E
                          ADDF32 R3H, R3H, R2H
                                                         ; Wait for ADDF32 to complete
                          MOV32 @Result, R3H
                                                         ; Store the result
                      MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32
See also
                      MACF32 R7H, R3H, mem32, *XAR7++
                      MACF32 R7H, R6H, RdH, ReH, RfH
                      MACF32 R7H, R6H, RdH, ReH, RfH | MOV32 RaH, mem32
                      MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH
```



MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32 32-bit Floating-Point Multiply and Accumulate with Parallel Move

Operands

R3H	floating-point destination/source register R3H for the add operation
R2H	floating-point source register R2H for the add operation
RdH	floating-point destination register (R0H to R7H) for the multiply operation RdH cannot be the same register as RaH
ReH	floating-point source register (R0H to R7H) for the multiply operation
RfH	floating-point source register (R0H to R7H) for the multiply operation
RaH	floating-point destination register for the MOV32 operation (R0H to R7H). RaH cannot be R3H or the same register as RdH.
mem32	32-bit source for the MOV32 operation

Opcode

```
LSW: 1110 0011 0011 fffe MSW: eedd daaa mem32
```

Description

Multiply and accumulate the contents of floating-point registers and move from register to memory. The destination register for the MOV32 cannot be the same as the destination registers for the MACF32.

```
R3H = R3H + R2H,
RdH = ReH * RfH,
RaH = [mem32]
```

Restrictions

The destination registers for the MACF32 and the MOV32 must be unique. That is, RaH cannot be R3H and RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MACF32 (add or multiply) generates an underflow condition.
- LVF = 1 if MACF32 (add or multiply) generates an overflow condition.

MOV32 sets the NF, ZF, NI and ZI flags as follows:

```
NF = RaH(31);
ZF = 0;
if(RaH(30:23) == 0) { ZF = 1; NF = 0; }
NI = RaH(31);
ZI = 0;
if(RaH(31:0) == 0) ZI = 1;
```

Pipeline

The MACF32 takes 2 pipeline cycles (2p) and the MOV32 takes a single cycle. That is:

```
MACF32 R3H, R2H, RdH, ReH, RfH ; 2 pipeline cycles (2p)

| MOV32 RaH, mem32 ; 1 cycle

ROP ; 1 cycle delay for MACF32

R3H, RdH updated

NOP ; -- MACF32 completes, R3H, RdH updated

NOP
```

Any instruction in the delay slot for this version of MACF32 must not use R3H or RdH as a destination register or R3H or RdH as a source operand.

```
Example
                         Perform 5 multiply and accumulate operations:
                          1ST multiply: A = X0 * Y0
                          2nd multiply: B = X1 * Y1
                          3rd multiply: C = X2 * Y2
                      ;
                          4TH multiply: D = X3 * Y3
                         5th multiply: E = X3 * Y3
                         Result = A + B + C + D + E
                         MOV32 ROH, *XAR4++
                                                       ; ROH = XO
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y0
                                                        ; R2H = A = X0 * Y0
                         MPYF32 R2H, R0H, R1H
                                                        ; In parallel ROH = X1
                       || MOV32 R0H, *XAR4++
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y1
                                                        ; R3H = B = X1 * Y1
                                                        ; In parallel ROH = X2
                         MPYF32 R3H, R0H, R1H
                       || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                        ; R1H = Y2
                                                        ; R3H = A + B
                                                        ; R2H = C = X2 * Y2
                          MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X3
                       || MOV32 ROH, *XAR4++
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y3
                                                        ; R3H = (A + B) + C
                                                        ; R2H = D = X3 * Y3
                         MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X4
                         MOV32 ROH, *XAR4
                         MOV32 R1H, *XAR5
                                                        ; R1H = Y4
                                                        ; R2H = E = X4 * Y4
                         MPYF32 R2H, R0H, R1H
                                                        ; in parallel R3H = (A + B + C) + D
                       | ADDF32 R3H, R3H, R2H
                                                        ; Wait for MPYF32 | ADDF32 to complete
                          ADDF32 R3H, R3H, R2H
                                                        ; R3H = (A + B + C + D) + E
                                                        ; Wait for ADDF32 to complete
                          MOV32 @Result, R3H
                                                        ; Store the result
                      MACF32 R3H, R2H, RdH, ReH, RfH
See also
                      MACF32 R7H, R3H, mem32, *XAR7++
                      MACF32 R7H, R6H, RdH, ReH, RfH
                      MACF32 R7H, R6H, RdH, ReH, RfH | MOV32 RaH, mem32
                      MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH
```



MACF32 R7H, R3H, mem32, *XAR7++ 32-bit Floating-Point Multiply and Accumulate

Operands

R7H	floating-point destination register
R3H	floating-point destination register
mem32	pointer to a 32-bit source location
*XAR7	32-bit location pointed to by auxiliary register 7

Opcode

```
LSW: 1110 0010 0101 0000 MSW: 00bb baaa mem32
```

Description

Perform an multiply and accumulate operation. When used as a stand-alone operation, the MACF32 will perform a single multiply as shown below:

```
Cycle 1: R3H = R3H + R2H, R2H = [mem32] * [XAR7++]
```

This instruction is the only floating-point instruction that can be repeated using the single repeat instruction (RPT ||). When repeated, the destination of the accumulate will alternate between R3H and R7H on each cycle and R2H and R6H are used as temporary storage for each multiply.

```
Cycle 1: R3H = R3H + R2H, R2H = [mem32] * [XAR7++]
Cycle 2: R7H = R7H + R6H, R6H = [mem32] * [XAR7++]
Cycle 3: R3H = R3H + R2H, R2H = [mem32] * [XAR7++]
Cycle 4: R7H = R7H + R6H, R6H = [mem32] * [XAR7++]
etc...
```

Restrictions

R2H and R6H will be used as temporary storage by this instruction.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MACF32 generates an underflow condition.
- LVF = 1 if MACF32 generates an overflow condition.

Pipeline

When repeated the MACF32 takes 3 + N cycles where N is the number of times the instruction is repeated. When repeated, this instruction has the following pipeline restrictions:



MACF32 can also be used standalone. In this case, the insruction takes 2 cycles and the following pipeline restrictions apply:

```
<instruction1>
                                       ; No restriction
   <instruction2>
                                       ; Cannot be a 2p instruction that writes
                                       ; to R2H, R3H, R6H or R7H
   MACF32 R7H, R3H, *XAR6, *XAR7
                                       ; R3H = R3H + R2H, R2H = [mem32] * [XAR7++]
                                       ; <-- R2H and R3H are valid (note: no
delay required)
   NOP
   ZERO R2H
                                      ; Zero the accumulation registers
   ZERO R3H
                                       ; and temporary multiply storage registers
   ZERO R6H
   ZERO R7H
  RPT #3
                                      ; Repeat MACF32 N+1 (4) times
| MACF32 R7H, R3H, *XAR6++, *XAR7++
                                      ; Final accumulate
   ADDF32 R7H, R7H, R3H
   NOP
                                      ; <-- ADDF32 completes, R7H valid
   NOP
```

Cascading of RPT || MACF32 is allowed as long as the first and subsequent counts are even. Cascading is useful for creating interruptible windows so that interrupts are not delayed too long by the RPT instruction. For example:

```
ZERO R2H
                                      ; Zero the accumulation registers
  ZERO R3H
                                      ; and temporary multiply storage registers
  ZERO R6H
  ZERO R7H
  RPT #3
                                      ; Execute MACF32 N+1 (4) times
| MACF32 R7H, R3H, *XAR6++, *XAR7++
  RPT #5
                                      ; Execute MACF32 N+1 (6) times
| MACF32 R7H, R3H, *XAR6++, *XAR7++
                                      ; Repeat MACF32 N+1 times where N+1 is even
  RPT #N
|| MACF32 R7H, R3H, *XAR6++, *XAR7++
  ADDF32 R7H, R7H, R3H
                                      ; Final accumulate
                                      ; <-- ADDF32 completes, R7H valid
```

See also

Example

MACF32 R3H, R2H, RdH, ReH, RfH || MOV32 RaH, mem32 MACF32 R7H, R6H, RdH, ReH, RfH || MOV32 RaH, mem32 MPYF32 RaH, RbH, RcH || ADDF32 RdH, ReH, RfH



MACF32 R7H, R6H, RdH, ReH, RfH 32-bit Floating-Point Multiply with Parallel Add

Operands

This instruction is an alias for the parallel multiply and add instruction. The operands are translated by the assembler such that the instruction becomes:

MPYF32	RdH, RaH, RbH	
ADDF32	R7H, R7H, R6H	
R7H	floating-point destination and source register for the ADDF32	
R6H	floating-point source register for the ADDF32 operation (R0H to R7H)	
RdH	floating-point destination register for MPYF32 operation (R0H to R7H) RdH cannot be R3H	
ReH	floating-point source register for MPYF32 operation (R0H to R7H)	
RfH	floating-point source register for MPYF32 operation (R0H to R7H)	

Opcode

```
LSW: 1110 0111 0100 00ff MSW: feee dddc ccbb baaa
```

Description

This instruction is an alias for the parallel multiply and add, MACF32 || ADDF32, instruction.

```
RdH = RaH * RbH

R7H = R6H + R6H
```

Restrictions

The destination register for the MPYF32 and the ADDF32 must be unique. That is, RdH cannot be R7H.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 or ADDF32 generates an underflow condition.
- LVF = 1 if MPYF32 or ADDF32 generates an overflow condition.

Pipeline

Both MPYF32 and ADDF32 take 2 pipeline cycles (2p) That is:

```
MPYF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)

| ADDF32 RdH, ReH, RfH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction

; <-- MPYF32, ADDF32 complete, RaH, RdH updated
```

Any instruction in the delay slot must not use RaH or RdH as a destination register or as a source operand.

```
Example
                          Perform 5 multiply and accumulate operations:
                          1st multiply: A = X0 * Y0
                          2nd multiply: B = X1 * Y1
                          3rd multiply: C = X2 * Y2
                          4th multiply: D = X3 * Y3
                          5th multiply: E = X3 * Y3
                          Result = A + B + C + D + E
                          MOV32 R0H, *XAR4++
                                                         ; ROH = XO
                          MOV32 R1H, *XAR5++
                                                          ; R1H = Y0
                                                          ; R6H = A = X0 * Y0
                          MPYF32 R6H, R0H, R1H
                                                         ; In parallel ROH = X1
                        || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                          ; R1H = Y1
                                                          ; R7H = B = X1 * Y1
                          MPYF32 R7H, R0H, R1H
                                                          ; In parallel ROH = X2
                        || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                          ; R1H = Y2
                                                          ; R7H = A + B
                          ; R6H = C = X2 * Y2
MACF32 R7H, R6H, R6H, R0H, R1H ; In parallel R0H = X3
                        | MOV32 ROH, *XAR4++
                          MOV32 R1H, *XAR5++
                                                          ; R1H = Y3
                                                          ; R7H = (A + B) + C
                                                          ; R6H = D = X3 * Y3
                          MACF32 R7H, R6H, R6H, R0H, R1H; In parallel R0H = X4
                       | MOV32 R0H, *XAR4
                          MOV32 R1H, *XAR5
                                                          ; R1H = Y4
                      ; Next MACF32 is an alias for
                       ; MPYF32 || ADDF32
                          MACF32 R7H, R6H, R6H, R0H, R1H; R6H = E = X4 * Y4
                                                          ; in parallel R7H = (A + B + C) + D
                                                          ; Wait for MPYF32 | ADDF32 to complete
                          ADDF32 R7H, R7H, R6H
                                                          ; R7H = (A + B + C + D) + E
                                                          ; Wait for ADDF32 to complete
                          MOV32 @Result, R7H
                                                          ; Store the result
                      MACF32 R3H, R2H, RdH, ReH, RfH
See also
                      MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32
                      MACF32 R7H, R3H, mem32, *XAR7++
                      MACF32 R7H, R6H, RdH, ReH, RfH | MOV32 RaH, mem32
                      MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH
```



MACF32 R7H, R6H, RdH, ReH, RfH ||MOV32 RaH, mem32 32-bit Floating-Point Multiply and Accumulate with Parallel Move

Operands

R7H	floating-point destination/source register R7H for the add operation
R6H	floating-point source register R6H for the add operation
RdH	floating-point destination register (R0H to R7H) for the multiply operation. RdH cannot be the same register as RaH.
ReH	floating-point source register (R0H to R7H) for the multiply operation
RfH	floating-point source register (R0H to R7H) for the multiply operation
RaH	floating-point destination register for the MOV32 operation (R0H to R7H). RaH cannot be R3H or the same as RdH.
mem32	32-bit source for the MOV32 operation

Opcode

```
LSW: 1110 0011 1100 fffe MSW: eedd daaa mem32
```

Description

Multiply/accumulate the contents of floating-point registers and move from register to memory. The destination register for the MOV32 cannot be the same as the destination registers for the MACF32.

```
R7H = R7H + R6H
RdH = ReH * RfH,
RaH = [mem32]
```

Restrictions

The destination registers for the MACF32 and the MOV32 must be unique. That is, RaH cannot be R7H and RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MACF32 (add or multiply) generates an underflow condition.
- LVF = 1 if MACF32 (add or multiply) generates an overflow condition.

The MOV32 Instruction will set the NF, ZF, NI and ZI flags as follows:

```
NF = RaH(31);
ZF = 0;
if(RaH(30:23) == 0) {ZF = 1; NF = 0;}
NI = RaH(31);
ZI = 0;
if(RaH(31:0) == 0) ZI = 1;
```

Pipeline

The MACF32 takes 2 pipeline cycles (2p) and the MOV32 takes a single cycle. That is:

```
MACF32 R7H, R6H, RdH, ReH, RfH ; 2 pipeline cycles (2p)

| MOV32 RaH, mem32 ; 1 cycle

NOP ; 1 cycle delay

; <-- MACF32 completes, R7H, RdH updated

NOP
```

```
Example
                          Perform 5 multiply and accumulate operations:
                          1st multiply: A = X0 * Y0
                          2nd multiply: B = X1 * Y1
                          3rd multiply: C = X2 * Y2
                          4th multiply: D = X3 * Y3
                          5th multiply: E = X3 * Y3
                          Result = A + B + C + D + E
                          MOV32 ROH, *XAR4++
                                                        ; ROH = XO
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y0
                                                        ; R6H = A = X0 * Y0
                          MPYF32 R6H, R0H, R1H
                                                        ; In parallel ROH = X1
                       || MOV32 R0H, *XAR4++
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y1
                                                        ; R7H = B = X1 * Y1
                                                         ; In parallel ROH = X2
                          MPYF32 R7H, R0H, R1H
                       || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                        ; R1H = Y2
                                                        ; R7H = A + B
                                                         ; R6H = C = X2 * Y2
                          MACF32 R7H, R6H, R6H, R0H, R1H ; In parallel R0H = X3
                       || MOV32 ROH, *XAR4++
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y3
                                                        ; R7H = (A + B) + C
                                                         ; R6H = D = X3 * Y3
                          MACF32 R7H, R6H, R6H, R0H, R1H; In parallel R0H = X4
                         MOV32 ROH, *XAR4
                          MOV32 R1H, *XAR5
                                                        ; R1H = Y4
                                                        ; R6H = E = X4 * Y4
                          MPYF32 R6H, R0H, R1H
                                                        ; in parallel R7H = (A + B + C) + D
                       | ADDF32 R7H, R7H, R6H
                                                        ; Wait for MPYF32 || ADDF32 to complete
                          ADDF32 R7H, R7H, R6H
                                                        ; R7H = (A + B + C + D) + E
                                                         ; Wait for ADDF32 to complete
                          MOV32 @Result, R7H
                                                         ; Store the result
                      MACF32 R7H, R3H, mem32, *XAR7++
See also
                      MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32
```

MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH



MAXF32 RaH, RbH 32-bit Floating-Point Maximum

Operands

RaH	floating-point source/destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1001 0110 MSW: 0000 0000 00bb baaa

Description

if(RaH < RbH) RaH = RbH

Special cases for the output from the MAXF32 operation:

- NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == RbH) {ZF=1, NF=0}
if(RaH > RbH) {ZF=0, NF=0}
if(RaH < RbH) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
; R0H = 5.0 (0x40A00000)
MOVIZF32
            ROH, #5.0
                          ; R1H = -2.0 (0xC0000000)
MOVIZF32
            R1H, #-2.0
MOVIZF32
            R2H, #-1.5
                         ; R2H = -1.5 (0xBFC00000)
MAXF32
            R2H, R1H
                         ; R2H = -1.5, ZF = NF = 0
                         ; R1H = -1.5, ZF = 0, NF = 1
MAXF32
            R1H, R2H
            R1H, R0H
                         ; R2H = 5.0, ZF = 0, NF = 1
MAXF32
MAXF32
                         ; R2H = 5.0, ZF = 1, NF = 0
```

See also

CMPF32 RaH, RbH CMPF32 RaH, #16FHi CMPF32 RaH, #0.0

MAXF32 RaH, RbH || MOV32 RcH, RdH

MAXF32 RaH, #16FHi MINF32 RaH, RbH MINF32 RaH, #16FHi



MAXF32 RaH, #16FHi 32-bit Floating-Point Maximum

Operands

RaH	floating-point source/destination register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

LSW: 1110 1000 0010 0III MSW: IIII IIII IIII IIII Iaaa

Description

Compare RaH with the floating-point value represented by the immediate operand. If the immediate value is larger, then load it into RaH.

```
if(RaH < #16FHi:0) RaH = #16FHi:0
```

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. This addressing mode is most useful for constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, -1.5 can be represented as #-1.5 or #0xBFC0.

Special cases for the output from the MAXF32 operation:

- NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == #16FHi:0) {ZF=1, NF=0}
if(RaH > #16FHi:0) {ZF=0, NF=0}
if(RaH < #16FHi:0) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32
                           ; R0H = 5.0 (0x40A00000)
             ROH, #5.0
             R1H, #4.0
MOVTZF32
                           ; R1H = 4.0 (0x40800000)
MOVIZF32
             R2H, #-1.5
                           ; R2H = -1.5 (0xBFC00000)
                           ; ROH = 5.5, ZF = 0, NF = 1
MAXF32
             ROH, #5.5
MAXF32
             R1H, #2.5
                           ; R1H = 4.0, ZF = 0, NF = 0
                         ; R2H = -1.0, ZF = 0, NF = 1
; R2H = 1 = --
MAXF32
             R2H, #-1.0
                           ; R2H = -1.5, ZF = 1, NF = 0
MAXF32
             R2H, #-1.0
```

See also

MAXF32 RaH, RbH MAXF32 RaH, RbH || MOV32 RcH, RdH

MINF32 RaH, RbH MINF32 RaH, #16FHi



MAXF32 RaH, RbH

MOV32 RcH, RdH 32-bit Floating-Point Maximum with Parallel Move

Operands

RaH	floating-point source/destination register for the MAXF32 operation (R0H to R7H) RaH cannot be the same register as RcH
RbH	floating-point source register for the MAXF32 operation (R0H to R7H)
RcH	floating-point destination register for the MOV32 operation (R0H to R7H) RcH cannot be the same register as RaH
RdH	floating-point source register for the MOV32 operation (R0H to R7H)

Opcode

LSW: 1110 0110 1001 1100 MSW: 0000 dddc ccbb baaa

Description

If RaH is less than RbH, then load RaH with RbH. Thus RaH will always have the maximum value. If RaH is less than RbH, then, in parallel, also load RcH with the contents of RdH.

```
if(RaH < RbH) { RaH = RbH; RcH = RdH; }</pre>
```

The MAXF32 instruction is performed as a logical compare operation. This is possible because of the IEEE floating-point format offsets the exponent. Basically the bigger the binary number, the bigger the floating-point value.

Special cases for the output from the MAXF32 operation:

- · NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Restrictions

The destination register for the MAXF32 and the MOV32 must be unique. That is, RaH cannot be the same register as RcH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	Yes	Yes	No	No	

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == RbH) {ZF=1, NF=0}
if(RaH > RbH) {ZF=0, NF=0}
if(RaH < RbH) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32
                ROH, #5.0
                              ; R0H = 5.0 (0x40A00000)
  MOVIZF32
                R1H, #4.0
                              ; R1H = 4.0 (0x40800000)
                R2H, #-1.5
R3H, #-2.0
  MOVIZF32
                              ; R2H = -1.5 (0xBFC00000)
  MOVIZF32
                              ; R3H = -2.0 (0xC0000000)
  MAXF32
                ROH, R1H
                              ; ROH = 5.0, R3H = -1.5, ZF = 0, NF = 0
| MOV32
                R3H, R2H
  MAXF32
                R1H, R0H
                              ; R1H = 5.0, R3H = -1.5, ZF = 0, NF = 1
| MOV32
                R3H, R2H
                R0H, R1H
                              ; ROH = 5.0, R2H = -1.5, ZF = 1, NF = 0
  MAXF32
                R2H, R1H
| MOV32
```

See also

MAXF32 RaH, RbH MAXF32 RaH, #16FHi

MINF32 RaH, RbH

32-bit Floating-Point Minimum

Operands

RaH	floating-point source/destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode

LSW: 1110 0110 1001 0111 MSW: 0000 0000 00bb baaa

Description

if(RaH > RbH) RaH = RbH

Special cases for the output from the MINF32 operation:

- NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == RbH) {ZF=1, NF=0}
if(RaH > RbH) {ZF=0, NF=0}
if(RaH < RbH) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
; R0H = 5.0 (0x40A00000)
MOVIZF32
            ROH, #5.0
                          ; R1H = 4.0 (0x40800000)
MOVIZF32
            R1H, #4.0
MOVIZF32
            R2H, #-1.5
                          ; R2H = -1.5 (0xBFC00000)
MINF32
            ROH, R1H
                          ; ROH = 4.0, ZF = 0, NF = 0
                          ; R1H = -1.5, ZF = 0, NF = 0
MINF32
            R1H, R2H
            R2H, R1H
                         ; R2H = -1.5, ZF = 1, NF = 0
MINF32
                         ; R2H = -1.5, ZF = 0, NF = 1
MINF32
            R1H, R0H
```

See also

MAXF32 RaH, RbH MAXF32 RaH, #16FHi MINF32 RaH, #16FHi

MINF32 RaH, RbH || MOV32 RcH, RdH



MINF32 RaH, #16FHi 32-bit Floating-Point Minimum

Operands

RaH	floating-point source/destination register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

```
LSW: 1110 1000 0011 0III MSW: IIII IIII IIII IIII Iaaa
```

Description

Compare RaH with the floating-point value represented by the immediate operand. If the immidate value is smaller, then load it into RaH.

```
if(RaH > #16FHi:0) RaH = #16FHi:0
```

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. This addressing mode is most useful for constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, -1.5 can be represented as #-1.5 or #0xBFC0.

Special cases for the output from the MINF32 operation:

- NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == #16FHi:0) {ZF=1, NF=0}
if(RaH > #16FHi:0) {ZF=0, NF=0}
if(RaH < #16FHi:0) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
; R0H = 5.0 (0x40A00000)
MOVIZF32
              ROH, #5.0
             R1H, #4.0
MOVTZF32
                             ; R1H = 4.0 (0x40800000)
MOVIZF32
              R2H, #-1.5
                            ; R2H = -1.5 (0xBFC00000)
                             ; ROH = 5.0, ZF = 0, NF = 1
MTNF32
             ROH, #5.5
MINF32
              R1H, #2.5
                            ; R1H = 2.5, ZF = 0, NF = 0
                            ; R2H = -1.5, ZF = 0, NF = 1
; R2H = -1.5, ZF = 1, NF = 0
MINF32
              R2H, #-1.0
MINF32
              R2H, #-1.5
```

See also

```
MAXF32 RaH, #16FHi
MAXF32 RaH, RbH
MINF32 RaH, RbH
```

MINF32 RaH, RbH || MOV32 RcH, RdH



MINF32 RaH, RbH

MOV32 RcH, RdH 32-bit Floating-Point Minimum with Parallel Move

Operands

RaH	floating-point source/destination register for the MIN32 operation (R0H to R7H) RaH cannot be the same register as RcH
RbH	floating-point source register for the MIN32 operation (R0H to R7H)
RcH	floating-point destination register for the MOV32 operation (R0H to R7H) RcH cannot be the same register as RaH
RdH	floating-point source register for the MOV32 operation (R0H to R7H)

Opcode

```
LSW: 1110 0110 1001 1101 MSW: 0000 dddc ccbb baaa
```

Description

```
if(RaH > RbH) { RaH = RbH; RcH = RdH; }
```

Special cases for the output from the MINF32 operation:

- NaN output will be converted to infinity
- A denormalized output will be converted to positive zero.

Restrictions

The destination register for the MINF32 and the MOV32 must be unique. That is, RaH cannot be the same register as RcH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	Yes	Yes	No	No

The ZF and NF flags are configured on the result of the operation, not the result stored in the destination register.

```
if(RaH == RbH) {ZF=1, NF=0}
if(RaH > RbH) {ZF=0, NF=0}
if(RaH < RbH) {ZF=0, NF=1}</pre>
```

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32
                ROH, #5.0
                              ; ROH = 5.0 (0x40A00000)
  MOVIZF32
                R1H, #4.0
                              ; R1H = 4.0 (0x40800000)
                R2H, #-1.5
R3H, #-2.0
  MOVIZF32
                              ; R2H = -1.5 (0xBFC00000)
                              ; R3H = -2.0 (0xC0000000)
  MOVIZF32
                              ; ROH = 4.0, R3H = -1.5, ZF = 0, NF = 0
  MINF32
                ROH, R1H
                R3H, R2H
MOV32
  MINF32
                R1H, R0H
                              ; R1H = 4.0, R3H = -1.5, ZF = 1, NF = 0
                R3H, R2H
| MOV32
                              ; R2H = -1.5, R1H = 4.0, ZF = 1, NF = 1
  MINF32
                R2H, R1H
| MOV32
                R1H, R3H
```

See also

MINF32 RaH, RbH MINF32 RaH, #16FHi



MOV16 mem16, RaH Move 16-bit Floating-Point Register Contents to Memory

Operands

mem16 points to the 16-bit destination memory

RaH floating-point source register (R0H to R7H)

Opcode LSW: 1110 0010 0001 0011 MSW: 0000 0aaa mem16

Description Move 16-bit value from the lower 16-bits of the floating-point register (RaH[15:0]) to the

location pointed to by mem16.

[mem16] = RaH[15:0]

Flags No flags STF flags are affected.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline This is a single-cycle instruction.

Example MOVW DP, #0x02C0; DP = 0x02C0

MOVXI R4H, #0x0003; R4H = 3.0 (0x0003)

MOV16 @0, R4H ; [0x00B000] = 3.0 (0x0003)

See also MOVIZ RaH, #16FHiHex

MOVIZF32 RaH, #16FHi MOVXI RaH, #16FLoHex



MOV32 *(0:16bitAddr), loc32 Move the Contents of loc32 to Memory

Operands

0:16bitAddr 16-bit immediate address, zero extended loc32 32 bit source location

Opcode LSW: 1011 1101 loc32 MSW: IIII IIII IIII IIII

Description Move the 32-bit value in loc32 to the memory location addressed by 0:16bitAddr. The

EALLOW bit in the ST1 register is ignored by this operation.

[0:16bitAddr] = [loc32]

Flags This instruction does not modify any STF register flags.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline This is a two-cycle instruction.

Example MOVIZ R5H, #0x1234 ; R5H[31:16] = 0x1234

MOVXI R5H, #0xABCD ; R5H[15:0] = 0xABCD NOP ; 1 Alignment Cycle MOV32 ACC, R5H ; ACC = 0x1234ABCD MOV32 *(0xA000), @ACC ; [0x00A000] = ACC

NOP ; 1 Cycle delay for MOV32 to complete

; <-- MOV32 *(0:16bitAddr), loc32 complete, ; [0x00A000] = 0xABCD, [0x00A001] = 0x1234

See also MOV32 mem32, RaH

MOV32 mem32, STF

MOV32 loc32, *(0:16bitAddr)



MOV32 ACC, RaH

Move 32-bit Floating-Point Register Contents to ACC

Operands

ACC	28x accumulator
RaH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1011 1111
                 loc32
MSW: IIII IIII IIII IIII
```

Description

If the condition is true, then move the 32-bit value referenced by mem32 to the floating-point register indicated by RaH.

ACC = RaH

Flags

No STF flags are affected.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Z and N flag in status register zero (ST0) of the 28x CPU are affected.

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required when copying a floating-point register to a C28x register. If the move follows a single cycle floating point instruction, a single alignment cycle must be added. For example:

```
; Single-cycle instruction
MINF32 ROH, R1H
NOP
                      ; 1 alignment cycle
MOV32
      @ACC,ROH
                      ; Copy ROH to ACC
NOP
                      ; Any instruction
```

If the move follows a 2 pipeline-cycle floating point instruction, then two alignment cycles must be used. For example:

```
ADDF32 R2H, R1H, R0H ; 2 pipeline instruction (2p)
NOP
                      ; 1 cycle delay for ADDF32 to complete
                      ; <-- ADDF32 completes, R2H is valid
NOP
                      ; 1 alignment cycle
MOV32 ACC, R2H
                      ; copy R2H into ACC, takes 2 cycles
                      ; <-- MOV32 completes, ACC is valid
NOP
                      ; Any instruction
MOVIZF32 R0H, #2.5
                      ; R0H = 2.5 = 0x40200000
F32TOUI32 R0H, R0H
NOP
                      ; Delay for conversion instruction
                      ; <-- Conversion complete, ROH valid
                      ; Alignment cycle
```

; P = 2 = 0x00000002

See also

Example

MOV32 P. RaH MOV32 XARn, RaH MOV32 XT, RaH

P, ROH

NOP MOV32



MOV32 loc32, *(0:16bitAddr) Move 32-bit Value from Memory to loc32

Operands

loc32 destination location
0:16bitAddr 16-bit address of the 32-bit source value

Opcode LSW: 1011 1111 loc32 MSW: IIII IIII IIII IIII

Description Copy the 32-bit value referenced by 0:16bitAddr to the location indicated by loc32.

[loc32] = [0:16bitAddr]

Flags No STF flags are affected. If loc32 is the ACC register, then the Z and N flag in status

register zero (ST0) of the 28x CPU are affected.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline This is a 2 cycle instruction.

Example MOVW DP, #0x0300 ; DP = 0x0300

MOV32 @ACC, *(0xC000); AL = [0x00C000], AH = [0x00C001] NOP; 1 Cycle delay for MOV32 to complete

; <-- MOV32 complete, AL = 0xFFFF, AH = 0x1111

See also MOV32 RaH, mem32{, CNDF}

MOV32 *(0:16bitAddr), loc32

MOV32 STF, mem32 MOVD32 RaH, mem32



MOV32 mem32, RaH Move 32-bit Floating-Point Register Contents to Memory

Operands

RaH	floating-point register (R0H to R7H)
mem32	points to the 32-bit destination memory

Opcode

LSW: 1110 0010 0000 0011 MSW: 0000 0aaa mem32

Description

Move from memory to STF.

[mem32] = RaH

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

No flags affected.

Pipeline

This is a single-cycle instruction.

Example

```
Perform 5 multiply and accumulate operations:
   1st multiply: A = X0 * Y0
   2nd multiply: B = X1 * Y1
   3rd multiply: C = X2 * Y2
   4th multiply: D = X3 * Y3
   5th multiply: E = X3 * Y3
   Result = A + B + C + D + E
   MOV32 R0H, *XAR4++
                                   ; ROH = XO
   MOV32 R1H, *XAR5++
                                  ; R1H = Y0
                                  ; R6H = A = X0 * Y0
                                  ; In parallel ROH = X1
   MPYF32 R6H, R0H, R1H
|| MOV32 R0H, *XAR4++
   MOV32 R1H, *XAR5++
                                  ; R1H = Y1
                                  ; R7H = B = X1 * Y1
                                  ; In parallel ROH = X2
   MPYF32 R7H, R0H, R1H
|| MOV32 R0H, *XAR4++
   MOV32 R1H, *XAR5++
                                   ; R1H = Y2
                                  ; R7H = A + B
                                   ; R6H = C = X2 * Y2
   MACF32 R7H, R6H, R6H, R0H, R1H; In parallel R0H = X3
|| MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                   ; R1H = Y3
                                   ; R3H = (A + B) + C
                                   ; R6H = D = X3 * Y3
   MACF32 R7H, R6H, R6H, R0H, R1H; In parallel R0H = X4
|| MOV32 R0H, *XAR4
   MOV32 R1H, *XAR5
                                  ; R1H = Y4
                                   ; R6H = E = X4 * Y4
   MPYF32 R6H, R0H, R1H
                                   ; in parallel R7H = (A + B + C) + D
| ADDF32 R7H, R7H, R2H
                                   ; Wait for MPYF32 | ADDF32 to complete
   ADDF32 R7H, R7H, R6H
                                  ; R7H = (A + B + C + D) + E
                                   ; Wait for ADDF32 to complete
   NOP
   MOV32 @Result, R7H
                                   ; Store the result
```

See also

MOV32 *(0:16bitAddr), loc32 MOV32 mem32, STF



MOV32 mem32, STF Move 32-bit STF Register to Memory

Operands

STF floating-point status register
mem32 points to the 32-bit destination memory

Opcode LSW: 1110 0010 0000 0000 MSW: 0000 0000 mem32

Description Copy the floating-point status register, STF, to memory.

[mem32] = STF

Flags This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

No flags affected.

Pipeline This is a single-cycle instruction.

Example 1 MOVW DP, #0x0280; DP = 0x0280

MOVIZF32 R0H, #2.0 ; R0H = 2.0 (0x40000000) MOVIZF32 R1H, #3.0 ; R1H = 3.0 (0x40400000)

CMPF32 ROH, R1H ; ZF = 0, NF = 1, STF = 0x00000004

MOV32 @0, STF ; [0x00A000] = 0x00000004

Example 2 MOV32 *SP++, STF ; Store STF in stack

MOVF32 R2H, #3.0 ; R2H = 3.0 (0x40400000) MOVF32 R3H, #5.0 ; R3H = 5.0 (0x40A00000)

CMPF32 R2H, R3H ; ZF = 0, NF = 1, STF = 0x00000004

MOV32 R3H, R2H, LT; R3H = 3.0 (0x40400000) MOV32 STF, *--SP; Restore STF from stack

See also MOV32 mem32, RaH

MOV32 *(0:16bitAddr), loc32

MOVST0 FLAG



MOV32 P, RaH

Move 32-bit Floating-Point Register Contents to P

Operands

Р	28x product register P
RaH	floating-point source register (R0H to R7H)

Opcode

LSW: 1011 1111 loc32 MSW: IIII IIII IIII IIII

Description

Move the 32-bit value in RaH to the 28x product register P.

P = RaH

Flags

No flags affected in floating-point unit.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required when copying a floating-point register to a C28x register. If the move follows a single cycle floating point instruction, a single alignment cycle must be added. For example:

```
MINF32 ROH,R1H ; Single-cycle instruction NOP ; 1 alignment cycle MOV32 @ACC,ROH ; Copy ROH to ACC NOP ; Any instruction
```

If the move follows a 2 pipeline-cycle floating point instruction, then two alignment cycles must be used. For example:

```
ADDF32 R2H, R1H, R0H
                     ; 2 pipeline instruction (2p)
NOP
                      ; 1 cycle delay for ADDF32 to complete
                      ; <-- ADDF32 completes, R2H is valid
NOP
                      ; 1 alignment cycle
MOV32 ACC, R2H
                      ; copy R2H into ACC, takes 1 cycle
                      ; <-- MOV32 completes, ACC is valid
NOP
                      ; Any instruction
MOVIZF32 R0H, #2.5
                      ; R0H = 2.5 = 0x40200000
F32TOUI32 ROH, ROH
                      ; Delay for conversion instruction
                      ; <-- Conversion complete, ROH valid
NOP
                      ; Alignment cycle
MOV32
          P, ROH
                      P = 2 = 0 \times 000000002
```

See also

Example

MOV32 ACC, RaH MOV32 XARn, RaH MOV32 XT, RaH



MOV32 RaH, ACC

Move the Contents of ACC to a 32-bit Floating-Point Register

Operands

RaH	floating-point destination register (R0H to R7H)
ACC	accumulator

Opcode

LSW: 1011 1101 loc32 MSW: IIII IIII IIII IIII

Description

Move the 32-bit value in ACC to the floating-point register RaH.

RaH = ACC

Flags

This instruction does not modify any STF register flags.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required. Four alignment cycles are required after any copy from a standard 28x CPU register to a floating-point register. The four alignment cycles can be filled with any non-conflicting instructions except for the following: FRACF32, UI16TOF32, I16TOF32, F32TOUI32, and F32TOI32.

```
MOV32 ROH, @ACC ; Copy ACC to ROH
NOP ; Wait 4 cycles
NOP ; Do not use FRACF32, UI16TOF32
NOP ; I16TOF32, F32TOUI32 or F32TOI32
NOP ;
; <-- ROH is valid
```

Example

```
MOV AH, #0x0000

MOV AL, #0x0200 ; ACC = 512

MOV32 R0H, ACC

NOP

NOP

NOP

NOP

NOP

NOP

UI32TOF32 R0H, R0H ; R0H = 512.0 (0x44000000)
```

See also

MOV32 RaH, P MOV32 RaH, XARn MOV32 RaH, XT

MOV32 RaH, mem32 {, CNDF} Conditional 32-bit Move

Operands

RaH	floating-point destination register (R0H to R7H)
mem32	pointer to the 32-bit source memory location
CNDF	optional condition.

Opcode

LSW: 1110 0010 1010 CNDF MSW: 0000 0aaa mem32

Description

If the condition is true, then move the 32-bit value referenced by mem32 to the floating-point register indicated by RaH.

if (CNDF == TRUE) RaH = [mem32]

CNDF is one of the following conditions:

Encode (1)	CNDF	Description	STF Flags Tested
0000	NEQ	Not equal to zero	ZF == 0
0001	EQ	Equal to zero	ZF == 1
0010	GT	Greater than zero	ZF == 0 AND NF == 0
0011	GEQ	Greater than or equal to zero	NF == 0
0100	LT	Less than zero	NF == 1
0101	LEQ	Less than or equal to zero	ZF == 1 AND NF == 1
1010	TF	Test flag set	TF == 1
1011	NTF	Test flag not set	TF == 0
1100	LU	Latched underflow	LUF == 1
1101	LV	Latched overflow	LVF == 1
1110	UNC	Unconditional	None
1111	UNCF (2)	Unconditional with flag modification	None

⁽¹⁾ Values not shown are reserved.

Flags

This instruction modifies the following flags in the STF register:

Flag	11-	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	No	No

```
if(CNDF == UNCF)
{
   NF = RaH(31);
   ZF = 0;
   if(RaH[30:23] == 0) { ZF = 1; NF = 0; }
   NI = RaH[31];
   ZI = 0;
   if(RaH[31:0] == 0) ZI = 1;
}
else No flags modified;
```

Pipeline

This is a single-cycle instruction.

⁽²⁾ This is the default operation if no CNDF field is specified. This condition will allow the ZF, NF, ZI, and NI flags to be modified when a conditional operation is executed. All other conditions will not modify these flags.



Example	MOVW MOV MOV MOVIZF32 MOVIZF32 MAXF32 MOV32	@1, #0x5555 R3H, #7.0 R4H, #7.0 R3H, R4H	; ; ; ;	DP = 0x0300 [0x00C000] = 0x5555 [0x00C001] = 0x5555 R3H = 7.0 (0x40E00000) R4H = 7.0 (0x40E00000) ZF = 1, NF = 0 R1H = 0x55555555
See also	MOV32 RaH, MOVD32 RaH			



MOV32 RaH, P

Move the Contents of P to a 32-bit Floating-Point Register

Operands

RaH	floating-point register (R0H to R7H)
Р	product register

Opcode

```
LSW: 1011 1101 loc32 MSW: IIII IIII IIII IIII
```

Description

Move the 32-bit value in the product register, P, to the floating-point register RaH.

RaH = P

Flags

This instruction does not modify any STF register flags.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required. Four alignment cycles are required after any copy from a standard 28x CPU register to a floating-point register. The four alignment cycles can be filled with any non-conflicting instructions except for the following: FRACF32, UI16TOF32, I16TOF32, F32TOUI32, and F32TOI32.

```
MOV32
                          ; Copy P to ROH
        ROH,@P
NOP
                           ; Wait 4 alignment cycles
NOP
                          ; Do not use FRACF32, UI16TOF32
                           ; I16TOF32, F32TOUI32 or F32TOI32
NOP
NOP
                           ; <-- ROH is valid
                           ; Instruction can use ROH as a source
MOV
       PH, #0x0000
MOV
       PL, #0x0200
                          ; P = 512
MOV32
      ROH, P
NOP
NOP
NOP
NOP
                          ; ROH = 512.0 (0x44000000)
UI32TOF32 ROH, ROH
```

See also

Example

MOV32 RaH, ACC MOV32 RaH, XARn MOV32 RaH, XT

MOV32 RaH, RbH {, CNDF} Conditional 32-bit Move

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)
CNDF	optional condition.

Opcode

LSW: 1110 0110 1100 CNDF MSW: 0000 0000 00bb baaa

Description

If the condition is true, then move the 32-bit value referenced by mem32 to the floating-point register indicated by RaH.

```
if (CNDF == TRUE) RaH = RbH
```

CNDF is one of the following conditions:

Encode ⁽¹⁾	CNDF	Description	STF Flags Tested
0000	NEQ	Not equal to zero	ZF == 0
0001	EQ	Equal to zero	ZF == 1
0010	GT	Greater than zero	ZF == 0 AND NF == 0
0011	GEQ	Greater than or equal to zero	NF == 0
0100	LT	Less than zero	NF == 1
0101	LEQ	Less than or equal to zero	ZF == 1 AND NF == 1
1010	TF	Test flag set	TF == 1
1011	NTF	Test flag not set	TF == 0
1100	LU	Latched underflow	LUF == 1
1101	LV	Latched overflow	LVF == 1
1110	UNC	Unconditional	None
1111	UNCF (2)	Unconditional with flag modification	None

⁽¹⁾ Values not shown are reserved.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	No	No

```
if(CNDF == UNCF)
{
   NF = RaH(31); ZF = 0;
   if(RaH[30:23] == 0) {ZF = 1; NF = 0;}
   NI = RaH(31); ZI = 0;
   if(RaH[31:0] == 0) ZI = 1;
}
else No flags modified;
```

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32 R3H, #8.0 ; R3H = 8.0 (0x41000000)

MOVIZF32 R4H, #7.0 ; R4H = 7.0 (0x40E00000)

MAXF32 R3H, R4H ; ZF = 0, NF = 0

MOV32 R1H, R3H, GT ; R1H = 8.0 (0x41000000)
```

See also

MOV32 RaH, mem32{, CNDF}

⁽²⁾ This is the default operation if no CNDF field is specified. This condition will allow the ZF, NF, ZI, and NI flags to be modified when a conditional operation is executed. All other conditions will not modify these flags.



MOV32 RaH, XARn Move the Contents of XARn to a 32-bit Floating-Point Register

Operands

RaH	floating-point register (R0H to R7H)
XARn	auxiliary register (XAR0 - XAR7)

Opcode

```
LSW: 1011 1101 loc32
MSW: IIII IIII IIII IIII
```

Description

Move the 32-bit value in the auxiliary register XARn to the floating point register RaH.

RaH = XARn

Flags

This instruction does not modify any STF register flags.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required. Four alignment cycles are required after any copy from a standard 28x CPU register to a floating-point register. The four alignment cycles can be filled with any non-conflicting instructions except for the following: FRACF32, UI16TOF32, I16TOF32, F32TOUI32, and F32TOI32.

```
MOV32
       ROH, @XAR7
                          ; Copy XAR7 to R0H
NOP
                          ; Wait 4 alignment cycles
NOP
                          ; Do not use FRACF32, UI16TOF32
NOP
                          ; I16TOF32, F32TOUI32 or F32TOI32
NOP
                          ; <-- ROH is valid
ADDF32 R2H,R1H,R0H
                          ; Instruction can use ROH as a source
MOVL
        XAR1, \#0x0200; XAR1 = 512
MOV32 ROH, XAR1
NOP
NOP
NOP
UI32TOF32 ROH, ROH ; ROH = 512.0 (0x44000000)
```

See also

Example

MOV32 RaH, ACC MOV32 RaH, P MOV32 RaH, XT



MOV32 RaH, XT

Move the Contents of XT to a 32-bit Floating-Point Register

Operands

RaH	floating-point register (R0H to R7H)
XT	auxiliary register (XAR0 - XAR7)

Opcode

LSW: 1011 1101 loc32 MSW: IIII IIII IIII IIII

Description

Move the 32-bit value in temporary register, XT, to the floating-point register RaH.

RaH = XT

Flags

This instruction does not modify any STF register flags.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required. Four alignment cycles are required after any copy from a standard 28x CPU register to a floating-point register. The four alignment cycles can be filled with any non-conflicting instructions except for the following: FRACF32, UI16TOF32, I16TOF32, F32TOUI32, and F32TOI32.

```
MOV32 ROH, XT ; Copy XT to ROH

NOP ; Wait 4 alignment cycles

NOP ; Do not use FRACF32, UI16TOF32

NOP ; I16TOF32, F32TOUI32 or F32TOI32

NOP ;

C-- ROH is valid

ADDF32 R2H,R1H,R0H ; Instruction can use ROH as a source
```

Example

```
MOVIZF32 R6H, #5.0 ; R6H = 5.0 (0x40A00000)

NOP ; 1 Alignment cycle

MOV32 XT, R6H ; XT = 5.0 (0x40A00000)

MOV32 R1H, XT ; R1H = 5.0 (0x40A00000)
```

See also

MOV32 RaH, ACC MOV32 RaH, P MOV32 RaH, XARn



MOV32 STF, mem32 Move 32-bit Value from Memory to the STF Register

Operands

STF floating-point unit status register
mem32 pointer to the 32-bit source memory location

Opcode LSW: 1110 0010 1000 0000 MSW: 0000 0000 mem32

Description Move from memory to the floating-point unit's status register STF.

STF = [mem32]

Flags This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	Yes						

Restoring status register will overwrite all flags.

Pipeline This is a single-cycle instruction.

Example 1 MOVW DP, #0x0300; DP = 0x0300

Example 2 MOV32 *SP++, STF ; Store STF in stack

MOVF32 R2H, #3.0 ; R2H = 3.0 (0x40400000) MOVF32 R3H, #5.0 ; R3H = 5.0 (0x40A00000)

CMPF32 R2H, R3H ; ZF = 0, NF = 1, STF = 0x000000004

MOV32 R3H, R2H, LT; R3H = 3.0 (0x40400000)MOV32 STF, *--SP; Restore STF from stack

See also MOV32 mem32, STF

MOVSTO FLAG



MOV32 XARn, RaH Move 32-bit Floating-Point Register Contents to XARn

Operands

XARn	28x auxiliary register (XAR0 - XAR7)
RaH	floating-point source register (R0H to R7H)

Opcode LSW: 1011 1111 loc32
MSW: IIII IIII IIII IIII

Description Move the 32-bit value from the floating-point register RaH to the auxiliary register XARn.

XARn = RaH

Flags No flags affected in floating-point unit.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required when copying a floating-point register to a C28x register. If the move follows a single cycle floating point instruction, a single alignment cycle must be added. For example:

MINF32 ROH,R1H ; Single-cycle instruction NOP ; 1 alignment cycle MOV32 @ACC,ROH ; Copy ROH to ACC NOP ; Any instruction

If the move follows a 2 pipeline-cycle floating point instruction, then two alignment cycles must be used. For example:

ADDF32 R2H, R1H, R0H; 2 pipeline instruction (2p)

NOP; 1 cycle delay for ADDF32 to complete
; <-- ADDF32 completes, R2H is valid

NOP; 1 alignment cycle
; copy R2H into ACC, takes 1 cycle
; <-- MOV32 completes, ACC is valid

NOP; Any instruction

Example MOVIZF32 ROH, #2.5; ROH = 2.5 = 0x40200000

F32TOUI32 ROH, ROH = 2.5 = 0x40200000

NOP ; Delay for conversion instruction ; <-- Conversion complete, ROH valid

See also MOV32 ACC, RaH

MOV32 P, RaH MOV32 XT, RaH



MOV32 XT, RaH

Move 32-bit Floating-Point Register Contents to XT

Operands

XT	temporary register
RaH	floating-point source register (R0H to R7H)

Opcode

LSW: 1011 1111 loc32 MSW: IIII IIII IIII IIII

Description

Move the 32-bit value in RaH to the temporary register XT.

XT = RaH

Flags

No flags affected in floating-point unit.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

While this is a single-cycle instruction, additional pipeline alignment is required when copying a floating-point register to a C28x register. If the move follows a single cycle floating point instruction, a single alignment cycle must be added. For example:

```
MINF32 ROH,R1H ; Single-cycle instruction NOP ; 1 alignment cycle MOV32 @XT,R0H ; Copy ROH to ACC NOP ; Any instruction
```

If the move follows a 2 pipeline-cycle floating point instruction, then two alignment cycles must be used. For example:

```
ADDF32 R2H, R1H, R0H
                     ; 2 pipeline instruction (2p)
NOP
                      ; 1 cycle delay for ADDF32 to complete
                      ; <-- ADDF32 completes, R2H is valid
NOP
                      ; 1 alignment cycle
MOV32 XT, R2H
                      ; copy R2H into ACC, takes 1 cycle
                      ; <-- MOV32 completes, ACC is valid
NOP
                      ; Any instruction
MOVIZF32 R0H, #2.5
                      ; R0H = 2.5 = 0x40200000
F32TOUI32 ROH, ROH
NOP
                      ; Delay for conversion instruction
                      ; <-- Conversion complete, ROH valid
NOP
                      ; Alignment cycle
MOV32
          XT, ROH
                      ; XT = 2 = 0x00000002
```

See also

Example

MOV32 ACC, RaH MOV32 P, RaH MOV32 XARn, RaH

MOVD32 RaH, mem32 Move 32-bit Value from Memory with Data Copy

Operands

RaH	floating-point register (R0H to R7H)
mem32	pointer to the 32-bit source memory location

Opcode LSW: 1110 0010 0010 0011 MSW: 0000 0aaa mem32

Description Move the 32-bit value referenced by mem32 to the floating-point register indicated by

RaH.

RaH = [mem32][mem32+2] = [mem32]

This instruction modifies the following flags in the STF register: **Flags**

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	No	No

```
NF = RaH[31];
ZF = 0;
if(RaH[30:23] == 0){ZF = 1; NF = 0;}
NI = RaH[31];
ZI = 0;
if(RaH[31:0] == 0) ZI = 1;
```

Pipeline This is a single-cycle instruction.

Example MOVW DP, #0x02C0; DP = 0x02C0

(2, #0x0000); [0x00B002] = 0x0000(3, #0x4110); [0x00B003] = 0x4110MOV MOV MOVD32 R7H, @2 ; R7H = 0x41100000,

; [0x00B004] = 0x0000, [0x00B005] = 0x4110

See also MOV32 RaH, mem32 {,CNDF}



MOVF32 RaH, #32F Load the 32-bits of a 32-bit Floating-Point Register

Operands

This instruction is an alias for MOVIZ and MOVXI instructions. The second operand is translated by the assembler such that the instruction becomes:

MOVIZ RaH, #16FHiHex MOVXI RaH, #16FLoHex

RaH	floating-point destination register (R0H to R7H)
#32F	immediate float value represented in floating-point representation

Opcode

```
LSW: 1110 1000 0000 0III (opcode of MOVIZ RaH, #16FHiHex)
MSW: IIII IIII IIII Iaaa

LSW: 1110 1000 0000 1III (opcode of MOVXI RaH, #16FLoHex)
MSW: IIII IIII IIII IIII Iaaa
```

Description

Note: This instruction accepts the immediate operand only in floating-point representation. To specify the immediate value as a hex value (IEEE 32-bit floating-point format) use the MOVI32 RaH, #32FHex instruction.

Load the 32-bits of RaH with the immediate float value represented by #32F.

#32F is a float value represented in floating-point representation. The assembler will only accept a float value represented in floating-point representation. That is, 3.0 can only be represented as #3.0. #0x40400000 will result in an error.

RaH = #32F

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

Depending on #32FH, this instruction takes one or two cycles. If all of the lower 16-bits of the IEEE 32-bit floating-point format of #32F are zeros, then the assembler will convert MOVF32 into only MOVIZ instruction. If the lower 16-bits of the IEEE 32-bit floating-point format of #32F are not zeros, then the assembler will convert MOVF32 into MOVIZ and MOVXI instructions.

Example

```
; R1H = 3.0 (0x40400000)
MOVF32
         R1H, #3.0
                        ; Assembler converts this instruction as
                        ; MOVIZ R1H, #0x4040
MOVF32
         R2H, #0.0
                        ; R2H = 0.0 (0x00000000)
                        ; Assembler converts this instruction as
                        ; MOVIZ R2H, #0x0
MOVF32
        R3H, #12.265
                        ; R3H = 12.625 (0x41443D71)
                        ; Assembler converts this instruction as
                        ; MOVIZ R3H, #0x4144
                        ; MOVXI R3H, #0x3D71
```

See also

MOVIZ RaH, #16FHiHex MOVXI RaH, #16FLoHex MOVI32 RaH, #32FHex MOVIZF32 RaH, #16FHi



MOVI32 RaH, #32FHex Load the 32-bits of a 32-bit Floating-Point Register with the immediate

Operands

This instruction is an alias for MOVIZ and MOVXI instructions. The second operand is translated by the assembler such that the instruction becomes:

MOVIZ RaH, #16FHiHex MOVXI RaH, #16FLoHex

MSW: IIII IIII IIII Iaaa

RaH	floating-point register (R0H to R7H)
#32FHex	A 32-bit immediate value that represents an IEEE 32-bit floating-point value.

Opcode

```
LSW: 1110 1000 0000 0III (opcode of MOVIZ RaH, #16FHiHex)
MSW: IIII IIII IIII Iaaa
LSW: 1110 1000 0000 1III (opcode of MOVXI RaH, #16FLoHex)
```

Description

Note: This instruction only accepts a hex value as the immediate operand. To specify the immediate value with a floating-point representation use the MOVF32 RaH, #32F instruction.

Load the 32-bits of RaH with the immediate 32-bit hex value represented by #32Fhex.

#32Fhex is a 32-bit immediate hex value that represents the IEEE 32-bit floating-point value of a floating-point number. The assembler will only accept a hex immediate value. That is, 3.0 can only be represented as #0x40400000. #3.0 will result in an error.

RaH = #32FHex

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

Depending on #32FHex, this instruction takes one or two cycles. If all of the lower 16-bits of #32FHex are zeros, then assembler will convert MOVI32 to the MOVIZ instruction. If the lower 16-bits of #32FHex are not zeros, then assembler will convert MOVI32 to a MOVIZ and a MOVXI instruction.

Example

```
; R1H = 0x40400000
MOVI32
         R1H, #0x40400000
                            ; Assembler converts this instruction as
                            ; MOVIZ R1H, #0x4040
                            ; R2H = 0x00000000
MOVI32
         R2H, #0x00000000
                            ; Assembler converts this instruction as
                            ; MOVIZ R2H, #0x0
MOVI32
         R3H, #0x40004001
                            ; R3H = 0x40004001
                            ; Assembler converts this instruction as
                            ; MOVIZ R3H, #0x4000
                            ; MOVXI R3H, #0x4001
MOVI32
         R4H, #0x00004040
                            ; R4H = 0x00004040
                            ; Assembler converts this instruction as
                             ; MOVIZ R4H, \#0\times0000
                             ; MOVXI R4H, #0x4040
```

See also

MOVIZ RaH, #16FHiHex MOVXI RaH, #16FLoHex MOVF32 RaH, #32F MOVIZF32 RaH, #16FHi



MOVIZ RaH, #16FHiHex Load the Upper 16-bits of a 32-bit Floating-Point Register

Operands

RaH	floating-point register (R0H to R7H)
#16FHiHex	A 16-bit immediate hex value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

LSW: 1110 1000 0000 0III MSW: IIII IIII IIII IIII Iaaa

Description

Note: This instruction only accepts a hex value as the immediate operand. To specify the immediate value with a floating-point representation use the MOVIZF32 pseudo instruction.

Load the upper 16-bits of RaH with the immediate value #16FHiHex and clear the low 16-bits of RaH.

#16FHiHex is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. The assembler will only accept a hex immediate value. That is, -1.5 can only be represented as #0xBFC0. #-1.5 will result in an error.

By itself, MOVIZ is useful for loading a floating-point register with a constant in which the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x4000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). If a constant requires all 32-bits of a floating-point register to be iniitalized, then use MOVIZ along with the MOVXI instruction.

RaH[31:16] = #16FHiHexRaH[15:0] = 0

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a single-cycle instruction.

Example

```
; Load ROH with -1.5 (0xBFC00000)

MOVIZ ROH, #0xBFC0 ; ROH = 0xBFC00000
```

; Load ROH with pi = 3.141593 (0x40490FDB)

MOVIZ ROH, #0x4049 ; ROH = 0x40490000 MOVXI ROH, #0x0FDB ; ROH = 0x40490FDB

See also

MOVIZF32 RaH, #16FHi MOVXI RaH, #16FLoHex



MOVIZF32 RaH, #16FHi Load the Upper 16-bits of a 32-bit Floating-Point Register

Operands

RaH	floating-point register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

```
LSW: 1110 1000 0000 0III MSW: IIII IIII IIII IIaaa
```

Description

Load the upper 16-bits of RaH with the value represented by #16FHi and clear the low 16-bits of RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. This addressing mode is most useful for constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). #16FHi can be specified in hex or float. That is, -1.5 can be represented as #-1.5 or #0xBFC0.

MOVIZF32 is an alias for the MOVIZ RaH, #16FHiHex instruction. In the case of MOVIZF32 the assembler will accept either a hex or float as the immediate value and encodes it into a MOVIZ instruction. For example, MOVIZF32 RaH, #-1.5 will be encoded as MOVIZ RaH. 0xBFC0.

```
RaH[31:16] = #16FHi

RaH[15:0] = 0
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline

This is a single-cycle instruction.

Example

```
; R0H = 3.0 = 0x40400000
; R1H = 1.0 = 0x3F800000
  MOVIZF32 R0H, #3.0
  MOVIZF32 R1H, #1.0
                             ; R2H = 2.5 = 0x40200000
  MOVIZF32 R2H, #2.5
  MOVIZF32 R3H, #-5.5
                             ; R3H = -5.5 = 0xC0B00000
  MOVIZF32 R4H, #0xC0B0
                             ; R4H = -5.5 = 0xC0B00000
Load R5H with pi = 3.141593 (0x40490000)
  MOVIZF32 R5H, \#3.141593; R5H = 3.140625 (0x40490000)
Load ROH with a more accurate pi = 3.141593 (0x40490FDB)
  MOVIZF32 R0H, #0x4049
                             ; R0H = 0x40490000
            R0H,#0x0FDB
                              ; ROH = 0x40490FDB
  MOVXI
```

See also

MOVIZ RaH, #16FHiHex MOVXI RaH, #16FLoHex



MOVSTO FLAG

Load Selected STF Flags into ST0

Operands

FLAG Selected flag

Opcode

LSW: 1010 1101 FFFF FFFF

Description

Load selected flags from the STF register into the ST0 register of the 28x CPU where FLAG is one or more of TF, CI, ZI, ZF, NI, NF, LUF or LVF. The specified flag maps to the ST0 register as follows:

- Set OV = 1 if LVF or LUF is set. Otherwise clear OV.
- Set N = 1 if NF or NI is set. Otherwise clear N.
- Set Z = 1 if ZF or ZI is set. Otherwise clear Z.
- Set C = 1 if TF is set. Otherwise clear C.
- Set TC = 1 if TF is set. Otherwise clear TF.

If any STF flag is not specified, then the corresponding ST0 register bit is not modified.

Restrictions

Do not use the MOVST0 instruction in the delay slots for pipelined operations. Doing so can yield invalid results. To avoid this, the proper number of NOPs or non-pipelined instructions must be inserted before the MOVST0 operation.

```
; The following is INVALID

MPYF32 R2H, R1H, R0H

MOVSTO TF

; INVALID, do not use MOVSTO in a delay slot

; The following is VALID

MPYF32 R2H, R1H, R0H

NOP

MOVSTO TF

; 2 pipeline-cycle instruction (2p)

; 1 delay cycle, R2H updated after this instruction
; VALID

; VALID
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

When the flags are moved to the C28x ST0 register, the LUF or LVF flags are automatically cleared if selected.

Pipeline

This is a single-cycle instruction.

Example

Program flow is controlled by C28x instructions that read status flags in the status register 0 (ST0). If a decision needs to be made based on a floating-point operation, the information in the STF register needs to be loaded into ST0 flags (Z,N,OV,TC,C) so that the appropriate branch conditional instruction can be executed. The MOVST0 FLAG instruction is used to load the current value of specified STF flags into the respective bits of ST0. When this instruction executes, it will also clear the latched overflow and underflow flags if those flags are specified.

```
Loop:

MOV32 R0H,*XAR4++

MOV32 R1H,*XAR3++

CMPF32 R1H, R0H

MOVST0 ZF, NF

BF Loop, GT ; Loop if (R1H > R0H)
```

See also

MOV32 mem32, STF MOV32 STF, mem32



MOVXI RaH, #16FLoHex Move Immediate to the Low 16-bits of a Floating-Point Register

Operands

Ra floating-point register (R0H to R7H)

#16FLoHex A 16-bit immediate hex value that represents the lower 16-bits of an IEEE 32-bit floating-point value. The upper 16-bits will not be modified.

Opcode LSW: 1110 1000 0000 1III MSW: IIII IIII IIII IIII Iaaa

Description Load the low 16-bits of RaH with the immediate value #16FLoHex. #16FLoHex

represents the lower 16-bits of an IEEE 32-bit floating-point value. The upper 16-bits of RaH will not be modified. MOVXI can be combined with the MOVIZ or MOVIZF32

instruction to initialize all 32-bits of a RaH register.

RaH[15:0] = #16FLoHex RaH[31:16] = Unchanged

Flags

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline This is a single-cycle instruction.

Example ; Load ROH with pi = 3.141593 (0x40490FDB)

MOVIZ R0H,#0x4049 ; R0H = 0x40490000 MOVXI R0H,#0x0FDB ; R0H = 0x40490FDB

See also MOVIZ RaH, #16FHiHex

MOVIZF32 RaH, #16FHi



MPYF32 RaH, RbH, RcH 32-bit Floating-Point Multiply

Operands

RaH	floating-point destination register (R0H to R7H)	
RbH	floating-point source register (R0H to R7H)	
RcH	floating-point source register (R0H to R7H)	

Opcode

LSW: 1110 0111 0000 0000 MSW: 0000 000c ccbb baaa

Description

Multiply the contents of two floating-point registers.

RaH = RbH * RcH

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
MPYF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- MPYF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example

Calculate Y = A * B:

```
MOVL XAR4, #A

MOV32 R0H, *XAR4 ; Load R0H with A

MOVL XAR4, # B

MOV32 R1H, *XAR4 ; Load R1H with B

MPYF32 R0H,R1H,R0H ; Multiply A * B

MOVL XAR4, #Y

; <--MPYF32 complete

MOV32 *XAR4,R0H ; Save the result
```

See also

MPYF32 RaH, #16FHi, RbH

```
MPYF32 RaH, RbH, RcH || ADDF32 RdH, ReH, RfH MPYF32 RdH, ReH, RfH || MOV32 RaH, mem32 MPYF32 RdH, ReH, RfH || MOV32 mem32, RaH MPYF32 RaH, RbH, RcH || SUBF32 RdH, ReH, RfH
```

MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32



MPYF32 RaH, #16FHi, RbH 32-bit Floating-Point Multiply

Operands

RaH	floating-point destination register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.
RcH	floating-point source register (R0H to R7H)

Opcode

```
LSW: 1110 1000 01II IIII MSW: IIII IIII IIbb baaa
```

Description

Multiply RbH with the floating-point value represented by the immediate operand. Store the result of the addition in RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. #16FHi is most useful for representing constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, the value -1.5 can be represented as #-1.5 or #0xBFC0.

```
RaH = RbH * #16FHi:0
```

This instruction can also be written as MPYF32 RaH, RbH, #16FHi.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
MPYF32 RaH, #16FHi, RbH; 2 pipeline cycles (2p)
NOP; 1 cycle delay or non-conflicting instruction
; <-- MPYF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example 1

```
MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MPYF32 R4H, #3.0, R3H ; R4H = 3.0 * R3H

MOVL XAR1, #0xB006 ; <-- Non conflicting instruction

; <-- MPYF32 complete, R4H = 6.0 (0x40C00000)

MOV32 *XAR1, R4H ; Save the result in memory location 0xB006

;Same as above example but #16FHi is represented in Hex

MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MPYF32 R4H, #0x4040, R3H ; R4H = 0x4040 * R3H
```

Example 2

```
MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MPYF32 R4H, #0x4040, R3H ; R4H = 0x4040 * R3H ; 3.0 is represented as 0x40400000 in ; IEEE 754 32-bit format

MOVL XAR1, #0xB006 ; <-- Non conflicting instruction ; <-- MPYF32 complete, R4H = 6.0 (0x40C00000)

MOV32 *XAR1, R4H ; Save the result in memory location 0xB006
```

See also

```
MPYF32 RaH, RbH, #16FHi
MPYF32 RaH, RbH, RcH
```

MPYF32 RaH, RbH, RcH | ADDF32 RdH, ReH, RfH



MPYF32 RaH, RbH, #16FHi 32-bit Floating-Point Multiply

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.

Opcode

```
LSW: 1110 1000 01II IIII MSW: IIII IIII IIbb baaa
```

Description

Multiply RbH with the floating-point value represented by the immediate operand. Store the result of the addition in RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. #16FHi is most useful for representing constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, the value -1.5 can be represented as #-1.5 or #0xBFC0.

```
RaH = RbH * #16FHi:0
```

This instruction can also be writen as MPYF32 RaH, #16FHi, RbH.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
MPYF32 RaH, RbH, #16FHi ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- MPYF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or use RaH as a source operand.

Example 1

```
MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MPYF32 R4H, R3H, #3.0 ; R4H = R3H * 3.0

MOVL XAR1, #0xB008 ; <-- Non conflicting instruction

; <-- MPYF32 complete, R4H = 6.0 (0x40C00000)

MOV32 *XAR1, R4H ; Save the result in memory location 0xB008

;Same as above example but #16FHi is represented in Hex

MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MDYF332 R3H, #2.0 ; R3H = 2.0 (0x40000000)
```

Example 2

```
MOVIZF32 R3H, #2.0 ; R3H = 2.0 (0x40000000)

MPYF32 R4H, R3H, #0x4040 ; R4H = R3H * 0x4040

; 3.0 is represented as 0x404000000 in

; IEEE 754 32-bit format

MOVL XAR1, #0xB008 ; <-- Non conflicting instruction

; <-- MPYF32 complete, R4H = 6.0 (0x40C00000)

MOV32 *XAR1, R4H ; Save the result in memory location 0xB008
```

See also

MPYF32 RaH, #16FHi, RbH MPYF32 RaH, RbH, RcH



Operands

RaH	floating-point destination register for MPYF32 (R0H to R7H) RaH cannot be the same register as RdH	
RbH	floating-point source register for MPYF32 (R0H to R7H)	
RcH	floating-point source register for MPYF32 (R0H to R7H)	
RdH	floating-point destination register for ADDF32 (R0H to R7H) RdH cannot be the same register as RaH	
ReH	floating-point source register for ADDF32 (R0H to R7H)	
RfH	floating-point source register for ADDF32 (R0H to R7H)	

Opcode

LSW: 1110 0111 0100 00ff MSW: feee dddc ccbb baaa

Description

Multiply the contents of two floating-point registers with parallel addition of two registers.

RaH = RbH * RcH RdH = ReH + RfH

This instruction can also be written as:

MACF32 RaH, RbH, RcH, RdH, ReH, RfH

Restrictions

The destination register for the MPYF32 and the ADDF32 must be unique. That is, RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 or ADDF32 generates an underflow condition.
- LVF = 1 if MPYF32 or ADDF32 generates an overflow condition.

Pipeline

Both MPYF32 and ADDF32 take 2 pipeline cycles (2p) That is:

```
MPYF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)

|| ADDF32 RdH, ReH, RfH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction
; <-- MPYF32, ADDF32 complete, RaH, RdH updated

NOP
```

Any instruction in the delay slot must not use RaH or RdH as a destination register or as a source operand.



```
Example
                         Perform 5 multiply and accumulate operations:
                          1st multiply: A = X0 * Y0
                          2nd multiply: B = X1 * Y1
                          3rd multiply: C = X2 * Y2
                          4th multiply: D = X3 * Y3
                         5th multiply: E = X3 * Y3
                         Result = A + B + C + D + E
                         MOV32 ROH, *XAR4++
                                                       ; R0H = X0
                          MOV32 R1H, *XAR5++
                                                        ; R1H = Y0
                                                        ; R2H = A = X0 * Y0
                                                       ; In parallel ROH = X1
                         MPYF32 R2H, R0H, R1H
                       || MOV32 R0H, *XAR4++
                          MOV32 R1H, *XAR5++
                                                       ; R1H = Y1
                                                        ; R3H = B = X1 * Y1
                                                        ; In parallel ROH = X2
                         MPYF32 R3H, R0H, R1H
                       || MOV32 R0H, *XAR4++
MOV32 R1H, *XAR5++
                                                        ; R1H = Y2
                                                       ; R3H = A + B
                                                        ; R2H = C = X2 * Y2
                          MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X3
                       || MOV32 R0H, *XAR4++
                          MOV32 R1H, *XAR5++
                                                       ; R1H = Y3
                                                        ; R3H = (A + B) + C
                                                        ; R2H = D = X3 * Y3
                         MACF32 R3H, R2H, R2H, R0H, R1H; In parallel R0H = X4
                         MOV32 ROH, *XAR4
                         MOV32 R1H, *XAR5
                                                       ; R1H = Y4
                                                        ; R2H = E = X4 * Y4
                         MPYF32 R2H, R0H, R1H
                                                        ; in parallel R3H = (A + B + C) + D
                       | ADDF32 R3H, R3H, R2H
                                                        ; Wait for MPYF32 || ADDF32 to complete
                          ADDF32 R3H, R3H, R2H
                                                        ; R3H = (A + B + C + D) + E
                                                        ; Wait for ADDF32 to complete
                          MOV32 @Result, R3H
                                                        ; Store the result
                      MACF32 R3H, R2H, RdH, ReH, RfH
See also
                      MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32
                      MACF32 R7H, R3H, mem32, *XAR7++
                      MACF32 R7H, R6H, RdH, ReH, RfH
                      MACF32 R7H, R6H, RdH, ReH, RfH || MOV32 RaH, mem32
```



MPYF32 RdH, ReH, RfH | MOV32 RaH, mem32 32-bit Floating-Point Multiply with Parallel Move

Operands

RdH	floating-point destination register for the MPYF32 (R0H to R7H) RdH cannot be the same register as RaH
ReH	floating-point source register for the MPYF32 (R0H to R7H)
RfH	floating-point source register for the MPYF32 (R0H to R7H)
RaH	floating-point destination register for the MOV32 (R0H to R7H) RaH cannot be the same register as RdH
mem32	pointer to a 32-bit memory location. This will be the source of the MOV32.

Opcode

```
LSW: 1110 0011 0000 fffe MSW: eedd daaa mem32
```

Description

Multiply the contents of two floating-point registers and load another.

```
RdH = ReH * RfH
RaH = [mem32]
```

Restrictions

The destination register for the MPYF32 and the MOV32 must be unique. That is, RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

The MOV32 Instruction will set the NF, ZF, NI and ZI flags as follows:

```
NF = RaH(31);
ZF = 0;
if(RaH(30:23) == 0) { ZF = 1; NF = 0; }
NI = RaH(31);
ZI = 0;
if(RaH(31:0) == 0) ZI = 1;
```

Pipeline

MPYF32 takes 2 pipeline-cycles (2p) and MOV32 takes a single cycle. That is:

Any instruction in the delay slot must not use RdH as a destination register or as a source operand.



Example

Calculate Y = M1*X1 + B1. This example assumes that M1, X1, B1 and Y1 are all on the same data page.

```
MOVW
          DP, #M1
                         ; Load the data page
  MOV32
          ROH, @M1
                        ; Load ROH with M1
                        ; Load R1H with X1
  MOV32
          R1H, @X1
  MPYF32 R1H,R1H,R0H
                        ; Multiply M1*X1
                               and in parallel load ROH with B1
| MOV32
          ROH, @B1
                         ; <-- MOV32 complete
  NOP
                         ; Wait 1 cycle for MPYF32 to complete
                         ; <-- MPYF32 complete
  ADDF32 R1H,R1H,R0H
                        ; Add M*X1 to B1 and store in R1H
                        ; Wait 1 cycle for ADDF32 to complete
  NOP
                         ; <-- ADDF32 complete
  MOV32
          @Y1,R1H
                         ; Store the result
Calculate Y = (A * B) * C:
  MOVL
          XAR4, #A
         ROH, *XAR4
  MOV32
                         ; Load ROH with A
  MOVL
          XAR4, #B
         R1H, *XAR4
  MOV32
                       ; Load R1H with B
  MOVL
          XAR4, #C
                        ; Calculate R1H = A * B
  MPYF32 R1H,R1H,R0H
                              and in parallel load R2H with C
| MOV32 R0H, *XAR4
                        ; <-- MOV32 complete
  MOVL
         XAR4, #Y
                        ; <-- MPYF32 complete
                        ; Calculate Y = (A * B) * C
  MPYF32 R2H,R1H,R0H
                        ; Wait 1 cycle for MPYF32 to complete
  NOP
                        ; MPYF32 complete
  MOV32 *XAR4,R2H
MPYF32 RdH, ReH, RfH | MOV32 mem32, RaH
MACF32 R3H, R2H, RdH, ReH, RfH | MOV32 RaH, mem32
MACF32 R7H, R6H, RdH, ReH, RfH | MOV32 RaH, mem32
```

See also

MACF32 R7H, R3H, mem32, *XAR7++



MPYF32 RdH, ReH, RfH

MOV32 mem32, RaH 32-bit Floating-Point Multiply with Parallel Move

Operands

RdH	floating-point destination register for the MPYF32 (R0H to R7H)
ReH	floating-point source register for the MPYF32 (R0H to R7H)
RfH	floating-point source register for the MPYF32 (R0H to R7H)
mem32	pointer to a 32-bit memory location. This will be the destination of the MOV32.
RaH	floating-point source register for the MOV32 (R0H to R7H)

Opcode

```
LSW: 1110 0000 0000 fffe MSW: eedd daaa mem32
```

Description

Multiply the contents of two floating-point registers and move from memory to register.

```
RdH = ReH * RfH,
[mem32] = RaH
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

MPYF32 takes 2 pipeline-cycles (2p) and MOV32 takes a single cycle. That is:

Any instruction in the delay slot must not use RdH as a destination register or as a source operand.

Example

```
MOVT
             XAR1, #0xC003
                            ; XAR1 = 0xC003
                             ; R3H = 2.0 (0x40000000)
  MOVIZF32 R3H, #2.0
  MPYF32
            R3H, R3H, \#5.0; R3H = R3H * 5.0
                             ; R1H = 5.0 (0x40A00000)
  MOVIZF32 R1H, #5.0
                             ; \leftarrow-- MPYF32 complete, R3H = 10.0 (0x41200000)
             R3H, R1H, R3H
                            ; R3H = R1H * R3H
  MPYF32
| MOV32
             *XAR1, R3H
                             ; and in parallel store previous R3 value
                             ; MOV32 complete, [0xC003] = 0x4120,
                                                [0xC002] = 0x0000
                             ; 1 cycle delay for MPYF32 to complete
                              ; \leftarrow-- MPYF32 , R3H = 50.0 (0x42480000)
```

See also

```
MPYF32 RdH, ReH, RfH || MOV32 RaH, mem32
MACF32 R3H, R2H, RdH, ReH, RfH || MOV32 RaH, mem32
MACF32 R7H, R6H, RdH, ReH, RfH || MOV32 RaH, mem32
MACF32 R7H, R3H, mem32, *XAR7++
```



MPYF32 RaH, RbH, RcH | SUBF32 RdH, ReH, RfH | 32-bit Floating-Point Multiply with Parallel Subtract

Operands

RaH	floating-point destination register for MPYF32 (R0H to R7H) RaH cannot be the same register as RdH	
RbH	floating-point source register for MPYF32 (R0H to R7H)	
RcH	floating-point source register for MPYF32 (R0H to R7H)	
RdH	floating-point destination register for SUBF32 (R0H to R7H) RdH cannot be the same register as RaH	
ReH	floating-point source register for SUBF32 (R0H to R7H)	
RfH	floating-point source register for SUBF32 (R0H to R7H)	

Opcode

```
LSW: 1110 0111 0101 00ff MSW: feee dddc ccbb baaa
```

Description

Multiply the contents of two floating-point registers with parallel subtraction of two registers.

```
RaH = RbH * RcH,
RdH = ReH - RfH
```

Restrictions

The destination register for the MPYF32 and the SUBF32 must be unique. That is, RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:.

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 or SUBF32 generates an underflow condition.
- LVF = 1 if MPYF32 or SUBF32 generates an overflow condition.

Pipeline

MPYF32 and SUBF32 both take 2 pipeline-cycles (2p). That is:

```
MPYF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)

|| SUBF32 RdH, ReH, RfH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction
; <-- MPYF32, SUBF32 complete. RaH, RdH updated

NOP
```

Any instruction in the delay slot must not use RaH or RdH as a destination register or as a source operand.

Example

```
MOVIZF32 R4H, #5.0 ; R4H = 5.0 (0x40A00000)

MOVIZF32 R5H, #3.0 ; R5H = 3.0 (0x40400000)

MPYF32 R6H, R4H, R5H ; R6H = R4H * R5H

| SUBF32 R7H, R4H, R5H ; R7H = R4H - R5H

NOP ; 1 cycle delay for MPYF32 | SUBF32 to complete

; <-- MPYF32 | SUBF32 complete,

; R6H = 15.0 (0x41700000), R7H = 2.0 (0x40000000)
```

See also

```
SUBF32 RaH, RbH, RcH
SUBF32 RdH, ReH, RfH || MOV32 RaH, mem32
SUBF32 RdH, ReH, RfH || MOV32 mem32, RaH
```



NEGF32 RaH, RbH{, CNDF} Conditional Negation

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)
CNDF	condition tested

Opcode

LSW: 1110 0110 1010 CNDF MSW: 0000 0000 00bb baaa

Description

```
if (CNDF == true) {RaH = - RbH }
else {RaH = RbH }
```

CNDF is one of the following conditions:

Encode (1)	CNDF	Description	STF Flags Tested
0000	NEQ	Not equal to zero	ZF == 0
0001	EQ	Equal to zero	ZF == 1
0010	GT	Greater than zero	ZF == 0 AND NF == 0
0011	GEQ	Greater than or equal to zero	NF == 0
0100	LT	Less than zero	NF == 1
0101	LEQ	Less than or equal to zero	ZF == 1 AND NF == 1
1010	TF	Test flag set	TF == 1
1011	NTF	Test flag not set	TF == 0
1100	LU	Latched underflow	LUF == 1
1101	LV	Latched overflow	LVF == 1
1110	UNC	Unconditional	None
1111	UNCF (2)	Unconditional with flag modification	None

⁽¹⁾ Values not shown are reserved.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	Yes	Yes	No	No	

Pipeline

This is a single-cycle instruction.

Example

```
MOVIZF32
             ROH, #5.0
                         ; ROH = 5.0 (0x40A00000)
                          ; R1H = 4.0 (0x40800000)
MOVIZF32
             R1H, #4.0
             R2H, #-1.5
                           ; R2H = -1.5 (0xBFC00000)
MOVIZF32
             R4H, R1H, R2H; R4H = -6.0
MPYF32
MPYF32
             R5H, R0H, R1H; R5H = 20.0
                           ; <-- R4H valid
             R4H, #0.0
CMPF32
                           ; NF = 1
                           ; <-- R5H valid
NEGF32
             R4H, R4H, LT ; if NF = 1, R4H = 6.0
CMPF32
             R5H, #0.0
                          ; NF = 0
             R5H, R5H, GEQ; if NF = 0, R4H = -20.0
NEGF32
```

See also

ABSF32 RaH, RbH

This is the default operation if no CNDF field is specified. This condition will allow the ZF, NF, ZI, and NI flags to be modified when a conditional operation is executed. All other conditions will not modify these flags.



POP RB

Pop the RB Register from the Stack

Operands

RB	repeat block register	
IND	repeat block register	

Opcode

LSW: 1111 1111 1111 0001

Description

Restore the RB register from stack. If a high-priority interrupt contains a RPTB instruction, then the RB register must be stored on the stack before the RPTB block and restored after the RTPB block. In a low-priority interrupt RB must always be saved and restored. This save and restore must occur when interrupts are disabled.

Flags

This instruction does not affect any flags floating-point Unit:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a single-cycle instruction.

Example

A high priority interrupt is defined as an interrupt that cannot itself be interrupted. In a high priority interrupt, the RB register must be saved if a RPTB block is used within the interrupt. If the interrupt service routine does not include a RPTB block, then you do not have to save the RB register.

A low-priority interrupt is defined as an interrupt that allows itself to be interrupted. The RB register must always be saved and restored in a low-priority interrupt. The RB register must stored before interrupts are enabled. Likewise before restoring the RB register interrupts must first be disabled.

```
; Repeat Block within a Low-Priority Interrupt (Interruptible)
_Interrupt:
                           ; RAS = RA, RA = 0
       PUSH RB
                           ; Always save RB register
       CLRC INTM
                           ; Enable interrupts only after saving RB
                           ; ISR may or may not include a RPTB block
       . . .
       SETC INTM
                           ; Disable interrupts before restoring RB
       POP
                           ; Always restore RB register
       IRET
                           ; RA = RAS, RAS = 0
PUSH RB
```

See also

RPTB #RSIZE, RC RPTB #RSIZE, loc16



PUSH RB

Push the RB Register onto the Stack

Operands

DD	repeat block register
RB	repeat block register

Opcode

LSW: 1111 1111 1111 0000

Description

Save the RB register on the stack. If a high-priority interrupt contains a RPTB instruction, then the RB register must be stored on the stack before the RPTB block and restored after the RTPB block. In a low-priority interrupt RB must always be saved and restored. This save and restore must occur when interrupts are disabled.

Flags

This instruction does not affect any flags floating-point Unit:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a single-cycle instruction for the first iteration, and zero cycles thereafter.

Example

A high priority interrupt is defined as an interrupt that cannot itself be interrupted. In a high priority interrupt, the RB register must be saved if a RPTB block is used within the interrupt. If the interrupt service routine does not include a RPTB block, then you do not have to save the RB register.

A low-priority interrupt is defined as an interrupt that allows itself to be interrupted. The RB register must always be saved and restored in a low-priority interrupt. The RB register must stored before interrupts are enabled. Likewise before restoring the RB register interrupts must first be disabled.

```
; Repeat Block within a Low-Priority Interrupt (Interruptible)
                           ; RAS = RA, RA = 0
Interrupt:
       PUSH RB
                            ; Always save RB register
       . . .
       CLRC INTM
                            ; Enable interrupts only after saving RB
       . . .
                            ; ISR may or may not include a RPTB block
       . . .
       SETC INTM
                            ; Disable interrupts before restoring RB
      POP RB
                            ; Always restore RB register
       IRET
                            ; RA = RAS, RAS = 0
```

See also

POP RB RPTB #RSIZE, RC RPTB #RSIZE, loc16



RESTORE

Restore the Floating-Point Registers

Operands

none This instruction does not have any operands

Opcode

LSW: 1110 0101 0110 0010

Description

Restore the floating-point register set (R0H - R7H and STF) from their shadow registers. The SAVE and RESTORE instructions should be used in high-priority interrupts. That is interrupts that cannot themselves be interrupted. In low-priority interrupt routines the floating-point registers should be pushed onto the stack.

Restrictions

The RESTORE instruction cannot be used in any delay slots for pipelined operations. Doing so will yield invalid results. To avoid this, the proper number of NOPs or non-pipelined instructions must be inserted before the RESTORE operation.

```
; The following is INVALID

MPYF32 R2H, R1H, R0H

RESTORE

; 2 pipeline-cycle instruction (2p)
; INVALID, do not use RESTORE in a delay slot

; The following is VALID

MPYF32 R2H, R1H, R0H

NOP

RESTORE

; 2 pipeline-cycle instruction (2p)
; 1 delay cycle, R2H updated after this instruction
; VALID
```

Flags

Restoring the status register will overwrite all flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	Yes							

Pipeline

This is a single-cycle instruction.



Example

The following example shows a complete context save and restore for a high-priority interrupt. Note that the CPU automatically stores the following registers: ACC, P, XT, ST0, ST1, IER, DP, AR0, AR1 and PC. If an interrupt is low priority (that is it can be interrupted), then push the floating point registers onto the stack instead of using the SAVE and RESTORE operations.

```
; Interrupt Save
_HighestPriorityISR:
                        ; Uninterruptable
   ASP
                        ; Align stack
                        ; Save RB register if used in the ISR
   PUSH
         RB
  PUSH
        AR1H:AR0H
                           ; Save other registers if used
   PUSH
        XAR2
   PUSH
         XAR3
   PUSH
         XAR4
   PUSH
        XAR5
   PUSH
        XAR6
   PUSH
         XAR7
   PUSH
        ΧТ
   SPM
         0
                        ; Set default C28 modes
   CLRC
         AMODE
         PAGE0,OVM
   CLRC
                        ; Save all FPU registers
   SAVE
        RNDF32=1
                        ; set default FPU modes
; Interrupt Restore
  RESTORE
                        ; Restore all FPU registers
   POP
                        ; restore other registers
   POP
         XAR7
   POP
         XAR6
   POP
         XAR5
   POP
         XAR4
   POP
         XAR3
   POP
         XAR2
   POP
         AR1H:AR0H
                        ; restore RB register
   POP
         RB
   NASP
                        ; un-align stack
   IRET
                        ; return from interrupt
```

See also

SAVE FLAG, VALUE



RPTB label, loc16 Repeat A Block of Code

Operands

label	This label is used by the assembler to determine the end of the repeat block and to calculate RSIZE. This label should be placed immediately after the last instruction included in the repeat block.
loc16	16-bit location for the repeat count value.

Opcode

LSW: 1011 0101 0bbb bbbb MSW: 0000 0000 loc16

Description

Initialize repeat block loop, repeat count from [loc16]

Restrictions

- The maximum block size is ≤127 16-bit words.
- An even aligned block must be ≥ 9 16-bit words.
- An odd aligned block must be ≥ 8 16-bit words.
- Interrupts must be disabled when saving or restoring the RB register.
- Repeat blocks cannot be nested.
- Any discontinuity type operation is not allowed inside a repeat block. This includes all call, branch or TRAP instructions. Interrupts are allowed.
- Conditional execution operations are allowed.

Flags

This instruction does not affect any flags in the floating-point unit:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This instruction takes four cycles on the first iteration and zero cycles thereafter. No special pipeline alignment is required.

Example

The minimum size for the repeat block is 8 words if the block is even aligned and 9 words if the block is odd aligned. If you have a block of 8 words, as in the following example, you can make sure the block is odd aligned by proceeding it by a .align 2 directive and a NOP instruction. The .align 2 directive will make sure the NOP is even aligned. Since a NOP is a 16-bit instruction the RPTB will be odd aligned. For blocks of 9 or more words, this is not required.

```
; Repeat Block of 8 Words (Interruptible)
 find the largest element and put its address in XAR6
  .align 2
   NOP
   RPTB
           VECTOR_MAX_END, AR7
                                     ; Execute the block AR7+1 times
   MOVL
           ACC, XAR0
   MOV32
           R1H, *XAR0++
                                     ; min size = 8, 9 words
   MAXF32
           ROH, R1H
                                     ; max size = 127 words
   MOVST0
           NF,ZF
   MOVL
           XAR6, ACC, LT
                                     ; label indicates the end
VECTOR_MAX_END:
                                     ; RA is cleared
```

When an interrupt is taken the repeat active (RA) bit in the RB register is automatically copied to the repeat active shadow (RAS) bit. When the interrupt exits, the RAS bit is automatically copied back to the RA bit. This allows the hardware to keep track if a repeat loop was active whenever an interrupt is taken and restore that state automatically.

A high priority interrupt is defined as an interrupt that cannot itself be interrupted. In a high priority interrupt, the RB register must be saved if a RPTB block is used within the interrupt. If the interrupt service routine does not include a RPTB block, then you do not



have to save the RB register.

A low-priority interrupt is defined as an interrupt that allows itself to be interrupted. The RB register must always be saved and restored in a low-priority interrupt. The RB register must stored before interrupts are enabled. Likewise before restoring the RB register interrupts must first be disabled.

```
; Repeat Block within a Low-Priority Interrupt (Interruptible)
; Interrupt:
                            ; RAS = RA, RA = 0
       PUSH RB
                            ; Always save RB register
       CLRC INTM
                            ; Enable interrupts only after saving RB
       . . .
       . . .
                            ; ISR may or may not include a RPTB block
       . . .
       . . .
       . . .
       SETC INTM
                            ; Disable interrupts before restoring RB
       POP RB
                            ; Always restore RB register
                            ; RA = RAS, RAS = 0
       IRET
```

See also

POP RB PUSH RB RPTB label, RC



RPTB	label	. #RC
-------------	-------	-------

Repeat a Block of Code

Operands

label	This label is used by the assembler to determine the end of the repeat block and to calculate RSIZE. This label should be placed immediately after the last instruction included in the repeat block.
#RC	16-bit immediate value for the repeat count.

Opcode

```
LSW: 1011 0101 1bbb bbbb MSW: cccc cccc cccc
```

Description

Repeat a block of code. The repeat count is specified as a immediate value.

Restrictions

- The maximum block size is ≤127 16-bit words.
- An even aligned block must be ≥ 9 16-bit words.
- An odd aligned block must be ≥ 8 16-bit words.
- Interrupts must be disabled when saving or restoring the RB register.
- Repeat blocks cannot be nested.
- Any discontinuity type operation is not allowed inside a repeat block. This includes all call, branch or TRAP instructions. Interrupts are allowed.
- Conditional execution operations are allowed.

Flags

This instruction does not affect any flags int the floating-point unit:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

Pipeline

This instruction takes one cycle on the first iteration and zero cycles thereafter. No special pipeline alignment is required.

Example

The minimum size for the repeat block is 8 words if the block is even aligned and 9 words if the block is odd aligned. If you have a block of 8 words, as in the following example, you can make sure the block is odd aligned by proceeding it by a .align 2 directive and a NOP instruction. The .align 2 directive will make sure the NOP is even aligned. Since a NOP is a 16-bit instruction the RPTB will be odd aligned. For blocks of 9 or more words, this is not required.

```
; Repeat Block (Interruptible)
 find the largest element and put its address in XAR6
  .align 2
   NOP
   RPTB
           VECTOR_MAX_END, #(4-1)
                                   ; Execute the block 4 times
   MOVL
           ACC, XAR0
   MOV32
           R1H, *XAR0++
                                     ; 8 or 9 words ≤ block size ≤ 127 words
   MAXF32
           ROH, R1H
   MOVST0
           NF,ZF
   MOVL
           XAR6, ACC, LT
                                     ; RE indicates the end address
VECTOR MAX END:
                                     ; RA is cleared
```

When an interrupt is taken the repeat active (RA) bit in the RB register is automatically copied to the repeat active shadow (RAS) bit. When the interrupt exits, the RAS bit is automatically copied back to the RA bit. This allows the hardware to keep track if a repeat loop was active whenever an interrupt is taken and restore that state automatically.

A high priority interrupt is defined as an interrupt that cannot itself be interrupted. In a high priority interrupt, the RB register must be saved if a RPTB block is used within the interrupt. If the interrupt service routine does not include a RPTB block, then you do not



have to save the RB register.

A low-priority interrupt is defined as an interrupt that allows itself to be interrupted. The RB register must always be saved and restored in a low-priority interrupt. The RB register must stored before interrupts are enabled. Likewise before restoring the RB register interrupts must first be disabled.

```
; Repeat Block within a Low-Priority Interrupt (Interruptible)
; Interrupt:
                            ; RAS = RA, RA = 0
       PUSH RB
                            ; Always save RB register
       CLRC INTM
                            ; Enable interrupts only after saving RB
       . . .
       . . .
                            ; ISR may or may not include a RPTB block
       . . .
       . . .
       . . .
       SETC INTM
                            ; Disable interrupts before restoring RB
       POP RB
                            ; Always restore RB register
                            ; RA = RAS, RAS = 0
       IRET
```

See also

POP RB PUSH RB RPTB #RSIZE, loc16



SAVE FLAG, VALUE Save Register Set to Shadow Registers and Execute SETFLG

Operands

FLAG	11 bit mask indicating which floating-point status flags to change.
VALUE	11 bit mask indicating the flag value; 0 or 1.

Opcode

```
LSW: 1110 0110 01FF FFFF MSW: FFFF FVVV VVVV VVVV
```

Description

This operation copies the current working floating-point register set (R0H to R7H and STF) to the shadow register set and combines the SETFLG FLAG, VALUE operation in a single cycle. The status register is copied to the shadow register before the flag values are changed. The STF[SHDWM] flag is set to 1 when the SAVE command has been executed. The SAVE and RESTORE instructions should be used in high-priority interrupts. That is interrupts that cannot themselves be interrupted. In low-priority interrupt routines the floating-point registers should be pushed onto the stack.

Restrictions

Do not use the SAVE instruction in the delay slots for pipelined operations. Doing so can yield invalid results. To avoid this, the proper number of NOPs or non-pipelined instructions must be inserted before the SAVE operation.

```
; The following is INVALID

MPYF32 R2H, R1H, R0H

SAVE RNDF32=1; 2 pipeline-cycle instruction (2p)

; INVALID, do not use SAVE in a delay slot

; The following is VALID

MPYF32 R2H, R1H, R0H

NOP

SAVE RNDF32=1; 2 pipeline-cycle instruction (2p)

; 1 delay cycle, R2H updated after this instruction
; VALID

; VALID
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	Yes							

Any flag can be modified by this instruction.

Pipeline

This is a single-cycle instruction.

Example

To make it easier and more legible, the assembler will accept a FLAG=VALUE syntax for the STFLG operation as shown below:

```
SAVE RNDF32=0, TF=1, ZF=0; FLAG = 01001000100, VALUE = X0XX0XXX1XX

MOVST0 TF, ZF, LUF; Copy the indicated flags to ST0; Note: X means this flag will not be modified.; The assembler will set these X values to 0.
```

The following example shows a complete context save and restore for a high priority interrupt. Note that the CPU automatically stores the following registers: ACC, P, XT, ST0, ST1, IER, DP, AR0, AR1 and PC.



```
_HighestPriorityISR:
  ĀSP
                        ; Align stack
  PUSH RB
                        ; Save RB register if used in the ISR
   PUSH
        AR1H:AR0H
                           ; Save other registers if used
  PUSH
        XAR2
  PUSH
        XAR3
  PUSH
        XAR4
  PUSH
        XAR5
  PUSH
        XAR6
  PUSH
        XAR7
  PUSH
        XT
  SPM
                        ; Set default C28 modes
         0
  CLRC
        AMODE
  CLRC
        PAGE0, OVM
                        ; Save all FPU registers
  SAVE
        RNDF32=0
                        ; set default FPU modes
   ...
   ...
   . . .
   . . .
                        ; Restore all FPU registers
  RESTORE
  POP
                        ; restore other registers
  POP
        XAR7
  POP
        XAR6
  POP
        XAR5
  POP
        XAR4
  POP
        XAR3
  POP
        XAR2
  POP
        AR1H:AR0H
                        ; restore RB register
  POP
        RB
                        ; un-align stack
  NASP
   IRET
                        ; return from interrupt
```

See also

RESTORE

SETFLG FLAG, VALUE



SETFLG FLAG, VALUE Set or clear selected floating-point status flags

Operands

FLAG	11 bit mask indicating which floating-point status flags to change.
VALUE	11 bit mask indicating the flag value; 0 or 1.

Opcode

LSW: 1110 0110 00FF FFFF MSW: FFFF FVVV VVVV VVVV

Description

The SETFLG instruction is used to set or clear selected floating-point status flags in the STF register. The FLAG field is an 11-bit value that indicates which flags will be changed. That is, if a FLAG bit is set to 1 it indicates that flag will be changed; all other flags will not be modified. The bit mapping of the FLAG field is shown below:

8 7 6 5 4 3 2 1 0

10	9	8	7	6	5	4	3	2	1	0
reserved	RNDF32	reserved	reserved	TF	ZI	NI	ZF	NF	LUF	LVF

The VALUE field indicates the value the flag should be set to; 0 or 1.

Restrictions

Do not use the SETFLG instruction in the delay slots for pipelined operations. Doing so can yield invalid results. To avoid this, the proper number of NOPs or non-pipelined instructions must be inserted before the SETFLG operation.

```
; The following is INVALID
MPYF32 R2H, R1H, R0H; 2 pipeline-cycle instruction (2p)
SETFLG RNDF32=1; INVALID, do not use SETFLG in a delay slot
```

```
; The following is VALID
```

MPYF32 R2H, R1H, R0H ; 2 pipeline-cycle instruction (2p)

NOP ; 1 delay cycle, R2H updated after this instruction

SETFLG RNDF32=1 ; VALID

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	Yes							

Any flag can be modified by this instruction.

Pipeline

This is a single-cycle instruction.

Example

To make it easier and legible, the assembler will accept a FLAG=VALUE syntax for the STFLG operation as shown below:

```
SETFLG RNDF32=0, TF=1, ZF=0; FLAG = 01001001000, VALUE = X0XX1XX0XXX MOVSTO TF, ZF, LUF; Copy the indicated flags to STO; X means this flag is not modified.; The assembler will set X values to 0
```

See also

SAVE FLAG, VALUE



SUBF32 RaH, RbH, RcH 32-bit Floating-Point Subtraction

Operands

RaH	floating-point destination register (R0H to R1)
RbH	floating-point source register (R0H to R1)
RcH	floating-point source register (R0H to R1)

Opcode

LSW: 1110 0111 0010 0000 MSW: 0000 000c ccbb baaa

Description

Subtract the contents of two floating-point registers

RaH = RbH - RcH

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- · LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
SUBF32 RaH, RbH, RcH ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- SUBF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example

Calculate Y - A + B - C:

```
MOVL
         XAR4, #A
  MOV32
         ROH, *XAR4
                        ; Load ROH with A
  MOVL
         XAR4, #B
  MOV32
         R1H, *XAR4
                        ; Load R1H with B
  MOVL
         XAR4, #C
  ADDF32 R0H,R1H,R0H
                        ; Add A + B and in parallel
| MOV32
         R2H,*XAR4
                        ; Load R2H with C
                        ; <-- MOV32 complete
  MOVL
         XAR4,#_xt
                        ; <-- ADDF32 complete
  SUBF32 ROH, ROH, R2H
                        ; Subtract C from (A + B)
                        ; <-- SUBF32 completes
  MOV32 *XAR4,R0H
                        ; Store the result
```

See also

SUBF32 RaH, #16FHi, RbH

SUBF32 RdH, ReH, RfH || MOV32 RaH, mem32 SUBF32 RdH, ReH, RfH || MOV32 mem32, RaH MPYF32 RaH, RbH, RcH || SUBF32 RdH, ReH, RfH



SUBF32 RaH, #16FHi, RbH 32-bit Floating Point Subtraction

Operands

RaH	floating-point destination register (R0H to R1)
#16FHi	A 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0.
RbH	floating-point source register (R0H to R1)

Opcode

```
LSW: 1110 1000 11II IIII MSW: IIII IIII IIIbb baaa
```

Description

Subtract RbH from the floating-point value represented by the immediate operand. Store the result of the addition in RaH.

#16FHi is a 16-bit immediate value that represents the upper 16-bits of an IEEE 32-bit floating-point value. The low 16-bits of the mantissa are assumed to be all 0. #16FHi is most useful for representing constants where the lowest 16-bits of the mantissa are 0. Some examples are 2.0 (0x40000000), 4.0 (0x40800000), 0.5 (0x3F000000), and -1.5 (0xBFC00000). The assembler will accept either a hex or float as the immediate value. That is, the value -1.5 can be represented as #-1.5 or #0xBFC0.

RaH = #16FHi:0 - RbH

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if MPYF32 generates an underflow condition.
- LVF = 1 if MPYF32 generates an overflow condition.

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
SUBF32 RaH, #16FHi, RbH; 2 pipeline cycles (2p)
NOP; 1 cycle delay or non-conflicting instruction; <-- SUBF32 completes, RaH updated
NOP
```

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example

Calculate Y = 2.0 - (A + B):

```
MOVL
       XAR4, #A
MOV32
      ROH,
            *XAR4
                     ; Load ROH with A
      XAR4, #B
MOV32 R1H, *XAR4
                     ; Load R1H with B
ADDF32 ROH, R1H, R0H
                     ; Add A + B and in parallel
                     ; <-- ADDF32 complete
SUBF32 ROH, #2.0, R2H; Subtract (A + B) from 2.0
NOP
                     ; <-- SUBF32 completes
MOV32 *XAR4,R0H
                     ; Store the result
```

See also

SUBF32 RaH, RbH, RcH SUBF32 RdH, ReH, RfH || MOV32 RaH, mem32 SUBF32 RdH, ReH, RfH || MOV32 mem32, RaH MPYF32 RaH, RbH, RcH || SUBF32 RdH, ReH, RfH



SUBF32 RdH, ReH, RfH ||MOV32 RaH, mem32 32-bit Floating-Point Subtraction with Parallel Move

Operands

RdH	floating-point destination register (R0H to R7H) for the SUBF32 operation RdH cannot be the same register as RaH
ReH	floating-point source register (R0H to R7H) for the SUBF32 operation
RfH	floating-point source register (R0H to R7H) for the SUBF32 operation
RaH	floating-point destination register (R0H to R7H) for the MOV32 operation RaH cannot be the same register as RdH
mem32	pointer to 32-bit source memory location for the MOV32 operation

Opcode

```
LSW: 1110 0011 0010 fffe MSW: eedd daaa mem32
```

Description

Subtract the contents of two floating-point registers and move from memory to a floating-point register.

```
RdH = ReH - RfH,
RaH = [mem32]
```

Restrictions

The destination register for the SUBF32 and the MOV32 must be unique. That is, RaH cannot be the same register as RdH.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	Yes	Yes	Yes	Yes	Yes	Yes

The STF register flags are modified as follows:

- LUF = 1 if SUBF32 generates an underflow condition.
- LVF = 1 if SUBF32 generates an overflow condition.

The MOV32 Instruction will set the NF, ZF, NI and ZI flags as follows:

```
NF = RaH(31);
ZF = 0;
if(RaH(30:23) == 0) { ZF = 1; NF = 0; }
NI = RaH(31);
ZI = 0;
if(RaH(31:0) == 0) ZI = 1;
```

Pipeline

SUBF32 is a 2 pipeline-cycle instruction (2p) and MOV32 takes a single cycle. That is:

Any instruction in the delay slot must not use RdH as a destination register or as a source operand.



Example	MOVL XAR1, #0xC000; XAR1 = 0xC000 SUBF32 R0H, R1H, R2H; (A) R0H = R1H - R2H MOV32 R3H, *XAR1; ; < R3H valid MOV32 R4H, *+XAR1[2]; ; < (A) completes, R0H valid, R4H valid ADDF32 R5H, R4H, R3H; (B) R5H = R4H + R3H MOV32 *+XAR1[4], R0H; ; < R0H stored MOVL XAR2, #0xE000; ; < (B) completes, R5H valid MOV32 *XAR2, R5H; ; < R5H stored
See also	SUBF32 RaH, RbH, RcH SUBF32 RaH, #16FHi, RbH MPYF32 RaH, RbH, RcH SUBF32 RdH, ReH, RfH



SUBF32 RdH, ReH, RfH

MOV32 mem32, RaH 32-bit Floating-Point Subtraction with Parallel Move

Operands

RdH	floating-point destination register (R0H to R7H) for the SUBF32 operation
ReH	floating-point source register (R0H to R7H) for the SUBF32 operation
RfH	floating-point source register (R0H to R7H) for the SUBF32 operation
mem32	pointer to 32-bit destination memory location for the MOV32 operation
RaH	floating-point source register (R0H to R7H) for the MOV32 operation

Opcode

LSW: 1110 0000 0010 fffe MSW: eedd daaa mem32

Description

Subtract the contents of two floating-point registers and move from a floating-point register to memory.

```
RdH = ReH - RfH,
[mem32] = RaH
```

Flags

This instruction modifies the following flags in the STF register:SUBF32 RdH, ReH, RfH || MOV32 RaH, mem32

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	Yes	Yes	

The STF register flags are modified as follows:

- LUF = 1 if SUBF32 generates an underflow condition.
- LVF = 1 if SUBF32 generates an overflow condition.

Pipeline

SUBF32 is a 2 pipeline-cycle instruction (2p) and MOV32 takes a single cycle. That is:

```
SUBF32 RdH, ReH, RfH
                           ; 2 pipeline cycles (2p)
                           ; 1 cycle
   MOV32
           mem32, RaH
; <-- MOV32 completes, mem32 updated
   NOP
                           ; 1 cycle delay or non-conflicting instruction
                           ; <-- ADDF32 completes, RdH updated
   NOP
```

Any instruction in the delay slot must not use RdH as a destination register or as a source operand.

Example

```
ADDF32
               R3H, R6H, R4H
                                       ; (A) R3H = R6H + R4H and R7H = I3
|| MOV32
               R7H, *-SP[2]
                                       ; <-- R7H valid
  SUBF32
               R6H, R6H, R4H
                                       ; (B) R6H = R6H - R4H
                                         <-- ADDF32 (A) completes, R3H valid
  SUBF32
               R3H, R1H, R7H
                                       ; (C) R3H = R1H - R7H and store R3H (A)
|| MOV32
               *+XAR5[2], R3H
                                       ; <-- SUBF32 (B) completes, R6H valid
                                         <-- MOV32 completes, (A) stored
  ADDF32
               R4H, R7H, R1H
                                       ; R4H = D = R7H + R1H and store R6H (B)
| MOV32
               *+XAR5[6], R6H
                                       ; <-- SUBF32 (C) completes, R3H valid
                                         <-- MOV32 completes, (B) stored
                                       ; store R3H (C)
  MOV32
               *+XAR5[0], R3H
                                         <-- MOV32 completes, (C) stored
                                       ; <-- ADDF32 (D) completes, R4H valid
  MOV32
               *+XAR5[4], R4H
                                       ; store R4H (D)
                                       ; <-- MOV32 completes, (D) stored
```

See also

SUBF32 RaH, RbH, RcH SUBF32 RaH, #16FHi, RbH

SUBF32 RdH, ReH, RfH | MOV32 RaH, mem32 MPYF32 RaH, RbH, RcH | SUBF32 RdH, ReH, RfH



SWAPF RaH, RbH{, CNDF} Conditional Swap

Operands

RaH	floating-point register (R0H to R7H)
RbH	floating-point register (R0H to R7H)
CNDF	condition tested

Opcode

LSW: 1110 0110 1110 CNDF MSW: 0000 0000 00bb baaa

Description

Conditional swap of RaH and RbH.

if (CNDF == true) swap RaH and RbH

CNDF is one of the following conditions:

Encode (1)	CNDF	Description	STF Flags Tested
0000	NEQ	Not equal to zero	ZF == 0
0001	EQ	Equal to zero	ZF == 1
0010	GT	Greater than zero	ZF == 0 AND NF == 0
0011	GEQ	Greater than or equal to zero	NF == 0
0100	LT	Less than zero	NF == 1
0101	LEQ	Less than or equal to zero	ZF == 1 AND NF == 1
1010	TF	Test flag set	TF == 1
1011	NTF	Test flag not set	TF == 0
1100	LU	Latched underflow	LUF == 1
1101	LV	Latched overflow	LVF == 1
1110	UNC	Unconditional	None
1111	UNCF (2)	Unconditional with flag modification	None

⁽¹⁾ Values not shown are reserved.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

No flags affected

Pipeline

This is a single-cycle instruction.

Example

;find the largest element and put it in R1H

```
XAR1, #0xB000
   MOVT
   MOV32
              R1H, *XAR1
                                ; Initialize R1H
    .align 2
   NOP
              LOOP_END, #(10-1); Execute the block 10 times
   RPTB
              R2H, *XAR1++
R2H, R1H
                             ; Update R2H with next element
   MOV32
                                ; Compare R2H with R1H
   CMPF32
    SWAPF
              R1H, R2H, GT
                               ; Swap R1H and R2H if R2 > R1
                                ; For minimum repeat block size
   NOP
   NOP
                                ; For minimum repeat block size
LOOP_END:
```

See also

⁽²⁾ This is the default operation if no CNDF field is specified. This condition will allow the ZF, NF, ZI, and NI flags to be modified when a conditional operation is executed. All other conditions will not modify these flags.



TESTTF CNDF

Test STF Register Flag Condition

Operands

01105	
CNDF	condition to test

Opcode

LSW: 1110 0101 1000 CNDF

Description

Test the floating-point condition and if true, set the TF flag. If the condition is false, clear the TF flag. This is useful for temporarily storing a condition for later use.

if (CNDF == true) TF = 1; else TF = 0;

CNDF is one of the following conditions:

Encode (1)	CNDF	Description	STF Flags Tested
0000	NEQ	Not equal to zero	ZF == 0
0001	EQ	Equal to zero	ZF == 1
0010	GT	Greater than zero	ZF == 0 AND NF == 0
0011	GEQ	Greater than or equal to zero	NF == 0
0100	LT	Less than zero	NF == 1
0101	LEQ	Less than or equal to zero	ZF == 1 AND NF == 1
1010	TF	Test flag set	TF == 1
1011	NTF	Test flag not set	TF == 0
1100	LU	Latched underflow	LUF == 1
1101	LV	Latched overflow	LVF == 1
1110	UNC	Unconditional	None
1111	UNCF (2)	Unconditional with flag modification	None

⁽¹⁾ Values not shown are reserved.

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	Yes	No	No	No	No	No	No	

```
TF = 0; if (CNDF == true) TF = 1;
```

Note: If (CNDF == UNC or UNCF), the TF flag will be set to 1.

Pipeline

This is a single-cycle instruction.

Example

```
CMPF32
          ROH, #0.0
                       ; Compare ROH against 0
TESTTF
                       ; Set TF if ROH less than 0 (NF == 0)
          LT
ABS
          ROH, ROH
                       ; Get the absolute value of {\tt ROH}
; Perform calculations based on ABS ROH
MOVST0
                       ; Copy TF to TC in ST0 \,
          TF
SBF
          End, NTC
                       ; Branch to end if TF was not set
NEGF32
          ROH, ROH
```

See also

End

⁽²⁾ This is the default operation if no CNDF field is specified. This condition will allow the ZF, NF, ZI, and NI flags to be modified when a conditional operation is executed. All other conditions will not modify these flags.



UI16TOF32 RaH, mem16 Convert unsigned 16-bit integer to 32-bit floating-point value

Operands

RaH	floating-point destination register (R0H to R7H)
mem16	pointer to 16-bit source memory location

Opcode

```
LSW: 1110 0010 1100 0100 MSW: 0000 0aaa mem16
```

Description

When converting F32 to I16/UI16 data format, the F32TOI16/UI16 operation truncates to zero while the F32TOI16R/UI16R operation will round to nearest (even) value.

```
RaH = UI16ToF32[mem16]
```

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
UI16TOF32 RaH, mem16 ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay or non-conflicting instruction
; <-- UI16TOF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example

```
; float32 y,m,b;
 AdcRegs.RESULTO is an unsigned int
 Calculate: y = (float)AdcRegs.ADCRESULT0 * m + b;
   MOVW
               DP
                    @0x01C4
   UI16TOF32
              ROH, @8
                                 ; ROH = (float)AdcRegs.RESULTO
               R1H, *-SP[6]
                                 ; R1H = M
   MOV32
                                 ; <-- Conversion complete, ROH valid
   MPYF32
               R0H, R1H, R0H
                                 ; ROH = (float)X * M
   MOV32
               R1H, *-SP[8]
                                 ; R1H = B
                                 ; <-- MPYF32 complete, R0H valid
; R0H = Y = (float)X * M + B
   ADDF32
               ROH, ROH, R1H
   NOP
                                 ; <-- ADDF32 complete, ROH valid
   MOV32
               *-[SP], R0H
                                 ; Store Y
```

See also

F32TOI16 RaH, RbH F32TOI16R RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, RbH



UI16TOF32 RaH, RbH Convert unsigned 16-bit integer to 32-bit floating-point value

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode LSW: 1110 0110 1000 1111

MSW: 0000 0000 00bb baaa

Description When converting F32 to I16/UI16 data format, the F32TOI16/UI16 operation truncates to

zero while the F32TOI16R/UI16R operation will round to nearest (even) value.

RaH = UI16ToF32[RbH]

Flags This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline This is a 2 pipeline cycle (2p) instruction. That is:

UI16TOF32 RaH, RbH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction

; <-- UI16TOF32 completes, RaH updated

NOP

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example MOVXI R5H, #0x800F ; R5H[15:0] = 32783 (0x800F)

UI16TOF32 R6H, R5H ; R6H = UI16TOF32 (R5H[15:0])

NOP ; 1 cycle delay for UI16TOF32 to complete

; R6H = 32783.0 (0x47000F00)

See also F32TOI16 RaH, RbH

F32TOI16R RaH, RbH F32TOUI16 RaH, RbH F32TOUI16R RaH, RbH I16TOF32 RaH, RbH I16TOF32 RaH, mem16 UI16TOF32 RaH, mem16



UI32TOF32 RaH, mem32 Convert Unsigned 32-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
mem32	pointer to 32-bit source memory location

Opcode

LSW: 1110 0010 1000 0100 MSW: 0000 0aaa mem32

Description

RaH = UI32ToF32[mem32]

Flags

This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline

This is a 2 pipeline cycle (2p) instruction. That is:

```
UI32TOF32 RaH, mem32 ; 2 pipeline cycles (2p)
NOP ; 1 cycle delay non-conflicting instruction
; <-- UI32TOF32 completes, RaH updated
```

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example

```
; unsigned long X
; float Y, M, B
 Calculate Y = (float)X * M + B
  UI32TOF32 ROH, *-SP[2]
                              ; ROH = (float)X
  MOV32
             R1H, *-SP[6]
                               ; R1H = M
                               ; <-- Conversion complete, ROH valid
  MPYF32
             ROH, R1H, ROH
                               ; ROH = (float)X * M
  MOV32
             R1H, *-SP[8]
                               ; R1H = B
                               ; <-- MPYF32 complete, ROH valid
  ADDF32
             ROH, ROH, R1H
                               ; ROH = Y = (float)X * M + B
  NOP
                               ; <-- ADDF32 complete, ROH valid
  MOV32
             *-[SP], ROH
                               ; Store Y
```

See also

F32TOI32 RaH, RbH F32TOUI32 RaH, RbH I32TOF32 RaH, mem32 I32TOF32 RaH, RbH UI32TOF32 RaH, RbH



UI32TOF32 RaH, RbH Convert Unsigned 32-bit Integer to 32-bit Floating-Point Value

Operands

RaH	floating-point destination register (R0H to R7H)
RbH	floating-point source register (R0H to R7H)

Opcode LSW: 1110 0110 1000 1011

MSW: 0000 0000 00bb baaa

Description RaH = UI32ToF32 RbH

Flags This instruction does not affect any flags:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

Pipeline This is a 2 pipeline cycle (2p) instruction. That is:

UI32TOF32 RaH, RbH ; 2 pipeline cycles (2p)

NOP ; 1 cycle delay or non-conflicting instruction

; <-- UI32TOF32 completes, RaH updated

NOE

Any instruction in the delay slot must not use RaH as a destination register or as a source operand.

Example MOVIZ R3H, #0x8000 ; R3H[31:16] = 0x8000 MOVXI R3H, #0x1111 ; R3H[15:0] = 0x1111

; R3H = 2147488017 UI32TOF32 R4H, R3H ; R4H = UI32TOF32 (R3H)

NOP ; 1 cycle delay for UI32TOF32 to complete

; R4H = 2147488017.0 (0x4F000011)

See also F32TOI32 RaH, RbH

F32TOUI32 RaH, RbH I32TOF32 RaH, mem32 I32TOF32 RaH, RbH UI32TOF32 RaH, mem32



ZERO RaH

Zero the Floating-Point Register RaH

Operands

RaH	floating point register (POU to P7U)
кап	floating-point register (R0H to R7H)

Opcode

```
LSW: 1110 0101 1001 0aaa
```

Description

Zero the indicated floating-point register:

```
RaH = 0
```

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF
Modified	No	No	No	No	No	No	No

No flags affected.

Pipeline

This is a single-cycle instruction.

Example

```
;for(i = 0; i < n; i++)
; {
    real += (x[2*i] * y[2*i]) - (x[2*i+1] * y[2*i+1]);
    imag += (x[2*i] * y[2*i+1]) + (x[2*i+1] * y[2*i]);
;}
; Assume AR7 = n-1
    ZERO
                                  ; R4H = real = 0
            R4H
                                  ; R5H = imag = 0
    ZERO
            R5H
LOOP
    MOV
            AL, AR7
    MOV
            ACC, AL << 2
    VOM
            AR0, ACC
            R0H, *+XAR4[AR0]
R1H, *+XAR5[AR0]
    MOV32
                                  ; R0H = x[2*i]
    MOV32
                                  ; R1H = y[2*i]
            AR0, #2
    ADD
    MPYF32
            R6H, R0H, R1H;
                                  ; R6H = x[2*i] * y[2*i]
    MOV32 R2H, *+XAR4[AR0]
MPYF32 R1H, R1H, R2H
 | MOV32
                                  ; R2H = x[2*i+1]
                                  ; R1H =
                                            y[2*i] * x[2*i+2]
 | MOV32
            R3H, *+XAR5[AR0]
                                  ; R3H = y[2*i+1]
                                  ; R2H = x[2*i+1] * y[2*i+1]
            R2H, R2H, R3H
    MPYF32
                                  ; R4H += x[2*i] * y[2*i]
; R0H = x[2*i] * y[2*i+1]
 | ADDF32
            R4H, R4H, R6H
    MPYF32
            ROH, ROH, R3H
                                 ; R5H += y[2*i] * x[2*i+2]
            R5H, R5H, R1H
 | ADDF32
            R4H, R4H, R2H
R5H, R5H,R0H
    SUBF32
                                  ; R4H -= x[2*i+1] * y[2*i+1]
                                  ; R5H += x[2*i] * y[2*i+1]
    ADDF32
    BANZ
            LOOP , AR7--
```

See also

ZEROA



ZEROA

Zero All Floating-Point Registers

Operands

none

Opcode

LSW: 1110 0101 0110 0011

Description

Zero all floating-point registers:

R0H = 0 R1H = 0 R2H = 0 R3H = 0 R4H = 0 R5H = 0 R6H = 0

R7H = 0

Flags

This instruction modifies the following flags in the STF register:

Flag	TF	ZI	NI	ZF	NF	LUF	LVF	
Modified	No	No	No	No	No	No	No	

No flags affected.

Pipeline

This is a single-cycle instruction.

Example

```
; for(i = 0; i < n; i++)
; {
    real += (x[2*i] * y[2*i]) - (x[2*i+1] * y[2*i+1]);
   imag += (x[2*i] * y[2*i+1]) + (x[2*i+1] * y[2*i]);
;}
; Assume AR7 = n-1
   ZER0A
                                ; Clear all RaH registers
LOOP
   MOV
            AL, AR7
   MOV
           ACC, AL << 2
   MOV
           AR0, ACC
   MOV32
            ROH, *+XAR4[AR0]
                               ; R0H = x[2*i]
           R1H, *+XAR5[AR0]
                                ; R1H = y[2*i]
   MOV32
            AR0,#2
   ADD
                               ; R6H = x[2*i] * y[2*i]
   MPYF32 R6H, R0H, R1H;
           R2H, *+XAR4[AR0]
                                ; R2H = x[2*i+1]
 | MOV32
   MPYF32 R1H, R1H, R2H
                               ; R1H = y[2*i] * x[2*i+2]
   MOV32 R3H, *+XAR5[AR0]
MPYF32 R2H, R2H, R3H
 | MOV32
                               ; R3H = y[2*i+1]
                               ; R2H = x[2*i+1] * y[2*i+1]
                               ; R4H += x[2*i] * y[2*i]
 | ADDF32 R4H, R4H, R6H
                               ; R0H = x[2*i] * y[2*i+1]
   MPYF32 ROH, ROH, R3H
 | ADDF32
           R5H, R5H, R1H
                               ; R5H += y[2*i] * x[2*i+2]
                                ; R4H = x[2*i+1] * y[2*i+1]
   SUBF32 R4H, R4H, R2H
   ADDF32 R5H, R5H,R0H
                                ; R5H += x[2*i] * y[2*i+1]
   BANZ
            LOOP , AR7--
```

See also

ZERO RaH



Revision History

A.1 Changes

This revision history lists the technical changes made in the most recent revision.

Table A-1. Technical Changes Made in This Revision

Location	Additions, Deletions, Modifications
Figure 1-1	Modified the functional block diagram
Section 1.2.1	Added this section.
Section 1.3.1	Deleted part of the last bullet in Emulation Logic section
Section 1.4.1	Modified bullets in Address and Data Buses section
Example 2-2	Modified code in The Repeat Block Instruction example
Example 3-8	Modified text following Destination Register Conflict Resolved example
ADDF32 RaH, #16FHi, RbH ADDF32 RaH, RbH, #16FHi	Modified operand for instruction ADDF32 RaH, #16FHi, RbH. Updated the description.
ADDF32 RdH, ReH, RfH MOV32 RaH, mem32	Modified the instruction ADDF32 RdH, ReH, RfH MOV32 RaH, mem32
CMPF32 RaH, #16FHi	Modified the CMPF32 RaH, #16FHi instruction
CMPF32 RaH, #0.0	Modified the CMPF32 RaH, #0.0 instruction
F32TOI32 RaH, RbH	Modified the F32TO132 RaH, RbH instruction
F32TOUI32 RaH, RbH	Modified the F32TOUI32 RaH, RbH instruction
I16TOF32 RaH, RbH	Modified the I16TOF32 RaH, RbH instruction
MACF32 R3H, R2H, RdH, ReH	Modified the MACF32 R3H, R2H, RdH, ReH, RfH instruction
MAXF32 RaH, #16FHi	Modified the syntax of the immediate operand. Modified the desciption.
MINF32 RaH, #16FHi	Modified the syntax of the immediate operand. Modified the description.
MINF32 RaH, RbH	Modified the MINF32 RaH, RbH instruction
MOV16 mem16, RaH	Modified the MOV16 mem16, RaH instruction
MOV32 loc32, *(0:16bitAddr)	Modified the MOV32 loc32, #(0:16bitAddr) instruction
MOV32 mem32, RaH	Modified the MOV32 mem32, RaH instruction
MOV32 mem32, STF	Modified the MOV32 mem32, STF instruction
MOV32 RaH, XT	Modified the MOV32 RaH, XT instruction
MOVF32 RaH, #32F	Added the MOV32 RaH, #32 instruction
MOVI32 RaH, #32FHex	Added the MOVI32 RaH, #32FHex instruction
MOVIZ RaH, #16FHiHex	Modified the syntax for the immediate operand. Modified the description. Modified the example.
MOVIZF32 RaH, #16FHi	Modified the syntax for the immediate operand. Modified the description.
MOVXI RaH, #16FLo	Modified the MOVXI RaH, #16FLo instruction. Modified the syntax of the immediate operand. Modified the description.
MPYF32 RaH, #16FHi, RbH MPYF32 RaH, RbH, #16FHi	Modified the syntax of the immediate operand. Modified the instruction description.
MPYF32 RdH, ReH, RfH	Modified the MPYF32 RdH, ReH, RfH MOV32 RaH, mem32 instruction
SAVE FLAG, VALUE	Modified the SAVE FLAG, VALUE instruction
SUBF32 RaH, #16FHi, RbH	Modified the syntax for the immediate operand. Modified the description.



Changes www.ti.com

Table A-1. Technical Changes Made in This Revision (continued)

Location	Additions, Deletions, Modifications
SUBF32 RdH, ReH, RfH MOV32 mem32, RaH	Modified the SUBF32, RdH, ReH, RfH MOV32 mem32, RaH instruction
UI16TOF32 RaH, RbH	Modified the UI16TOF32 RaH, RbH instruction
UI32TOF32 RaH, RbH	Modified the UI32TOF32 RaH, RbH instruction
Globally	The syntax sections of the #16F, #16I and #immF32 immediate addressing modes modes were changed to #16FHi, #16FHiHex, and #16FLoHex to be more descriptive and consistent. The descriptions for instructions using these modes were updated for clarity.
Example 2-2	Changed first instruction in example
Table 4-1	Updated the operand nomenclature table
Section 2.1.2	Modified the register figure introduction and register figure
EINVF32 RaH, RbH	Modified the example
EISQRTF32 RaH, RbH	Modified the example
Chapter 4	Added instructions to the See Also area of various instructions

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, modifications, enhancements, improvements, and other changes to its products and services at any time and to discontinue any product or service without notice. Customers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All products are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its hardware products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by government requirements, testing of all parameters of each product is not necessarily performed.

TI assumes no liability for applications assistance or customer product design. Customers are responsible for their products and applications using TI components. To minimize the risks associated with customer products and applications, customers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any TI patent right, copyright, mask work right, or other TI intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information published by TI regarding third-party products or services does not constitute a license from TI to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. Reproduction of this information with alteration is an unfair and deceptive business practice. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions

Resale of TI products or services with statements different from or beyond the parameters stated by TI for that product or service voids all express and any implied warranties for the associated TI product or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

TI products are not authorized for use in safety-critical applications (such as life support) where a failure of the TI product would reasonably be expected to cause severe personal injury or death, unless officers of the parties have executed an agreement specifically governing such use. Buyers represent that they have all necessary expertise in the safety and regulatory ramifications of their applications, and acknowledge and agree that they are solely responsible for all legal, regulatory and safety-related requirements concerning their products and any use of TI products in such safety-critical applications, notwithstanding any applications-related information or support that may be provided by TI. Further, Buyers must fully indemnify TI and its representatives against any damages arising out of the use of TI products in such safety-critical applications.

TI products are neither designed nor intended for use in military/aerospace applications or environments unless the TI products are specifically designated by TI as military-grade or "enhanced plastic." Only products designated by TI as military-grade meet military specifications. Buyers acknowledge and agree that any such use of TI products which TI has not designated as military-grade is solely at the Buyer's risk, and that they are solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI products are neither designed nor intended for use in automotive applications or environments unless the specific TI products are designated by TI as compliant with ISO/TS 16949 requirements. Buyers acknowledge and agree that, if they use any non-designated products in automotive applications, TI will not be responsible for any failure to meet such requirements.

Following are URLs where you can obtain information on other Texas Instruments products and application solutions:

Products Amplifiers amplifier.ti.com Data Converters dataconverter.ti.com DSP dsp.ti.com Clocks and Timers www.ti.com/clocks Interface interface.ti.com Logic logic.ti.com Power Mgmt power.ti.com Microcontrollers microcontroller.ti.com www.ti-rfid.com RF/IF and ZigBee® Solutions www.ti.com/lprf

Applications	
Audio	www.ti.com/audio
Automotive	www.ti.com/automotive
Broadband	www.ti.com/broadband
Digital Control	www.ti.com/digitalcontrol
Medical	www.ti.com/medical
Military	www.ti.com/military
Optical Networking	www.ti.com/opticalnetwork
Security	www.ti.com/security
Telephony	www.ti.com/telephony
Video & Imaging	www.ti.com/video
Wireless	www.ti.com/wireless

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265 Copyright © 2008, Texas Instruments Incorporated