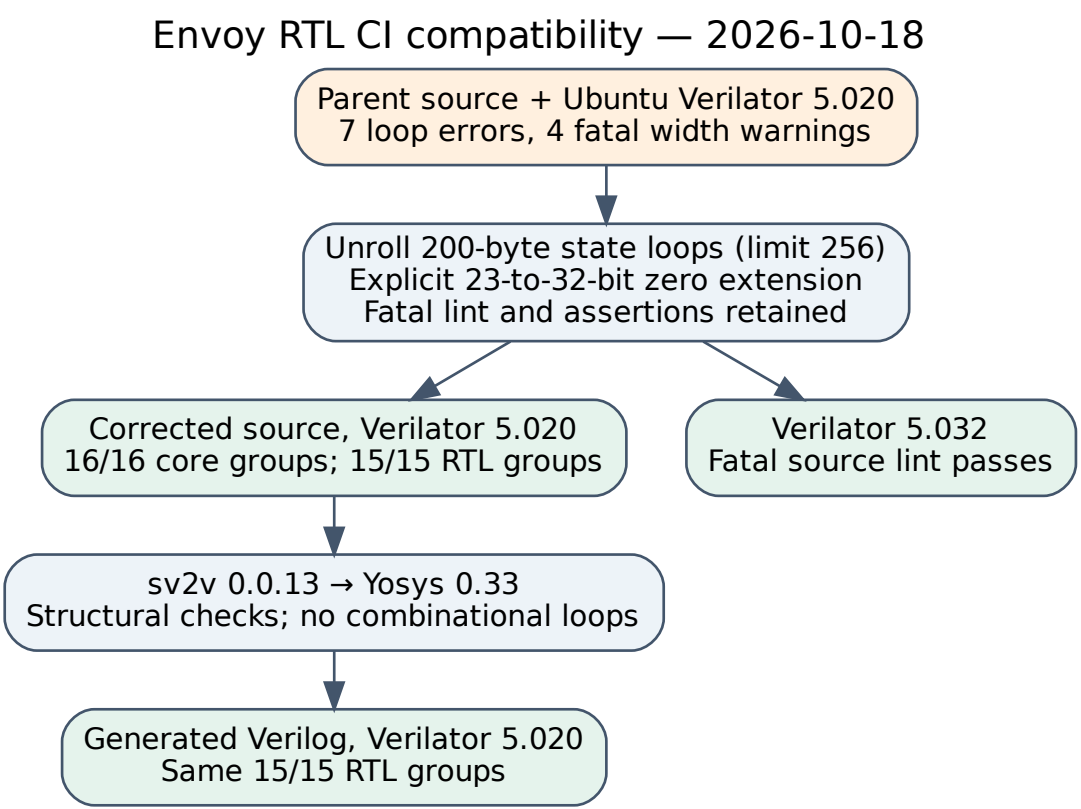
Envoy RTL CI compatibility — 2026-10-18
Parent source + Ubuntu Verilator 5.020
7 loop errors, 4 fatal width warnings
Unroll 200-byte state loops (limit 256)
Explicit 23-to-32-bit zero extension
Fatal lint and assertions retained
Corrected source, Verilator 5.020
16/16 core groups; 15/15 RTL groups
Verilator 5.032
Fatal source lint passes
sv2v 0.0.13 → Yosys 0.33
Structural checks; no combinational loops
Generated Verilog, Verilator 5.020
Same 15/15 RTL groups