Fabric Shrinkage S.O.P

YJ.IK-CAD.0024




revised : 26-Mar-2024

1. Pattern maker terima laporan shrinkage test fabric dari merchandiser via e-mail.
   Pattern maker receives fabric shrinkage test result from merchandiser via e-mail.

2. Jika hasil shrinkage test fabric PASS (dibawah 3%), maka pattern bisa langsung diproses.
   If fabric shrinkage test is PASS (under 3%), then the pattern can be directly processed.

3. Jika hasil shrinkage test fabric FAIL (diatas 3%), merchandiser akan mengkonfirmasi apakah fabric masuk ke mesin sponging atau tidak.
   If fabric shrinkage test is FAIL (above 3%), merchandiser will confirm whether fabric will be proceeded by sponging machine or not.

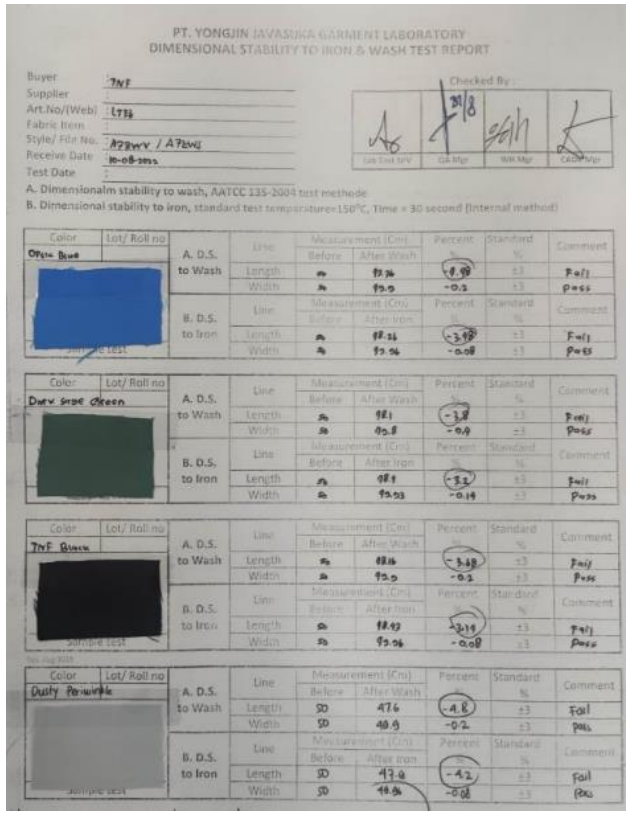

PT. YONGJIN JAVASUKA GARMENT LABORATORY
DIMENSIONAL STABILITY TO IRON & WASH TEST REPORT

Buyer : TNF
Supplier :
Art.No/(Web) : LTH
Fabric Item :
Style/ File No. : A78WV / A7EWJ
Receive Date : 10-08-2022
Test Date :

A. Dimensionalm stability to wash, AATCC 135-2004 test methode
B. Dimensional stability to iron, standard test temperature:150°C, Time = 30 second (Internal method)

Checked By :

Color	Lot/ Roll no		Line	Measurement (Cm) Before	Measurement (Cm) After Wash	Percent %	Standard %	Comment
Optic Blue		A. D.S. to Wash	Length	50	47.26	-5.48	±3	Fail
			Width	50	49.9	-0.2	±3	Pass
		B. D.S. to Iron	Line	Measurement (Cm) Before	Measurement (Cm) After Iron	Percent %	Standard %	Comment
			Length	50	48.34	-3.32	±3	Fail
			Width	50	49.96	-0.08	±3	Pass
Dark Sage Green		A. D.S. to Wash	Length	50	48.1	-3.8	±3	Fail
			Width	50	49.8	-0.4	±3	Pass
		B. D.S. to Iron	Length	50	48.1	-3.8	±3	Fail
			Width	50	49.53	-0.94	±3	Pass
TNF Black		A. D.S. to Wash	Length	50	48.16	-3.68	±3	Fail
			Width	50	49.9	-0.2	±3	Pass
		B. D.S. to Iron	Length	50	48.43	-3.14	±3	Fail
			Width	50	49.96	-0.08	±3	Pass
Dusty Periwinkle		A. D.S. to Wash	Length	50	47.6	-4.8	±3	Fail
			Width	50	49.9	-0.2	±3	Pass
		B. D.S. to Iron	Length	50	47.8	-4.2	±3	Fail
			Width	50	49.96	-0.08	±3	Pass

4. Jika fabric diproses mesin sponging, maka fabric di test shrinkage ulang.
   Jika hasilnya PASS maka proses pattern normal & untuk costing MM (Mini Marker) pattern ditambah hasil shrinkage test fabric (sebelum-sesudah) tapi jika hasilnya FAIL maka akan check dengan Manager Korea CAD.
   If fabric proceed by sponging machine, then re-test shrinkage the fabric.
   If the result is PASS so pattern process is normal & for MM (Mini Marker) costing pattern added the fabric shrinkage test result (before-after) but if the result is FAIL so will check to CAD Korean manager

5. Manager Korea CAD memutuskan proses pattern normal & untuk costing MM (Mini Marker) pattern dengan ditambah hasil shrinkage test fabric (sebelum-sesudah) atau fabric akan dikembalikan ke merchandiser.
   CAD Korean manager decided that pattern process is normal & for MM (Mini Marker) costing pattern by added the fabric shrinkage test result (before-after) or fabric will be returned to merchandiser.

6. Jika fabric tidak diproses ke mesin sponging, maka pattern akan diubah dengan menambahkan persentase hasil shrinkage test fabric.
   If fabric isn't proceeded by sponging machine, then pattern will be changed by adding the percentage of fabric shrinkage test result.



CHANGE LOG

Date	Description	Changed by
22-Mar-2024	detail & picture added into page 2 & 3.	Yayat / Ilham
26-Mar-2024	add register # from ISO team	Yayat