

Precision Pressure Transmitter



Zenith Pressure eXperts

Series



New Standard in Industrial Pressure Environments
High-Accuracy Pressure Solutions, Reliable Results Always
Enhanced Accuracy with Temperature Correction Technology
Real-Time Data, Superior Accuracy

Applications

- Measurement & Test benches
- Laboratories
- Machine building
- Compressor Control
- Calibration technology
- Plant construction
- Hydraulics & Pneumatic

Features

- CE Certified
- Vdc, mA Analog output
- RS-232, RS-485 Digital output
- Gauge, Compound Gauge, Absolute measurement
- Piezoresistive silicon cell
- Stainless steel media-wetted materials


Specifications

Range	(Gauge) 0 ~ 100, 200, 350, 700 kPa / 2, 3.5, 7, 10, 20, 35, 70 MPa (Compound/Absolute) 0 ~ 100, 200, 350, 700 kPa / 2, 3.5 MPa	
Performance	Accuracy	± 0.1% FS, ± 0.075% FS, ± 0.05% FS
	Thermal Effect on Zero	± 0.05% FS/°C
	Thermal Effect on Span	± 0.05% FS/°C
	Compensated Temperature Range	-10 ~ 50°C
	Operating Temperature Range	-20 ~ 80°C
Electrical	Excitation	12~28 Vdc
	Output ----- 2 wire	4 ~ 20 mA
	----- 3, 4 wire	1 ~ 5 Vdc, 0 ~ 5 Vdc, 0 ~ 10 Vdc
	----- Digital	RS232(9600, 8, n, 1) / RS485(9600, 8, n, 1)
	Electrical Connection	M12, DIN43650-A
Physical	Proof Pressure	150% FS
	Burst Pressure	200% FS
	Pressure Port	PT 3/8", PT 1/4", PF 1/4", NPT 1/4", PT 1/8"
	Media-Wetted Materials	(< 7 MPa) Stainless Steel 316L, Viton (≥ 7 MPa) Stainless Steel 313, Titanium 87% Alloy

■ Electrical Connection

DIN 43650-A Connector				
Output Type	Pin No.	3-wire	2-wire	
Connection Method				
	1	Input+	Input+	
	2	Common	Output+	
	3	Output+	-	
	4	Shield	Shield	


■ Dimension & Electrical Connection

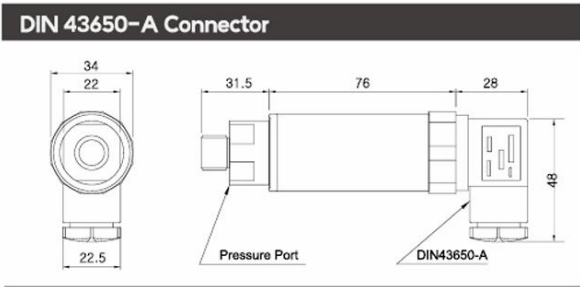

■ Electrical Connection

M12 Connector Type					
Output Type	Pin No.	4-wire	3-wire	2-wire	COMM. Only
Connection Method					
	1	Input+	Input+	Input+	Input+
	2	Output+	Output+	-	TXD
	3	Input-	Common	Output+	Common
	4	Output-	-	-	RXD
	5	Shield	Shield	Shield	Shield

■ Dimension & Electrical Connection

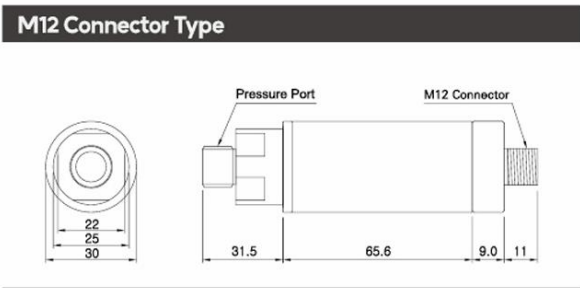

※ M12 : ●1 - White / ●2 - Brown / ●3 - Gray / ●4 - Black / ●5 - Blue

■ Ordering Information

ZT- 1 H		G 0 1 0 0		R A I	
Accuracy & Output		Pressure Type & Range		Unit	Port
1: 0.1%	H: 4-20mA (2-wire) Y: Comm (RS232) Z: Comm (RS485)	G : Gauge	0100: 100 kPa 0200: 200 kPa 0350: 350 kPa 0700: 700 kPa 0002: 2 MPa 03.5 : 3.5 MPa 0007: 7 MPa 0010: 10 MPa 0020: 20 MPa 0035: 35 MPa 0070: 70 MPa	R: kPa M: MPa B: bar K: kgf/cm ² P: psi C: cmH ₂ O	A: PT 3/8" C: PT 1/4" D: PF 1/4" N: NPT 1/4" G: PT 1/8"
2: 0.075%	B: 0-5 VDC (4-wire) C: 0-5 VDC (3-wire) D: 1-5 VDC (4-wire) E: 1-5 VDC (3-wire) K: 0-10 VDC (4-wire) J: 0-10 VDC (3-wire)	C : Compound gauge A : Absolute	0100: 100 kPa 0200: 200 kPa 0350: 350 kPa 0700: 700 kPa 0002: 2 MPa 03.5 : 3.5 MPa		
3: 0.05%	B: 0-5 VDC (4-wire) C: 0-5 VDC (3-wire) D: 1-5 VDC (4-wire) E: 1-5 VDC (3-wire) K: 0-10 VDC (4-wire) J: 0-10 VDC (3-wire) Y: Comm (RS232) Z: Comm (RS485)				
ex) ZT-1HG0100RAI : 0.1%, 4-20mA(2-wire), Gauge, 100 kPa, PT 3/8", DIN 43650-A Connector					
Connector I : DIN 43650-A Connector M : M12 Connector					