


Manifold Absolute Pressure (MAP) / Intake Air Temperature 2 (IAT2) Sensor — 3.5L GTDI

 [Ford Ecat Electronic Parts Catalog](#)

Material	
Item	Specification
Motorcraft® SAE 5W-20 Premium Synthetic Blend Motor Oil (US); Motorcraft® SAE 5W-20 Super Premium Motor Oil (Canada) XO-5W20-QSP (US); CXO-5W20-LSP12 (Canada)	WSS-M2C945-A

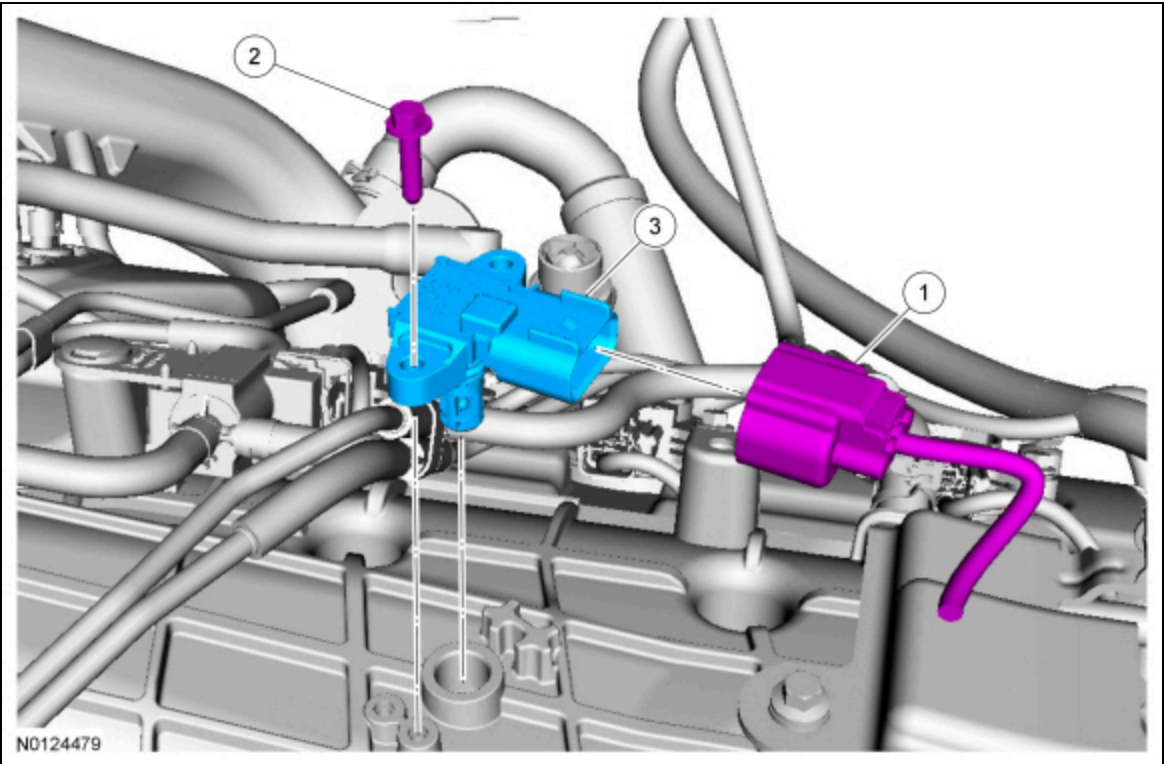

Item	Part Number	Description
1	—	MAP / IAT2 sensor electrical connector (part of 12A581)
2	W505565 W505565	Manifold Absolute Pressure (MAP) / Intake Air Temperature 2 (IAT2) sensor bolt - 6 Nm (53 lb-in)
3	9F479 9F479	MAP / IAT2 sensor

Removal

NOTE: The Turbocharger Boost Pressure (TCBP) /Charge Air Cooler Temperature (CACT) sensor and the Manifold Absolute Pressure (MAP) / Intake Air Temperature 2 (IAT2) sensor are not interchangeable.

1. Disconnect the MAP / IAT2 sensor electrical connector.

2. Remove the bolt and the MAP /IAT2 sensor.

Installation

1. Lubricate the MAP /IAT2 sensor O-ring seal with clean engine oil.
2. Install the MAP /IAT2 sensor and the bolt.
 - Tighten to 6 Nm (53 lb-in).
3. Connect the MAP /IAT2 sensor electrical connector.