


Turbocharger Boost Pressure (TCBP) / Charge Air Cooler Temperature (CACT) Sensor — 3.5L GTDI

 [Ford Ecat Electronic Parts Catalog](#)

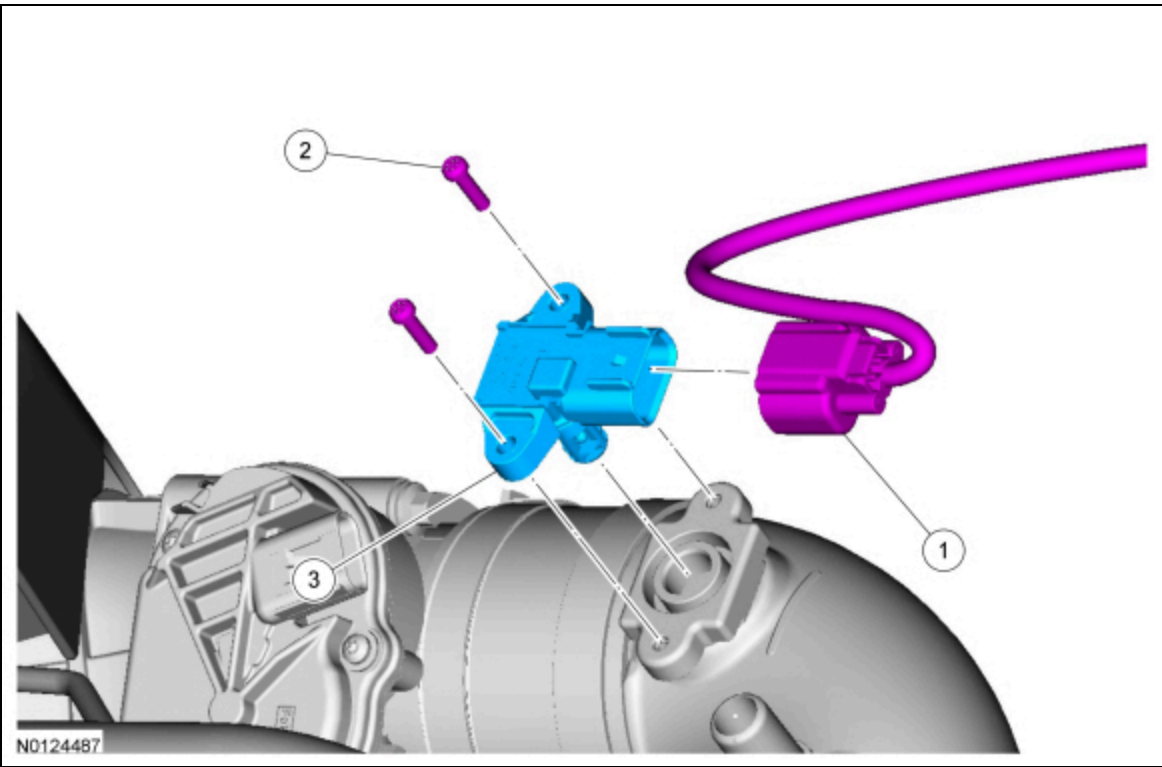

Item	Part Number	Description
1	—	Turbocharger Boost Pressure (TCBP) / Charge Air Cooler Temperature (CACT) sensor electrical connector (part of 12A581)
2	W506843W506843	TCBP /CACT sensor screws - 3 Nm (27 lb-in)
3	9F4799F479	TCBP /CACT sensor

Removal

NOTE: Turbocharger Boost Pressure (TCBP) / Charge Air Cooler Temperature (CACT) sensor and the Manifold Absolute Pressure (MAP) /Intake Air Temperature 2 (IAT2) sensor are not interchangeable.

1. Remove the ACL outlet tube. For additional information, refer to Section 303-12.
2. Disconnect the Turbocharger Boost Pressure (TCBP) /Charge Air Cooler Temperature (CACT) sensor electrical connector.
3. Remove the 2 screws and the TCBP /CACT sensor.

Installation

1. Install the TCBP /CACT sensor and the 2 screws.
 - Tighten to 3 Nm (27 lb-in).

2. Connect the ~~TCBP /CACT~~ sensor electrical connector.
3. Install the ~~ACL~~ outlet tube. For additional information, refer to Section 303-12.