



Instrument panel dimmer switch

Schematic

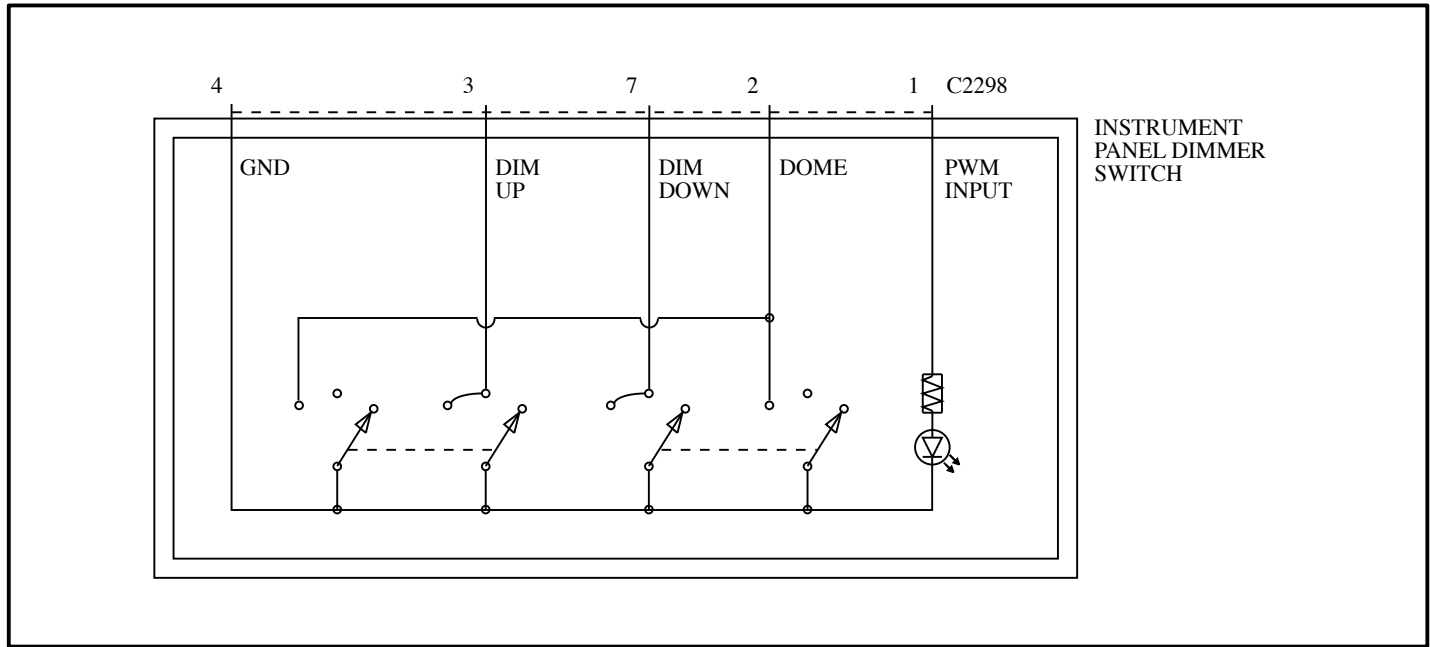

Terminals

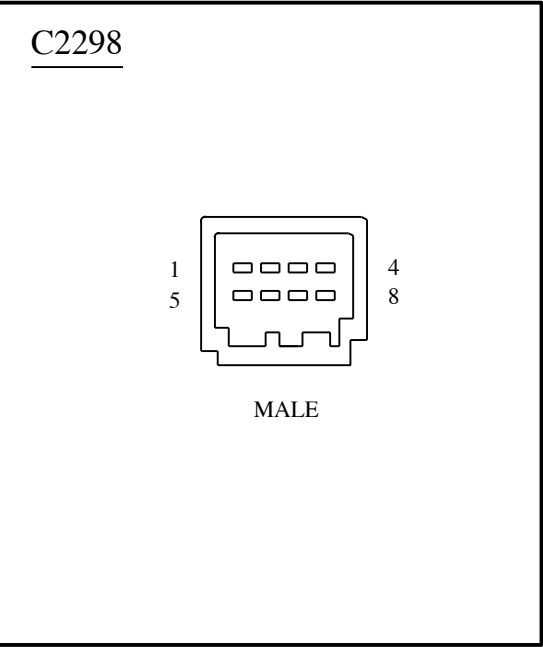

Component testing procedure

Circuit to test	Connect self-powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Interior dome Circuit	4 and 2 4 and 3	Dome lamp on	Closed circuit
	4 and 2 4 and 7	Dome lamp off	Closed circuit
Interior dimmer Circuit	4 and 3	Dimmer Up / Dome lamp on	Closed circuit
	4 and 7	Dimmer Down / Dome lamp off	Closed circuit
Interior dome / dimmer Circuit	4 and 2 4 and 3 4 and 7	At rest	Open circuit

