



Relay - Ultra Micro ISO

Schematic

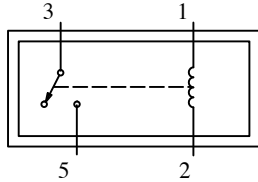

Terminals

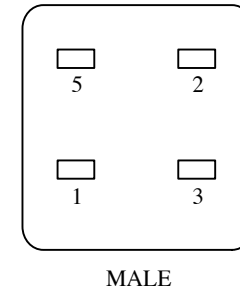

Component testing procedure (no voltage applied)

Circuit to test	Connect ohmmeter to terminals	A good relay will indicate
Coil	1 and 2	87 - 216 ohms
Contact	3 and 5	Open circuit
Coil - Contact	2 and 3	Open circuit
	2 and 5	Open circuit

Component testing procedure (voltage applied)

Disconnect the ohmmeter and connect pins 3 and 1 to 12V DC power and pin 2 to ground. Measure voltage between pins 5 and 2. If the voltage is 12V, the relay is okay. If not, replace the relay.

