

CA-102 Electronics tray

NOTES


1. Hole sizes are the printed sizes from the PETG tolerance table (cad/model.py TOL).
   Print CA-900 first and adjust TOL if a fit is off.
2. Screws thread straight into the printed pilots (HF kit #67675, no nuts).
3. Datum = the part's bounding-box corner (min X, Y, Z), lower left of the front and top views.
   Hole centres: (X, Y) for Z holes, (X, Z) for Y holes, (Y, Z) for X holes. ×k = k holes stacked
   along the axis; +n = n more positions (see the STEP file).
4. Shown in its assembly orientation; the STEP file defines all other geometry.

TOP VIEW

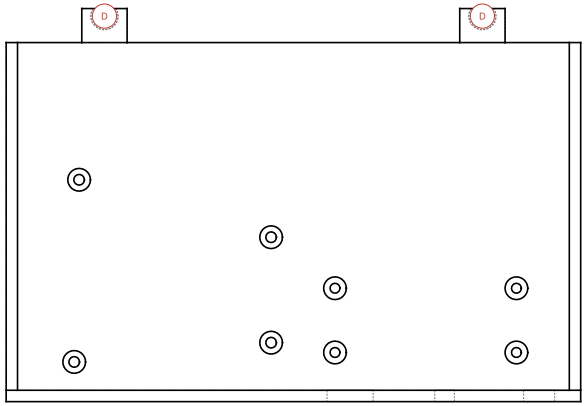


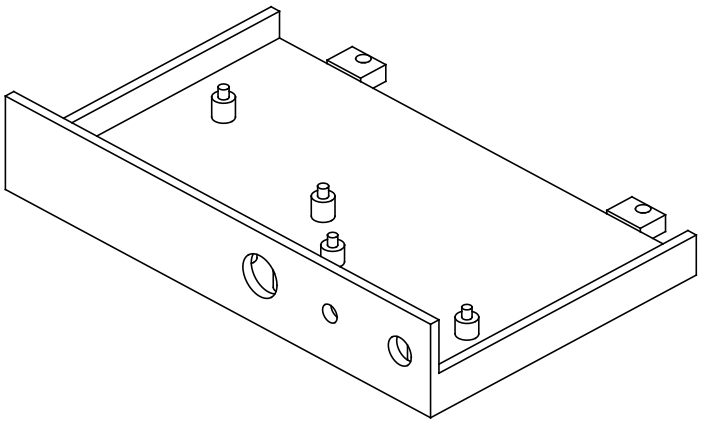

ISOMETRIC (not to scale)

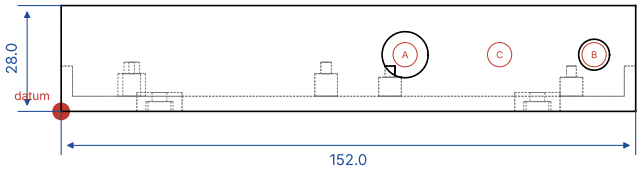

FRONT VIEW

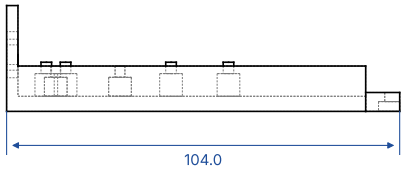

RIGHT VIEW

HOLE TABLE (letters mark hole centres on the view along that axis)

	Ø (mm)	×	axis	depth	centres from datum (mm)	fit / feature
A	12.20	1	Y	3.0	(91.0, 15.0)	12 mm START button
B	8.20	1	Y	3.0	(141.0, 15.0)	DC panel jack
C	5.20	1	Y	3.0	(116.0, 15.0)	5 mm status LED
D	3.90	2	Z	2.4	(26.0, 102.0); (126.0, 102.0)	#6-32 clearance / running

PART NO.	**CA-102**
TITLE	**Electronics tray**
MATERIAL	PETG printed, 0.4 mm nozzle
MASS	57.0 g (CAD, 60 % fill)
QTY	1 per robot
SCALE	1:2
UNITS	mm · general tolerance ±0.2
SOURCE	cad/model.py → cad/out/parts/electronics_tray.step / .stl
PROJECTION	Third angle ⊕◁
SHEET	3 of 13
DRAWN	ME 2331 Project 2 team 2026-11-02