## RISC-V External Debug Support Version 0.13 48f437b038d3c98588ea06cb420a2c49e4c3eeea

Tim Newsome <tim@sifive.com>

Fri Oct 6 15:53:30 2017 -0700

# **Preface**

Warning! This draft specification will change before being accepted as standard, so implementations made to this draft specification will likely not conform to the future standard.

## Acknowledgments

I would like to thank the following people for their time, feedback, and ideas: Bruce Ableidinger, Krste Asanovic, Mark Beal, Alex Bradbury, Zhong-Ho Chen, Monte Dalrymple, Vyacheslav Dyanchenco, Peter Egold, Richard Herveille, Po-wei Huang, Scott Johnson, Aram Nahidipour, Rishiyur Nikhil, Gajinder Panesar, Klaus Kruse Pedersen, Antony Pavlov, Ken Pettit, Wesley Terpstra, Megan Wachs, Stefan Wallentowitz, Ray Van De Walker, Andrew Waterman, and Andy Wright.

# Contents

P	refac	e	i
1	Intr	roduction	1
	1.1	Terminology	1
	1.2	About This Document	1
		1.2.1 Structure	1
		1.2.2 Register Definition Format	2
		1.2.2.1 Long Name (shortname, at 0x123)	2
	1.3	Background	2
	1.4	Supported Features	3
2	Sys	tem Overview	5
3	Deb	oug Module (DM)	7
	3.1	Debug Module Interface (DMI)	7
	3.2	Reset Control	8
	3.3	Selecting Harts	8
		3.3.1 Selecting a Single Hart	8
		3.3.2 Selecting Multiple Harts	9
	3.4	Run Control	9
	3.5	Abstract Commands	9
		3.5.1 Abstract Command Listing	10

	3.5.1.1 Access Register	10
	3.5.1.2 Quick Access	11
3.6	Program Buffer	12
3.7	Overview of States	13
3.8	System Bus Access	13
3.9	Quick Access	13
3.10	Security	15
3.11	Debug Module DMI Registers	15
	3.11.1 Debug Module Status (dmstatus, at 0x11)	16
	3.11.2 Debug Module Control (dmcontrol, at 0x10)	17
	3.11.3 Hart Info (hartinfo, at 0x12)	19
	3.11.4 Halt Summary (haltsum, at 0x13)	20
	3.11.5 Hart Array Window Select (hawindowsel, at 0x14)	21
	3.11.6 Hart Array Window (hawindow, at 0x15)	21
	3.11.7 Abstract Control and Status (abstractcs, at 0x16)	21
	3.11.8 Abstract Command (command, at 0x17)	22
	3.11.9 Abstract Command Autoexec (abstractauto, at 0x18)	23
	3.11.10 Device Tree Addr 0 (devtreeaddr0, at 0x19)	23
	3.11.11 Abstract Data 0 (data0, at 0x04)	24
	3.11.12 Program Buffer 0 (progbuf0, at 0x20)	24
	3.11.13 Authentication Data (authdata, at 0x30)	24
	3.11.14 System Bus Access Control and Status (sbcs, at 0x38)	24
	3.11.15 System Bus Address 31:0 (sbaddress0, at 0x39)	26
	3.11.16 System Bus Address 63:32 (sbaddress1, at 0x3a)	26
	3.11.17 System Bus Address 95:64 (sbaddress2, at 0x3b)	26
	3.11.18 System Bus Data 31:0 (sbdata0, at 0x3c)	27
	3.11.19 System Bus Data 63:32 (sbdata1, at 0x3d)	28
	3.11.20 System Bus Data 95:64 (sbdata2, at 0x3e)	28

		3.11.21 Sys	stem Bus Data 127:96 (sbdata3, at 0x3f)	28
4	RIS	C-V Debu	ıg	29
	4.1	Debug Mo	ode	29
	4.2	Load-Rese	erved/Store-Conditional Instructions	30
	4.3	Reset		30
		4.3.1 dre	et Instruction	30
	4.4	Core Debu	ng Registers	30
		4.4.1 De	bug Control and Status (dcsr, at 0x7b0)	31
		4.4.2 De	bug PC (dpc, at 0x7b1)	32
		4.4.3 De	bug Scratch Register 0 (dscratch0, at 0x7b2)	33
		4.4.4 De	bug Scratch Register 1 (dscratch1, at 0x7b3)	33
	4.5	Virtual De	ebug Registers	33
		4.5.1 Pri	vilege Level (priv, at virtual)	34
5	Trig	gger Modu	ıle	35
5	Trig			
5		Trigger Re		35
5		Trigger Re	egisters	35 36
5		Trigger Re 5.1.1 Tri 5.1.2 Tri	egisters	35 36 36
5		Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri	gger Select (tselect, at 0x7a0)	35 36 36 37
5		Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri	gger Select (tselect, at 0x7a0)	35 36 36 37 37
5		Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri 5.1.5 Ma	egisters	35 36 36 37 37
5	5.1	Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri 5.1.5 Ma 5.1.6 Ins	egisters	35 36 36 37 37
	5.1	Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri 5.1.5 Ma 5.1.6 Ins	egisters	35 36 36 37 37 41
	5.1 Deb	Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri 5.1.5 Ma 5.1.6 Ins  Dug Transp  JTAG Del	egisters  gger Select (tselect, at 0x7a0)  gger Data 1 (tdata1, at 0x7a1)  gger Data 2 (tdata2, at 0x7a2)  gger Data 3 (tdata3, at 0x7a3)  tch Control (mcontrol, at 0x7a1)  truction Count (icount, at 0x7a1)  cort Module (DTM)  bug Transport Module	35 36 36 37 37 41 <b>43</b>
	5.1 Deb	Trigger Re 5.1.1 Tri 5.1.2 Tri 5.1.3 Tri 5.1.4 Tri 5.1.5 Ma 5.1.6 Ins  Dug Transp  JTAG Del 6.1.1 JT	egisters  gger Select (tselect, at 0x7a0)  gger Data 1 (tdata1, at 0x7a1)  gger Data 2 (tdata2, at 0x7a2)  gger Data 3 (tdata3, at 0x7a3)  etch Control (mcontrol, at 0x7a1)  truction Count (icount, at 0x7a1)  boort Module (DTM)  bug Transport Module  AG Background	35 36 36 37 37 41 <b>43</b> 43

		6.1.4	DTM Control and Status (dtmcs, at 0x10)	45
		6.1.5	Debug Module Interface Access (dmi, at 0x11)	46
		6.1.6	BYPASS (at 0x1f)	47
		6.1.7	Recommended JTAG Connector	48
A	Hare	dware	Implementations	51
	A.1	Abstra	act Command Based	51
	A.2	Execu	tion Based	51
В	Deb	ugger	Implementation	53
	B.1	Debug	Module Interface Access	53
	B.2	Main 1	Loop	54
	B.3	Haltin	g	54
	B.4	Runni	ng	54
	B.5	Single	Step	54
	B.6	Access	sing Registers	54
		B.6.1	Using Abstract Command	54
		B.6.2	Using Program Buffer	55
	B.7	Readin	ng Memory	55
		B.7.1	Using System Bus Access	55
		B.7.2	Using Program Buffer	56
	B.8	Writin	g Memory	57
		B.8.1	Using System Bus Access	57
		B.8.2	Using Program Buffer	57
	B.9	Handl	ing Exceptions	58
	B.10	Quick	Access	58
$\mathbf{C}$	Futu	ıre Ide	eas	61
	C.1	Serial	Ports	62

RISC-V External Debug Support Version 0.13					
C.1.1	Serial Control and Status (sercs, at 0x34)	62			
C.1.2	Serial TX Data (sertx, at 0x35)	63			
C.1.3	Serial RX Data (serrx, at 0x36)	63			
D Change L	$\mathbf{og}$	65			

# List of Figures

2.1	RISC-V Debug System Overview	•	 •		 •		 			•	•			•	•	6
3.1	Run/Halt Debug State Machine.			_			 									14

# List of Tables

1.1	Register Access Abbreviations	2
3.1	Debug Module Interface Address Space	8
3.2	Use of Data Registers	10
3.3	Meaning of cmdtype	10
3.4	Abstract Register Numbers	12
3.5	Debug Module Debug Bus Registers	15
4.1	Core Debug Registers	30
4.2	Virtual address in DPC upon Debug Mode Entry	33
4.3	Virtual Core Debug Registers	34
4.4	Privilege Level Encoding	34
5.1	Trigger Registers	36
5.2	Suggested Breakpoint Timings	38
6.1	JTAG DTM TAP Registers	44
6.2	JTAG Connector Diagram	48
6.3	JTAG Connector Pinout	48
B.1	Memory Read Timeline	57
C 1	Debug Module Debug Rus Registers	62

## Chapter 1

## Introduction

When a design progresses from simulation to hardware implementation, a user's control and understanding of the system's current state drops dramatically. To help bring up and debug low level software and hardware, it is critical to have good debugging support built into the hardware. When a robust OS is running on a core, software can handle many debugging tasks. However, in many scenarios, hardware support is essential.

This document outlines a standard architecture for external debug support on RISC-V platforms. This architecture allows a variety of implementations and tradeoffs, which is complementary to the wide range of RISC-V implementations. At the same time, this specification defines common interfaces to allow debugging tools and components to target a variety of platforms based on the RISC-V ISA.

System designers may choose to add additional hardware debug support, but this specification defines a standard interface for common functionality.

## 1.1 Terminology

A platform is a single integrated circuit consisting of one or more components. Some components may be RISC-V cores, while others may have a different function. Typically they will all be connected to a single system bus. A single RISC-V core contains one or more hardware threads, called harts.

#### 1.2 About This Document

#### 1.2.1 Structure

This document contains two parts. The main part of the document is the specification, which is given in the numbered sections. The second part of the document is a set of appendices. The information in the appendix is intended to clarify and provide examples, but is not part of the

actual specification.

### 1.2.2 Register Definition Format

All register definitions in this document follow the format shown below. A simple graphic shows which fields are in the register. The upper and lower bit indices are shown to the top left and top right of each field. The total number of bits in the field are shown below it.

After the graphic follows a table which for each field lists its name, description, allowed accesses, and reset value. The allowed accesses are listed in Table 1.1.

	10010 1111 10000000 110010 110010					
R	Read-only.					
R/W	Read/Write.					
R/W0	Read/Write. Only writing 0 has an effect.					
R/W1 Read/Write. Only writing 1 has an effect.						
R/W1C	Read/Write. For each bit in the field, writing 1 clears					
	that bit. Writing 0 has no effect.					
W	Write-only. When read this field returns 0.					
W1	Write-only. Only writing 1 has an effect.					

Table 1.1: Register Access Abbreviations

#### 1.2.2.1 Long Name (shortname, at 0x123)

31		8	7	0
	0		fie	eld
	24		8	3

Field	Description	Access	Reset
field	Description of what this field is used for.	R/W	15

## 1.3 Background

There are several use cases for dedicated debugging hardware, both internal to a CPU core and with an external connection. This specification addresses the use cases listed below. Implementations can choose not to implement every feature, which means some use cases might not be supported.

- Debugging low-level software in the absence of an OS or other software.
- Debugging issues in the OS itself.
- Bootstrapping a system to test, configure, and program components before there is any executable code path in the system.

• Accessing hardware on a system without a working CPU.

In addition, even without a hardware debugging interface, architectural support in a RISC-V CPU can aid software debugging and performance analysis by allowing hardware triggers and breakpoints. This specification aims to define common resources which can be used for different cases.

When debugging software, this specification distinguishes between two forms of external debugging. The first is *halt mode* debugging, where an external debugger halts some or all components of a platform and inspects their state while they are in stasis. The debugger can read and/or modify state, then direct the hardware to execute a single instruction, or continue to run freely.

The second is run mode debugging. In this mode a software debug agent runs on a component (eg. triggered by a timer interrupt or breakpoint on a RISC-V core) which transfers data to or from the debugger without halting the component, only briefly interrupting its program flow. This functionality is essential if the component is controlling some real-time system (like a hard drive) where long timing delays could lead to physical damage. This requires additional software support (both on the system as well as on the debugger), and efficient communication channels between the component and the debugger.

### 1.4 Supported Features

The debug interface described in this specification supports the following features:

- 1. RV32, RV64, and future RV128 are all supported.
- 2. Any hart in the platform can be independently debugged.
- 3. A debugger can discover almost <sup>1</sup> everything it needs to know itself, without user configuration.
- 4. Each hart can be debugged from the very first instruction executed.
- 5. A RISC-V hart can be halted when a software breakpoint instruction is executed.
- 6. Hardware single-step can execute one instruction at a time.
- 7. Debug functionality is independent of the debug transport used.
- 8. The debugger does not need to know anything about the microarchitecture of the cores it is debugging.
- 9. Arbitrary subsets of harts can be halted and resumed simultaneously. (Optional)
- 10. Arbitrary instructions can be executed on a halted hart. That means no new debug functionality is needed when a core has additional or custom instructions or state, as long as there exist programs that can move that state into GPRs. (Optional)
- 11. Registers can be accessed without halting. (Optional)

<sup>&</sup>lt;sup>1</sup>Notable exceptions include information about the memory map and peripherals.

- 12. A running hart can be directed to execute a short sequence of instructions, with little overhead. (Optional)
- 13. A system bus master allows memory access without involving any hart. (Optional)
- 14. A RISC-V hart can be halted when a trigger matches the PC, read/write address/data, or an instruction opcode. (Optional)

While both the mechanism to execute arbitrary instructions and the system bus master are optional, at least one of them must be implemented. Otherwise there is no mechanism to access memory.

This document does not suggest a strategy or implementation for hardware test, debugging or error detection techniqes. Scan, BIST, etc. are out of scope of this specification, but this specification does not intend to limit their use in RISC-V systems.

## Chapter 2

# System Overview

Figure 2.1 shows the main components of External Debug Support. Blocks shown in dotted lines are optional.

The user interacts with the Debug Host (eg. laptop), which is running a debugger (eg. gdb). The debugger communicates with a Debug Translator (eg. OpenOCD, which may include a hardware driver) to communicate with Debug Transport Hardware (eg. Olimex USB-JTAG adapter). The Debug Transport Hardware connects the Debug Host to the Platform's Debug Transport Module (DTM). The DTM provides access to the Debug Module (DM) using the Debug Module Interface (DMI).

The DM allows the debugger to halt any hart in the platform. Abstract commands provide access to GPRs. Additional registers are accessible through abstract commands or by writing programs to the optional Program Buffer.

The Program Buffer allows the debugger to execute arbitrary instructions on a hart. This mechanism can be used to access memory. An optional system bus access block allows memory accesses without using a RISC-V hart to perform the access.

Each RISC-V hart may implement a Trigger Module. When trigger conditions are met, harts will halt and inform the debug module that they have halted.



Figure 2.1: RISC-V Debug System Overview

## Chapter 3

# Debug Module (DM)

The Debug Module implements a translation interface between abstract debug operations and their specific implementation. It might support the following operations:

- 1. Give the debugger necessary information about the implementation. (Required)
- 2. Allow any individual hart to be halted and resumed. (Required)
- 3. Provide status on which harts are halted. (Required)
- 4. Provide read and write access to a halted hart's GPRs. (Required)
- 5. Provide access to a reset signal that allows debugging from the very first instruction after reset. (Required)
- 6. Provide access to other hart registers. (Optional)
- 7. Provide a Program Buffer to force the hart to execute arbitrary instructions. (Optional)
- 8. Allow multiple harts to be halted, resumed, and/or reset at the same time. (Optional)
- 9. Allow direct System Bus Access. (Optional)

In order to implement memory access, a target must implement either the Program Buffer or System Bus Access.

A single DM can debug up to 1024 harts.

## 3.1 Debug Module Interface (DMI)

The Debug Module is a slave to a bus called the Debug Module Interface (DMI). The master of the bus is the Debug Transport Module(s). The Debug Module Interface can be a trivial bus with one master and one slave, or use a more full-featured bus like TileLink or the AMBA Advanced Peripheral Bus. The details are left to the system designer.

The DMI uses between 7 and 32 address bits. It supports read and write operations. The bottom of the address space is used for the DM. Extra space can be used for custom debug devices, other cores, additional DMs, etc.

The Debug Module is controlled via register accesses to its DMI address space.

	Tab	ole 3.1: Debug Module Interface Address Space			
0x00 - 0x3f Registers described in Section 3.11.					
0x40 - 0x5f This is called the 'halt region'. These 32 addresse					
		32-bit words provide access to the halt bit for up to			
		1024 harts. If the hart is halted, the bit is 1.			
		Otherwise the bit is 0. The bit for hart 0 is the LSB			
		in the 32-bit word at 0x40. The bit for hart 1023 is			
		the MSB in the 32-bit word at 0x5f.			

#### 3.2 Reset Control

The Debug Module controls a global reset signal, ndmreset (non-debug module reset), which can reset, or hold in reset, every component in the platform, except for the Debug Module and Debug Transport Modules. Exactly what is affected by this reset is implementation dependent, as long as it is possible to debug programs from the first instruction executed. The Debug Module's own state and registers should only be reset at power-up and while dmactive in dmcontrol is 0. The halt state of harts should be maintained across system reset provided that dmactive is 1, although trigger CSRs may be cleared.

Due to clock and power domain crossing issues, it may not be possible to perform arbitrary DMI accesses across system reset. While ndmreset or any external reset is asserted, the only supported DM operation is accessing dmcontrol. The behavior of other accesses is undefined.

#### 3.3 Selecting Harts

Up to 1024 harts can be connected to a single DM. The debugger selects a hart, and then subsequent halt, resume, reset, and debugging commands are specific to that hart.

A debugger can enumerate all the harts attached to the DM by selecting each hart starting from 0 until anynonexistent in dmstatus is 1.

The debugger can discover the mapping between hart indices and mhartid by using the interface to read mhartid, or by reading the system's Device Tree.

#### Selecting a Single Hart 3.3.1

All debug modules must support selecting a single hart. The debugger can select a hart by writing its index to hartsel. Hart indexes start at 0 and are contiguous until the final index.

#### 3.3.2 Selecting Multiple Harts

Debug Modules may optionally implement a Hart Array Mask register to allow selecting multiple harts at once. The debugger can set bits in the hart array mask register using hawindowsel and hawindow, then apply actions to all selected harts by setting hasel. If this feature is supported, multiple harts can be halted, resumed, and reset simultaneously.

Only the actions initiated by dmcontrol can apply to multiple harts at once, Abstract Commands apply only to the hart selected by hartsel.

#### 3.4 Run Control

The Debug Module can halt selected harts and allow them to run again using the dmcontrol register. After selecting harts, it sets haltreq, then waits for allhalted to indicate the harts are halted before clearing haltreq to 0. Setting haltreq has no effect on harts which are already halted.

To resume, the debugger sets resumereq. This action sets each selected hart's resumeack bit to 0. Once a hart has resumed, it sets its resumeack bit to 1. Thus, the debugger should wait for allresumeack to indicate all harts have resumed before clearing resumereq to 0. If a debugger reads anyresumeack and anyhalted in the same operation, then some selected harts must have resumed and then halted again.

When waiting for a hart to resume, a debugger should examine allresumeack, not allrunning or allhalted, because the hart may immediately halt again due to trigger or step conditions.

Setting resumered on hart which is running clears resumeack but may cause a hart which halts in the future to immediately resume. Debuggers should not depend on this behavior and should not set resumered for running harts.

To halt or resume multiple harts at the same time, the debugger first sets the hart's bits in the hart array mask register, then follows the same procedure but with hasel set to 1. Depending on the desired operation, the debugger might consider the any\* versions of the status instead of all\*.

When halt or resume is requested, a hart must respond in less than one second, unless it is unavailable. (How this is implemented is not further specified. A few clock cycles will be a more typical latency).

#### 3.5 Abstract Commands

The DM supports a set of abstract commands, most of which are optional. Depending on the implementation, the debugger may be able to perform some abstract commands even when the selected hart is not halted. Debuggers can only determine which abstract commands are supported by a given hart in a given state by attempting them and then looking at cmderr in abstractcs to see if they were successful.

Debuggers execute abstract commands by writing them to command. Debuggers can determine whether an abstract command is complete by reading busy in abstracts. If the command takes arguments, the debugger must write them to the data registers before writing to command. If a command returns results, the Debug Module must ensure they are placed in the data registers before busy is cleared. Which data registers are used for the arguments is described in Table 3.2. In all cases the least-significant word is placed in the lowest-numbered data register.

Table 3.2: Use of Data Registers

XLEN	arg0/return value	arg1	arg2
32	data0	data1	data2
64	data0, data1	data2 , data3	data4, data5
128	data0- data3	data4 — data7	data8 - data11

#### 3.5.1 Abstract Command Listing

This section describes each of the different abstract commands and how their fields should be interpreted when they are written to command.

Each abstract command is a 32-bit value. The top 8 bits contain cmdtype which determines the kind of command. Table 3.3 lists all commands.

Table 3.3: Meaning of cmdtype

rabic o.o. meaning of ematype								
cmdtype	Command	Page						
0	Access Register Command	10						
1	Quick Access	11						

#### 3.5.1.1 Access Register

This command gives the debugger access to CPU registers and program buffer. It performs the following sequence of operations:

- 1. Copy data from the register specified by regno into the arg0 region of data, if write is clear and transfer is set.
- 2. Copy data from the argo region of data into the register specified by regno, if write is set and transfer is set.
- 3. Execute the Program Buffer, if postexec is set.

If any of these operations fail, cmderr is set and none of the remaining steps are executed. An implementation may detect an upcoming failure early, and fail the overall command before it reaches the step that would cause failure.

Debug Modules must implement this command and must support read and write access to all GPRs when the selected hart is halted. Debug Modules may optionally support accessing other registers,

or accessing registers when the hart is running. If this command is supported for a register while the hart is running, it must also be supported for a register while the hart is halted. Each individual register (aside from GPRs) may be supported differently across read, write, and halt status.

The encoding of size was chosen to match sbaccess in sbcs.

31	24	23	22	20	19	18	17	16	15	0
cmdtype		0	siz	ze	0	postexec	transfer	write	regno	
8		1	5	3	1	1	1	1	16	

Field	Description						
cmdtype	This is 0 to indicate Access Register Command.						
size	2: Access the lowest 32 bits of the register.						
	3: Access the lowest 64 bits of the register.						
	4: Access the lowest 128 bits of the register.						
	If size specifies a size larger than the register's						
	actual size, then the access must fail. If a register						
	is accessible, then reads of size less than or equal						
	to the register's actual size must be supported.						
postexec	When 1, execute the program in the Program						
	Buffer exactly once after performing the transfer,						
	if any.						
transfer	0: Don't do the operation specified by write.						
	1: Do the operation specified by write.						
	This bit can be used to just execute the Pro-						
	gram Buffer without having to worry about plac-						
	ing valid values into size or regno.						
write	When transfer is set: 0: Copy data from the spec-						
	ified register into arg0 portion of data.						
	1: Copy data from arg0 portion of data into the						
	specified register.						
regno	Number of the register to access, as described in						
	Table 3.4. dpc may be used as an alias for PC if						
	this command is supported on a non-halted hart.						

#### 3.5.1.2 Quick Access

Perform the following sequence of operations:

- 1. If the hart is halted, the command sets cmderr to halt/resume and does not continue.
- 2. Halt the hart. If the hart halts for some other reason (e.g. breakpoint), the command sets cmderr to halt/resume and does not continue.
- 3. Execute the Program Buffer. If an exception occurs, cmderr is set to exception and the program buffer execution ends, but the quick access command continues.

#### 4. Resume the hart.

Implementing this command is optional.

31	24	23		0
cmd	type		0	
8	3		24	

Field	Description
cmdtype	This is 1 to indicate Quick Access command.

Table 3.4: Abstract Register Numbers

0x0000 - 0x0fff	CSRs. The "PC" can be accessed here through dpc.
0x1000 - 0x101f	GPRs
0x1020 - 0x103f	Floating point registers
0xc000 - 0xffff	Reserved for non-standard extensions and internal use.

## 3.6 Program Buffer

To support executing arbitrary instructions on a halted hart, a Debug Module can include a Program Buffer that a debugger can write small programs to. Systems that support all necessary functionality using abstract commands only may choose to omit the Program Buffer.

A debugger can write a small program to the Program Buffer, and then execute it exactly once with the Access Register Abstract Command,

setting the postexec bit in command. If progbufsize is 1, the Program Buffer may only hold a single instruction. This can be a 32-bit instruction, or a compressed instruction in the lower 16 bits accompanied by a compressed nop in the upper 16 bits. If progbufsize is greater than 1, the debugger can write whatever program it likes, but the program must end with ebreak or ebreak.c. If the debugger executes a program that does not terminate with an ebreak instruction, the hart will remain in Debug Mode until it is reset.

While these programs are executed, the hart does not leave Debug Mode (see Section 4.1). If an exception is encountered during execution of the Program Buffer, no more instructions are executed, the hart remains in Debug Mode, and cmderr is set to 3 (exception error). If the debugger executes a program that doesn't terminate, then it loses control of the hart.

Executing the Program Buffer may clobber dpc. If that is the case, it must be possible to read/write dpc using an abstract command with postexec not set. The debugger must attempt to save dpc between halting and executing a Program Buffer, and then restore dpc before leaving Debug Mode.

Allowing Program Buffer execution to clobber dpc allows for direct implementations that don't have a separate PC register, and do need to use the PC when executing the Program Buffer.

The Program Buffer may be implemented as RAM which is accessible to the hart as RAM memory. A debugger can determine if this is the case by executing small programs that attempt to write and read back relative to pc while executing from the Program Buffer. If so, the debugger has more flexibility in what it can do with the program buffer.

#### 3.7 Overview of States

Figure 3.1 shows a conceptual view of the states passed through by a hart during run/halt debugging as influenced by the different fields of dmcontrol, abstractcs, abstractauto, and command.

### 3.8 System Bus Access

When a Program Buffer is present, a debugger can access the system bus by having a RISC-V hart perform the accesses it requires. A Debug Module may also include a System Bus Access block to provide memory access without involving a hart, regardless of whether Program Buffer is implemented. The System Bus Access block uses physical addresses.

Implementing a System Bus Access block has several benefits even when a Debug Module also implements a Program Buffer. First, it is possible to access memory in a running system with minimal impact. Second, it may improve performance when accessing memory. Third, it may provide access to devices that a hart does not have access to.

## 3.9 Quick Access

Depending on the task it is performing, some harts can only be halted very briefly. There are several mechanisms that allow accessing resources in such a running system with a minimal impact on the running hart.

First, an implementation may allow some abstract commands to execute without halting the hart.

Second, the Quick Access abstract command can be used to halt a hart, quickly execute the contents of the Program Buffer, and let the hart run again. Combined with instructions that allow Program Buffer code to access the data registers, as described in 3.11.3, this can be used to quickly perform a memory or register access. For some systems this will be too intrusive, but many systems that can't be halted can bear an occasional hiccup of a hundred or less cycles.

Third, if the System Bus Access block is implemented, it can be used while a hart is running to access system memory.

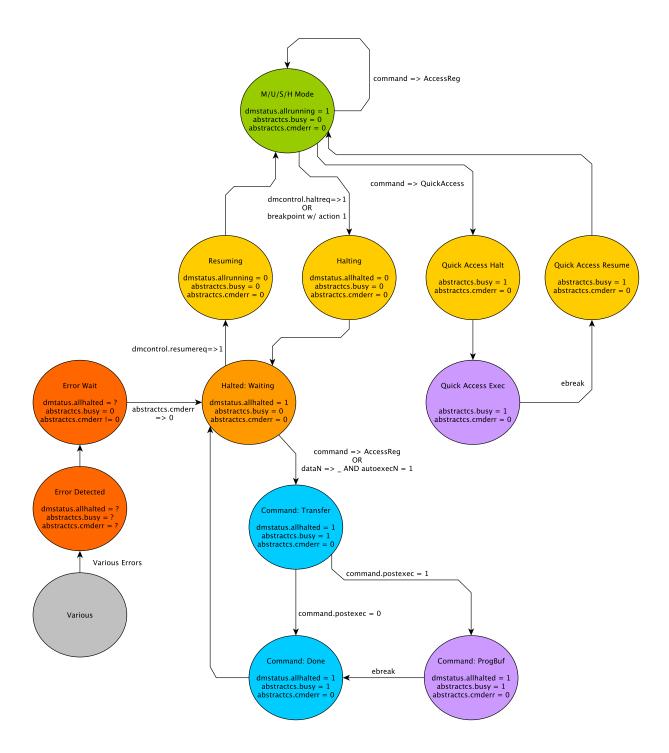


Figure 3.1: Run/Halt Debug State Machine. As only a small amount of state is visibile to the debugger, the states and transitions are conceptual.

## 3.10 Security

To protect intellectual property it may be desirable to lock access to the Debug Module. To allow access during a manufacturing process and not afterwards, a reasonable solution could be to add a fuse bit to the Debug Module that can be used to be permanently disable it. Since this is technology specific, it is not further addressed in this spec.

Another option is to allow the DM to be unlocked only by users who have an access key. A few bits in dmstatus and authdata can support an arbitrarily complex authentication mechanism. When authenticated is clear, the DM must not interact with the rest of the platform in any way.

## 3.11 Debug Module DMI Registers

When read, unimplemented Debug Module DMI Registers return 0. Writing them has no effect.

Table 3.5: Debug Module Debug Bus Registers

Address	Name	Page
0x04	Abstract Data 0	24
0x0f	Abstract Data 11	
0x10	Debug Module Control	17
0x11	Debug Module Status	16
0x12	Hart Info	19
0x13	Halt Summary	20
0x14	Hart Array Window Select	21
0x15	Hart Array Window	21
0x16	Abstract Control and Status	21
0x17	Abstract Command	22
0x18	Abstract Command Autoexec	23
0x19	Device Tree Addr 0	23
0x1a	Device Tree Addr 1	
0x1b	Device Tree Addr 2	
0x1c	Device Tree Addr 3	
0x20	Program Buffer 0	24
0x2f	Program Buffer 15	
0x30	Authentication Data	24
0x38	System Bus Access Control and Status	24
0x39	System Bus Address 31:0	26
0x3a	System Bus Address 63:32	26
0x3b	System Bus Address 95:64	26
0x3c	System Bus Data 31:0	27
0x3d	System Bus Data 63:32	28
0x3e	System Bus Data 95:64	28
0x3f	System Bus Data 127:96	28

#### 3.11.1 Debug Module Status (dmstatus, at 0x11)

The address of this register will not change in the future, because it contains version. It has changed from version 0.11 of this spec.

This register reports status for the overall debug module as well as the currently selected harts, as defined in hasel.

Harts are nonexistent if they will never be part of this system, no matter how long a user waits. Eg. in a simple single-hart system only one hart exists, and all others are nonexistent.

Harts are unavailable if they might exist/become available at a later time. Eg. in a multi-hart system some might temporarily be powered down, or a system might support hot-swapping harts.

31		21	20	18	17		16		15			14			
	0	dmerr		allresumeack		anyresumeack		allnonexistent		it	anynonex	istent			
	11	11 3		3	1			1		1			1		
		13			12	11		10			9			8	
		allunavail		an	yunavail	allru	nning	anyrunning		ng a	allhalted		a	nyhalted	
		1			1	i 1		1		1			1		
					7		6	5		4		3	0		
		a		authe	enticated	auth	nbusy	0	devtr	eevali	d	versi	on		
					1		1	1		1		4		_	

Field	Description	Access	Reset				
dmerr	Gets set if the Debug Module was accessed incor-	R/W1C	0				
	rectly.						
	0 (none): No error.						
	1 (badaddr): There was an access to an unimple-						
	mented Debug Module address.						
	7 (other): An access failed for another reason.						
allresumeack	This field is 1 when all currently selected harts	R	-				
	have acknowledged the previous resumereq.						
anyresumeack	This field is 1 when any currently selected hart	R	-				
	has acknowledged the previous resumereq.						
allnonexistent	This field is 1 when all currently selected harts do	R	-				
	not exist in this system.						
anynonexistent	This field is 1 when any currently selected hart	R	-				
	does not exist in this system.						
allunavail	This field is 1 when all currently selected harts	R	-				
	are unavailable.						
	Continued on next page						

anyunavail	This field is 1 when any currently selected hart is unavailable.	R	-
allrunning	This field is 1 when all currently selected harts are running.	R	-
anyrunning	This field is 1 when any currently selected hart is running.	R	-
allhalted	This field is 1 when all currently selected harts are halted.	R	-
anyhalted	This field is 1 when any currently selected hart is halted.	R	-
authenticated	0 when authentication is required before using the DM. 1 when the authentication check has passed. On components that don't implement authentication, this bit must be preset as 1.	R	Preset
authbusy	<ul> <li>0: The authentication module is ready to process the next read/write to authdata.</li> <li>1: The authentication module is busy. Accessing authdata results in unspecified behavior. authbusy only becomes set in immediate response to an access to authdata.</li> </ul>	R	0
devtreevalid	0: devtreeaddr0-devtreeaddr3 hold information which is not relevant to the Device Tree. 1: devtreeaddr0-devtreeaddr3 registers hold the address of the Device Tree.	R	Preset
version	<ol> <li>There is no Debug Module present.</li> <li>There is a Debug Module and it conforms to version 0.11 of this specification.</li> <li>There is a Debug Module and it conforms to version 0.13 of this specification.</li> <li>There is a Debug Module but it does not conform to any available version of this spec.</li> </ol>	R	2

## 3.11.2 Debug Module Control (dmcontrol, at 0x10)

This register controls the overall debug module as well as the currently selected harts, as defined in hasel.

31		30		4	29	28	27	26	
haltred	ı r	esume	ereq	hart	reset	0 ha		hasel	
1		1			1	2	:	1	
25	16	15		2	1	L		0	
harts	el		0		ndmi	reset	dn	nactive	
10			14			Ĺ	1		

Field	Description	Access	Reset
haltreq	Halt request signal for all currently selected harts.	R/W	0
	When set to 1, each selected hart will halt if it is		
	not currently halted.		
	Writing 1 or 0 has no effect on a hart which is		
	already halted, but the bit should be cleared to 0		
	before the hart is resumed.		
	Writes apply to the new value of hartsel and hasel.		
resumereq	Resume request signal for all currently selected	R/W	0
	harts. When set to 1, each selected hart will re-		
	sume if it is currently halted.		
	This bit is ignored while haltreq is set.		
	Writes apply to the new value of hartsel and hasel.		
hartreset	This optional bit controls reset to all the currently	R/W	0
	selected harts. To perform a reset the debugger		
	writes 1, and then writes 0 to deassert the reset		
	signal.		
	If this feature is not implemented, the bit always		
	stays 0, so after writing 1 the debugger can read		
	the register back to see if the feature is supported.		
	Writes apply to the new value of hartsel and hasel.		
hasel	Selects the definition of currently selected harts.	R/W	0
	0: There is a single currently selected hart, that		
	selected by hartsel.		
	1: There may be multiple currently selected harts		
	- that selected by hartsel, plus those selected by		
	the hart array mask register.		
	An implementation which does not implement the		
	hart array mask register should tie this field to 0.		
	A debugger which wishes to use the hart array		
	mask register feature should set this bit and read		
	back to see if the functionality is supported.		
	Continu	ed on nex	xt page

hartsel	The DM-specific index of the hart to select. This	R/W	0
	hart is always part of the currently selected harts.		
ndmreset	This bit controls the reset signal from the DM to	R/W	0
	the rest of the system. The signal should reset		
	every part of the system, including every hart,		
	except for the DM and any logic required to access		
	the DM. To perform a system reset the debugger		
	writes 1, and then writes 0 to deassert the reset.		
dmactive	This bit serves as a reset signal for the Debug	R/W	0
	Module itself.		
	0: The module's state, including authentication		
	mechanism, takes its reset values (the dmactive bit		
	is the only bit which can be written to something		
	other than its reset value).		
	1: The module functions normally.		
	No other mechanism should exist that may result		
	in resetting the Debug Module after power up,		
	including the platform's system reset or Debug		
	Transport reset signals.		
	A debugger may pulse this bit low to get the de-		
	bug module into a known state.		
	Implementations may use this bit to aid debug-		
	ging, for example by preventing the Debug Mod-		
	ule from being power gated while debugging is		
	active.		

### 3.11.3 Hart Info (hartinfo, at 0x12)

This register gives information about the hart currently selected by hartsel.

This register is optional. If it is not present it should read all-zero.

If this register is included, the debugger can do more with the Program Buffer by writing programs which explicitly access the data and/or dscratch registers.

This entire register is read-only.

31	24	23	20	19	17	16	15	12	11	0
	0	nscr	atch	(	)	dataaccess	data	size	data	addr
	8	4	1		3	1	4	:	1:	2

Field	Description		Access	Reset
		Continu	ed on nex	t page

nscratch	Number of dscratch registers available for the	R	Preset
	debugger to use during program buffer execution,		
	starting from dscratch0. The debugger can make		
	no assumptions about the contents of these regis-		
	ters between commands.		
dataaccess	0: The data registers are shadowed in the hart by	R	Preset
	CSR registers. Each CSR register is XLEN bits		
	in size, and corresponds to a single argument, per		
	Table 3.2.		
	1: The data registers are shadowed in the hart's		
	memory map. Each register takes up 4 bytes in		
	the memory map.		
datasize	If dataaccess is 0: Number of CSR registers dedi-	R	Preset
	cated to shadowing the data registers.		
	If dataaccess is 1: Number of 32-bit words in the		
	memory map dedicated to shadowing the data		
	registers.		
dataaddr	If dataaccess is 0: The number of the first CSR	R	Preset
	dedicated to shadowing the data registers.		
	If dataaccess is 1: Signed address of RAM where		
	the data registers are shadowed, to be used to		
	access relative to zero.		


## 3.11.4 Halt Summary (haltsum, at 0x13)

This register contains a summary of which harts are halted.

Each bit contains the logical OR of 32 halt bits. When there are a large number of harts in the system, the debugger can first read this register, and then read from the halt region (0x40-0x5f) to determine which hart is the one that is halted.

This entire register is read-only.


31	30	29	28	27	26
halt1023:992	halt991:960	halt959:928	halt927:896	halt895:864	halt863:832
1	1	1	1	1	1
25	24	23	22	21	20
halt831:800	halt799:768	halt767:736	halt735:704	halt703:672	halt671:640
1	1	1	1	1	1
19	18	17	16	15	14
halt639:608	18 halt607:576	17 halt575:544	16 halt543:512	15 halt511:480	14 halt479:448
halt639:608	halt607:576	halt575:544	halt543:512	halt511:480	halt479:448



#### 3.11.5 Hart Array Window Select (hawindowsel, at 0x14)

This register selects which of the 32-bit portion of the hart array mask register is accessible in hawindow.

The hart array mask register provides a mask of all harts controlled by the debug module. A hart is part of the currently selected harts if the corresponding bit is set in the hart array mask register and hasel in dmcontrol is 1, or if the hart is selected by hartsel.



### 3.11.6 Hart Array Window (hawindow, at 0x15)

This register provides R/W access to a 32-bit portion of the hart array mask register. The position of the window is determined by hawindowsel. I.e. bit 0 refers to hart hawindowsel \* 32, while bit 31 refers to hart hawindowsel \* 32 + 31.



### 3.11.7 Abstract Control and Status (abstractcs, at 0x16)

31	29	28	24	23		13	12	11	10	8	7	5	4	0
(	)	progb	ufsize		0		busy	0	cmd	err	(	)	data	count
;	3	5	5		11		1	1	3		9	3		5

Field	Description	Access	Reset
progbufsize	Size of the Program Buffer, in 32-bit words. Valid	R	Preset
	sizes are 0 - 16.		
	Continu	ued on ne	ext page

busy	1: An abstract command is currently being exe-	R	0
	cuted.		
	This bit is set as soon as command is written, and		
	is not cleared until that command has completed.		
cmderr	Gets set if an abstract command fails. The bits in	R/W1C	0
	this field remain set until they are cleared by writ-		
	ing 1 to them. No abstract command is started		
	until the value is reset to 0.		
	0 (none): No error.		
	1 (busy): An abstract command was executing		
	while command, abstractcs, abstractauto was		
	written, or when one of the data or progbuf reg-		
	isters was read or written.		
	2 (not supported): The requested command is		
	not supported. A command that is not supported		
	while the hart is running may be supported when		
	it is halted.		
	3 (exception): An exception occurred while ex-		
	ecuting the command (eg. while executing the		
	Program Buffer).		
	4 (halt/resume): An abstract command couldn't		
	execute because the hart wasn't in the expected		
	state (running/halted).		
	7 (other): The command failed for another rea-		
	son.		
	Continued	on next pa	ıge

datacount	Number of data registers that are implemented	R	Preset
	as part of the abstract command interface. Valid		
	sizes are 0 - 12.		

#### 3.11.8 Abstract Command (command, at 0x17)

Writes to this register cause the corresponding abstract command to be executed.

Writing while an abstract command is executing causes cmderr to be set.

If cmderr is non-zero, writes to this register are ignored.

cmderr inhibits starting a new command to accommodate debuggers that, for performance reasons, send several commands to be executed in a row without checking cmderr in between. They can safely do so and check cmderr at the end without worrying that one command failed but then a later command (which might have depended on the previous one succeeding) passed.

31	24	23		0
cmd	type		control	
5	3		24	

Field	Description	Access	Reset
cmdtype	The type determines the overall functionality of	W	0
	this abstract command.		
control	This field is interpreted in a command-specific	W	0
	manner, described for each abstract command.		

#### 3.11.9 Abstract Command Autoexec (abstractauto, at 0x18)

This register is optional. Including it allows more efficient burst accesses. Debugger can attempt to set bits and read them back to determine if the functionality is supported.

31	16	15	12	11	0
autoexec	orogbuf	C	)	autoe	xecdata
16		4	Į.		12

Field	Description	Access	Reset
autoexecprogbuf	When a bit in this field is 1, read or write ac-	R/W	0
	cesses the corresponding progbuf word cause the		
	command in command to be executed again.		
autoexecdata	When a bit in this field is 1, read or write accesses	R/W	0
	the corresponding data word cause the command		
	in command to be executed again.		

#### 3.11.10 Device Tree Addr 0 (devtreeaddr0, at 0x19)

When devtreevalid is set, reading this register returns bits 31:0 of the Device Tree address. Reading the other devtreeaddr registers returns the upper bits of the address.

When system bus mastering is implemented, this must be an address that can be used with the System Bus Access module. Otherwise, this must be an address that can be used to access the Device Tree from the hart with ID 0.

If devtreevalid is 0, then the devtreeaddr registers hold identifier information which is not further specified in this document.

The Device Tree itself is described in the RISC-V Privileged Specification.

This entire register is read-only.




#### 3.11.11 Abstract Data 0 (data0, at 0x04)

Basic read/write registers that may be read or changed by abstract commands.

Accessing them while an abstract command is executing causes cmderr to be set.

Attempts to write them while busy is set does not change their value.

The values in these registers may not be preserved after an abstract command is executed. The only guarantees on their contents are the ones offered by the command in question. If the command fails, no assumptions can be made about the contents of these registers.



#### 3.11.12 Program Buffer 0 (progbuf0, at 0x20)

The progbuf registers provide read/write access to the optional program buffer.

Accessing them while an abstract command is executing causes cmderr to be set.

Attempts to write them while busy is set does not change their value.



## 3.11.13 Authentication Data (authdata, at 0x30)

This register serves as a 32-bit serial port to the authentication module.

When authbusy is clear, the debugger can communicate with the authentication module by reading or writing this register. There is no separate mechanism to signal overflow/underflow.



## 3.11.14 System Bus Access Control and Status (sbcs, at 0x38)

31	21	20	19 17	16	15	14 12
	0	sbsingleread	sbaccess	sbautoincremen	t sbautorea	d sberror
	11	1	3	1	1	3
11	. 5	4	3	2	1	0
S	basize	sbaccess128	sbaccess6	4 sbaccess32	sbaccess16	sbaccess8
	7	1	1	1	1	1

Field	Description	Access	Reset
sbsingleread	When a 1 is written here, triggers a read at the	W1	0
	address in sbaddress using the access size set by		
	sbaccess.		
sbaccess	Select the access size to use for system bus ac-	R/W	2
	cesses triggered by writes to the sbaddress reg-		
	isters or sbdata0.		
	0: 8-bit		
	1: 16-bit		
	2: 32-bit		
	3: 64-bit		
	4: 128-bit		
	If an unsupported system bus access size is writ-		
	ten here, the DM does not perform the access and		
	sberror is set to 3.		
	Continu	ed on nex	kt page

sbautoincrement	When 1, sbaddress is incremented by the access	R/W	0
	size (in bytes) selected in sbaccess after every sys-		
	tem bus access.		
sbautoread	When 1, every read from sbdata0 automatically	R/W	0
	triggers a system bus read at the (possibly auto-		
	incremented) address.		
sberror	When the debug module's system bus master	R/W1C	0
	causes a bus error, this field gets set. The bits		
	in this field remain set until they are cleared by		
	writing 1 to them. While this field is non-zero, no		
	more system bus accesses can be initiated by the		
	debug module.		
	0: There was no bus error.		
	1: There was a timeout.		
	2: A bad address was accessed.		
	3: There was some other error (eg. alignment).		
	4: The system bus master was busy when one of		
	the sbaddress or sbdata registers was written,		
	or sbdata0 was read when it had stale data.		
sbasize	Width of system bus addresses in bits. (0 indi-	R	Preset
	cates there is no bus access support.)		
sbaccess128	1 when 128-bit system bus accesses are supported.	R	Preset
sbaccess64	1 when 64-bit system bus accesses are supported.	R	Preset
sbaccess32	1 when 32-bit system bus accesses are supported.	R	Preset
sbaccess16	1 when 16-bit system bus accesses are supported.	R	Preset
sbaccess8	1 when 8-bit system bus accesses are supported.	R	Preset

## 3.11.15 System Bus Address 31:0 (sbaddress0, at 0x39)

If sbasize is 0, then this register is not present.

When the system bus master is busy, writes to this register will set sberror.

If sberror is 0 and sbautoread is set then the system bus master will start to read after updating the address from address. The access size is controlled by sbaccess in sbcs.

If sbsingleread is set, the bit is cleared.



Field	Description	Access	Reset
address	Accesses bits 31:0 of the physical address in	R/W	0
	sbaddress.		

#### 3.11.16 System Bus Address 63:32 (sbaddress1, at 0x3a)



Field	Description	Access	Reset
address	Accesses bits 63:32 of the physical address in	R/W	0
	sbaddress (if the system address bus is that wide).		

## 3.11.17 System Bus Address 95:64 (sbaddress2, at 0x3b)

If sbasize is less than 65, then this register is not present.



Field	Description	Access	Reset
address	Accesses bits 95:64 of the physical address in	R/W	0
	sbaddress (if the system address bus is that		
	wide).		

#### 3.11.18 System Bus Data 31:0 (sbdata0, at 0x3c)

If all of the sbaccess bits in sbcs are 0, then this register is not present.

Any successful system bus read updates the data in this register, and marks it no longer stale.

If sberror isn't 0 then accesses do nothing.

Writes to this register:


- 1. If the bus master is busy then accesses set sberror, and don't do anything else.
- 2. Start a bus write of sbdata to sbaddress.
- 3. If sbautoincrement is set, increment sbaddress.

Reads from this register:

1. If the register is marked stale, then set sberror and don't do anything else.

- 2. "Return" the data.
- 3. Mark the register stale.
- 4. If sbautoincrement is set, increment sbaddress.
- 5. If sbautoread is set, start another system bus read.

Only sbdata0 has this behavior. The other sbdata registers have no side effects. On systems that have buses wider than 32 bits, a debugger should access sbdata0 after accessing the other sbdata registers.



Field	Description	Access	Reset
data	Accesses bits 31:0 of sbdata.	R/W	0

#### 3.11.19 System Bus Data 63:32 (sbdata1, at 0x3d)


If sbaccess64 and sbaccess128 are 0, then this register is not present.



Field	Description	Access	Reset
data	Accesses bits 63:32 of sbdata (if the system bus	R/W	0
	is that wide).		

#### 3.11.20 System Bus Data 95:64 (sbdata2, at 0x3e)


This register only exists if sbaccess128 is 1.



Field	Description	Access	Reset
data	Accesses bits 95:64 of sbdata (if the system bus	R/W	0
	is that wide).		

#### 3.11.21 System Bus Data 127:96 (sbdata3, at $0\mathrm{x}3\mathrm{f})$

This register only exists if sbaccess128 is 1.



Field	Description	Access	Reset
data	Accesses bits 127:96 of sbdata (if the system bus	R/W	0
	is that wide).		

## Chapter 4

# RISC-V Debug

Modifications to the RISC-V core to support debug are kept to a minimum. There is a special execution mode (Debug Mode) and a few extra CSRs. The DM takes care of the rest.

## 4.1 Debug Mode

Debug Mode is a special processor mode used only when the core is halted for external debugging. How Debug Mode is implemented is not specified here.

When executing code from the Program Buffer, the processor stays in Debug Mode and the following apply:

- 1. All operations are executed at machine mode privilege level, except that mprv in mstatus is ignored.
- 2. All interrupts are masked.
- 3. Exceptions don't update any registers. That includes cause, epc, badaddr, dpc, and mstatus. They do end execution of the Program Buffer.
- 4. No action is taken if a trigger matches.
- 5. Trace is disabled.
- 6. Counters may be stopped, depending on stopcount in dcsr.
- 7. Timers may be stopped, depending on stoptime in dcsr.
- 8. The wfi instruction acts as a nop.
- 9. Almost all instructions that change the privilege level have undefined behavior. This includes ecall, mret, hret, sret, and uret. (To change the privilege level, the debugger can write prv in dcsr). The only exception is ebreak. When that is executed in Debug Mode, it halts the processor again but without updating dpc or dcsr.

## 4.2 Load-Reserved/Store-Conditional Instructions

The reservation registered by an lr instruction on a memory address may be lost when entering Debug Mode or while in Debug Mode. This means that there may be no forward progress if Debug Mode is entered between lr and sc pairs.

#### 4.3 Reset

If the halt signal is asserted when a core comes out of reset, the core must enter Debug Mode before executing any instructions, but after performing any initialization that would usually happen before the first instruction is executed.

#### 4.3.1 dret Instruction

To return from Debug Mode, a new instruction is defined: dret. It has an encoding of 0x7b200073. On harts which support this instruction, executing dret in Debug Mode changes pc to the value stored in dpc. The current privilege level is changed to that specified by prv in dcsr. The hart is no longer in debug mode.

It is not necessary for the debugger to know whether an implementation supports dret, as the Debug Module will ensure that it is executed if necessary. It is defined in this specification only to reserve the opcode and allow for reusable Debug Module implementations.

## 4.4 Core Debug Registers

The supported Core Debug Registers must be implemented for each hart that can be debugged.

These registers are only accessible from Debug Mode.

Table 4.1: Core Debug Registers

Address	Name	Page
0x7b0	Debug Control and Status	31
0x7b1	Debug PC	32
0x7b2	Debug Scratch Register 0	
0x7b3	Debug Scratch Register 1	

## 4.4.1 Debug Control and Status (dcsr, at 0x7b0)

31	28	27	16	1	.5	14		13			12		11	
xdebu	gver		0	ebre	akm	0	el	orea	ks	eb	real	кu	stepie	į
4			12		1	1		1			1		1	
		10		9	8	6	5	3	2		1	0		
	stop	coun	t sto	otime	cau	se	C	)	ste	р	рі	rv		
		1		1	3		3	3	1		6	2	_	

Field	Description	Access	Reset
xdebugver	0: There is no external debug support.	R	Preset
	4: External debug support exists as it is described		
	in this document.		
	15: There is external debug support, but it does		
	not conform to any available version of this spec.		
ebreakm	When 1, ebreak instructions in Machine Mode	R/W	0
	enter Debug Mode.		
ebreaks	When 1, ebreak instructions in Supervisor Mode	R/W	0
	enter Debug Mode.		
ebreaku	When 1, ebreak instructions in User/Application	R/W	0
	Mode enter Debug Mode.		
stepie	0: Interrupts are disabled during single stepping.	R/W	0
	1: Interrupts are enabled during single stepping.		
	Implementations may hard wire this bit to 0. The		
	debugger must read back the value it writes to		
	check whether the feature is supported. If not		
	supported, interrupt behavior can be emulated by		
	the debugger.		
stopcount	0: Increment counters as usual.	R/W	Preset
	1: Don't increment any counters while in Debug		
	Mode or on ebreak instructions that cause en-		
	try into Debug Mode. These counters include the		
	cycle and instret CSRs. This is preferred for		
	most debugging scenarios.		
	An implementation may choose not to support		
	writing to this bit. The debugger must read back		
	the value it writes to check whether the feature is		
	supported.		
	Continu	ied on ne	ext page

stoptime	0: Increment timers as usual.	R/W	Preset
'	1: Don't increment any hart-local timers while in	,	
	Debug Mode.		
	An implementation may choose not to support		
	writing to this bit. The debugger must read back		
	the value it writes to check whether the feature is		
	supported.		
cause	Explains why Debug Mode was entered.	R	0
	When there are multiple reasons to enter Debug		
	Mode in a single cycle, the cause with the highest		
	priority is the one written.		
	1: An ebreak instruction was executed. (priority		
	3)		
	2: The Trigger Module caused a breakpoint ex-		
	ception. (priority 4)		
	3: The debugger requested entry to Debug Mode.		
	(priority 2)		
	4: The hart single stepped because step was set.		
	(priority 1)		
	Other values are reserved for future use.		
step	When set and not in Debug Mode, the hart will	R/W	0
	only execute a single instruction and then enter		
	Debug Mode. If the instruction does not com-		
	plete due to an exception, the hart will immedi-		
	ately enter Debug Mode before executing the trap		
	handler, with appropriate exception registers set.		
prv	Contains the privilege level the hart was operating	R/W	0
	in when Debug Mode was entered. The encoding		
	is described in Table 4.4. A debugger can change		
	this value to change the hart's privilege level when		
	exiting Debug Mode.		
	Not all privilege levels are supported on all harts.		
	If the encoding written is not supported or the		
	debugger is not allowed to change to it, the hart		
	may change to any supported privilege level.		

## 4.4.2 Debug PC (dpc, at 0x7b1)

Upon entry to debug mode, dpc is updated with the virtual address of the next instruction to be executed. The behavior is described in more detail in Table 4.2.

Cause	Virtual Address in DPC
ebreak	Address of the ebreak instruction
single step	Address of the instruction that would be executed
	next if no debugging was going on. Ie. $pc + 4$ for
	32-bit instructions that don't change program flow,
	the destination PC on taken jumps/branches, etc.
trigger module	If timing is 0, the address of the instruction which
	caused the trigger to fire. If timing is 1, the address of
	the next instruction to be executed at the time that
	debug mode was entered.
halt request	Address of the next instruction to be executed at the
	time that debug mode was entered

Table 4.2: Virtual address in DPC upon Debug Mode Entry

When resuming, the hart's PC is updated to the virtual address stored in dpc. A debugger may write dpc to change where the hart resumes.

XLEN-1	0
dpc	
XLEN	

### 4.4.3 Debug Scratch Register 0 (dscratch0, at 0x7b2)

Optional scratch register that can be used by implementations that need it. A debugger must not write to this register unless hartinfo explicitly mentions it (the Debug Module may use this register internally).

#### 4.4.4 Debug Scratch Register 1 (dscratch1, at 0x7b3)

Optional scratch register that can be used by implementations that need it. A debugger must not write to this register unless hartinfo explicitly mentions it (the Debug Module may use this register internally).

## 4.5 Virtual Debug Registers

Virtual debug registers are a requirement on the debugger SW/interface, not on the Core designer.

Users of the debugger shouldn't need to know about the core debug registers, but may want to change things affected by them. A virtual register is one that doesn't exist directly in the hardware, but that the debugger exposes as if it does.

Table 4.3: Virtual Core Debug Registers

Address	Name	Page
virtual	Privilege Level	34

Table 4.4: Privilege Level Encoding

Encoding	Privilege Level
0	User/Application
1	Supervisor
3	Machine

## 4.5.1 Privilege Level (priv, at virtual)

User can read this register to inspect the privilege level that the hart was running in when the hart halted. User can write this register to change the privilege level that the hart will run in when it resumes.

This register contains prv from dcsr, but in a place that the user is expected to access. The user should not access dcsr directly, because doing so might interfere with the debugger.

Field	Description	Access	Reset
prv	Contains the privilege level the hart was operating	R/W	0
	in when Debug Mode was entered. The encoding		
	is described in Table 4.4, and matches the priv-		
	ilege level encoding from the RISC-V Privileged		
	ISA Specification. A user can write this value to		
	change the hart's privilege level when exiting De-		
	bug Mode.		

## Chapter 5

# Trigger Module

Triggers can cause a breakpoint exception, entry into Debug Mode, or a trace action without having to execute a special instruction. This makes them invaluable when debugging code from ROM. They can trigger on execution of instructions at a given memory address, or on the address/data in loads/stores. These are all features that can be useful without having the Debug Module present, so the Trigger Module is broken out as a separate piece that can be implemented separately.

Each trigger may support a variety of features. A debugger can build a list of all triggers and their features as follows:

- 1. Write 0 to tselect.
- 2. Read back tselect to confirm this trigger exists. If not, exit.
- 3. Read tdata1, and possible tdata2 and tdata3 depending on the trigger type.
- 4. If type is 0, this trigger doesn't exist. Exit the loop.
- 5. Repeat, incrementing the value in tselect.

There are two ways to check whether a given trigger is the last one to support these implementations:

- 1. When no hardware triggers are implemented at all, all related registers return 0. The algorithm above terminates when checking type.
- 2. When 2 triggers are implemented, tselect is just a single bit that selects one of the two. When the debugger writes 2, it reads back as 0 which terminates the enumeration.

## 5.1 Trigger Registers

The trigger registers are only accessible in machine and Debug Mode to prevent untrusted user code from causing entry into Debug Mode without the OS's permission.

Table 9.1. Higger Registers								
Address	Name	Page						
0x7a0	0x7a0 Trigger Select							
0x7a1	Trigger Data 1	36						
0x7a1	Match Control	37						
0x7a1	Instruction Count	41						
0x7a2	Trigger Data 2	37						
0x7a3	Trigger Data 3	37						

Table 5.1: Trigger Registers

#### 5.1.1 Trigger Select (tselect, at 0x7a0)

This register determines which trigger is accessible through the other trigger registers. The set of accessible triggers must start at 0, and be contiguous.

Writes of values greater than or equal to the number of supported triggers may result in a different value in this register than what was written. Debuggers should read back the value to confirm that what they wrote was a valid index.

Since triggers can be used both by Debug Mode and M Mode, the debugger must restore this register if it modifies it.

XLEN-1	0
index	
XLEN	

#### 5.1.2 Trigger Data 1 (tdata1, at 0x7a1)

XLEN-1	XLEN-4	XLEN-5	XLEN-6	0
type		hmode	data	
4		1	XLEN - 5	

Field	Description	Access	Reset
type	0: There is no trigger at this tselect.	R	Preset
	1: The trigger is a legacy SiFive address match		
	trigger. These should not be implemented and		
	aren't further documented here.		
	2: The trigger is an address/data match trig-		
	ger. The remaining bits in this register act as		
	described in mcontrol.		
	3: The trigger is an instruction count trigger. The		
	remaining bits in this register act as described in		
	icount.		
	15: This trigger exists (so enumeration shouldn't		
	terminate), but is not currently available.		
	Other values are reserved for future use.		
hmode	0: Both Debug and M Mode can write the tdata	R/W	0
	registers at the selected tselect.		
	1: Only Debug Mode can write the tdata regis-		
	ters at the selected tselect. Writes from other		
	modes are ignored.		
	This bit is only writable from Debug Mode.		
data	Trigger-specific data.	R/W	Preset

## 5.1.3 Trigger Data 2 (tdata2, at 0x7a2)

Trigger-specific data.



#### 5.1.4 Trigger Data 3 (tdata3, at 0x7a3)

Trigger-specific data.



#### 5.1.5 Match Control (mcontrol, at 0x7a1)

This register is accessible as tdata1 when type is 2.

Writing unsupported values to any field in this register results in the reset value being written

instead. When a debugger wants to use a feature, it must write the appropriate value and then read back the register to determine whether it is supported.

Address and data trigger implementation are heavily dependent on how the processor core is implemented. To accommodate various implementations, execute, load, and store address/data triggers may fire at whatever point in time is most convenient for the implementation. The debugger may request specific timings as described in timing. Table 5.2 suggests timings for the best user experience.

Table 5.2: Suggested Breakpoint Timings

Match Type	Suggested Trigger Timing
Execute Address	Before
Execute Instruction	Before
Execute Address+Instruction	Before
Load Address	Before
Load Data	After
Load Address+Data	After
Store Address	Before
Store Data	Before
Store Address+Data	Before

	XLEN-1	XLE	N-4	XLEN-5	XLI	EN-6	XL	EN-	11	XLEI	N-12	20	19	18
type			dmode	maskmax		0			select	timing				
	4	1	1			6					XLEN - 31	1	1	
		17	12	11	10	7	6	5	4	3	2	1	0	
	action		ion	chain	ma	tch	m	h	S	u	execute	store	load	
			3	1		1	1	1	1	1	1	1	1	

Field	Description	Access	Reset				
maskmax	Specifies the largest naturally aligned powers-of-	R	Preset				
	two (NAPOT) range supported by the hardware.						
	The value is the logarithm base 2 of the number						
	of bytes in that range. A value of 0 indicates						
	that only exact value matches are supported (one						
	byte range). A value of 63 corresponds to the						
	maximum NAPOT range, which is $2^{63}$ bytes in						
	size.						
Continued or							

select	0: Perform a match on the virtual address.	R/W	0						
	1: Perform a match on the data value loaded/s-								
	tored, or the instruction executed.								
timing	,								
	fore the instruction that triggered it is executed,								
	but after all preceding instructions are are com-								
	mitted.								
	1: The action for this trigger will be taken af-								
	ter the instruction that triggered it is executed.								
	It should be taken before the next instruction is								
	executed, but it is better to implement triggers								
	and not implement that suggestion than to not								
	implement them at all.								
	Most hardware will only implement one timing or								
	the other, possibly dependent on select, execute,								
	load, and store. This bit primarily exists for the								
	hardware to communicate to the debugger what								
	will happen. Hardware may implement the bit								
	fully writable, in which case the debugger has a								
	little more control.								
	Data load triggers with timing of 0 will result in								
	the same load happening again when the debugger								
	lets the core run. For data load triggers, debug-								
	gers must first attempt to set the breakpoint with								
	timing of 1.								
	A chain of triggers that don't all have the same								
	timing value will never fire (unless consecutive in-								
	structions match the appropriate triggers).								
	Continued on next page								

action	Determines what happens when this trigger matches.	R/W	0								
	0: Raise a breakpoint exception. (Used when soft-										
	ware wants to use the trigger module without an										
	external debugger attached.)										
	1: Enter Debug Mode. (Only supported when hmode is 1.)										
	,										
	2: Start tracing.										
	3: Stop tracing.										
	4: Emit trace data for this match. If it is a data										
	access match, emit appropriate Load/Store Ad-										
	dress/Data. If it is an instruction execution, emit										
	its PC.										
	Other values are reserved for future use.	D /337	0								
chain	0: When this trigger matches, the configured ac-	R/W	0								
	tion is taken.										
	1: While this trigger does not match, it prevents										
	the trigger with the next index from matching.	D /111									
match	0: Matches when the value equals tdata2.	R/W	0								
	1: Matches when the top M bits of the value										
	match the top M bits of tdata2. M is XLEN-1										
	minus the index of the least-significant bit con-										
	taining 0 in tdata2.										
	2: Matches when the value is greater than (un-										
	signed) or equal to tdata2.										
	3: Matches when the value is less than (unsigned)										
	tdata2.										
	4: Matches when the lower half of the value equals										
	the lower half of tdata2 after the lower half of the										
	value is ANDed with the upper half of tdata2.										
	5: Matches when the upper half of the value										
	equals the lower half of tdata2 after the upper half of the value is ANDed with the upper half of										
	tdata2.										
	Other values are reserved for future use.										
	Continued on	next pa	ge								

m	When set, enable this trigger in M mode.	R/W	0
h	When set, enable this trigger in H mode.	R/W	0
S	When set, enable this trigger in S mode.	R/W	0
u	When set, enable this trigger in U mode.	R/W	0
execute	When set, the trigger fires on the virtual address	R/W	0
	or opcode of an instruction that is executed.		
store	When set, the trigger fires on the virtual address	R/W	0
	or data of a store.		
load	When set, the trigger fires on the virtual address	R/W	0
	or data of a load.		

#### 5.1.6 Instruction Count (icount, at 0x7a1)

This register is accessible as tdata1 when type is 3.

Warning! icount is just a proposal. So far nobody has commented on it, so it could very easily be removed or changed in the future.

Writing unsupported values to any field in this register results in the reset value being written instead. When a debugger wants to use a feature, it must write the appropriate value and then read back the register to determine whether it is supported.

This trigger type is intended to be used as a single step that's useful both for external debuggers and for software monitor programs. For that case it is not necessary to support count greater than 1. The only two combinations of the mode bits that are useful in those scenarios are u by itself, or m, h, s, and u all set.

If the hardware limits count to 1, and changes mode bits instead of decrementing count, this register can be implemented with just 2 bits. One for u, and one for m, h, and s tied together. If only the external debugger or only a software monitor needs to be supported, a single bit is enough.

XLEN-1	XLEN-4	XLEN-5	XLEN-6	24	23	10	9	8	7	6	5	0
typ	ре	dmode	0		cou	ınt	m	h	S	u	actio	on
4		1	XLEN -	29	1.	4	1	1	1	1	6	

Field	Description	Access	Reset					
count	When count is decremented to 0, the trigger fires.	R/W	1					
	Instead of changing count from 1 to 0, it is also							
	acceptable for hardware to clear $m$ , $h$ , $s$ , and $u$ .							
	This allows count to be hard-wired to 1 if this							
	register just exists for single step.							
	Continued on next page							

m	When set, every instruction completed or excep-	R/W	0
	tion taken in M mode decrements count by 1.		
h	When set, every instruction completed or excep-	R/W	0
	tion taken in H mode decrements count by 1.		
S	When set, every instruction completed or excep-	R/W	0
	tion taken in S mode decrements count by 1.		
u	When set, every instruction completed or excep-	R/W	0
	tion taken in U mode decrements count by 1.		
action	Determines what happens when this trigger	R/W	0
	matches.		
	0: Raise a breakpoint exception. (Used when soft-		
	ware wants to use the trigger module without an		
	external debugger attached.)		
	1: Enter Debug Mode. (Only supported when		
	hmode is 1.)		
	2: Start tracing.		
	3: Stop tracing.		
	4: Emit trace data for this match. If it is a data		
	access match, emit appropriate Load/Store Ad-		
	dress/Data. If it is an instruction execution, emit		
	its PC.		
	Other values are reserved for future use.		

## Chapter 6

# Debug Transport Module (DTM)

Debug Transport Modules provide access to the DM over one or more transports (eg. JTAG or USB).

There may be multiple DTMs in a single platform. Ideally every component that communicates with the outside world includes a DTM, allowing a platform to be debugged through every transport it supports. For instance a USB component could include a DTM. This would trivially allow any platform to be debugged over USB. All that is required is that the USB module already in use also has access to the Debug Module Interface.

Using multiple DTMs at the same time is not supported. It is left to the user to ensure this does not happen.

This specification defines a JTAG DTM in Section 6.1. Additional DTMs may be added in future versions of this specification.

## 6.1 JTAG Debug Transport Module

This Debug Transport Module is based around a normal JTAG Test Access Port (TAP). The JTAG TAP allows access to arbitrary JTAG registers by first selecting one using the JTAG instruction register (IR), and then accessing it through the JTAG data register (DR).

#### 6.1.1 JTAG Background

JTAG refers to IEEE Std 1149.1-2013. It is a standard that defines test logic that can be included in an integrated circuit to test the interconnections between integrated circuits, test the integrated circuit itself, and observe or modify circuit activity during the components normal operation. This specification uses the latter functionality. The JTAG standard defines a Test Access Port (TAP) that can be used to read and write a few custom registers, which can be used to communicate with debug hardware in a component.

#### 6.1.2 JTAG DTM Registers

JTAG TAPs used as a DTM must have an IR of at least 5 bits. When the TAP is reset, IR must default to 00001, selecting the IDCODE instruction. A full list of JTAG registers along with their encoding is in Table 6.1. If the IR actually has more than 5 bits, then the encodings in Table 6.1 should be extended with 0's in their most significant bits. The only regular JTAG registers a debugger might use are BYPASS and IDCODE, but this specification leaves IR space for many other standard JTAG instructions. Unimplemented instructions must select the BYPASS register.

Table 6.1: JTAG DTM TAP Registers

Address	Name	Description	Page
0x00	BYPASS	JTAG recommends this encoding	
0x01	IDCODE	JTAG recommends this encoding	
0x10	DTM Control and Status	For Debugging	45
0x11	Debug Module Interface Access	For Debugging	46
0x12	Reserved (BYPASS)	Reserved for future RISC-V debugging	
0x13	Reserved (BYPASS)	Reserved for future RISC-V debugging	
0x14	Reserved (BYPASS)	Reserved for future RISC-V debugging	
0x15	Reserved (BYPASS)	Reserved for future RISC-V standards	
0x16	Reserved (BYPASS)	Reserved for future RISC-V standards	
0x17	Reserved (BYPASS)	Reserved for future RISC-V standards	
0x1f	BYPASS	JTAG requires this encoding	

#### 6.1.3 IDCODE (at 0x01)

This register is selected (in IR) when the TAP state machine is reset. Its definition is exactly as defined in IEEE Std 1149.1-2013.

This entire register is read-only.

31	28	27	12	11	1	0
Version		PartNumber		Mar	1	
4 16		6	1	1	1	

Field	Description	Access	Reset
Version	Identifies the release version of this part.	R	Preset
PartNumber	Identifies the designer's part number of this part.	R	Preset
Manufld	Identifies the designer/manufacturer of this part.	R	Preset
	Bits 6:0 must be bits 6:0 of the designer/manufac-		
	turer's Identification Code as assigned by JEDEC		
	Standard JEP106. Bits 10:7 contain the modulo-		
	16 count of the number of continuation characters		
	(0x7f) in that same Identification Code.		

## 6.1.4 DTM Control and Status (dtmcs, at 0x10)

The size of this register will remain constant in future versions so that a debugger can always determine the version of the DTM.

31	18	17	16	15	14	12	11	10	9	4	3	0
	0	dmihardreset	dmireset	0	id	le	dmis	stat	abi	ts	vers	ion
	14	1	1	1		3	2	!	6		4	

Field	Description	Access	Reset		
dmihardreset	Writing 1 to this bit does a hard reset of the DTM,	W1	0		
	causing the DTM to forget about any outstand-				
	ing DMI transactions. In general this should only				
	be used when the Debugger has reason to expect				
	that the outstanding DMI transaction will never				
	complete (e.g. a reset condition caused an inflight				
	DMI transaction to be cancelled).				
dmireset	dmireset Writing 1 to this bit clears the sticky error state				
	and allows the DTM to retry or complete the pre-				
	vious transaction.				
idle	This is a hint to the debugger of the minimum	R	Preset		
	number of cycles a debugger should spend in Run-				
	Test/Idle after every DMI scan to avoid a 'busy'				
	return code (dmistat of 3). A debugger must still				
	check dmistat when necessary.				
	0: It is not necessary to enter Run-Test/Idle at				
	all.				
	1: Enter Run-Test/Idle and leave it immediately.				
	2: Enter Run-Test/Idle and stay there for 1 cycle				
	before leaving.				
	And so on.				
Continued on next page					

dmistat	0: No error.	R	0			
	1: Reserved. Interpret the same as 2.					
	2: An operation failed (resulted in op of 2).					
	3: An operation was attempted while a DMI ac-					
	cess was still in progress (resulted in op of 3).					
abits	The size of address in dmi. R Preset					
version	0: Version described in spec version 0.11.	R	1			
	1: Version described in spec version 0.13 (and					
	later?), which reduces the DMI data width to 32					
	bits.					
	15: Version not described in any available version					
	of this spec.					

#### 6.1.5 Debug Module Interface Access (dmi, at 0x11)

This register allows access to the Debug Module Interface (DMI).

In Update-DR, the DTM starts the operation specified in op unless the current status reported in op is sticky.

In Capture-DR, the DTM updates data with the result from that operation, updating op if the current op isn't sticky.

See Section B.1 and Table B.1 for examples of how this is used.

For instance a series of scans may write a Debug Program and execute it. If one of the writes fails but the execution continues, then the Debug Program may hang or have other unexpected side effects.

abits+33	34	33	2	1	0
address			data	О	р
abits			32	2	2

Field	Description	Access	Reset		
address	address   Address used for DMI access. In Update-DR this				
	value is used to access the DM over the DMI.				
data	The data to send to the DM over the DMI during	R/W	0		
	Update-DR, and the data returned from the DM				
	as a result of the previous operation.				
Continued on next page					

The still-in-progress status is sticky to accommodate debuggers that batch together a number of scans, which must all be executed or stop as soon as there's a problem.

op When the debugger writes this field, it has the following meaning:

0: Ignore data and address. (nop)

Don't send anything over the DMI during Update-DR. This operation should never result in a busy or error response. The address and data reported in the following Capture-DR are undefined.

- 1: Read from address. (read)
- 2: Write data to address. (write)
- 3: Reserved.

When the debugger reads this field, it means the following:

- 0: The previous operation completed successfully.
- 1: Reserved.
- 2: A previous operation failed. The data scanned into dmi in this access will be ignored. This status is sticky and can be cleared by writing dmireset in dtmcs.

This indicates that the DM itself responded with an error. Note: there are no specified cases in which the DM would respond with an error, and DMI is not required to support returning errors. 3: An operation was attempted while a DMI request is still in progress. The data scanned into dmi in this access will be ignored. This status is sticky and can be cleared by writing dmireset in dtmcs. If a debugger sees this status, it needs to give the target more TCK edges between Update-DR and Capture-DR. The simplest way to do that is to add extra transitions in Run-Test/Idle. (The DTM, DM, and/or component may be in different clock domains, so synchronization may be required. Some relatively fixed number of TCK ticks may be needed for the request to reach the DM, complete, and for the response to be syn-

chronized back into the TCK domain.)

#### 6.1.6 BYPASS (at 0x1f)

1-bit register that has no effect. It is used when a debugger does not want to communicate with this TAP.

This entire register is read-only.

0

#### 6.1.7 Recommended JTAG Connector

To make it easy to acquire debug hardware, this spec recommends a connector that is compatible with the Atmel AVR JTAG Connector, as described below.

The connector is a .05"-spaced, gold-plated male header with .016" thick hardened copper or beryllium bronze square posts (SAMTEC FTSH-105 or equivalent). Female connectors are compatible  $20\mu m$  gold connectors.

Viewing the male header from above (the pins pointing at your eye), a target's connector looks as it does in Table 6.2. The function of each pin is described in Table 6.3.

Table 6.2: JTAG Connector Diagram

TCK	1	2	GND
TDO	3	4	VCC
TMS	5	6	(SRSTn)
(NC)	7	8	(TRSTn)
TDI	9	10	GND

Table 6.3: JTAG Connector Pinout

1	TCK	JTAG TCK signal, driven by the debug adapter. This		
		pin must be clearly marked in both male and female		
		headers.		
5	TMS	JTAG TMS signal, driven by debug adapter.		
9	TDI	JTAG TDI signal, driven by the debug adapter.		
3	TDO	JTAG TDO signal, driven by the target.		
8	TRSTn	Test Reset (optional, only used by some devices. Used		
		to reset the JTAG TAP Controller).		
4	VCC	Reference voltage for logic high. A debug adapter		
		may attempt to draw up to 20mA from this pin to		
		power itself, but a target is not obligated to provide		
		that power.		
2, 10	GND	Target ground.		
6	SRSTn	Active-low reset signal, driven by the debug adapter.		
		Asserting reset should reset any RISC-V cores as well		
		as any other peripherals on the PCB. It should not		
		reset the debug logic. Although connecting this pin is		
		optional, it is recommended as it allows the debugger		
		to hold the target device in a reset state, which may		
		be essential to debug some scenarios. If not		
		implemented in a target, this pin must not be		
		connected.		

Target connectors may be shrouded. In that case the key slot should be next to pin 5. Female headers should have a matching key.

Debug adapters should be tagged or marked with their isolation voltage threshold (i.e. unisolated,  $250\mathrm{V},\,\mathrm{etc.}$ ).

All debug adapter pins other than GND should be current-limited to 20mA.

# Appendix A

# Hardware Implementations

Below are two possible implementations. A designer could choose one, mix and match, or come up with their own design.

#### A.1 Abstract Command Based

Halting happens by stalling the processor execution pipeline.

Muxes on the register file(s) allow for accessing GPRs and CSRs using the Access Register abstract command.

System Bus Access allows main memory access.

#### A.2 Execution Based

This implementation only implements the Access Register abstract command for GPRs on a halted hart, and relies on the Program Buffer for all other operations.

This method uses the processor's existing pipeline and ability to execute from arbitrary memory locations to avoid modifications to a processor's datapath. When haltreq is set, the Debug Module raises a special interrupt to the selected hart(s). This interrupt causes each hart to enter Debug Mode and jump to a defined memory region that is serviced by the DM. When taking this exception, pc is saved to dpc and cause is updated in dcsr.

The code in the Debug Module causes the hart to execute a "park loop". In the park loop the hart writes its mhartid to a memory location within the Debug Module to indicate that it is halted. To allow the DM to individually control one out of several halted harts, each hart polls for flags in a DM-controlled memory location to determine whether the debugger wants it to execute the Program Buffer or perform a resume.

To execute an abstract command, the DM first populates some internal words of program buffer

according to command. When transfer is set, the debugger populates these words with lw <gpr>, 0x400(zero) or sw 0x400(zero), <gpr>>. 64- and 128-bit accesses use ld/sd and lq/sq respectively. If transfer is not set, these instructions are populated as nops. If execute is set, execution continues to the debugger-controlled Program Buffer, otherwise the debug module causes a ebreak to execute immediately.

When ebreak is executed (indicating the end of the Program Buffer code) the hart returns to its park loop. If an exception is encountered, the hart jumps to a defined debug exception address within the Debug Module. The code at that address causes the hart to write to an address in the Debug Module which indicates exception. Then the hart jumps back to the park loop. The DM infers from the write that there was an exception, and sets cmderr appropriately.

To resume execution, the debug module sets a flag which causes the core to execute a dret. When dret is executed, pc is restored from dpc and normal execution resumes at the privilege set by prv.

data0 etc. are mapped into regular memory at an address relative to zero with only a 12-bit imm. The exact address is an implementation detail that a debugger must not rely on. For example, the data registers might be mapped to 0x400.

For additional flexibility, progbuf0, etc. are mapped into regular memory immediately preceding data0, in order to form a contiguous region of memory which can be used for either program execution or data transfer.

## Appendix B

# Debugger Implementation

This section details how an external debugger might use the described debug interface to perform some common operations on RISC-V cores using the JTAG DTM described in Appendix ??. All these examples assume a 32-bit core but it should be easy to adapt the examples to 64- or 128-bit cores.

To keep the examples readable, they all assume that everything succeeds, and that they complete faster than the debugger can perform the next access. This will be the case in a typical JTAG setup. However, the debugger must always check the sticky error status bits after performing a sequence of actions. If it sees any that are set, then it should attempt the same actions again, possibly while adding in some delay, or explicit checks for status bits.

## B.1 Debug Module Interface Access

To read an arbitrary Debug Module register, select dmi, and scan in a value with op set to 1, and address set to the desired register address. In Update-DR the operation will start, and in Capture-DR its results will be captured into data. If the operation didn't complete in time, op will be 3 and the value in data must be ignored. The busy condition must be cleared by writing dmireset in dtmcs, and then the second scan scan must be performed again. This process must be repeated until op returns 0. In later operations the debugger should allow for more time between Capture-DR and Update-DR.

To write an arbitrary Debug Bus register, select dmi, and scan in a value with op set to 2, and address and data set to the desired register address and data respectively. From then on everything happens exactly as with a read, except that a write is performed instead of the read.

It should almost never be necessary to scan IR, avoiding a big part of the inefficiency in typical JTAG use.

## B.2 Main Loop

A debugger continuously monitors haltsum to see if any harts have spontaneously halted.

## B.3 Halting

To halt a hart, the debugger sets hartsel and haltreq. Then it waits for all halted to become 1.

## B.4 Running

First, the debugger should restore any registers that it has clobbered. Once that's done, it can let the core run by setting resumereq.

## B.5 Single Step

Using the hardware single step feature is almost the same as regular running. The debugger just sets step in dcsr before letting the core run. The core behaves exactly as in the running case, except that interrupts may be disabled (depending on stepie) and it only fetches and executes a single instruction before re-entering Debug Mode.

## **B.6** Accessing Registers

#### **B.6.1** Using Abstract Command

Read s0 using abstract command:

Op	Address	Value	Comment
Write	command	$size = 2,  transfer,  0\mathrm{x}1008$	Read s0
Read	data0	-	Returns value that was in s0

Write mstatus using abstract command:

Op	Address	Value	Comment
Write	data0	new value	
Write	command	size = $2$ , transfer, write, $0x300$	Write mstatus

## B.6.2 Using Program Buffer

Abstract commands are used to exchange data with GPRs. Using this mechanism, other registers can be accessed by moving their value into/out of GPRs.

Write mstatus using program buffer:

Op	Address	Value	Comment
Write	progbuf0	csrw s0,	
		MSTATUS	
Write	progbuf1	ebreak	
Write	data0	new value	
Write	command	size = 2,	Write s0, then execute program buffer
		postexec,	
		transfer,	
		write, $0x1008$	

#### Read f1 using program buffer:

Op	Address	Value	Comment
Write	progbuf0	fmv.x.s s0, f1	
Write	progbuf1	ebreak	
Write	command	postexec	Execute program buffer
Write	command	transfer $0\mathrm{x}1008$	read s0
Read	data0	-	Returns the value that was in f1

## B.7 Reading Memory

#### B.7.1 Using System Bus Access

Read a word from memory using system bus access:

Op	Address	Value	Comment
Write	sbaddress0	address	
Write	sbcs	sbaccess = 2,sbsingleread	Perform a read
Read	sbdata0	-	Value read from memory

Read block of memory using system bus access:

Op	Address	Value	Comment
Write	sbaddress0	address	
Write	sbcs	sbaccess = 2,	Turn on autoread and autoincrement, and perform a
		sbsingleread,	read
		sbautoread,	
		sbautoincremen	t
Read	sbdata0	-	Value read from memory
Read	sbdata0	-	Next value read from memory
Write	sbcs	0	Clear sbautoread
Read	sbdata0	-	Get last value read from memory.

## B.7.2 Using Program Buffer

Read a word from memory using program buffer:

Op	Address	Value	Comment
Write	progbuf0	lw s0, 0(s0)	
Write	progbuf1	ebreak	
Write	data0	address	
Write	command	write, postexec, $0x1008$	Write s0, then execute program buffer
Write	command	0x1008	Read s0
Read	data0	-	Value read from memory

Read block of memory using program buffer:

Op	Address	Value	Comment
Write	progbuf0	lw s1, 0(s0)	
Write	progbuf1	addi s0, s0, 4	
Write	progbuf2	ebreak	
Write	data0	address	
Write	command	write, postexec, $0x1008$	Write s0, then execute program buffer
Write	command	postexec, $0x1009$	Read s1, then execute program buffer
Write	abstractauto	autoexecdata [0]	$\operatorname{Set}$ autoexecdata $[0]$
Read	data0	-	Get value read from memory, then execute program
			buffer
Read	data0	-	Get next value read from memory, then execute
			program buffer
Write	abstractauto	0	Clear autoexecdata [0]
Read	data0	-	Get last value read from memory.

TODO: Table B.1 shows the scans involved in reading a single word using this method.

Table B.1: Memory Read Timeline

	JTAG State	Activity
TODO	TODO	TODO

### B.8 Writing Memory

#### B.8.1 Using System Bus Access

Write a word to memory using system bus access:

Op	Address	Value	Comment
Write	sbaddress0	address	
Write	sbdata0	value	

Write block of memory using system bus access:

Op	Address	Value	Comment
Write	sbaddress0	address	
Write	sbcs	sbaccess = 2,	Turn on autoincrement
		sbautoincremen	t
Write	sbdata0	value0	
Write	sbdata0	value1	
Write	sbdata0	valueN	

#### B.8.2 Using Program Buffer

Write a word to memory using program buffer:

Op	Address	Value	Comment
Write	progbuf0	sw s1, 0(s0)	
Write	progbuf1	ebreak	
Write	data0	value	
Write	command	write, $0x1008$	Write s0
Write	data0	address	
Write	command	write, postexec, $0x1009$	Write s1, then execute program buffer

Write block of memory using program buffer:

Op	Address	Value	Comment
Write	progbuf0	sw s1, 0(s0)	
Write	progbuf1	addi s0, s0, 4	
Write	progbuf2	ebreak	
Write	data0	address	
Write	command	write, $0x1008$	Write s0
Write	data0	value0	
Write	command	write, postexec, $0x1009$	Write s1, then execute program buffer
Write	abstractauto	autoexecdata [0]	$\operatorname{Set}$ autoexecdata $[0]$
Write	data0	value1	
•••			
Write	data0	valueN	
Write	abstractauto	0	Clear autoexecdata [0]

#### **B.9** Handling Exceptions

Generally the debugger can avoid exceptions by being careful with the programs it writes. Sometimes they are unavoidable though, eg. if the user asks to access memory or a CSR that is not implemented. A typical debugger will not know enough about the platform to know what's going to happen, and must attempt the access to determine the outcome.

When an exception occurs while executing the Program Buffer, cmderr becomes set. The debugger can check this field to see whether a program encountered an exception. If there was an exception, it's left to the debugger to know what must have caused it.

#### B.10 Quick Access

Halt the hart for a minimum amount of time to perform a single memory write.

There are a variety of instructions to transfer data between GPRs and the data registers. They are either loads/stores or CSR reads/writes. The specific addresses also vary. This is all specified in hartinfo. The example here uses the pseudo-op transfer dest, src to represent all these options.

Op	Address	Value	Comment
Write	progbuf0	transfer arg2, s0	Save s0
Write	progbuf1	transfer s0, arg0	Read first argument (address)
Write	progbuf2	transfer arg0, s1	Save s1
Write	progbuf3	transfer s1, arg1	Read second argument (data)
Write	progbuf4	sw s1, 0(s0)	
Write	progbuf5	transfer s1, arg0	Restore s1
Write	progbuf6	transfer s0, arg2	Restore s0
Write	progbuf7	ebreak	
Write	data0	address	
Write	data1	data	
Write	command	0x10000000	Perform quick access

## Appendix C

## **Future Ideas**

All items in this section are future ideas and should not be considered part of the specification.

Some future version of this spec may implement some of the following features.

- 1. The spec defines several additions to the Device Tree which enable a debugger to discover hart IDs and supported triggers for all the cores in the system.
- 2. DTMs can function as general bus slaves, so they would look like regular RAM to bus masters.
- 3. Harts can be divided into groups. All the harts in the same group can be halted/run/stepped simultaneously. When a hart hits a breakpoint, all the other harts in the same group also halt within a few clock cycles.
- 4. DTMs are specified for protocols like USB, I2C, SPI, and SWD.
- 5. Core registers can be read without halting the processor.
- 6. The debugger can communicate with the power manager to power cores up or down, and to query their status.
- 7. Serial ports can raise an interrupt when a send/receive queue becomes full/empty.
- 8. The debug interrupt can be masked by running code. If the interrupt is asserted, then deasserted, and then asserted again the debug interrupt happens anyway. This mechanism can be used to eg. read/write memory with minimal interruption, making sure never to interrupt during a critical piece of code.
- 9. The debugger can non-intrusively sample a recent PC value from any running hart.
- 10. The Debug Module can include a serial interface for re-using the DTM interface as a generic communication interface.

#### C.1 Serial Ports

The Debug Module may implement up to 8 serial ports. They support basic flow control and full duplex data transfer between a component and the debugger, essentially allowing the Debug Transport to be used to communicate with a debug monitor running on a hart, or more generally emulate devices which aren't present. All these uses require software support, and are not further specified here. Only the DMI side of the Debug Module serial registers are defined in this specification as the core side interface should look like a peripheral device.

Table C.1: Debug Module Debug Bus Registers

Address	Name	Page
0x34	Serial Control and Status	62
0x35	Serial TX Data	63
0x36	Serial RX Data	63
	0x34 0x35	Address Name  0x34 Serial Control and Status 0x35 Serial TX Data 0x36 Serial RX Data

#### C.1.1 Serial Control and Status (sercs, at 0x34)

If serialcount is 0, this register is not present.

31	28	27	26	24	23	22	21	20	19	18
serialcou	ınt	0	seria	l e	rror7	valid7	full7	error6	valid6	full6
4		1	3		1	1	1	1	1	1
17		16	15	1	4	13	12	11	10	9
error5	V	alid5	full5	err	or4	valid4	full4	error3	valid3	full3
1		1	1	1	L	1	1	1	1	1
8		7	6		5	4	3	2	1	0
error2	V	alid2	full2	err	or1	valid1	full1	error0	valid0	full0
1		1	1		L	1	1	1	1	1

Field	Description	Access	Reset
serialcount	Number of supported serial ports.	R	Preset
serial	Select which serial port is accessed by serrx and	R/W	0
	sertx.		
error0	1 when the debugger-to-core queue for serial port	R/W1C	0
	0 has over or underflowed. This bit will remain		
	set until it is reset by writing 1 to this bit.		
valid0	1 when the core-to-debugger queue for serial port	R	0
	0 is not empty.		
	Conti	nued on ne	ext page

full0	1 when the debugger-to-core queue for serial port	R	0
	0 is full.		


#### C.1.2 Serial TX Data (sertx, at 0x35)

If serial count is 0, this register is not present.

This register provides access to the write data queue of the serial port selected by serial in sercs.

If the error bit is not set and the queue is not full, a write to this register adds the written data to the core-to-debugger queue. Otherwise the error bit is set and the write returns error.

A read to this register returns the last data written.

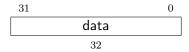

#### C.1.3 Serial RX Data (serrx, at 0x36)

If serialcount is 0, this register is not present.

This register provides access to the read data queues of the serial port selected by serial in sercs.

If the error bit is not set and the queue is not empty, a read from this register reads the oldest entry in the debugger-to-core queue, and removes that entry from the queue. Otherwise the error bit is set and the read returns error.

This entire register is read-only.



## Appendix D

# Change Log

Revision	Date	$\mathbf{Author}(\mathbf{s})$	Description
48f437b	2017-10-06	Megan Wachs	Merge pull request #159 from riscv/unsup-
			ported_access_size
24f0494	2017-10-06	Tim Newsome	Merge branch '0.13' into unsupported_access_size
812686d	2017-10-06	Tim Newsome	Merge pull request #157 from riscv/reset
486ecc $6$	2017-10-05	Tim Newsome	Refuse unsupported bus accesses.
c9cdf9e	2017-10-05	Tim Newsome	Merge branch '0.13' into reset
2be57af	2017-10-04	Tim Newsome	Merge pull request #128 from riscv/connector
d16b390	2017-10-04	Tim Newsome	Merge branch '0.13' into connector
d4118ab	2017-09-30	Tim Newsome	ndmreset can't reset logic required to access DM.
d569387	2017-09-29	Tim Newsome	Merge pull request #154 from riscv/nikhil
2a47bd1	2017-09-29	Tim Newsome	Merge branch '0.13' into nikhil
6269 d9 d	2017-09-29	Tim Newsome	Merge pull request #132 from riscv/progbufsize
c6bd8d1	2017-09-29	Tim Newsome	and -¿ or
58c2441	2017-09-29	Tim Newsome	Mention stepie in Single Step
94c5f78	2017-09-29	Tim Newsome	Clarify ndmreset.
12810b4	2017-09-29	Tim Newsome	Clarify that sbaddress is physical.
5862 fdf	2017-09-29	Tim Newsome	Unify M mode and mprv comment.
aea1bd5	2017-09-29	Tim Newsome	Define behavior when haltreq and resumereq are set
fe76d39	2017-09-28	Megan Wachs	Merge branch '0.13' into progbufsize
146b348	2017-09-28	Megan Wachs	remove superflous 'an'
a5d16c4	2017-09-28	Megan Wachs	remove superfluous 'a'
052a8ab	2017-09-28	Tim Newsome	Clarify that a debugger can lose hart control.
cc52cff	2017-09-28	Tim Newsome	Add dmerr.
$25685 \mathrm{eb}$	2017-09-28	Tim Newsome	Explain that bus master or progbuf is required.
f75ee7d	2017-09-28	Tim Newsome	Clarify debugger can discover "almost" everything
71e6788	2017-09-27	Tim Newsome	Remove description of manual stepping.
9aea347	2017-09-27	Tim Newsome	Move Running/Single Step near Halting.
2090d9b	2017-09-27	Tim Newsome	data0 should be sbdata0 in this table.
5858cfe	2017-09-27	Tim Newsome	Clarify why priv exists.
bc3c2aa	2017-09-27	Tim Newsome	Mention where priv encoding comes from.
ef77cc4	2017-09-27	Tim Newsome	One more attempt to clarify DPC after single step.

80a288e	2017-09-27	Tim Newsome	Clarify instret not incrementing on ebreak.
4359b78	2017-09-27	Tim Newsome	Merge pull request #152 from riscv/nikhil
c163d22	2017-09-20	Tim Newsome	Remove ebreakh.
9971075	2017-09-20	Tim Newsome	Clarify we're talking about privilege
3 fbe 495	2017-09-20	Tim Newsome	Clarify that we're talking about *implementation*
3684854	2017-09-20	Tim Newsome	Use steps environment in sbdata0.
d4eda18	2017-09-20	Tim Newsome	Explain that only sbdata0 has side effects.
ae781c6	2017-09-20	Tim Newsome	Don't refer to internal system bus registers.
875922e	2017-09-20	Tim Newsome	Explain sbdata0 being stale a bit more.
cd44fd5	2017-09-20	Tim Newsome	Clarify autoread
194484b	2017-09-20	Tim Newsome	Clarify hawindow.
02f1aac	2017-09-20	Tim Newsome	Clarify that dataaddr is relative to zero.
0e $9$ b $6$ ae	2017-09-20	Tim Newsome	Clarify nonexistent vs unavailable.
b55ff41	2017-09-20	Tim Newsome	Fix devtreevalid.
4325ef8	2017-09-20	Megan Wachs	Merge branch '0.13' into progbufsize
2eccb $86$	2017-09-20	Tim Newsome	Explicitly state which registers are read-only.
4af505c	2017-09-20	Tim Newsome	Show section numbers for registers.
cbd5573	2017-09-20	Tim Newsome	Thank Nikhil
19c206f	2017-09-20	Tim Newsome	Clarify how to determine whether progbuf is RAM
0651 f7d	2017-09-20	Tim Newsome	Explain what happens if ebreak is missing.
e889dae	2017-09-20	Tim Newsome	Move figure of states into its own section.
cff7b80	2017-09-20	Tim Newsome	Explain when transfer might be used.
6b2ee61	2017-09-20	Tim Newsome	Explain where size encoding came from.
900d8ab	2017-09-20	Tim Newsome	Merge pull request #145 from riscv/nikhil
c9f3b73	2017-09-14	Tim Newsome	Fix typo.
4b25400	2017-09-13	Tim Newsome	Mention dpc in CSRs abstract register numbers.
c3ee426	2017-09-13	Tim Newsome	Move abstract regno table closer to its reference.
111b9a3	2017-09-13	Tim Newsome	cycle -; operation
994afdc	2017-09-13	Tim Newsome	Account for multiple selected harts.
aa4a297	2017-09-13	Tim Newsome	Halt Control -; Run Control
e97c821	2017-09-13	Tim Newsome	continuous -; contiguous
97f73ff	2017-09-13	Tim Newsome	Clarify ndmreset behavior.
6078220	2017-09-13	Tim Newsome	Explain ndmreset
a3d4f30	2017-09-13	Tim Newsome	Describe 'halt region'
272b3d9	2017-09-13	Tim Newsome	Clarify accessing unimplemented DM DMI regs
3e91f1b	2017-09-13	Tim Newsome	Clarify either Prog Buf or Sys Bus Acc is required
e8a6145	2017-09-13	Tim Newsome	Clarify CSR access; remove serial port
ce20766	2017-09-13	Tim Newsome	Remove section referencing itself.
1195a61	2017-09-18	Tim Newsome	Generate constants to be unsigned for clang.
ba200ab	2017-08-18	Megan Wachs	Merge branch '0.13' into progbufsize
8967b0a	2017-08-16	Megan Wachs	Compressed instructions are c.foo, not foo.c
b5698a9	2017-08-16	Megan Wachs	clarify progbufsize description
d221bab	2017-08-16	Megan Wachs	Remove progbufsize enums from register description
d232d64	2017-08-16	Megan Wachs	Merge pull request #134 from riscv/sw-examples-
3202401	201. 00 10		cleanup
0498102	2017-08-16	Megan Wachs	appendix: Use standard assembly format for sw
6e20373	2017-08-15	Megan Wachs	Merge pull request #131 from riscv/devtree
50ea40c	2017-08-15	Megan Wachs	Merge branch '0.13' into devtree
3000100	201. 00 10		

4e51a25	2017-08-10	Tim Newsome	Merge pull request #130 from riscv/trigsign
4456d99	2017-08-09	Tim Newsome	Rename progsize to progbufsize.
55d5b66	2017-08-09	Tim Newsome	Clarify that trigger comparisons are unsigned.
21e35ef	2017-08-09	Tim Newsome	Configuration String -; Device Tree
dc52f28	2017-08-03	Megan Wachs	Merge pull request #127 from riscv/cmdtype
f044f45	2017-08-02	Tim Newsome	Don't require a target to provide 25mA on VCC.
c883943	2017-08-02	Tim Newsome	Add table of Abstract Command Types
d6b8148	2017-08-02	Tim Newsome	Merge pull request #123 from riscv/lists
71f5cb2	2017-08-02	Tim Newsome	Merge branch '0.13' into lists
b83af70	2017-08-02	Megan Wachs	Merge pull request #125 from riscv/no_dmi_error
2a41bd8	2017-08-02	Megan Wachs	Merge branch '0.13' into no_dmi_error
9c73ce8	2017-08-02	Megan Wachs	Merge pull request #111 from riscv/dpc
a814400	2017-08-02	Tim Newsome	Merge branch '0.13' into dpc
8bdc5cd	2017-08-02	Tim Newsome	Merge pull request #126 from riscv/build
985a3df	2017-08-02	Tim Newsome	Fix and speed up build.
95b9108	2017-08-02	mwachs5	DTM: Clarify that there are no cases when DMI
9909100	2017-00-02	mwacnso	would actually return an error.
9c9e0c0	2017-08-02	mwachs5	SystemBus: No longer returns error. So DMI has no
9096000	2017-00-02	IIIwaciisə	'error' return code.
ae1e9e4	2017-07-28	Tim Newsome	Merge branch '0.13' into dpc
5ba18f9	2017-07-28	Tim Newsome Tim Newsome	
			Fix more typos.
c6fef98	2017-07-26	Tim Newsome	Merge pull request #122 from riscv/version
dbc65bf	2017-07-26	Tim Newsome	Fix typos.
bba0ad9	2017-07-26	Tim Newsome	Tighten up introduction lists.
e22d5eb	2017-07-26	Tim Newsome	Add version constants for "not compatible".
c79038e	2017-07-26	Tim Newsome	Small clarification.
9df0411	2017-07-21	Tim Newsome	Incorporate review feedback.
d67419c	2017-07-21	Tim Newsome	Clarify dpc contents.
c562898	2017-07-11	Tim Newsome	Merge pull request #109 from riscv/ll
498cdf4	2017-07-11	Megan Wachs	Merge branch '0.13' into ll
0e707f1	2017-07-11	Megan Wachs	Merge pull request #105 from
			riscv/quick_access_errors
2d34f65	2017-07-11	Tim Newsome	Merge branch '0.13' into ll
a56831c	2017-07-11	Megan Wachs	Merge branch '0.13' into quick_access_errors
65d596e	2017-07-11	Megan Wachs	Merge pull request #106 from riscv/er-
			ror_halt_resume
9f50c05	2017-07-11	Tim Newsome	Use LL instead of L for 64-bit constant suffix.
23 fd 24 a	2017-07-10	Megan Wachs	Cleaning up whitespaces
102 ba67	2017-07-10	Megan Wachs	Merge branch '0.13' into error_halt_resume
1720505	2017-07-10	Megan Wachs	Merge pull request #107 from riscv/csr_individuality
d67f6ef	2017-07-10	Megan Wachs	Merge branch '0.13' into csr_individuality
c1e61b0	2017-07-10	Megan Wachs	Merge pull request $\#108$ from riscv/dcsr_causes
c5ab04c	2017-07-10	Megan Wachs	Update abstract_commands.xml
6e8cdf1	2017-07-10	Megan Wachs	$Update\ abstract\_commands.xml$
cf6e3f2	2017-07-10	Megan Wachs	clarify DCSR.cause
79ffbb9	2017-07-10	Megan Wachs	Clarify implications of CSR read, write, halt
013e191	2017-07-10	Megan Wachs	Clarify when you would get error halt/resume
231e457	2017-07-10	Megan Wachs	Quick Access error clarification

7c760b0	2017-07-03	Megan Wachs	Merge pull request #104 from riscv/serial_to_appendix
c54c2f2	2017-07-03	mwachs5	serial: add the XML file, not the TEX file
ac77477	2017-07-03	mwachs5	serial: Fix compile errors after moving serial port to
acri iii	2011 01 00	III W GOILS O	appendix
6defcb8	2017-07-03	mwachs5	serial: Move serial ports out of main spec and into
0401000	2011 01 00	11111001100	Future Work appendix
3541152	2017-07-03	Megan Wachs	Merge pull request #102 from riscv/remove_trace
a28f639	2017-06-30	mwachs5	remove trace dependencies from Makefile
52a122b	2017-06-30	mwachs5	remove trace section
d9e166b	2017-06-30	mwachs5	remove trace registers
7caf $4$ e $5$	2017-06-30	mwachs5	remove trace appendix
aff0c16	2017-06-30	Megan Wachs	Merge pull request #82 from riscv/intdisable
4688988	2017-06-29	mwachs5	DCSR: define a 'stepie' bit which may be hard-wired
			to $0$ .
443b $3$ fe	2017-06-29	mwachs5	Merge remote-tracking branch 'origin/0.13' into int-
			disable
497ed95	2017-06-29	Megan Wachs	Merge pull request #96 from riscv/j-
		_	tagdtm_non_appendix
f1488c4	2017-06-29	Megan Wachs	Merge branch '0.13' into jtagdtm_non_appendix
920ec9a	2017-06-13	Megan Wachs	Merge pull request #95 from riscv/re-
			move_spontaneous
67 fa7 b0	2017-06-13	Megan Wachs	Merge branch '0.13' into remove_spontaneous
78eb $65$ e	2017-06-13	Megan Wachs	Merge pull request #94 from riscv/anynonexistent
d97b296	2017-06-13	Megan Wachs	Merge branch '0.13' into anynonexistent
61c6d30	2017-06-13	Megan Wachs	Merge pull request #93 from riscv/define-dret-again
389ee69	2017-06-13	Megan Wachs	Merge branch '0.13' into define-dret-again
421dcf2	2017-06-13	Megan Wachs	Merge pull request #97 from riscv/implementa-
			$tion\_deets$
9a0492c	2017-06-13	Megan Wachs	Add missing period and some other small text edits
13ccdbf	2017-06-13	Megan Wachs	fix typo in ProgBuf register macro
b01f989	2017-06-13	mwachs5	implementations: be a bit more concrete about the
			one example implementation we have.
a7b5f83	2017-06-13	mwachs5	jtagdtm: Move it out of the appendix as it is really
			part of the specification
87aceb0	2017-06-13	Megan Wachs	remove "spontaneous"
50b9950	2017-06-13	Megan Wachs	Forward reference for anynonexistent
adea3e2	2017-06-13	Megan Wachs	More clarifications on dret
1b8dd0e	2017-06-13	Megan Wachs	Define DRET instruction
b4f1f43	2017-06-08	Tim Newsome	Merge pull request #79 from riscv/cleanups
09c7f6e	2017-06-08	mwachs5	Merge remote-tracking branch 'origin/0.13' into
			cleanups
617da4c	2017-06-08	Megan Wachs	Update description of R/W1C
de2c56b	2017-06-08	Megan Wachs	Clarify that DCSR is also not updated on ebreak
efa615d	2017-06-07	Tim Newsome	Increase xdebugver field size to 4 bits. (#92)
a0e147a	2017-06-07	Tim Newsome	Address some review comments.
c1b3e54	2017-06-07	Megan Wachs	Merge pull request #91 from riscv/ndmreset
5c7c1bb	2017-06-07	Tim Newsome	Merge branch '0.13' into cleanups

72bb874	2017-06-06	Megan Wachs	Merge branch '0.13' into ndmreset
1fbbe6e	2017-06-06	Megan Wachs	Merge pull request #90 from riscv/dpc_clarifications
89ffe50	2017-06-06	mwachs5	NDMRESET: Clarify what it may and may not do
1932 da0	2017-06-06	mwachs5	DPC: Clarifications on its meaning
03bcafe	2017-06-06	Megan Wachs	Merge pull request #89 from riscv/datacount
6470 fdb	2017-06-06	mwachs5	ABSTRACTCS: Correct inconsistency on the num-
			ber of data words.
1f4a1fe	2017-06-06	Megan Wachs	Merge pull request #88 from riscv/W0_corrections
3ca82b4	2017-06-06	Megan Wachs	More corrections for R vs R/W1C on SERCS
9705 fb8	2017-06-06	Megan Wachs	Correct a bunch of W0 registers
1058690	2017-06-05	Megan Wachs	Merge branch '0.13' into intdisable
7531c41	2017-06-05	Megan Wachs	Merge pull request #80 from riscv/issue76
1347371	2017-06-05	Tim Newsome	Add intdisable to dcsr.
850 bd 87	2017-06-05	Megan Wachs	Merge branch '0.13' into issue76
43307eb	2017-06-05	Megan Wachs	Merge pull request #81 from riscv/issue63
989c60d	2017-06-05	Tim Newsome	Fix language. We can only halt harts, not cores.
517a08b	2017-06-05	Tim Newsome	Incorporate review feedback.
802 be 28	2017-06-05	Tim Newsome	Clarify/fix Quick Access example.
dbcaec8	2017-06-02	Tim Newsome	Merge branch '0.13' into cleanups
b8cc523	2017-06-02	Tim Newsome	Add included tex files as dependencies. (#78)
d0a5959	2017-06-02	Tim Newsome	Merge pull request #77 from riscv/pageno
15f864a	2017-06-01	Tim Newsome	Language cleanups, consistency and typo fixes.
4ecae86	2017-06-01	Tim Newsome	Add page numbers to list-of-register tables.
59b3e4a	2017-05-19	Megan Wachs	Setting up a Travis regression to check for build errors
			(#72)
124 bf 44	2017 - 05 - 17	mwachs5	Debug Module: CMDERR is Write-1-to clear, not
			R/W0
bb6c7f0	2017 - 05 - 17	mwachs5	SW Registers file should be XML, not TEX
d360358	2017-05-10	Megan Wachs	Remove virtual register from core_registers.xml
		(Temporary	
		Acct.)	
bfc64fb	2017-05-10	Megan Wachs	Add missing sw_registers.tex file
		(Temporary	
		Acct.)	
0512 f5 d	2017-05-06	mwachs5	Move virtual 'prv' register to a seperate section to
			make it more clear it is not a real register.
6b3c9d7	2017-05-06	mwachs5	Clarify haltreq/resumereq/resumack
0a487eb	2017-04-26	mwachs5	jtag: Change specified JTAG pinout from Coretex to
			AVR, to provide for TRSTn option.
93cdfaf	2017-04-26	mwachs5	DM: Clarify that DATA/PROGBUF can't be writ-
			ten while busy.
ef98f23	2017-04-19	mwachs5	jtag: Make it clear that a NOP is really a NOP.
a6f8efa	2017-04-17	mwachs5	single_step: Exceptions count as the 'step' comple-
			tion.
bf11e9e	2017-04-17	mwachs5	resumeack: fix some LaTeX cross references
4afa081	2017-04-11	mwachs5	halt/resumereq: Clarify what setting them to 0 or 1
			does
297a39b	2017-04-06	mwachs5	fix chisel build

082c499	2017-04-06	mwachs5	Rename resumed to resumeack, and add more text about what these bits mean.
909d617	2017-04-06	mwachs5	Correct some cross references after removing all the multiply listed registers
dd09914	2017-04-06	mwachs5	Add 'resumedall' and 'resumedany' bits to avoid race condition on about to resume and just halted
feb88fc	2017-04-05	mwachs5	JTAG DTM: Clarify that leading bits are 0 for more than 5-bit IR
75b $96$ ea	2017-04-04	mwachs5	use renamed dm_registers file
9f3ec7e	2017-04-04	mwachs5	debugger_implementation: remove some old TODO and commentary.
45dd5b5	2017-04-04	mwachs5	Don't list out every single DM register for those that are just indexed versions
b8b3aa2	2017-04-04	mwachs5	remove core-side register definitions from Debug Module. Rename dm1 to dm
d979a13	2017-04-04	mwachs5	remove core-side serial port specification, as these should look like implementation-specific devices with appropriate drivers.
b56870b	2017-04-04	mwachs5	Remove the wording about 'debug exception', as it is called breakpoint exception in the RISC-V Spec.
$1\mathrm{e}9347\mathrm{d}$	2017-04-03	mwachs5	Add description of hasel
0 dda 84 d	2017-04-03	mwachs5	JTAG DTM: Clean up TAP register descriptions
82ccde5	2017-04-03	mwachs5	JTAG DTM: Add a hard DMI bit which cancels the outstanding DMI transaction
bd2a3d1	2017-04-03	mwachs5	remove preexec
02c733a	2017-04-03	mwachs5	remove preexec from Abstract State diagram.
1e271d6	2017-04-03	mwachs5	Update Debugger implementation for DMI register access, and fix tex compile issues.
155dda4	2017-04-03	mwachs5	Rewrite HW Implementation examples to describe a pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module
556c2be	2017-04-03	mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers
556c2be 523c64a	2017-04-03 2017-04-03	mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section.
556c2be 523c64a b9a371f	2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.
556c2be 523c64a b9a371f 58b2396	2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file. Re-order the JTAG DTM Sections
556c2be 523c64a b9a371f 58b2396 a8827e2	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4 2c89a86	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5 mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file. move risc-v core debug info into seperate file.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4 2c89a86 e676491	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file. move risc-v core debug info into seperate file. Move System Overview to seperate file
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4 2c89a86 e676491 03df6ee	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file. move risc-v core debug info into seperate file. Move System Overview to seperate file. Move Debug Module description to a seperate file.
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4 2c89a86 e676491 03df6ee 5faa430	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file. move risc-v core debug info into seperate file. Move System Overview to seperate file Move Debug Module description to a seperate file. add back in JTAG DTM in appendix
556c2be 523c64a b9a371f 58b2396 a8827e2 c5417ce 287d5c6 9e873f4 2c89a86 e676491 03df6ee	2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03 2017-04-03	mwachs5	pure abstract command approach, and to not rely on harts executing every instruciton which is fetched from the Debug Module minor wording edits about RISC-V core registers Edits to the Debug Module section. add missing trace.tex file.  Re-order the JTAG DTM Sections Edits to the System Overview. add more sections as seperate files. moving more files to seperate tex files. move trigger info into seperate file. move risc-v core debug info into seperate file. Move System Overview to seperate file. Move Debug Module description to a seperate file.

Section	2c83830	2017-04-03	mwachs5	Merge remote-tracking branch 'origin/0.13' into 0.13
6065alc 1727d14         2017-04-03         Megan Wachs mwachs5         Merge branch '0.13' into intro.edits           815951d         2017-04-03         mwachs5         Use Chapters vs Sections. Needs reorganization.           69ffaf8         2017-03-31         mwachs5         Formatting updates. Make this look more like the RISC-V specs. Need to use chapter vs. section           60ffaf8         2017-03-31         mwachs5         Remove debug_rom.S           112bbac         2017-03-31         Megan Wachs         figures: reorganize the figures into directories.           12d05746         2017-03-22         Megan Wachs         Merge pull request #50 from riscv/add license           165068         2017-03-22         Po-wei Huang         Change some halt mode into debug mode to synchronize with the priv spec.           161339e         2017-03-21         mwachs5         Merge pull request #47 from poweihuang17/0.13           164349e         2017-03-17         mwachs5         Correct duplicated progbuf register names           0797ec1         2017-03-17         mwachs5         Correct duplicated progbuf register names           8e76d93         2017-03-17         mwachs5         dupl_registers: row a few more things around. Reduce abstract data words back to 12.           8bf292         2017-03-17         mwachs5         dupl_registers: row a small bit changes				· · · · · · · · · · · · · · · · · ·
1727.01.4   2017-04-03   mwachs5   Use Chapters vs Sections. Needs reorganization.			_	
Stip551d   2017-04-03   mwachs5   Formatting updates. Make this look more like the RISC-V specs. Need to use chapter vs. section	f727d14			
RISC-V specs. Need to use chapter vs. section			mwachs5	
69fia/S b2763842017-03-31 2017-03-31mwachs5 mwachs5Move XML files into a subdirectory. Remove debug rom.S112bbac 20457462017-03-31 2017-03-32mwachs5 Megan Wachs Megan Wachs 2017-03-22Megan Wachs 				
D276384   2017-03-31   mwachs5   figures: reorganize the figures into directories.	69ffaf8	2017-03-31	mwachs5	
112bbac   2017-03-31   mwachs5   figures: reorganize the figures into directories.				<u> </u>
2d05746         2017-03-31         Megan Wachs         Merge pull request #50 from riscv/add_license           1e5c068         2017-03-22         Megan Wachs         Add LICENSE           0e2d08a         2017-03-22         Megan Wachs         Merge pull request #47 from poweihuang17/0.13           fc17730         2017-03-22         Po-wei Huang         Change some halt mode into debug mode.           8ccf029         2017-03-21         mwachs5         Correct duplicated progbuf register names           7079cc1         2017-03-17         mwachs5         Correct duplicated progbuf register names           8c76d93         2017-03-17         mwachs5         dml_registers: move a few more things around. Reduce abstract data words back to 12.           fbbf292         2017-03-17         mwachs5         access_register: some small bit changes           2e6b0ca         2017-03-17         mwachs5         access_register: some small bit changes           2e6b0ca         2017-03-10         mwachs5         Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.           6f9347a         2017-03-10         mwachs5         Abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.           2017-03-06         mwachs5			mwachs5	9
1e5c0682017-03-27Megan Wachs Megan Wachs (2017-03-22)Add LICENSE Merge pull request #47 from poweihuang17/0.13fe177302017-03-22Po-wei Huang 2017-03-22Change some halt mode into debug mode to synchronize with the priv spec.ged 2017-03-21mwachs5Correct duplicated progbuf register names autoexec: make autoexec bits match the number of data words there really are.8e76d932017-03-17mwachs5dml_registers: move a few more things around. Re- duce abstract data words back to 12.f8bf2922017-03-17mwachs5dml_registers: resolve some address conflicts and in- consistenciesa74dff92017-03-17mwachs5config string: Fix LaTeX compile errors.f83260a2017-03-10mwachs5Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.69347a2017-03-10mwachs5Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.4ea10ff2017-03-10mwachs5abstract: Make autoexec apply to all data and prog- buf words. Make a seperate register which is optional.50084362017-03-06mwachs5Command: use the name 'emdtype' not 'type' to al- low easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5Command: use the name 'emdtype' not 'type' to al- low easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5Command: use the name 'emdtype' not 'type' to al- low easier auto-generation of Scala code.25ccaa82017-03-06mwachs5CONTROL:				
0e2d08a2017-03-22Megan Wachs (2017-03-22)Merge pull request #47 from poweihuang17/0.13 (Change some halt mode into debug mode.) All halt mode changed to debug mode to synchronize with the priv spec.6cf0292017-03-21mwachs5Correct duplicated progbuf register names autoexec: make autoexec bits match the number of data words there really are.6797ec12017-03-17mwachs5autoexec: make autoexec bits match the number of data words there really are.68e76d932017-03-17mwachs5dml_registers: move a few more things around. Reduce abstract data words back to 12.68bf2922017-03-17mwachs5dml_registers: solve some address conflicts and inconsistencies access_register: some small bit changes config string: Fix LaTeX compile errors.680ca2017-03-10mwachs5Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.689347a2017-03-10mwachs5Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.68084362017-03-10mwachs5abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.69bb72c2017-03-06mwachs5Command: use the name 'emdtype' not 'type' to allow easier auto-generation of Scala code.69bb72c2017-03-06mwachs5Hart Array: Add registers for hart array.5d17a352017-03-06mwachs5Consistency and to accurately reflect their functionalities in HW25ccaa8 <t< td=""><td></td><td></td><td>_</td><td>,</td></t<>			_	,
Change some halt mode into debug mode.	0e2d08a		0	Merge pull request #47 from poweihuang17/0.13
8ccf0292017-03-22Po-wei Huang with the priv spec.All halt mode changed to debug mode to synchronize with the priv spec.f143d9e2017-03-21mwachs5Correct duplicated progbuf register names0797ec12017-03-17mwachs5autoexec: make autoexec bits match the number of data words there really are.8e76d932017-03-17mwachs5dml registers: move a few more things around. Re- duce abstract data words back to 12.8bf2922017-03-17mwachs5dml registers: resolve some address conflicts and in- consistenciesa74dff92017-03-17mwachs5access register: some small bit changes2e6b0ca2017-03-10mwachs5config string: Fix LaTeX compile errors.83260a2017-03-10mwachs5Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.6f9347a2017-03-10mwachs5Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.4ea10ff2017-03-10mwachs5abstract: Make autoexec apply to all data and prog- buf words. Make a seperate register which is optional.50084362017-03-06mwachs5Command: use the name 'cmdtype' not 'type' to al- low easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5DM: Move addresses around for better seperation of functionalities in HW25ccaa82017-03-06mwachs5CONTROL: Rename control and status registers to CS for consistency and to accurately reflect their functionality.45cf6c22017-03-06<	fc17730			· · · · · · · · · · · · · · · · · ·
with the priv spec.  Correct duplicated progbuf register names autoexec: make autoexec bits match the number of data words there really are.  8e76d93 2017-03-17 mwachs5 dml_registers: move a few more things around. Re- duce abstract data words back to 12.  f8bf292 2017-03-17 mwachs5 dml_registers: resolve some address conflicts and in- consistencies ar4dff9 2017-03-15 mwachs5 access_register: some small bit changes 2e6b0ca 2017-03-15 mwachs5 config string: Fix LaTeX compile errors.  R83260a 2017-03-10 mwachs5 Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.  Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and prog- buf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to al- low easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionality.  25ccaa8 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 Errors: Make errors write-1-to-clear.			_	
Correct duplicated progbuf register names			9	
0797ec12017-03-17mwachs5autoexec: make autoexec bits match the number of data words there really are.8e76d932017-03-17mwachs5dm1_registers: move a few more things around. Reduce abstract data words back to 12.f8bf2922017-03-17mwachs5dm1_registers: resolve some address conflicts and inconsistenciesa74dff92017-03-17mwachs5access_register: some small bit changes2e6b0ca2017-03-15mwachs5config string: Fix LaTeX compile errors.f83260a2017-03-10mwachs5Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.6f9347a2017-03-10mwachs5Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.4ea10ff2017-03-10mwachs5abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.50084362017-03-10mwachs5abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.aaa13e52017-03-06mwachs5Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5DM: Move addresses around for better seperation of functionalities in HW25ccaa82017-03-06mwachs5CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.45cf6c22017-03-06mwachs5Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.5d36d772017-03-06<	f143d9e	2017-03-21	mwachs5	
Ser6d93   2017-03-17   mwachs5   dm1_registers: move a few more things around. Reduce abstract data words back to 12.   Milling   Mill	0797ec1	2017-03-17		
Ser6d93   2017-03-17   mwachs5   dm1_registers: move a few more things around. Reduce abstract data words back to 12.   Milling   Mill				data words there really are.
dm1_registers: resolve some address conflicts and inconsistencies a74dff9 2017-03-17 mwachs5 access_register: some small bit changes 2e6b0ca 2017-03-15 mwachs5 config string: Fix LaTeX compile errors.  83260a 2017-03-10 mwachs5 Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.  6f9347a 2017-03-10 mwachs5 Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW 25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  88cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  45d6d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	8e76d93	2017-03-17	mwachs5	
consistencies a74dff9 2017-03-17 mwachs5 access_register: some small bit changes 2e6b0ca 2017-03-15 mwachs5 config string: Fix LaTeX compile errors.  R83260a 2017-03-10 mwachs5 Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.  Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  45d6d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				duce abstract data words back to 12.
a74dff92017-03-17mwachs5access_register: some small bit changes2e6b0ca2017-03-15mwachs5config string: Fix LaTeX compile errors.f83260a2017-03-10mwachs5Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.6f9347a2017-03-10mwachs5Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.4ea10ff2017-03-10mwachs5abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.aaa13e52017-03-06mwachs5Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5Hart Array: Add registers for hart array.5d17a352017-03-06mwachs5DM: Move addresses around for better seperation of functionalities in HW25ccaa82017-03-06mwachs5CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.45cf6c22017-03-06mwachs5Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.38cb5a02017-03-06mwachs5Errors: Make errors write-1-to-clear.b436d772017-03-03mwachs5Errors: Clarify that matches are against virtual ad-	f8bf292	2017-03-17	mwachs5	dm1_registers: resolve some address conflicts and in-
2017-03-15 mwachs5 config string: Fix LaTeX compile errors.  R83260a 2017-03-10 mwachs5 Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.  Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  S008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  Hart Array: Add registers for hart array.  DM: Move addresses around for better seperation of functionalities in HW  CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  45d6d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				consistencies
Abstract Commands: clarify that 32-bit reads should always work. This allows reading MISA.  6f9347a 2017-03-10 mwachs5 Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  5008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  45cf6c2 2017-03-08 mwachs5 Errors: Make errors write-1-to-clear.  5d17a37 2017-03-08 mwachs5 Errors: Clarify that matches are against virtual ad-	a74dff9	2017-03-17	mwachs5	access_register: some small bit changes
always work. This allows reading MISA.  Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  5008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  45cf6c7 2017-03-08 mwachs5 triggers: Clarify that matches are against virtual ad-	2e6b0ca	2017-03-15	mwachs5	config string: Fix LaTeX compile errors.
Config String: change the Abstract Command to DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  5008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	f83260a	2017-03-10	mwachs5	Abstract Commands: clarify that 32-bit reads should
DMI registers. Allow the same registers to be used for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  5008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				always work. This allows reading MISA.
for unspecified identifier information.  4ea10ff 2017-03-10 mwachs5 abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.  5008436 2017-03-10 mwachs5 abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	6f9347a	2017-03-10	mwachs5	Config String: change the Abstract Command to
4ea10ff2017-03-10mwachs5abstract: Make autoexec apply to all data and progbuf words. Make a seperate register which is optional.50084362017-03-10mwachs5abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.aaa13e52017-03-06mwachs5Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.e9bb72c2017-03-06mwachs5Hart Array: Add registers for hart array.5d17a352017-03-06mwachs5DM: Move addresses around for better seperation of functionalities in HW25ccaa82017-03-06mwachs5CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.45cf6c22017-03-06mwachs5Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.38cb5a02017-03-06mwachs5Errors: Make errors write-1-to-clear.b436d772017-03-03mwachs5triggers: Clarify that matches are against virtual ad-				DMI registers. Allow the same registers to be used
buf words. Make a seperate register which is optional. abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear. b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				for unspecified identifier information.
abstract: Allow up to 16 progbuf and/or data words. Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	4ea10ff	2017-03-10	mwachs5	abstract: Make autoexec apply to all data and prog-
Inform debugger about dscratch registers available for its use.  aaa13e5 2017-03-06 mwachs5 Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				buf words. Make a seperate register which is optional.
for its use.  Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  Hart Array: Add registers for hart array.  DM: Move addresses around for better seperation of functionalities in HW  CONTROL: Rename control and status registers to accurately reflect their functionality.  September 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  Seb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  Triggers: Clarify that matches are against virtual addresses.	5008436	2017-03-10	mwachs5	abstract: Allow up to 16 progbuf and/or data words.
Command: use the name 'cmdtype' not 'type' to allow easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				Inform debugger about dscratch registers available
low easier auto-generation of Scala code.  e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				for its use.
e9bb72c 2017-03-06 mwachs5 Hart Array: Add registers for hart array.  5d17a35 2017-03-06 mwachs5 DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  5d17a35 bt Array: Add registers for hart array.  CONTROL: Rename control and status registers to functionality.  Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  Errors: Make errors write-1-to-clear.  5d17a35 bt Array: Add registers for hart array.  DM: Move addresses around for better seperation of functionalities in HW  CONTROL: Rename control and status registers to functionality.  Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  Errors: Make errors write-1-to-clear.  5d2 bt Array: Add registers for hart array.  DM: Move addresses around for better seperation of functionalities in HW  CONTROL: Rename control and status registers to functionality.  Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.	aaa13e5	2017-03-06	mwachs5	Command: use the name 'cmdtype' not 'type' to al-
DM: Move addresses around for better seperation of functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				low easier auto-generation of Scala code.
functionalities in HW  25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers to CS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear. b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	e9bb72c	2017-03-06	mwachs5	Hart Array: Add registers for hart array.
25ccaa8 2017-03-06 mwachs5 CONTROL: Rename control and status registers toCS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear. b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	5d17a35	2017-03-06	mwachs5	DM: Move addresses around for better seperation of
CS for consistency and to accurately reflect their functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				functionalities in HW
functionality.  45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	25ccaa $8$	2017-03-06	mwachs5	_
45cf6c2 2017-03-06 mwachs5 Errors: fix up the bit assignments in SERSTATUS with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear.  b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				
with the addition of error bit.  38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear. b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				· ·
38cb5a0 2017-03-06 mwachs5 Errors: Make errors write-1-to-clear. b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-	45cf6c2	2017-03-06	mwachs5	
b436d77 2017-03-03 mwachs5 triggers: Clarify that matches are against virtual ad-				
0				
dresses.	b436d77	2017-03-03	mwachs5	
				dresses.

793bb85	2017-03-03	mwachs5	triggers: Add suggested timings for best user experi-
1990000	2017-03-03	mwacnso	ence.
2669866	2017-03-03	mwachs5	stoptime/stopcycle: Make their functionality match
_000000	2011 00 00	11111001100	their name. Allow any reset value.
c85a1cf	2017-03-01	mwachs5	config_string: Simplify the Config String Address ab-
			stract command.
a303a6b	2017-03-02	Megan Wachs	Update README.md
1951ae3	2017-03-01	Megan Wachs	Merge pull request #35 from sifive/generate_chisel
2e2dc28	2017-03-01	Megan Wachs	Merge pull request #34 from sifive/serial_addrs
c087c34	2017-03-01	mwachs5	Merge remote-tracking branch 'origin/0.13' into gen-
			erate_chisel
92a4923	2017-03-01	mwachs5	serial: tweak addresses.
b09f460	2017-03-01	mwachs5	serial: tweak addresses.
6477837	2017-03-01	mwachs5	chisel: tweaks to class names.
be83e3e	2017-02-28	Tim Newsome	Clarify stoptime, stopcycle.
7f94662	2017-02-27	mwachs5	Merge remote-tracking branch 'origin/0.13' into gen-
			erate_chisel
c17c17c	2017-02-27	Tim Newsome	Abstract command that returns config string addr.
096 dfbc	2017-02-27	Tim Newsome	Acknowledge Alex.
c0253ab	2017-02-24	Tim Newsome	Explain tdata1 type a bit more.
e43ac2e	2017-02-24	Tim Newsome	Clarify how to enumerate triggers again.
c6e3e20	2017-02-23	Tim Newsome	Revert previous commit.
ef770bf	2017-02-23	Tim Newsome	mcontrol and icount mask tdata2, not tdata1.
27806f2	2017-02-23	mwachs5	rename 'type' to 'cmdtype' purely so my auto-
			generation scripts work.
e46798d	2017-02-22	mwachs5	Add Abstract Commands to automatic chisel
b3bb939	2017-02-21	mwachs5	Generate Chisel headers as well for Debug Module.
3d5b6f6	2017-02-22	Tim Newsome	Merge pull request #31 from sifive/ab-
			stract_command_types
c9db98c	2017-02-22	Tim Newsome	Simplify description of op statuses.
bda39cc	2017-02-22	mwachs5	Add explicit type field to Abstract Command.
34ff $1$ d $8$	2017-02-22	Tim Newsome	Merge pull request #30 from sifive/-
			more_ibuf_progbuf
f83a1ca	2017-02-22	mwachs5	Finish up replacement of ibuf-¿progbuf
ddde0a2	2017-02-22	Tim Newsome	Merge pull request #28 from
			sifive/inst_supply_vs_progbuf
9666e51	2017-02-22	mwachs5	IBUF-¿PROGBUF
5308ecd	2017-02-22	mwachs5	Remove last references to "Instruction Supply"
f6ebde9	2017-02-22	Tim Newsome	Move authentication to a serial protocol.
0f079c8	2017-02-22	Tim Newsome	Reserve bit for per-hart reset.
f2c93ac	2017-02-22	Tim Newsome	Clarify that dractive resets authentication.
59154ac	2017-02-22	Tim Newsome	Merge pull request #27 from asb/clarify_reset
f5e7b1c	2017-02-22	Alex Bradbury	Clarify that the halt state of all harts is maintained
216 061	0017 00 00	T: N	through reset
3dfe8fd	2017-02-22	Tim Newsome	More Debug Mode -; Halt Mode.
d29fc1f	2017-02-22	Tim Newsome	Debug Mode -; Halt Mode
55d6030	2017-02-21	Tim Newsome	Generate debug_defines.h as part of normal make
b0e6a7f	2017-02-21	Tim Newsome	Minor clarifications.

0f9885c	2017-02-20	Tim Newsome	Various clarifications.
e443ab9	2017-02-15	Tim Newsome	Merge pull request #25 from sifive/ctrl_status
3b08e90	2017-02-15	Tim Newsome	Merge pull request #24 from
0.00000	201, 02 10		sifive/sm_diagram_resumereq
0802d5a	2017-02-15	mwachs5	Use consistent 'Control and Status' naming for CS
000-000			registers.
$5 \operatorname{accc7d}$	2017-02-15	Tim Newsome	Change all the "other" JTAG IRs to just reserved.
bcbd7da	2017-02-15	mwachs5	sm_diagram: Show using resumered bit to resume.
18f6e55	2017-02-14	Tim Newsome	Introduce resumered command, similar to haltred.
fb40538	2017-02-14	Tim Newsome	Merge pull request #22 from sifive/sb_errors
4b62c40	2017-02-14	mwachs5	SystemBus: Clean up some formatting and error
			specification notes.
0f346e4	2017-02-14	Tim Newsome	Merge pull request #21 from
			sifive/sm_for_quick_access
bc97723	2017-02-14	mwachs5	quick-access: Update SM Diagram for Quick Access
d27066e	2017-02-14	Tim Newsome	Clarify haltred bit.
6f8ec43	2017-02-14	Tim Newsome	Always generate long constants when required.
c6ac6bc	2017-02-13	Tim Newsome	Include field descriptions in C header file.
b849213	2017-02-13	Tim Newsome	Fix the build.
c82c62e	2017-02-12	Tim Newsome	Merge pull request #20 from sifive/jtag_ir_minimum
1cf8033	2017-02-12	mwachs5	jtag: More clarifications
6203bd $6$	2017-02-12	Megan Wachs	Update requirements— W GPRs Required
f2b43a7	2017-02-12	Megan Wachs	Remove double 'the'
2c64ef1	2017-02-12	Megan Wachs	Remove comma
f84abce	2017-02-12	Megan Wachs	Whitespace edits and address come comments
7246b44	2017-02-12	Tim Newsome	Merge pull request #19 from sifive/jtag_dtm_edits
23c2648	2017-02-11	mwachs5	jtag_dtm: ask for clarification on TAP sharing.
7020d23	2017-02-11	mwachs5	jtag_dtm: Clarifications, DBUS-¿DMI
292 d49 c	2017-02-11	Megan Wachs	fix indentation
55ef $8$ d $6$	2017-02-11	Tim Newsome	Merge pull request #17 from sifive/prog_buffer_size
b879b86	2017-02-11	Megan Wachs	Add missing period
bbe0521	2017-02-11	mwachs5	Make comments on program buffer size match the
			address map.
4ceaa $37$	2017-02-11	mwachs5	Flesh out and edit the introduction/background Add
			a description of use cases this spec has in mind, and
			what it doesn't cover.
cbf89d6	2017-02-11	Tim Newsome	Rewrite Quick Access.
9115 db1	2017-02-10	Tim Newsome	Merge pull request #16 from sifive/re-
			duce_prog_buffer_size
170 bff1	2017-02-10	Megan Wachs	Allow size 4 for the program buffer
9d46077	2017-02-10	Tim Newsome	Merge pull request #15 from sifive/dmactive
c911e6e	2017-02-10	Tim Newsome	Clarify use of dmactive.
2ca296f	2017-02-09	Tim Newsome	Reserve command register space for custom use.
e49666e	2017-02-09	Tim Newsome	Clarify hart index change per Megan's comments.
$84865\mathrm{e}9$	2017-02-09	Tim Newsome	Add header prefix for abstract commands.
2434f4f	2017-02-09	Tim Newsome	Select harts by index instead of hart ID.
7bf112a	2017-02-09	Tim Newsome	Generate correct headers for ¿32-bit registers.
7 f 0 f 0 9 a	2017-02-08	Tim Newsome	Reset dbus status to "failure" to avoid confusion.

7b1803e	2017-02-08	Tim Newsome	Merge pull request #13 from sifive/arg0_clarification
8b1c6f0	2017-02-08	Megan Wachs	Fix line wrap issue
345c33f	2017-02-08	Megan Wachs	Call out "arg0" specifically.
9f080f5	2017-02-08	Megan Wachs	Clarify "arguments" to commands
259badd	2017-02-08	Tim Newsome	Make haltsum/halt registers mandatory.
eb0f1d3	2017-02-07	Tim Newsome	Allow for early abstract command failures.
bb49bd1	2017-02-07	Tim Newsome	Clarify error handling a little.
3fc0a97	2017-02-07	Tim Newsome	Explain when abstract data regs may be clobbered.
c37167e	2017-02-07	Tim Newsome	Fix old language in description of halt registers.
6943c96	2017-02-07	Tim Newsome	Generate more useful C header files from reg defs
d7a8045	2017-02-06	Tim Newsome	Merge pull request #11 from sifive/sm_diagram
8bef40e	2017-02-05	mwachs5	Merge remote-tracking branch 'origin/0.13' into
0501100	2011 02 00	III Waalisa	sm_diagram
98639df	2017-02-05	mwachs5	Include the SM Diagram as a figure. Also some minor
becode	2011 02 00	III Waalisa	capitalization fixes.
a95e4c3	2017-02-05	mwachs5	Update State Machine diagram to show uncertainty
0000100	201. 02 00	111 11 01 01 12 0	of halt bit during auto halt/resume.
ba76744	2017-02-05	Tim Newsome	Combine loabits and hiabits.
02b1d92	2017-02-05	Tim Newsome	DMI can get away with just 6 address bits.
35d6e33	2017-02-05	mwachs5	Update State machine diagram to show BUSY with-
304000	2011 02 00	III Waalisa	out HALTED
f511b05	2017-02-04	Tim Newsome	Clarify command busy bit.
a8e5ae7	2017-02-03	mwachs5	Merge remote-tracking branch 'origin/0.13' into
	201. 02 00	111 // 4021250	sm_diagram
d0f8961	2017-02-03	mwachs5	_
adioddi	2017-02-03	mwachso	Update figures
e18a68d	2017-02-03	Tim Newsome	
			Clarify prehalt/postresume failure. Clarify abstract command failure behavior.
e18a68d	2017-02-03	Tim Newsome	Clarify prehalt/postresume failure.
e18a68d ac3e2a9	2017-02-03 2017-02-02	Tim Newsome Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior.
e18a68d ac3e2a9 ce4baee	2017-02-03 2017-02-02 2017-02-02	Tim Newsome Tim Newsome Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section.
e18a68d ac3e2a9 ce4baee 0490377	2017-02-03 2017-02-02 2017-02-02 2017-02-02	Tim Newsome Tim Newsome Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command.
e18a68d ac3e2a9 ce4baee 0490377 67515bd	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02	Tim Newsome Tim Newsome Tim Newsome Tim Newsome Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02	Tim Newsome Tim Newsome Tim Newsome Tim Newsome Tim Newsome Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -i preexec, execa -i postexec Limit Program Buffer sizes to 0, 1, 8.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure.  Clarify abstract command failure behavior.  Add Quick Access section.  Add prehalt and postresume to reg command.  Deal with a few minor TODOs.  Turn register names into links.  Explain what register access is required.  Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec  Limit Program Buffer sizes to 0, 1, 8.  Incorporate Po-wei's feedback.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure.  Clarify abstract command failure behavior.  Add Quick Access section.  Add prehalt and postresume to reg command.  Deal with a few minor TODOs.  Turn register names into links.  Explain what register access is required.  Revert Plain Exception implementation to be simple execb -i preexec, execa -i postexec  Limit Program Buffer sizes to 0, 1, 8.  Incorporate Po-wei's feedback.  Clarify how all autoexec bits work.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -i preexec, execa -i postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -i preexec, execa -i postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48 781c68e	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register. Update README.md
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48 781c68e f46b32e	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -i preexec, execa -i postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register. Update README.md Add a diagram of Abstract Command flow.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48 781c68e f46b32e 633bd63	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register. Update README.md Add a diagram of Abstract Command flow. Move Reading Order into About This Document
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48 781c68e f46b32e 633bd63 51ec4d1	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -¿ preexec, execa -¿ postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register. Update README.md Add a diagram of Abstract Command flow. Move Reading Order into About This Document Add reading order section.
e18a68d ac3e2a9 ce4baee 0490377 67515bd 96456fc 317cd98 f3ad2f2 a0ad281 1d4a2c3 cc40815 c8b45d6 dbb1deb c5f8f59 5c69194 50f7c48 781c68e f46b32e 633bd63 51ec4d1 03d20ad	2017-02-03 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-02 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01 2017-02-01	Tim Newsome	Clarify prehalt/postresume failure. Clarify abstract command failure behavior. Add Quick Access section. Add prehalt and postresume to reg command. Deal with a few minor TODOs. Turn register names into links. Explain what register access is required. Revert Plain Exception implementation to be simple execb -; preexec, execa -; postexec Limit Program Buffer sizes to 0, 1, 8. Incorporate Po-wei's feedback. Clarify how all autoexec bits work. Remove stale TODO. Explain why cmderr inhibits starting new commands. Fix editing error. Remove empty hart info register. Update README.md Add a diagram of Abstract Command flow. Move Reading Order into About This Document Add reading order section. autoexec0 applies to data0, not inst0.

a36ddce	2017-01-31	Tim Newsome	Add size to abstract register command.
64 de 458	2017-01-31	Tim Newsome	Detail bus master reads.
c08486f	2017-01-31	Megan Wachs	reset: Add some comments (#5)
1558049	2017-01-30	Tim Newsome	Automate Change Log.
51525a4	2017-01-29	Tim Newsome	Update System Overview
7d39ac0	2017-01-29	Tim Newsome	Update Supported Features.
9e7cbea	2017-01-29	Tim Newsome	Update RISC-V Core section.
515188d	2017-01-29	Tim Newsome	Update Hardware Implementations section.
4b19ed8	2017-01-29	mwachs5	system_bus: be consistent and always call it 'System
			Bus'. Even if some dislike the name, we should be
			consistent and clear in the spec.
9ccef3d	2017-01-29	Tim Newsome	Fleshed out some debugger implementation.
04b9176	2017-01-28	Tim Newsome	Rename debug exception to breakpoint exception.
5ac4ea1	2017 - 01 - 27	Tim Newsome	WIP on big update on instruction supply.
2d9c3e2	2017 - 01 - 27	Tim Newsome	Reorganize dm registers.
de50ba8	2017 - 01 - 27	Tim Newsome	Abstract command support is already addressed.
27cb $0$ da	2017-01-26	Tim Newsome	Merge pull request #4 from sifive/access_renames
5085046	2017-01-26	mwachs5	Rename registers and fields like 'access' that were
			confusingly the same name.
10bbf6f	2017-01-26	Tim Newsome	Fix #2: DM address space table
a05c582	2017-01-26	Tim Newsome	Add debugger inspection as a feature.
4062681	2017-01-24	Tim Newsome	Add publish target.
5c8bb83	2017 - 01 - 24	Tim Newsome	Clarify use of data registers.
1504 da6	2017-01-24	Tim Newsome	Replace manual date with automatic git hash/date.
997f2a0	2017-01-23	Tim Newsome	Deal with unsupported abstract commands.
cb6f2b8	2017-01-23	Tim Newsome	Renumber registers to prevent duplicates.
8b4db96	2017-01-23	Tim Newsome	Don't print out addresses if they're not provided.
b00cd21	2017-01-23	Tim Newsome	Add an abstract command.
675b556	2017-01-23	Tim Newsome	Reorganize DM bits into functional group regs.
5 fc 7512	2017-01-23	Tim Newsome	Remove bits 33:32 from sbdata[23].
ceb5d66	2017-01-20	Tim Newsome	Starting point for a comprehensive spec