


REF. NUMBER	PART NUMBER	PART NAME	QUANTITY Wt.Lbs.Ea.
1		TUB ASSEMBLY	1
2	000014840	TIP FRAME (OPTIONAL)	1
	000010605 000010810 000010945	BOLTS: 3/4"-10 x 2" BOLTS 3/4"-10 NUTS 3/4" LOCK WASHERS	4 4 4
3	000003007	TUB FRAME CROSS MEMBER	2
	000010605 000010810 000010945	BOLTS: (PER CROSS MEMBER)  3/4"-10 × 2" BOLTS  3/4"-10 NUTS  3/4" LOCK WASHERS	2 2 2
4	000009938	LOG SHAFT (LH SPIRAL)	1
5	000009937	LOG SHAFT (RH SPIRAL)	Ç.
6	4430LW16	DISCHARGE CHUTE (OPTIONAL)	ą.
	000010580 000010805 000010937 000010950	BOLTS: 1/2"-13 x 2 1/2" BOLTS 1/2"-13 NUTS 1/2" LOCK WASHERS 1/2" FLAT WASHERS	2 2 2 2 4
7		DRIVE ASSEMBLY	Î
8	4430LW17/18	V-BELT GUARD	1
	000010570 000010805 000010937	BOLTS: 1/2"-13 x 1 1/4" BOLTS 1/2"-13 NUTS 1/2" LOCK WASHERS	3 3 3
DWG. NUMBER:	PF4630L1 BY:	JWB DATE: 8-30-00 REVIS	SIONS PAGE # 1

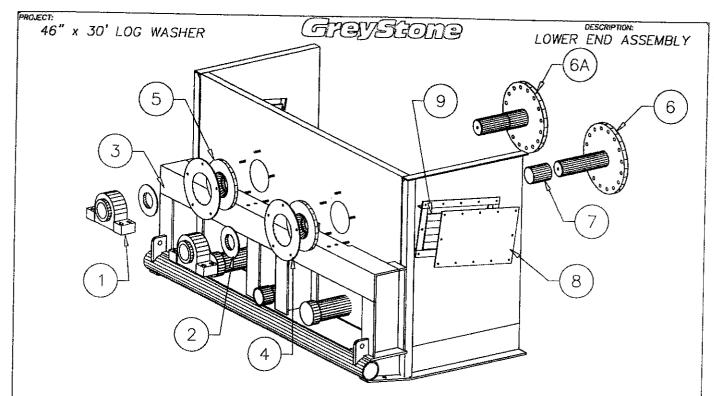

REF. NUMBER	PART NUMBER	PART NAME	QUANTITY	Wt.Lbs.Ea.
1	000010420	BEARING	2	
	000010616 000010810 000010945 000010955	BOLTS: (PER BEARING)  3/4"-10 x 4 1/2" BOLTS  3/4"-10 NUTS  3/4" LOCK WASHERS  3/4" FLAT WASHERS	4 4 4 4	
2	000035231	SLINGER w/COLLAR	2	
4	000035140	SEAL RETAINER PLATE	2	
	000010580 000010805 000010940 000010900	BOLTS: (PER RETAINER)  1/2"-13 x 2 1/2" BOLTS  1/2"-13 NUTS  1/2" LOCK WASHERS  1/2" RUBBER BACKED WASHER	5 5 5 5	
5	000035290	RUBBER SEAL	2	
6	000015882	LOWER STUB SHAFT	2	
6A	000010392	LOWER STUB SHAFT w/WEAR SLEEVE		
7	000035340	WEAR SLEEVE	2	ļ
8	000002675	OVERFLOW GATE COVER	2	
	000010553 000010803 000010942	BOLTS: (PER COVER)  3/8"-16 x 1 1/4" BOLTS  3/8"-16 NUTS  3/8" LOCK WASHERS	12 12 12	No.
9	000002677	OVERFLOW GATE FLAT	10	Y symmetric and a single

DATE:

REVISIONS

8-30-00


PAGE #

6-20-06

JWB


PF4630L2 BY

DWG. NUMBER:

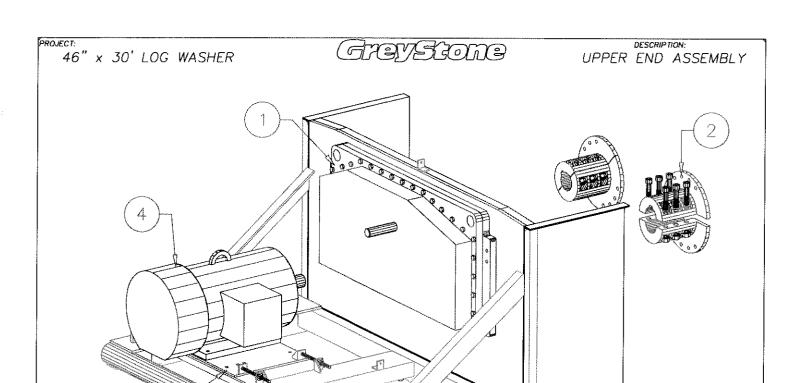

REF. NUMBER	PART NUMBER	PART NAME	QUANTITY	<u>Wt.Lbs.Ea.</u>
1	000012682	GEARBOX, P.E.M. DOSR -1	1	
	000010615 000010810 000010945	BOLTS: 3/4"-10 x 4" BOLTS 3/4"-10 NUTS 3/4" LOCK WASHERS	8 8 8	
2	000015393	SPLIT COUPLER	2	
	000015413 000012410 000012411	BOLTS: (PER COUPLER)  1 1/8"-12 x 5" GR. 8 SHCS  1 1/8"-12 NUTS, GR. 8  1 1/8" LOCK WASHERS	6 6 6	
3	000001734	MOTOR MOUNT BASE	1	Ì
	000010614 000010810 000010945 000010955	BOLTS:  3/4"-10 x 3 1/2" BOLTS  3/4"-10 NUTS  3/4" LOCK WASHERS  3/4" FLAT WASHERS	4 4 4 4	
4	00000000	MOTOR: 200HP, 1800 RPM, 447T FRAME	1	

DWG. NUMBER: PF4630L3 BY: JWB DATE: 8-30-00 REVISIONS PAGE # 1

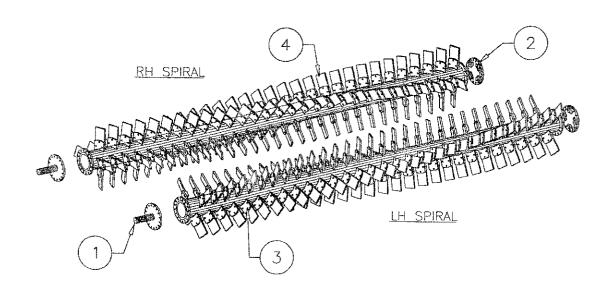

REF. NUMBER	PART NUMBER	PART NAME	QUANTITY	<u>Wt.Lbs.Ea.</u>
1	000010392	LOWER STUB SHAFT ASSEMBLY	2	
	000010725 000010860 000010920	BOLTS: (PER STUB SHAFT)  7/8"-14 x 4" GR. 8  7/8"-14 NUTS GR. 8  7/8" A325 FLAT WASHERS	16 16 16	
2	000012366	SPIDER COUPLER	2	
	000010720 000010840 000010920	BOLTS: (PER SPIDER) 7/8"-14 x 3 1/2" GR. 8 7/8"-14 JAM NUTS GR. 8 7/8" A325 FLAT WASHERS	16 16 16	
3	000004603	PADDLE BASE (PER SHAFT)	118	
4	000034730	PADDLE 44LWP (PER SHAFT)	118	
	000010725 000010860 000010840 000010920	BOLTS: (PER SHAFT)  7/8"-14 x 4" GR. 8  7/8"-14 NUTS GR. 8  7/8"-14 JAM NUTS GR. 8  7/8" A325 FLAT WASHERS	354 354 354 354	

PF4630L4 BY: DWG. NUMBER:


JWB

DATE:

REVISIONS

8-28-00

PAGE #

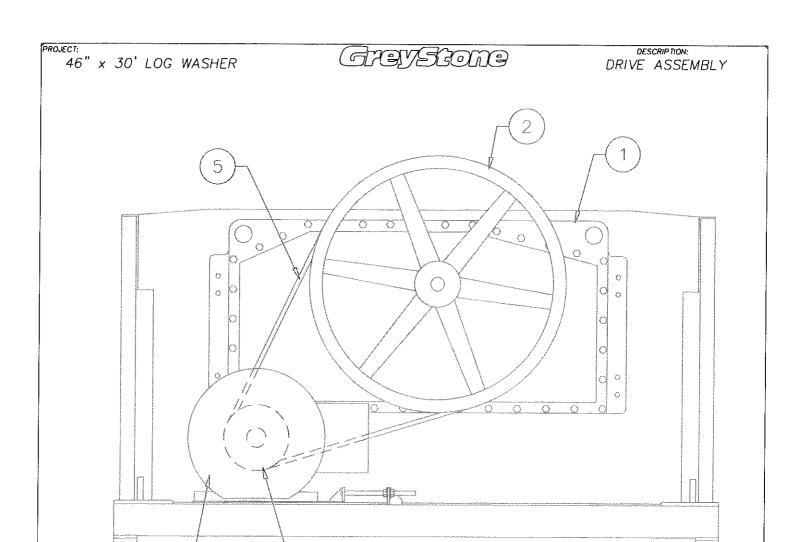

REF. NUMBER	PART NUMBER	PART NAME	QUANTITY	Wt.Lbs.Ea.
Ť	000012682	GEARBOX P.E.M. DOSR 7-1	1	
2	000015446 000009681	SHEAVE 6C-44.0 (GEAR BOX) BUSHING J 2 3/8"	1	
3	000000000	MOTOR, 200 HP, 1800 RPM, TEFC 447T	1	
4	000015445 000009734	SHEAVE 6C-11.0 (MOTOR) BUSHING F 3 3/8"	1	
5	000015458	BELT CX-173	6	

DWG. NUMBER: PF4630L5 ORAWN BY: JWB DATE: 8-30-00 REVISIONS PAGE # 1