Western Weld SV8.....8 oz SV32 32 oz Vulcanizing Cement

EMISSION DATE: Enero de 2011.


SUPPLIER: Industrias Vermar S.A. de C.V.

PHONE: (52-33) 38-34-37-37

ADDRESS: Km. 2.8 carretera a Tesistán, Zapopan, Jalisco, México

SECTION 1.- PRODUCT IDENTIFICATION

	1
	Blue Seal
CHEMICAL NAME:	
	Flammable cement, light cement
	N/A (Mixture)
CHEMICAL FAMILY:	Aliphatic Hydrocarbon

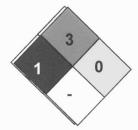

FORMULATION, COMPOSITION / INFORMATION	
CHEMICAL NAME	QUANTIY
ALIPHATIC PETROLEUM NAPHTAS:	(60-100 %) (NO NPT CANCERIGENOUS) (NO OSHA CANCERIGENOUS)
	(CAS NUM. 64742-88-7)
NATURAL RUBBER	(5-10%) (NO NPT CANCERIGENOUS) (NO OSHA CANCERIGENOUS)
	(CAS NUM. N/A)

SECTION 2.- FIRE AND EXPLOSION RISK DATA

FLASH POINT AND METHOD:	>32°C, TCC
AUTOIGNITION TEMPERATURE:]70°C - 80°C
LOWER EXPLOSION LIMIT:]1.0 % VOL.
UPPER EXPLOSION LIMIT:]6.0 % VOL.
SPECIAL PROCEDURES FOR THE	Isolate the area; use self contained breathing apparatus.
COMBAT FIRE	
UNUSUAL FIRE AND EXPLOSION RISKS	Accumulation of vapours in an enclosed area and an ignition source such as static or
	an open flame can lead to fire or explosion.
EXTINGUISHING MEDIA AND FIRE	Use dry chemical, alcohol foam, carbon dioxide extinguishers. Use water spray to cool
FIGHTING PROCEDURES	containers.

SECTION 3.- PHYSICAL AND CHEMICAL PROPERTIES

BOILING POINT AT 760 mmHg]77 - 140°C
DENSITY AT 20°C	0.716 Kg/dm
	Insoluble in water
% VOLATILES BY VOLUME	94%
APPEARANCE AND ADOUR	Viscous blue liquid with solvent odour.

SECTION 4.- REACTIVITY INFORMATION

STABILITY	Stable
HAZARDOUS POLYMERIZATION	Will not occur.
DANGEROUS DECOMPOSITION	High temperature decomposition produces highly irritant smoke; combustion produces
	CO and CO ₂
INCOMPATIBILITY	Strong Oxidizers

SECTION 5.- HEALTH HAZARD INFORMATION

	ACUTE EFFECTS OF OVEREXPOSURE
INHALATION	Symptoms can include headache, nausea, drowsiness, skin irritation, the intensity of
	which depends on concentration and duration of exposure.
EYES	May cause irritation.
SWALLOWING	May cause irritation of the gastrointestinal tract, may cause nausea and vomiting.
SKIN CONTACT	May cause irritation upon prolonged or repeated contact.
CHRONIC EFFECTS OF OVEREXPOSURE	N/A
	_

EMERGENCY AND FIRST AID PROCEDURES		
	Remove the affected person to fresh air, keep him quiet and administer oxygen if	
I .	necessary. Apply artificial respiration or CPR if breathing has stopped. Seek medical attention.	
	Remove contaminated clothing. Wash the affected area with soap and large quantities	
	of water. Seek medical advice or attention if irritation persists.	
EYES	Flush with large quantities of water for at least 15 minutes. Seek medical attention.	
SWALLOWING	Do not induce vomiting. Seek inmediate medical attention.	
PRIMARY ROUTE OF ENTRY	Contact, Inhalation.	
EXPOSURE LIMITS	8 hour - 5000 ppm	

SECTION 6.- PERSONAL PROTECTION

RESPIRATORY PROTECTION	Use NIOSH approved cartridge or gas mask.
VENTILATION	Use mechanical ventilation to keep product whithin specified TLV ranges.
PROTECTION OF HANDS	Impermeable gloves recommended
EYE PROTECTION	
FACE PROTECTION	Face shield
OTHER PROTECTIVE EQUIPMENT	Cotton work clothes; antistatic safety helmet; safety shoes.

SECTION 7.- SPECIAL PRECAUTIONS

SPILL PROCEDURES Eliminate all sources of ignition. Use sand or other absorbent material to absorb spill. Dispose of according to local, provincial and federal regulations. OTHER PRECAUTIONS Avoid inhalation of vapours and contact with skin and eyes.	STORAGE AND HANDIING	Store in well ventilated area, away from sun, rain, heat sources of ignition. Do not store near oxidizing chemicals. Storage temperature should be less than 25°C. The container should be grounded and should not be crushed or puntured. Avoid leaving the container open when not in use. Vehicles used for transportation of the product should be equipped with fire extinguishers of the right type. (See section 2)
OTHER PRECAUTIONS Avoid inhalation of vapours and contact with skin and eyes.	SPILL PROCEDURES	Eliminate all sources of ignition. Use sand or other absorbent material to absorb spill.
		Dispose of according to local, provincial and federal regulations.
INCORUMNETTY DITTE DE LA	OTHER PRECAUTIONS	Avoid inhalation of vapours and contact with skin and eyes.
WORK SAFETY RULES DO not smoke in the work area. Do not eat or have food in the work area. Use proper	WORK SAFETY RULES	Do not smoke in the work area. Do not eat or have food in the work area. Use proper
equipment. The work area must have an approved eyewash station.		equipment. The work area must have an approved eyewash station.

SECTION 8.- HMIS RATING

HEALTH
FLAMMABILITY
REACTIVITY
PERSONAL PROTECTIVE GROUP

SECTION 9.- TRANSPORTATION INFORMATION

PACKING GROUP	III.
PROPER SHIPING NA	ME Vulcanizing Cement
EQUIVALENT UN NUME	ER 1133
OBLIGATORIED VEHICLE CONDITION	NS THE VEHICLES FOR THE TRANSPORTATION SHOULD HAVE FIRE
	EXTINGUISHERS.

SECTION 10.- MSDS PREPARATION INFORMATION

THIS MSDS WAS PREPARED BY

Juan Manuel González Solís (Quality Manager) Industrias Vermar S.A. de C.V. Km. 2.8 carretera a Tesistán, Zapopan, Jalisco, México

The information contained herein is based on data considered accurate. However, no warranty is expressed or implied regarding the accuracy of this data or the results to be obtained from the use thereof. Vendor assumes no responsibility for injury to vendee or third persons proximately caused by the material if reasonable safety measures are not adhered to as stipulated in the data sheet. Additionally, vendor assumes no responsibility for injury to vendee or third person proximately caused by abnormal use of the material, even if reasonable safety procedures are followed. Furthermore, vendee assumes the risk in his use of the material.