WEST FARMS WELDING

Select Vehicle | New TSBs | Technician's Reference

Component Search: OK

Conversion Calculator


1998 Mercedes Benz Truck ML 320 (163.154) V6-3.2L (112.942)

Vehicle Level → Instrument Panel, Gauges and Warning Indicators → Dashboard / Instrument Panel → Service and Repair -> AR68.10-P-1000GH Remove/Install Instrument Panel -

AR68.10-P-1000GH Remove/Install Instrument Panel

Notes

AR68.10-P-1000GH Remove/Install Instrument Panel

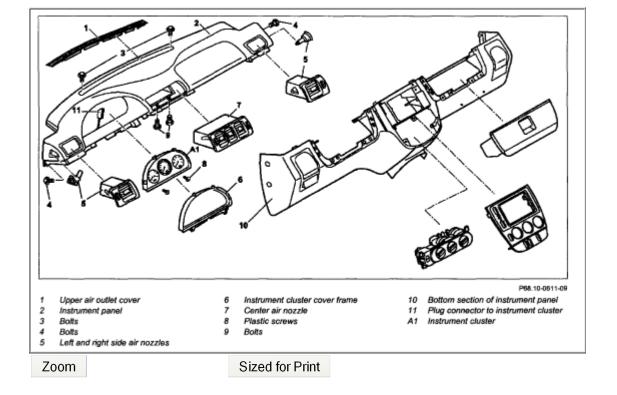

Remove/Install

- 1 Remove instrument panel bottom section (1()
- Remove A-pillar trim on left and right
- Remove upper section of air outlet panel (1)
 - Long wedge: See Special Tools below.
- Unscrew screws (3) from upper side of instrument panel

10/23/2009 5:22 AM 1 of 3

- 5 Remove instrument cluster (A1 remove
- 6.1 Disconnect sun sensor connector

NOTE: Only as of 01.09.01: Connector is located behind instrument cluster

7.1 Remove Parktronic display

NOTE: Only with Parktronic system (PTS), Code 220a.

8.1 Disconnect connector from actuator motor for air distribution flap

NOTE: Only as of 01.09.01: Connector is located at center air outlet nozzle on driver's side.

9.1 Disconnect connector from temperature sensor

NOTE: Only as of 01.09.01: Connector is located on right side of center air outlet nozzle.

- 10 Remove screws (9) from center of instrument panel
- 11 Remove screws (4) from sides of instrument panel
- 12 Remove instrument panel (2)


CAUTION: Danger of damaging instrument panel when removing and installing

13 Install in the reverse order

Special Tools

Long Wedge P/N # 115 589 03 59 00

2 of 3 10/23/2009 5:22 AM

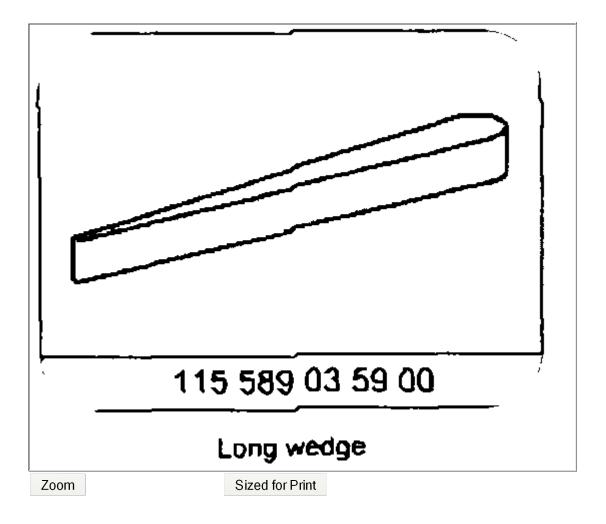

© 2009 ALLDATA LLC. All rights reserved. <u>Terms of Use</u>

3 of 3 10/23/2009 5:22 AM