
CALIGA Feature Test Results


Test 1. Add and deactivate a user

James H. added Test U. as a QA user, then deactivated them. Test U. dropped to the bottom of the list, greyed out, with a Reactivate button.

Screenshot 1. Manage Users with the new user Test U.

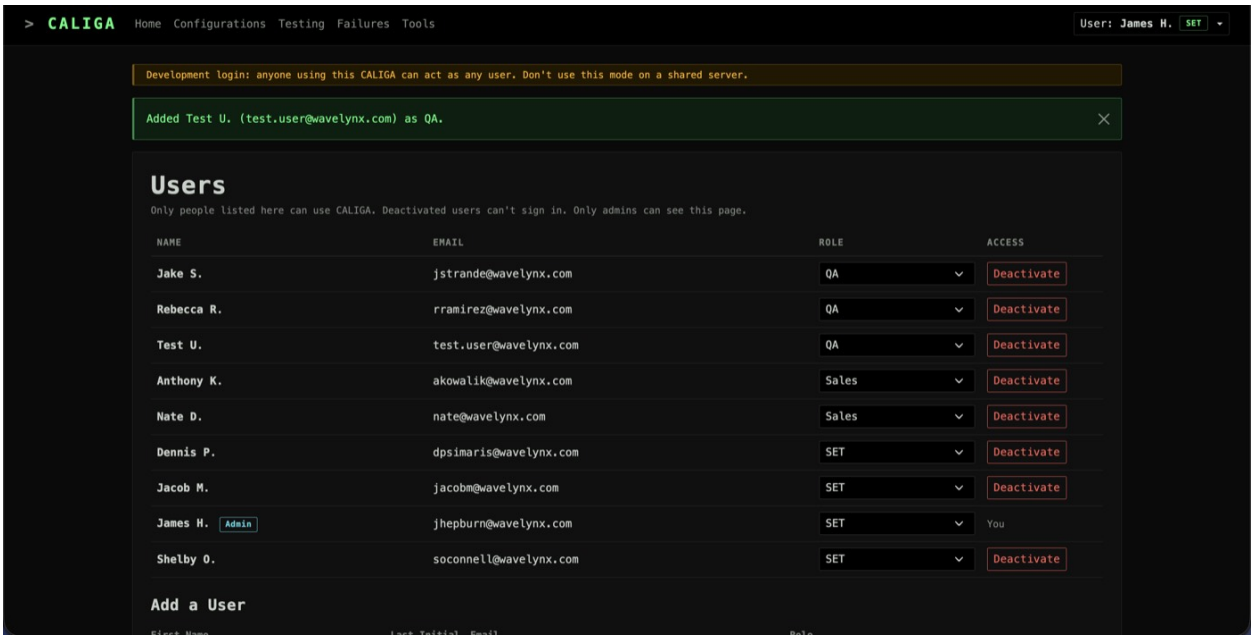


Screenshot 2. Test U. deactivated and greyed out.

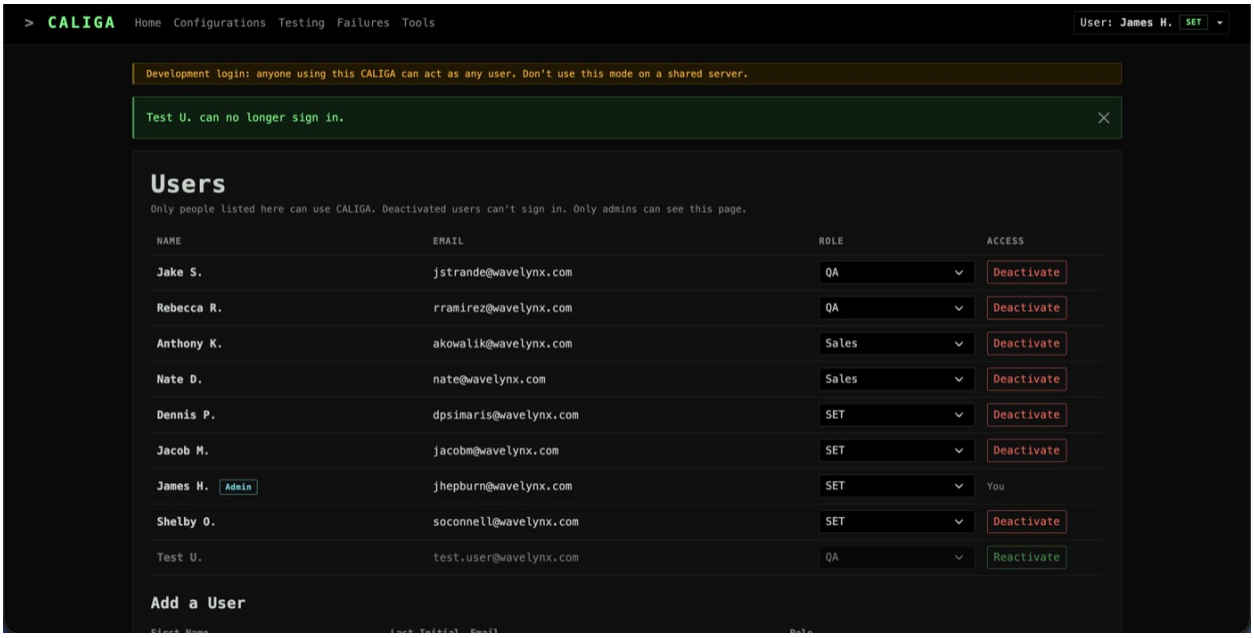


Test 2. Create a configuration

Anthony K. created CTEST1 in POC status. CALIGA assigned ID 358 (0x0166). The LEAF & Wallet card carried Keyset Lk12345, both wallets on, and TCI 0209FE.

Screenshot 3. New Configuration form filled in.

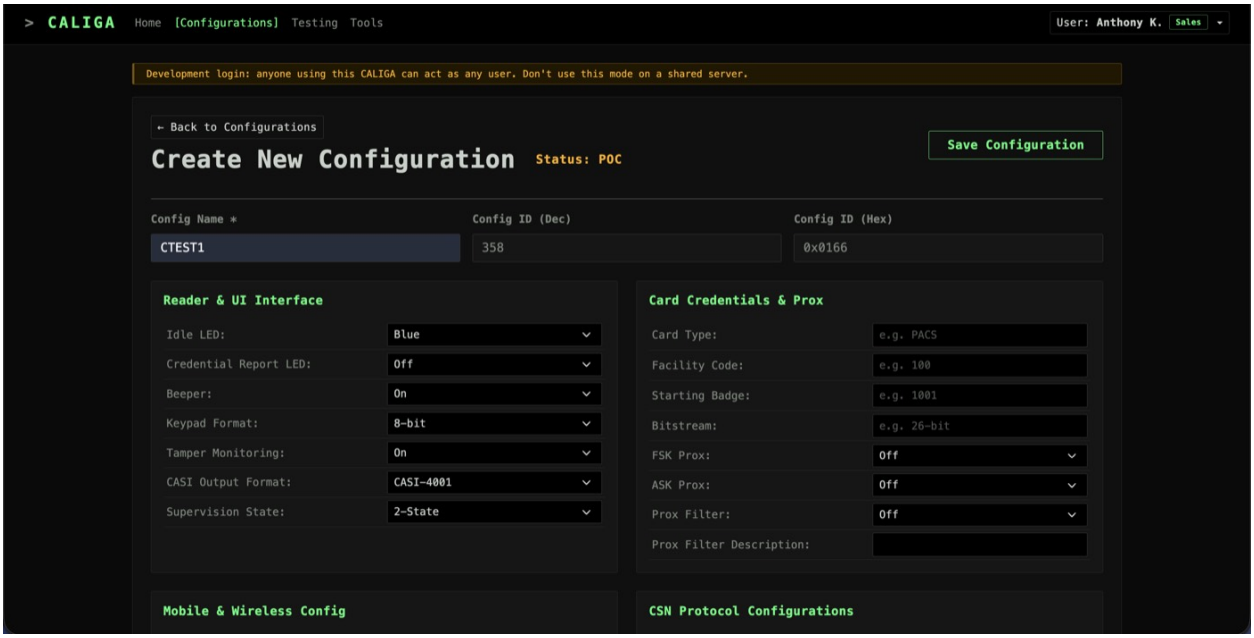


Screenshot 4. CTEST1 details page after saving, showing POC.

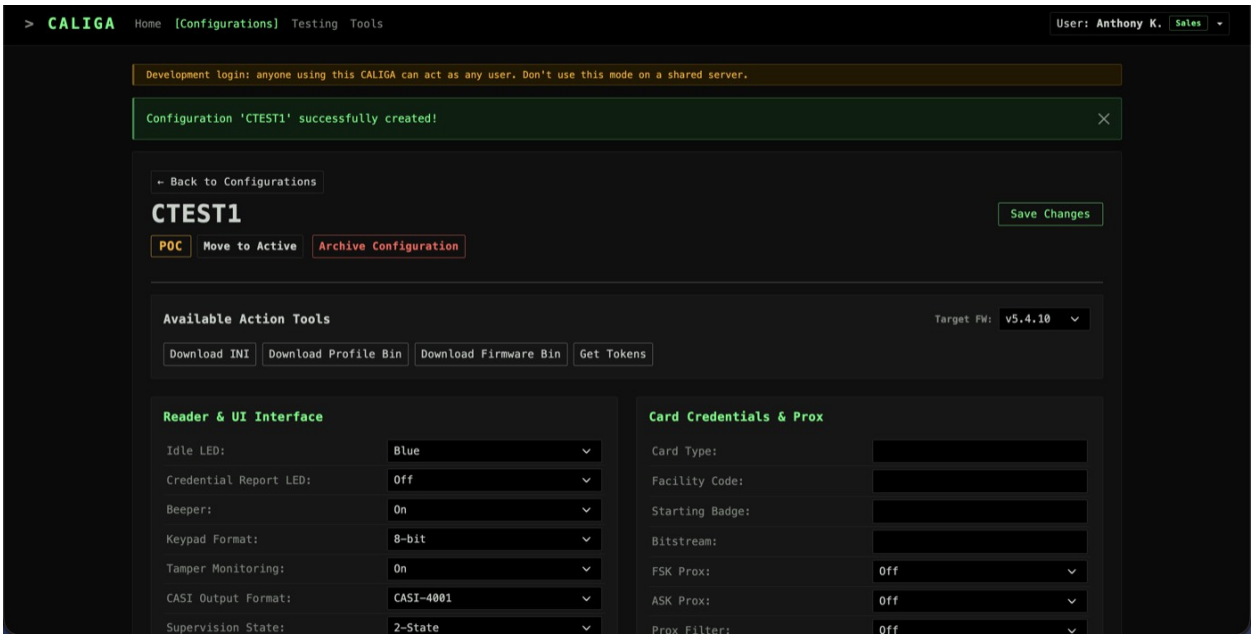


Test 3. Edit and move to Active

Anthony K. changed Idle LED from Blue to Off, then moved CTEST1 to Active. Revision history logged both changes against akowalik@wavelynx.com.

Screenshot 5. Revision history with the creation, the edit and the status change.

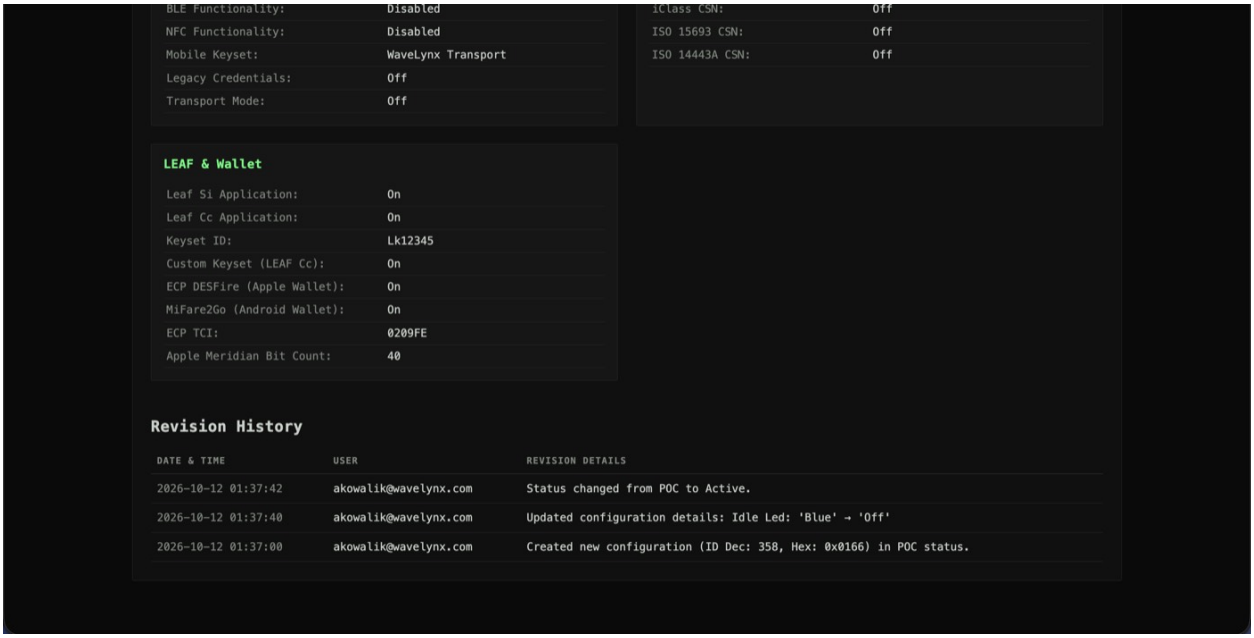


Screenshot 6. CTEST1 showing Active, with Alert QA available.

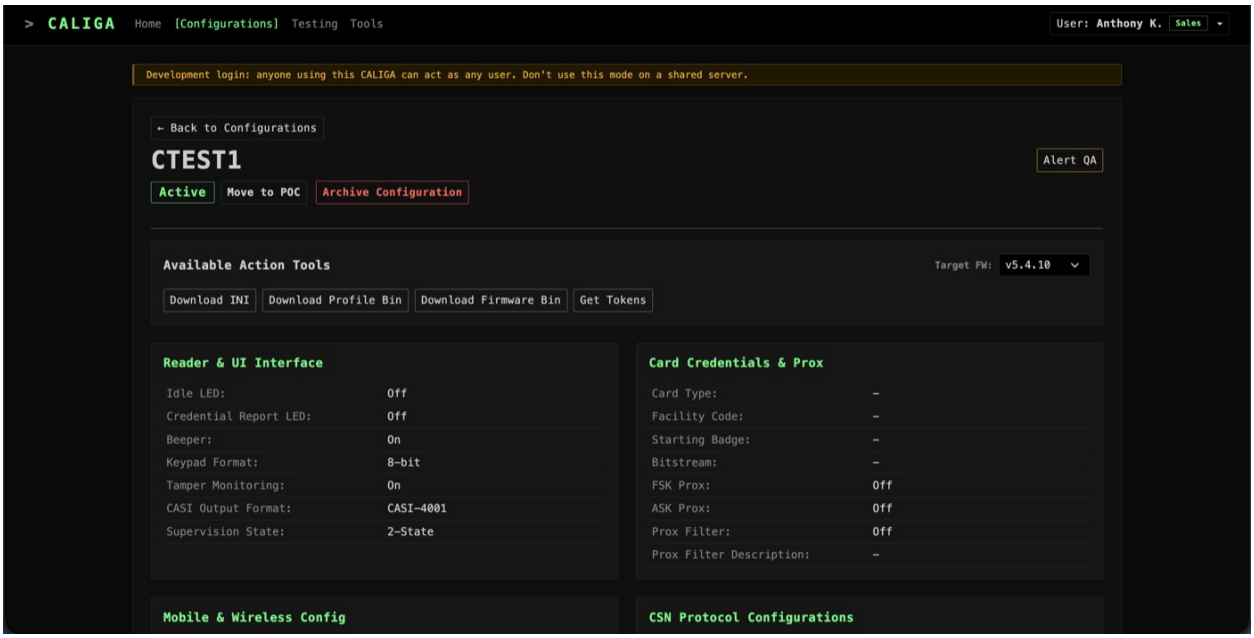


Test 4. Alert QA

Anthony K. pressed Alert QA. CALIGA confirmed it, and the CALIGA Bot posted the request in Slack with CTEST1, Active, v5.4.10 and the requester.

Screenshot 7. "QA team alerted" message in CALIGA.

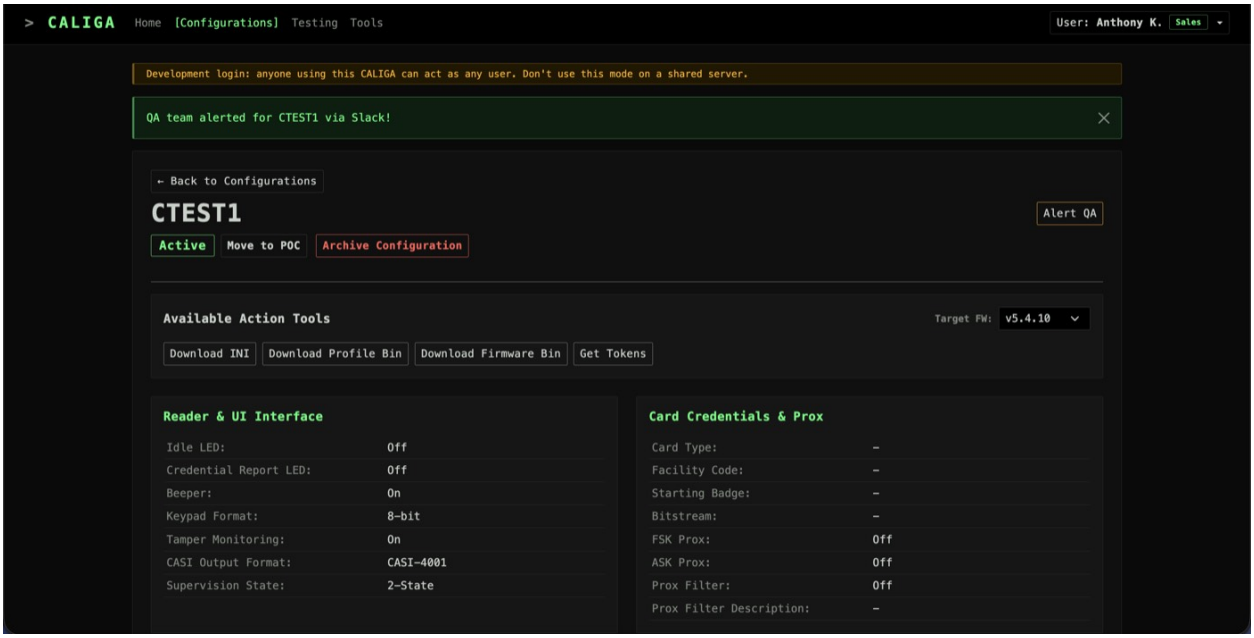

Screenshot 8. The QA request in Slack.

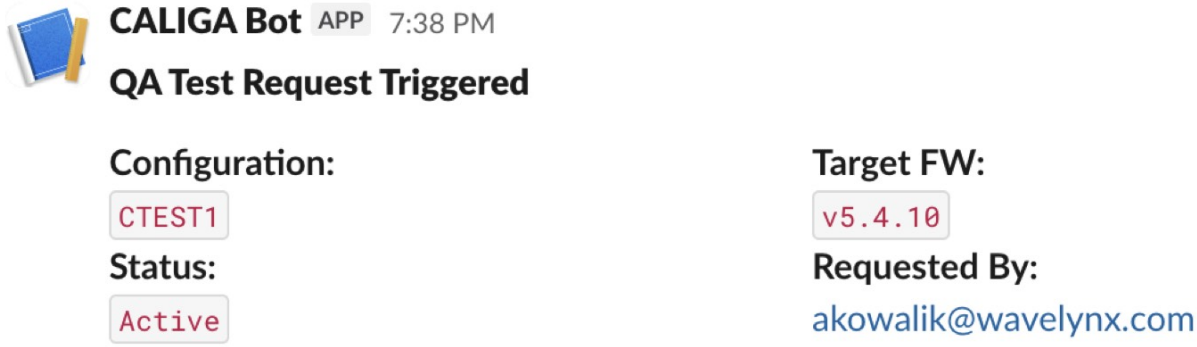


Test 5. Download INI and firmware

The CTEST1 INI downloaded with its LEAF, wallet and key slot sections. The firmware download used CQU1.


Screenshot 9. CTEST1's generated INI in a text editor.



Screenshot 10. Progress window while the CQU1 firmware builds.

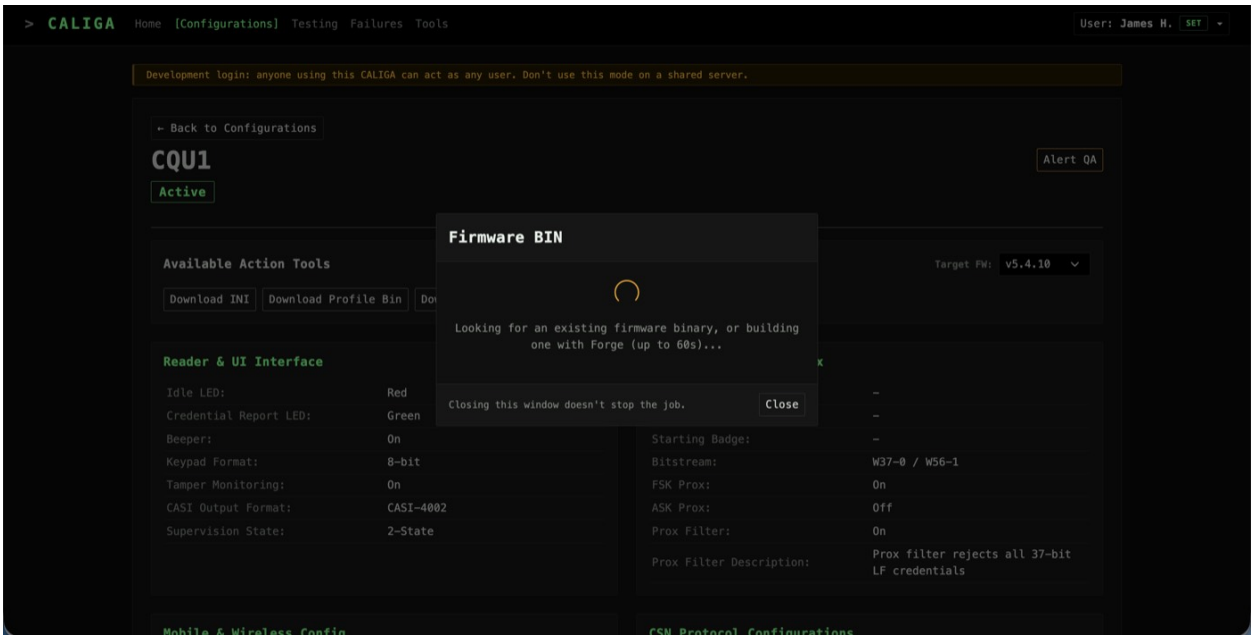


Screenshot 11. Browser downloads with both files.

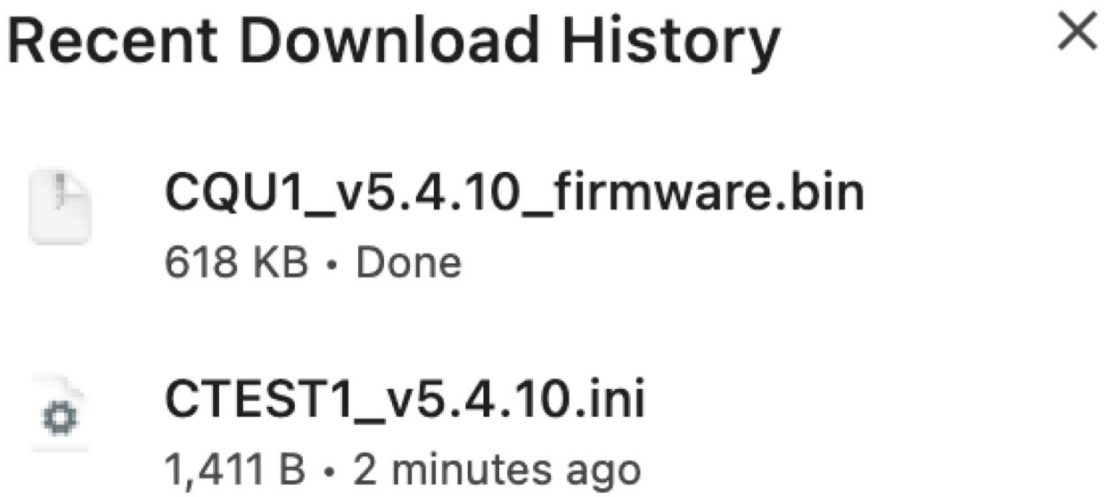

Test 6. Get Tokens

Get Tokens for CQU1 on v5.4.10 returned both PocketBase tokens, one for the profile and one for the firmware, each with a Copy button.


Screenshot 12. Get Tokens window for CQU1.

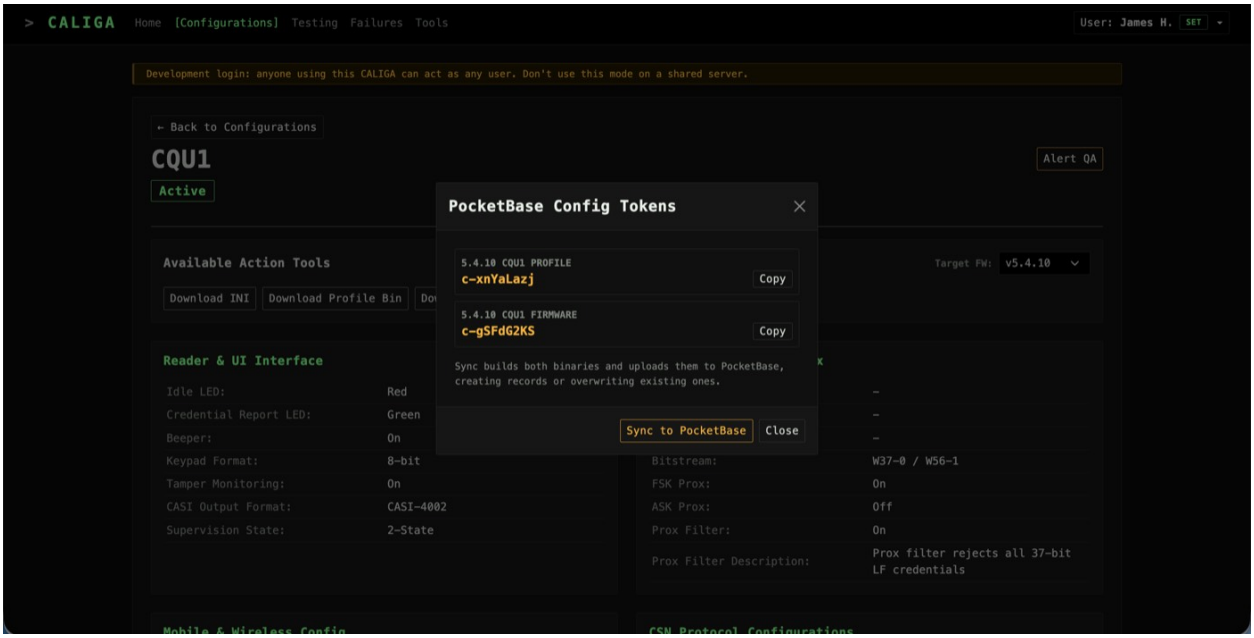


Test 7. Fail a test

Rebecca R. started FW Run #10 on v5.4.10 with CTEST1 and failed Idle LED (expected Off, comment "LED was red"). CALIGA marked the group Failed, opened Jira ticket SWAG-138, and posted the failure in Slack.


Screenshot 13. CTEST1 checklist with the Expected Configuration column.

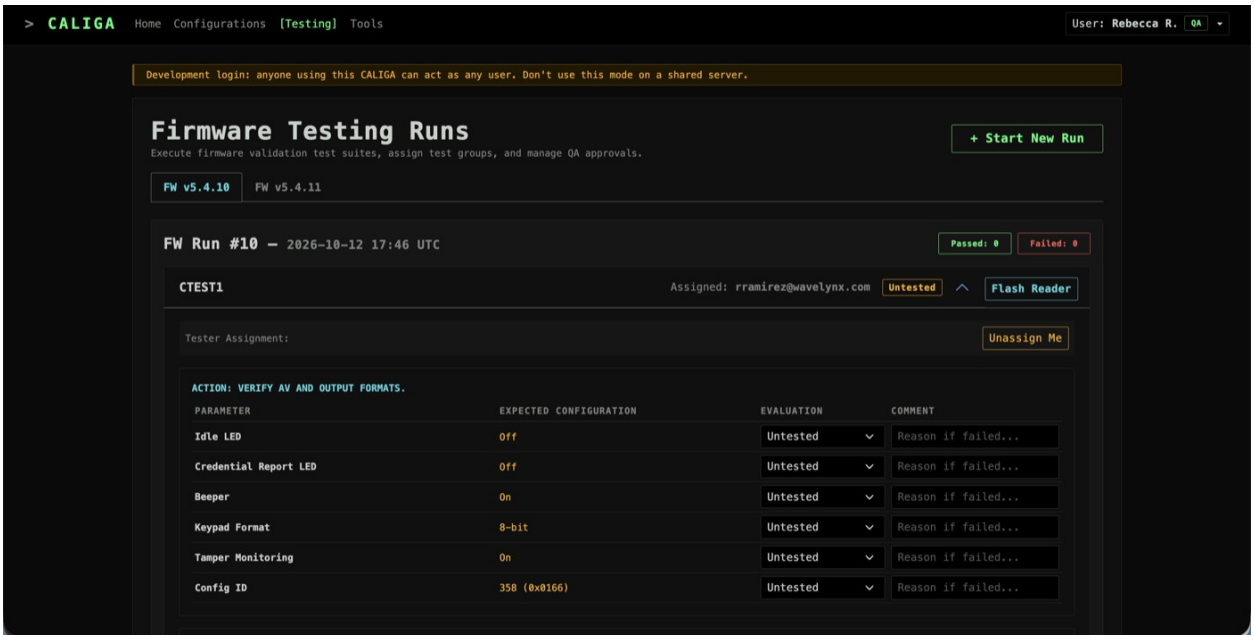


Screenshot 14. Run #10 showing CTEST1 Failed and Failed: 1.

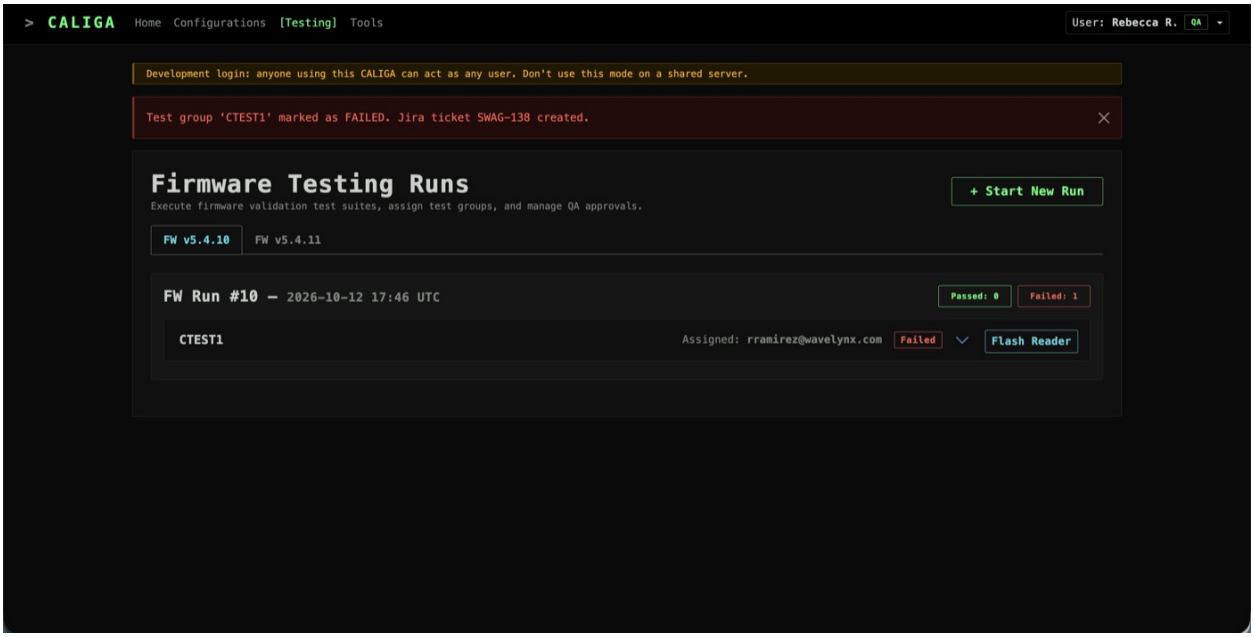

Screenshot 15. Jira ticket SWAG-138 in Next Up, unassigned.

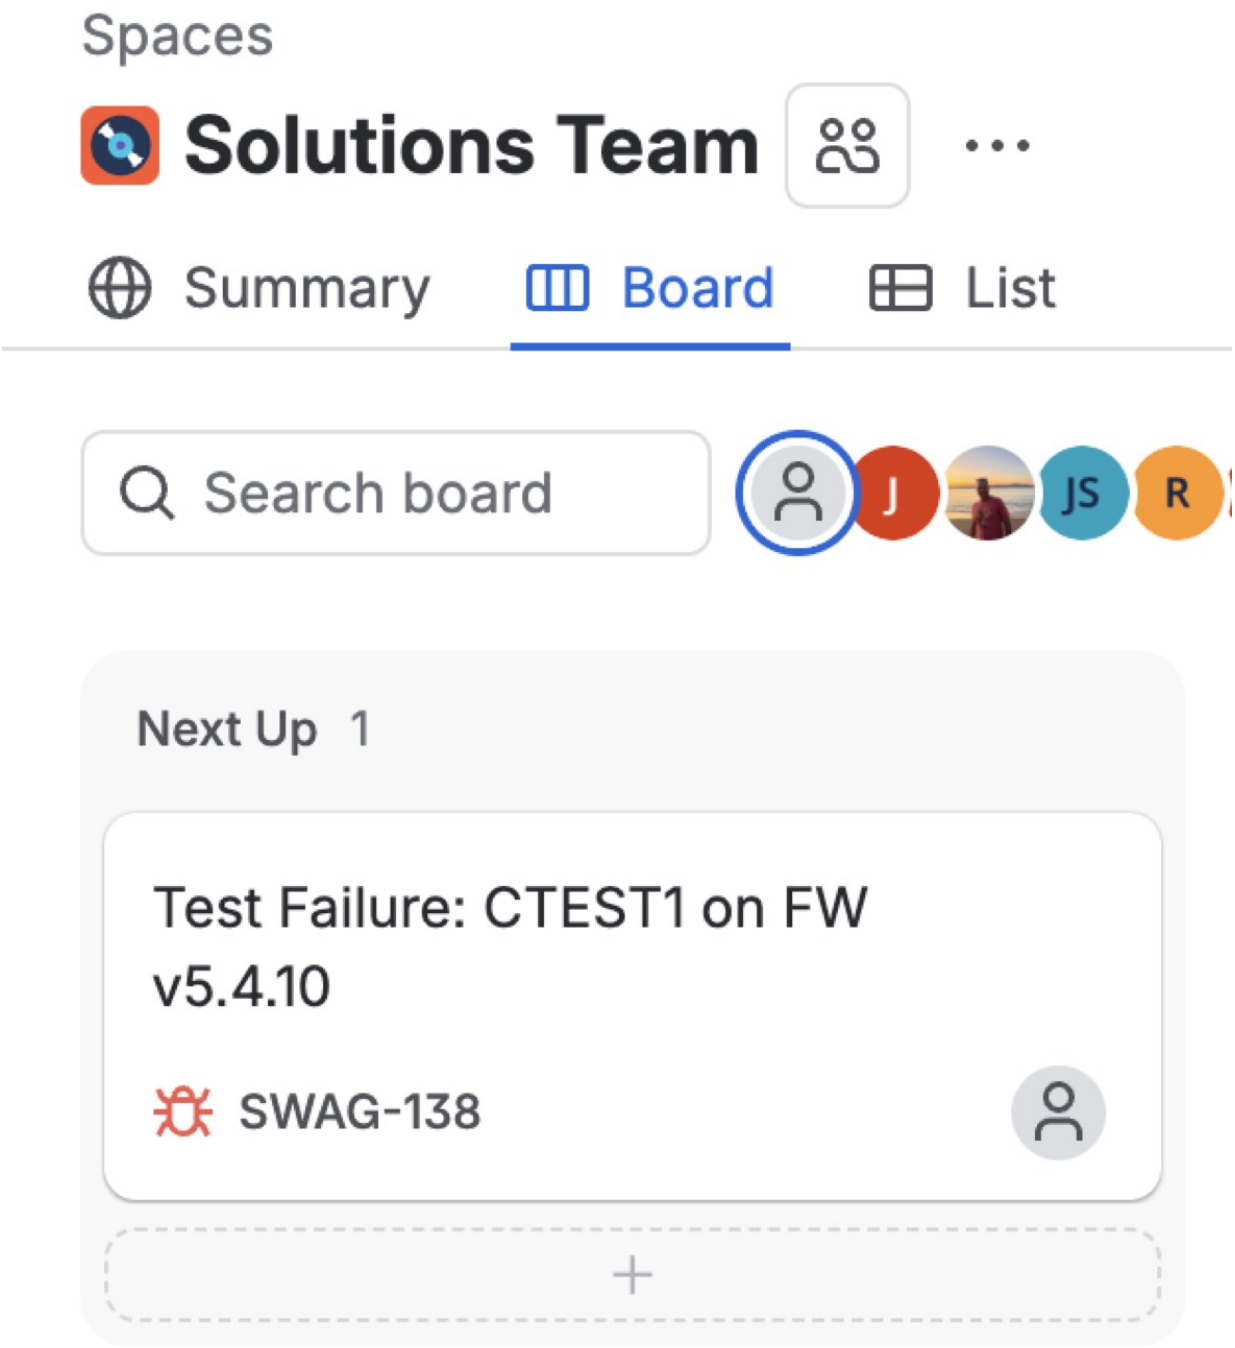


Screenshot 16. The failure alert in Slack.

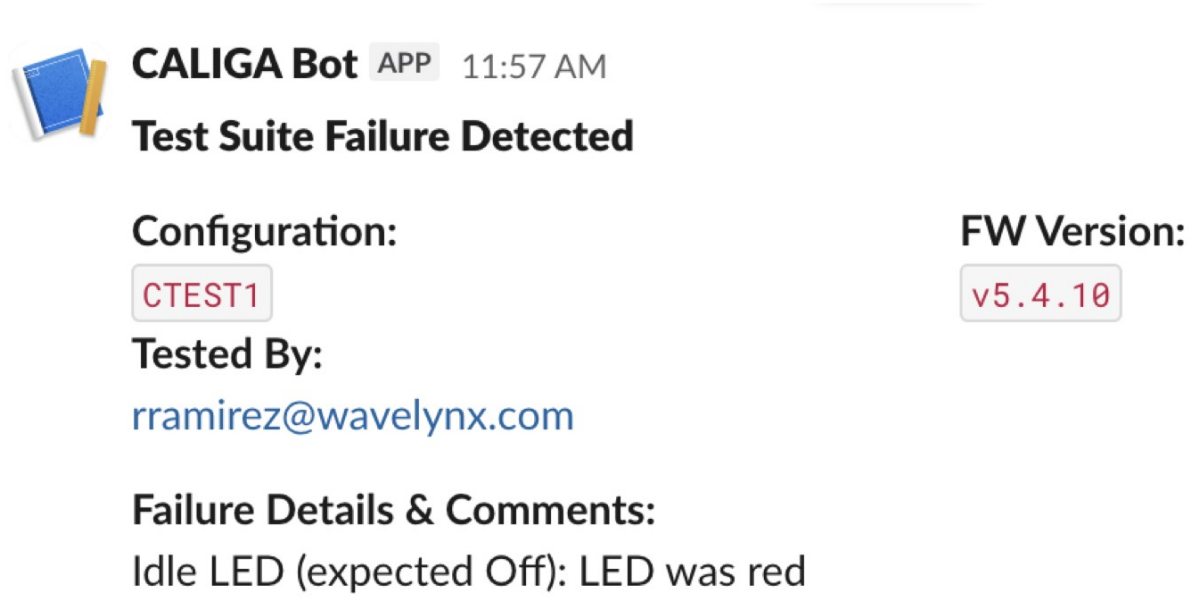


Test 8. Claim and edit the failure

James H. claimed the CTEST1 failure on the Failures page. CALIGA assigned SWAG-138 to James in Jira. Saving the edited INI wrote it to `forge/jhepburn@wavelynx.com/v5.4.10/`.


Screenshot 17. Failures page with CTEST1 claimed by you.

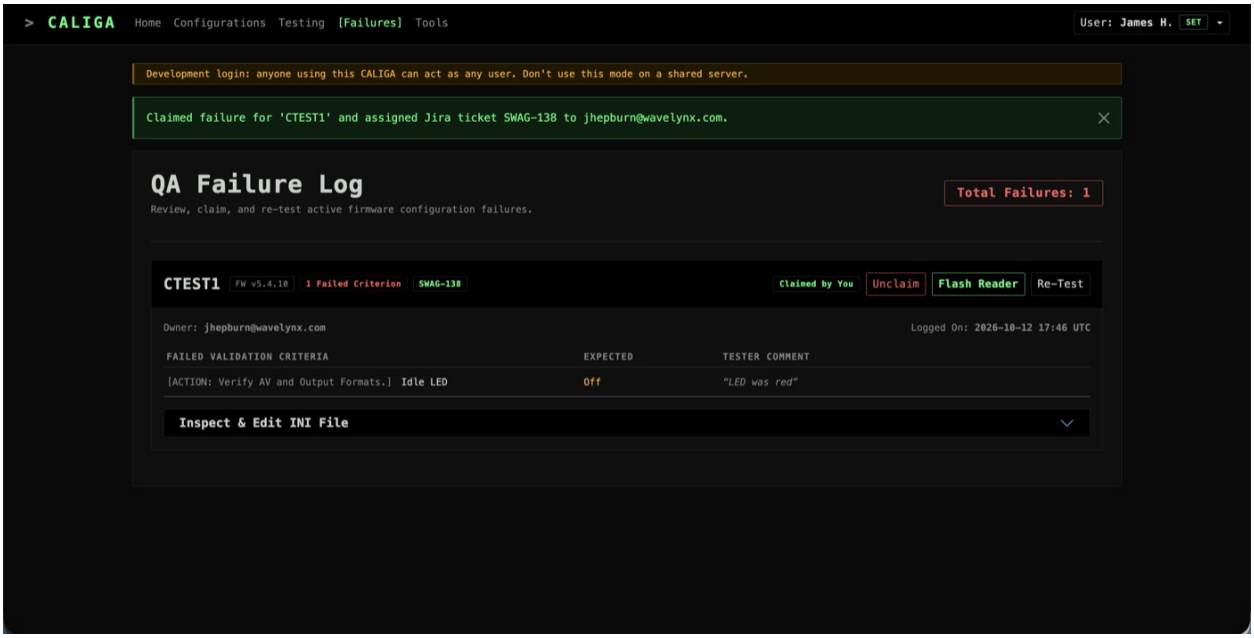

Screenshot 18. SWAG-138 assigned to James in Jira.

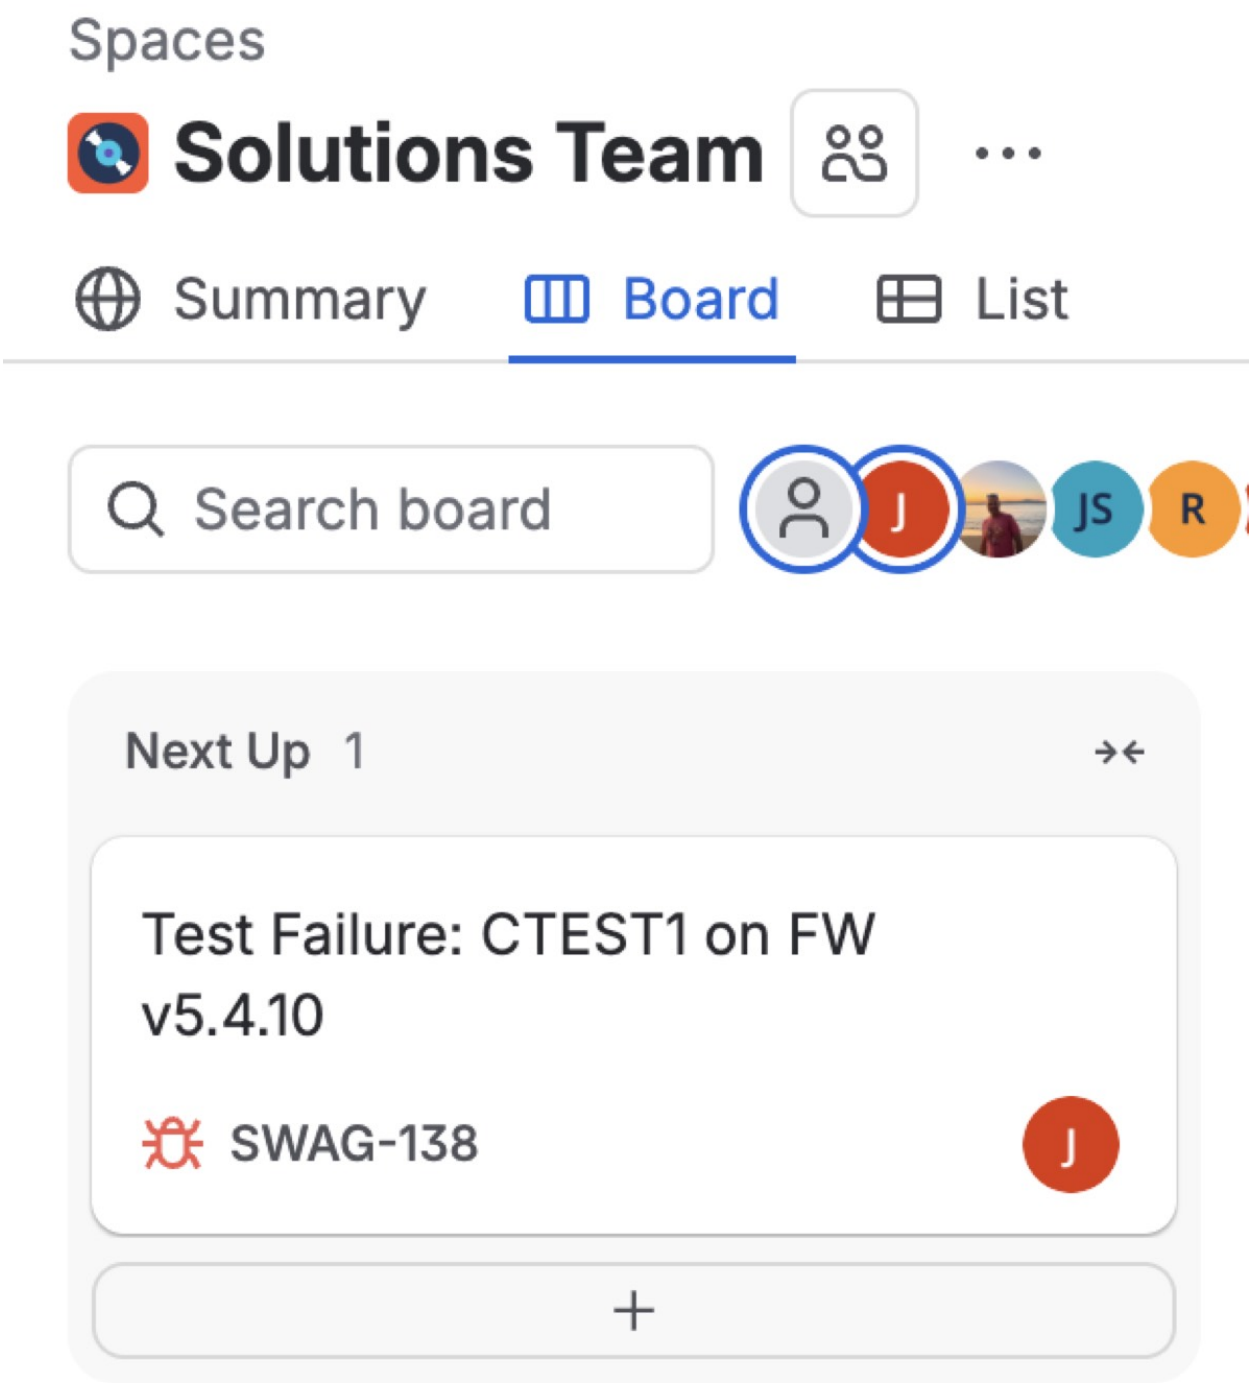


Screenshot 19. INI drawer open with the "saved to Forge bucket" message.

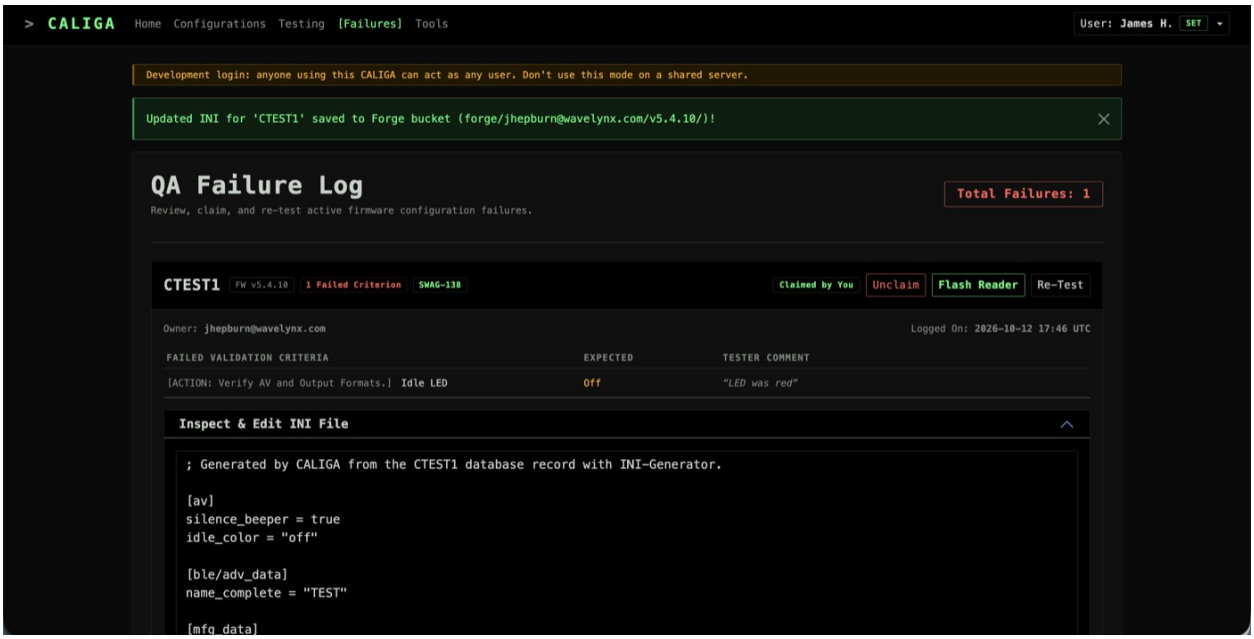


Test 9. Flash CQU1 from the browser

James H. flashed CQU1 (v5.4.10) through the USB-RS485 cable using Web Serial in Chrome. The transfer reached 100% and the reader rebooted. CQU1's revision history recorded the flash as a success.


Screenshot 20. Browser serial port picker with the USB-RS485 cable listed.

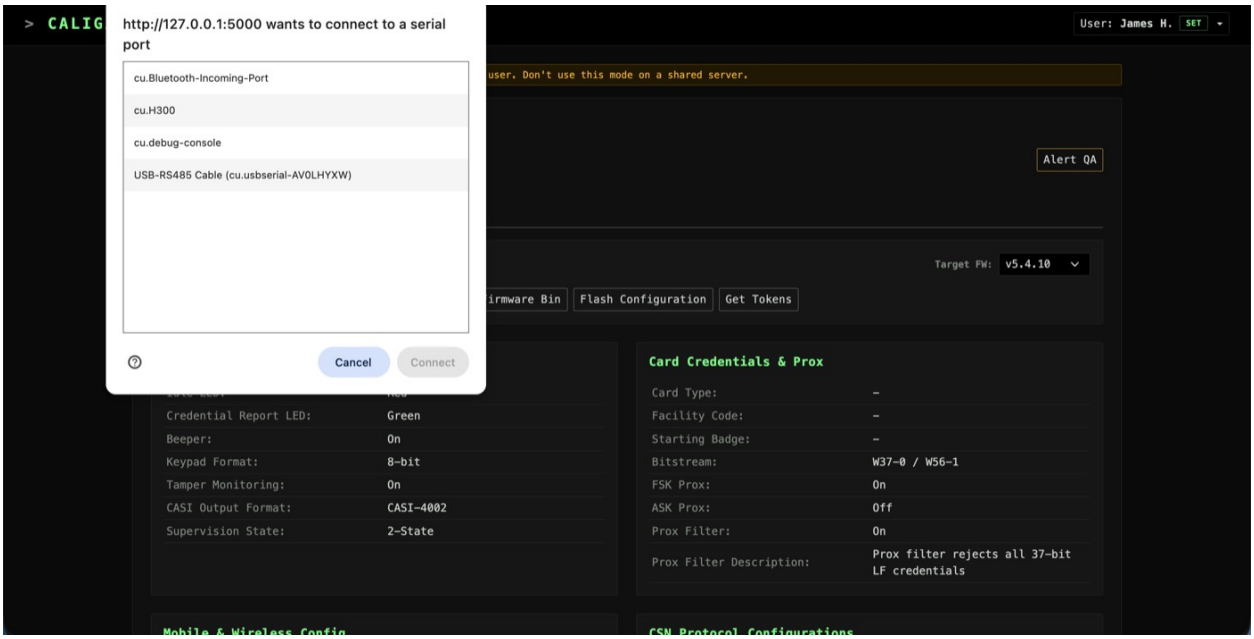


Screenshot 21. Flash window during the transfer, at 8.7%.

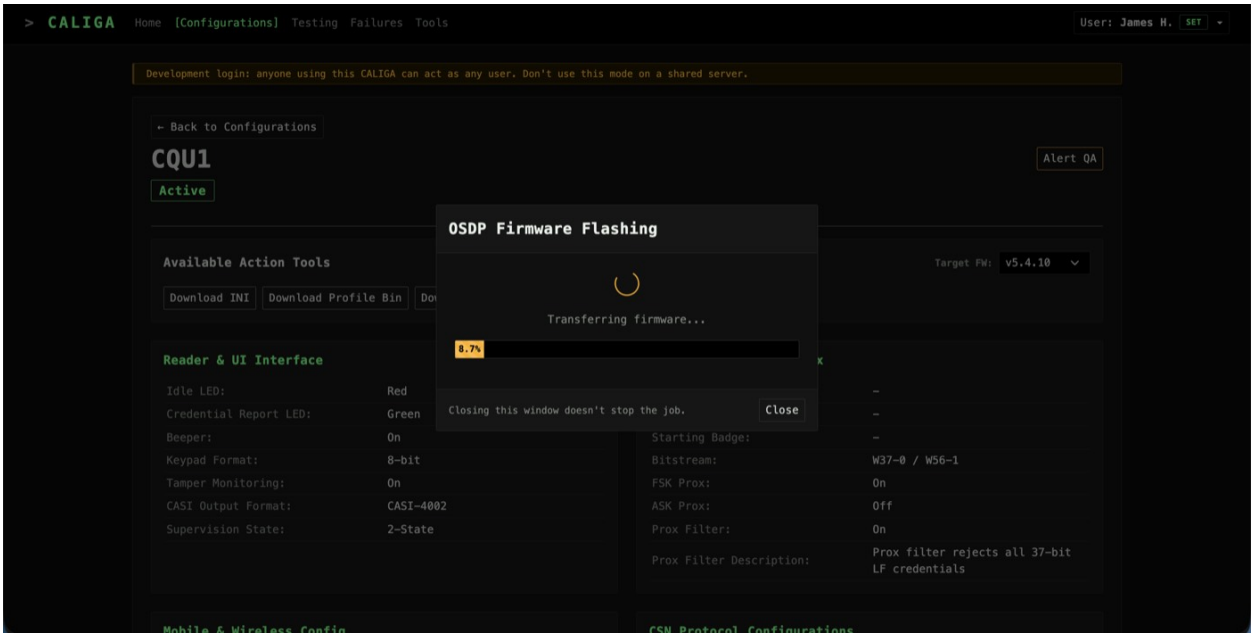

Screenshot 22. Flash window finished, "Reader is rebooting!"

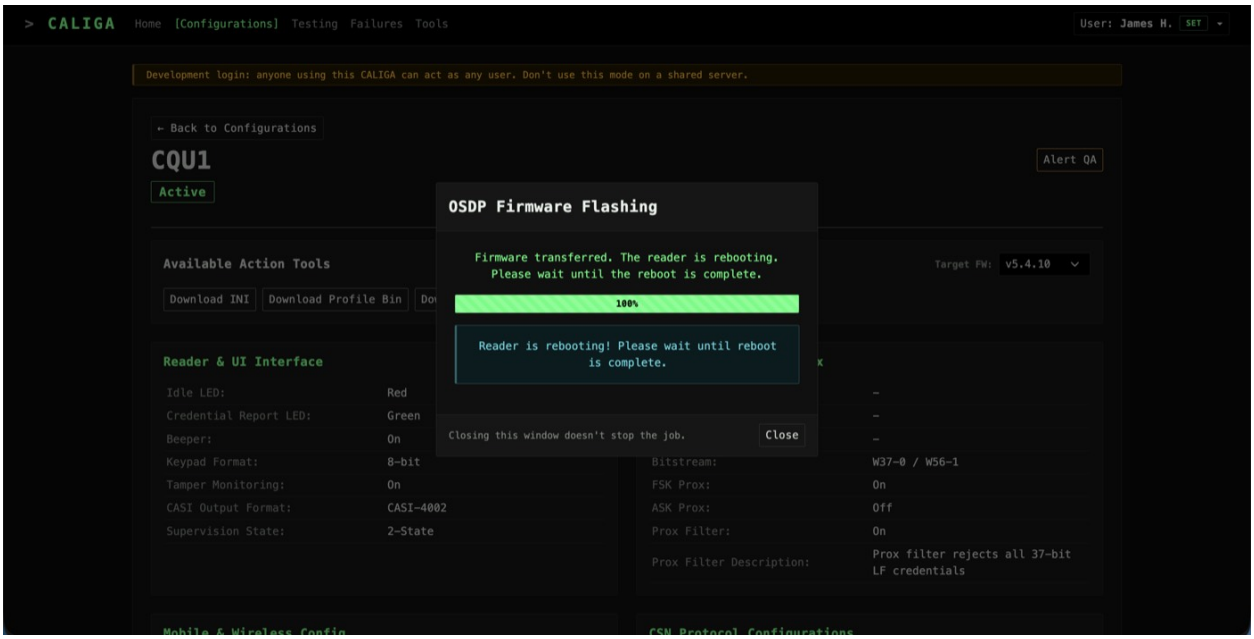


Screenshot 23. CQU1 revision history with the flash entry.

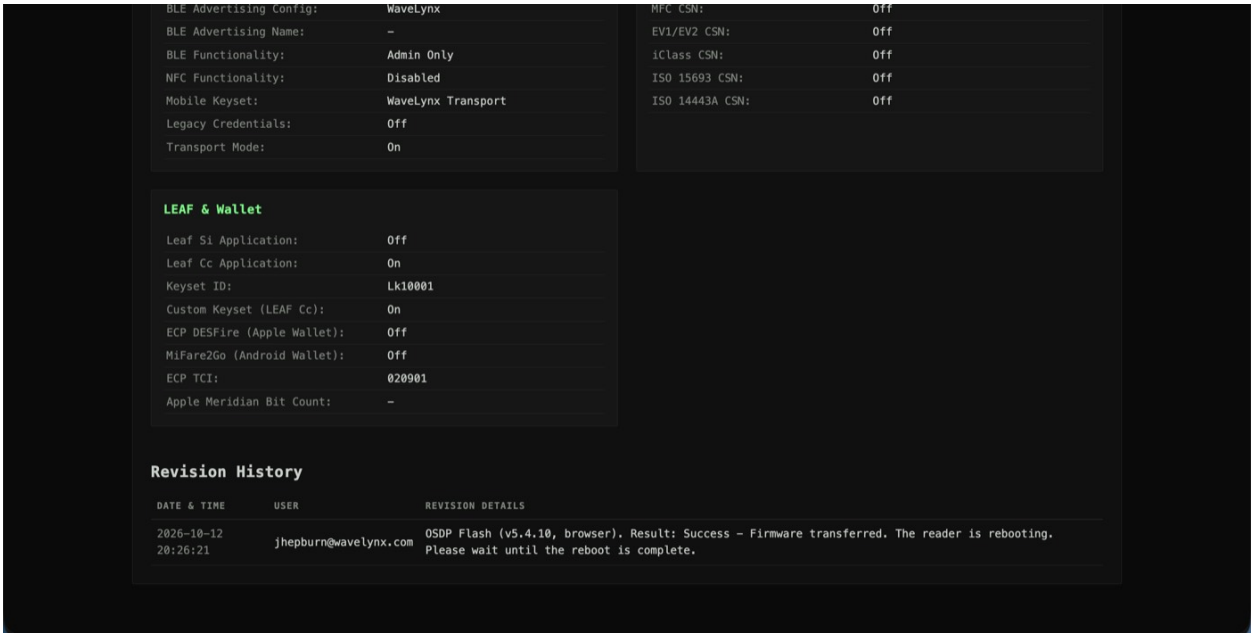


Test 10. Flash the edited INI and request a re-test

From the Failures page, James H. rebuilt CTEST1's firmware from the edited INI with Forge and flashed it. Re-Test then moved SWAG-138 to Complete and posted a re-test request in Slack.


Screenshot 24. Flash window on the "Building firmware" step.

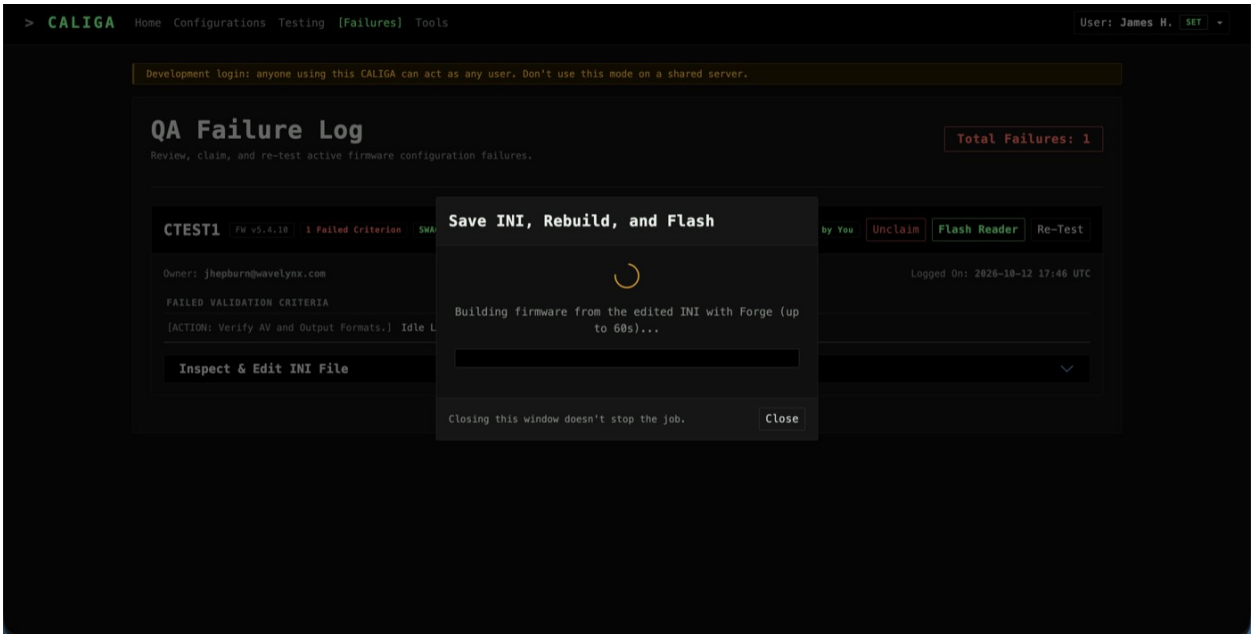


Screenshot 25. Flash window finished.

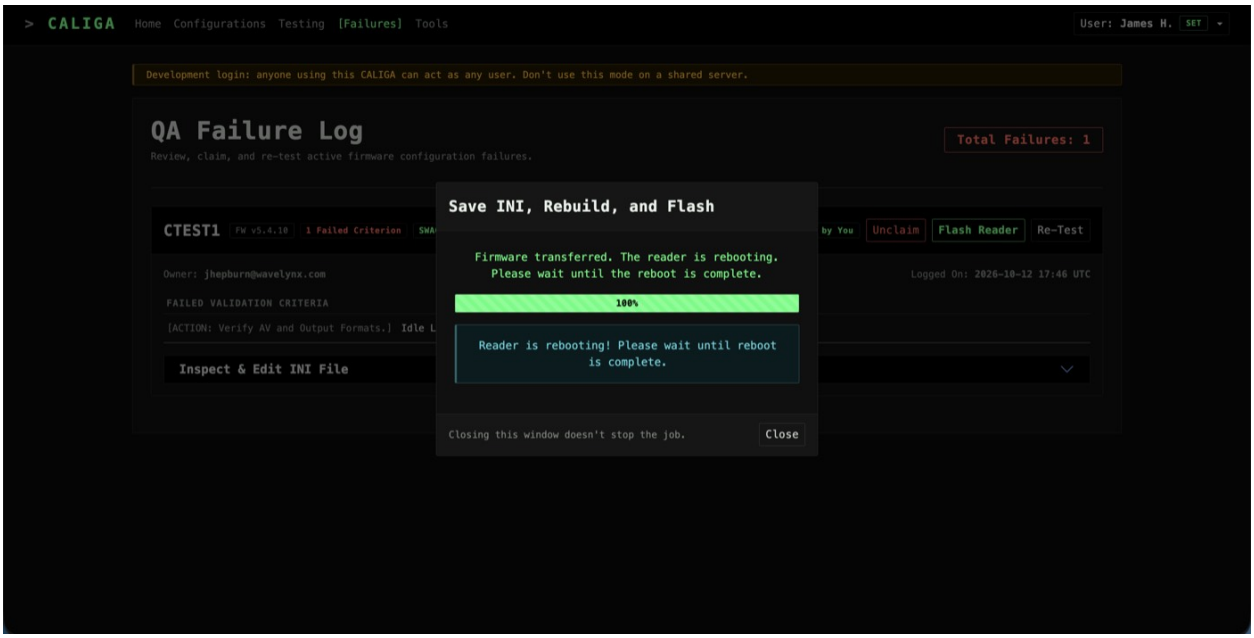

Screenshot 26. SWAG-138 moved to Complete.

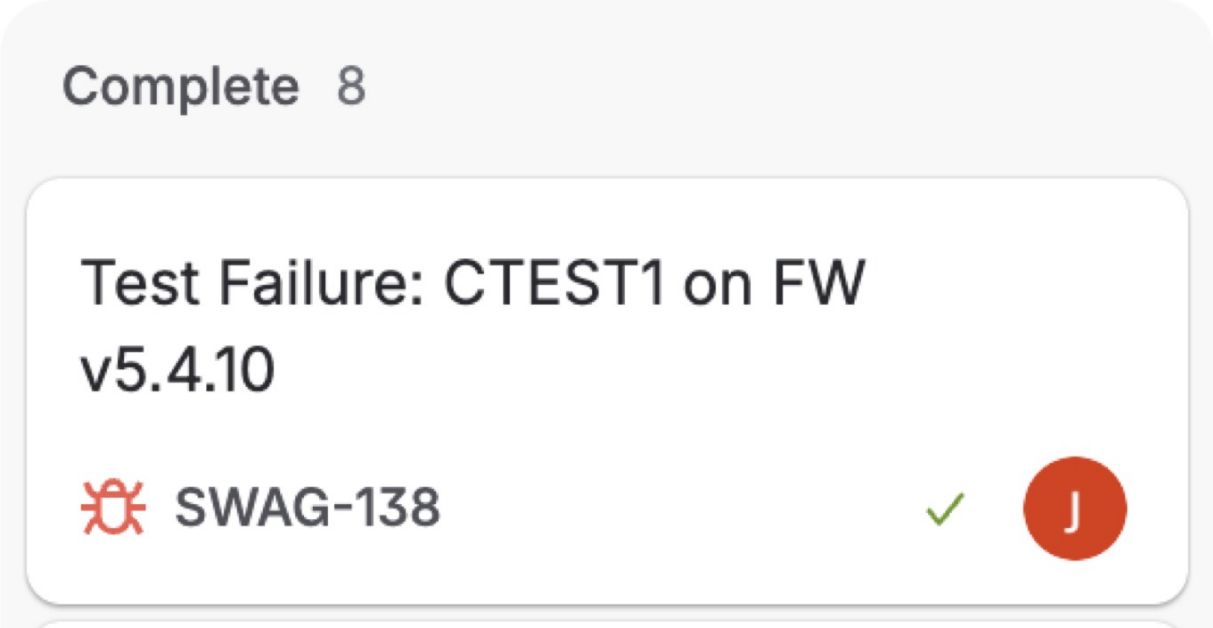


Screenshot 27. Re-test request in Slack.

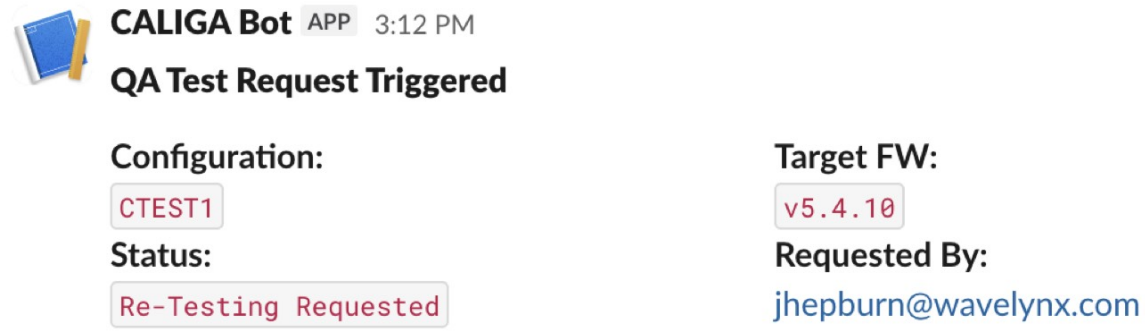


Test 11. Pass to Production

Rebecca R. re-tested CTEST1 in Run #10 and passed every criterion. CALIGA promoted CTEST1 from Active to Production. Revision history shows the whole path, from creation through the edited-INI flash and re-test to the promotion.

Screenshot 28. "PASSED! Configuration is in Production" message.

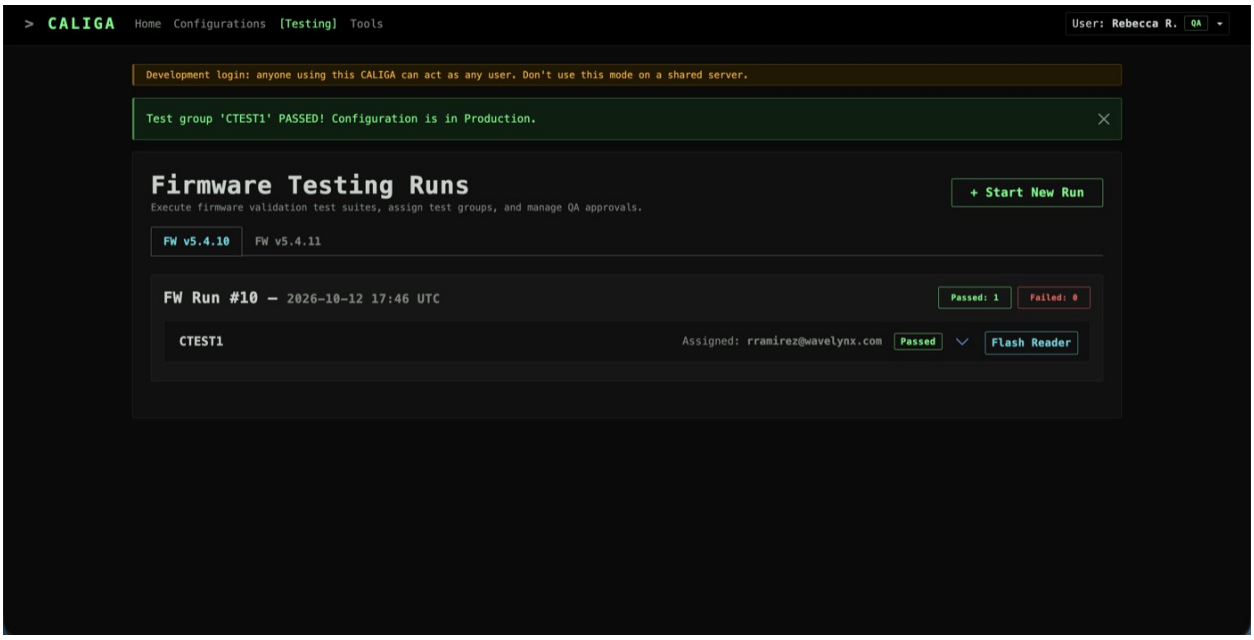

Screenshot 29. CTEST1 revision history ending in "Promoted from Active to Production".

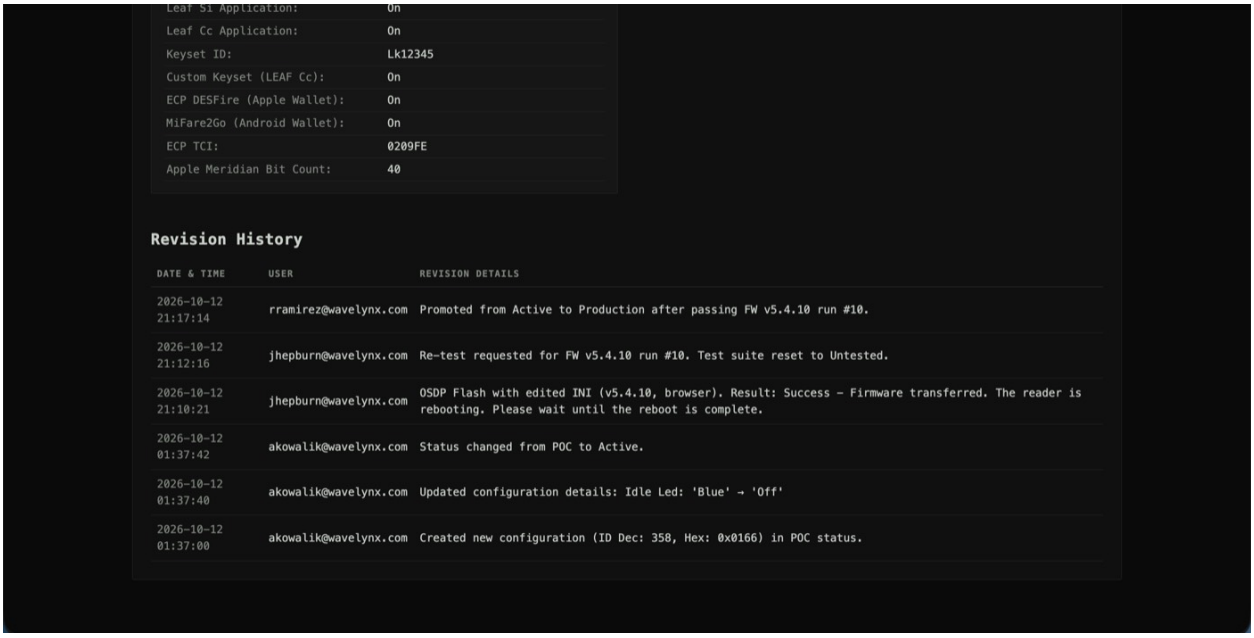


Test 12. Tools


All four tools returned results on v5.4.10:

- **Partial config.** Built a partial INI and profile BIN.
- **INI Translator.** Translated an uploaded INI into plain settings.
- **YAML Automator.** Produced a SAM config file.
- **Batch Tokens.** Looked up tokens for CQU1 and CWL1.

Screenshot 30. Partial config window with both download links.

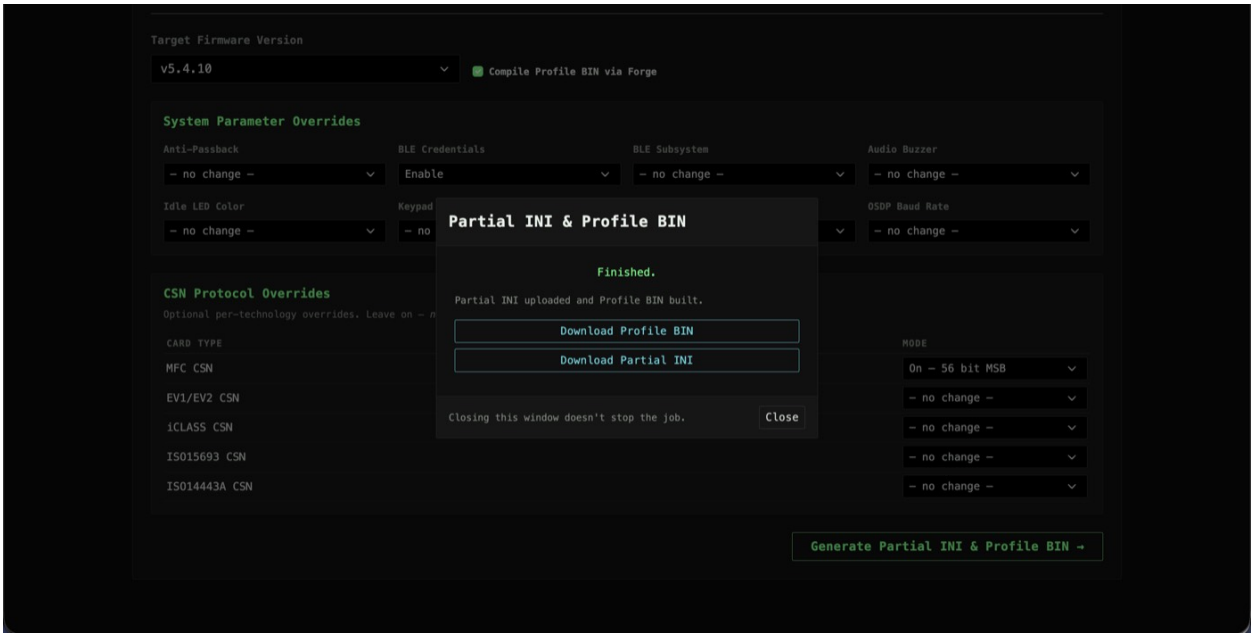

Screenshot 31. INI Translator results.

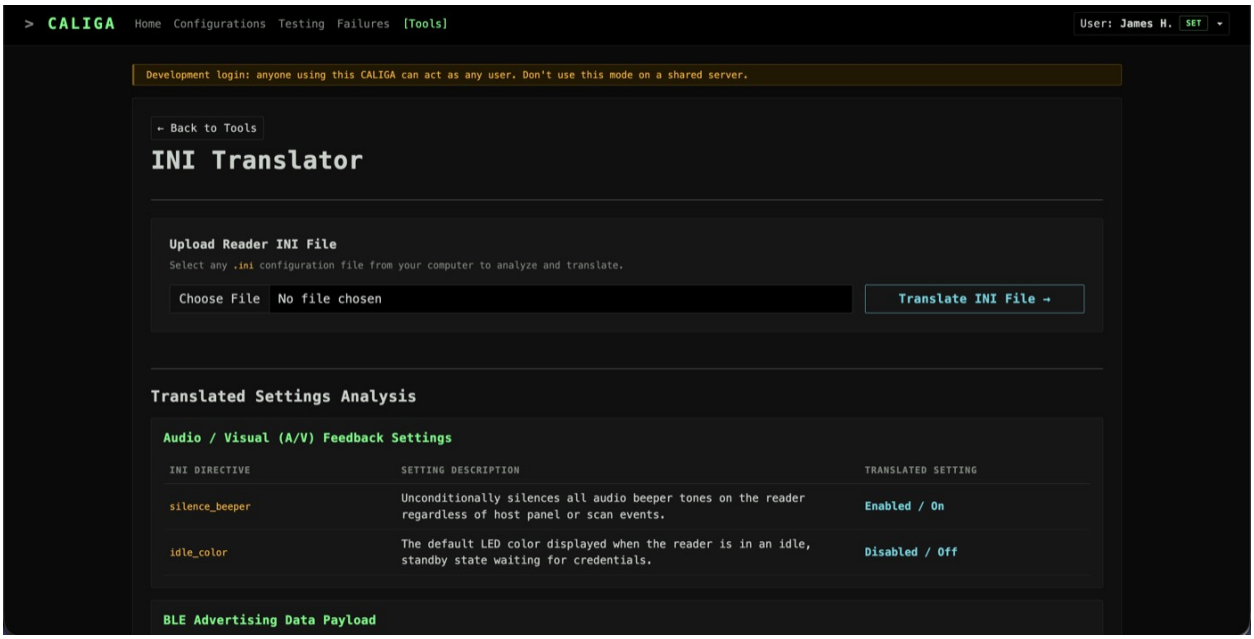

Screenshot 32. YAML file in a text editor.



Screenshot 33. Batch Tokens lookup results.

