

Combo board errata

6 Apr. 2018 JI1UDD

- Wrong MCP23008 footprint

SSOP-20 version is used on Combo board schematic. But SOIC-20 footprint is used on PCB. MCP23008 SOIC-20 is not in the lineup, but SOIC-18 is in the lineup. Use MCP23008-E/SO (SOIC-18), place it close to the 1pin side.

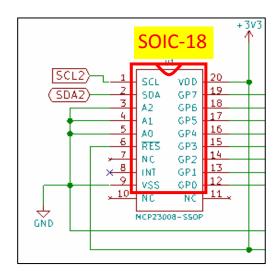

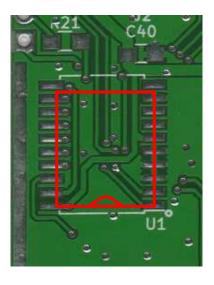

cf.

