
DI1KM-07

DTC B2791/99 Key Unlock Warning SW OFF Malfunction

CIRCUIT DESCRIPTION

DTC No.	DTC Detection Condition	Trouble Area
B2791/99	Open circuit in key unlock warning switch circuit Key unlock warning switch adheres to OFF position	Key unlock warning switch Wire harness ECM

WIRING DIAGRAM

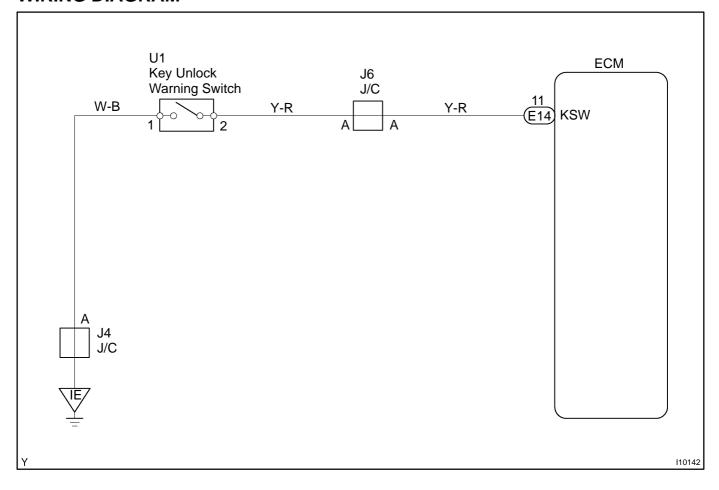

2002 4RUNNER (RM887U)

Author: Date: 678

INSPE	CTIO	N DD	OCE	JIIDE
INSPE	しロひ	IN PR	UGEI	JUKE

1 Check key unlock warning switch (See page BE-12).

NG

Replace key unlock warning switch.

OK

2 Check harness and connector between key unlock warning switch and ECM (See page IN-28).

NG

Repair or replace harness or connector.

OK

Replace ECM

2002 4RUNNER (RM887U)

Author: Date: 679