SIEMENS

Installation Instructions
Model VPM-MP

Mounting Plate for the VPM

INTRODUCTION

The VPM-MP mounting plate (shown in Figure 1) is used to mount one VPM module, up to two socket cards and up to 2 HLI High Level Interface cards in a CC-5 footprint of a CAB enclosure. This equipment will support VESDA LaserFocus, LaserCompact, LaserPlus, and Laser Scanner detectors. One VPM can support a total of 200 VESDA detectors.

NOTE

The VPM-MP Mounting Plate is for indoor use only in dry environments.

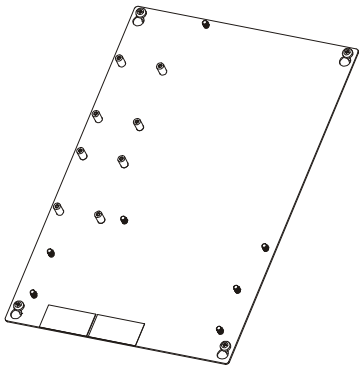


Figure 1
VPM-MP Mounting Plate

INSTALLATION

WARNING

Remove all system power before installation, first battery then AC. (To power up, connect the AC first, then the battery.)


The installation kit consists of the following items:

QUANTITY	ITEM	USE
1	VPM-MP Mounting Plate	Mounts VPM, socket card(s) and HLI card(s)
7	#8-32 kep lock hex nuts	3 hex nuts for mounting VPM; 4 hex nuts for mounting HLI card(s)
8	#8-32 x 5/16 sems-square screws	Used to mount socket card(s)
4	#10-32 x 3/8 pan Phillips screws	Used to mount VPM to enclosure or to CAB-MP
4	3/8" male to female standoffs	Used for mounting HLI cards

The VPM-MP can be mounted in any location in a CAB enclosure (CAB1, CAB1-X, CAB2 or CAB3) where a CC-5 card cage can be mounted. Refer to Figure 2 for the mounting location of the VPM, socket card(s) and HLI card(s) on the VPM-MP mounting plate. Figure 3 shows the VPM-MP with one set of modules mounted on it.


P/N A6V10347525_a_en_US

Siemens Industry, Inc.
Building Technologies Division

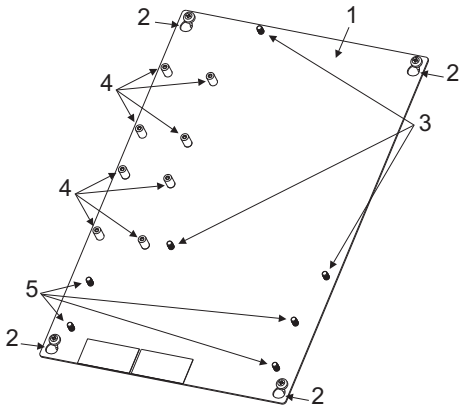

Legend:
1 VPM-MP mounting plate
2 Four (4) keyholes for mounting VPM-MP in CAB enclosure
3 Studs for mounting VPM
4 Standoffs for mounting socket card(s)
5 Four (4) studs for mounting HLI card(s)

Figure 2
Mounting Locations on VPM-MP

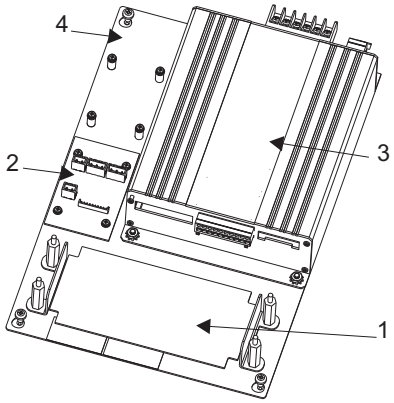


Legend:
1 HLI high level interface card
2 Socket card
3 VPM VESDA peripheral module
4 VPM-MP mounting plate

Figure 3
Modules Mounted on VPM-MP

Mounting the VPM

Mount the VPM to the VPM-MP on the upper right side of the bracket. Refer to Figure 4.

1. Place the VPM on the three studs provided for it on the VPM-MP.
2. Place the three #8-32 kep lock hex nuts provided with the VPM-MP over the studs and secure the VPM in place on the mounting plate.
3. Leave the upper right hand mounting hole open. This hole will be used when the VPM-MP is installed into the CAB enclosure.

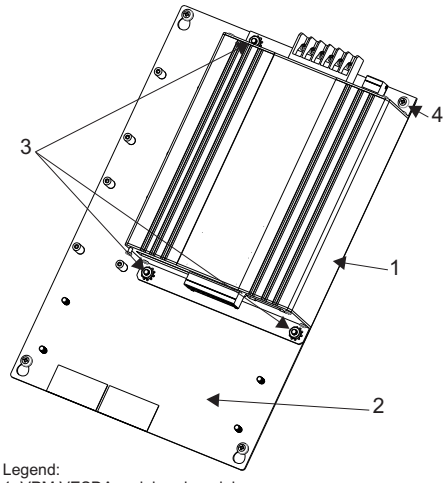

Legend:
1 VPM VESDA peripheral module
2 VPM-MP mounting plate
3 3 #8-32 kep lock hex nuts
4 Open mounting hole

Figure 4
Mounting the VPM on the VPM-MP

Mounting HLI Card(s)

Mount the HLI High Level Interface card(s) on the lower portion of the VPM-MP. Up to two HLI cards can be mounted on a VPM-MP. Refer to Figure 5.

1. Place the HLI card on the four studs on the lower portion on the VPM-MP. Refer to Figure 2 for the location of the studs.
2. Place the four #3/8" male to female standoffs in the studs to secure the HLI card in place on the VPM-MP mounting plate (see Figure 5). Securely tighten the standoffs.
3. If only one HLI card will be used, place one #8-32 kep lock hex nut on top of each of the four standoffs to retain them for possible future use.
4. If two HLI cards will be used, place the second card on top of the four standoffs. Secure the second HLI card in place using one #8-32 kep lock hex nut on top of each of the four standoffs.

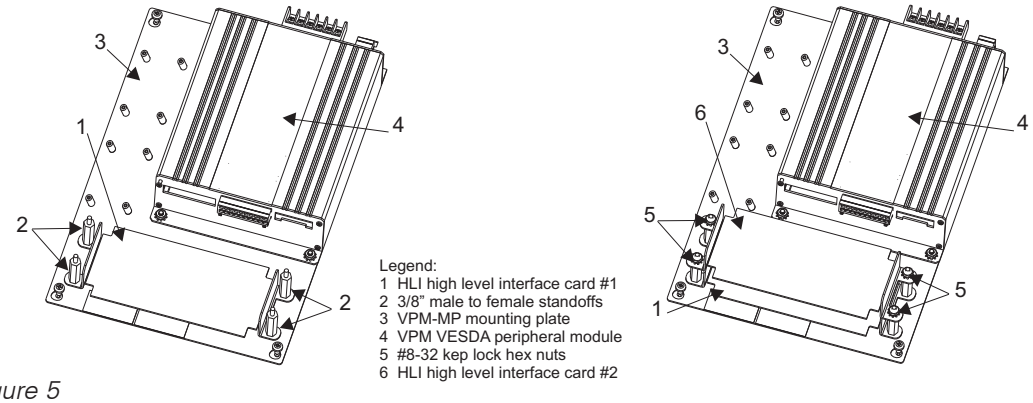


Figure 5
Mounting the HLI Card(s) on the VPM-MP

Mounting Socket Card(s)

Mount the Socket Card(s) on the left hand side of the VPM-MP to the left of the VPM and above the HLI card(s). Up to two Socket Cards can be mounted on the VPM-MP. Refer to Figure 6.

1. Mount Socket Card #1 on the four standoffs above the location where the HLI is mounted. Secure the socket card in place with four #8-32 x 5/16 sems-square screws provided.
2. If a second Socket Card is used, mount it on the four standoffs above socket card #1 and secure it in place with the remaining four #8-32 x 5/16 sems-square screws provided.


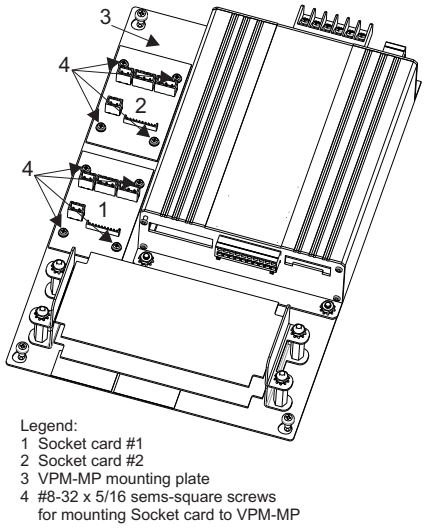


Figure 6
Mounting Socket Card(s) on the VPM-MP

Mounting the VPM-MP

The VPM-MP mounts in any location in a CAB enclosure (CAB1, CAB1-X, CAB2 or CAB3) where a CC-5 card cage can be mounted. The VPM-MP can also be mounted on a CAB-MP mounting plate. Refer to Figure 7.

1. To mount the VPM-MP in a CAB enclosure or on a CAB-MP, place three of the four #10-32 x 3/8 pan Phillips screws supplied with the VPM-MP in the studs in the enclosure backbox or CAB-MP that line up with the bottom two and top left keyhole openings in the VPM-MP. Tighten the screws halfway.
2. Place the VPM-MP mounting plate over the three screws and drop it in position.
3. Install the fourth #10-32 x 3/8 pan Phillips screw into the upper right hand mounting hole. This screw will pass through the VPM mounting hole and into the stud in the CAB or CAB-MP.
4. Tighten the screws to secure the VPM-MP in place.

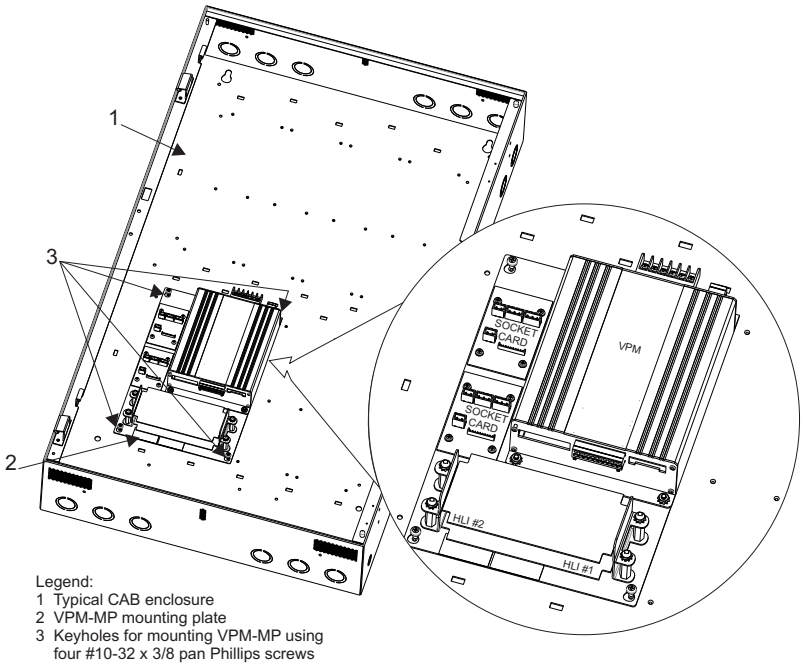

Legend:
1 Typical CAB enclosure
2 VPM-MP mounting plate
3 Keyholes for mounting VPM-MP using four #10-32 x 3/8 pan Phillips screws

Figure 7
Mounting the VPM-MP in a Typical CAB Enclosure

Refer to the VPM Installation Instructions, P/N A6V10347523, for wiring information.

COMPATIBILITY

The VPM-MP can be used in CAB1, CAB1-X, CAB2, and CAB3 enclosures and on the CAB-MP.

DIMENSIONS

VPM-MP Mounting Plate: 9.50"W x 14.25"H

Siemens Industry, Inc.
Building Technologies Division
Florham Park, NJ

Siemens Canada Limited
Building Technologies Division
2 Kenview Boulevard
Brampton, Ontario L6T 5E4 Canada

PN A5Q00051761 P/N A6V10347525_a_en_US