

## ROUTE INFORMATION MANUAL EMERGENCY ESCAPE ROUTES

**WIDE BODY** 


Chapter: **10.3**Page: **41 - 94**Date: 17 SEP 14

### G325 PS - 61nm SW PURPA

#### **CHART REFERENCES:**

- ME/CH (H/L) 5
- OPPS (Peshawar) DEST 1 ALT MES
- OPRN (Islamabad) DEST 1 ALT MES



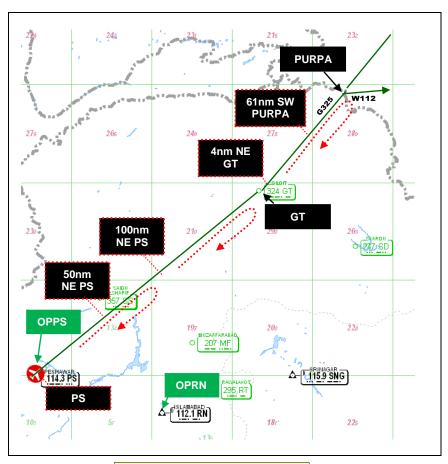

**SEE INSTRUCTIONS NEXT PAGE** 



# ROUTE INFORMATION MANUAL EMERGENCY ESCAPE ROUTES

**WIDE BODY** 

Chapter: **10.3** Page: **42 - 94** 

Date: 17 SEP 14

### G325 PS - 61nm SW PURPA

ENGINE FAILURE	DEPRESSURIZATION	ENGINE FAILURE + DEPRESSURIZATION
Start the turn,     Apply OBSTACLE STRATEGY,     Return on G325 to PS and divert to Peshawar (OPPS) or Islamabad (OPRN).	Start the turn, Descend initially FL290, Return to PS on G325,  4NM NE GT descend FL200, At 100NM NE PS descend FL140 and continue, At 50NM NE PS descend FL100 and divert to Peshawar (OPPS) or Islamabad (OPRN).	Start the turn,     Apply OBSTACLE STRATEGY,     Return to PS on G325      4NM NE GT initiate EMERGENCY DESCENT FL200, and continue PS on G325.      At 100NM NE PS descend FL140 and continue PS      At 50NM NE PS descend FL100 and divert to Peshawar (OPPS) or Islamabad (OPRN).