


ROUTE INFORMATION MANUAL EMERGENCY ESCAPE ROUTES

NARROW BODY

Chapter: **10.1** Page: **60 - 72**

Date: 04 MAR 15

G325 PS - 61nm SW PURPA CHART REFERENCES: • ME/CH (H/L) 5 • OPPS (Peshawar) DEST 1 ALT MES • OPRN (Islamabad) DEST 1 ALT MES

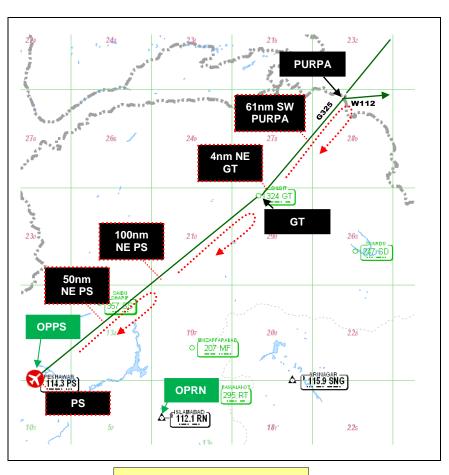

SEE INSTRUCTIONS NEXT PAGE



ROUTE INFORMATION MANUAL EMERGENCY ESCAPE ROUTES

NARROW BODY

Chapter: **10.1** Page: **61 - 72**

Date: 04 MAR 15

G325 PS - 61nm SW PURPA

ENGINE FAILURE	DEPRESSURIZATION	ENGINE FAILURE + DEPRESSURIZATION
Start the turn, Apply OBSTACLE STRATEGY, Return on G325 to PS and divert to Peshawar (OPPS) or Islamabad (OPRN).	 Start the turn, Descend initially FL290, Return to PS on G325, At 4nm NE GT descend FL200, At 100nm NE PS descend FL140, At 50nm NE PS descend FL100 and divert to Peshawar (OPPS) or Islamabad (OPRN). 	Start the turn, Apply OBSTACLE STRATEGY, Return to PS on G325 4nm NE GT initiate EMERGENCY DESCENT FL200, and continue PS on G325. At 100nm NE PS descend FL140 At 50nm NE PS descend FL100 and divert to Peshawar (OPPS) or Islamabad (OPRN).