

d1 HAS BEEN corrected
to 8224 pin 7
because pin 11 is upside
down. pin 7 is sts
(status stable)

6-2-80 - VSSB


2-8


2001 09

2/16/83


I/O section of CPU BOARD

schematic

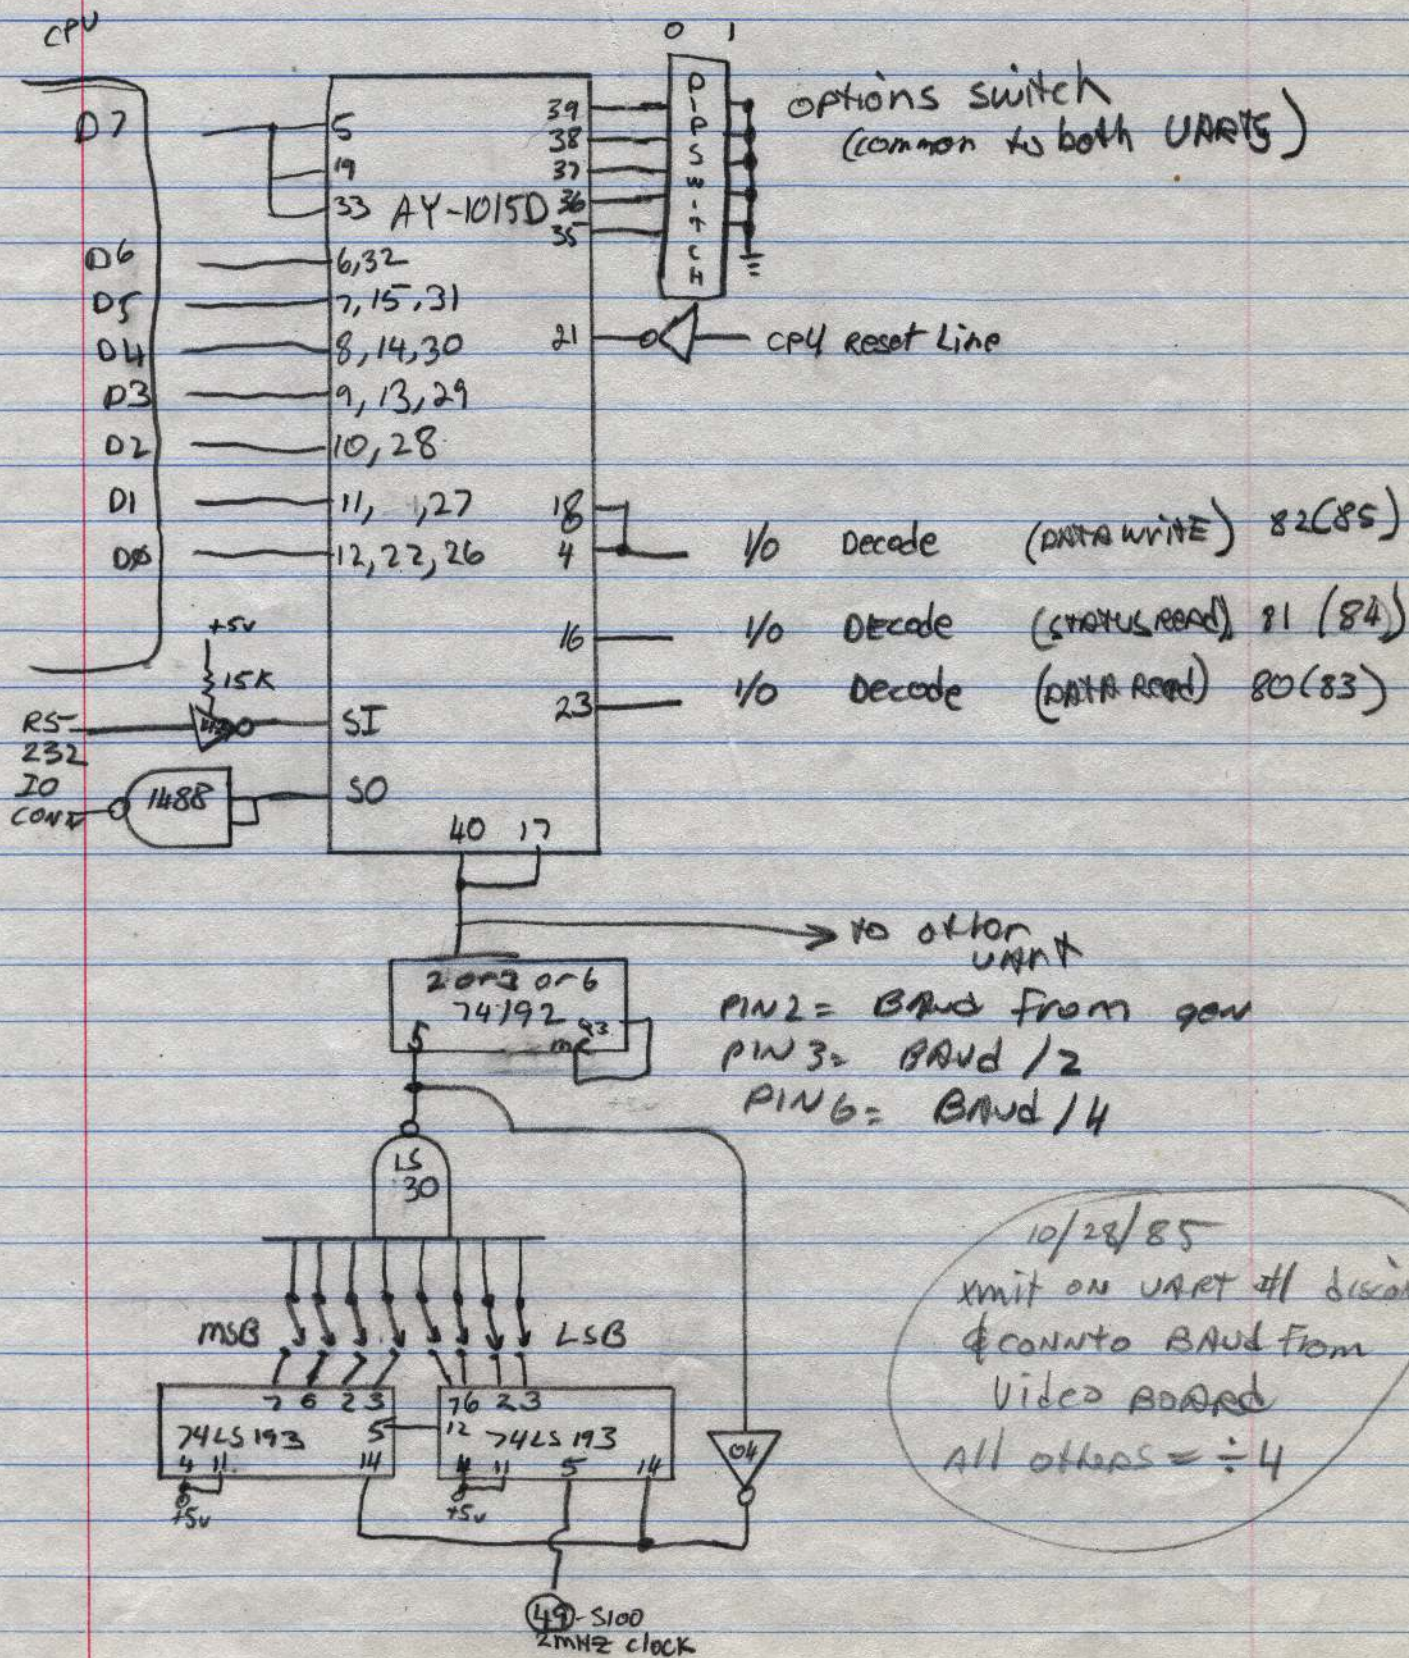

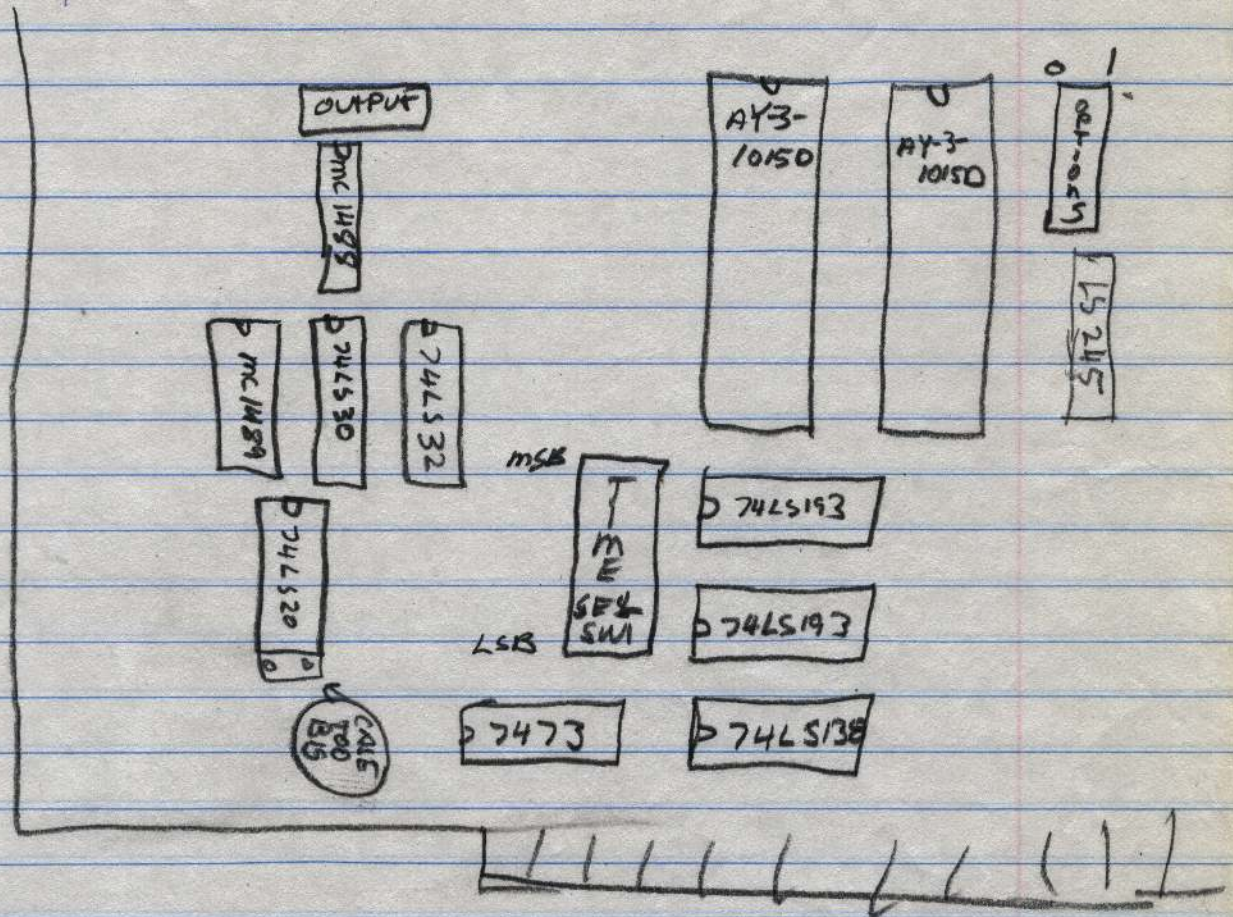


BAUD	VALUE	SWITCH
300	= 208	= ↑↑↓↑↓↓↓
600	= 104	= ↓↑↑↓↑↓↓
1200	= 52	= ↓↓↑↑↓↑↓
2400	= 34	= ↓↓↓↑↑↑↓
3600	= 26	= ↓↓↓↑↑↓↑
4800	= 13	= ↓↓↓↓↑↑↑
9600	= 6	= ↓↓↓↓↑↑↓
19200	= 3	= ↓↓↓↓↓↑↑

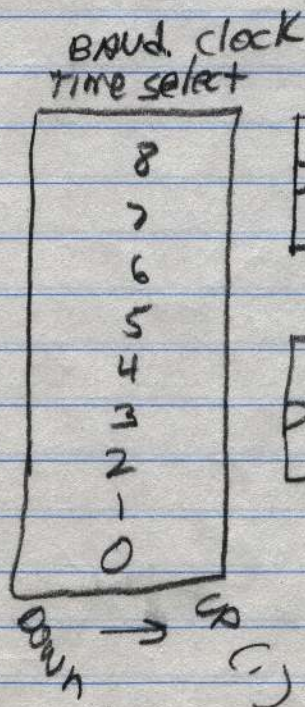

clock sent out to pin 24
 12 sent out
 12 sent out

option switches

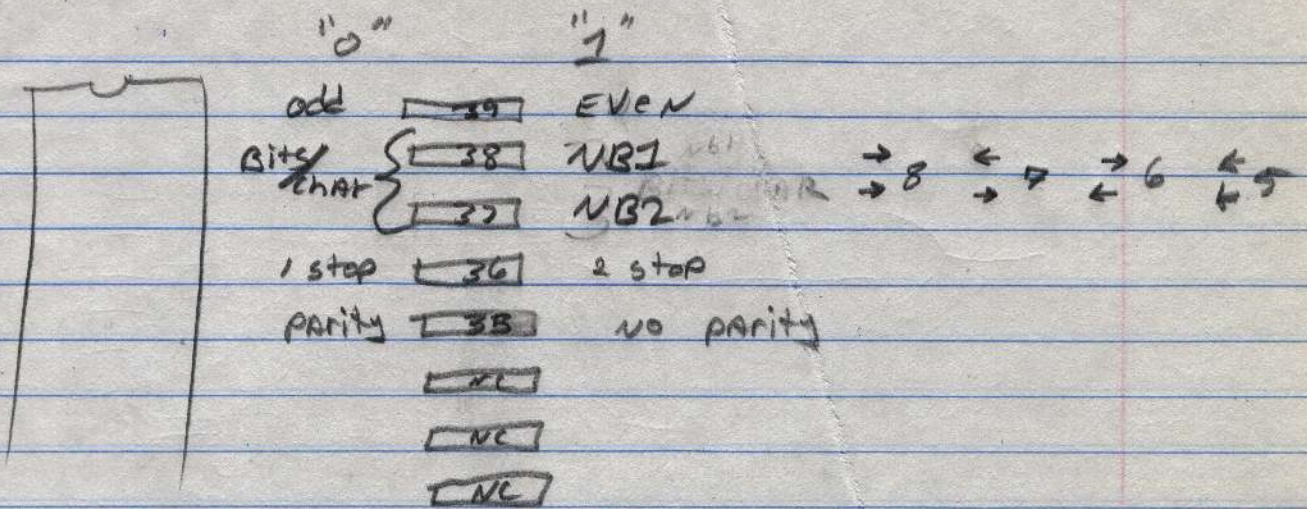

(UP = AWAY FROM UNIT)

OPTION switch

up (1) down (0)

39 = EVEN P odd P

38 = BITS/CHAR

37 = " "

0 0 = 5


0 1 = 6

1 0 = 7

1 1 = 8

36 = 2 1 stop bits

35 = NO P YES P parity disable

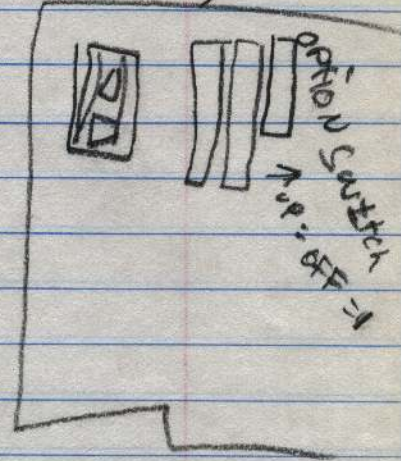

UART ADDRESSES

I/O ADDR #

CONSOLE

		function	UART #
128 -	80 -	DATA READ	1
129 -	81 -	STATUS READ	1
130 -	82 -	DATA WRITE	1
131 -	83 -	DATA READ	2
132 -	84 -	STATUS READ	2
133 -	85 -	DATA WRITE	2

STATUS BYTE (same for each port)

	TBMT	xmit Buffer empty + cts ^{not implemented}
0	TEOC	xmit end of char
1	X	X
2	X	X
3	RPE	PARITY error on read
4	RFE	Framing error (no valid stop bit)
5	ROR	OVER RUN (not read last char)
6	X	X
7	DAV	DATA AVAILABLE AT RCVR

UART BAUD RATE SELECTION




$$300 \text{ baud} = \uparrow\uparrow\uparrow\downarrow\downarrow\downarrow = 208 = 416/2 = 00$$

$$2400 \text{ " } = \downarrow\downarrow\downarrow\uparrow\uparrow\uparrow = 26 = 56/2 =$$


see pg 185

IEEE 696 Interfacing BOOK

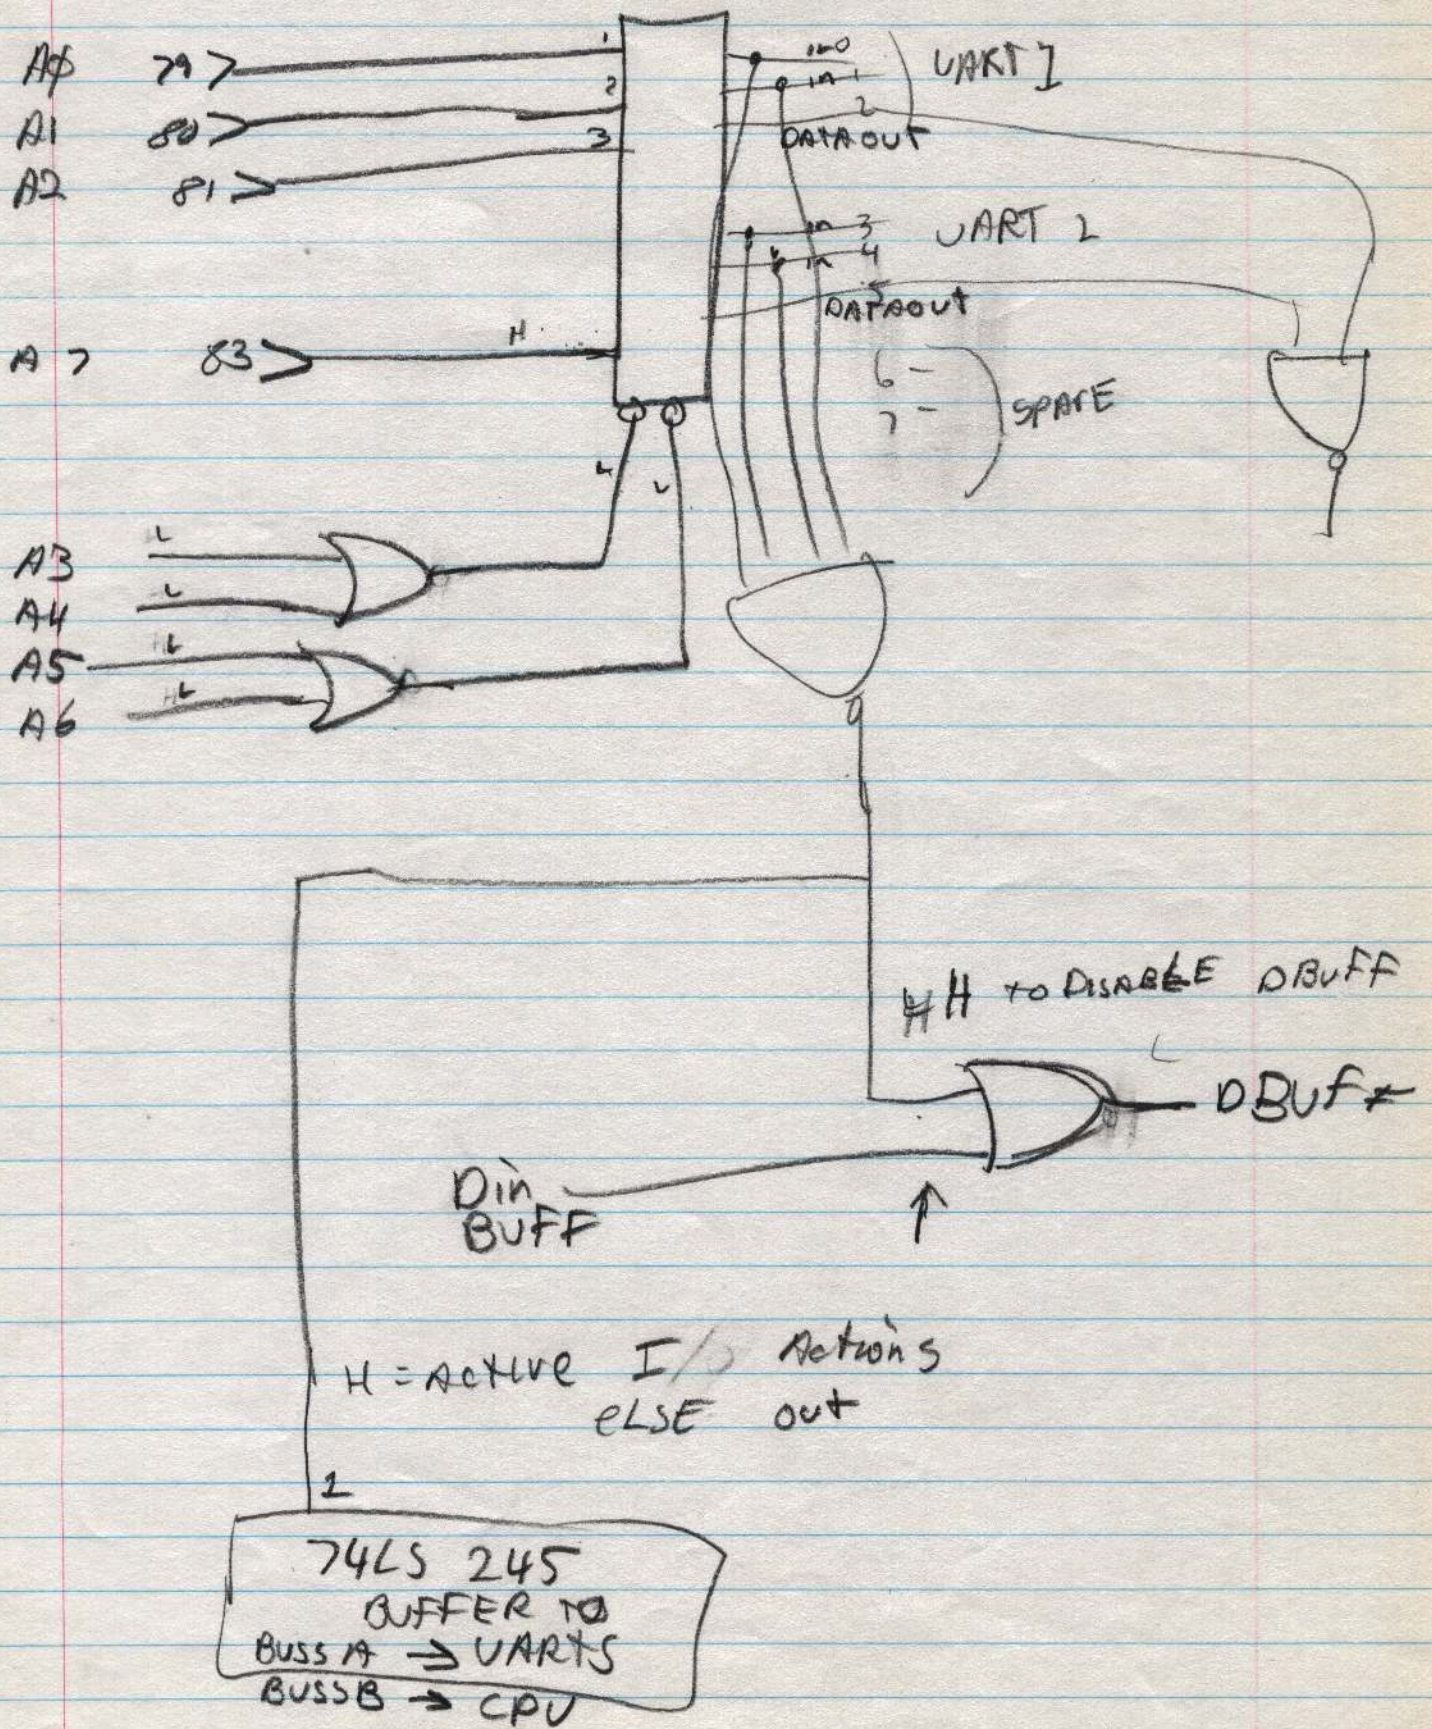

ENABLE out




Din ENABLE from CPU Accode
U29 pin 8

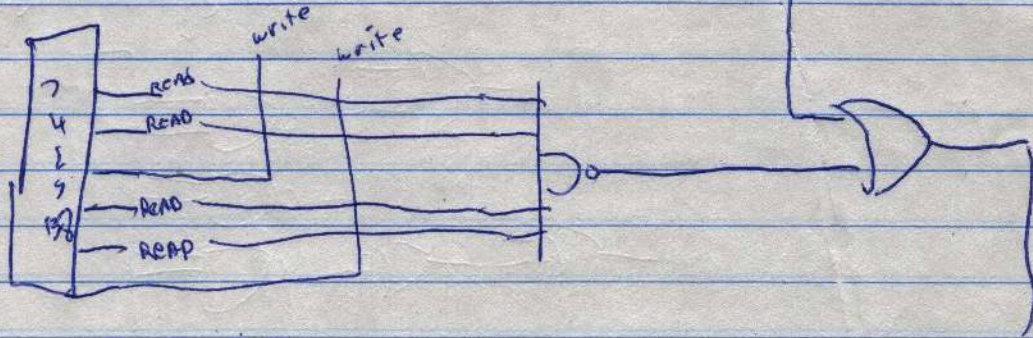

to Din Buffer
enable

U10 pins 1 & 19

280 and
UART BRG
 $BRG = 2 \text{ MHz} \div 16$

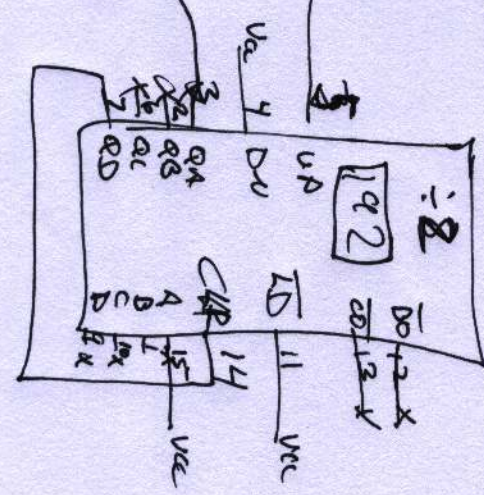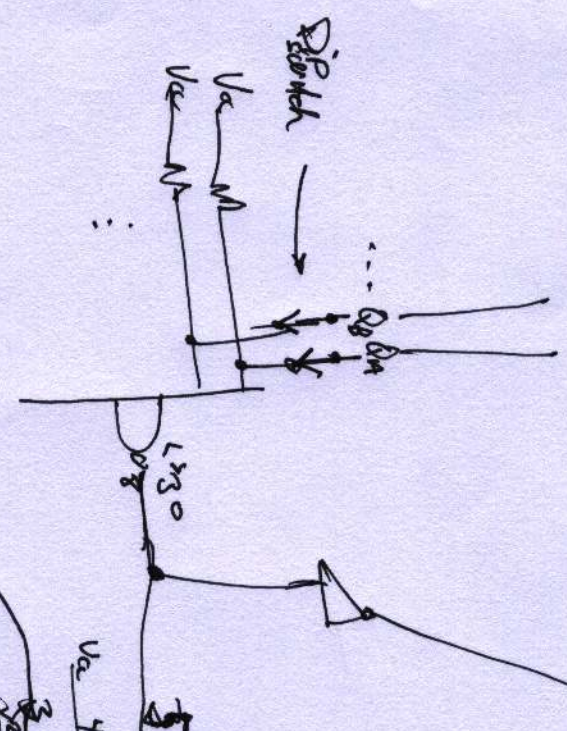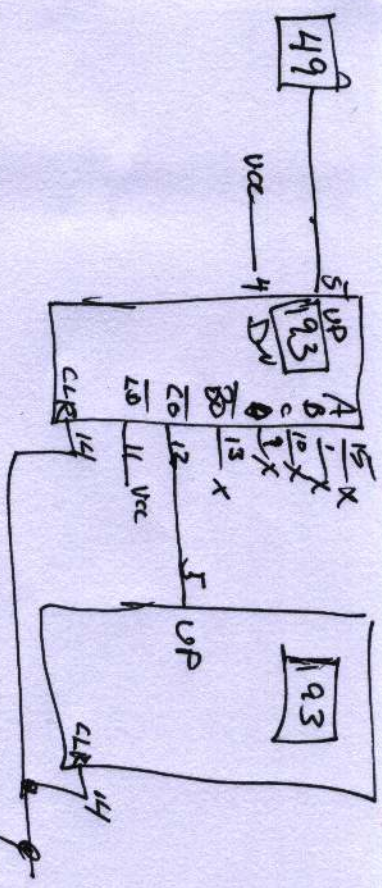

20-7