

# **INSPECTION AND TEST PLAN**

**Section 1800**

**AIR ADMISSION**

**Project: SEVEN MILE**

**Unit 4**



GE Hydro

# INSPECTION AND TEST PLAN

Project SEVEN MILE

Customer: B.C. Hydro

Contract: SM-70

Unit 4

Section 1800 : Air admission

Page: 1801

CODE

A: Hold point/ customer

T: Witness point/ customer

I : Inspection and test point

R: Results recorded in Q-A files

Copy to customer

M: Monitoring in process

O: Assembly Operation

V: In process Verification/ operation

| Oper. # | Ref.<br>GE | Code | Description | Reference documents | Comments | Form | Date and initials |
|---------|------------|------|-------------|---------------------|----------|------|-------------------|
|---------|------------|------|-------------|---------------------|----------|------|-------------------|

|      |      |       |                                                                                                                                                                                                                                                                                                                                                                                         |                                                                                      |                                 |           |                      |
|------|------|-------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|---------------------------------|-----------|----------------------|
| 1801 | 100  | I,R   | Incoming inspection.                                                                                                                                                                                                                                                                                                                                                                    | See ITP<br>Section 100                                                               |                                 | QCR 101   |                      |
| 1802 | 2450 | O,M,R | Clean all parts of the air admission piping installation.<br>Install the stainless steel sleeve onto the inner housing.<br>Install the O'rings at the bottom of the lower pipe.<br>Install the shim on the seal base plate. Lower the lower pipe in the shaft and centre. Install the butterfly valve at the top part of the lower pipe and the flange. Bolt.<br><br>Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Steps 2.1 to 2.6<br><br>Drawing<br>222038229  | Torque value is<br>340 N.m lub. | QCR 004 ✓ | <i>Feb 21st 2003</i> |
| 1803 | 2450 | O     | Install the stainless steel sleeve onto the bottom end of the upper pipe. Install the O'rings at the bottom of the upper pipe. Lower the upper pipe in the shaft and centre. Install temporarily four studs and nuts at the junction collector support/upper pipe.                                                                                                                      | Installation proc.<br>SMI-U04-02160<br>Steps 2.7 to 2.10<br><br>Drawing<br>222038229 |                                 |           | <i>Feb 5 2003</i>    |

Prepared by:

Bruno Auger, Eng.

Approved by: Bruno Auger, Eng.

Date: January 13<sup>th</sup>, 2003

Accepted by:

Date:

Revision

no: 00

|                                                               |                                                                                                |                                                                                                     |                        |
|---------------------------------------------------------------|------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------|------------------------|
| <b>GE Hydro</b>                                               |                                                                                                | <b>INSPECTION AND TEST PLAN</b>                                                                     |                        |
| <b>Project SEVEN MILE</b>                                     |                                                                                                | <b>Customer: B.C. Hydro</b>                                                                         | <b>Contract: SM-70</b> |
| <b>Unit 4</b>                                                 |                                                                                                | <b>Section 1800 : Air admission</b>                                                                 |                        |
| <b>CODE</b>                                                   | <b>I : Inspection and test point<br/>R: Results recorded in Q-A files<br/>Copy to customer</b> | <b>M: Monitoring in process<br/>O: Assembly Operation<br/>V: In process Verification/ operation</b> |                        |
| <b>A: Hold point/ customer<br/>T: Witness point/ customer</b> |                                                                                                |                                                                                                     | <b>Page: 1802</b>      |

| Oper. # | Ref. GE | Code | Description | Reference documents | Comments | Form | Date and initials |
|---------|---------|------|-------------|---------------------|----------|------|-------------------|
|---------|---------|------|-------------|---------------------|----------|------|-------------------|

|      |      |       |                                                                                                                                                                                                     |                                                                                    |                              |            |                                                     |
|------|------|-------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------|------------------------------|------------|-----------------------------------------------------|
| 1804 | 2450 | O     | Clean the brush rigging support and the housing support. Assemble the housing support onto the brush rigging support. Prepare inner housing and install on top of the upper pipe. Bolt temporarily. | Installation proc.<br>SMI-U04-02160<br>Steps 2.11 and 2.12<br>Drawing<br>222038229 |                              |            | —<br><i>[Signature]</i><br>Feb 5 <sup>th</sup> 2003 |
| 1805 | 2450 | O,M,R | Perform a rotational check on the inner housing.                                                                                                                                                    | Installation proc.<br>SMI-U04-02160<br>Step 2.13<br>Drawing<br>222038229           | Adjust if required           | QCR 2451 ✓ | <i>[Signature]</i><br>Feb 08 <sup>th</sup> 2003     |
| 1806 | 2450 | O,M,R | Bring the flange halves around the lower pipe. Install studs and nuts and center the flange halves holes over the studs. Torque.                                                                    | Installation proc.<br>SMI-U04-02160<br>Step 2.14                                   | Torque value is 130 N.m lub. | QCR 004 ✓  | <i>[Signature]</i><br>Feb 25 <sup>th</sup> 2003.    |

|                                   |                                                                         |                       |                    |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|
| Prepared by:<br>Bruno Auger, Eng. | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003 | Accepted by:<br>Date: | Revision<br>no: 00 |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|

|                                                       |  |                                                                                       |  |                                                                                            |  |
|-------------------------------------------------------|--|---------------------------------------------------------------------------------------|--|--------------------------------------------------------------------------------------------|--|
| <b>GE Hydro</b>                                       |  | <b>INSPECTION AND TEST PLAN</b>                                                       |  |                                                                                            |  |
| <b>Project SEVEN MILE</b>                             |  | <b>Customer: B.C. Hydro</b>                                                           |  | <b>Contract: SM-70</b>                                                                     |  |
| <b>Unit 4</b>                                         |  | <b>Section 1800 : Air admission</b>                                                   |  | <b>Page: 1803</b>                                                                          |  |
| <b>CODE</b>                                           |  | I : Inspection and test point<br>R: Results recorded in Q-A files<br>Copy to customer |  | M: Monitoring in process<br>O: Assembly Operation<br>V: In process Verification/ operation |  |
| A: Hold point/ customer<br>T: Witness point/ customer |  |                                                                                       |  |                                                                                            |  |

| Oper. # | Ref. GE | Code  | Description                                                                                    | Reference documents                                                                                      | Comments                     | Form      | Date and initials                    |
|---------|---------|-------|------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------|------------------------------|-----------|--------------------------------------|
| 1807    | 2450    | O     | Torque monitoring.<br><br>Weld the flange halves to the lower pipe using the welding sequence. | Drawing<br>222038229<br><br>Installation proc.<br>SMI-U04-02160<br>Step 2.15<br><br>Drawing<br>222038229 |                              |           | /<br><i>Feb 10<sup>th</sup> 2003</i> |
| 1808    | 2450    | O,M,R | If displacement occurred during welding, perform a rotational check on the inner housing.      | Installation proc.<br>SMI-U04-02160<br>Step 2.16<br><br>Drawing<br>222038229                             | If required                  | QCR 2451  | Not required<br><i>Feb 12 2003.</i>  |
| 1809    | 2450    | O,M,R | Install studs and nuts at the junction collector support/upper pipe. Torque.                   | Installation proc.<br>SMI-U04-02160<br>Step 2.17                                                         | Torque value is 130 N.m lub. | QCR 004 ✓ | <i>Feb 25<sup>th</sup> 2003.</i>     |

|                                   |                                                                         |                       |                    |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|
| Prepared by:<br>Bruno Auger, Eng. | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003 | Accepted by:<br>Date: | Revision<br>no: 00 |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|



GE Hydro

# INSPECTION AND TEST PLAN

Project SEVEN MILE

Customer: B.C. Hydro

Contract: SM-70

Unit 4

Section 1800 : Air admission

Page: 1804

CODE

A: Hold point/ customer

T: Witness point/ customer

I : Inspection and test point

R: Results recorded in Q-A files

Copy to customer

M: Monitoring in process

O: Assembly Operation

V: In process Verification/ operation

| Oper. # | Ref.<br>GE | Code | Description | Reference<br>documents | Comments | Form | Date and<br>initials |
|---------|------------|------|-------------|------------------------|----------|------|----------------------|
|---------|------------|------|-------------|------------------------|----------|------|----------------------|

|      |      |     |                                                                                                                                                                                                                                                                         |                                                                                   |  |                                         |                              |
|------|------|-----|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|--|-----------------------------------------|------------------------------|
|      |      |     | Torque monitoring.                                                                                                                                                                                                                                                      | Drawing<br>222038229                                                              |  |                                         |                              |
| 1810 | 2450 | O   | Dowel the upper pipe flange to collector support.<br>Remove the inner housing. Remove the shims inserted<br>in the gap between the lower pipe and the seal base<br>plate and between the upper pipe and the flange. Cover<br>the upper and lower pipes with insulation. | Installation proc.<br>SMI-U04-02160<br>Steps 2.18 to 2.21<br>Drawing<br>222038229 |  |                                         | Feb 16 <sup>th</sup><br>2003 |
| 1811 | 2450 | I,R | Test the float switch on the erection bay.                                                                                                                                                                                                                              | Installation proc.<br>SMI-U04-02160<br>Step 3.1<br>Drawing<br>222038229           |  | QCR 004<br>NIC-SMI- U04-023<br>04/24/03 |                              |
| 1812 | 2450 | O   | Clean the outer housing and install it with the proper<br>orientation. Install the insulated parts and four studs.<br>Tighten temporarily.                                                                                                                              | Installation proc.<br>SMI-U04-02160<br>Step 3.2<br>Drawing                        |  |                                         | Feb 7 <sup>th</sup><br>2003  |

Prepared by:  
Bruno Auger, Eng.

Approved by: Bruno Auger, Eng.  
Date: January 13<sup>th</sup>, 2003

Accepted by:  
Date:

Revision  
no: 00





GE Hydro

# INSPECTION AND TEST PLAN

Project SEVEN MILE

Customer: B.C. Hydro

Contract: SM-70

Unit 4

Section 1800 : Air admission

Page: 1805

CODE

A: Hold point/ customer

T: Witness point/ customer

I : Inspection and test point

R: Results recorded in Q-A files

Copy to customer

M: Monitoring in process

O: Assembly Operation

V: In process Verification/ operation

| Oper. # | Ref. | Code | Description | Reference documents | Comments | Form | Date and initials |
|---------|------|------|-------------|---------------------|----------|------|-------------------|
|---------|------|------|-------------|---------------------|----------|------|-------------------|

|      |      |       |                                                                                                                                                                                |                                                                                     |                                 |           |                                  |
|------|------|-------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|---------------------------------|-----------|----------------------------------|
|      |      |       |                                                                                                                                                                                | 222038229                                                                           |                                 |           | ✓                                |
| 1813 | 2450 | O,M,R | Clean the upper flange of the upper pipe. Install O'ring on the upper pipe. Install the inner housing on the top of the upper pipe and bolt. Torque.<br><br>Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Steps 3.3 to 3.5<br><br>Drawing<br>222038229 | Torque value is<br>52 N.m lub.  | QCR 004   | <i>Feb 25<sup>th</sup> 2003.</i> |
| 1814 | 2450 | I,R   | Dimensional inspection:<br><br>-Housing concentricity with the inner housing                                                                                                   | Installation proc.<br>SMI-U04-02160<br>Step 3.6<br><br>Drawing<br>222038229         | Adjust if<br>required           | QCR 2453  | <i>Feb 8<sup>th</sup> 2003.</i>  |
| 1815 | 2450 | O,M,R | Install remaining studs from outer housing in housing support. Torque.                                                                                                         | Installation proc.<br>SMI-U04-02160                                                 | Torque value is<br>440 N.m lub. | QCR 004 ✓ | ✓                                |

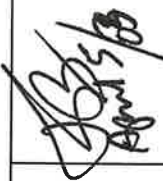
Prepared by:  
Bruno Auger, Eng.

Approved by: Bruno Auger, Eng.  
Date: January 13<sup>th</sup>, 2003

Accepted by:  
Date:

Revision  
no: 00

| <b>GE Hydro</b>                                                      |            | <b>INSPECTION AND TEST PLAN</b>                                                       |                                                                                                                                     |                                                                                  |                                |           |                                                     |
|----------------------------------------------------------------------|------------|---------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------|--------------------------------|-----------|-----------------------------------------------------|
| <b>Project SEVEN MILE</b>                                            |            | <b>Customer: B.C. Hydro</b>                                                           |                                                                                                                                     | <b>Contract: SM-70</b>                                                           |                                |           |                                                     |
| <b>Unit 4</b>                                                        |            | <b>Section 1800 : Air admission</b>                                                   |                                                                                                                                     | <b>Page: 1806</b>                                                                |                                |           |                                                     |
| <b>CODE</b><br>A: Hold point/ customer<br>T: Witness point/ customer |            | I : Inspection and test point<br>R: Results recorded in Q-A files<br>Copy to customer | M: Monitoring in process<br>O: Assembly Operation<br>V: In process Verification/ operation                                          |                                                                                  |                                |           |                                                     |
| Oper. #                                                              | Ref.<br>GE | Code                                                                                  | Description                                                                                                                         | Reference documents                                                              | Comments                       | Form      | Date and initials                                   |
|                                                                      |            |                                                                                       | Torque monitoring.                                                                                                                  | Step 3.6<br>Drawing<br>222038229                                                 |                                |           | <i>[Signature]</i><br>Feb 25 <sup>th</sup><br>2003. |
| 1816                                                                 | 2450       | O,M,R                                                                                 | Install remaining studs from housing support in the brush rigging support. Torque.<br><br>Torque monitoring.                        | Installation proc.<br>SMI-U04-02160<br>Step 3.7<br>Drawing<br>222038229          | Torque value is 440 N.m lub.   | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup><br>2003. |
| 1817                                                                 | 2450       | O                                                                                     | Install the dowels between the outer housing and the housing support and between the housing support and the brush rigging support. | Installation proc.<br>SMI-U04-02160<br>Steps 3.8 and 3.9<br>Drawing<br>222038229 |                                |           | <i>[Signature]</i><br>Feb 18 <sup>th</sup><br>2003  |
| 1818                                                                 | 2450       | O,M,R                                                                                 | Perform a megger test between the housing and the housing support.                                                                  | Installation proc.<br>SMI-U04-02160                                              | The value must be greater than | QCR 004   | <i>[Signature]</i>                                  |
| Prepared by:<br>Bruno Auger, Eng.                                    |            | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003               |                                                                                                                                     |                                                                                  | Accepted by:<br>Date:          |           | Revision<br>no: 00                                  |

|  <b>GE Hydro</b> |            | <b>INSPECTION AND TEST PLAN</b>                                                       |                                                                                                                                                                                                                                     |                                                                                            |                              |           |                                                                                                                     |
|-----------------------------------------------------------------------------------------------------|------------|---------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|------------------------------|-----------|---------------------------------------------------------------------------------------------------------------------|
| <b>Project SEVEN MILE</b>                                                                           |            | <b>Customer: B.C. Hydro</b>                                                           |                                                                                                                                                                                                                                     | <b>Contract: SM-70</b>                                                                     |                              |           |                                                                                                                     |
| <b>Unit 4</b>                                                                                       |            | <b>Section 1800 : Air admission</b>                                                   |                                                                                                                                                                                                                                     | <b>Page: 1807</b>                                                                          |                              |           |                                                                                                                     |
| <b>CODE</b><br>A: Hold point/ customer<br>T: Witness point/ customer                                |            | I : Inspection and test point<br>R: Results recorded in Q-A files<br>Copy to customer |                                                                                                                                                                                                                                     | M: Monitoring in process<br>O: Assembly Operation<br>V: In process Verification/ operation |                              |           |                                                                                                                     |
| Oper. #                                                                                             | Ref.<br>GE | Code                                                                                  | Description                                                                                                                                                                                                                         | Reference documents                                                                        | Comments                     | Form      | Date and initials                                                                                                   |
|                                                                                                     |            |                                                                                       | housing support.                                                                                                                                                                                                                    | Step 3.10<br>Drawing<br>222038229                                                          | 1 MΩ                         |           |                                     |
| 1819                                                                                                | 2450       | O,M,R                                                                                 | Install the O'ring on the outer housing flange for the lower seal housing. Install the lower seal housing. Install the lower seal with O'ring on the top and bottom of the seal. Install studs and nuts. Torque. Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Step 3.11<br>Drawing<br>222038229                   | Torque value is 130 N.m lub. | QCR 004 ✓ | <br>Feb 25 <sup>th</sup><br>2003.   |
| 1820                                                                                                | 2450       | O,M,R                                                                                 | Install the lower seal cover with studs and nuts. Torque. Torque monitoring.                                                                                                                                                        | Installation proc.<br>SMI-U04-02160<br>Step 3.11<br>Drawing<br>222038229                   | Torque value is 52 N.m lub.  | QCR 004 ✓ | <br>Feb 25 <sup>th</sup><br>2003. |
| 1821                                                                                                | 2450       | O,M,R                                                                                 | Install the lubricating water piping portion inside the outer housing. Install the stainless steel sleeve onto the                                                                                                                  | Installation proc.<br>SMI-U04-02160                                                        | Torque value is 52 N.m lub.  | QCR 004   |                                  |
| Prepared by:<br>Bruno Auger, Eng.                                                                   |            |                                                                                       | Accepted by:<br>Date:                                                                                                                                                                                                               |                                                                                            | Revision<br>no: 00           |           |                                                                                                                     |



| <b>GE Hydro</b>                                               |         | <b>INSPECTION AND TEST PLAN</b>                                                       |                                                                                                                                                                                                                                |                                                                                            |                              |           |                                                  |
|---------------------------------------------------------------|---------|---------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|------------------------------|-----------|--------------------------------------------------|
| Project SEVEN MILE                                            |         | Customer: B.C. Hydro                                                                  |                                                                                                                                                                                                                                | Contract: SM-70                                                                            |                              |           |                                                  |
| Unit 4                                                        |         | Section 1800 : Air admission                                                          |                                                                                                                                                                                                                                | Page: 1808                                                                                 |                              |           |                                                  |
| CODE<br>A: Hold point/ customer<br>T: Witness point/ customer |         | I : Inspection and test point<br>R: Results recorded in Q-A files<br>Copy to customer |                                                                                                                                                                                                                                | M: Monitoring in process<br>O: Assembly Operation<br>V: In process Verification/ operation |                              |           |                                                  |
| Oper. #                                                       | Ref. GE | Code                                                                                  | Description                                                                                                                                                                                                                    | Reference documents                                                                        | Comments                     | Form      | Date and initials                                |
| 1822                                                          | 2450    | O,M,R                                                                                 | inner housing cover. Install O'ring on the inner housing and install the inner housing cover. Install studs and nuts. Torque.<br><br>Torque monitoring.                                                                        | Steps 3.11 to 3.13<br>Drawing<br>222038229                                                 | 52 N.m lub. ✓                | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup> 2003. |
| 1823                                                          | 2450    | O,M,R                                                                                 | Clean and deburr the machined faces of the upper seal housing. Install the upper seal housing. Install the upper seal with O'ring on the top and bottom of the seal. Install studs and nuts. Torque.<br><br>Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Step 3.14<br>Drawing<br>222038229                   | Torque value is 130 N.m lub. | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup> 2003. |
| 1823                                                          | 2450    | O,M,R                                                                                 | Clean and deburr the machined faces of the upper seal housing. Install the upper seal housing. Install the upper seal with O'ring on the top and bottom of the seal. Install studs and nuts. Torque.<br><br>Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Step 3.15<br>Drawing<br>222038229                   | Torque value is 130 N.m lub. | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup> 2003. |

|                                   |                                                                         |                       |                    |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|
| Prepared by:<br>Bruno Auger, Eng. | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003 | Accepted by:<br>Date: | Revision<br>no: 00 |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|



**GE Hydro**

# INSPECTION AND TEST PLAN

**Project SEVEN MILE**

**Customer: B.C. Hydro**

**Contract: SM-70**

**Unit 4**

**Section 1800 : Air admission**

**Page: 1809**

**CODE**

**A: Hold point/ customer**

**T: Witness point/ customer**

I : Inspection and test point

R: Results recorded in Q-A files

Copy to customer

M: Monitoring in process

O: Assembly Operation

V: In process Verification/ operation

| Oper. # | Ref. GE | Code | Description | Reference documents | Comments | Form | Date and initials |
|---------|---------|------|-------------|---------------------|----------|------|-------------------|
|---------|---------|------|-------------|---------------------|----------|------|-------------------|

|      |      |       |                                                                                                                                                         |                                                                                    |                                |           |                                                     |
|------|------|-------|---------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------|--------------------------------|-----------|-----------------------------------------------------|
| 1824 | 2450 | O,M,R | Install the upper seal cover with studs and nuts.<br>Torque.<br>Torque monitoring.                                                                      | Installation proc.<br>SMI-U04-02160<br>Step 3.15<br>Drawing<br>222038229           | Torque value is<br>30 N.m lub. | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup><br>2003. |
| 1825 | 2450 | O,M,R | Install the lubricating water piping portion inside the housing cover. Install the sealing plate. Install studs and nuts. Torque.<br>Torque monitoring. | Installation proc.<br>SMI-U04-02160<br>Steps 3.15 and 3.16<br>Drawing<br>222038229 | Torque value is<br>40 N.m lub. | QCR 004 ✓ | <i>[Signature]</i><br>Feb 25 <sup>th</sup><br>2003. |
| 1826 | 240  | O,M,R | Install the inspection cover with O'ring. Install studs and nuts. Torque.<br>Torque monitoring.                                                         | Installation proc.<br>SMI-U04-02160<br>Step 3.17<br>Drawing<br>222038229           | Torque value is<br>15 N.m lub. | QCR 004 ✓ | <i>[Signature]</i><br>MAR 1, 2003                   |

Prepared by:  
Bruno Auger, Eng.

Approved by: Bruno Auger, Eng.  
Date: January 13<sup>th</sup>, 2003

Accepted by:  
Date:

Revision  
no: 00

|                           |  |                                     |  |                        |  |
|---------------------------|--|-------------------------------------|--|------------------------|--|
| <b>GE Hydro</b>           |  | <b>INSPECTION AND TEST PLAN</b>     |  |                        |  |
| <b>Project SEVEN MILE</b> |  | <b>Customer: B.C. Hydro</b>         |  | <b>Contract: SM-70</b> |  |
| <b>Unit 4</b>             |  | <b>Section 1800 : Air admission</b> |  |                        |  |
| <b>Page: 1810</b>         |  |                                     |  |                        |  |

| CODE                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Ref. GE | Code  | Description                                                                                                                                                                                                                               | Reference documents                                                     | Comments                            | Form    | Date and initials              |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------|-------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------|-------------------------------------|---------|--------------------------------|
| <div style="display: flex; justify-content: space-between; font-size: small;"> <span>A: Hold point/ customer</span> <span>M: Monitoring in process</span> </div> <div style="display: flex; justify-content: space-between; font-size: small;"> <span>T: Witness point/ customer</span> <span>O: Assembly Operation</span> </div> <div style="display: flex; justify-content: space-between; font-size: small;"> <span></span> <span>V: In process Verification/ operation</span> </div> |         |       |                                                                                                                                                                                                                                           |                                                                         |                                     |         |                                |
| 1827                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | 2450    | O     | Install and connect the float switch. Install and fit the piping for the drain and for the natural air admission. Install the valves. Install insulation. Complete installation of the lubricating piping, valves, pressure gauges, etc.. | Installation proc. SMI-U04-02160 Step 3.18 Drawings 222038229 27E1050FT |                                     |         | <br>Feb 22 <sup>nd</sup> 2003. |
| 1828                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | 2450    | O,M,R | Perform a megger test between the housing and the pipes.                                                                                                                                                                                  | Installation proc. SMI-U04-02160 Steps 3.20 Drawing 222038229           | The value must be greater than 1 MΩ | QCR 004 | <br>Apr 5/03                   |
| 1829                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | 2450    | O,M,R | Install the cover plates under the seal base plate in the runner area. Torque. Torque monitoring.                                                                                                                                         | Installation proc. SMI-U04-02160 Step 3.21 Drawing 222038229            | Torque value is 130 N.m lub.        |         | <br>Feb 22 <sup>nd</sup> 2003. |

|                                   |                                                                         |                       |                    |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|
| Prepared by:<br>Bruno Auger, Eng. | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003 | Accepted by:<br>Date: | Revision<br>no: 00 |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|

|                                                                                                     |  |                                                                                       |  |                                                                                            |  |
|-----------------------------------------------------------------------------------------------------|--|---------------------------------------------------------------------------------------|--|--------------------------------------------------------------------------------------------|--|
|  <b>GE Hydro</b> |  | <b>INSPECTION AND TEST PLAN</b>                                                       |  |                                                                                            |  |
| <b>Project SEVEN MILE</b>                                                                           |  | <b>Customer: B.C. Hydro</b>                                                           |  | <b>Contract: SM-70</b>                                                                     |  |
| <b>Unit 4</b>                                                                                       |  | <b>Section 1800 : Air admission</b>                                                   |  | <b>Page: 1811</b>                                                                          |  |
| <b>CODE</b><br>A: Hold point/ customer<br>T: Witness point/ customer                                |  | I : Inspection and test point<br>R: Results recorded in Q-A files<br>Copy to customer |  | M: Monitoring in process<br>O: Assembly Operation<br>V: In process Verification/ operation |  |

| Oper. # | Ref. GE | Code | Description | Reference documents | Comments | Form | Date and initials |
|---------|---------|------|-------------|---------------------|----------|------|-------------------|
|---------|---------|------|-------------|---------------------|----------|------|-------------------|

|      |      |     |                                                                                       |                                     |  |         |                                                                                               |
|------|------|-----|---------------------------------------------------------------------------------------|-------------------------------------|--|---------|-----------------------------------------------------------------------------------------------|
| 1830 | 2450 | I,R | Final inspection :<br>Ensure that all the work and documentation have been completed. | Installation proc.<br>SMI-U04-02160 |  | QCR 003 | <br>04/29/03 |
|------|------|-----|---------------------------------------------------------------------------------------|-------------------------------------|--|---------|-----------------------------------------------------------------------------------------------|

**RECEIVED**  
29 Apr 2003  


|                                   |                                                                         |                       |                    |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|
| Prepared by:<br>Bruno Auger, Eng. | Approved by: Bruno Auger, Eng.<br>Date: January 13 <sup>th</sup> , 2003 | Accepted by:<br>Date: | Revision<br>no: 00 |
|-----------------------------------|-------------------------------------------------------------------------|-----------------------|--------------------|



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1802

EQUIPMENT : Torquing of the butterfly valve

The studs holding the isolation butterfly valve inside the rotor have been torqued at a value of  
340 N.m lubricated.

RECEIVED  
FEB 21 2003  
CA

Measured by.: P. Lamontagne ( / / )  
GE Repres.: [Signature] (Feb 19<sup>th</sup> 2003)  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 07/23/01





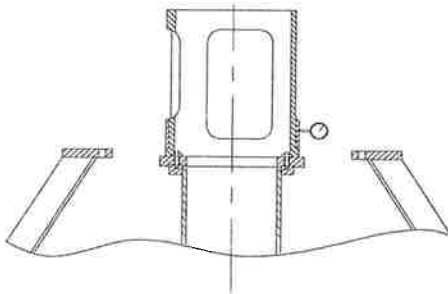
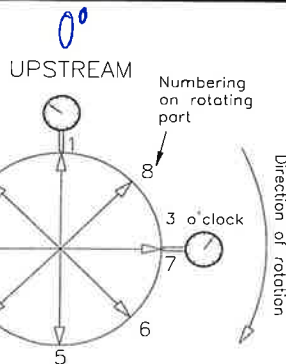
## RUNOUT AIR ADMISSION PIPE

QCR 2451

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1305



Note 1 : Align mark #1 with pole #1.

Note 2 : The 4 cells with thicker borders are the start points when taking the readings.

Measurement Instruments

Ambient Temperature

Dial indicators

Before: \_\_\_\_\_

After: \_\_\_\_\_

|                          | Pts on shaft | TURN #1  |       |                |       | TURN #2  |       |                |       |
|--------------------------|--------------|----------|-------|----------------|-------|----------|-------|----------------|-------|
|                          |              | U/S (mm) |       | 3 O'clock (mm) |       | U/S (mm) |       | 3 O'clock (mm) |       |
|                          |              | Rdg      | Corr. | Rdg            | Corr. | Rdg      | Corr. | Rdg            | Corr. |
| THRUST BLOCK             | 1            | 0.02     |       | 0.01           |       | 0.02     |       | 0.01           |       |
|                          | 2            | -0.01    |       | -0.02          |       | -0.01    |       | -0.02          |       |
|                          | 3            | 0.00     |       | -0.02          |       | 0.01     |       | -0.02          |       |
|                          | 4            | 0.01     |       | 0.00           |       | 0.01     |       | -0.01          |       |
|                          | 5            | 0.05     |       | 0.04           |       | 0.05     |       | 0.04           |       |
|                          | 6            | 0.02     |       | 0.04           |       | 0.02     |       | 0.04           |       |
|                          | 7            | 0.02     |       | 0.03           |       | 0.02     |       | 0.03           |       |
|                          | 8            | 0.01     |       | 0.03           |       | 0.02     |       | 0.03           |       |
| AIR ADMISSION PIPE       | 1            | 0.05     | 0.03  | 0.04           | 0.03  | 0.05     | 0.03  | 0.04           | 0.03  |
|                          | 2            | 0.03     | 0.04  | 0.01           | 0.03  | 0.03     | 0.04  | 0.03           | 0.05  |
|                          | 3            | 0.02     | 0.02  | -0.01          | 0.01  | 0.02     | 0.01  | -0.01          | 0.01  |
|                          | 4            | 0.02     | 0.01  | 0.02           | +0.02 | 0.03     | 0.02  | 0.01           | 0.02  |
|                          | 5            | 0.02     | -0.03 | 0.02           | -0.02 | 0.02     | -0.03 | 0.03           | -0.01 |
|                          | 6            | -0.03    | -0.05 | 0.01           | -0.03 | -0.02    | -0.04 | 0.01           | -0.03 |
|                          | 7            | 0        | -0.02 | 0.01           | -0.02 | 0        | -0.02 | 0.01           | -0.02 |
|                          | 8            | 0.02     | 0.01  | 0.04           | 0.01  | 0.02     | 0     | 0.03           | 0     |
| TGB RUNOUT PER DIAL (mm) |              | 0.09     |       | 0.06           |       | 0.08     |       | 0.08           |       |
| HIGH SPOT (°)            |              | 40°      |       | 43°            |       | 44.50    |       | 50.7           |       |

| Runout             | Tolerance* (mm) | Result (mm) |
|--------------------|-----------------|-------------|
| Air admission pipe | 0.20            | 0.09        |

\* Tolerance on air admission pipe after thrust block runout is eliminated from air admission pipe runout by calculation. With the rotating parts numbered as indicated at left, rotate in clockwise direction.



Measured by.: B. Sankarukott, Tami (Feb 5<sup>th</sup> 2003)  
J. W. Wilson, T. R. Ridd  
GE Repres.: [Signature] (Feb 7<sup>th</sup> 2003)  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_Rev.: 0  
Date: 03-01-10



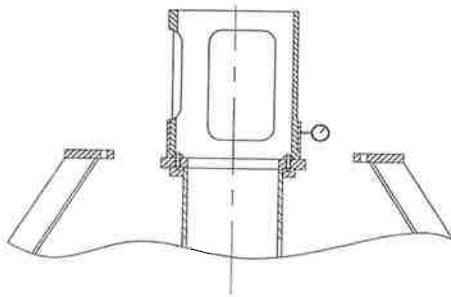
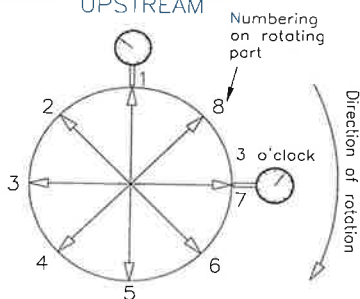
## RUNOUT AIR ADMISSION PIPE

QCR 2451

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1805

Final values  
UPSTREAM

Note 1 : Align mark #1 with pole #1.

Note 2 : The 4 cells with thicker borders are the start points when taking the readings.

Measurement Instruments

Dial indicators

Ambient Temperature

Before: \_\_\_\_\_

After: \_\_\_\_\_

| Pts on shaft             | TURN #1  |       |                |       | TURN #2  |       |                |       |
|--------------------------|----------|-------|----------------|-------|----------|-------|----------------|-------|
|                          | U/S (mm) |       | 3 O'clock (mm) |       | U/S (mm) |       | 3 O'clock (mm) |       |
|                          | Rdg      | Corr. | Rdg            | Corr. | Rdg      | Corr. | Rdg            | Corr. |
| THRUST BLOCK             | 1        | 0.02  |                | 0     | 0.03     |       | 0.01           |       |
|                          | 2        | 0.04  |                | 0.03  | 0.04     |       | 0.03           |       |
|                          | 3        | 0.05  |                | 0.04  | 0.05     |       | 0.03           |       |
|                          | 4        | 0.05  |                | 0.04  | 0.05     |       | 0.04           |       |
|                          | 5        | 0.07  |                | 0.05  | 0.07     |       | 0.04           |       |
|                          | 6        | 0.01  |                | -0.01 | 0.01     |       | -0.02          |       |
|                          | 7        | 0.02  |                | -0.01 | 0.01     |       | -0.02          |       |
|                          | 8        | -0.01 |                | -0.02 | -0.01    |       | -0.02          |       |
| AIR ADMISSION PIPE       | 1        | 0.04  | 0.02           | -0.11 | 0.05     | 0.02  | -0.11          | -0.12 |
|                          | 2        | 0.14  | 0.10           | -0.02 | 0.05     | 0.13  | 0.09           | -0.02 |
|                          | 3        | 0.20  | 0.15           | 0.03  | -0.01    | 0.20  | 0.15           | 0.03  |
|                          | 4        | 0.25  | 0.20           | 0.09  | 0.05     | 0.25  | 0.20           | 0.09  |
|                          | 5        | 0.27  | 0.20           | 0.07  | 0.02     | 0.27  | 0.20           | 0.07  |
|                          | 6        | 0.16  | 0.15           | -0.02 | 0        | 0.17  | 0.16           | -0.03 |
|                          | 7        | 0.06  | 0.06           | -0.12 | -0.11    | 0.06  | 0.07           | -0.12 |
|                          | 8        | -0.01 | 0.0            | -0.15 | -0.13    | -0.01 | 0              | -0.15 |
| TGB RUNOUT PER DIAL (mm) |          | 0.20  |                | 0.18  |          | 0.20  |                | 0.18  |
| HIGH SPOT (°)            |          |       |                |       |          |       |                |       |

| Runout             | Tolerance* (mm) | Result (mm) |
|--------------------|-----------------|-------------|
| Air admission pipe | 0.20            | 0.20        |

\* Tolerance on air admission pipe after thrust block runout is eliminated from air admission pipe runout by calculation. With the rotating parts numbered as indicated at left, rotate in clockwise direction.

RECEIVED  
FEB 15 2003  
ck

Measured by.: Tom Reddy, Tami ( / / )

GE Repres.: Bob Spoko, J. Williams

Cust. Repres.: ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_

Comments: \_\_\_\_\_

Rev.: 0

Date: 03-01-10



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: N/A

Around 1805

EQUIPMENT : Stub shaft run out with dial indicators

|                                 | Pts on shaft | TURN #1  |       |                |       | TURN #2  |       |                |       |
|---------------------------------|--------------|----------|-------|----------------|-------|----------|-------|----------------|-------|
|                                 |              | U/S (mm) |       | 3 O'clock (mm) |       | U/S (mm) |       | 3 O'clock (mm) |       |
|                                 |              | Rdg      | Corr. | Rdg            | Corr. | Rdg      | Corr. | Rdg            | Corr. |
| THRUST BLOCK                    | 1            | 0,01     |       | 0,04           |       | 0,01     |       | 0,02           |       |
|                                 | 2            | 0,03     |       | 0,03           |       | 0,03     |       | 0,03           |       |
|                                 | 3            | 0,04     |       | 0,04           |       | 0,04     |       | 0,03           |       |
|                                 | 4            | 0,05     |       | 0,04           |       | 0,05     |       | 0,04           |       |
|                                 | 5            | 0,06     |       | 0,05           |       | 0,06     |       | 0,05           |       |
|                                 | 6            | 0,01     |       | -0,02          |       | 0,01     |       | 0              |       |
|                                 | 7            | 0        |       | -0,01          |       | 0        |       | -0,01          |       |
|                                 | 8            | -0,01    |       | -0,02          |       | -0,01    |       | -0,02          |       |
| Stub shaft                      | 1            | 0,02     | 0,01  | -0,20          | -0,24 | 0,02     | 0,01  | -0,18          | -0,20 |
|                                 | 2            | 0,18     | 0,15  | -0,07          | -0,10 | 0,17     | 0,14  | -0,07          | -0,10 |
|                                 | 3            | 0,26     | 0,22  | 0,0            | -0,04 | 0,26     | 0,22  | 0              | -0,03 |
|                                 | 4            | 0,31     | 0,26  | 0,05           | 0,01  | 0,30     | 0,25  | 0,05           | +0,01 |
|                                 | 5            | 0,30     | 0,24  | 0,04           | -0,01 | 0,30     | 0,24  | 0,05           | 0     |
|                                 | 6            | 0,12     | 0,11  | -0,12          | -0,10 | 0,12     | 0,11  | -0,09          | -0,09 |
|                                 | 7            | 0        | 0     | -0,23          | -0,22 | 0        | 0     | -0,23          | -0,22 |
|                                 | 8            | -0,05    | 0,04  | -0,26          | -0,24 | -0,05    | -0,04 | -0,24          | -0,22 |
| STUB SHAFT RUNOUT PER DIAL (mm) |              | 0,30     |       | 0,25           |       | 0,29     |       | 0,23           |       |
| HIGH SPOT (°)                   |              |          |       |                |       |          |       |                |       |

RECEIVED  
FEB 15 2003  
Ch

Measured by.: Tom Raddy, J. Williamson ( / / )  
GE Repres.: Tom Raddy, J. Williamson  
Cust. Repres.: Philippe S. Gagnon (Feb 11 2003) ( / / )

GE Canada  
International Inc.Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_Rev.: 0  
Date: 07/23/01



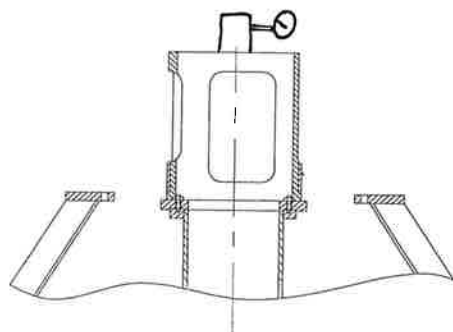
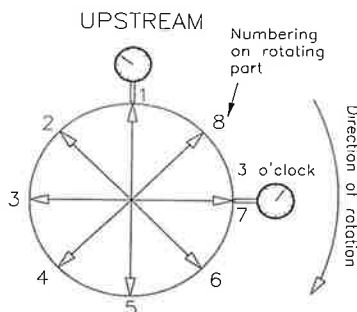


## RUNOUT AIR ADMISSION PIPE- upper seal ring

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: As per 1805

Note 1 : Align mark #1 with pole #1.

Note 2 : The 4 cells with thicker borders are the start points when taking the readings.

Measurement Instruments

Dial indicators.

Ambient Temperature

Before: \_\_\_\_\_

After: \_\_\_\_\_

| Pts on shaft                         | TURN #1  |       |                |       | TURN #2  |       |                |       |       |
|--------------------------------------|----------|-------|----------------|-------|----------|-------|----------------|-------|-------|
|                                      | U/S (mm) |       | 3 O'clock (mm) |       | U/S (mm) |       | 3 O'clock (mm) |       |       |
|                                      | Rdg      | Corr. | Rdg            | Corr. | Rdg      | Corr. | Rdg            | Corr. |       |
| THRUST BLOCK                         | 1        | 0,01  |                | 0,02  |          | 0,02  |                | 0,03  |       |
|                                      | 2        | 0,04  |                | 0,03  |          | 0,03  |                | 0,04  |       |
|                                      | 3        | 0,04  |                | 0,04  |          | 0,04  |                | 0,04  |       |
|                                      | 4        | 0,05  |                | 0,05  |          | 0,05  |                | 0,03  |       |
|                                      | 5        | 0,06  |                | 0,04  |          | 0,06  |                | 0,04  |       |
|                                      | 6        | 0,01  |                | -0,02 |          | 0,01  |                | -0,02 |       |
|                                      | 7        | 0,01  |                | -0,02 |          | 0     |                | -0,02 |       |
|                                      | 8        | -0,01 |                | -0,01 |          | -0,01 |                | -0,02 |       |
| AIR ADMISSION PIPE                   | 1        | 0,03  | -0,02          | 0,02  | 0        | 0,05  | 0,03           | 0,02  | -0,01 |
|                                      | 2        | 0,07  | 0,03           | 0,03  | 0        | 0,07  | 0,04           | 0,02  | -0,02 |
|                                      | 3        | 0,04  | 0              | 0,01  | -0,03    | 0,05  | 0,01           | -0,01 | -0,05 |
|                                      | 4        | 0,03  | -0,02          | 0,01  | -0,04    | 0,03  | -0,02          | 0     | -0,03 |
|                                      | 5        | 0,05  | 0,01           | -0,03 | -0,07    | 0,05  | -0,01          | -0,05 | -0,09 |
|                                      | 6        | -0,06 | -0,07          | -0,10 | -0,08    | -0,07 | -0,08          | -0,08 | -0,06 |
|                                      | 7        | 0,01  | 0              | -0,05 | -0,03    | 0,01  | -0,01          | -0,05 | -0,03 |
|                                      | 8        | 0     | 0,01           | -0,03 | -0,01    | 0     | 0,01           | -0,04 | -0,02 |
| UPPER SEAL RING RUNOUT PER DIAL (mm) |          | 0,10  |                | 0,08  |          | 0,12  |                | 0,08  |       |
| HIGH SPOT (°)                        |          |       |                |       |          |       |                |       |       |

| Runout             | Tolerance* (mm) | Result (mm) |
|--------------------|-----------------|-------------|
| Air admission pipe |                 | 0,12        |

\* Tolerance on air admission pipe after thrust block runout is eliminated from air admission pipe runout by calculation. With the rotating parts numbered as indicated at left, rotate in clockwise direction.

RECEIVED  
FEB 15 2003

Measured by.: Tom Roddy, J. Willman / / )GE Repres.: Bob Sookorubert / / )Cust. Repres.: Philip Satorp (Feb 11 2003) / / )GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_

Comments: \_\_\_\_\_

Rev.: 0

Date: 03-01-10



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1806

EQUIPMENT : Torquing of the bottom pipe flange halves

The studs and nuts holding in place the bottom pipe flange halves inside the shaft have been torqued at a value of 130 N.m lubricated.

RECEIVED  
FEB 25 2003  
*JA*

Measured by.: P. Langlois ( / / )  
GE Repres.: [Signature] (Feb 28 2003)  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 07/23/01





## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1809

EQUIPMENT : Torquing of the upper pipe to the collector support

The studs and nuts at the junction collector support / upper pipe have been torqued at a value of  
130 N.m lubricated.

RECEIVED  
FEB 23 2003  
CA

Measured by.: P. Lamontagne ( / / )  
GE Repres.: Philippe Lamontagne (Feb 23rd 2003)  
Cust. Repres.: ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 07/23/01



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1811

EQUIPMENT : Float switch test

The float switch supplied by the contract was not working properly in the shop configuration (see NC-SMI-U04-033). Some modifications have been made to the switch. The actual configuration is working as expected.

Since this solution is not satisfying to the client, a new model of float switch will be found and installed by GE.

RECEIVED  
FEB 28 2003  
Clt

Measured by.: M-André Pilon (Feb 10<sup>th</sup> 2003)  
GE Repres.: [Signature] (Feb 26<sup>th</sup> 2003)  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.

Reference NC no.: NC-U04-033  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 07/23/01



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1811

EQUIPMENT : Float switch test

The float switch supplied by the contract was not working properly in the shop configuration (see NC-SMI-U04-033). Some modifications made on the arm inside resolves the problem at the customer's satisfaction. The spare float switch will be modified accordingly.

Measured by.: Jeani Beauchamp (04/24/03)GE Repres.: Paul B... (04/24/03)

Cust. Repres.: \_\_\_\_\_ ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_

Comments: \_\_\_\_\_

Rev.: 0

Date: 07/23/01



## GENERAL INSPECTION REPORT

QCR 004

PROJECT: Seven Mile

Unit: 4

ITP step no.: 1813

EQUIPMENT : Torquing of the inner housing

The inner housing has been bolted to the top of the upper pipe using a torque value of 52 N.m lubricated.

RECEIVED  
FEB 25 2003  
CA

Measured by.: P. Lamontagne ( / / )  
GE Repres.: [Signature] Feb 22nd 2003  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 07/23/01



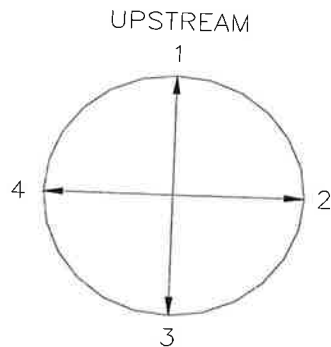
# HOUSING CONCENTRICITY AIR ADMISSION PIPING

QCR 2453

PROJECT: Seven Mile

Unit: 4

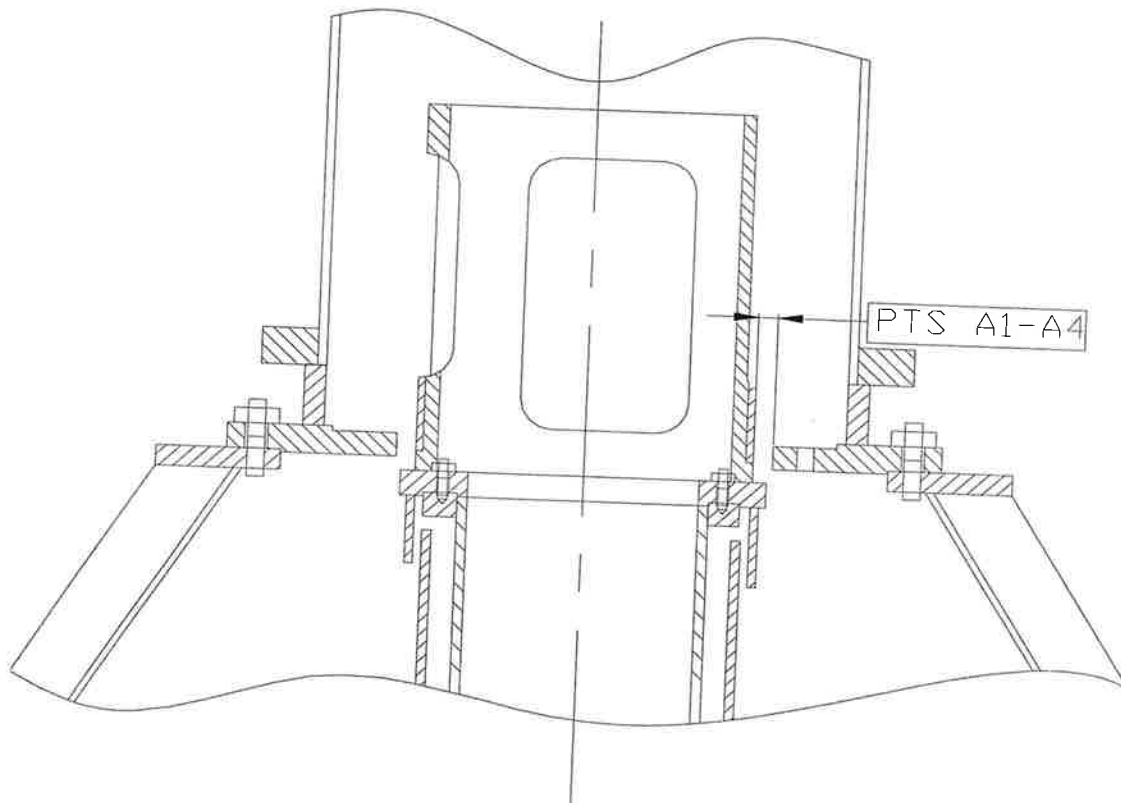
ITP step no.: 1814



| PTS | A (mm) |
|-----|--------|
| 1   | 20.73  |
| 2   | 20.71  |
| 3   | 20.83  |
| 4   | 20.73  |

| Measurement Instruments | Ambient Temperature |
|-------------------------|---------------------|
| Telescopic gauges       | Before: _____       |
| Micrometer              | After: _____        |

|               | Tolerance (mm) | Result (mm) |
|---------------|----------------|-------------|
| Concentricity | 0.50           | 0.05        |



FEB 08 2003  
Checked  
[Signature]

Measured by.: John Willman (Feb 8th 2003)  
GE Repres.: [Signature] (Feb 8th 2003)  
Cust. Repres.: [Signature] ( / / )

GE Canada  
International Inc.

Reference NC no.: \_\_\_\_\_  
Comments: \_\_\_\_\_

Rev.: 0  
Date: 02-12-09