

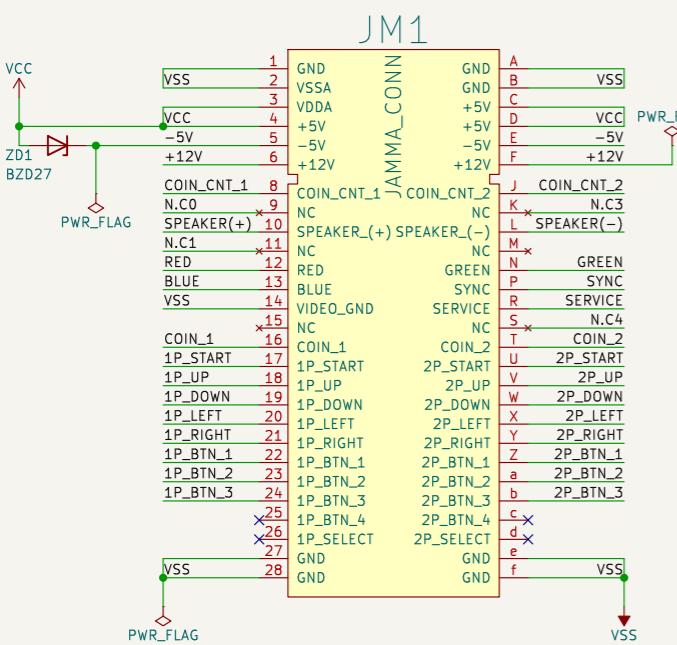
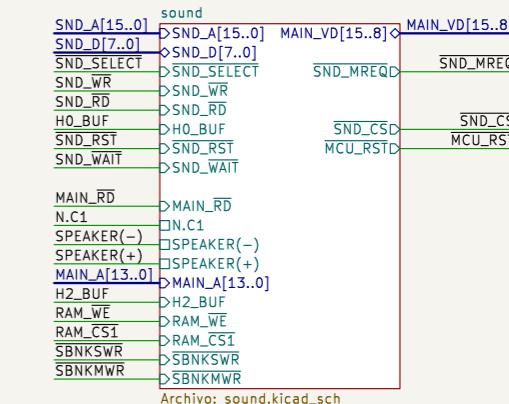
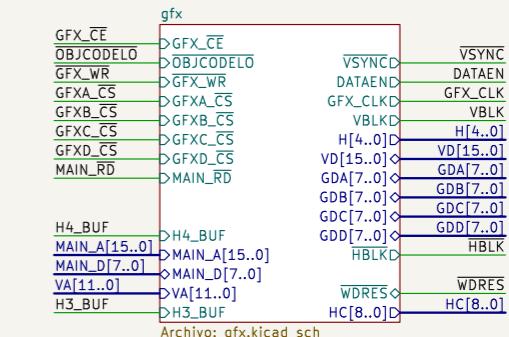
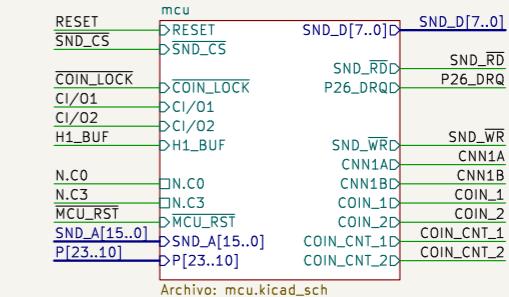
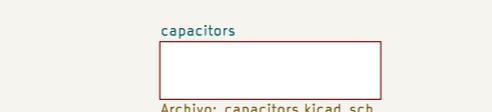
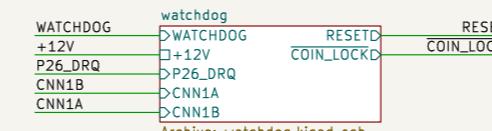



A

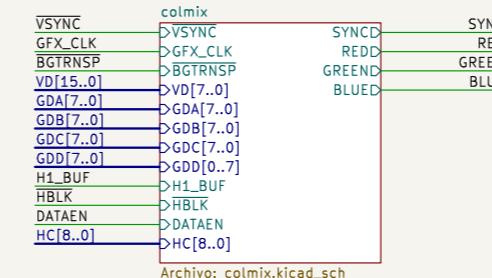

B

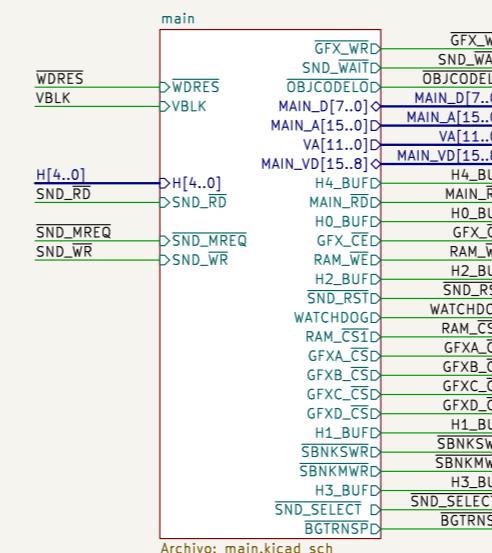

## CABINET I/O

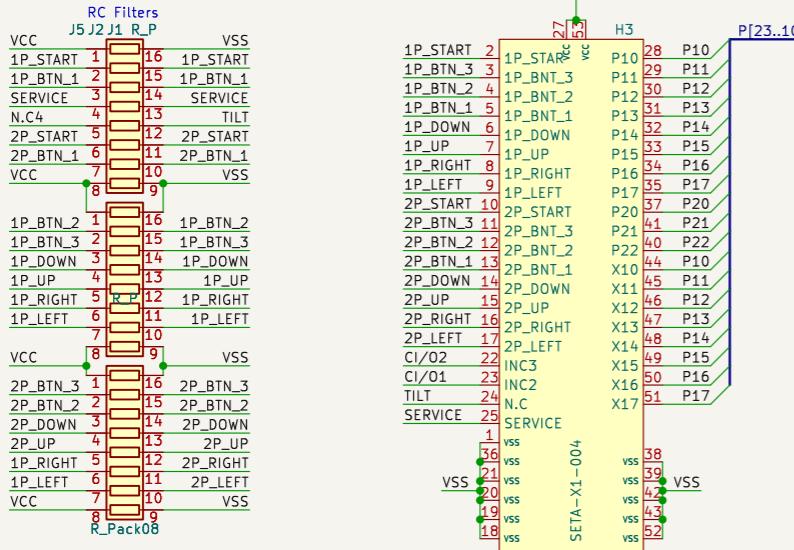

1 2 3 4 5 6 7 8

A

B

C

D

E

F




JOTEGO  
JOTEGO

Sheet: /capacitors/  
File: capacitors.kicad\_sch


Title: EXTERMINATION

Size: A3 Date: 29/08/2022  
KiCad E.D.A. kicad-cli 7.0.10-7.0.10-ubuntu20.04.1

Rev: José Tejada G. Id: 2/10

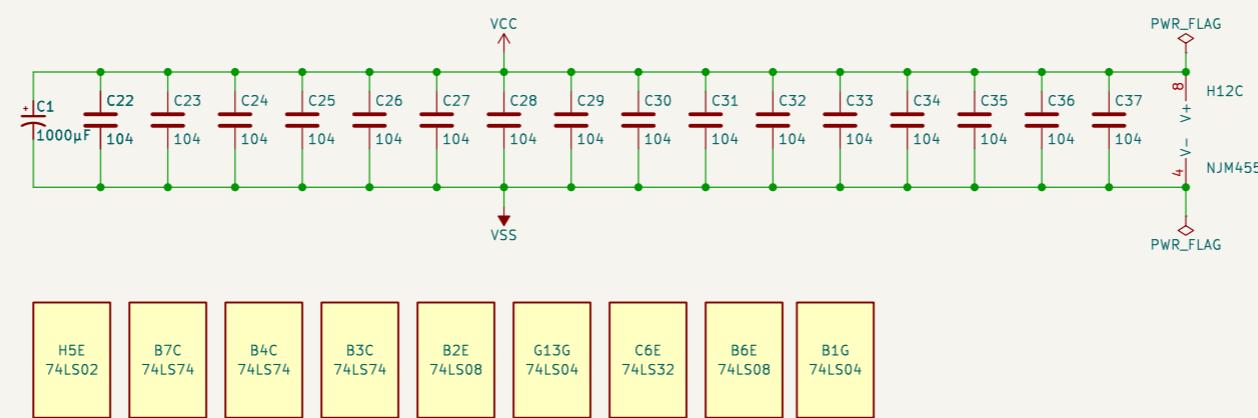

1 2 3 4 5 6 7 8

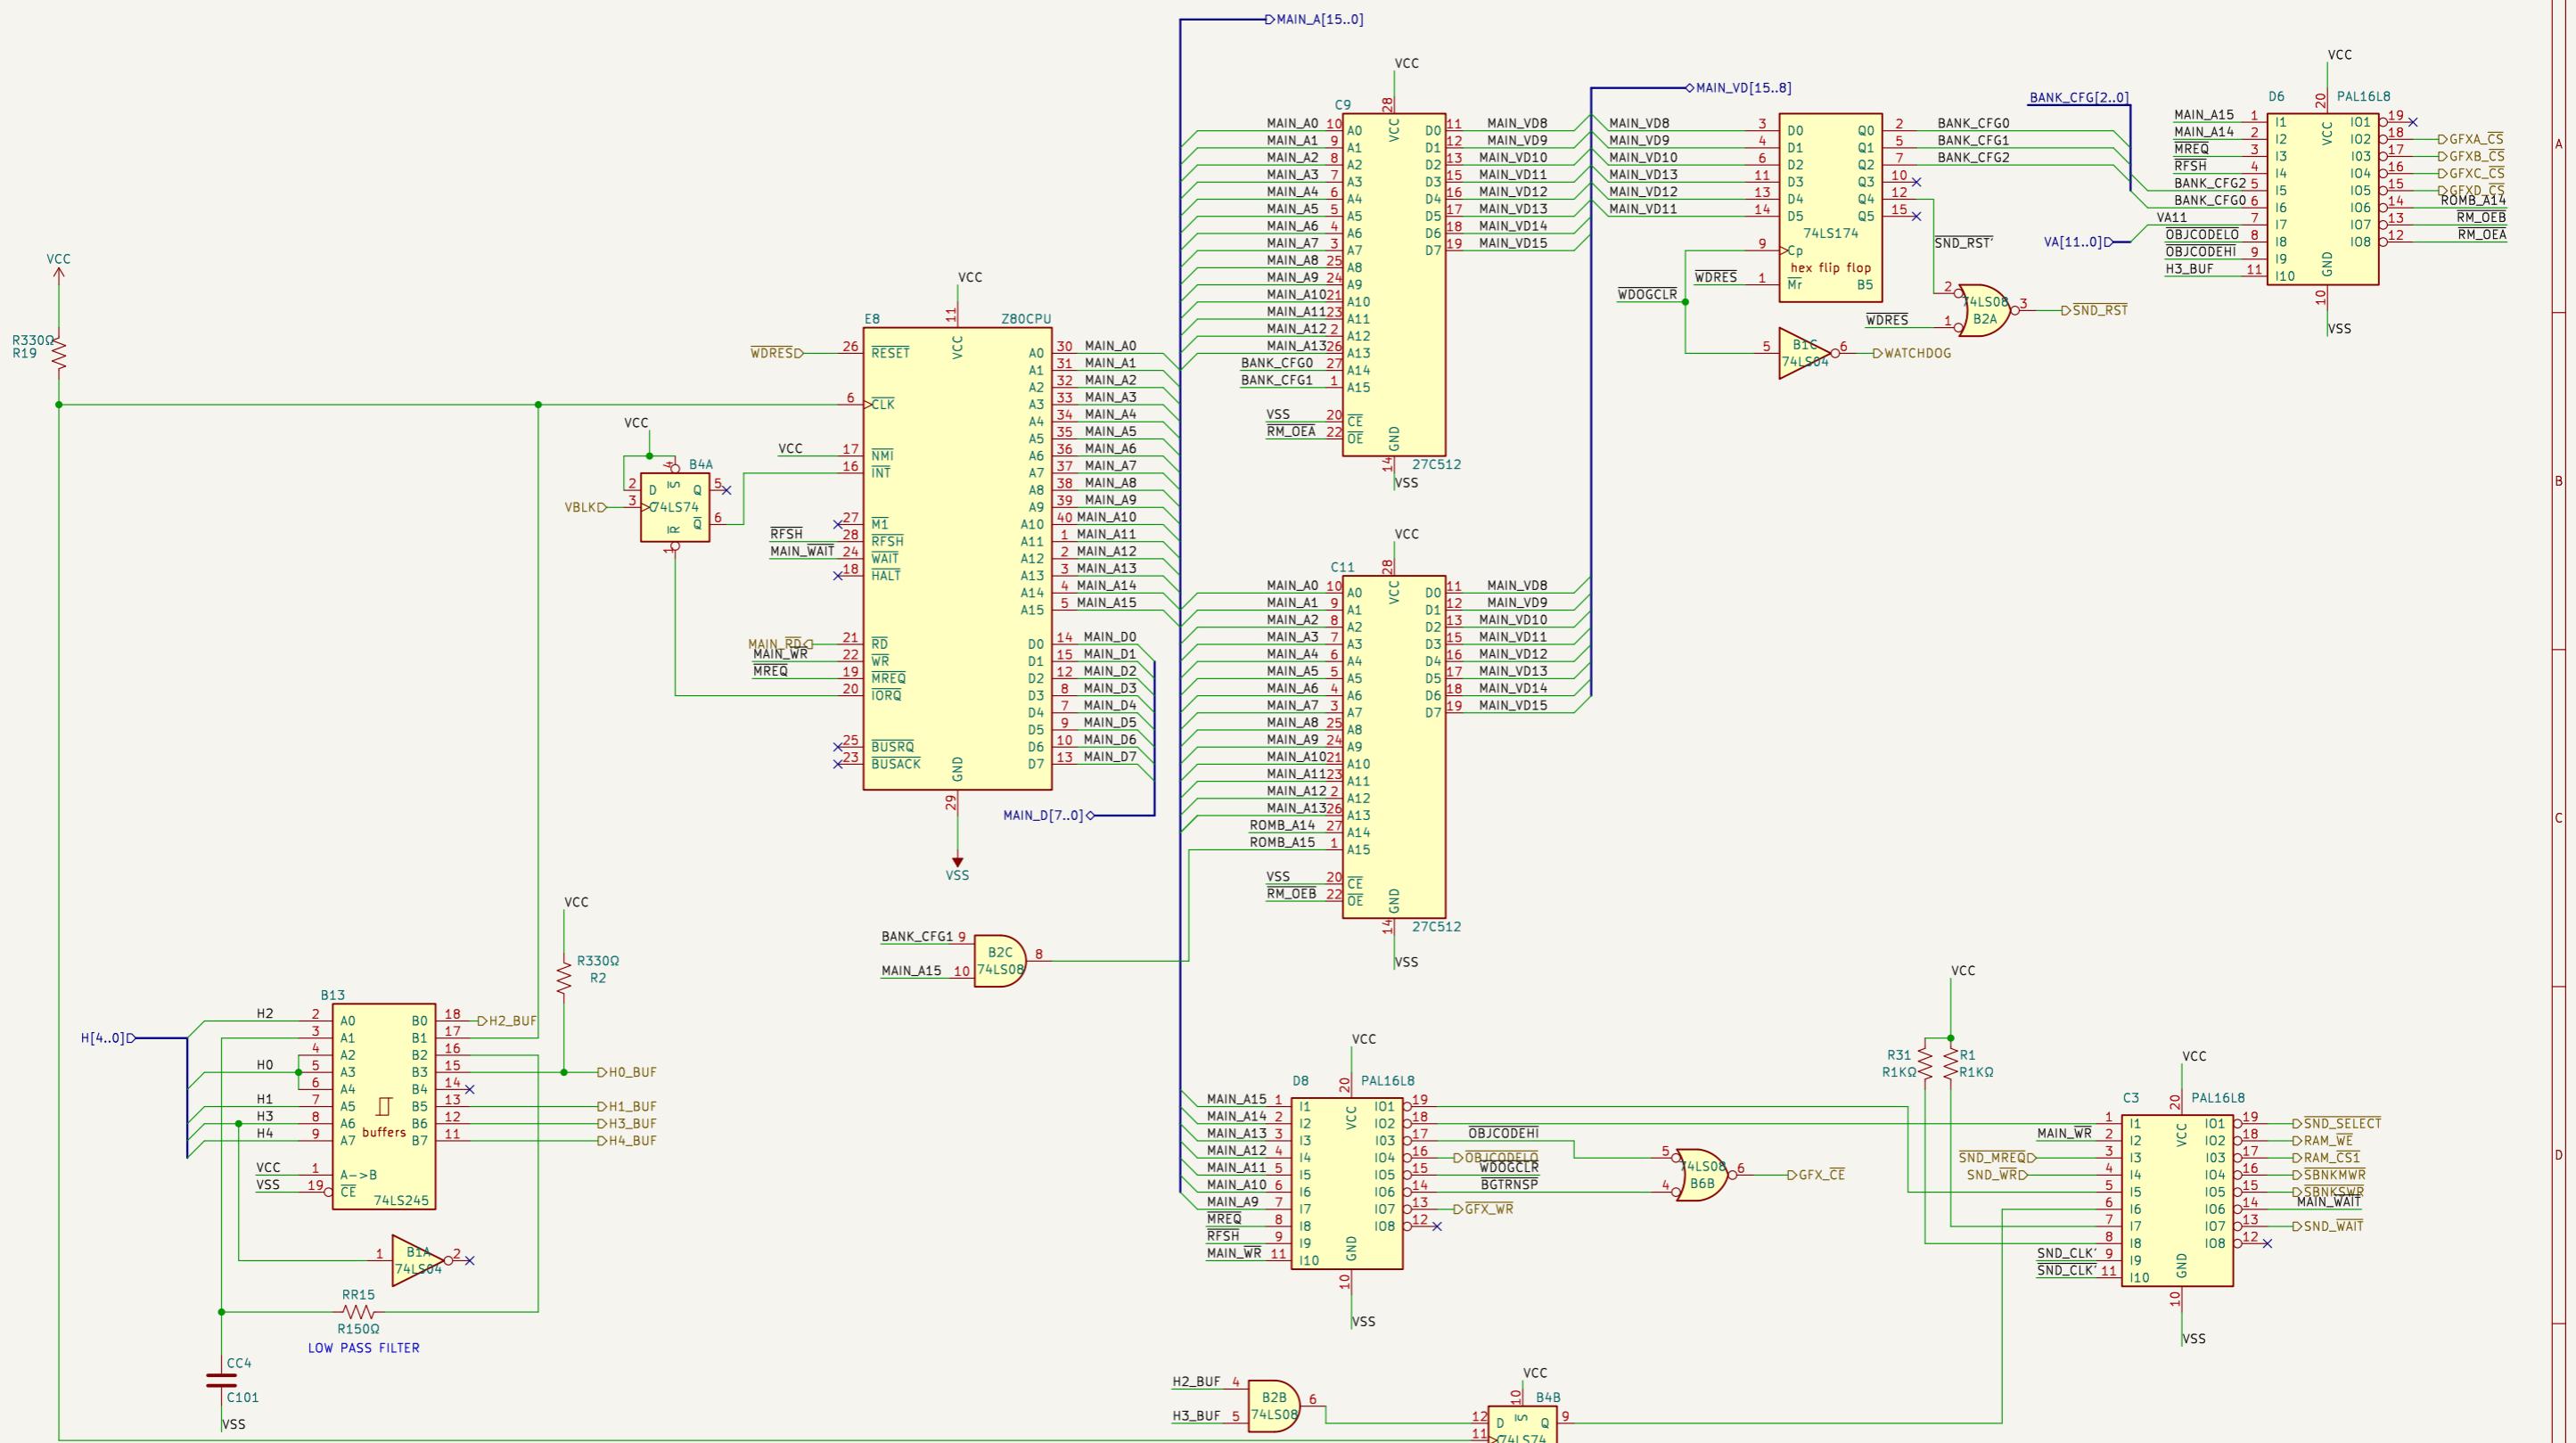

JOTEGO  
JOTEGO

Sheet: /main/  
File: main.kicad\_sch

Title: EXTERMINATION

Size: A3 Date: 29/08/2022  
KiCad E.D.A. kicad-cliv 7.0.10-7.0.10-ubuntu20.04.1



Rev: José Tejada G.  
Id: 3/10

A

A

B

B

C

C

D


D

E

E

F

F

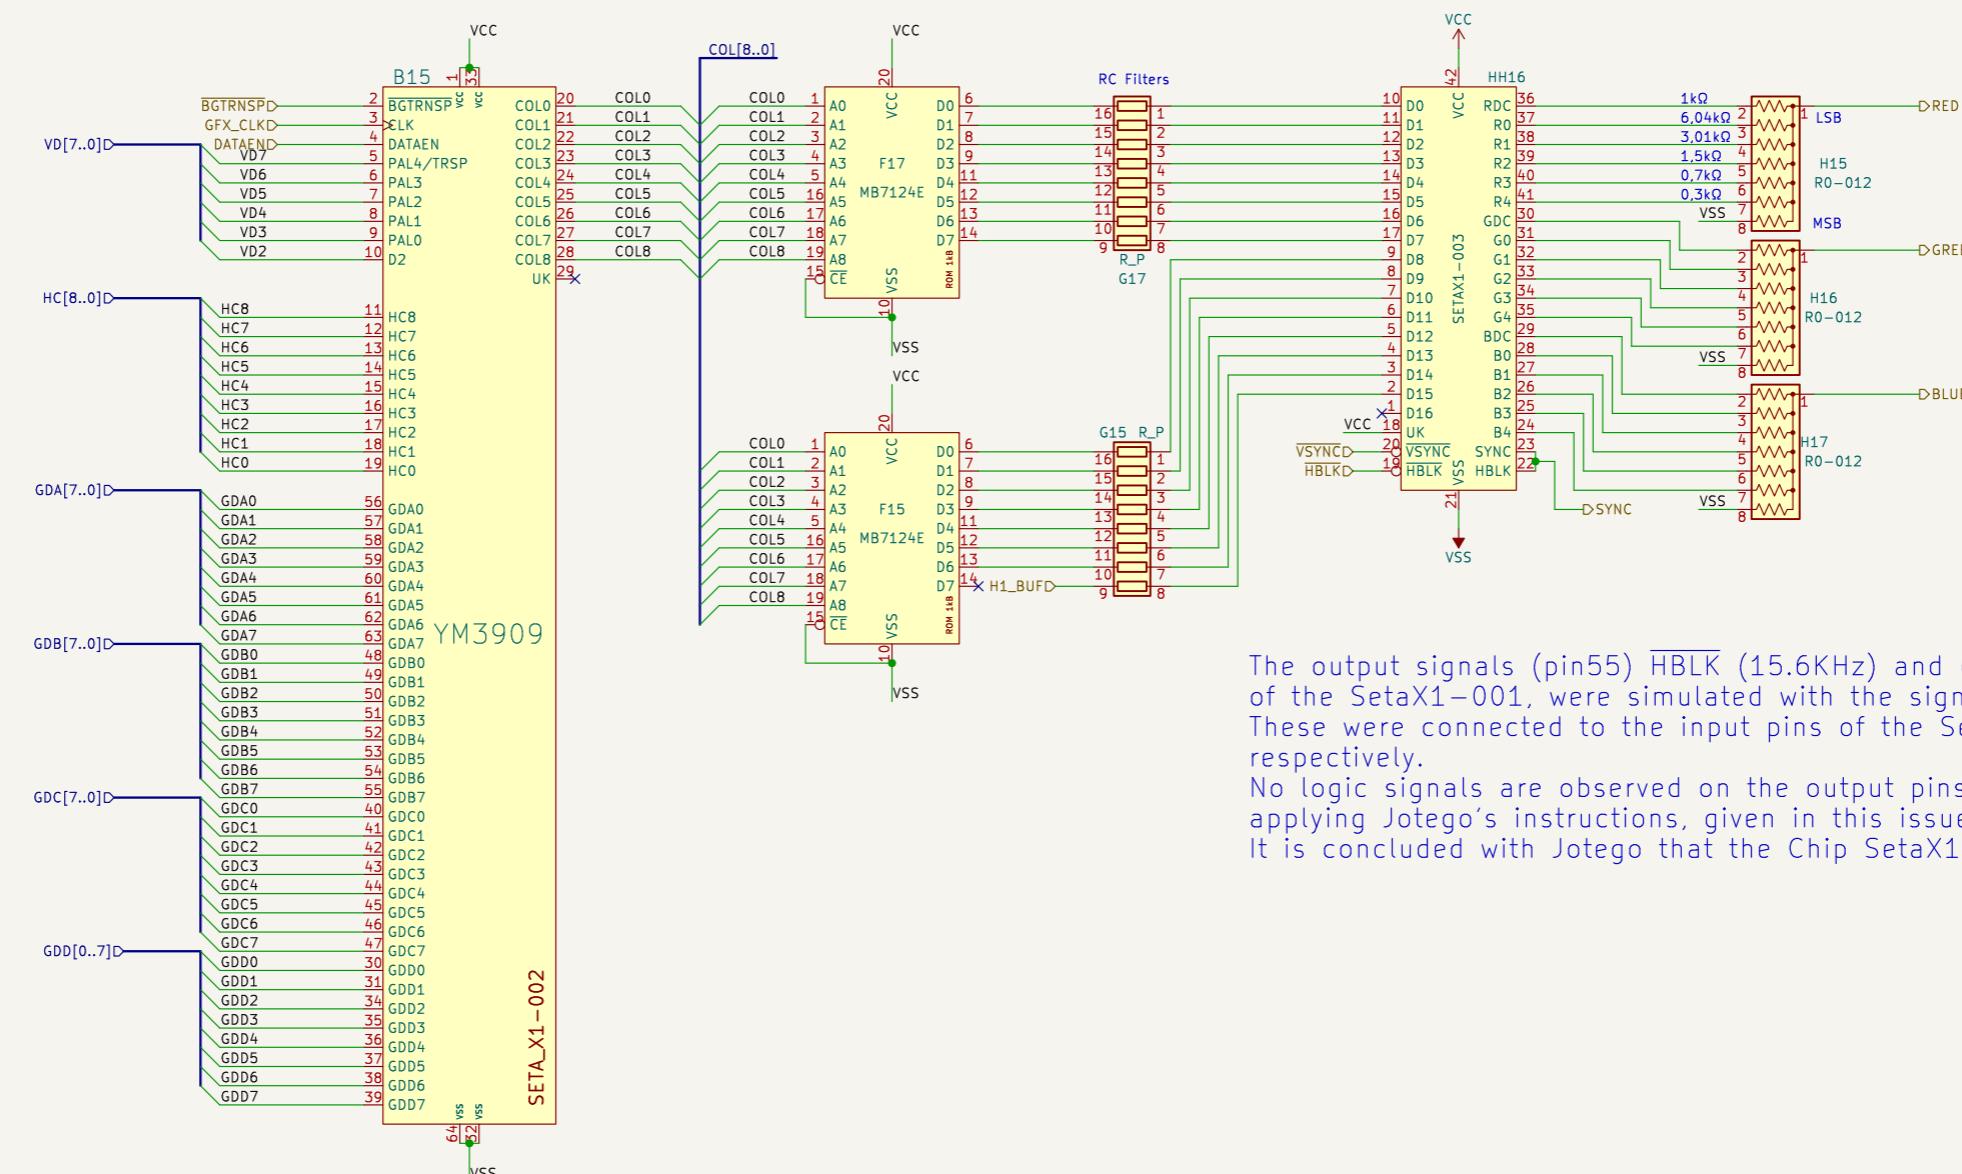

The output signals (pin55) HBLK (15.6KHz) and (pin56) VSYNC (59.2 Hz) of the SetaX1-001, were simulated with the signal generator and an inverter. These were connected to the input pins of the SetaX01-003 (pin 19 – 20), respectively.  
 No logic signals are observed on the output pins (22–23) HBLK – SYNC, applying Jotego's instructions, given in this issue.  
 It is concluded with Jotego that the Chip SetaX1-001 is broken.

JOTEGO  
JOTEGO




Sheet: /colmix/  
File: colmix.kicad\_sch

**Title: EXTERMINATION**

Size: A3 | Date: 29/08/2022  
KiCad E.D.A. kicad-cl 7.0.10-7.0.10-ubuntu20.04.1



Rev: José Tejada G.  
Id: 4/10

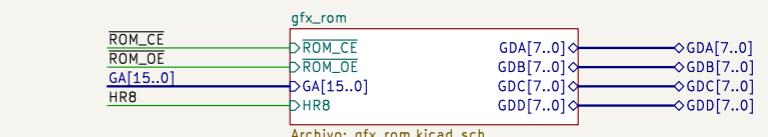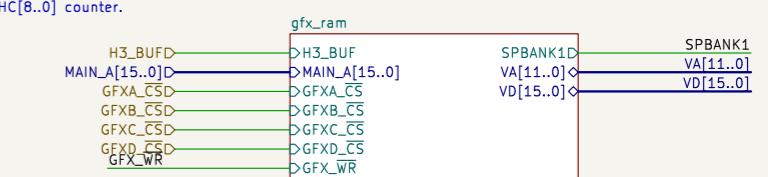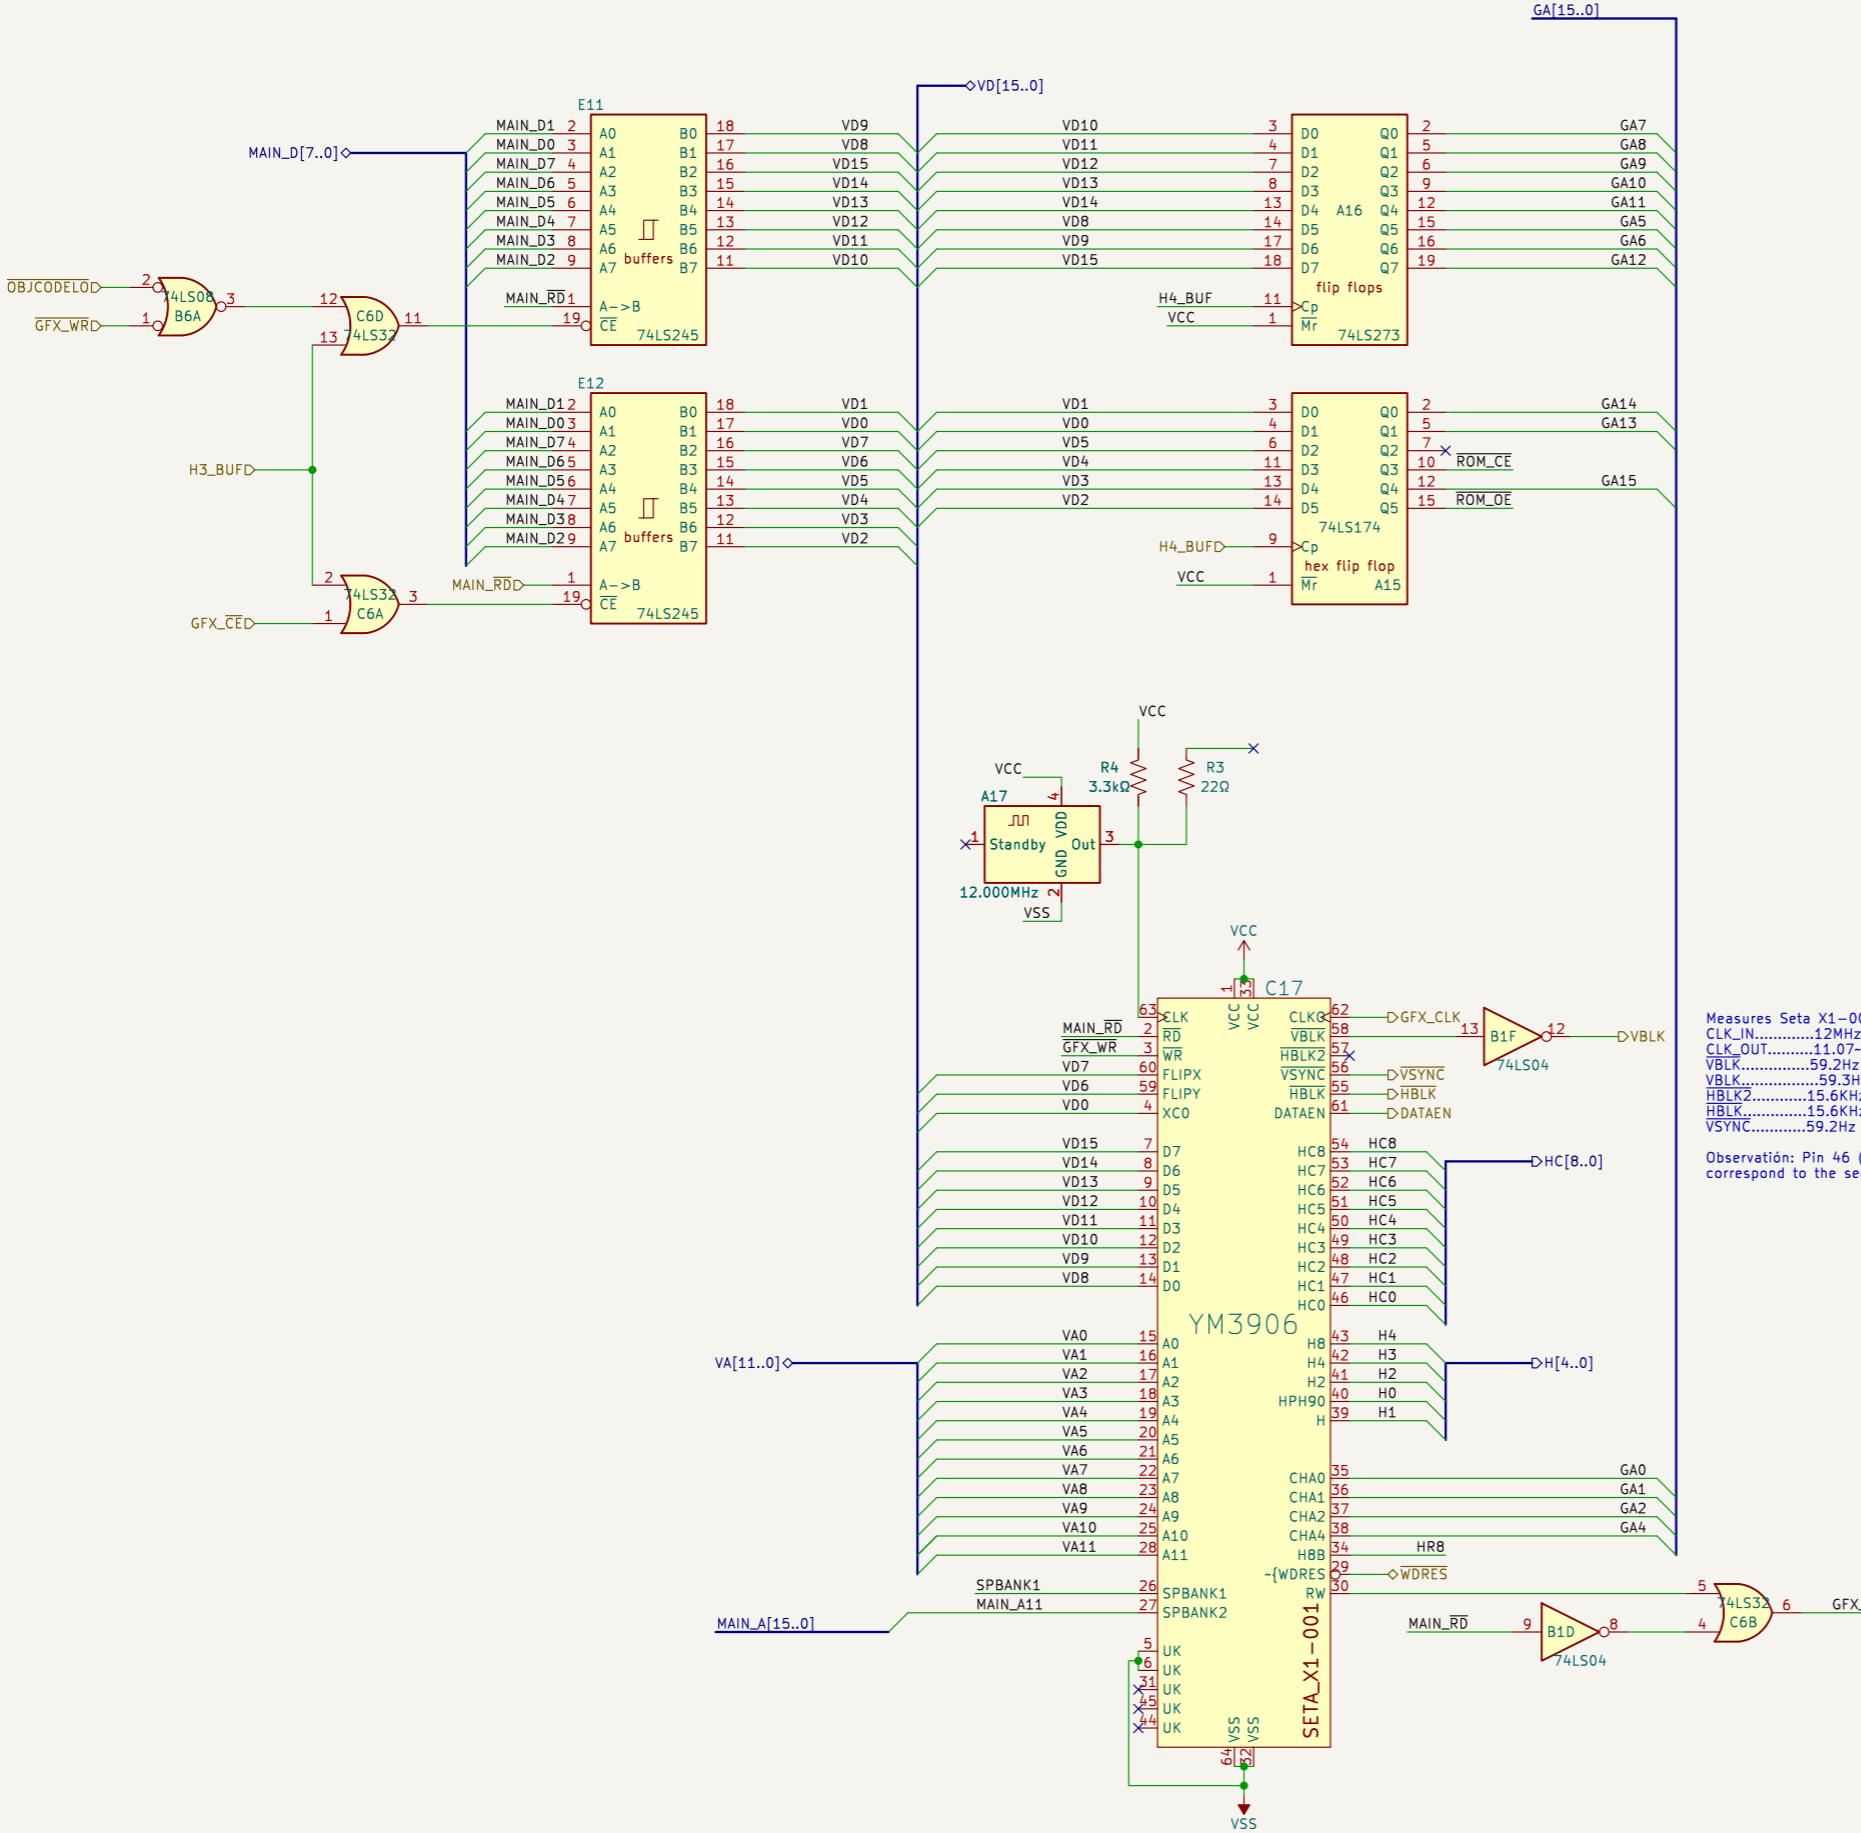

**JOTEGO**  
**JOTEGO**  
Sheet: /gfx/  
File: **gfx.kicad\_sch**  
**Title: EXTERMINATION**  
Size: A3 | Date: 29/08/2022  
KiCad E.D.A. kicad-cli 7.0.10-7.0.10-ubuntu20.04.1 | Rev: José Tejada G.  
Id: 5/10



1 2 3 4 5 6 7 8

A

A

B

B

C

C

D


D

E

E

F

F

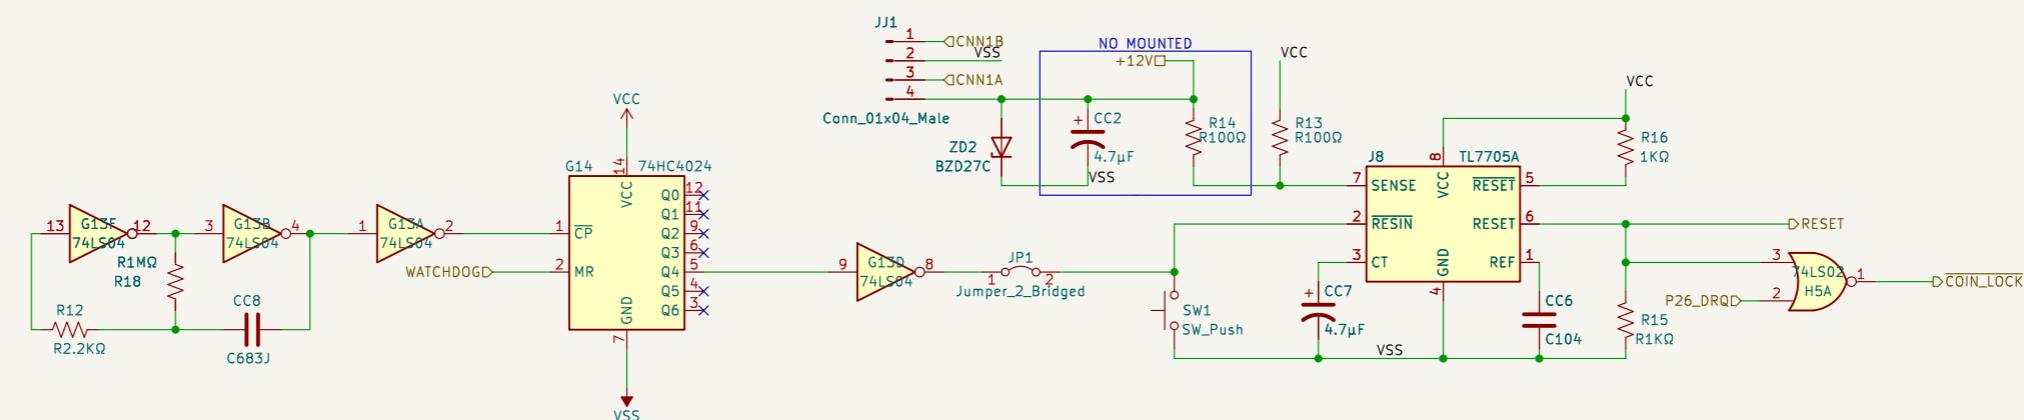

JOTEGO  
JOTEGO





Sheet: /watchdog/  
File: watchdog.kicad\_sch


Title: EXTERMINATION

Size: A3 Date: 29/08/2022  
KiCad E.D.A. kicad-cli 7.0.10-7.0.10-ubuntu20.04.1

Rev: José Tejada G.  
Id: 6/10

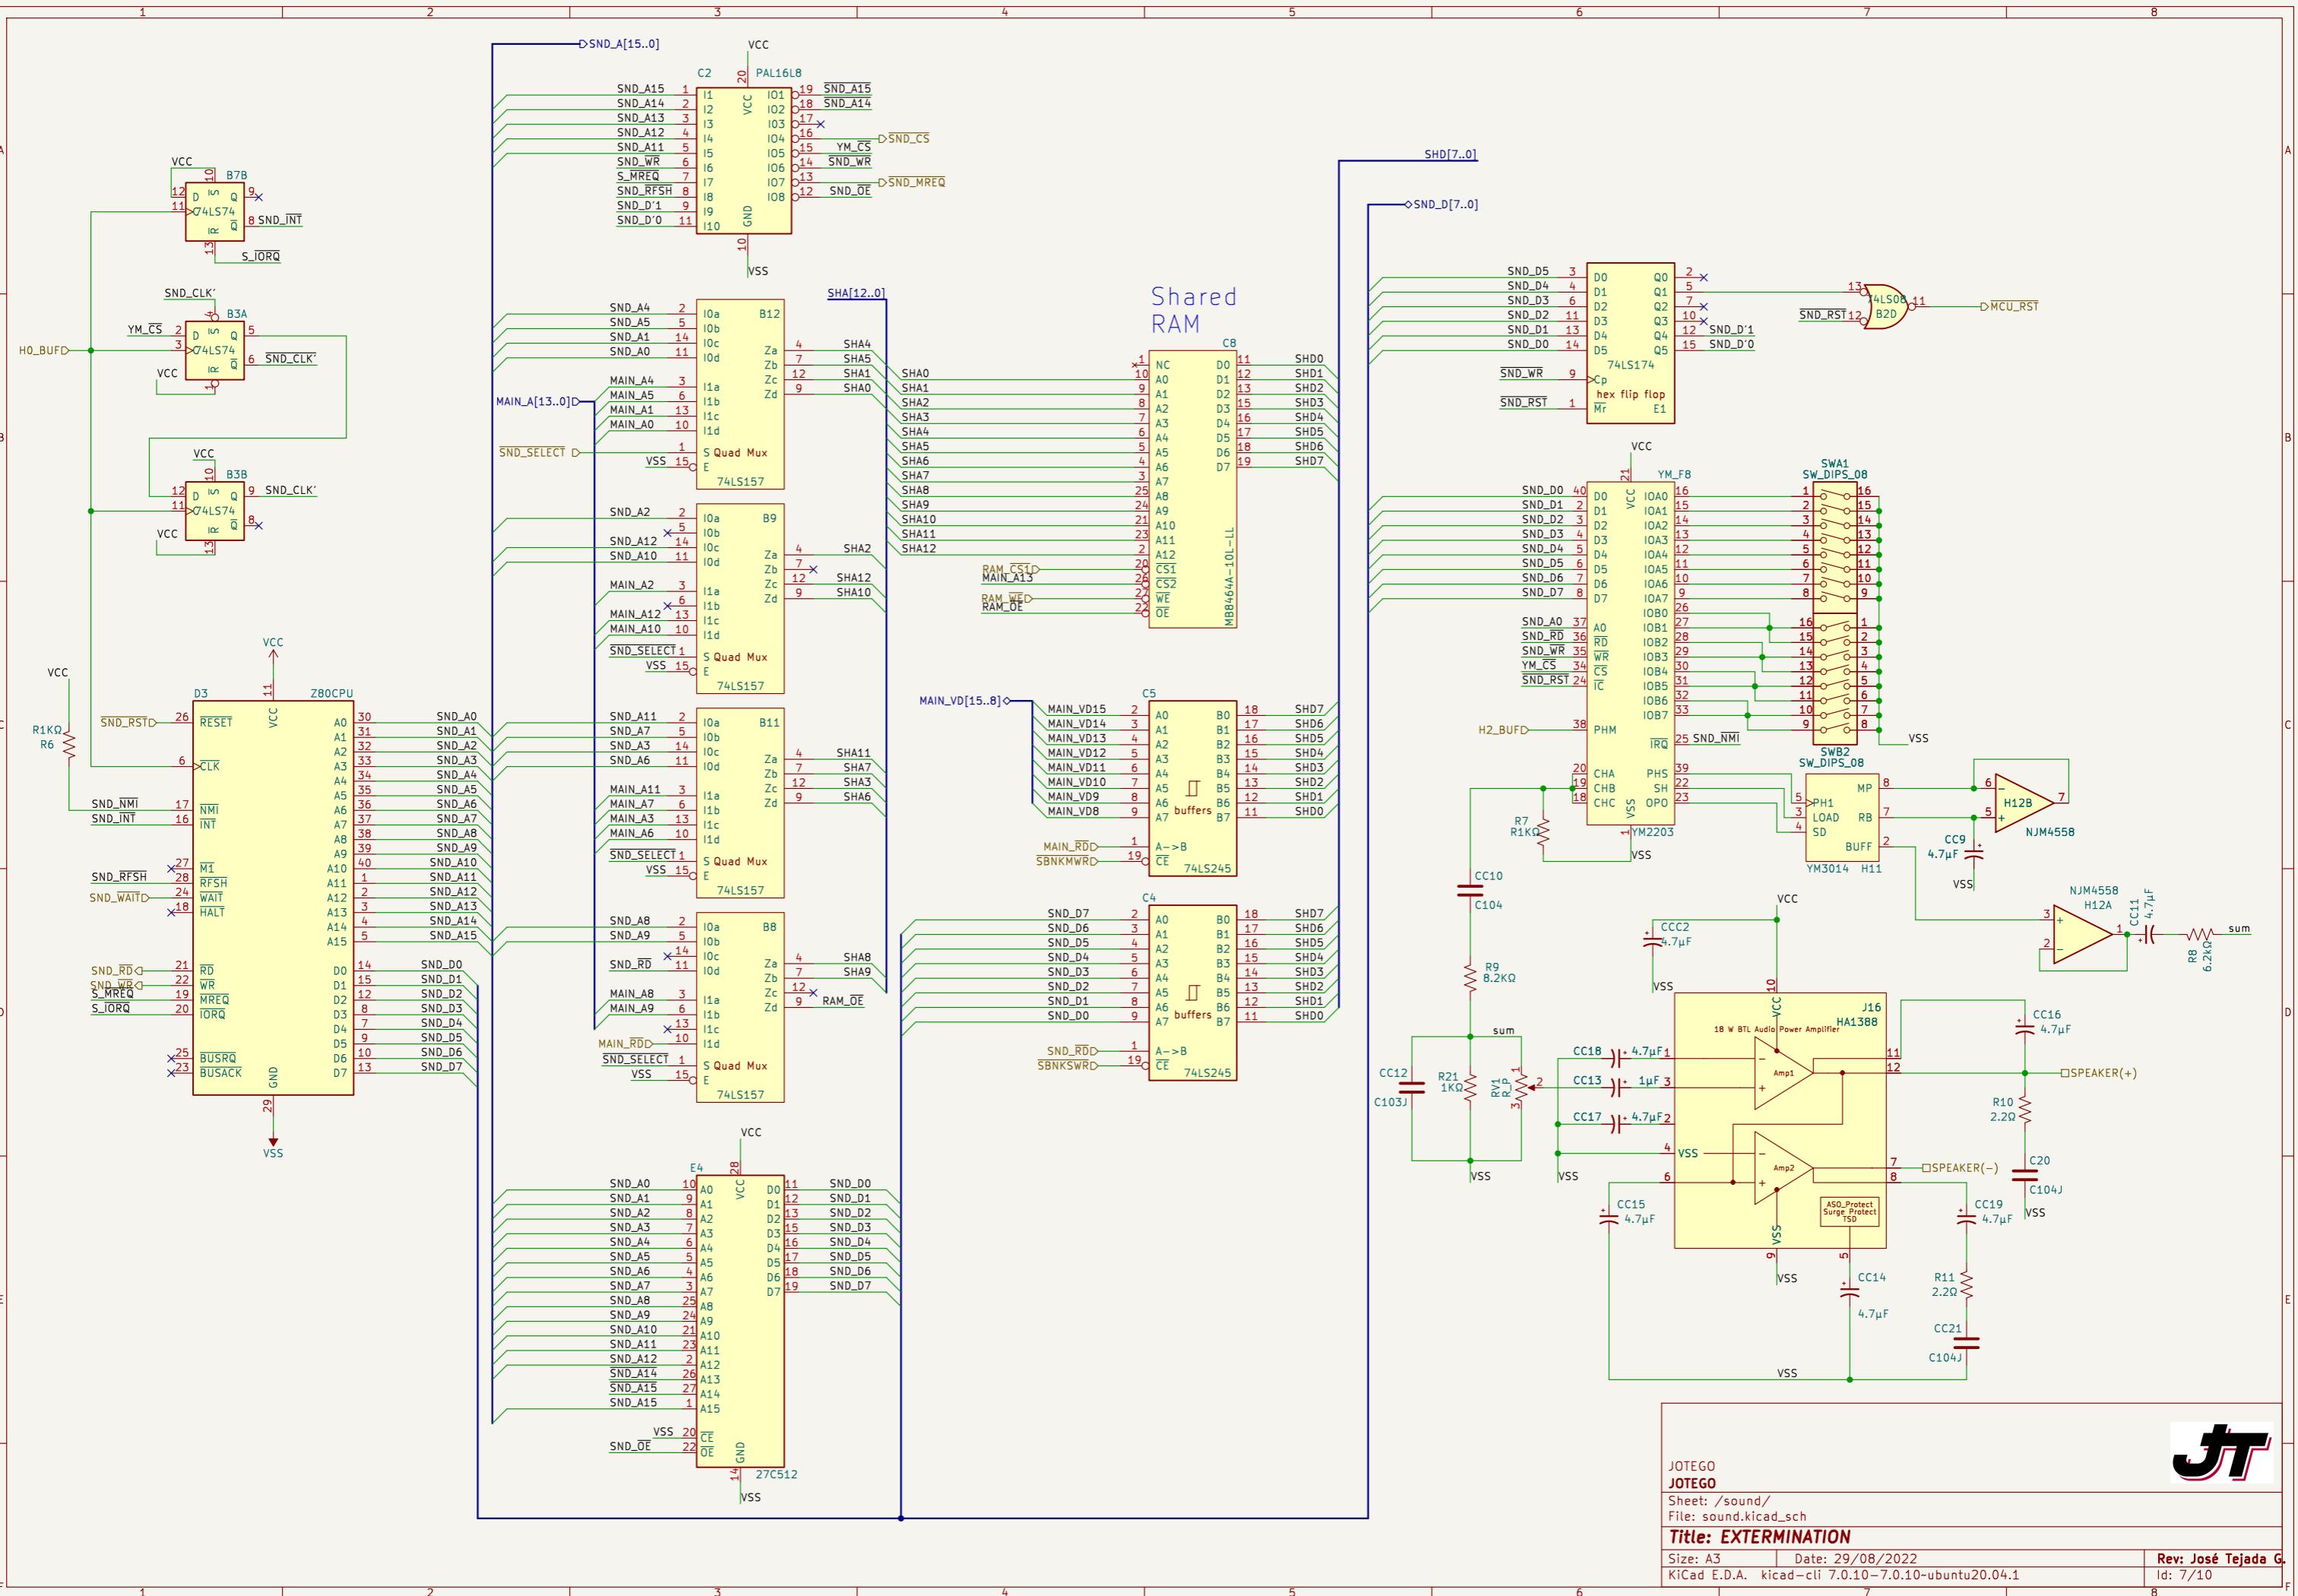

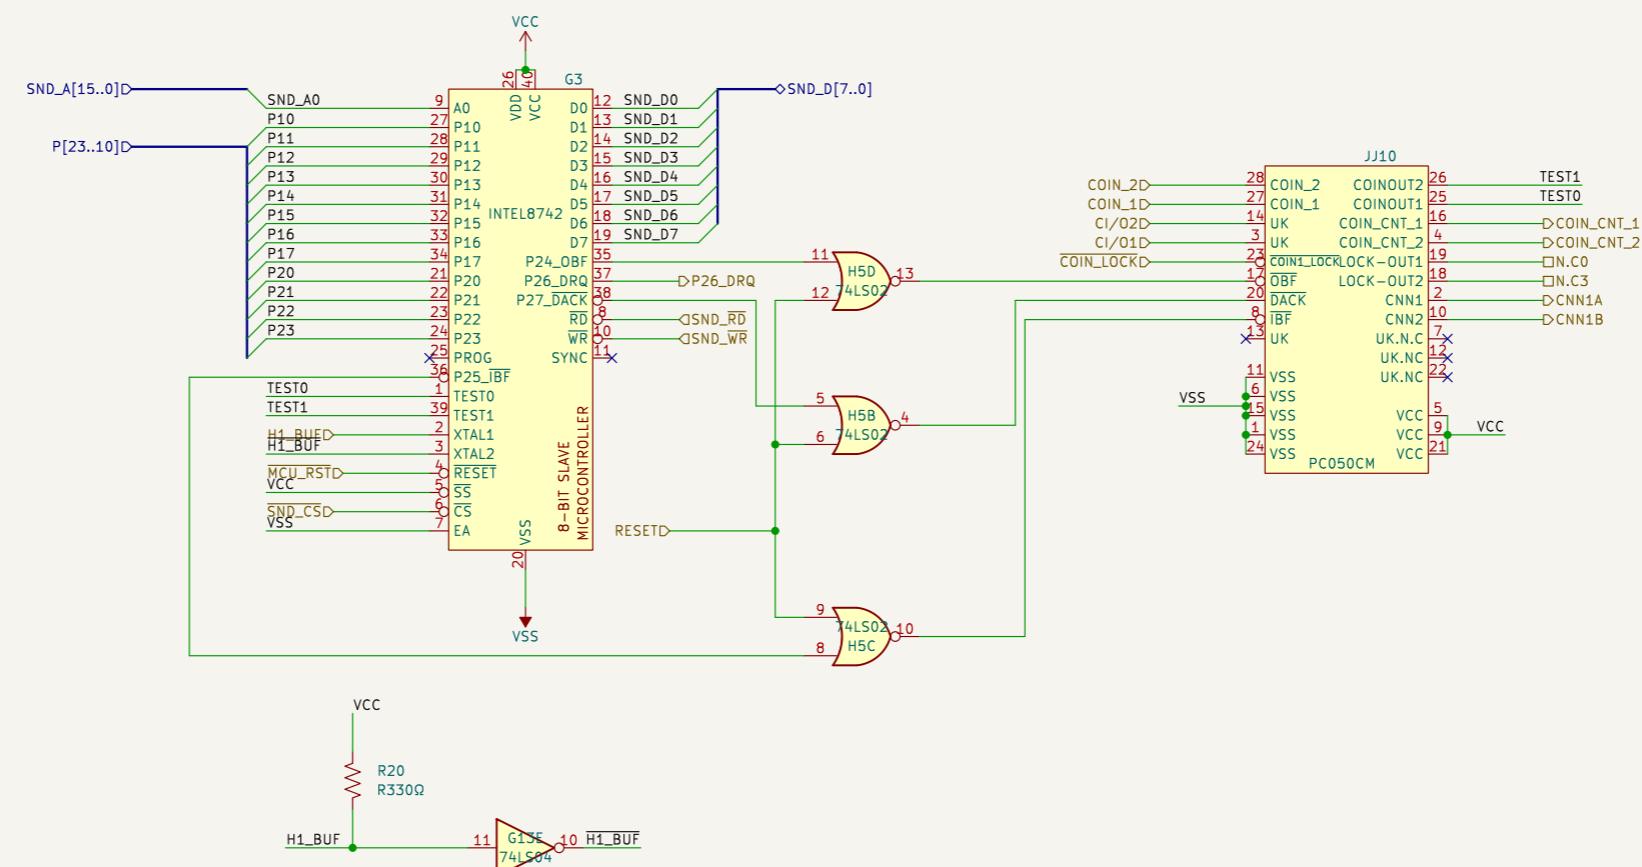

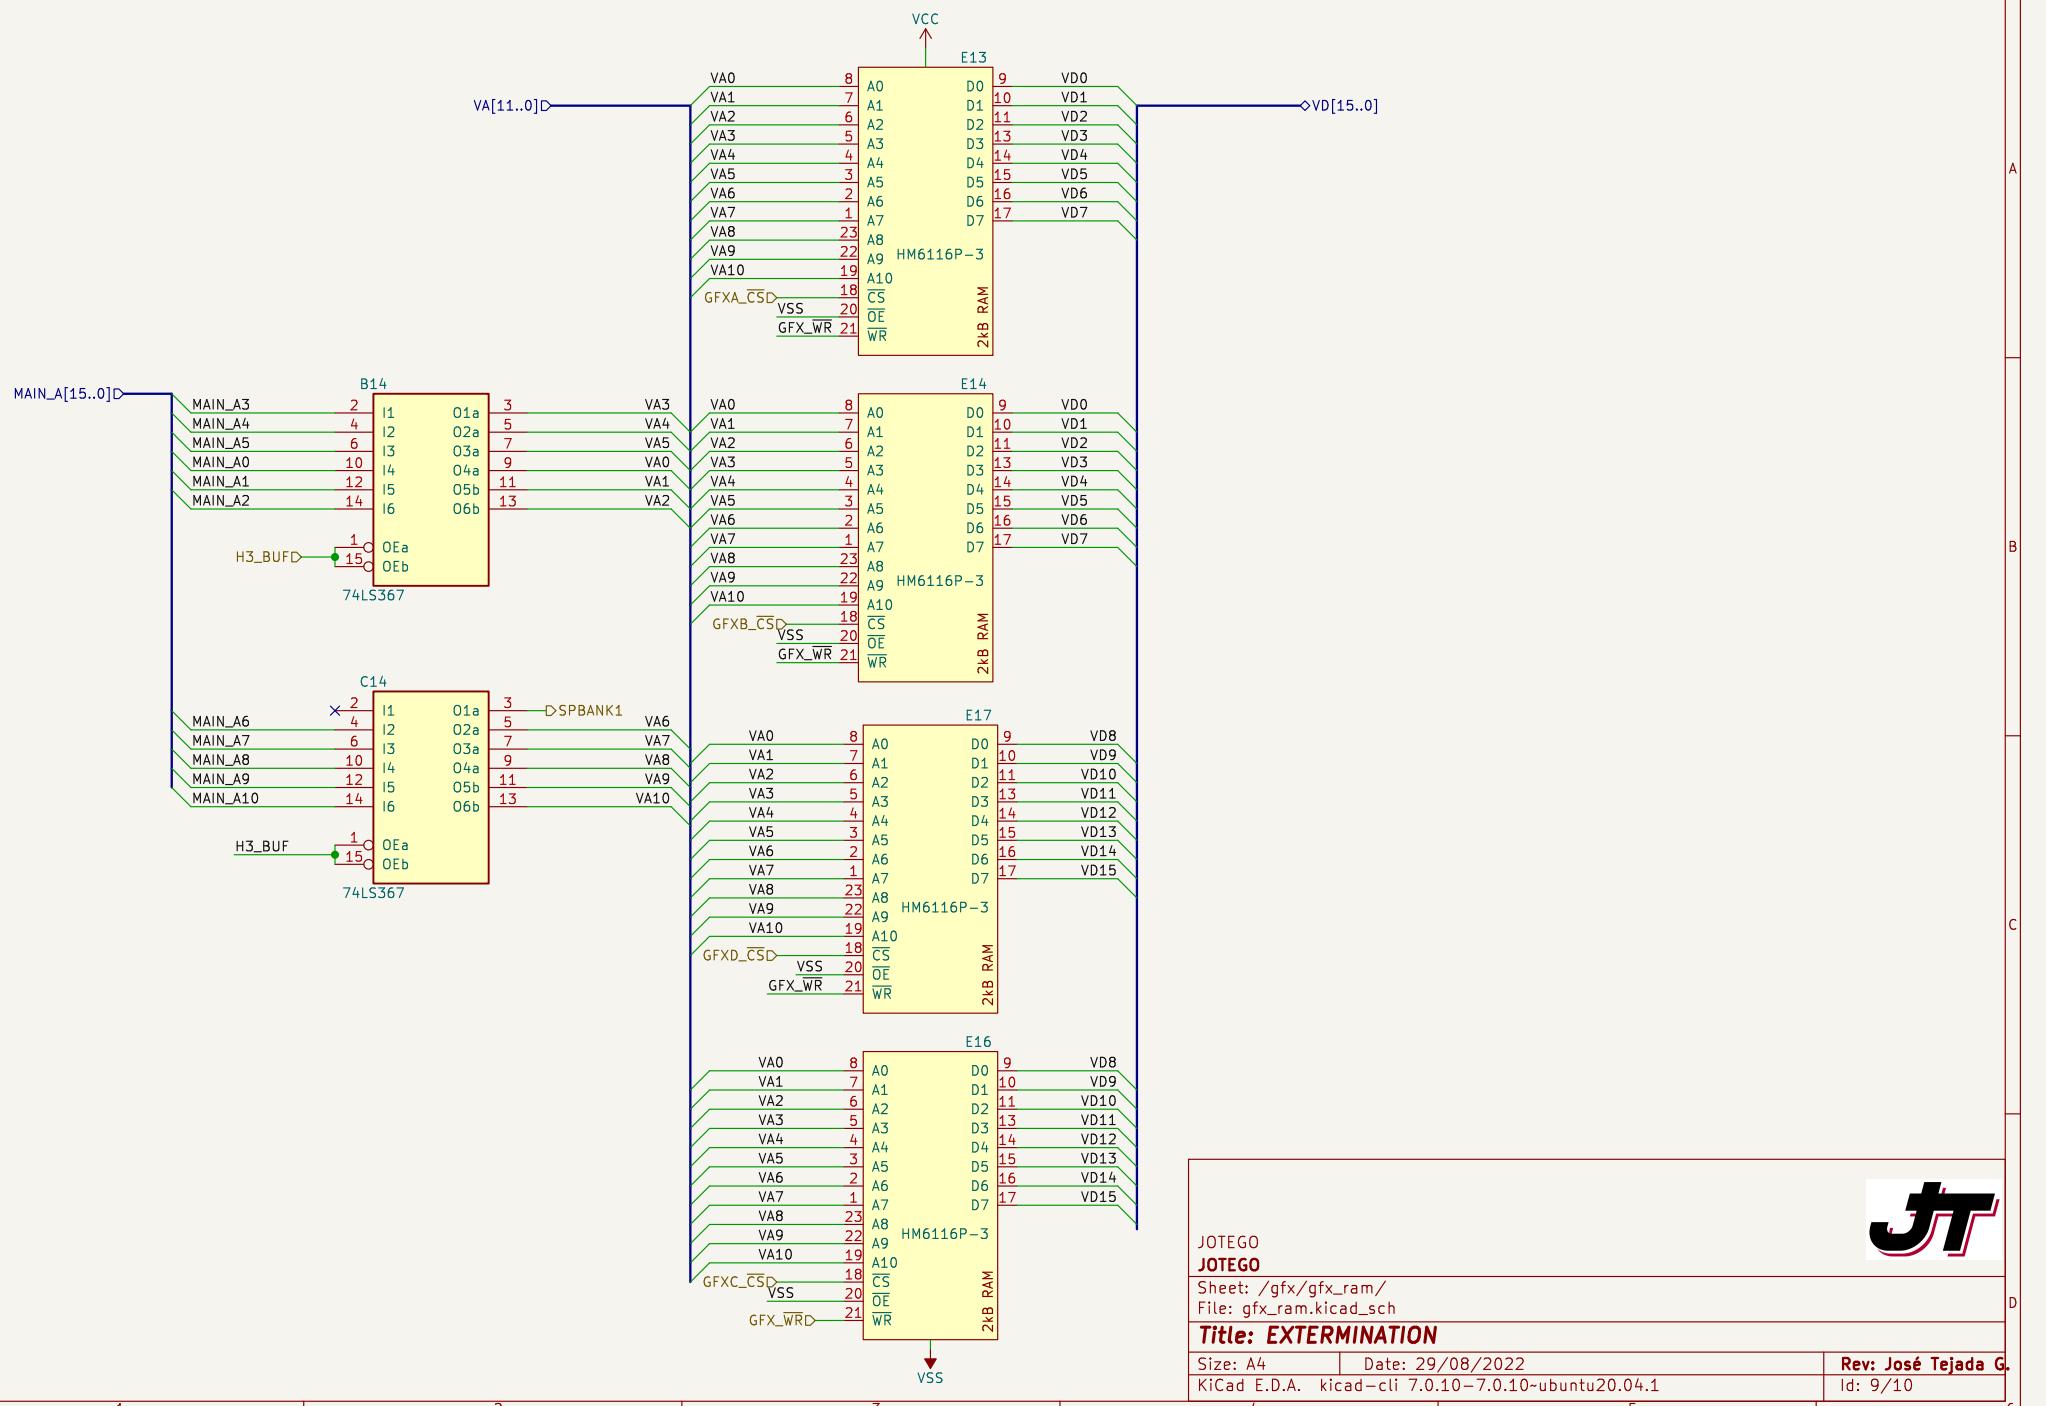

JOTEGO  
JOTEGO

Sheet: /gfx/gfx\_ram/  
File: gfx\_ram.kicad\_sch

**Title: EXTERMINATION**

Size: A4 Date: 29/08/2022

KiCad E.D.A. kicad-cli 7.0.10-7.0.10-ubuntu20.04.1



Rev: José Tejada G.

Id: 9/10

